

**Palm Beach County Fleet Management
Asset Maintenance History**

10185249 2011 CHEVROLET SILVERADO Pickup, 1/2 Ton, Ext Cab, 4X4

Workorder: 1104907 **Meter:** 326 **In Date:** 05/09/2011 **Closed:** 05/09/2011
Problem: 1 - Wash ticket(s) issued

- 1 - Wash ticket(s) issued

Hours 0.00 Labor: 0.00 Parts: 0.00 Total: 0.00
:

Workorder: 1104964 **Meter:** 326 **In Date:** 05/10/2011 **Closed:** 05/10/2011
Problem: Pre Delivery Inspection

- Pre Delivery Inspection
- Wash Vehicle

Hours 3.00 Labor: 180.00 Parts: 0.00 Total: 180.00
:

Workorder: 1112829 **Meter:** 4697 **In Date:** 12/05/2011 **Closed:** 12/27/2011
Problem: P.M. Service.

- Perform pm service.
- Diagnose horn inop.test and replace failed horn assembly with new.fabricate wiring and relocate horn to upper radiator support.
- Install new rear brake shoes and resurface rear brake drums.adjust parking brake cables automated bleed hydraulic system with scan tool.
- Rotate and balance all four tires.
- Inspect and service power winch.
- Shop Supplies

Parts List	Qty
Shop Supplies	1.00
Ph10060 Oil Filter Acd Pf48 Wix 57060	1.00
Rear Brake Shoes Set	1.00
10-9050 Oil Dexos1 5w30	6.00
Wd40 Spray Lube Stock# 405540002	1.00
Horn	1.00

Hours 10.00 Labor: 600.00 Parts: 357.92 Total: 957.92
:

Workorder: 1200030 **Meter:** 4697 **In Date:** 12/19/2011 **Closed:** 01/03/2012
Problem: damage to rear bumper, tail gate & rgt rear fender

- damage to rear bumper, tail gate & rgt rear fender

Hours 0.00 Labor: 0.00 Parts: 0.00 Total: 0.00
:

Workorder: 1206134 **Meter:** 9679 **In Date:** 06/29/2012 **Closed:** 07/20/2012
Problem: P.M. Service.

- Perform pm service.
- install new fire extinguisher and mounting bracket.
- Perform rear drum brake service and adjust brake shoes.
- Inspect and service power winch.remove winch to service rusted planetary gears due to water intrusion.replace two failed solenoid switches and test operation.
- Rotate and balance all four tires.
- Shop Supplies

Parts List	Qty
Shop Supplies	1.00
Ph10060 Oil Filter Acd Pf48 Wix 57060	1.00
6678 Air Filter Frm Ca8755a Wix 46678	1.00
10-9050 Oil Dexos1 5w30	6.00
5lb Firex Abc Stock# 340280001	1.00
Custom5lb Bracket Firex Stock #340060300	1.00
Wiper Blade	2.00
Wheel Weight Kit	1.00
Winch Solenoid	2.00

Hours 9.00 Labor: 540.00 Parts: 324.41 Total: 864.41
:

**Palm Beach County Fleet Management
Asset Maintenance History**

Workorder: 1210480 **Meter:** 12760 **In Date:** 10/31/2012 **Closed:** 11/20/2012

Problem: Noise from left front tire and service brake system lighton.

<ul style="list-style-type: none"> - Resurface front brake rotors,replace front pads.service and lube calipers.replace rear brake drums,and worn out brake shoes.replace leaking wheel cylinders,and broken left side parking brake cable. - Replace broken transmission fill tube. - Shop Supplies 	<p>Parts List</p> <ul style="list-style-type: none"> Disc Pad Reman Brake Shoes 1401 Brake Fluid Bra 05088 Brake Clean Drum Wheel Cyl Rear Parking Cable transmission tube tube seal Shop Supplies Freight Charge 	<p>Qty</p> <ul style="list-style-type: none"> 1.00 1.00 1.00 2.00 2.00 2.00 1.00 1.00 1.00 1.00 1.00 	
Hours 9.50 :	Labor: 570.00	Parts: 531.66	Total: 1,101.66

Workorder: 1300532 **Meter:** 14292 **In Date:** 01/15/2013 **Closed:** 01/29/2013

Problem: Pm service and replace broken passerger side mirror.

<ul style="list-style-type: none"> - Perform pm service. - Remove passenger door trim to acess and replace broken side view mirror assembly with new. - Install two new tires to the front wheels.nitrogen fill and balance all four. - Perform rear drum brake service and adjust brake shoes. - Inspect and service power winch. - Perform wheel alignment complete. - Shop Supplies 	<p>Parts List</p> <ul style="list-style-type: none"> Dexos 5w30 Filter Accufit Beam 18410 Pintle Pin Mirror 35x12.50r17 35x12.5r17 Nitto Grap Shop Supplies Tire Disposal Fee 	<p>Qty</p> <ul style="list-style-type: none"> 6.00 1.00 2.00 1.00 1.00 2.00 2.00 1.00 2.00 	
Hours 10.50 :	Labor: 630.00	Parts: 2,082.60	Total: 2,712.60

Workorder: 1301367 **Meter:** 14292 **In Date:** 01/28/2013 **Closed:** 02/07/2013

Problem: damage to rgt side of bed

<ul style="list-style-type: none"> - damage to rgt side of bed 	<p>Parts List</p> <ul style="list-style-type: none"> 	<p>Qty</p> <ul style="list-style-type: none"> 	
Hours 0.00 :	Labor: 0.00	Parts: 0.00	Total: 0.00

**Palm Beach County Fleet Management
Asset Maintenance History**

Workorder: 1309714 **Meter:** 19303 **In Date:** 09/25/2013 **Closed:** 10/22/2013
Problem: Pm service

- P.m. Service.	Parts List	Qty
- Resurface rear brake drums,replace worn out shoes and leaking wheel cylinders.clean mud and debris from backing plates.flush and bleed system.	Napa Quart 5w30	6.00
- Inspect and service winch.	Napagold Oil Filter	1.00
- Rotate and balance all tires.	Accufit Beam	2.00
- Replace front asset #.	Washer FI	1.00
- Shop Supplies	Floor Mat-2pc Rub Bk	1.00
	Brake Cleaner	1.00
	2232 Brake Fluid Quar	1.00
	Brake Shoe	1.00
	Wheel Cyl	2.00
	Used Fire X Refurbished	1.00
	Shop Supplies	1.00
Hours 9.75	Labor: 585.00	Parts: 291.83
:		Total: 876.83

Workorder: 1404512 **Meter:** 24041 **In Date:** 05/08/2014 **Closed:** 05/21/2014
Problem: Pm service.

- Perform pm service.	Parts List	Qty
- Install new front brake pads and resurface rotors.service all calipers and install new front caliper brackets.flush brake fluid and automated bleed hydraulic system with scan tool and road test.	Bracket K	1.00
- Install two new tires to the front wheels.nitrogen fill and balance all four.	Bracket K	1.00
- Inspect and service power winch.	Dexos 5w30 Oil	6.00
- Shop Supplies	Napagold Oil Filter	1.00
	Napagold Air Filter	1.00
	Washer FI	1.00
	Accufit Beam	2.00
	pad kit	1.00
	35x12.5r17 Nitto Grap	2.00
	Shop Supplies	1.00
	Tire Disposal Fee	2.00
Hours 11.75	Labor: 705.00	Parts: 1,521.95
:		Total: 2,226.95

Workorder: 1409080 **Meter:** 26809 **In Date:** 09/09/2014 **Closed:** 09/15/2014
Problem: Grinding and squealing noise at slow speeds.

- Road test and inspect for grinding noise at slow speeds.replace noisy right front wheel bearing assembly.	Parts List	Qty
- Shop Supplies	hub bearingassy	1.00
	Shop Supplies	1.00
Hours 1.50	Labor: 90.00	Parts: 397.64
:		Total: 487.64

**Palm Beach County Fleet Management
Asset Maintenance History**

Workorder: 1411149 **Meter:** 27454 **In Date:** 11/06/2014 **Closed:** 11/26/2014
Problem: Pm service.Check over brakes and pedal effort.ABS and stability track warning lights on dash.

	Parts List	Qty
- Pm service.		
- Check battery and charging system.battery failed loadtest after recharge.replace defective battery.	Dexos 5w30 Oil	6.00
	Napagold Oil Filter	1.00
- Computer diagnose for Abs light on.c0050 Pinpiont test and replace defective right rear wheel speed sensor.replace rear brake shoes,both wheel cylinders and brake drums.bleed brake system.	Accufit Beam	2.00
	Used Fire X Refurbished	1.00
	Battery	1.00
- Inspect and service winch.	Reman Brake Shoes	1.00
- Rotate and balance all four tires.	Brake Drum	2.00
- Shop Supplies	1401 Brake Fluid Bra	1.00
	Drum Brake Whl Cylind	2.00
	Sensor	1.00
	Shop Supplies	1.00
Hours 12.75	Labor: 765.00	Parts: 433.30
:		Total: 1,198.30

Workorder: 1502037 **Meter:** 28942 **In Date:** 02/25/2015 **Closed:** 03/18/2015
Problem: Noise and vibration while driving.

	Parts List	Qty
- Diagnose for vibration and noise.replace defective rear drive shaft(broken apart inside and rattling).	Hub Bearing Assembly	1.00
- Diagnose for growling noise when driving and replace defective right front hub/ bearing assembly.roadtest.	Drive Shaft	1.00
- Shop Supplies	Shop Supplies	1.00
Hours 2.50	Labor: 150.00	Parts: 792.67
:		Total: 942.67

Workorder: 1505017 **Meter:** 30366 **In Date:** 05/18/2015 **Closed:** 05/29/2015
Problem: Pm service.Stability control light on.Vibration.

	Parts List	Qty
- Pm service.		
- Diagnose for growling noise while driving.inspect and replace defective left front wheel bearing assembly.	Dexos 5w30 Oil	6.00
	Napagold Oil Filter	1.00
- Diagnose for horns inop.test and replace both defective high and low horns .	Napagold Air Filter	1.00
	Accufit Beam	2.00
- Perform front differential service due to water contamination.	Macs Chain Cable Lube	1.00
- Inspect and service power winch.	Napa Gear 80w-90 Qt	2.00
- Inspect and service rear drum brakes.	hub bearingassy	1.00
- Rotate and balance all four tires.	High Note Horn Kit	1.00
- Shop Supplies	Horn Assy	1.00
	Shop Supplies	1.00
Hours 9.75	Labor: 585.00	Parts: 614.65
:		Total: 1,199.65

**Palm Beach County Fleet Management
Asset Maintenance History**

Workorder: 1512733 **Meter:** 33434 **In Date:** 12/17/2015 **Closed:** 01/05/2016
Problem: Pm service.

- Pm service.	Parts List	Qty
- Replace two tires.rotate and balance all four.	Dexos 5w30	6.00
- Inspect electrical circuit to horn inop.replace burnt out horn.relocate horn from water intrusion.	Napagold Oil Filter	1.00
- Inspect and service rear brakes.	Accufit Beam	2.00
- Perform complete front wheel alignment.	Washer Fluid Concentr	1.00
- Inspect and service winch.	Used Fire X Refurbished	1.00
- Shop Supplies	35x12.5r17 Nitto Grap	2.00
	Horn	1.00
	Shop Supplies	1.00
	Tire Disposal Fee	2.00
Hours 10.25	Labor: 615.00	Parts: 1,002.65
:		Total: 1,617.65

Workorder: 1602431 **Meter:** 34549 **In Date:** 03/07/2016 **Closed:** 03/14/2016
Problem: Nail in right rear tire.

- Repair and blance right rear tire.	Parts List	Qty
- Shop Supplies	Shop Supplies	1.00
Hours 1.00	Labor: 60.00	Parts: 2.00
:		Total: 62.00

Workorder: 1604946 **Meter:** 35798 **In Date:** 05/12/2016 **Closed:** 05/24/2016
Problem: ABS light on and noise from right front.

- P.m. Service.	Parts List	Qty
- Diagnose Abs light.replace right front speed sensor/hub assemble.remove axle shaft and replace output shaft seal.clean grass and debri twisted around shaft.	Rear Adjuster Brake	2.00
- Replace front rotors,calipers and brake pads.replace frear drums,shoes wheel cylinder and hardware.flush and bleed system.test drive.	Napagold Oil Filter	1.00
- Rotate and balance tires	Dexos 5w30	6.00
- Inspect and service winch.	Napagold Air Filter	1.00
- Complete wheel alignment.test drive.	Accufit Beam	2.00
- Shop Supplies	Washer Fluid Concentr	1.00
	hub bearingassy	1.00
	Brake Rotor	2.00
	Disc Pad	1.00
	Front Caliper	1.00
	Front Caliper	1.00
	Reman Brake Shoes	1.00
	Brake Drum	2.00
	Drum Brake Whl Cylind	2.00
	Drum Brake Maxi-pack	1.00
	Seal	1.00
	Reman Cv Drive Axle	1.00
	Brake Cleaner	2.00
	B Fluid Dot 3-32oz	1.00
	Gasket	1.00
	Oil Axle Shaft	3.00
	Shop Supplies	1.00
Hours 21.25	Labor: 1,275.0	Parts: 1,275.70
:	0	Total: 2,550.70

**Palm Beach County Fleet Management
Asset Maintenance History**

Workorder: 1607667 **Meter:** 37403 **In Date:** 07/27/2016 **Closed:** 07/29/2016
Problem: Left front outside mirror broke off.

	Parts List	Qty
- Remove left door panel and replace broken mirror assemble.	Mirror Assy	1.00
- Shop Supplies	Shop Supplies	1.00
Hours 1.00	Labor: 60.00	Parts: 112.21
:		Total: 172.21

Workorder: 1613022 **Meter:** 39839 **In Date:** 12/22/2016 **Closed:** 01/03/2017
Problem: P.M. service.

	Parts List	Qty
- P.m. Service.	Napagold Oil Filter	1.00
- Replace two tires,rotate and balance all four.	Napa Syn 5w30 Qt	6.00
- Replace rear brake drums shoes and wheel cylinders.clean mud and sand from parts.flush and bleed system.	Accufit Beam	2.00
- Pressure test and inspect cooling system.flush and refill system.	Used Fire X Refurbished	1.00
- Inspect and service winch.	Napagold Air Filter	1.00
- Shop Supplies	35x12.5r17 Nitto Grap	2.00
	B Fluid Dot 3-32oz	1.00
	Non-chlor Brake Clnr	1.00
	Peak Global Antifrz	2.00
	Shoe Kit	1.00
	Wheel Cyl	2.00
	Spring Kit Brake Shoe	2.00
	Rear Adjuster Brake	2.00
	Drum	2.00
	Brake Rotor	2.00
	Shop Supplies	1.00
	Tire Disposal Fee	2.00
Hours 11.75	Labor: 705.00	Parts: 1,996.50
:		Total: 2,701.50

Workorder: 1707748 **Meter:** 44024 **In Date:** 08/08/2017 **Closed:** 08/16/2017
Problem: P.M. service.

	Parts List	Qty
- P.m. service.	Napa Syn 5w30 Qt	6.00
- Check battery and charging system.fully charge and recheck battery.failed load test .replace defective battery.	Napagold Oil Filter	1.00
- Check and replace both upper control arms due to defective ball joints.	Used Fire X Refurbished	1.00
- Complete front end alignment.road test.	Accufit Beam	2.00
- Balance and rotate all four tires.	Control Arm And Ball	1.00
- Shop Supplies	Control Arm And Ball	1.00
	Battery	1.00
	Shop Supplies	1.00
Hours 10.25	Labor: 615.00	Parts: 416.93
:		Total: 1,031.93

**Palm Beach County Fleet Management
Asset Maintenance History**

Workorder: 1801684 **Meter:** 46311 **In Date:** 02/13/2018 **Closed:** 03/06/2018
Problem: P.M. service and vibration turning steering wheel.

<ul style="list-style-type: none"> - P.m. service. - Rear brake shoes worn.removed and replaced brake shoes, drums and wheel cylinders .adjust brakes and flush and bleed brake system.test drive. - Diagnose vibration insteering .r&r faulty power steering pump .bleed system and retest. - Remove and replace worn out upper and lower control arms on both sides in front. - Rotated and balanced all four tires .had to clean excessive mud from rims before balancing .nitrogen filled tires. - Inspect and service front differential due to contaminated gear oil. - Perform full front end alignment. - Inspected and serviced winch. - Shop Supplies 	<table border="0"> <thead> <tr> <th align="left">Parts List</th> <th align="right">Qty</th> </tr> </thead> <tbody> <tr><td>5w-30 Full Syn Wolf's Head</td><td align="right">6.00</td></tr> <tr><td>Napagold Oil Filter</td><td align="right">1.00</td></tr> <tr><td>Napagold Air Filter</td><td align="right">1.00</td></tr> <tr><td>Accufit Beam</td><td align="right">2.00</td></tr> <tr><td>Used Fire X Refurbished</td><td align="right">1.00</td></tr> <tr><td>Shoe Kit</td><td align="right">1.00</td></tr> <tr><td>Brake Drum Hdwr Kit</td><td align="right">1.00</td></tr> <tr><td>Non-chlor Brake Clnr</td><td align="right">4.00</td></tr> <tr><td>Pawer Steering Pump</td><td align="right">1.00</td></tr> <tr><td>P/s Fluid A/c Delco</td><td align="right">2.00</td></tr> <tr><td>Upper Control Arm Right</td><td align="right">3.00</td></tr> <tr><td>Rear Control Arm</td><td align="right">1.00</td></tr> <tr><td>Rear Control Arm</td><td align="right">1.00</td></tr> <tr><td>Napa Gear 80w-90 Qt</td><td align="right">2.00</td></tr> <tr><td>Wheel Cyl</td><td align="right">2.00</td></tr> <tr><td>Brake Drum</td><td align="right">2.00</td></tr> <tr><td>Nut</td><td align="right">2.00</td></tr> <tr><td>Control Arm Asy</td><td align="right">1.00</td></tr> <tr><td>Control Arm Asy</td><td align="right">1.00</td></tr> <tr><td>Uppercontrol Arm Left</td><td align="right">1.00</td></tr> <tr><td>Shop Supplies</td><td align="right">1.00</td></tr> </tbody> </table>	Parts List	Qty	5w-30 Full Syn Wolf's Head	6.00	Napagold Oil Filter	1.00	Napagold Air Filter	1.00	Accufit Beam	2.00	Used Fire X Refurbished	1.00	Shoe Kit	1.00	Brake Drum Hdwr Kit	1.00	Non-chlor Brake Clnr	4.00	Pawer Steering Pump	1.00	P/s Fluid A/c Delco	2.00	Upper Control Arm Right	3.00	Rear Control Arm	1.00	Rear Control Arm	1.00	Napa Gear 80w-90 Qt	2.00	Wheel Cyl	2.00	Brake Drum	2.00	Nut	2.00	Control Arm Asy	1.00	Control Arm Asy	1.00	Uppercontrol Arm Left	1.00	Shop Supplies	1.00
Parts List	Qty																																												
5w-30 Full Syn Wolf's Head	6.00																																												
Napagold Oil Filter	1.00																																												
Napagold Air Filter	1.00																																												
Accufit Beam	2.00																																												
Used Fire X Refurbished	1.00																																												
Shoe Kit	1.00																																												
Brake Drum Hdwr Kit	1.00																																												
Non-chlor Brake Clnr	4.00																																												
Pawer Steering Pump	1.00																																												
P/s Fluid A/c Delco	2.00																																												
Upper Control Arm Right	3.00																																												
Rear Control Arm	1.00																																												
Rear Control Arm	1.00																																												
Napa Gear 80w-90 Qt	2.00																																												
Wheel Cyl	2.00																																												
Brake Drum	2.00																																												
Nut	2.00																																												
Control Arm Asy	1.00																																												
Control Arm Asy	1.00																																												
Uppercontrol Arm Left	1.00																																												
Shop Supplies	1.00																																												
Hours 24.25 :	Labor: 1,455.0 Parts: 2,414.15 Total: 3,869.15 0																																												

Workorder: 1805778 **Meter:** 48263 **In Date:** 06/06/2018 **Closed:** 06/07/2018
Problem: Left rear tire going flat.

<ul style="list-style-type: none"> - Repair left rear tire and balance .nitrogen fill tires. - Shop Supplies 	<table border="0"> <thead> <tr> <th align="left">Parts List</th> <th align="right">Qty</th> </tr> </thead> <tbody> <tr><td>Shop Supplies</td><td align="right">1.00</td></tr> </tbody> </table>	Parts List	Qty	Shop Supplies	1.00
Parts List	Qty				
Shop Supplies	1.00				
Hours 1.00 :	Labor: 60.00 Parts: 2.00 Total: 62.00				

Workorder: 1806269 **Meter:** 48594 **In Date:** 06/19/2018 **Closed:** 06/27/2018
Problem: "Service Stabiltrack" lighth on. "Check Engine" light on.

<ul style="list-style-type: none"> - Computer diagnose check engine light P0101. Perform pinpoint test .replace mass air flow sensor and air filter due to water and foreign material contamination .clear codes and retest. - Computer diagnose Abs light , code C0035 .replace defective left front hub assembly and brake light switch .clear codes and test drive. - Shop Supplies 	<table border="0"> <thead> <tr> <th align="left">Parts List</th> <th align="right">Qty</th> </tr> </thead> <tbody> <tr><td>Brake Stop Swicth</td><td align="right">1.00</td></tr> <tr><td>Air Filter</td><td align="right">1.00</td></tr> <tr><td>Mass Sensor</td><td align="right">1.00</td></tr> <tr><td>Hub Assy</td><td align="right">1.00</td></tr> <tr><td>Shop Supplies</td><td align="right">1.00</td></tr> </tbody> </table>	Parts List	Qty	Brake Stop Swicth	1.00	Air Filter	1.00	Mass Sensor	1.00	Hub Assy	1.00	Shop Supplies	1.00
Parts List	Qty												
Brake Stop Swicth	1.00												
Air Filter	1.00												
Mass Sensor	1.00												
Hub Assy	1.00												
Shop Supplies	1.00												
Hours 6.00 :	Labor: 360.00 Parts: 600.62 Total: 960.62												

**Palm Beach County Fleet Management
Asset Maintenance History**

Workorder: 1808090 **Meter:** 49204 **In Date:** 08/07/2018 **Closed:** 08/22/2018
Problem: Towed in left front wheel came off. P.M. service.

<ul style="list-style-type: none"> - Replace all six left front wheel studs and inspect for damage . Replace all four wheels and valve stems and lug nuts . Balance tires and nitrogen fill all . Test drive. - P.m. service. - Resurface both front rotors .replace brake pads and calipers . Flush and bleed brake system . Inspect and service rear brakes. - Inspect and service winch. - Shop Supplies 	<table border="0"> <thead> <tr> <th align="left">Parts List</th> <th align="right">Qty</th> </tr> </thead> <tbody> <tr><td>Wheel Stud</td><td align="right">6.00</td></tr> <tr><td>Lugnuts</td><td align="right">1.00</td></tr> <tr><td>Pro Comp Steel Wheel 51 Series</td><td align="right">4.00</td></tr> <tr><td>17x9 6x5.5 Wheel Black</td><td align="right">4.00</td></tr> <tr><td>Tire Pressure Monitoring System Sensor (</td><td align="right">4.00</td></tr> <tr><td>Napagold Oil Filter</td><td align="right">1.00</td></tr> <tr><td>Napa Syn 5w30 Qt</td><td align="right">6.00</td></tr> <tr><td>22in Exactfit-beam</td><td align="right">2.00</td></tr> <tr><td>lube</td><td align="right">1.00</td></tr> <tr><td>B Fluid Dot 3-32oz</td><td align="right">1.00</td></tr> <tr><td>Pad</td><td align="right">1.00</td></tr> <tr><td>Front Caliper</td><td align="right">1.00</td></tr> <tr><td>Front Caliper</td><td align="right">1.00</td></tr> <tr><td>Shop Supplies</td><td align="right">1.00</td></tr> </tbody> </table>	Parts List	Qty	Wheel Stud	6.00	Lugnuts	1.00	Pro Comp Steel Wheel 51 Series	4.00	17x9 6x5.5 Wheel Black	4.00	Tire Pressure Monitoring System Sensor (4.00	Napagold Oil Filter	1.00	Napa Syn 5w30 Qt	6.00	22in Exactfit-beam	2.00	lube	1.00	B Fluid Dot 3-32oz	1.00	Pad	1.00	Front Caliper	1.00	Front Caliper	1.00	Shop Supplies	1.00
Parts List	Qty																														
Wheel Stud	6.00																														
Lugnuts	1.00																														
Pro Comp Steel Wheel 51 Series	4.00																														
17x9 6x5.5 Wheel Black	4.00																														
Tire Pressure Monitoring System Sensor (4.00																														
Napagold Oil Filter	1.00																														
Napa Syn 5w30 Qt	6.00																														
22in Exactfit-beam	2.00																														
lube	1.00																														
B Fluid Dot 3-32oz	1.00																														
Pad	1.00																														
Front Caliper	1.00																														
Front Caliper	1.00																														
Shop Supplies	1.00																														
Hours 11.75 :	Labor: 705.00 Parts: 1,711.45 Total: 2,416.45																														

Workorder: 1808155 **Meter:** 49101 **In Date:** 08/07/2018 **Closed:** 08/08/2018
Problem: Wheel came off

<ul style="list-style-type: none"> - Tow From: vista Pkwy To: Lv shop 	Hours 0.00 :	Labor: 0.00 Parts: 0.00 Total: 0.00
--	-----------------	---

Workorder: 1904312 **Meter:** 53113 **In Date:** 04/19/2019 **Closed:** 05/09/2019
Problem: PM Service, CEL, ABS and trailer brake lights on.

<ul style="list-style-type: none"> - P.m. service. - Replace two tires and rotate and high speed balance all four tires . Nitrofill all. - Computer diagnose Abs light , code C0561 , U0121 ,u4073 . Perform pin point test . Replace and program Abs module . Clear codes and retest . - Perform complete front end alignment and road test . - Diagnose trailer light warning on , code C1116 and C1117 . Test for powers and grounds at trailer brake controll module . Clean and dry out module connector due to water intrusion and retest . Clear all codes. . - Shop Supplies 	<table border="0"> <thead> <tr> <th align="left">Parts List</th> <th align="right">Qty</th> </tr> </thead> <tbody> <tr><td>Napagold Oil Filter</td><td align="right">1.00</td></tr> <tr><td>Napa Syn 5w30 Qt</td><td align="right">6.00</td></tr> <tr><td>22in Exactfit-beam</td><td align="right">2.00</td></tr> <tr><td>Washer Fluid Concentr</td><td align="right">1.00</td></tr> <tr><td>35x12.5r17 Nitto Grap</td><td align="right">2.00</td></tr> <tr><td>A B S Install And Program</td><td align="right">1.00</td></tr> <tr><td>Shop Supplies</td><td align="right">1.00</td></tr> <tr><td>Tire Disposal Fee</td><td align="right">2.00</td></tr> </tbody> </table>	Parts List	Qty	Napagold Oil Filter	1.00	Napa Syn 5w30 Qt	6.00	22in Exactfit-beam	2.00	Washer Fluid Concentr	1.00	35x12.5r17 Nitto Grap	2.00	A B S Install And Program	1.00	Shop Supplies	1.00	Tire Disposal Fee	2.00
Parts List	Qty																		
Napagold Oil Filter	1.00																		
Napa Syn 5w30 Qt	6.00																		
22in Exactfit-beam	2.00																		
Washer Fluid Concentr	1.00																		
35x12.5r17 Nitto Grap	2.00																		
A B S Install And Program	1.00																		
Shop Supplies	1.00																		
Tire Disposal Fee	2.00																		
Hours 10.25 :	Labor: 686.75 Parts: 1,950.76 Total: 2,637.51																		

**Palm Beach County Fleet Management
Asset Maintenance History**

Workorder: 1910328 **Meter:** 56134 **In Date:** 10/04/2019 **Closed:** 10/16/2019
Problem: Left front wheel getting hot .

- Test drive . Replace both front brake rotors ,calipers , brake hoses and brake pads . Flush and bleed brake system . Road test .	Parts List	Qty
	Brake Rotor	2.00
	Brk Fluid Dot 4-32oz	2.00
- Computer diagnose Abs light , code C0040 . Perform pinpoint test . R&r defective right front hub assembly . Wire in new pigtail for right front wheel speed sensor . Clear codes and road test .	Non-chlor Brake Clnr	1.00
	Front Brake Pad	1.00
	Brake Hose	1.00
- Shop Supplies	Front Caliper	1.00
	Brake Hose	1.00
	Front Caliper	1.00
	Connector Abs Sensor	1.00
	Hub Assy	1.00
	Shop Supplies	1.00
Hours 7.50	Labor: 547.50	Parts: 981.54
:		Total: 1,529.04

Workorder: 1911236 **Meter:** 56291 **In Date:** 10/29/2019 **Closed:** 11/06/2019
Problem: P.M. service.

- P.m. service.	Parts List	Qty
- Inspect and test trailer plug . R&r defective trailer plug connector and rewire as needed .	Napagold Oil Filter	1.00
	Napa Syn 5w30 Qt	6.00
- Replace both broken front sway bar links .	22in Exactfit-beam	2.00
- Test and replace defective horn . Retest .	Washer Fluid Concentr	1.00
- Inspect and service winch .	trailer plug	1.00
- Inspect and service rear brakes .	Sway Bar Links	2.00
- Rotate and high speed balance all four tires . Nitrofill all.	Horn	1.00
- Shop Supplies	Shop Supplies	1.00
Hours 8.35	Labor: 609.55	Parts: 181.32
:		Total: 790.87

Workorder: 2003374 **Meter:** 58649 **In Date:** 04/02/2020 **Closed:** 04/02/2020
Problem: Transition Prep Charge

- Transition Prep Charge			
Hours 2.00	Labor: 146.00	Parts: 0.00	Total: 146.00
:			