

FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

Workorder: V036

In Date: 10/07/2005

**Close Date:** 10/07/2005

**Problem?** 

LEAK AT PUMP. INTAKE RELIEF VALVE INOP. E-21

Meter Reading:

|                                                  | ,                                 |                              |                                                                 |          |
|--------------------------------------------------|-----------------------------------|------------------------------|-----------------------------------------------------------------|----------|
| Task performed:                                  |                                   |                              | Parts                                                           | Quantity |
|                                                  |                                   |                              | 01068234000CTACTLD1 CONTROL PANEL TRAFFIC 360HLOBSOLETE FLASHER | 1        |
| Workorder:                                       | V793                              |                              |                                                                 |          |
| In Date:<br>Close Date:<br>Problem?              | 12/02/2005<br>12/12/2005          | Meter Reading:               |                                                                 |          |
| foam tank (                                      | guage reads 1/                    | 2 when tank is full-reartraf | fic It. stays on in off position E21                            |          |
| Task perform                                     | med:                              |                              | Parts                                                           | Quantity |
|                                                  |                                   |                              | NO PARTS USED                                                   |          |
| Workorder:                                       | V1196                             |                              |                                                                 |          |
| In Date:<br>Close Date:<br>Problem?<br>SIREN 10- | 01/17/2006<br>01/23/2006<br>7 E21 | Meter Reading:               |                                                                 |          |
| Task perfor                                      | med:                              |                              | Parts                                                           | Quantity |
|                                                  |                                   |                              | NO PARTS USED                                                   |          |
| Workorder:                                       | V1226                             |                              |                                                                 |          |
| In Date: Close Date: Problem?                    | 01/19/2006<br>01/26/2006          | Meter Reading:               |                                                                 |          |
| I OAW LLA                                        | ut i itolii iteli i               | ELT GIVII L-21               |                                                                 |          |
| Task perform                                     | med:                              |                              | Parts                                                           | Quantity |

4300-505PUMP FLOJET 12V

1



FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

Workorder: V1430

02/06/2006 In Date:

02/08/2006 Close Date:

Meter Reading:

**Problem?** 

3 float pumps won't start E21, T21, B21

| 3 iloat puil                        | ips won i start E        | EZI, IZI, DZI           |                              |          |
|-------------------------------------|--------------------------|-------------------------|------------------------------|----------|
| Task perfor                         | med:                     |                         | Parts                        | Quantity |
|                                     |                          |                         | 78-72BATTERY GROUP 78        | 1        |
|                                     |                          |                         | BPR5ESSPARK PLUG 7734        | 4        |
|                                     |                          |                         | J19LMUSE 1147 NGK SPARK PLUG | 2        |
| Workorder:                          | V1471                    |                         |                              |          |
| In Date:<br>Close Date:<br>Problem? | 02/10/2006<br>02/28/2006 | Meter Reading:          |                              |          |
|                                     | ISORS ON LAD             | DDERS OUT OF DATE, E-21 |                              |          |
| Task perfor                         | med:                     |                         | Parts                        | Quantity |
|                                     |                          |                         | NO PARTS USED                |          |
| Workorder:                          | V1942                    |                         |                              |          |
| In Date:<br>Close Date:             | 03/23/2006<br>03/27/2006 | Meter Reading:          |                              |          |
| Problem?<br>HOOD CA                 | BLE BROKEN,              | E-21                    |                              |          |
| Task perfor                         | med:                     |                         | Parts                        | Quantity |
| ·                                   |                          |                         | A1712756000HOOD CABLE        | 1        |
| Workorder:                          | V1798                    |                         |                              |          |
| In Date:<br>Close Date:<br>Problem? | 03/09/2006<br>03/28/2006 | Meter Reading:          |                              |          |

**REBUILD INTAKE RELIEF VALVE E21** 

| Task performed: | Parts                                           | Quantity |
|-----------------|-------------------------------------------------|----------|
|                 | 038-1010-01HALE RELIEF VALVE W/ VULCANIZED SEAT | 1        |
|                 | 546126000TPM/QG HALE REPAIR KIT                 | 1        |



FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

Workorder: V1835

03/13/2006 In Date: Close Date:

03/29/2006

Meter Reading:

**Problem?** 

| HURST POWER UNIT HAS NO POWER                                                                   | 2, E-21                |          |
|-------------------------------------------------------------------------------------------------|------------------------|----------|
| Task performed:                                                                                 | Parts                  | Quantity |
|                                                                                                 | BPR5ESSPARK PLUG 7734  | 1        |
| Workorder: V2296                                                                                |                        |          |
| In Date: 04/19/2006 Meter Readin<br>Close Date: 04/25/2006<br>Problem?<br>COMPT DOOR INOP, E-21 | ng:                    |          |
| Task performed:                                                                                 | Parts                  | Quantity |
|                                                                                                 | NO PARTS USED          |          |
| Workorder: V2333                                                                                |                        |          |
| In Date: 04/19/2006 Meter Readin<br>Close Date: 05/03/2006<br>Problem?                          |                        |          |
| REPLACE FRONT TIRE E21 (OUTSIDE                                                                 | AGENCY-CALLAGHAN TIRE) |          |
| Task performed:                                                                                 | Parts                  | Quantity |
|                                                                                                 | NO PARTS USED          |          |
| Workorder: V2801                                                                                |                        |          |
| In Date: 05/31/2006 Meter Readin<br>Close Date: 06/05/2006<br>Problem?                          | ng:                    |          |
| REAR DOOR AJAR LIGHT ON, E-21                                                                   |                        |          |
| Task performed:                                                                                 | Parts                  | Quantity |
|                                                                                                 | 52-624SWITCH DOOR      | 1        |



FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

| W | or | kor | der: | V | 28 | 28 |
|---|----|-----|------|---|----|----|
|---|----|-----|------|---|----|----|

In Date: 06/01/2006

Meter Reading:

**Close Date:** 06/14/2006

| Problem? REPLACE 1 FRONT TIRE, E-21 (CALLAGHAN)                    |               |          |
|--------------------------------------------------------------------|---------------|----------|
| Task performed:                                                    | Parts         | Quantity |
|                                                                    | NO PARTS USED |          |
| <b>Vendor?</b> : VC-15214                                          |               |          |
| Workorder: V3076                                                   |               |          |
| In Date: 06/21/2006 Meter Reading: Close Date: 06/28/2006 Problem? |               |          |
| foam tank indicator reads 1/2 when tank is full. E-21              |               |          |
| Task performed:                                                    | Parts         | Quantity |
|                                                                    | NO PARTS USED |          |
| Workorder: V3043                                                   |               |          |
| In Date: 06/19/2006 Meter Reading: Close Date: 07/13/2006          |               |          |
| Problem? REPLACE 2 FRONT TIRES, E-21 (CALLAGHAN)                   |               |          |
| Task performed:                                                    | Parts         | Quantity |
| ·                                                                  |               |          |
| <b>Vendor?</b> : VC-15214                                          |               |          |
| Workorder: V3777                                                   |               |          |
| In Date: 08/04/2006 Meter Reading: Close Date: 08/10/2006 Problem? |               |          |
| red light on master gate valve out. E21                            |               |          |
| Task performed:                                                    | Parts         | Quantity |

1165ZNSTRIKER 206-15

HA24434STRIKER PIN

A0631087000CABLE BATT. POS. A0631088000CABLE BATT. NEG.

HA24694PIN WHEEL COACH

1



FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

Workorder: V3778

In Date: 08/04/2006

Close Date: 09/11/2006

Problem?

foam pump panel wont change screens, tried to reset. E21

Meter Reading:

NO PARTS USED



FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

Workorder: V4063

08/22/2006 In Date: Meter Reading:

Close Date:

09/15/2006

14,239.00

**Problem?** 

B INSPECTION AND REPAIRS AS NEEDED E21

| Task performed: | Parts                                             | Quantity |
|-----------------|---------------------------------------------------|----------|
|                 | 01068234000CTACTLD1 CONTROL PANEL TRAFFIC         | 1        |
|                 | 048009000SPEEDCOUNTER PUMP PANEL                  | 1        |
|                 | 091-3YWCOVER KUSSMAUL AUTO EJECT                  | 1        |
|                 | 107796DRYER KIT AD9 -NEW                          | 1        |
|                 | 108-12FBEADED CHAIN W/CONN 12                     | 1        |
|                 | 180R002HURST HYD. FLUID QT                        | 1        |
|                 | 203FFBEARING PULLEY                               | 1        |
|                 | 47222LED STANSION LIGHT SAME AS 30276R            | 2        |
|                 | 50R03ZRRLIGHT 500 TIR LED                         | 4        |
|                 | 52-24WIPER BLADES ANCO 24                         | 2        |
|                 | 5462290020VALVE KIT SS VALVE 2 1/2 546-2290-02-0  | 1        |
|                 | 67BULB 12 VOLT                                    | 1        |
|                 | 68-3963453-30LENS CLEAR FOR STRIP LIGHT           | 1        |
|                 | 6806970098SEAL DOOR                               | 1        |
|                 | 78R536078R5360M 2PK FILTER AIR COND               | 1        |
|                 | 91513AMBER LENS                                   | 1        |
|                 | 9440BELT                                          | 1        |
|                 | 9480BELT                                          | 1        |
|                 | A1205Q2591OIL SEAL PINION A11205A2731 NEW #       | 1        |
|                 | A1834388002MOLD L/H                               | 2        |
|                 | A1834388003MOLD R/H                               | 2        |
|                 | BATTERY EPA TAXBATTERY EPA TAX \$1.50 PER BATTERY | 4        |
|                 | BCPR5ESSPARK PLUGS 6130                           | 1        |
|                 | CA8193AIR FILTER 46744 WIX                        | 1        |
|                 | FG87904MFG3937557S FILTER P/S NEW STYLE           | 1        |
|                 | FGQ79699GASKET-P/S FILTER NEW STYLE               | 1        |
|                 | FS1022FILTER FUEL WIX 33422 PS8689 FRAM           | 1        |
|                 | HP-31DBATTERY 950CCA HP-31D                       | 4        |
|                 | HPH6349AOIL FILTER 51748                          | 1        |
|                 | K080716BELT                                       | 1        |
|                 | PR338324070 WIX FILTER WATER                      | 1        |
|                 | PVG-KITORING KIT                                  | 1        |
|                 | R90PFILTER FUEL 33231                             | 1        |



FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

Workorder: V5514

In Date: 11/23/2006

Close Date:

11/28/2006

1,071.90 Meter Reading:

Problem?

air leaking from brake retarder when braking. Turned off retarder and notifed on duty mechnic. E-21

| Task performed:                               | Parts                             | Quantity |
|-----------------------------------------------|-----------------------------------|----------|
| 1. replace transmission retarder air solenoid | 2952271729552377 VALVE ASSY.ACCUM | 1        |

Workorder: V6286

In Date: 01/14/2007 16,865.00 Meter Reading:

Close Date: 01/24/2007

**Problem?** 

ON CALL SIREN 10-7 BATTERY TRAY WONT OPEN E21

| Task performed: | Parts                       | Quantity |
|-----------------|-----------------------------|----------|
|                 | 50R03ZCRLIGHT LED RED TIR 6 | 1        |

Workorder: V6271

In Date: 01/14/2007 Meter Reading: 1,058.00

Close Date: 01/25/2007

**Problem?** 

R FRONT STROBE EMERGENCY LIGHT ON THE HOOD HAS 4 OF 6 LED'S OUT (NON-FUNCTIONING) E-21

| Task performed:                                            | Parts                       | Quantity |
|------------------------------------------------------------|-----------------------------|----------|
| 1. TRAVELED TO STN 21. R/R STROBE LIGHT ON HOOD, TEST/ OK. | 50R03ZCRLIGHT LED RED TIR 6 | 1        |
| TIGOB. TEGT/ GR.                                           | 50R03ZRRLIGHT 500 TIR LED   | 1        |

Workorder: V6478

In Date: 01/26/2007 Meter Reading: 29.20

Close Date: 01/31/2007

**Problem?** 

tank fill valve is disconected E21

| Task performed:                                               | Parts                              | Quantity |
|---------------------------------------------------------------|------------------------------------|----------|
| 1. TRAVELED TO STN 21. HOOK UP TANK FILL VALVE<br>& TEST/ OK. | S775COUPLER<br>S777COUPLING NIPPLE | 1        |



FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

Workorder: V6435

In Date: 01/23/2007 Close Date:

02/01/2007

Meter Reading:

29.20

**Problem?** 

LENS FOR TANK WATER LEVEL LIGHTS BROKEN OFF LEFT SIDE E21

Task performed: **Parts** Quantity

1. Installed lens checked system and tested ok 68-3963453-30LENS CLEAR FOR STRIP LIGHT 1

V6509 Workorder:

In Date: 01/28/2007 Meter Reading: 29.20

**Close Date:** 02/01/2007

**Problem?** 

SPOT LIGHT ON TOP OF ENGINE NOT WORKING(JUST THE BULB), ROTATES, JUST NO LIGHT E21

Task performed: **Parts** Quantity

2 1. Installed new bulb in spot light tested ok H3LIGHT BULB BP1255/H3 H

Workorder: V6990

02/28/2007 In Date: Meter Reading: 1,111.00

Close Date: 03/06/2007

**Problem?** 

INTAKE RELIEF VALVE IS LEAKING HAS A CAP ON IT. e21

Task performed: **Parts** Quantity

1. Drive to station. Hook up tanker flushed system. Test

pump for leaks ok

NO PARTS USED

Workorder: V7069

In Date: 03/05/2007 Meter Reading: 1,172.00

Close Date: 03/07/2007

Problem?

crosslay #2 1 3/4" (bolt on coupling) after the valve leaking. e21

Task performed: **Parts** Quantity

1. Drive to station rework valve and coupling NO PARTS USED



FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

Workorder: V7440

In Date: 03/30/2007 Close Date:

04/10/2007

Meter Reading:

18,439.00

**Problem?** 

Fitting behind #2 crosslay leaks when open and under pressrue.

Task performed: **Parts** Quantity

1. Travel to station 21 truck in Belle Glade 2. Drive to station. R&R veltec rubber test ok

7001-20ESEAL

1

2

Workorder: V7934

In Date: Close Date:

04/26/2007 Meter Reading: 05/03/2007

19,427.00

**Problem?** 

CRANKCASE FULL OF FUEL FLOAT PUMP ON E21

Quantity Task performed: **Parts** 

Drain crankcase, refill; test ok NO PARTS USED

Workorder: V8948

In Date: 06/21/2007

Close Date: 07/03/2007 Meter Reading: 1,248.00

**Problem?** 

hurst power unit motor mounts broken, four mounts total, e21

Task performed: **Parts** Quantity

1. Drive to stn; installed (4) new mounts; tst ok

2. Drive to stn; fill Hurst tool

180R002HURST HYD. FLUID QT

4 HR149460107MOUNT VIBRATION (NEWER POWER UNITS

Workorder: V9004

In Date: 06/25/2007 Meter Reading: 1,248.00

**Close Date:** 07/03/2007

Problem?

hurst hydro fluid needed station supply out E21

Task performed: **Parts** Quantity

See W/O 8948 NO PARTS USED



FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

Workorder: **V9668** 

In Date: 08/01/2007

08/07/2007 Close Date:

Meter Reading:

**Problem?** 

**E21 RIGHT TURN SIGNAL BASE BROKEN** 

Task performed: **Parts** Quantity 1 replace right turn signal 6808200020LIGHT ASSY. TURN SIGNAL Workorder: V10071

1.269.00

08/22/2007 In Date: Meter Reading:

**Close Date:** 09/11/2007

**Problem?** 

The plate form on the passanger side front dose not pull out. The brake pedal feels like it has alot of play in it. E21

21,718.00

1,307.00

Task performed: Quantity **Parts** 

Adjusted brake pedal - free play NO PARTS USED

Meter Reading:

Workorder: V10291

In Date: 09/06/2007

Close Date: 09/20/2007

**Problem?** 

replace air filter on saw e21

Task performed: Quantity **Parts** drive to Stn; R/R/ filter; test run-ok 1 FREIGHTSHIPPING CHARGES

> 1 **RU1200AIR FILTER CUTTERS EDGE**

Workorder: V10311

In Date: 09/07/2007 Meter Reading: 1,307.00

Close Date: 09/20/2007

**Problem?** 

white lights not working on llight bar E21

Task performed: **Parts** Quantity

Drive to Stn; fnd bad wire in light; test ok NO PARTS USED



FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

Workorder: V10270

In Date: 09/05/2007

09/25/2007 Close Date:

Meter Reading:

Meter Reading:

21,718.00

21,718.00

Problem?

repair saw E21 (outside agency-Regan's small engine service)

Task performed: **Parts** Quantity

NO PARTS USED

Repair Saw on E21 (Outside Agency- Regan's Small

**Engine Service**)

Vendor?: REGAN'S SMALL ENGINE

Workorder: V10272

In Date: 09/05/2007

09/26/2007 Close Date:

**Problem?** 

primer leaking water e21

Task performed: **Parts** Quantity

538028052VALVE PRIMER PUMP W/HARDWARE

1

1. DRIVE TO STATION REMVED OLD VALVE

INSTALLED NEW VALVE, TEST O.K.

2. HELP LEHAN WITH VALVE INSTALLMENT AND TEST.

Workorder: V10584

In Date: 09/20/2007 Meter Reading: 1,333.00

09/27/2007 Close Date:

**Problem?** 

brecket for halligan broken t21

Task performed: **Parts** Quantity

1. DRIVE TO STATION, R/R TOOL HOLDER. NO PARTS USED



FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

Workorder: V11445

11/05/2007 In Date: Close Date:

11/13/2007

Meter Reading:

23,004.00

**Problem?** 

B inspection and related repairs E21

Task performed: Quantity **Parts** 



FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

| 4/ | 27 | /2( | )21 |
|----|----|-----|-----|
|    |    |     |     |

| Ί. | perrorn | J B | servi | ce  |        |    |       |   |
|----|---------|-----|-------|-----|--------|----|-------|---|
| 2  | nickun  | and | dron  | ∩ff | trucks | tο | Finey | т |

- 2. pickup and drop off trucks to Elpex Tire, also picked up Blazer from Dean Chev.
- 3. serviced "T" case
- 4. serviced air dryer
- 5. serviced diff and found a large amount of metal in diff fluid and on plug magnets, reinstalled metal cover plug and old fluid so truck could goto frightliner for warranty (as per Eddy Orlando)
- 6. torqued U-bolts
- 7. Serviced Trans
- 8. Repaired melted wires at rear of frame rail. Secured and protected harness
- 9. Cleaned and lubricated slides and rollers for step under RI compartment.
- 10. Removed entire lock/latch assembly from battery box (frozen) cleaned, lubbricated and reinstalled.
- 11. R+R coolant filter housing to rebuild shut off valve (frozen/leaking) also replaced coolant rescvior sight glass
- 12. Replaced all four batteries, clean all Trem. ends, clean all frame rail grounds and Term ends.
- 13. sevice small engins and equipement. replaced spark plugs check air filters, spark arresters, pull cords, check grnerator output. replaced Hurst Hoses, flush hydroutic system.
- 14. shop meeting
- 15. delievered rescue 39 to palm Springs to Total Truck
- 16. Replaced wiper blades, left A/C filter, drivers side A/C vent and air filter
- 17. Grind off old paint and repaint fuel cap
- 18. Replaced belts, also replaced Idler pulley bearing
- 19. Replaced FRC pump pressure gauge on pump panel
- 20. Changed right rear discharge from Hale valve to acron valve
- 21. install preconnect nets on both sides of Veh.
- 22. Installed 2 new nuts and waxhers in U-clamp for deck gun hold down bracket (missing)
- 23. Rebuilt intake relief valve (leaking)
- 24. Replace intake relief check valve and all surrounding line fittings (seized)
- 25. Replaced screen fittings for intake control valve signal lines.

| 0100080010STRAINER                              | 2    |
|-------------------------------------------------|------|
| 1050173 IN FLANGE                               | 1    |
| 107796DRYER KIT AD9 -NEW                        | 1    |
| 107800VALVE CHECK AD9                           | 1    |
| 1160033 IN FLANGE ADPT W/ HOLES P2S             | 1    |
| 203FFBEARING PULLEY                             | 1    |
| 29526898 29548988 TRANS FILTER ALLISON          | 1    |
| 3530016HOSE HURST 16 ORANGE                     | 1    |
| 353R091USE 353R403 HURST HOSE 16 GREEN          | 1    |
| 3818885O-RING WATER SHUT OFF                    | 2    |
| 3937367GASKET 4942874                           | 1    |
| 39437394940547 SHAFT SHUT-OFF VALVE             | 1    |
| 3943740SHAFT SHUT-OFF VALVE                     | 1    |
| 39444543977737 SCREW SHUTOFF VALVE              | 1    |
| 50R03ZRRLIGHT 500 TIR LED                       | 1    |
| 52-24WIPER BLADES ANCO 24                       | 2    |
| 546126000TPM/QG HALE REPAIR KIT                 | 1    |
| 680-10LAMERICAN FLAG W UV CLEAR LEFT            | 1    |
| 680-10RAMERICAN FLAG W UV CLEAR RIGHT           | 1    |
| 6808300174VENT A/C RH                           | 1    |
| 7875AKRON SLO-CLOSE FOR TORK LOC VAVLE          | 1    |
| 78R536078R5360M 2PK FILTER AIR COND             | 1    |
| 800405PURGE VALVE KIT                           | 1    |
| 8830-1USE 8830 SLO-CLOSE 3 IN VALVE W/HANDLE    | 1    |
| 91513AMBER LENS                                 | 1    |
| 9440BELT                                        | 1    |
| 9480BELT                                        | 1    |
| BATTERY EPA TAXBATTERY EPA TAX \$1.50 PER BATTE | RY 4 |
| BPR5ESSPARK PLUG 7734                           | 2    |
| CA8193AIR FILTER 46744 WIX                      | 1    |
| FREIGHTSHIPPING CHARGES                         | 1    |
| FS1022FILTER FUEL WIX 33422 PS8689 FRAM         | 1    |
| HP-31DBATTERY 950CCA HP-31D                     | 4    |
| HPH6349AOIL FILTER 51748                        | 1    |
| K080716BELT                                     | 1    |
| PR338324070 WIX FILTER WATER                    | 1    |
| R90PFILTER FUEL 33231                           | 1    |
| VML-T1413T3248 SIGHT GLASS                      | 1    |



FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

Workorder: V11594

In Date: 11/14/2007

Close Date: 11/19/2007

H/2007 Meter Reading:

23,004.00

**Problem?** 

install slow close on valve e21

Task performed: Parts Quantity

install slow close mechanism on Right Rear discharge

valve; (Part was charged out on "B" svc W/O) j

NO PARTS USED

Workorder: V11452

In Date: 11/05/2007 Meter Reading: 23,004.00

Close Date: 11/21/2007

Problem?

replace tires at shop callaghan

Task performed: Parts Quantity

Replace tires at shop - Callaghan j NO PARTS USED

Vendor?: CALLAGHAN

Workorder: V11517

In Date: 11/08/2007 Meter Reading: 23,004.00

Close Date: 11/21/2007

Problem?

replace hose bed cover e21

Task performed: Parts Quantity

hose bed cover E21 - Central Auto Trim NO PARTS USED

Vendor?: CENTRAL AUTO TRIM

Workorder: V11710

In Date: 11/21/2007 Meter Reading: 23,004.00

Close Date: 12/04/2007

Problem?

repair rear end e21 total truck

Task performed: Parts Quantity

Repair rear end E21 total truck

NO PARTS USED

Vendor? TOTAL TRUCK



FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

Workorder: V12201

In Date: 12/22/2007

Close Date: 01/04/2008

Meter Reading:

23,723.00

**Problem?** 

main drain valve leaks E-21

| Task performed:                          | Parts                                 | Quantity |
|------------------------------------------|---------------------------------------|----------|
| R+R gasket in drain valve to pump drain. | 10/1067DIADHDAM FOR 6 DORT DUMP VALVE | 2        |

Workorder: V12989

In Date: 02/01/2008 Meter Reading: 1,458.00

**Close Date:** 02/12/2008

**Problem?** 

clear tank lights lens cover on driver side needs replaced. e21

| Task performed:                          | Parts                                   | Quantity |
|------------------------------------------|-----------------------------------------|----------|
| 1. Drive to station, R & R lens, test OK | 68-3963453-30LENS CLEAR FOR STRIP LIGHT | 1        |

Workorder: V13355

In Date: 02/19/2008 Meter Reading: 1,475.00

Close Date: 02/25/2008

Problem?

right side over rear wheel red led warning light, all bulbs not lit. e21

| Task performed:                               | Parts                       | Quantity |
|-----------------------------------------------|-----------------------------|----------|
| 1. Drive to station, R & R led light, test OK | 50R03ZCRLIGHT LED RED TIR 6 | 1        |
|                                               | 52-624SWITCH DOOR           | 2        |

Workorder: V13362

In Date: 02/19/2008 Meter Reading: 1,475.00

Close Date: 02/25/2008

Problem?

LED Flasher Right side over rear wheels out \*\* Replaced by mechanic on 02-19-08 while here for R21.

| Task performed:                          | Parts         | Quantity |
|------------------------------------------|---------------|----------|
| 1. This should be on E21, see WO # 13355 | NO PARTS USED |          |



FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

Workorder: V13363

In Date: 02/19/2008

03/05/2008 Close Date:

Meter Reading:

1.475.00

**Problem?** 

bracket holding preconnect nozzle on Left side broken -- needs to be replaced. (Right side will need it soon also) e21

Task performed: Quantity **Parts** 

1. drive to station, installed holder for preconnect nozzle NO PARTS USED

Workorder: V13790

In Date: 03/10/2008 Meter Reading: 1,495.00

**Close Date:** 03/18/2008

**Problem?** 

Foam system does not work. e21

Task performed: **Parts** Quantity

1. Drive to station, take foam pump apart, clean wheel in NO PARTS USED

pump, test OK

Workorder: V14430

In Date: 04/12/2008 Meter Reading: 26,106.00

Close Date: 04/24/2008

**Problem?** 

2 lug nut covers came off E21. One missing and one broken.

Task performed: **Parts** Quantity

5 1. installed covers and repair side pump panel pool. 6256LNC6256LNC COVER LUG NUT

Workorder: V14534

In Date: 04/17/2008 Meter Reading: 26,466.00

Close Date: 05/08/2008

**Problem?** 

2 hurst cutter holder straps broken E21

Task performed: **Parts** Quantity

Drive to Stn; R/R straps; test. 1 FREIGHTSHIPPING CHARGES

T69-15.5 STRAP FOR TOOL HOLDER

2



FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

Workorder: V15458

06/02/2008 In Date: Close Date:

06/23/2008

Meter Reading:

27,670.00

**Problem?** 

B INSPECTION AND REPAIRS AS NEEDEDED E21

| Task performed:                                                   | Parts                                   | Quantity |
|-------------------------------------------------------------------|-----------------------------------------|----------|
| 6-3&4 B Inspection                                                | 0100080010STRAINER                      | 2        |
| 6-3 Shop Meeting                                                  | 104967DIAPHRAM FOR 6 PORT DUMP VALVE    | 1        |
| 6-3 removed Rear differential; Replace seals and clean            | 15W40BSYN OIL BULK QTS                  | 24       |
| entire rear then Road test. 6-12 Levy helped w/ diff install.     | 35200-YLIGHT MARKER LEDAMBER            | 1        |
| 6-4 Replace Compressor coolant line & seals                       | 380003ASEAL                             | 2        |
| 6-4 Tighten rf lower shock mount                                  | 401581GASKET AXLE FL80 R002435          | 2        |
| 6-4 rebuilt main pump drain valve                                 | 78R536078R5360M 2PK FILTER AIR COND     | 1        |
| 6-4 Serviced batteries replaced terminal ends negative &          | FS1022FILTER FUEL WIX 33422 PS8689 FRAM | 1        |
| positive<br>6-6 Meeting w/ Tim                                    | HPH6349AOIL FILTER 51748                | 1        |
| 6-6 Replaced rear ac filter                                       | PR338324070 WIX FILTER WATER            | 1        |
| 6-6 replaced right side body marker light                         | PVG-KITORING KIT                        | 1        |
| 6-6 Replaced ts marker light bulb                                 |                                         | 1        |
| 6-10 Resealed all fittings on master drain valve                  | R90PFILTER FUEL 33231                   | 2        |
| 6-10 Repaired faulty wiring to spot light control in              | S1003-A3103015 SEAL                     | 2        |
| console                                                           |                                         |          |
| 6-10 Rebuild vacuum pump valve on right side pump panel (frozen)  |                                         |          |
| 6-10 Replaced both relief vlave screen fittings in pump (clogged) |                                         |          |
| 6-16 Calibrate foam system                                        |                                         |          |

Workorder: V16441

6-16 Clean bay

In Date: 07/18/2008 Meter Reading: 1,683.70

Close Date: 07/28/2008

**Problem?** 

LEFT SIDE PASSENGER/FIREFIGHTER DOOR HAVING PROBLEMS CLOSING e21

| Task performed:                                      | Parts                 | Quantity |
|------------------------------------------------------|-----------------------|----------|
| Drive to Stn; installed/adj door & hinge; test ok. j | 18-45484-000LATCH L/H | 1        |



FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

Workorder: V16571

07/24/2008 In Date: Close Date:

07/31/2008

Meter Reading:

1,683.70

Problem?

**Problem?** 

Task performed:

Set up foam control head with correct specifications

Tractor ABS light on dash e21

| Tractor Ab3 lig         | Jill Oil dasii ez                                                                 | ı                   |            |               |          |
|-------------------------|-----------------------------------------------------------------------------------|---------------------|------------|---------------|----------|
| Task performed          | d:                                                                                |                     |            | Parts         | Quantity |
|                         | Drive to Stn; hookup laptop; R/R sender out of adjustment; adj; test drive; ok. j |                     |            | NO PARTS USED |          |
| Workorder: V            | /16843                                                                            |                     |            |               |          |
|                         | 3/05/2008<br>3/12/2008                                                            | Meter Reading:      | 1,69       | 4.00          |          |
| red whelen len          | s on driver side                                                                  | e of cab broken (sr | nall) E-21 |               |          |
| Task performed          | d:                                                                                |                     |            | Parts         | Quantity |
| Replace lens.           | j                                                                                 |                     |            | NO PARTS USED |          |
| Workorder: V            | /17618                                                                            |                     |            | -             |          |
| Close Date: 09 Problem? | 9/29/2008                                                                         | Meter Reading:      | 29,25      | 1.00          |          |
| flota pump leak         | king oil near ex                                                                  | ahust e21           |            |               |          |
| Task performed          | d:                                                                                |                     |            | Parts         | Quantity |
| Regan will repair       | r at stn. j                                                                       |                     |            | NO PARTS USED |          |
| Workorder: V            | /17544                                                                            |                     |            |               |          |
|                         | 9/07/2008<br>9/30/2008                                                            | Meter Reading:      | 1,73       | 0.00          |          |

THE LAST 2 SHIFTS EACH WITH A CAR FIRE, THE FOAM SYSTEM WOULD NOT FLOW MUCH FOAM. FOAM GAGE LIGHT

NO PARTS USED

Quantity

ONLY WOULD MOVE 1/8TH INCH AT A HIGHER % SETTING THAN NORMAL E-21



FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

Workorder: V17666

In Date: 09/12/2008

09/30/2008 Close Date:

Meter Reading:

1,730.00

Problem?

St 21 A. TIC camera #10173225 backup battery will not charge due to a broken tab. Passed on from "C" shift.

Task performed: Quantity **Parts** R & R TIC Charger and battery, test OK. NO PARTS USED Workorder: V18079 In Date: 10/02/2008 Meter Reading: 29,791.00 **Close Date:** 10/09/2008 **Problem?** repair door damage Task performed: **Parts** Quantity 1. Drive to Sta-21. Take door apart replace holder and 1 6807200216DOOR CHECK ASSY adjusted door. test (OK). (R.T.) Workorder: V15508 In Date: 06/03/2008 Meter Reading: 1,638.00 Close Date: 10/21/2008 Problem? please check foam system clabration seems to be low (have to crank up% to get foam) E-21 Task performed:

**Parts** 

Quantity

1

NO PARTS USED

Workorder: V18835

In Date: 11/04/2008

**Close Date:** 11/17/2008

**Problem?** 

pump panel Its 10-7 e21

Task performed: **Parts** Quantity

Drive to Stn; replc light; test ok. 01-06635060-C90PSC0CDCR STRIP LIGHT STEADY WHITE

30,310.00

Meter Reading:



FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

Workorder: V19028

In Date: 11/12/2008 Meter Reading:

**Close Date:** 11/19/2008

**Problem?** 

mount bracket for TIC in a manor to stop vibration to TIC e21

|                                     |                                           | •                         |           |                                       |                          |  |  |
|-------------------------------------|-------------------------------------------|---------------------------|-----------|---------------------------------------|--------------------------|--|--|
| Task perfor                         | med:                                      |                           |           | Parts                                 | Quantity                 |  |  |
| Drive to Stn; ok. j                 | move handlight                            | & TIC to new location; t  | test      |                                       |                          |  |  |
| Workorder:                          | V19346                                    |                           |           |                                       |                          |  |  |
| In Date:<br>Close Date:<br>Problem? | 11/25/2008<br>12/15/2008                  | Meter Reading:            | 1,813.    | 00                                    |                          |  |  |
| Sign brack                          | ets need to be in                         | stalled on both sides of  | engine 2  | 1. Signs need to be cut down to fit i | n brackets on rescue 21. |  |  |
| Task perform                        | med:                                      |                           |           | Parts                                 | Quantity                 |  |  |
|                                     | ation, pic up sign<br>ation, installed si | s.<br>gns and bracket.    |           | NO PARTS USED                         |                          |  |  |
| Workorder:                          | V19435                                    |                           |           |                                       |                          |  |  |
| In Date:<br>Close Date:<br>Problem? | 12/01/2008<br>12/16/2008                  | Meter Reading:            | 1,813.    | 00                                    |                          |  |  |
| FITTINGS                            | FOR ENGINE C                              | OOLER WEAK, SHOW          | N TO MI   | KE HE KNOWS WHAT NEEDS TO             | BE REPAIRED E-21         |  |  |
| Task perfor                         | med:                                      |                           |           | Parts                                 | Quantity                 |  |  |
| Drive to Stn;                       | installed new fitt                        | ting; test ok. j          |           | NO PARTS USED                         |                          |  |  |
| Workorder:                          | V19388                                    |                           |           |                                       |                          |  |  |
| In Date:<br>Close Date:<br>Problem? | 11/29/2008<br>12/17/2008                  | Meter Reading:            | 30,780.   |                                       |                          |  |  |
| Right 3" Int                        | ake leaking thru                          | the shut off valve very s | slowly. W | orked valve and flushed water thru    | it. Still leaks. E-21    |  |  |
| Task perfor                         | med:                                      |                           |           | Parts                                 | Quantity                 |  |  |
| Drive to Stn;                       | rework valve ho                           | using; test ok. j         |           | NO PARTS USED                         |                          |  |  |

1,789.00



FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

Workorder: V20110

In Date: 01/05/2009

01/30/2009 Close Date:

Meter Reading:

31,490.00

**Problem?** 

ON CALL AIR HORN WENT OFF WHILE BRAKEING

Task performed: **Parts** Quantity

Fnd air horns inop; rem air line at solenoid on wheel well; air going to horns but horns inop; fnd horn button inop sometimes for air horns; disconnected solenoid per opr.

NO PARTS USED

Workorder: V20111

In Date: 01/05/2009 **Close Date:** 

02/04/2009

Meter Reading: 31,490.00

Problem?

**REAIR AIR HORN E21** 

Task performed: Quantity **Parts** 

Drive to Stn; hookup horns; adj coolant leak at radiator; repair; test ok.

NO PARTS USED

Workorder: V20214

In Date: 01/08/2009 Meter Reading: 31,490.00

Close Date: 02/04/2009

**Problem?** 

winch out unit on call

Task performed: **Parts** Quantity

drive to location; pull truck out; chk for damage; truck ok. NO PARTS USED

Workorder: V20311

In Date: 01/13/2009 Meter Reading: 31,490.00

Close Date: 02/04/2009

Problem?

DOOR SHOCK INOP, E-21

Task performed: Quantity **Parts** 

1-Drive to shop installed new holder and shock. test ok. NO PARTS USED



FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

Workorder: V20374

In Date: 01/14/2009 Close Date: 02/04/2009

**Problem?** 

repair chain saw E21

Meter Reading: 31,770.00

Task performed:

**Parts** 

Quantity

1

1- Drive to station, replace plug adjusted carb, check spark no spark call regor to repair.

NO PARTS USED

Workorder: V20735

In Date: 01/30/2009

Meter Reading: 1,857.00

Close Date: 02/13/2009

**Problem?**pump panel, relief valve, and scene lights on pole not working. E21

Task performed: Parts Quantity

1 drive to station replace bulb for spot light H3-100WBP1210H3 BULB

3-100WBP1210H3 BULB

2 drive to station bad connection at scene light. adjusted relief valve light.

tested OK

Workorder: V20162

In Date: 01/06/2009 Meter Reading: 31,490.00

Close Date: 02/19/2009

**Problem?** 

repair vent saw E21 (outside agency-Regan's small engine service)

Task performed: Parts Quantity

repair vent saw E21 - Regan j NO PARTS USED

Vendor?: REGANS SMALL ENG

Workorder: V20386

In Date: 01/15/2009 Meter Reading: 31,770.00

Close Date: 02/19/2009

Problem?

Repair saw E21 (outside agency-Regan's small engine service)

Task performed: Parts Quantity

Repair saw E21 - Regans j NO PARTS USED

Vendor?: REGANS SMALL ENG



FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

Workorder: V21659

In Date: 03/09/2009 Close Date: 03/13/2009

**Problem?** 

relioef valve 10-7 e 21

**Meter Reading:** 33,184.00

| Task performed:                                                                                                              | Parts                                          | Quantity |
|------------------------------------------------------------------------------------------------------------------------------|------------------------------------------------|----------|
| <ol> <li>Drive to stn; installed relief valve; test ok.</li> <li>Rebuilt old relief valve for road truck stock. j</li> </ol> | 042-0550-00SPRING-VALVE QG RELIEF VALVE        | 1        |
|                                                                                                                              | 200226200200-2262-50 SWITCH-PROXIMITY QG VALVE | 1        |
|                                                                                                                              | 538-1400-00QG VALVE                            | 1        |
|                                                                                                                              | 546126000TPM/QG HALE REPAIR KIT                | 1        |

32,702.00

Workorder: V21243

In Date: 02/20/2009

Close Date: 04/07/2009

Problem?

vent saw won't run E21

| Task performed:                                                                                  | Parts                 | Quantity |
|--------------------------------------------------------------------------------------------------|-----------------------|----------|
| Drive to Stn; i nstlled plug; cln; old fuel out of saw & can; get fresh fuel; adj carb; test ok. | S986AIR GAUGE 160 PSI | 1        |

Workorder: V22192

In Date: 03/30/2009 Meter Reading: 1,897.20

Meter Reading:

Close Date: 04/08/2009

**Problem?** 

Primer on engine 21 has a small leak

| Task performed:                               | Parts                                 | Quantity |
|-----------------------------------------------|---------------------------------------|----------|
| Drive to Stn; replcd primer valve; test ok. j | 538028052VALVE PRIMER PUMP W/HARDWARE | 1        |
|                                               | PVG-KITORING KIT                      | 1        |



FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

Workorder: V22576

In Date: 04/16/2009

Close Date: 05/07/2009

Meter Reading: 34,289.00

**Problem?** 

C INSPECTION AND REPAIRS AS NEEDED E 21

| Task performed:                                                                                                    | Parts                                            | Quantit |
|--------------------------------------------------------------------------------------------------------------------|--------------------------------------------------|---------|
| C-Inspection                                                                                                       | 0100080010STRAINER                               | 2       |
| 2. Installed new strap for cones on left on tailboard.                                                             | 038-1550-00VALVE CHECK HALE 1/4""                | 1       |
| 3. T-case svc                                                                                                      | 107796DRYER KIT AD9 -NEW                         | 1       |
| Rem injectores & installed new injectors & high-press                                                              |                                                  | 1       |
| ubes; fnd lieft pump leaking.                                                                                      | 107800VALVE CHECK AD9                            | 1       |
| 5. Drained fuel sys & filled with fresh fuel.                                                                      | 108-12FBEADED CHAIN W/CONN 12                    | •       |
| 6. Rem press gov adjustment frm pump panel; rebuilt.<br>7. Rem/rebuilt air dryer.                                  | 15W40BSYN OIL BULK QTS                           | 24      |
| B. Rem faulty throttle control for pump & replcd w/new                                                             | 3935172USE 3963988 WASHER-SEAL                   | 2       |
| one; tested opn.                                                                                                   | 3936953INJ TUBE                                  | 6       |
| ). P/S svc & filter.                                                                                               | 3948529RXINJECTOR                                | 6       |
| 0. svc eng belts & chkd proper opn.                                                                                | 3949085PUMP ISC FUEL TRANSFER NEW #4935005       | 1       |
| 1. Replcd rear cab A/C filter.                                                                                     | 3963983WASHER SEAL ISB                           | 2       |
| 2. Rem/rebuilt total press gov controller.                                                                         |                                                  | 1       |
| 3. t-shoot vac leak in pump sys.                                                                                   | 538-1410-00VALVE SENSING SV HALE                 | 1       |
| 4. Replcd faulty lift pump.                                                                                        | 546-0200-50QD REL.VALVE KIT                      |         |
| 5. Rebuilt intake relief valve & press sensing valve; fnd                                                          | 546126000TPM/QG HALE REPAIR KIT                  | 1       |
| nir leak & to remov & reseal surface.                                                                              | 5462290020VALVE KIT SS VALVE 2 1/2 546-2290-02-0 | 1       |
| 6. T-shoot siren module & fnd to be faulty; replicd siren.                                                         | 5462300020VALVE KIT SS VALVE 3 IN                | 1       |
| 7. Replcd faulty sensing valve & fittings & chkd vac                                                               | 78R536078R5360M 2PK FILTER AIR COND              | 1       |
| ngain.<br>8. Rebuilt Hale discharge valve #1 - leaking; retested.                                                  | 800405PURGE VALVE KIT                            | 1       |
| Rebuilt 1 are discharge valve #1 - leaking, relested.     Rebuilt 3" deckgun valve; failed vac test after rebuild; | 883088301201 3 IN SLO-CLOZ W/R1 HANDLE           | 1       |
| advised foreman; told to swap over to Akron.                                                                       |                                                  | 1       |
| 20. Rem 3" Hale deckgun valve & repared/mod plumbing                                                               | 91553941GAUGE                                    | •       |
| o accept 3" Akron valve; had to mod linkage on valve;                                                              | 9440BELT                                         | 1       |
| perated properly.                                                                                                  | 9480BELT                                         | 1       |
| 21.T-shoot faulty city horn; cannot find problem.                                                                  | A0631117000HORN HIGH NEW # 06-52125-039          | 1       |
| 2. Extend gun alarm & light coming on when park brake                                                              | A0631117003HORN LOW NEW #06-52125-041            | 1       |
| lisengaged; had to rewire sensor.                                                                                  | ELA101-ATHROTTLE EXCEL CUMMINS IS SERIES         | 1       |
| 23. Assist Reines w/retr fit of change frm Hale SS valve                                                           | FG87904MFG3937557S FILTER P/S NEW STYLE          | 1       |
| o Akron SS valve for deck gun.                                                                                     |                                                  | 1       |
| 24. Test drove & filled pump w/water & tested opn; went                                                            | FGQ79699GASKET-P/S FILTER NEW STYLE              | 1       |
| o Stn23 to fill fuel tank; eng died; had to get fuel &                                                             | FS1022FILTER FUEL WIX 33422 PS8689 FRAM          |         |
| eprime fuel sys; all ok. j                                                                                         | HPH6349AOIL FILTER 51748                         | 1       |
|                                                                                                                    | K080716BELT                                      | 1       |
|                                                                                                                    | PR338324070 WIX FILTER WATER                     | 1       |
|                                                                                                                    | R90PFILTER FUEL 33231                            | 1       |
|                                                                                                                    | LIMVS254411STRAP 46 IN                           | 1       |

WS-295HFSM1USE 295SLSA1 SIREN XG840-KITEXTENDA GUN SWITCH

1



FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

Workorder: V22688

In Date: 04/20/2009

Close Date: 05/11/2009

/20/2009 Meter Reading:

34,289.00

Problem?

REPLACE HOSE BED COVER CENTRAL AUTO TRIM E21

Task performed: Parts Quantity

NO PARTS USED

Vendor?: CENTRAL

Workorder: V23114

In Date: 05/06/2009 Meter Reading: 34,482.00

Close Date: 05/19/2009

Problem?

pump panel /relief valve light 10-7 e21

Task performed: Parts Quantity

Drive to Stn; fnd bad connection at node; rework wiring;

Meter Reading:

test ok. i

NO PARTS USED

Workorder: V23175

In Date: 05/10/2009

Close Date: 05/20/2009

Problem?

spot light out E21

Task performed: Parts Quantity

Drive to Stn; replace top spotlights; test ok. j 620122SPOT LIGHT REMOTE 1

1,910.00

Workorder: V23317

In Date: 05/16/2009 Meter Reading: 1,914.00

Close Date: 06/15/2009

Problem?

Foam not working on E21

Task performed: Parts Quantity

Drive to Stn; take head of pump apart; cln vein &

converter; rebuild; test ok. j

NO PARTS USED



FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

Workorder: V23565

In Date: 05/26/2009

Close Date: 06/15/2009

Problem?

siren 10-7 e21

Meter Reading: 34,776.00

Task performed: Parts Quantity

Drive to Stn; wire plug loos at head of siren; rework; test

ok. j

NO PARTS USED

Workorder: V23828

In Date: 06/04/2009 Meter Reading: 1,943.00

Close Date: 06/19/2009

Problem?

right rear uper clearance light lens missing. e21

Task performed: Parts Quantity

Drive to Stn; replc lens. j 372000084MARKER LIGHT 2

Workorder: V23829

In Date: 06/04/2009 Meter Reading: 1,943.00

Close Date: 06/19/2009

**Problem?** 

right rear clearance light lens missing.

Task performed: Parts Quantity

drive to Stn; installed lens; tested ok. j

Workorder: V23643

In Date: 05/29/2009 Meter Reading: 34,776.00

Close Date: 06/23/2009

**Problem?** 

speaker (driver) in left side front bumper loose. e21

Task performed: Parts Quantity

Drive to Stn; installed new hsng & speaker. j NO PARTS USED



FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

Workorder: V25141

In Date: 07/29/2009 Close Date:

07/30/2009

Meter Reading:

1,968.00

Problem?

Left turn signal on the front fender is about to fall off. Look like it's missing a screw from the bottom.

| Task performed:                            |   | Parts                             | Quantity |
|--------------------------------------------|---|-----------------------------------|----------|
| drive to stn; replcd turn signal; test ok. | j | 6808200020LIGHT ASSY. TURN SIGNAL | 1        |

Workorder: V25290

In Date: 08/04/2009 1,992.00 Meter Reading:

Close Date: 08/17/2009

**Problem?** 

pressure relief valve sticks. dosn't appear to work as well as other Engines, circle D handle broken, air intake guage broken E21

|                                                                                                                                        | Task performed:                                             | Parts                                   | Quantity |
|----------------------------------------------------------------------------------------------------------------------------------------|-------------------------------------------------------------|-----------------------------------------|----------|
|                                                                                                                                        | 1. Drive to Stn; replc valve in pump - scrren; need         | 0100080010STRAINER                      | 1        |
|                                                                                                                                        | control unit; replicd.                                      | 042-0550-00SPRING-VALVE QG RELIEF VALVE | 1        |
| <ul><li>2. Drive to Stn; installed valve; test ok.</li><li>3. Rebuild relief valves &amp; drive to stn; isntalled air filter</li></ul> | 200226200200-2262-50 SWITCH-PROXIMITY QG VALVE              | 1                                       |          |
|                                                                                                                                        | minder & rep D lite & installed (2) marker litest; test ok. | 22-51374-000SENSOR AIR RESTRICTION      | 1        |
|                                                                                                                                        | j                                                           | 35200-RLIGHT MARKER LED RED             | 2        |
|                                                                                                                                        |                                                             | 519007110SLIDE CONTROL 519-0071-10      | 1        |
|                                                                                                                                        |                                                             | 538-1400-00QG VALVE                     | 1        |
|                                                                                                                                        |                                                             | 546126000TPM/QG HALE REPAIR KIT         | 1        |
|                                                                                                                                        |                                                             | 562008150PMD CONTROL VALVE              | 1        |

Workorder: V25553

In Date: 08/16/2009 Meter Reading: 2,006.00

Close Date: 09/03/2009

Problem?

pump panel & both(R)(L) spot lights not working E21

| Task performed:                                            | Parts         | Quantity |
|------------------------------------------------------------|---------------|----------|
| Drive to Stn; fnd bad connection at Node #3; cln; test ok. | NO PARTS USED |          |



FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

Workorder: V25946

In Date: 09/01/2009 Close Date: 09/30/2009

**Problem?** 

circle D light is out. E21

Meter Reading: 36,729.00

Task performed: Parts Quantity

Drive to Stn; replc bulb. j NO PARTS USED

Workorder: V27036

In Date: 10/20/2009 Meter Reading: 2,051.00

Close Date: 11/02/2009

**Problem?** 

Need new fuel tank for the gas powered fan on E21. Has a Honda engine of 5.5hp with asset #10155550. \*\* Old tank rusted inside

Task performed: Parts Quantity

Drive to Stn; rem fuel tank; cln rusted; too bad for rep;

order one from Regan; Joe will install. j

NO PARTS USED

Workorder: V27063

In Date: 10/21/2009 Meter Reading: 2,051.00

Close Date: 11/02/2009

**Problem?** 

chain on booster hose reel falls off E21

Task performed: Parts Quantity

Drive to Stn; rem motor; installed chain; hooked motor

up; adj; test ok. j

NO PARTS USED

Workorder: V27287

In Date: 10/30/2009 Meter Reading: 37,943.00

Close Date: 11/05/2009

**Problem?** 

LED lights innop E21

Task performed: Parts Quantity

Drive to Stn; fnd bad grnds & replc (2) lights; test ok.

j

50R03ZCRLIGHT LED RED TIR 6

1



FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

Workorder: V25405

In Date: 08/09/2009

Close Date: 11/23/2009

Meter Reading: 1,998.00

Problem?

Heat Indicator stickers expired on the extension and attic ladder E21

Task performed: Parts Quantity

Dropped off stickers; eng on a call. j NO PARTS USED

Workorder: V28078

In Date: 12/02/2009 Meter Reading: 2,095.00

Close Date: 12/17/2009

**Problem?** 

Left rear (lower red) is out e21

Task performed: Parts Quantity

4

1. Drive to Stn21; C/O, ned to get parts at shop.

35200-RLIGHT MARKER LED RED

2. Travel.

3. Replcd R/rear, L/rear & right center marker lights.

i

Workorder: V28079

In Date: 12/02/2009 Meter Reading: 2,095.00

Close Date: 12/17/2009

Problem?

Need one light bulb for circle D light. 1500/600. (blown bulb) e21

Task performed: Parts Quantity

Drop off circle D-light. j

Workorder: V28081

In Date: 12/02/2009 Meter Reading: 2,095.00

Close Date: 12/17/2009

**Problem?** 

Expired heat sensors on 24 foot extension ladder. e21

Task performed: Parts Quantity

C/O old tag; rem other up to date.

NO PARTS USED



10155548

FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

Workorder: V28077

In Date: 12/02/2009

12/21/2009 Close Date:

Meter Reading:

2,095.00

Problem?

Broken latch on trashline compartment door. Under FF door, broke off today, e21

Meter Reading:

Task performed: **Parts** Quantity

1. Latch wrong size, too big.

NO PARTS USED

2. Travel

3. Cut larger opening & install latch.

Workorder: V29366

In Date: 01/22/2010 Close Date: 02/08/2010

2,118.00

**Problem?** 

left head light is out e 21

Task performed: **Parts** Quantity

went to Stn21; when I arrived, truck was transferred to

Stn22; followed truck to Stn22; R/R headlight. j

1

1

1

H6054USE CV TYPE SEALED BEAM

Workorder: V29476

In Date: 01/27/2010 Close Date: 03/01/2010

Meter Reading: 2.137.00

Problem?

right side strob light, by pump panal 10-7 e21

Task performed: **Parts** Quantity

Went to Stn21; fnd strobe light bad; R/R strobe asy; ck

50R03ZRRLIGHT 500 TIR LED opn. 5FLANGEC5FLANGEC FLANGE CHROME

Workorder: V29867

In Date: 02/10/2010 Meter Reading: 39.641.00

Close Date: 03/02/2010

Problem?

repair hose bed cover e21 central

Task performed: **Parts** Quantity

Repair hose bed cover E21 - Central Auto NO PARTS USED

Vendor?: CENTRAL AUTO



#### 4/27/2021

## Palm Beach County Fire Rescue **Fleet Maintenance Asset History** 10155548

FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

Workorder: V29691

In Date: 02/03/2010

03/05/2010 Close Date:

39.641.00 Meter Reading:

Problem?

**B INSPECTION AND REPAIRS AS NEEDED E21** 

#### Task performed: Quantity **Parts** 30 15W40BSYN OIL BULK QTS 10 **194BULB** 3. Rem slip yoke-wld not come apart when u-joint was 2 283255 SLIDE 18IN 500 LBS 1 4. Replc wiperblades-worn. 295SLSA1SIREN 5. Replc sliders for trash line-seized. 35200-RLIGHT MARKER LED RED 6. Replc frnt shocks-worn; lower bolts were siezed, very 1 5-280XU-JOINT 2 52-24WIPER BLADES ANCO 24 2 6803230300 65482 SHOCK FRONT ENGINE 8. Rear bumper EZ lock inop; loaded w/sand; clndlubed 6808330631CABLE ASSY HEATER 9. Tank-to-pump hard to open; wrng angle on rod; 6809881078DZ STUD 6819634283068-1963428-30 LENS CLR 800034VALVE PARKING BRK. ABPN83322930CONTROL HEAD AC/HEAT 11. (1) bumper LED dim; replc LED asy. 12. Cln A/C condensors; cvrd w/dirt; washed frnt/rear CA8193AIR FILTER 46744 WIX FS1022FILTER FUEL WIX 33422 PS8689 FRAM 13. Install fan cyr-safety. HPH6349AOIL FILTER 51748 14. Air leaks park brake valve; replc. **R90PFILTER FUEL 33231** 15. Intake relief leaks-debris; back flushed. 16. Air leak w/brakes; released; fitting in dash-replcd.

#### **B-Inspection**

- 2. Replc #4 u-joint-will not take grease.
- removed; clnd rust frm spring & lubed.

- difficult to replc.
- 7. R-1 pull out step jammed; free up R-1 step.
- EZ lock.
- corrected rod angle & lubed linkage & Hale valve.
- 10. (1) cab marker inop; wire pulled out; rep marker wiring.
- A/C condensors.

- 17. Air tires-low; rem steel frm LRO tire.
- 18. Leak @ deck gun valve; mntng bolt brkn; rem brkn bolt & replcd.
- 19. Tightened loose belts.
- 20. Btry box & trash line pull out steps inop; rust/dirt on track; clnd/lube sliders; need to replc trash line slides.
- 21. Cln cab A/C filter-dirty.
- 22. A/C controller not working properly; cable brkn, other out of adj; replcd cable & adjusted; replcd controller.
- 23. Siren inop-defective; replcd siren & rep connector.



FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

501-3090-00PRIMER PUMP MOTOR

Workorder: V30492

In Date: 03/05/2010 03/24/2010 Close Date:

**Problem?** 

pimer motor inop E21

40.093.00 Meter Reading:

Task performed:

1. Went to Stn25; fnd hard suction end not sealing; cut off bolt; replc bolt & reconnected hose end; ck ok.

2. Went to Stn21; fnd primer pump inop; R/R primer

motor asy; ran/ck opn; ck ok. jj

Workorder: V30507

In Date: 03/06/2010 Close Date:

03/25/2010

Meter Reading:

40,093.00

**Problem?** 

Chain/vent saw strarts and idels fine with chain spinning. Touch the throttle and unit dies. Restart unit several times with same results. Asset # 10137921...FYI.... IBEm says no such piece of equipment found E21

**Parts** 

Task performed:

Went to Stn21; ran saw; cld not adj; runs but will not

throttle up.

**Parts** 

Quantity

Quantity

NO PARTS USED

Workorder: V30213

In Date: 02/24/2010

Close Date: 04/02/2010 Meter Reading: 39,821.00

**Problem?** 

SCBA holder neeed to be adjusted for the sperian aipacks to fix. e21

Task performed:

**Parts** 

Quantity

1. went to Stn21; Rem, drilled & replc brckts on all seats

2. R/R SCBA brkts on compt L-2. j

**FHLP-6TANK CLIP** 

2

Workorder: V31000

In Date: 03/24/2010

Close Date: 04/20/2010 Meter Reading: 40,552.00

**Problem?** 

SCBA brackets need to be adjusted in both rear seats of E21

Task performed:

**Parts** 

Quantity

went to Stn21; rem both both rear SCBA brkts; reposition

& remnt brkts; ck ok. j

NO PARTS USED



FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

Workorder: V31610

In Date: 04/18/2010

Close Date: 04/30/2010

Meter Reading:

40,954.00

Problem?

**Problem?** 

Task performed:

siren switch on dash not working e21

Went to 21; fnd hands free siren inop; rem dash, ck

butto/switch; ck ok; R/R siren head asy; ck opn-ck ok.

Spot lite on E21 roof top working intermittently on and off and then fails.

**Parts** Task performed: Quantity 2 1. Went to Stn21; fnd roof spot going on/off; rem bulb; H3-100WBP1210H3 BULB did not have one; returned to Stn21; R/R bulb; ck opn; ck ok. 2. Fnd eng protection lite on; fnd 418 code; rem fuel filters; clnd sensors; reinstalled sensors & filter; started/ran; ck ok; cleared codes. Workorder: V32441 In Date: 05/26/2010 Meter Reading: 41,387.00 Close Date: 05/28/2010 Problem? load hose move holder E21 Task performed: **Parts** Quantity Mov spare truck & help set up for move hose; took NO PARTS USED divider out of surplus truck & set up divider for new hose. Workorder: V32797 In Date: 06/10/2010 Meter Reading: 42.133.70 Close Date: 06/17/2010 Problem? light box on E21 appears to have a short. It works intermittently. It has been tagged and removed from E21. Task performed: **Parts** Quantity Swapped lights & rebuilt one. NO PARTS USED Workorder: V34906 In Date: 09/13/2010 Meter Reading: 43,768.60 Close Date: 10/05/2010

**Parts** 

295SLSA1SIREN

Quantity



FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

Workorder: V35015

In Date: 09/17/2010 Close Date: 10/05/2010

Problem?

Litebox not working E21

**Meter Reading:** 43,768.60

Task performed: Parts Quantity

Fnd rear box light inop; fnd wiring bad - R/R fuse/wiring; NO PARTS USED

ck ok.

Workorder: V35755

In Date: 10/19/2010 Meter Reading: 44,005.00

**Close Date:** 11/05/2010 **Problem?** 

Secure hose bed divider.

Task performed: Parts Quantity

NO PARTS USED

- 1. Travel to stn; inspect hose bed; met w/chief & crews.
- 2. Unload hose frm hose bed for partition repair.
- 3. Rem hose line partition; drill/tap partition to deck; install/sec to deck; install step on hose reel compt door; install support brkt for soft suction; load hose on hose bed.
- 4. Install btry charger. j



FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

Workorder: V35786

**In Date:** 10/19/2010 **Close Date:** 11/08/2010

**Problem?** 

Perform"B" service. E21

Meter Reading: 44,503.00

| Task performed: Parts | Quantity |
|-----------------------|----------|
|-----------------------|----------|



4/27/2021

33. fill foam and water tanks.

34. rear tail light inop and pump panel light loose, r&r

## **Palm Beach County Fire Rescue Fleet Maintenance Asset History** 10155548

FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

| 1. c inspection                                                                                                                       | 0100080010STRAINER                                | 2      |
|---------------------------------------------------------------------------------------------------------------------------------------|---------------------------------------------------|--------|
| pressure wash engine and pump compartment                                                                                             | 05-17223-000CAP RADIATOR 10 LB                    | 1      |
| 3. inspect batterys , r&r batterys.                                                                                                   | 0913912CHARGER 2000                               | 1      |
| 4. inspect differential and top fluid.                                                                                                | 0915520120AUTO EJECT 20 AERO OTL3925              | 1      |
| <ul><li>5. clean and paint fuel cap.</li><li>6. replace 2 lugnut covers</li></ul>                                                     |                                                   | 1      |
| 7. service transfer case.                                                                                                             | 097-1971-00-05MM SEAL WASHER FOR SPEED SENSOR     |        |
| 8. service transmission                                                                                                               | 107796DRYER KIT AD9 -NEW                          | 1      |
| 9. service air dryer.                                                                                                                 | 107800VALVE CHECK AD9                             | 1      |
| 10. inspect transmission lines and brackets, found 2                                                                                  | 15W40BSYN OIL BULK QTS                            | 28     |
| broken clamps,                                                                                                                        | 200-2481-00-0546-3240-00-0 FOAM PUMP SENSOR KIT   | 1      |
| 11. inspect battery tray and trash line tray, found both                                                                              | 203FFBEARING PULLEY                               | 1      |
| trays to be binding up, clean out road dirt and dry lube                                                                              | 29526898 29548988 TRANS FILTER ALLISON            | 1      |
| all componets.                                                                                                                        |                                                   | 1      |
| 12. service cooling system.                                                                                                           | 372000031IGNITION ON DISPLAY                      | 2      |
| 13. inspect coolant shut off valve, found valve seized,                                                                               | 3818885O-RING WATER SHUT OFF                      | 4      |
| r&r water shut off valve and rebuild.                                                                                                 | 3937367GASKET 4942874                             | 1      |
| 14. inspect radiator cap, cap failed psi test, r&r radiator                                                                           | 39437394940547 SHAFT SHUT-OFF VALVE               | 1      |
| cap.<br>15. r&r rear a/c filter                                                                                                       | 3943740SHAFT SHUT-OFF VALVE                       | 1      |
| 16. check door seals, r&r door seals on left rear, right                                                                              | 39438574989614 SEAL O-RING SHUT-OFF VALVE         | 1      |
| rear, and officers door.                                                                                                              | 39444543977737 SCREW SHUTOFF VALVE                | 1      |
| 17. check compartment doors, found I1&r1 locks loose,                                                                                 | 50R03ZCRLIGHT LED RED TIR 6                       | 2      |
| secure loose locks, checks ok.                                                                                                        |                                                   | 2      |
| 18. check door struts, found door struts weak on, I3 &                                                                                | 52-24WIPER BLADES ANCO 24                         | 1      |
| r3, r&r door struts.                                                                                                                  | 546126000TPM/QG HALE REPAIR KIT                   | 1      |
| 19. left fender strobe inop, r&r strobe light assy, checks                                                                            | 5462300020VALVE KIT SS VALVE 3 IN                 | 1      |
| ok.                                                                                                                                   | 67BULB 12 VOLT                                    | 1      |
| 20. tailboard refloctor broken, r&r reflector.                                                                                        | 6806840018DOOR SILL L/H                           | 1      |
| 21. check door sills, found left rear door sill cracked,                                                                              | 6806970098SEAL DOOR                               | 1      |
| r&r left rear door sill.                                                                                                              | 6807200575HANDLE DOOR                             | 2      |
| 22. r&r a/c belt.                                                                                                                     | 6814600340A14-15472-000 HORN BUTTON               | 1      |
| 23. r&r fan belt                                                                                                                      |                                                   | 1      |
| <ul><li>24. r&amp;r a/c tensioner and rebuild a/c idler pulley.</li><li>25. check exhaust stack, found exhaust stack loose,</li></ul> | 78R536078R5360M 2PK FILTER AIR COND               | 1      |
| tighten bolts and nuts, check ok.                                                                                                     | 800405PURGE VALVE KIT                             | ,<br>, |
| 26. check foam system, diagnose why foam system is                                                                                    | 91398907 VALVE KIT 3 IN AKRON                     | 1      |
| inop, foam sensing element at foam head is defective,                                                                                 | 9440BELT                                          | 1      |
| r&r sensor and test.                                                                                                                  | 9480BELT                                          | 1      |
| 27. diagnose pump failure, pump will not pull vacuum,                                                                                 | 98032R 41032-3 RED REFLECTOR OVAL REFLECTOR       | 1      |
| r&r pressure relief valve, and test.                                                                                                  | A1834388002MOLD L/H                               | 2      |
| 28. tank to pump valve leaking, drain tank and remove                                                                                 | A1834388003MOLD R/H                               | 1      |
| valve, rebuild valve and reinstall,                                                                                                   |                                                   | 2      |
| 29. r&r pump sv valve, and rebuild.                                                                                                   | ACX-84534LUG NUT COVER PK10                       |        |
| 30. disgnose vacuum test failure, found deck gun                                                                                      | BATTERY EPA TAXBATTERY EPA TAX \$1.50 PER BATTERY | 4      |
| leaking, r&r deck gun valve and rebuild , passes vaccum                                                                               | EAA-8350-60UGSS6557UP STRUT-LIFT                  | 4      |
| test with 4.5 inches.                                                                                                                 | FS1022FILTER FUEL WIX 33422 PS8689 FRAM           | 1      |
| 31. check inop primer pump, found loose connection on                                                                                 | HP-31DBATTERY 950CCA HP-31D                       | 4      |
| pump, secure connection, test ok.  32. check window mouldings, found 3 broken door                                                    | HPH6349AOIL FILTER 51748                          | 1      |
| mouldings and 2 door open assy broken, R&R door                                                                                       | K080716BELT                                       | 1      |
| mouldings and retap 3 holes.                                                                                                          | R90PEILTER FLIFI 33231                            | 1      |
|                                                                                                                                       |                                                   |        |

R90PFILTER FUEL 33231

UMVS111611STRAP



FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

tail light bulb, and tighten loose lens.

- 35. bad ign light indicator, r&r indicator light.
- 36. r&r wiper blades and fill washer fluid tank.
- 37. r&r heat sensor on all ground ladders.
- 38. adjust air horns.
- city horn inop, diagnose and found coroded ground
- at solenoid, clean and tighten connection.
- 40. secure all loose and hanging electrical wires.

Workorder: V36543

In Date: 11/18/2010 Meter Reading: 44,631.00

Close Date: 12/01/2010

**Problem?** 

EC3500 Honda Generator and Honda vent fan needs service. Spark Plug replaced by AT on 11/17 e21

| Task performed:                                           | Parts                                 | Quantity |
|-----------------------------------------------------------|---------------------------------------|----------|
| Travel to sn; Gen inop - carb clogged; clnd & replc plug. | 17210-ZE3-505AIR FILTER HONDA         | 1        |
| J                                                         | 524740830-805 A/F HONDA 17210-ZE1-505 | 1        |
|                                                           | 7460967AIR FILTER 17210-ZE2-515 HONDA | 1        |
|                                                           | BPR5ESSPARK PLUG 7734                 | 2        |

Workorder: V35509

In Date: 10/08/2010 Meter Reading: 44,005.00

Close Date: 12/22/2010

**Problem?** 

Need 3 smoke detector campaign signs for R21 (2) and T21 (1).

Task performed: Parts Quantity

(1) TRAVELED TO ST21 TO FIT 3 SMOKE DETECTOR CAMPAIGN SIGNS. TWO FOR R21 AND ONE FOR T21. FILED AS NEEDED TO FIT BRACKETS. OK. J.W.

NO PARTS USED

Workorder: V35523

In Date: 10/09/2010 Meter Reading: 44,005.00

Close Date: 12/22/2010

Problem?

K-12 no gasket on the fuel cap/ fuel leak E21

Task performed: Parts Quantity

(1) TRAVELED TO ST21 TO INSTALL O RING ON FUEL CAP OF THE K12 IN E21. DONE. J.W.



FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

Workorder: V35680

In Date: 10/15/2010

12/22/2010 Close Date:

44,005.00 Meter Reading:

**Problem?** 

Secure hose bed divider, E21

| Task performed: | Parts                                   | Quantity |
|-----------------|-----------------------------------------|----------|
|                 | FS1022FILTER FUEL WIX 33422 PS8689 FRAM | 1        |
|                 | R90PFILTER FUEL 33231                   | 1        |

Workorder: V36965

In Date: 12/06/2010 Close Date:

12/22/2010

Meter Reading: 45,003.00

**Problem?** 

repair 3 float pumps sta 21 (outside agency-regan's small eng. service)

| Task performed: | Parts                             | Quantity |
|-----------------|-----------------------------------|----------|
|                 | X170DECK GUN ROTATION LOCK INSERT | 1        |

Workorder: V37091

In Date: 12/11/2010 Meter Reading: 45,003.00

**Close Date:** 12/22/2010

**Problem?** 

K-650 fuel leak. Fuel leaking from fuel cap, the O-ring will not stay in place, moving from the sealing surfice. E21

| Task performed:                                                                  | Parts                                | Quantity |
|----------------------------------------------------------------------------------|--------------------------------------|----------|
| (1) TRAVELED TO ST21 TO REPAIR FUEL LEAK ON K-650 FROM E21. CHECKED OUT LEAK AND | TV495-375TEMPEST VENTMASTER FUEL CAP | 1        |
| REPLACED THE FUEL CAP. J.W.                                                      |                                      |          |

Workorder: V37018

In Date: 12/08/2010 Meter Reading: 45,003.00

**Close Date:** 01/05/2011

**Problem?** 

right front head light replaced from sta. stock. replaced stock with light off ATec. 19's truck.

| Task performed:                                 |   | Parts                        | Quantity |
|-------------------------------------------------|---|------------------------------|----------|
| Drive to stn; Right headlight inop; replc bulb. | j | H6054USE CV TYPE SEALED BEAM | 2        |



FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

Workorder: V36913

In Date: 12/06/2010

Close Date: 01/11/2011

Meter Reading:

45,003.00

**Problem?** 

repair 3 float pumps sta 21 (outside agency-regan's small eng. service)

Task performed: Parts Quantity

Repair (3) float pumps Stn21 - Regan j NO PARTS USED

Vendor?: REGAN

Workorder: V36966

In Date: 12/07/2010 Meter Reading: 45,003.00

Close Date: 01/11/2011

Problem?

repair small engines for Batt 3,4,8,training (outside agency-regan's small eng. service)

Task performed: Parts Quantity

Repair small engin Batt 3, 4, 8, training - Regan j

NO PARTS USED

Vendor?: REGAN

Workorder: V37715

In Date: 01/10/2011 Meter Reading: 46,108.00

Close Date: 01/18/2011

**Problem?** 

Master Pressure guage io FRC reading 30psi to low on intake side. E21

Task performed: Parts Quantity

Master press gauge inaccurate; intake transducer bad; replc transducer & clnd terms on head pump; test ok.

103100PT-2XE-IO3100PT3-S0B 600 TRANSDUCER INT

1

Workorder: V37681

In Date: 01/07/2011 Meter Reading: 46,108.00

Close Date: 01/24/2011

**Problem?** 

Med. cabinet right front leaking water from top in the rain. E21

Task performed: Parts Quantity

Travel to stn; Medic cab water leak - caulking worn;

locate/rep leak in medic cabinet.



FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

Workorder: V39342

03/21/2011 In Date: Close Date:

03/24/2011

48,425.00

**Problem?** 

right front hood light is broken from the bracket, the light does work e21

Meter Reading:

| Task performed:                                                                                     |             | Parts                                    | Quantity |
|-----------------------------------------------------------------------------------------------------|-------------|------------------------------------------|----------|
| replc brkn right t-signal asy. j                                                                    |             | NO PARTS USED                            |          |
| Workorder: V39343                                                                                   |             |                                          |          |
| In Date: 03/21/2011 Meter Reading: Close Date: 03/28/2011 Problem?                                  | 48,42       | 25.00                                    |          |
| stop button is out of the back of saw. able to pull                                                 | stop butt   | on out/ not secure, but it does work E21 |          |
| Task performed:                                                                                     |             | Parts                                    | Quantity |
| Rep switch on saw. j                                                                                |             | NO PARTS USED                            |          |
| Workorder: V39496                                                                                   |             |                                          |          |
| In Date: 03/28/2011 Meter Reading: Close Date: 04/05/2011 Problem?                                  | 48,42       |                                          |          |
| repair 3 float pumps, fan, blower, and generator f                                                  | for statior | n 21 & E21 (outside agency-regan)        |          |
| Task performed:                                                                                     |             | Parts                                    | Quantity |
| Repair (3) float pumps, fan, blower, & gen for Str<br>E21 - Regan j<br><b>Vendor?</b> : REGAN       | n21 &       | NO PARTS USED                            |          |
| Workorder: V39772                                                                                   |             |                                          |          |
| In Date: 04/07/2011 Meter Reading: Close Date: 04/07/2011 Problem? hurst power unit low on hyd. oil | 48,92       | 21.00                                    |          |
| Task performed:                                                                                     |             | Parts                                    | Quantity |
| 1. top off hurst power unit                                                                         |             | 180R002HURST HYD, FLUID OT               |          |

180R002HURST HYD. FLUID QT



FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

Workorder: V39541

03/30/2011 In Date: Close Date:

04/13/2011

Meter Reading:

48,921.00

**Problem?** 

right air horn 10-7, sounds like a leak, removed and put back but only air comes out, poss needs new gasket. E21

| Task performed:                                                                                                                   | Parts                                                                     | Quantity                   |
|-----------------------------------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------|----------------------------|
| <ol> <li>Travel to 21; rep air horn.</li> <li>Replc chain saw blade/bar. j</li> </ol>                                             | NO PARTS USED                                                             |                            |
| Workorder: V39691                                                                                                                 |                                                                           |                            |
| In Date: 04/05/2011 Meter Reading: Close Date: 04/13/2011 Problem?                                                                | 48,921.00                                                                 |                            |
| Small fuel leak noted from fuel cap. O ring m                                                                                     | ay not be seated correctly. E21                                           |                            |
| Task performed:                                                                                                                   | Parts                                                                     | Quantity                   |
| Travel to 21; K12 saw has leak, not truck; will b unit out tomorrow. j                                                            | oring spare 03-34467-000FUEL CAP M2                                       | 1                          |
| Workorder: V38757                                                                                                                 |                                                                           |                            |
| In Date: 02/24/2011 Meter Reading: Close Date: 04/21/2011  Problem? pump test, dry vacuum failed, will not attaine                | 47,542.50 ed 22 in. hg with primer, drops to 0 in. hg in less than 1 minu | ute. CS Driver B shift. E2 |
| Task performed:                                                                                                                   | Parts                                                                     | - "                        |
| rask periorineu.                                                                                                                  |                                                                           | Quantity                   |
| travel to 21; reb uild valve & test - ok. j                                                                                       | 546126000TPM/QG HALE REPAIR KIT                                           | Quantity                   |
| travel to 21; reb uild valve & test - ok. j                                                                                       | 546126000TPM/QG HALE REPAIR KIT                                           |                            |
| travel to 21; reb uild valve & test - ok. j  Workorder: V39843 In Date: 04/11/2011 Meter Reading: Close Date: 04/21/2011 Problem? | 546126000TPM/QG HALE REPAIR KIT 49,082.00                                 |                            |
| travel to 21; reb uild valve & test - ok. j  Workorder: V39843  In Date: 04/11/2011 Meter Reading: Close Date: 04/21/2011         |                                                                           |                            |
| travel to 21; reb uild valve & test - ok. j  Workorder: V39843 In Date: 04/11/2011 Meter Reading: Close Date: 04/21/2011 Problem? |                                                                           |                            |



FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

Workorder: V40250

In Date: 04/29/2011

Close Date: 05/03/2011

Meter Reading:

49,593.00

Problem?

water in fuel light on. Sta 21.

| Task performed:                            |   | Parts                                       | Quantity |
|--------------------------------------------|---|---------------------------------------------|----------|
| travel to 21; replcd wtr separator filter. | j | R90PFILTER FUEL 33231                       | 2        |
|                                            |   | RAIRK30880N122WSKL4000 SENSOR WATER IN FUEL | 1        |

Workorder: V40547

In Date: 05/11/2011 Close Date: 05/13/2011

05/11/2011 Meter Reading: 05/13/2011

49,870.80

Problem?

Floater pump not starting, place on bay floor. This the second floater pump with same problem e21

Task performed: Parts Quantity

1. rep (2) floater pumps at Stn23; adj carbs; chk plugs; chk full fuel; (2) running ok at this time.

2. take other one to shop; change oil, cln carb, cln cyl of gas/oil & carb of gas/oil; cln spark plug; start to c ln oil

frm exh sys.

NO PARTS USED

Workorder: V40456

In Date: 05/06/2011 Meter Reading: 49,593.00

Close Date: 05/16/2011

**Problem?** 

Light bar lens cover on passenger side has small hole in it.E21

 Task performed:
 Parts
 Quantity

 Travel to 21; R/R lens. j
 9UCAPCC9UCAPCC END CAP CLEAR
 1



4/27/2021

#### Palm Beach County Fire Rescue **Fleet Maintenance Asset History** 10155548

FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

Workorder: V41261

In Date: 06/10/2011 Close Date:

Meter Reading: 06/30/2011

50,875.00

**Problem?** 

**B INSPECTION AND REPAIRS E 21** 

| Task performed:                                                                                  | Parts                                          | Quantity |
|--------------------------------------------------------------------------------------------------|------------------------------------------------|----------|
| Perform "B" service                                                                              | 038-1790-00CHECK VALVE INJECTOR HALE FOAM SYS. | 1        |
| 2. Rem both frt cab seats to be sent out for rep;                                                | 103385NDRAIN COCK                              | 1        |
| reinstalled seats after rep.  3. Svc diff.                                                       | 1094KIT-AIR HORN-GROVER                        | 2        |
| 4. Rem pull cord drains frm air tanks & replc w/petcok                                           | 501-3130-00PUMP HALE FOR FOAMMASTER            | 1        |
| style - leaking.                                                                                 | 52-24WIPER BLADES ANCO 24                      | 2        |
| 5.Replc both rear mudflaps-ripped/torn; also R & right                                           | 546-2210-02-0LIGHT KIT HALE                    | 1        |
| rear mudflap mnt to straighten.  6. Replcd A/C compressor mntng bolt - brkn.                     | 78R536078R5360M 2PK FILTER AIR COND            | 1        |
| 7. Replc wiper blades & clnd squirters.                                                          | B2420LP-SMUD FLAP 24 X 24                      | 2        |
| 8. Replod rear A/C filter.                                                                       | CA8193AIR FILTER 46744 WIX                     | 1        |
| 9. Replc indicator socket/bulb asy for master intake valve                                       | EAA-8350-30UGSS1783UQ STRUT-LIFT               | 2        |
| - rusted out.                                                                                    | FS1022FILTER FUEL WIX 33422 PS8689 FRAM        | 1        |
| 10. Recovered frt A/C sys, vac & recharged; leak chkd; sys is now cooling normally - 42 degrees. | HPH6349AOIL FILTER 51748                       | 1        |
| 11. Recvrd rear A/C sys;, vac/recharged; leak chk; sys                                           | R90PFILTER FUEL 33231                          | 1        |
| is now cooling normally - 44 degrees.                                                            |                                                |          |
| 12. Straightened seat belt - twisted, pass frnt.                                                 |                                                |          |
| 13. Replc hold opens on both L-1 compt doors - worn                                              |                                                |          |

17. T-shoot foam sys error code for low volt; clnd all terms, pos & grnds at frame rail; also clnd all posts at frame rail at btry box - corroded; retest sys; no further sign of error code.

15. C/O foam inop; fnd foam pump bypassing; clnd bypass valve; still bypassing; replc pump only; tested sys; sys now works; sys is flashing volt supply error;

18. Clnd/installed diaphragm kits in both air horns & adj.

19. Qualtiy check - Ferraher.

Workorder: V41600

14. Replc eng air filter.

also replc foam ejector. 16. Flush foam frm wtr tank.

In Date: 06/25/2011 Meter Reading: 50,909.00

Close Date: 07/07/2011

**Problem?** 

out.

Front intake valve is not opening. E 21

Task performed: **Parts** Quantity

REPLACED WIF SENSOR ON ENGINE CHECKED FT INTAKE WORKS FINE AK



FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

Workorder: V42114

In Date: 07/19/2011 07/20/2011

Close Date:

Problem?

Repair deck gun lock.

51,351.40 Meter Reading:

Task performed: **Parts** Quantity

1 travel to 21 replaced stop for deck gun ak X170DECK GUN ROTATION LOCK INSERT

Workorder: V42187

In Date: 07/21/2011 Meter Reading: 51,351.40

Close Date: 07/22/2011

**Problem?** 

E21- Hurst hydraulic hose burned from muffler. Green hose need replacement, Sta 21.

Task performed: Quantity **Parts** 

PARTS ONLY NO LABOR AK 1 3530016HOSE HURST 16 ORANGE

Workorder: V40260

In Date: 04/29/2011 Meter Reading: 49,593.00

Close Date: 08/02/2011

Problem?

replace 4 rear tires E21 (outside agency-Boulevard tire)

Task performed: **Parts** Quantity

no invoice found, nothing in file, close per mike NO PARTS USED

Workorder: V43476

In Date: 09/06/2011 Meter Reading: 52,442.00

Close Date: 09/07/2011

Problem?

Battery light on in dash. Wont drop down from HIGH idle. E 21

Task performed: **Parts** Quantity

drive to st 21 test charging system r&r alternator 4867JB320 UPGRADE ALTERNATOR



FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

Workorder: V44653

repair done on 45090

10/24/2011 In Date: Close Date:

11/01/2011

Meter Reading:

**Problem?** 

rear compartment door cab sensor not functioning. Cab door aiar buzzer will not cease. E 21

| Task performed:  Went to stn; fnd door ajar warning light on all the time; traced problem to rear door; fnd connector full of wtr. j |                          |                                 | Parts                              | Quantity |
|--------------------------------------------------------------------------------------------------------------------------------------|--------------------------|---------------------------------|------------------------------------|----------|
|                                                                                                                                      |                          |                                 | NO PARTS USED                      |          |
| Workorder:                                                                                                                           | V45090                   |                                 |                                    |          |
| In Date:<br>Close Date:<br>Problem?                                                                                                  | 11/10/2011<br>11/21/2011 | Meter Reading:                  |                                    |          |
|                                                                                                                                      | headlight out o          | n driver's side. High beam work | s. No replacements in station.     |          |
| Task perform                                                                                                                         | med:                     |                                 | Parts                              | Quantity |
| changed bulk                                                                                                                         | 0                        |                                 | NO PARTS USED                      |          |
| also see wo                                                                                                                          | 45089                    |                                 |                                    |          |
| Workorder:                                                                                                                           | V45136                   |                                 |                                    |          |
| In Date:<br>Close Date:<br>Problem?                                                                                                  | 11/13/2011<br>11/21/2011 | Meter Reading:                  |                                    |          |
|                                                                                                                                      | of oilfor engine         | and some for station suppy. E   | 21                                 |          |
| Task perfori                                                                                                                         | med:                     |                                 | Parts                              | Quantity |
| gave to static                                                                                                                       | on off of service        | truck                           | NO PARTS USED                      |          |
| Workorder:                                                                                                                           | V45089                   |                                 |                                    |          |
| In Date:<br>Close Date:<br>Problem?                                                                                                  | 11/10/2011<br>11/23/2011 | Meter Reading:                  |                                    |          |
|                                                                                                                                      | headlight out o          | n driver's side. High beam work | ss. No replacements in station.E21 |          |
| Task perfori                                                                                                                         | med:                     |                                 | Parts                              | Quantity |



FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

Workorder: V41601

In Date: 06/25/2011

Close Date: 12/02/2011

Meter Reading:

50,909.00

Problem?

Digital number display on intake not working properly. E21

Task performed:

Parts

Quantity

travel to st 21 r&r display rewire unit

IOA200A00DISPLAY MODULE REBUILD ONLY SEND IN

1

Workorder: V46816

In Date: 01/24/2012 Meter Reading:

02/28/2012

ading: 55,501.00

Close Date: Problem?

CAN WE HAVE THE SAME FOG/FLOOD LIGHTS INSTALLED ON THE FRONT OF E26 INSTALLED ON THE FRONT OF E21.

DARK ROADS W/ NO STREETLIGHTS. Sta 21

Task performed: Parts Quantity

CHECKED WITH CREW ON WHAT THEY NEEDED.

NO PARTS USED

Workorder: V47234

In Date: 02/10/2012 Meter Reading: 56,030.60

Close Date: 02/28/2012

**Problem?** 

POWER CORD, THAT HANGS FROM CEILING AND SUPPLIES E21, WAS PULLED OUT OF CEILING PLUG WHEN CORD

CAUGHT ON E21 HAND RAIL WHILE RESPONDING TO A CALL

Task performed: Parts Quantity

1

CHECKED CORD NEED LIFT AT STATION. 800034VALVE PARKING BRK.

Workorder: V47272

In Date: 02/13/2012 Meter Reading: 56,030.60

Close Date: 02/28/2012

Problem?

Driver side strob light, under "B" post 10-7. E21

Task performed: Parts Quantity

LOOSE WIRE CONNECTION REPAIR.

NO PARTS USED



FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

Workorder: V47435

In Date: 02/20/2012

02/29/2012 Close Date:

Meter Reading:

56,202.00

Problem?

Engine 21 rooftop mounted spotlight broken, will not move side to side, we need spotlight on roads at night, with no streetlights. A approved to install fog/flood lights to front of E21 still need at night plz

Task performed: Quantity **Parts** 

REMOVED COVER FROM SPOT LIGHT FOUND

NO PARTS USED

MOTOR JAMBED REPAIRED.

Workorder: V47494

In Date: 02/22/2012

Meter Reading: 56,202.00

Close Date: 02/29/2012

Problem?

poss, fuel injector leak and a pump cooler/engine cooler leak E21

Task performed: **Parts** Quantity

FOUND INJECTOR LEAKING REPAIRED.

NO PARTS USED

FOUND BAD FITTING ON COOLANT LINE

REPLACED.

Workorder: V47609

In Date: 02/28/2012 Meter Reading: 56,375.70

Close Date: 03/06/2012

**Problem?** 

foam system would shut off approx every 2 min on its own. I had to activate the system over 10 times in one incident to keep foam

flowing E21

Task performed: Quantity **Parts** 

CHECKED WIRING FOUND LOOSE CONNECTION ON

POWER STUD CORRECTED.

NO PARTS USED

Workorder: V47905

In Date: 03/12/2012 Meter Reading:

03/13/2012 Close Date:

Problem?

on call hurst unit wont run e 21

Task performed: **Parts** Quantity

56.721.20

1. WENT TO 21 DRAINED AND CLEANED CARB -

STARTED AND RAN - CHECK OK.

FOUND L-QUARTZ LIGHT ALARM GOING OFF -ADJUSTED SWITCH - CHECK OPERATION - CHECK OK.



FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

Workorder: V47881

In Date: 03/09/2012

03/16/2012 Close Date:

Meter Reading:

Meter Reading:

56.721.20

Problem?

Spent the past 2 shifts exercising and back flushing the pump to try to get the Pressure Relief Valve working better. It sticks bad and the intake relief appears to go off easier than other Engines I've been on. E21

Task performed:

WENT TO 21 - FOUND INTAKE RELIEF LEAKING -RAN AND CHECK. OPERATION - FOUND S.W. MOUNT BENT AND OPENING VALVE - ADJUSTED AND **REPAIRED** SW MOUNT-CHECK OPERATION/CHECK OK - MOUNT SENSING.

Quantity **Parts** 1 038-1010-01HALE RELIEF VALVE W/ VULCANIZED SEAT 1 5460990500GASKET SEAL KIT P25/30

Workorder: V47731

In Date: 03/03/2012

Close Date: 03/19/2012

**Problem?** 

White rear park light is out on the right. E 21

Task performed:

REMOVED OLD LIGHT INSTALLED NEW LIGHT AND

HOUSING.

**Parts** 

60C00FCRCLEAR BACKUP 600 SERIES

1

Quantity

Workorder: V47781

03/06/2012 In Date:

Close Date: 03/19/2012

Meter Reading:

56,575.10

56,575.10

Problem?

Hale TRV-L Hot Pump tester light is not working. E 21

Task performed:

**Parts** 

Quantity

TRAVEL TO STATION FOUND TEST LIGHT INOP DUE TO CORROSION CLEANED CONTACTS AND SWITCH

NO PARTS USED

Workorder: V47782

In Date: 03/06/2012

56,575.10 Meter Reading:

03/19/2012 Close Date:

Problem?

E21 will need to add oil soon. Request a case of motor oil for the station.

Task performed:

**Parts** Quantity

TRAVEL TO STATION CHECK OIL IN ENGINE LEAVE CASE OF OIL AT STATION.

15W40QSYN OIL QT

12



FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

Workorder: V48618

In Date: 04/12/2012 Close Date:

04/24/2012

57,018.90 Meter Reading:

**Problem?** 

telelight on drive side oos .thanks darrell

Task performed: Quantity **Parts** 3 INSTALLED NEW BULBS. LB-D30BULB QUARTZ HAL. 12V 150W

Workorder: V48776

In Date: 04/20/2012 Meter Reading: 57,173.00

Close Date: 04/24/2012

**Problem?** 

The engine coolant is below the glass bulb. R 21

Task performed: Quantity **Parts** 

TRAVEL TO 21 FOUND SIGHT GLASS CRACKED FOR SURGE TANK NONE ON TRUCK. CAME TO SHOP FOR PARTS AND BACK TO 21 FOR REPAIR TESTED

FOR LEAK. OK.

VML-T1413T3248 SIGHT GLASS

2

Workorder: V49129

In Date: 05/06/2012 Meter Reading: 57,696.50

**Close Date:** 05/10/2012

Problem?

needs new windshieldwiper blades E 21

Task performed: **Parts** Quantity

2 TRAVEL TO 21 R&R WIPERS. 52-24WIPER BLADES ANCO 24

Workorder: V49324

In Date: 05/14/2012 Meter Reading: 57,870.50

05/17/2012 Close Date:

**Problem?** 

T.I.C. is not charging. All batteries dead E21

Task performed: **Parts** Quantity

REPLACED AND REWIRED TIC CHARGER. NO PARTS USED



FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

Workorder: V49716

In Date: 05/29/2012

Close Date: 06/04/2012

Problem?

battery #1 is low E21

**Meter Reading:** 58,201.00

Task performed: Parts Quantity

TRAVEL TO 21 CHECKED BATTERIES AND CHARGING SYSTEM ALL OK. CHECKED SHORE

POWER OK.



FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

Workorder: V47962

In Date: 03/14/2012 Close Date: 06/05/2012

**Problem?** 

C INSPECTION E 21

**Meter Reading:** 56,880.00

Task performed: Parts Quantity



#### FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

| <ol> <li>C Inspection</li> </ol> | ٦. |
|----------------------------------|----|
|----------------------------------|----|

- 2. Service air dryer and had to move dryer because line hitting spring shackle so dryer and tried airline away from the spring
- 3. Service T-Case.
- 4. Started service trans, finish service trans.
- Service power steering.
- 6. Change front tires.
- 7. Mount two tires.
- 8. Battery fail load test so I remove old battery, replaced with new battery, cleaned battery box and terminals.
- 9. Found battery box would not open, had to remove latches to open and clean slides, replace latches and handle ass. and cleaned slides and lube, slides worked good.
- 10. started to make back slides draw work need new latches and clean slides, replaced latch and clean and
- 11. put LED tire pressure low flasher, put extension on inside tire on rear and hose on outside tire on rear so fireman can see LED flasher.
- 12. started remove trans, cooler and lines. Finish cooler and lines. Finish trans, cooler and lines.
- 13. R&R bolts, and had to remove fan toput the smallest
- 14. R&R warning light on left rear side, because 30% of the light was out. Took light off and found no plug, so I cut wires and put a plug on.
- 15. repaired wire in center console and put in lum to
- 16. Top off coolant and ATF after changing cooler and
- 17. Remove inlet relief valve. Found bad stem in valve rebuild valve, found treads bad in hose holding SV sensing valve so i had to put a keen sert thread repair, replaced 3 fittings and installed both valves.
- 18. tighten up passenger side and air pack bracket.
- 19. started vacuum test after repairing inlet relief valve found hose reel valve leak R&R hose reel and tested, found deck gun valve leak R&R deck gun and tested. Found recirculator valve leaking R&R recirculator valve. 20. Did vacuum test could not get more than 17" of vacuum so got other gauge and found gauge bad. Then it would go to 24" vacuum but would not hold found both primer valve leaking R&r both rimer valves did vacuum test and it went to 24" and did not hold.
- 21. R&R tank to pump valve and rebuild put back on and vacuum test still fail so I grease all halp valve found two grease zerks leaking replaced zerks and pass vacuum test.
- 22. Check nozzle holders on step and two would not work R&R two nozzle holders.
- 23. Check relief valve found light not working right check wire found not problem with wire, check switch at inlet

| 0100080010STRAINER                                | 1  |
|---------------------------------------------------|----|
| 038-1010-01HALE RELIEF VALVE W/ VULCANIZED SEAT   | 1  |
| 038-1550-00VALVE CHECK HALE 1/4""                 | 1  |
| 042002000SPRING RELIEF VALVE HALE                 | 1  |
| 073004100PISTON                                   | 1  |
| 082-2007-00-0GREASE ZERK W/CHECK VLV              | 2  |
| 097-0990-00WASHER                                 | 1  |
| 10129102690ZNFW/O FLUSH LOCK BOLT                 | 3  |
| 107796DRYER KIT AD9 -NEW                          | 1  |
| 107800VALVE CHECK AD9                             | 1  |
| 108-12FBEADED CHAIN W/CONN 12                     | 3  |
| 29526898 29548988 TRANS FILTER ALLISON            | 1  |
| 404844HOSE AND FITTING                            | 1  |
| 440-33-11/16 VALVE EXT                            | 2  |
| 44530FLASHER ELECTRONIC                           | 1  |
| 546-0200-50QD REL.VALVE KIT                       | 1  |
| 5460990500GASKET SEAL KIT P25/30                  | 1  |
| 5462270020VALVE KIT SS 546-2270-02-0              | 1  |
| 5462300020VALVE KIT SS VALVE 3 IN                 | 1  |
| 715000000501 1/2 IN VALVE SS 715-0000-00-50       | 1  |
| 800405PURGE VALVE KIT                             | 1  |
| 91398907 VALVE KIT 3 IN AKRON                     | 1  |
| 92541676VAC TEST GAUGE 0-30                       | 1  |
| 9440BELT                                          | 1  |
| 9480BELT                                          | 1  |
| AMH-1AMH-1 VALVE EXTENSION                        | 1  |
| ANTICOOLANT ANTIFREEZE GAL                        | 6  |
| 14022-1-5COOLER 14032                             | 1  |
| 15W40BSYN OIL BULK QTS                            | 22 |
| 75W90GEAR OIL SYN QT                              | 4  |
| BATTERY EPA TAXBATTERY EPA TAX \$1.50 PER BATTERY | 4  |
| CA8193AIR FILTER 46744 WIX                        | 1  |
| FG87904MFG3937557S FILTER P/S NEW STYLE           | 1  |
| FGQ79699GASKET-P/S FILTER NEW STYLE               | 1  |
| FS1022FILTER FUEL WIX 33422 PS8689 FRAM           | 1  |
| G3FUEL FILTER 33033                               | 2  |
| HP-31DBATTERY 950CCA HP-31D                       | 4  |
| HPH6349AOIL FILTER 51748                          | 1  |
| K080716BELT                                       | 1  |
| PR338324070 WIX FILTER WATER                      | 1  |
| PVG-KITORING KIT                                  | 2  |
| R90PFILTER FUEL 33231                             | 1  |
| REDG6S14023 GASKET 6 IN                           | 1  |
| RWTG1234LED PRESSURE CAP                          | 6  |
| TRANSYNDALLISON TRANS FLUID GAL                   | 7  |



FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

relief valve found switch was working but light was very dim R&R switch light was bright but do not flash so R&R flasher.

- 24. Adjust magnet switch on relief valve and switch on inlet relief valve fill tank, ran pump and tested inlet relief valve and relief valve worked good but found 2 line leaking R&R fitting and stop leak.
- 25. Assist Jerry S. with valves and relief.
- 26. Q Inspection.
- 27. Reglue man saver on.

Workorder: V49876

06/04/2012 In Date: Meter Reading: 58.330.30

Close Date: 06/07/2012

Problem?

can you please mount a strap in rear compartment of E-21 for k12 and chainsaw to keep them from bouncing around compartment.

Task performed: **Parts** Quantity

MOUNTED 2 SAW TRAYS IN REAR COMPARTMENT OF E21. INSTALLED SAWS IN TRAYS AND

SECURED.

NO PARTS USED

Workorder: V48893

In Date: 04/25/2012 Meter Reading: 57,303.80

Close Date: 06/08/2012

**Problem?** 

FOAM SYSTEM ON E21 NOT WORKING PROPER, FOAM TANK EMTIES IN VERY SHORT TIME

#### Task performed:

- 1. TRAVEL TO 21 FOR FOAM SYSTEM CALIBRATION. FOAM HEAD WILL NOT LET ME CALIBRATE ALL HAVE TO R&R HEAD.
- 2. TRAVEL TO STA 21 INSTALLED AND CALIBRATED FOAM HEAD STILL POTS OUT TO MUCH FOAM.
- 3. REPLACED PANEL SENSOR, PADDLE WHEEL, AND CHECK VALVE CALIPRATED SYSTEM AND TESTED OK.

| Parts                                           | Quantity |
|-------------------------------------------------|----------|
| 168-0380-56-0FM CONTROL UNIT RETROFIT KIT       | 1        |
| 200-2481-00-0546-3240-00-0 FOAM PUMP SENSOR KIT | 1        |
| 200-2491-00SENSOR HALE HPF FOAM FLOW            | 1        |
| 3320-0027CHECK VALVE 1/2 FOAMPRO                | 1        |
| 516-0670-52-0TALL SENSOR GEARS                  | 2        |

Workorder: V50168

06/15/2012 In Date: Meter Reading: 58,686.00

Close Date: 06/25/2012

**Problem?** 

diesel pump gauge not working. B 21

Task performed: **Parts** Quantity

CHECKED GAUGES FOR PUMP MOTOR ALL WORK

NO PROBLEM FOUND.



FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

Workorder: V50242

In Date: 06/19/2012

06/25/2012 Close Date:

Meter Reading:

58,686.00

Problem?

**INSTALL FOG LIGHTS E 21** 

Task performed: **Parts** Quantity TRAVEL TO 21 INSTALL FOG LAMPS AND WIRE. 1

5291FOG LIGHTS

Workorder: V50415

In Date: 06/26/2012

Meter Reading: 58,798.80

**Close Date:** 06/28/2012

**Problem?** 

Bulb for the pump overheat light is out and needs to be replaced. E21

Task performed: **Parts** Quantity

1. TRAVEL TO 21 REPAIRED LOOSE WIRE TO OVER HEAT TEST SWITCH.

LPVM-7LG MOUNT

4

2. TRACED DOWN AND REPAIRED WIRE FOR DOOR

AJAR ALARM

Workorder: V51117

In Date: 07/25/2012 Meter Reading:

08/01/2012

Close Date: **Problem?** 

low voltage reading on engine, alarm goes off when truck started-and continues to show low voltage after trucks been running E2

Task performed: **Parts** Quantity

59,679.80

TRAVEL TO 21 CHECKED SYSTEM FOUND MELTED SHUNT BY PASSED SHUNT OK.

TRAVEL TO 21 REPLACED SHUNT ON FRAME RAIL

AND TESTED SYSTEM OK.

352000037SHUNT 300 AMP

1

Workorder: V51168

In Date: 07/27/2012 Meter Reading: 59,679.80

Close Date: 08/01/2012

Problem?

The green spare hurst hose on Eng 21 has had the outer green coating melted down to the woven hose.

Quantity Task performed: **Parts** TRAVEL TO 21 REPLACED GREEN HURST HOSE AND 180R002HURST HYD. FLUID QT ADDED FLUID TO PUMP. 1 3530016HOSE HURST 16 ORANGE



FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

Workorder: V51897

In Date: 08/27/2012

Close Date: 09/12/2012

**Problem?** 

AIRHORN STICKING

**Meter Reading:** 59,983.20

| ıask | pertormea: |  |
|------|------------|--|
|------|------------|--|

1. CUT WIRE TO AIR HORN TO GET INTO SNAP.
REPLACED FOOT PEDAL IN CAB AND CLEANED

CONNECTIONS AT MODE 2.

2. REPLACED 5 DOOR AJAR SWITCHES IN DOOR OF

TRUCK W/ WIRING HARNESS.

#### Workorder: V51570

In Date: 08/13/2012

09/17/2012

Close Date: 09/17/ Problem? Meter Reading:

Meter Reading:

noticed engine having hard time changing gears and driving rough. checked transmission fluid with engine warm and running and transmission fluid in cold zone. low. noticed fluid leaking under vehicle as well. spoke w/rob. E21

Task performed:

TRVL TO 21 ADED 2 GALL OF ATF AND FOUND LEAK

IS STRIPPED BOLTS IN FILTER HOUSING.

Parts

**Parts** 

52-624SWITCH DOOR

7605-666764-0023 SWITCH FOOT SIREN

Quantity

Quantity 5

1

TRANSYND-GGAL CONTAINER TRANS FLUID

2

Workorder: V52251

In Date: 09/07/2012

Close Date: 09/19/2012

**Problem?** 

left front blinker not blinking. E 21

Task performed:

**Parts** 

Quantity

TRVL TO 21 REPLACED SIGNAL BULB.

NO PARTS USED

Workorder: V52307

In Date: 09/11/2012

Close Date: 09/19/2012

**Problem?** 

quartz light alarm wont shut off. they are lowered all the way and won't turn off.

Meter Reading:

Task performed:

**Parts** 

Quantity

REPLACED SENSOR FOR LIGHT TOWER.



FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

Workorder: V51860

In Date: 08/24/2012

**Close Date:** 09/20/2012

24/2012 Meter Reading:

59,983.20

**Problem?** 

Task performed:

CHECKED VALVE FOR FT SUCHON.

A INSPECTION WITH NEEDED REPAIRS

| Task performed:                                                                                                                                                                                                           | Parts                                                     | Quantity |
|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----------------------------------------------------------|----------|
| 1. A INSPCT                                                                                                                                                                                                               | 35200-YLIGHT MARKER LEDAMBER                              | 1        |
| <ol> <li>2. R&amp;R R/S MID BODY MARKER LT</li> <li>3. REPAIR CIGARETTE PLUG ON SPOTLIGHT IN CAE</li> <li>4. R&amp;R CAB AUX A/C FILTER.</li> <li>5. TANK FILL REPLACE VALVE.</li> <li>6. INTAKE RELIEF VALVE.</li> </ol> | 78R536078R5360M 2PK FILTER AIR COND                       | 1        |
| Workorder: V52598                                                                                                                                                                                                         |                                                           |          |
| In Date: 09/24/2012 Meter Reading: Close Date: 09/27/2012 Problem?                                                                                                                                                        |                                                           |          |
| need larger hose cover so we can pack 1000 ft of 5 inch&                                                                                                                                                                  | or differant configuration of hose bed so it will all fit |          |
| Task performed:                                                                                                                                                                                                           | Parts                                                     | Quantity |
| CONTACTED CAPT HE WAS ABLE TO MAKE HSE                                                                                                                                                                                    |                                                           |          |
| BEDS COVER KIT. AFTER LETTING AIR OUT OF HOSE.                                                                                                                                                                            | NO PARTS USED                                             |          |
| Workorder: V52642                                                                                                                                                                                                         |                                                           |          |
| In Date: 09/26/2012 Meter Reading: Close Date: 10/01/2012 Problem?                                                                                                                                                        |                                                           |          |
| hinge in d/o compartment broken. needs replacing. E 21                                                                                                                                                                    |                                                           |          |
| Task performed:                                                                                                                                                                                                           | Parts                                                     | Quantity |
| TRVL TO 21 REPLACED DOOR HOLD OPEN.                                                                                                                                                                                       | EAA-8350-30UGSS1783UQ STRUT-LIFT                          | <u></u>  |
|                                                                                                                                                                                                                           | EAA-0330-300G3317030Q 31R01-LIF1                          |          |
| Workorder: V52690                                                                                                                                                                                                         |                                                           |          |
| In Date: 09/28/2012 Meter Reading: 60,74 Close Date: 10/16/2012 Problem? 60,74                                                                                                                                            | 7.30                                                      |          |
| Front bumper intake not opening when switch is opened. E                                                                                                                                                                  | E21                                                       |          |

**Parts** 

NO PARTS USED

Quantity



FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

Workorder: V52994

In Date: 10/10/2012 Close Date:

10/16/2012

Meter Reading:

Meter Reading:

61,006.30

**Problem?** 

The front intake pnuematic switch with not open the valve for the front intake. E21

Task performed: **Parts** Quantity

TRAVEL TO 21 REPLACED ALL SWITCH FOR FRONT

SUCHON.

MJTV5 VALVE AIR CONTROL

1

Workorder: V53680

In Date: 11/10/2012

11/14/2012

**Close Date:** Problem?

muffler hanger broken on engine E21

Task performed: **Parts** Quantity

MUFFLER LOOSE HANGER BOLTS PULLED OUT WALLOWED OUT MOUNTING REPAIRED EXHAUST

BRACKET.

NO PARTS USED

Workorder: V54047

In Date: 11/28/2012 Meter Reading:

Close Date: 12/04/2012

**Problem?** 

chainsaw leaks fuel bad when you turn it on its side to the right. whole rear compartment of engine soaked with fuel. taken off engine E21

Task performed:

**Parts** 

Quantity

TRAVEL TO 21 PICKED UP SAW AND DROPPED OFF

SPARE UNIT.

NO PARTS USED

Workorder: V53790

In Date: 11/15/2012

12/06/2012

Meter Reading:

Close Date: Problem?

> The telescope scene lights and pump panel lights do not work. When I opened the panel above the pump panel, it looked like the wires to the lights were cut. E21

Task performed: **Parts** Quantity

CHK FOR COOLANT LEAK- TOPPED OFF SYSTEM TIGHTENED CLAMPS-TEST SYSTEM I FFT

ALA00350-50 EXTENDED LIFE COOLANT GAL

1

ANTIFREEZE AND STATION.



FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

Workorder: V54336

In Date: 12/10/2012 Close Date: 12/26/2012

12/10/2012 **Meter Reading:** 12/26/2012

62,280.00

**Problem?** 

spotlight wont go up or down. and map book light is broken. can we get spot light replaced to a newer/better version. this one seems to always have problems E21

Task performed: Parts Quantity

1. TRAVEL TO 21 REPLACED BROKEN MAP LIGHT.

2. REPLACED CONTROLLER FOR SPOT LIGHT.

620122SPOT LIGHT REMOTE

1

Workorder: V54564

In Date: 12/21/2012

Meter Reading: 62,748.80

Close Date: 12/27/2012

**Problem?** 

Dewalt drill chuck lock is frozen open....not operational E21

Task performed: Parts Quantity

CHECKED DRILL - CLEANED CHUCK AND NO PARTS USED

LUBRICATED.

Workorder: V54736

In Date: 12/31/2012 Meter Reading: 63,019.30

Close Date: 01/02/2013

**Problem?** 

ON CALL PRIMER STICKS E21

Task performed: Parts Quantity

TRAVEL TO STA 21 DIAGNOSE PROBLEM, FOUND STUCK PRIMER VALVE. REPLACED HOUSIMG AND

RE-USED VALVE. TEST (OK) TRAVEL HOME.

NO PARTS USED

Workorder: V54591

In Date: 12/24/2012 Meter Reading: 62,748.80

Close Date: 01/14/2013

Problem? primer inop

Task performed: Parts Quantity

REMOVED AND REPLACED PRIMER. 501-3090-00PRIMER PUMP MOTOR

1



FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

Workorder: V54784

In Date: 01/03/2013 Close Date:

01/16/2013

Meter Reading:

Problem?

relief valve operating VERY slow. E21

| Task perforr | ned:       |                   |        | Parts                                 | Quantity |
|--------------|------------|-------------------|--------|---------------------------------------|----------|
|              |            | ED RELIEF VALVE A | AND    | 0100080010STRAINER                    | 2        |
| TESTED OK    | -          |                   |        | 538-0201-02-0QG RELIEF VALVE COMPLETE | 1        |
|              |            |                   |        | 546126000TPM/QG HALE REPAIR KIT       | 1        |
| Workorder:   | V55158     |                   |        |                                       |          |
| In Date:     | 01/18/2013 | Meter Reading:    | 63,273 | 3.30                                  |          |

**Close Date:** 01/23/2013

Problem? no start

Task performed: **Parts** Quantity

NO START/STARTER/ TROUBLESHOOT STARTER

DEFECTIVE GO BACKC TO SHOP.

**NO PARTS USED** 

Workorder: V55140

In Date: 01/17/2013

01/24/2013 Close Date:

Meter Reading:

63,273.30

63,475.00

**Problem?** 

DeWalt drill battery will not hold a charge any longer. E21

Task performed: **Parts** Quantity

TRAVEL TO 21 DELIVERED BATTERY. NO PARTS USED

Meter Reading:

Workorder: V55432

In Date: 01/31/2013

Close Date: 01/31/2013

Problem?

Mount equipment E-21

Task performed: Quantity **Parts** 

TRAVEL TO 21 MOVED EQUIPMENT AS REQUESTED

BY CREW.



4/27/2021

#### Palm Beach County Fire Rescue **Fleet Maintenance Asset History** 10155548

FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

Workorder: V55416

In Date: 01/30/2013 02/04/2013 Close Date:

**Problem?** 

**B INSPECTION E 21** 

63,475.00 Meter Reading:

| Task performed:                                                    | Parts                                   | Quantity |
|--------------------------------------------------------------------|-----------------------------------------|----------|
| 1. B INSP                                                          | 52-24WIPER BLADES ANCO 24               | 2        |
| 2. TIGHTEN BELTS.                                                  | 78R536078R5360M 2PK FILTER AIR COND     | 1        |
| 3. REOSITION DRIVERS WINDOW WEATHER STRIP AND GLUE TO FRAME.       | FS1022FILTER FUEL WIX 33422 PS8689 FRAM | 1        |
| 4. FREE- UP FROZEN COMPTS FOR BATTERIES AND                        | HPH6349AOIL FILTER 51748                | 1        |
| TRAH LINE CLEAN AND LUBRICATE TRACKS.                              | R90PFILTER FUEL 33231                   | 1        |
| REMOVE CATCH BRACKET. DRILL NEW HOLES AND                          |                                         |          |
| SHIM BACK SIDE FOR CATCH TO WORK.                                  |                                         |          |
| 5. REPLACED WIPER BLADES. 6. DIAGNOSE FOAM PUMP INOP. FREE UP PUMP |                                         |          |
| GEARS AND CALIBRATE FEED BACK PUMP. TEST                           |                                         |          |
| OK.                                                                |                                         |          |
| 7. ADJ AIR HORNS FOR SOUND QUALITY.                                |                                         |          |
| 8. CUT AND GLUED HEADLINER HANGING DOWN.                           |                                         |          |
| 9. REPAIR AIR LEAKS AT VARIOUS FITTINGS.                           |                                         |          |

Workorder: V55847

10. Q. A TRUCK.

In Date: 02/19/2013

Close Date: 02/20/2013

**Problem?** 

pressure relief valve light not coming on. checked bulb, bulb looks good, reinstalled still did not work

Task performed: **Parts** Quantity

64,017.00

TRAVEL TO 21 CHECKED RELIEF VALVE LIGHT

FOUND NO PROBLEM.

NO PARTS USED

Workorder: V55817

In Date: 02/18/2013 Meter Reading: 64,017.00

Meter Reading:

Close Date: 03/04/2013

Problem?

floor compartment stuck closed unable to open

#### Task performed: **Parts** Quantity

- 1. LATCH RUSTED SHUT REMOVED LATCH AND WILL RETURN TOMORROW WITH NEW LATCH.
- 2. TRAVEL TO 21 REPLACED LATCH FOR FLOOR COMPARTMENT.

SOC-64-21-11PADDLE LATCH FLOOR COMPARTMENT FL8



FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

Workorder: V56305

In Date: 03/11/2013 Close Date:

03/11/2013

Meter Reading:

64.424.00

Problem?

ON CALL HURST POWER UNIT 10-7 E 21

Task performed: **Parts** Quantity

NO PARTS USED

WENT TO SHOP FROM 24 PICKED UP SPARE POWER UNIT #10142767- WENT TO 21 SWAPTED

UNIT #10155909 WENT TO 25.

Workorder: V56344

In Date: 03/12/2013

Meter Reading: 64,540.40

Close Date: 03/28/2013

Problem?

manifold for hurst tool does not work. pressure release valve does not work

Task performed: Quantity **Parts** 

59,983.20

MANIFOLD IN FOR REPAIR. NO PARTS USED

Workorder: V51639

In Date: 08/16/2012

Close Date: 04/04/2013

Meter Reading:

**Problem?** 

TRANS LEAKS E 21

#### Task performed:

- 1. CHK E-21 FOUND TWO BOLTS W/ BAD TREADS SO DRAINED OIL OUT OF TRANS. DROPPED VALVE BODY TO GET TO BOLT HOLDS. FOUND TOOL TO DRILL AND TAP BOLT.
- 2. ASSIST JERRY-TRAIN PROPER PROCEDURE IN DRILLING AND INSTALL OF THREAD INSERTS ON TRANS CASE STRIPPED OUT BOLTS ASSIST BREAK DOWN OF VALVE BODY.
- CLEAN UP PARTS.
- 4. PUT VALVE BODY BACK TOGETHER AND IN TRUCK.
- 5.ASSIST JERRY W/ REASSEMBLY OF COMPLETE VALVE BODY-(SUBASSEMBLY)-AND **EXPLAIN PROCEDURE EASIER** INSTALLATION FOR INSTALLATION.
- 6. FINSIH TRANS PAT FLTERS AND TORQ ALL BOLTS FILL W/ FLUID AND TEST DROVE THEN CHK FOR LEAKS.

| Parts                                  | Quantity |
|----------------------------------------|----------|
| 29526898 29548988 TRANS FILTER ALLISON | 1        |
| 29543433SPEED SENSOR                   | 1        |
| 29544784CONTROL MODULE KIT             | 1        |
| 29544785KIT FILTER ASSY                | 1        |
| 29549755OIL LEVEL SENSOR               | 1        |
| 401581GASKET AXLE FL80 R002435         | 2        |
| TRANSYNDALLISON TRANS FLUID GAL        | 7        |



FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

Workorder: V46817

In Date: 01/24/2012 Close Date:

04/05/2013

Meter Reading:

Meter Reading:

65,040.50

56,030.60

Problem?

CAN YOU PLEASE INSTALL A HANDLIGHT CHARGER/HOLDER BETWEEN THE OFFICER SEAT AND THE OFFICER DOOR.

Sta 21

Task performed: **Parts** Quantity

COULD NOT INSTALL NEXT TO SEAT PUT BEHIND SEAT NO ROOM ON SIDE.

NO PARTS USED

Workorder: V47327

In Date: 02/15/2012 Close Date:

04/08/2013

**Problem?** 

Install fog lights. Sta 21

Task performed: **Parts** Quantity

NO PARTS USED

Workorder: V51670

In Date: 08/17/2012

**Close Date:** 

04/10/2013

Meter Reading: 59,983.20

**Problem?** 

A INSPECTION AND ANY NEEDED REPAIRS

Task performed: **Parts** Quantity

**RWTG1234LED PRESSURE CAP** 

2

Workorder: V56873

In Date: 04/07/2013 Meter Reading: 65,072.00

Close Date: 04/11/2013

Problem?

Low beam head lamps not working.

Task performed: **Parts** Quantity

TRAVEL TO 21 REPLACED BOTH LOW BEAM HEAD

LIGHTS.

H6054USE CV TYPE SEALED BEAM

2



FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

Workorder: V57090

In Date: 04/17/2013 Close Date: 04/22/2013

Problem?

Mount equipment E-21

**Meter Reading:** 65,188.90

Task performed: Parts Quantity

TRAVEL TO 21 REMOUNT EQUIPMENT IN L-1 NO PARTS USED

COMPARTMENT.

Workorder: V57196

In Date: 04/22/2013 Meter Reading:

Close Date: 05/01/2013

Problem?

Tic will not charge battery, will charge tic. E-21

Task performed: Parts Quantity

NO PARTS USED

TRAVEL TO 21 ADJUSTED TIC IN CHARGER BASE

OK.

Workorder: V57488

In Date: 05/05/2013 Meter Reading:

Close Date: 05/07/2013

**Problem?** 

Right head light is out, only works in high beam mode. Looked for replacement light bulb in the station and cannot find.

Task performed: Parts Quantity

REPLACED BLOWN HEADLIGHT.

H6054USE CV TYPE SEALED BEAM

1

Workorder: V57536

In Date: 05/07/2013 Meter Reading:

Close Date: 05/20/2013

Problem?

scene lighting both come on after a few minutes both lights go out and wont come on until bulbs cool. E21

Task performed: Parts Quantity

UMVS111611STRAP

1. TRAVEL TO 21 CHECKED ALL LIGHT NO PROBLEM FOUND.

2. INSTALLED HOOKS AND STRAS FOR CABLES AND

HOLES.



FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

Workorder: V58396

06/13/2013 In Date:

07/11/2013 Close Date:

Meter Reading:

66,591.10

**Problem?** 

Booster reel working on and off. E21

| Booster feel working on and oil. E21                                                                                             |                                                                                       |
|----------------------------------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------|
| Task performed:                                                                                                                  | Parts Quantity                                                                        |
| TRAVEL TO 21 BOOSTER REEL SWIVEL RUSTED OUT WILL GET NEW FITTINGS AND REPLACE.                                                   | 531616-SS53-16-16-SS SWIVEL ADPT 1 BD5501516160BD55015-1616-01 SWIVEL 1               |
| Workorder: V58548                                                                                                                |                                                                                       |
| In Date: 06/19/2013 Meter Reading: 66,78 Close Date: 07/25/2013 Problem? 66,78                                                   | 39.00                                                                                 |
| Generator will start w/choke and immediately stall. Ventsa                                                                       | w airfilter/cleaner is broken off unit E21                                            |
| Task performed:                                                                                                                  | Parts Quantity                                                                        |
| WAS REPAIRED BY REGAN TESTED AND SENT BACK TO STATION.                                                                           | NO PARTS USED                                                                         |
| Workorder: V59266                                                                                                                |                                                                                       |
| In Date: 07/22/2013 Meter Reading: 67,55 Close Date: 07/26/2013                                                                  | 56.90                                                                                 |
| Problem? A halogen lightbulb is out in the passenger side scene ligh side causing the possibility of an accidental deployment of | nt. And the clips for the crosslay webbing are broken on the passenger<br>f hose. E21 |
| Task performed:                                                                                                                  | Parts Quantity                                                                        |
| TRAVEL TO 21 REPLACED BLOWN SCENE LIGHT BULB.                                                                                    | NO PARTS USED                                                                         |
| 2. REPLACED CROSS LAY NETS ON BOTH SIDES.                                                                                        |                                                                                       |
| Workorder: V59558                                                                                                                |                                                                                       |
| In Date: 08/05/2013 Meter Reading: 67,89 Close Date: 08/14/2013                                                                  | 99.00                                                                                 |

Close Date: 08/14/2013

Problem?

engine 21 takes a few seconds to start up once turning the key. This morning it did not start up on first try but started on second.

Task performed: **Parts** Quantity

CHECKED FOR HARD START FOUND FUEL LEAK ON RETURN FITTING TOP OF PUMP. SECURED FITTING AND TESTED OK.



FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

Workorder: V59712

In Date: 08/09/2013

Close Date: 08/14/2013

Meter Reading:

67,999.00

**Problem?** 

The lock nut for Discharge #3 at the lever to valve rod is missing. The rod will become free during pump operations. E 21

Task performed: Parts Quantity

CHECKED ROD FOUND NUT MISSING ON ROD END

INSTALLED NUT AND LOCK WASHER OK.

NO PARTS USED

Workorder: V58272

In Date: 06/09/2013 Meter Reading: 66,522.00

Close Date: 08/15/2013

Problem?

DURING HEAVY RAIN, ROOF LEAKING WATER FROM OUTSIDE CAB INTO CAB. NEAR DRIVERS SIDE FRONT. WATER

LEAKING ONTO CENTER CONSOLE. E 21

Task performed: Parts Quantity

1. ROOF SEAM IS RUSTING AWAY AND ALL SILICONE DRYING OUT. CAME TO SHOP FOR SOME 5200 TO RESEAL ROOF.

NO PARTS USED

5200 TO RESEAL ROOF.2. TRAVEL TO 21 CLEANED RUST OFF ROOF AND

Workorder: V59970

RESEALED WITH 5200 ACRMOTEX.

In Date: 08/21/2013 Meter Reading: 68,262.00

Close Date: 08/26/2013

Problem?

MIV on driver side. unable to open or close valve. MIV taken off truck. Tank to pump valve will not completely close allowing water drain from tank onto floor

Task performed: Parts Quantity

TRAVEL TO 21 REPLACED MIV VALVE.

NO PARTS USED

Workorder: V60196

In Date: 08/31/2013 Meter Reading: 68,736.30

Close Date: 09/05/2013

**Problem?** 

electrical shoreline cord for e21 was found damaged and needs to be replaced.

Task performed: Parts Quantity

TRAVEL TO 21 COMPLETE CORD BAD WILL HAVE TO BE REPLACED BY BUILDING MAINTENANCE.



4/27/2021

#### Palm Beach County Fire Rescue **Fleet Maintenance Asset History** 10155548

FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

Workorder: V60220

In Date: 09/02/2013 09/05/2013 Close Date:

**Problem?** 

WONT START E21.

68.736.30 Meter Reading:

Task performed:

WENT ON SCENE D RD AND SOUTHERN **BOULEVARD - FOUND BATTERY CABLE BAD AT BAD** REPAIRED CABLE FOUND TERM. BROKEN AT BATT SWITCH REPLACED TERM. CHECK OK. CHECK CHARGING SYSTEM. CHECK OK. RETURN HOME.

**Parts** Quantity 1 A0631087000CABLE BATT. POS.

Workorder: V60665

In Date: 09/21/2013

Close Date: 09/26/2013

Task performed:

**Problem?** 

roof ladder-pin sheared off of hook. hook flops around E21

Meter Reading:

TRAVEL TO 21 DRIVER COMPLAINT ROOF LADDER

PIV BROKEN. FOUND ROLL PIN FOR ROOF ARM BROKEN REMOVED BROKEN PIN AND INSTALL NEW

PIN OK.

Problem?

Task performed:

NO PARTS USED

**Parts** 

69,139.00

69.139.00

Workorder: V60664

In Date: 09/21/2013

09/27/2013 Close Date:

Meter Reading:

drivers compartment right side door jammed. Will not open. E21

TRAVEL TO ST 21 CHECK OUT DOOR STUCK CLOSED GET DOOR OPEN REMOVE PANELS AND

LATCH RED FELL OFF REPLACE AND ADJUST AND

TIE WRAP LOCKS ON RODS.

NO PARTS USED

**Parts** 

Workorder: V61120

In Date: 10/08/2013 Meter Reading: 69,410.50

10/22/2013 Close Date:

**Problem?** 

unable to charge triptix tablet due to cigarette plug not having any current when the engine is turned off.

Task performed: **Parts** Quantity

INSTALLED POWER PANT IN ENGINE AND WIRED.

56415CIG. LIGHTER ACCES.

2

Quantity

Quantity



4/27/2021

## Palm Beach County Fire Rescue Fleet Maintenance Asset History

FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

Workorder: V61117

In Date: 10/08/2013 Close Date: 10/31/2013

REPLACE LEAKING TERK FITTINGS, REMOVE AND

19. CHECK FOR AIR LEAKS REPLACE BAD QUIRCK CONNECTS TIGHTEN FITTINGS ON AIR TANKS AND

21. FOAM LINES LEAKING CLEAN AND TIGHTEN

22. INSTALL NEW HOSE BED COVER, REPLACE

23. REPLACE ALL PUMP DRAIN O'S RINGS LEAKING

20. R&R PLACARDS, PUT NUMBERS

24. REPLACE CROSSLAY NOZZLE HOLDER.25. TIGHTEN ALL COMP DOOR LATCHEES HOSE.26. ADJUST ALL PUMP DOOR LATCHES LOOSE.

REBUILD TANK TO PUMP VALVE.

BROKEN SWAPS HOLD DOWNS.

GOVERNOR.

WINDSHIELD.

FITTING.

Problem?

C inspection E21

| Meter Reading: | 69,410.50 |
|----------------|-----------|
|----------------|-----------|

| Task performed:                                                        | Parts                                             | Quanti |
|------------------------------------------------------------------------|---------------------------------------------------|--------|
| 1. C INSP.                                                             | 040114003SEAL SVS DRAIN VALVE                     | 8      |
| 2. C INSP.                                                             | 082-2007-00-0GREASE ZERK W/CHECK VLV              | 10     |
| 3. FINISH C INSP.                                                      |                                                   | 1      |
| 4. FORCE OPEN BATTERY AND TRASHLINE SLIDE                              | 107796DRYER KIT AD9 -NEW                          |        |
| OUTS CLEAN AND LUBE SLIDES AND LATCHES,                                | 107800VALVE CHECK AD9                             | 1      |
| REALIGHN.                                                              | 2FC00ZCR4 IN ROUND LED                            | 1      |
| 5. REPLACE REAR TAG LIGHT AND OFFICERS DOOR                            | 546126000TPM/QG HALE REPAIR KIT                   | 1      |
| ENTRY LIGHT.                                                           | 5462270020VALVE KIT SS 546-2270-02-0              | 2      |
| 6. REPLACE BATTERIES. 7. REPLACE REAR REFLECTIONS.                     | 5462280020VALVE KIT 2 IN SS VALVE 546-2280-02-0   | 2      |
| 8. R&R ENGINE AND A/C AIR FILTERS.                                     | 5462300020VALVE KIT SS VALVE 3 IN                 | 1      |
| 9. REPLACE MISSING SHELF MOUNTING BOLTS AND                            | 67BULB 12 VOLT                                    | 4      |
| ADJUST AND TIGHTEN ALL COMP SHELFS AND TOOL                            | 6737200054673-720-00-54 SEAL WINDOW               | 4      |
| HOLDERS.                                                               | 78R536078R5360M 2PK FILTER AIR COND               | 1      |
| 10. SERVICE DRYER.                                                     | 800405PURGE VALVE KIT                             | 1      |
| 11. SERVICE T-CASE.                                                    |                                                   | 2      |
| 12. REBUILD PRIMER VALVE ON PUMP PAVED                                 | 91398907 VALVE KIT 3 IN AKRON                     |        |
| STICKING.                                                              | 98032R 41032-3 RED REFLECTOR OVAL REFLECTOR       | 3      |
| 13. CLEAN AND LUBE ALL FOUR REAR PULL OUT.                             | BATTERY EPA TAXBATTERY EPA TAX \$1.50 PER BATTERY | 4      |
| 14. REPLACE ALL FOUR CAB WINDOW SEALS, WORE DRIED OUT AND FALLING OFF. | CA8193AIR FILTER 46744 WIX                        | 1      |
| 15. START TROUBLESHOOT PUMP, FAILED DRY                                | FS1022FILTER FUEL WIX 33422 PS8689 FRAM           | 1      |
| VACUUM AND PRESSURE INOP, REPLACE CHECK                                | HP-31DBATTERY 950CCA HP-31D                       | 4      |
| VALVE REMOVE RELIEF VALVE.                                             | HPH6349AOIL FILTER 51748                          | 1      |
| 16. REBUILD AND REINSTALL PRESSURE RELIEF                              | PVG-KITORING KIT                                  | 1      |
| VALVE, CROSSLAY VALVES.                                                |                                                   | 1      |
| 17. CONTINUE REBUILD VALVES, RIGHT REAR                                | R90PFILTER FUEL 33231                             | •      |
| DISCHARGE, DECK GUN.                                                   | S775COUPLER                                       | 2      |
| 18. REMOVE REBUILD PRESSURE RELIEF VLAVE                               | S777COUPLING NIPPLE                               | 2      |



FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

Workorder: V59898

In Date: 08/19/2013

11/04/2013 Close Date:

Meter Reading:

**Problem?** 

Dduring pump testing found tank to pump valve to be leaking during dry vac test. Also, discharge 1 and 3 are leaking. E21

| Task performed:                                                                                               | Parts                                            | Quantity |
|---------------------------------------------------------------------------------------------------------------|--------------------------------------------------|----------|
| TRAVEL TO 21 DEIVER COMPLAINT #1 AND #3                                                                       | 5462270020VALVE KIT SS 546-2270-02-0             | 2        |
| DISCHARGE VALVES COOLING REBUILT 1 AND 3 AND ALSO HOSE REEL VALVE. TANK TO PUMP AND TANK FILL ALSO NEED DONE. | 5462280020VALVE KIT 2 IN SS VALVE 546-2280-02-0  | 2        |
|                                                                                                               | 5462290020VALVE KIT SS VALVE 2 1/2 546-2290-02-0 | 4        |
| W. I. I. V64400                                                                                               |                                                  |          |

Workorder: V61433

In Date: 10/22/2013 Meter Reading:

Close Date: 11/04/2013

Problem?

just got engine back from pm. need hot plug installed for triptix and new windshield wiper blades. also driver cab door inside pane coming off. E21

| Task performed:                                         | Parts                     | Quantity |
|---------------------------------------------------------|---------------------------|----------|
| 1. TRAVEL TO 21 DRIVER COMPLAINT NO POSITIVE            | 52-24WIPER BLADES ANCO 24 | 2        |
| PLUG FOR TRIP TIX INSTALLED HOTPOINT.                   | A1834388002MOLD L/H       | 2        |
| 2. DRIVER COMPLAINT WIPER BLADES 10-7 R&R WIPER BLADES. | A1834388003MOLD R/H       | 2        |

Workorder: V61710

In Date: 11/01/2013 69,734.00 Meter Reading:

**Close Date:** 12/04/2013

**Problem?** 

the air hose fitting used to fill the tires is broken

| Task performed:                                                                                       | Parts                | Quantity |
|-------------------------------------------------------------------------------------------------------|----------------------|----------|
| DRIVER COMPLAINT HOSE BROKEN PICKED UP HOSE FOR REPAIR.     TRAVEL TO 21 REPAIRED END ON AIR HOSE FOR | 601601 MALE HOSE END | 1        |
| TIRE FILL.                                                                                            |                      |          |



FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

Workorder: V61725

In Date: 11/02/2013

Close Date: 12/04/2013

Meter Reading:

69,734.00

**Problem?** 

on board foam system not working, foam system flushed and still running intermittently, flashing low sp reading, E21

Task performed: Parts Quantity

TRAVEL TO 21 OPERATED FOAM SYSTEM FOUND LOW SP CODE MEANS LOW VOLTAGE. CHECKED SYSTEM 14. VOLTS EVERY WHERE NEEDS NEW COMPUTER.

2002501500DISTRIBUTION BOX

1

Workorder: V62947

In Date: 12/26/2013 Close Date: 12/26/2013

12/26/2013 Meter Reading: 12/26/2013

71,143.00

**Problem?** 

check foam system

Task performed: Parts Quantity

TRAVEL TO 21 DRIVER COMPLAINT FOAM SYSTEM INOP INSTALLED FOAM COMPUTER AND

CALIBRATED SYSTEM OK.

NO PARTS USED

Workorder: V62799

In Date: 12/18/2013 Meter Reading:

Close Date: 12/31/2013

Problem?

1 air tank leaks down quickley E21

Task performed: Parts Quantity

CHECK FOR LEAKS NONE FOUND.

2. CHECK A/C HOT PER DRIVER CHECK A/C HEATER VALVE STUCK ON ADJUST VALVE TEST OK.

NO PARTS USED

Workorder: V63059

In Date: 01/02/2014 Meter Reading: 71,235.00

Close Date: 01/02/2014

Problem?

check electrical problem E21

Task performed: Parts Quantity

WENT TO 21 FROM 73- CHK DASH-CHK- REMOVED DASH- UNPLUGGED AND PLUGGED IN- WIGGLED WIRES- CHK OK. INSTALLED DASH- CHK OK-RETURN HOME.



FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

Workorder: V63184

01/06/2014 In Date: Close Date:

01/09/2014

Meter Reading:

**Problem?** 

spot light mounting bracket broke / spot light is dangling by connection wire T21

| Task performed:                                                                              | Parts                                                  | Quantity |
|----------------------------------------------------------------------------------------------|--------------------------------------------------------|----------|
| TRAVEL TO 21 DRIVER COMPLAINT SPOT LIGHT BROKEN REPLACED SPOT LIGHT.                         | 50R03ZCRLIGHT LED RED TIR 6<br>620122SPOT LIGHT REMOTE | 1 1      |
| Workorder: V63195                                                                            |                                                        |          |
| In Date: 01/07/2014 Meter Reading: Close Date: 01/09/2014 Problem?                           |                                                        |          |
| warnng light bar not working, spot light, telescoping scene                                  | e lights and pump panel lights not working.            |          |
| Task performed:                                                                              | Parts                                                  | Quantity |
| DRIVER COMPLAINT OF MANY LIGHTS OUT CHECKED SYSTEM ALL OK REPLACED ONE SIDE EMERGENCY LIGHT. | NO PARTS USED                                          |          |
| Workorder: V63091                                                                            |                                                        |          |
| In Date: 01/02/2014 Meter Reading: Close Date: 01/16/2014 Problem?                           |                                                        |          |
| air tank leaks down very fast Bottom gauge in panel E21                                      |                                                        |          |
| Task performed:                                                                              | Parts                                                  | Quantity |
| DRIVER COMPLAINT AIR LEAKS DOWN. CHECKED TRUCK REPAIRED ALL LEAKS AT PANEL AND               | 5460370530VPS SHIFT KIT 546-0370-53-0                  | 1        |

Workorder: V63613

01/22/2014 In Date: Meter Reading: 71,676.00

01/23/2014 Close Date:

**Problem?** 

blower pull cord broken or motor froze up. on floor in bay-tagged. no asset number to enter under equipment instead of vehicle.

E21

Task performed: Quantity **Parts** 

PICKED UP BLOWER FOR REPAIR. NO PARTS USED



FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

Workorder: V63632

In Date: 01/23/2014

01/23/2014 Close Date:

Problem? air leak

71,676.00 Meter Reading:

Task performed: **Parts** Quantity

TRAVEL TO 21 DRIVER COMPLAINT AIR LEAK.

Meter Reading:

REPAIRED LEAK AT VALVE ON AIR TANK.

NO PARTS USED

Workorder: V63360

In Date: 01/14/2014

Close Date: 01/31/2014

Problem?

emergency light bar on cab roof- warning lights still out. driver side rear window frame broken-glass ready to break. E21

Task performed: **Parts** Quantity 1 6807200253GUIDE METAL

1. DRIVER COMPLAINT LIGHTS OUT ON LIGHT BAR CHECKED LIGHT BAR ALL OK.

2. TRAVEL TO 21 DRIVER COMPLAINT REAR WINDO LOOSE REPLACED REAR WINDOW TRACK AND MOLDING LUBRICATED LINKAGE OK.

6809870055SEAL CAB WINDOW

1 A1834388002MOLD L/H

1

Workorder: V63754

In Date: 01/27/2014 Meter Reading:

Close Date: 02/11/2014

**Problem?** 

generator is leaking fuel from under the gas tank. 10155570.

Task performed: **Parts** Quantity

TRAVEL TO 21 DRIVER COMPLAINT FUEL LEAK FROM GENERATOR. REPLACED FUEL HOSE FROM

TANK TO CARB.

NO PARTS USED

Workorder: V64106

In Date: 02/10/2014 Meter Reading:

Close Date: 03/03/2014

**Problem?** 

passed on from off going shift the spotlight over cab has bad connection light off/on

Task performed: **Parts** Quantity

REPAIRED ON V64503. NO PARTS USED



FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

Workorder: V64503

In Date: 02/24/2014 Close Date:

03/03/2014

Meter Reading:

**Problem?** 

spot light on top of engine works intermitently, goes on and off while driving down road E21

Task performed: **Parts** Quantity

**ROOF SPOT INOP** INTERMITTENT, **POOR** CONNECTION @GROUND REPAIRED WIRING FOR

ROF MOUNTED SPOT LIGHT.

NO PARTS USED

Workorder: V64566

In Date: 02/27/2014 Meter Reading: 72,335.00

Close Date: 03/05/2014

Problem?

Flat repair E21 Boulevard Tire

Task performed: **Parts** Quantity

FLAT REPAIR E21 BOULEVARD TIRE. NO PARTS USED

Vendor?: BOULEVARD TIRE

Workorder: V64246

In Date: 02/15/2014 Meter Reading:

Close Date: 03/10/2014

Problem?

generator taken off truck, fuel dripping all over compartment, either broken gas line or crack in fuel tank, generator in bay on floor and gas drained from tank. E21

Task performed: **Parts** Quantity

HARD WIRE TRIP TIX SERVICED TRIP TIX

H3LIGHT BULB BP1255/H3 H

2

Workorder: V60072

In Date: 08/21/2013 Meter Reading: 68,378.20

**Close Date:** 03/19/2014

Problem?

CHARGER.

ENGINE 21- FAILED DRY VACUUM TEST-TANK TO PUMP VALVE LEAKING.

Task performed: **Parts** Quantity

REPAIRED ON W.O #60072. BY BILL HINES. NO PARTS USED



FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

Workorder: V63442

In Date: 01/16/2014 Close Date:

03/19/2014

Meter Reading:

Meter Reading:

**Problem?** 

Front tire(s) are past their expiration dates. Manufactured on (1306)

| Task performed:                        | Parts                        | Quantity |
|----------------------------------------|------------------------------|----------|
| TIRES REPLACED ON W.O 64345 ON OUTSIDE | 575BACKUP ALARM ECCO 107 DEC | 1        |
| INSPECTION.                            | RBKT1MTG BRACKET             | 4        |

Workorder: V64947

In Date: 03/15/2014

Close Date: 03/19/2014

**Problem?** 

Chain Saw won't start E21

**Parts** Task performed: Quantity

NO PARTS USED

1. ENG OUT AT THIS TIME, CHECK BAY IN A/M STOP BACK ON TUESDAY MORNING.

2. CHECK OUT CHAINSAW, ADD FUEL, CHECK AND ADJUST CARB. RUNNING AK AT THIS TIME INSTALLED BACK ON TRUCK.

Workorder: V65254

03/27/2014 In Date: Meter Reading:

Close Date: 03/31/2014

Problem?

roof spot light cover missing, not operating

Task performed: **Parts** Quantity

DRIVER COMPLAINT SPOT LIGHT COVER MISSING

REPLACED COVER.

NO PARTS USED

Workorder: V65621

04/10/2014 In Date: Meter Reading: 73,426.00

Close Date: 04/15/2014

Problem?

replace 4 rear tires

Task performed: **Parts** Quantity

REPLACE 4 REAR TIRES. NO PARTS USED

Vendor?: BOULEVARD TIRE



FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

Workorder: V65195

In Date: 03/25/2014

Close Date: 04/21/2014

air leak in the auxiliary tank/system

Task performed: Parts

TRAVEL TO 21 DRIVER COMPLAINT AIR LEAK. CHECKED FOR LEAKS FOUND CAB AIR BAGS LEAK

Meter Reading:

ORDERED PARTS.

Workorder: V65239

In Date: 03/26/2014 Meter Reading:

Close Date: 04/21/2014

**Problem?** 

**Problem?** 

spot light on top of engine front light bar is completely broken, needs to be replaced asap, thanks

Task performed: Parts Quantity

NO PARTS USED

DRIVER COMPLAINT SPOT LIGHT INOP REPLACED

LOOSE CONNECTION AT SWITCH.

620122SPOT LIGHT REMOTE

1

Quantity

Workorder: V65253

In Date: 03/27/2014

Close Date: 04/21/2014

Problem?

air tank leaks down quickley on bottom gauge

Task performed: Parts Quantity

REPAIRED AT SHOP. LML-1102-0023CAB AIR BAG IS4007 2

Workorder: V65721

In Date: 04/15/2014 Meter Reading:

Close Date: 05/02/2014

**Problem?** 

air tank leaking down in 1 hour. only 1 of the 2 air tanks are leaking E21

Meter Reading:

Task performed: Parts Quantity

1. DRIVE TO ST-21 CHECK FOR AIR LEAKS FOUND NEEDS CAB AIR BAGS REMOVE LINE TO BAG WHILE BAGS GET FINISHED.

2. REPLACED CAB AIR BAGS.

NO PARTS USED



FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

Workorder: V66234

In Date: 05/05/2014

05/05/2014 Close Date:

**Problem?** 

hurst tool no start

**Parts** 

74,076.00

PICK UP SPARE UNIT AT SHOP TO REPLACE OTHER

Meter Reading:

UNIT. NO START.

Task performed:

NO PARTS USED

Workorder: V66725

In Date: 05/24/2014 Meter Reading:

Close Date: 06/10/2014

**Problem?** 

left headlight out, works on high beam only E21

**Parts** Quantity Task performed:

Travel to 21 Driver complaint headlight out replaced

headlight

H6054USE CV TYPE SEALED BEAM

1

1

Quantity

V66930 Workorder:

In Date: 06/02/2014 Meter Reading:

**Close Date:** 06/17/2014

Problem?

pressure relief valve is not working properly, unable to properly set.

Task performed: **Parts** Quantity

travel to sta,21 driver complant relief value inop replaced

filter in pump and ran pump working ok.

2 0100080010STRAINER

Workorder: V67177

In Date: 06/13/2014 Meter Reading:

Close Date: 06/18/2014

Problem?

Generator's plastic dipstick is cross threaded and needs to be replaced.

Task performed: Quantity **Parts** 

TRAVEL TO 21 REPLACED GENERATOR DIP STICK.

EG-3500OIL CAP HONDA



FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

Workorder: V67719

In Date: 07/07/2014 07/09/2014 Close Date:

**Problem?** 

fuel shut off-leaking

Meter Reading: 75,582.40

| Task performed:                                                            | Parts                          | Quantity |
|----------------------------------------------------------------------------|--------------------------------|----------|
| Checked out ram fan and carb is leaking. Rebuild fuel                      | 16957-ZE1-812HONDA FUEL GROMET | 1        |
| shut off and cleaned out carborator. Replaced foot on unit and air filter. | 30-802AIR FILTER 17210-ZE1-505 | 1        |
| unit and all liller.                                                       | FZ51368FEET RUBBER RAM-FAN     | 1        |

Workorder: V68623

In Date: 08/12/2014 Meter Reading: 75,900.00

Close Date: 09/09/2014

**Problem?** 

B inspection SE11

| Task performed:                                                                                        | Parts                                   | Quantity |
|--------------------------------------------------------------------------------------------------------|-----------------------------------------|----------|
| 1. B insp.                                                                                             | 78R536078R5360M 2PK FILTER AIR COND     | 1        |
| <ol> <li>front intake valve inop, replace air valve</li> <li>replace cab a/c filter red dot</li> </ol> | FS1022FILTER FUEL WIX 33422 PS8689 FRAM | 1        |
| 4. I/side flood lite inop, remove lite assy, repair broken                                             | HPH6349AOIL FILTER 51748                | 1        |
| wires in tube, replace 1 burnt out bulb                                                                | LB-D30BULB QUARTZ HAL. 12V 150W         | 1        |
|                                                                                                        | MJTV5 VALVE AIR CONTROL                 | 1        |
|                                                                                                        | R90PFILTER FUEL 33231                   | 1        |

Workorder: V69091

In Date: 09/01/2014 Meter Reading: 75,900.00

Close Date: 09/15/2014

Problem?

Discharge # 4 bleeder leaks. May be cause of vacuum drop during pump testing @Training

#### Task performed: Quantity **Parts**

- 1. Unit bad in yard. Jump start and check battery low. Run unit aultinator charging 14.v battery.
- 2. Check pump vaccum #4 discharge bleeder valve leaking. Remove bleeder valve. O-ring missing. Clean valve, install new o-ring. Test vaccum. Pressure held to 22hg fell off to 17hg but pass test in time allowed

NO PARTS USED



FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

Workorder: V69882

In Date: 10/03/2014 Close Date: 11/03/2014

**Problem?** 

check engine light

**Meter Reading:** 764,570.00

#### Task performed:

- 1. Remove exhaust manifold , found out was the wrong one after it was installed
- 2. Work on exhaust repair, install new manifold and gaskets. Test for operation, found turbo hose leaking.
- 3. Work on turbo hose leak , test for operation it's good now also install missing fuel line holders and bracket bolts.
- 4. Check for engine light on found code to TPS needs a new one
- 5. Work on code for throttle pedal, found broken exhaust manifold. Remove manifold, turbo, turbo pipe and clean up engine head.
- 6. Clean up turbo and down pipe and all accesories
- 7. Rusted exhuast manifold and gaskets, found out it's the wrong manifold when try to install trubo needs to be remove again.

| Parts                           | Quantity |
|---------------------------------|----------|
| 38188233818823 CAPSCREWS        | 4        |
| 3818824TURBO NUT                | 8        |
| 39013563901356 EXH.GASKET       | 1        |
| 3922794SEAL O RING              | 2        |
| 3937477MANIFOLD EXHAUST         | 1        |
| 39374795269779 EXHAUST GASKET C | 18       |
| 3943841EXHAUST MANIFOLD         | 1        |
| 3944593EXH. MAN. BOLT           | 24       |
| 5264569DRAIN GASKET 3937706     | 2        |
| FRT V68040FREIGHT CHARGE        | 1        |
| MISC PARTMISC PART              | 1        |
| WIL-131973TPS SENSOR            | 1        |
|                                 |          |

Workorder: V69521

In Date: 09/19/2014 Meter Reading:

Close Date: 12/23/2014

**Problem?** 

Chainsaw 10151971 leaking fuel below carb. @19

 Task performed:
 Parts
 Quantity

 Repaired by Regan.
 NO PARTS USED

Workorder: V69522

In Date: 09/19/2014 Meter Reading:

Close Date: 12/23/2014

Problem?

Hurst unit 10155943 and generator 10155567 need servicing for running rough at idle and stalling out if not run in choke. @19

Task performed:

Parts \_\_\_\_\_ Quantity

Repaired by Regan.

NO PARTS USED



FL80 FIRE DEPARTMENT PUMPER NFPA COMPLIANT

Workorder: V74683

In Date: 04/15/2015 Meter Reading:

Close Date: 05/05/2015

**Problem?** 

Shoreline charger does not work. Red flasher on Officer's side front missing screw, moves around and rubber grommet is falling

off.

Task performed: Parts Quantity

completed in asset works

NO PARTS USED



Asset: (10155548) 2004 - FERRARA FL80 1250 Gpm Pumper

10155548

CSHOP-2015-1286

Comments: ON CALL MAJOR AIR LEAK E51 BOOSTER LINE SWIVEL LOCKED

Date Opened: 6-22-2015 Date Finished 6-22-2015 Meter 1 Reading: 77,328

TASKS PERFORMED Q PARTS

AIR SYSTEM 1 9IP; 29552377 VALVE ASSY.ACCUM

1 GOVERNOR; GOVERNOR D-2

2 HORN; KIT-AIR HORN-GROVER

3 9IP; SPRK PLUG BLOWER

CSHOP-2015-2224

Comments: SPARE AT E41 SHOREINE INDICATING LIGHTS NOT WORKING. NOT SURE IF ACTUALLY WORKING OPEN/CLOSE

HANDLE FOR DRIVERS SIDE 3" INTAKE IS MISSING

Date Opened: 8-10-2015 Date Finished 10-1-2015 Meter 1 Reading: 79,154

TASKS PERFORMED NO PARTS USED

FIRE APPARATUS

CSHOP-2015-264

Comments: SPARE ENGINE AT 39 HOSE REEL ELBO RUSTED AND POPPED OFF AT REEL

Date Opened: 4-24-2015 Date Finished 5-20-2015 Meter 1 Reading: 77,128

TASKS PERFORMED Q PARTS

TRAVEL TO BE CHARGED TO WORK ORDER

FIRE PUMP PLUMBING

1 SWIVEL; BD55015-1616-01 SWIVEL

CSHOP-2015-2677

Date Opened: 9-2-2015 Date Finished 9-2-2015 Meter 1 Reading: 79,132

TASKS PERFORMED NO PARTS USED

A INSPECTION

CSHOP-2015-2679

Comments: PLUMBING INTAKE HANDLE

Date Opened: 9-2-2015 Date Finished 9-15-2015 Meter 1 Reading: 79,132

INTAKE HANDLE

TASKS PERFORMED NO PARTS USED

FIRE PUMP

#### CSHOP-2015-3060

Comments: **C-INSPECTION** 

> Date Opened: 9-24-2015 Date Finished 9-25-2015 Meter 1 Reading: 79,154 Q

**TASKS PERFORMED** 

PM SERVICE C 1 FILTER; FILTER FUEL 33231

> 1 FILTER; FILTER FUEL WIX 33422 PS8689 FRAM

1 FILTER; 24070 WIX FILTER WATER

FILTER; OIL FILTER 51748

**PARTS** 

#### CSHOP-2015-3234

Comments: REPAIRS FROM PM

> Date Opened: 10-5-2015 Date Finished 10-28-2015 79,224 Meter 1 Reading:

#### **TASKS PERFORMED** Q **PARTS** FOAM SYSTEM 3 VALVE; GREASE ZERK W/CHECK VLV FIRE PUMP PLUMBING 2 PUMP; SC5025 SUCTION SCREEN PUMP PANEL CHAIN; BEADED CHAIN W/CONN 12 7 HOSE REEL 1 KNOB; KNOB DRAIN HOSE BED BODY 2 CAMERA; SCREEN 6 IN DOOR PROP CYLINDER 1 SWIVEL; BD55015-1616-01 SWIVEL WIPER BLADES 2 STRUT; GSS1783UQ STRUT-LIFT **COOLING SYSTEM** 1 SWITCH: SWITCH SWT5499 MED MASTER PARK-CLEARANCE LIGHTS 2 WIPER; WIPER BLADES ANCO 24 **BATTERY TRAY** 2 HOSE; HOSE LOWER RADIATOR TRANSFER CASE 1 CAP; CAP RADIATOR 10 LB **HOSES-LINES & FITTINGS** 1 LIGHT; LIGHT MARKER LEDAMBER **TRANSMISSION** 1 LIGHT; LIGHT MARKER LED RED DIFFERENTIAL 2 LIGHT; LIGHT MARKER LED RED **ROTATE TIRES** 1 9IP; PLUG DRAIN REAR END FREIGHTLINER LIGHT BAR 8 FLUID; COOLANT ANTIFREEZE GAL STROBE LIGHTS 1 **NEWPART; HOSE & FITTINGS** INTERIOR TRIM-MOLDINGS-UPHOLS 8 FLUID; ALLISON TRANS FLUID GAL **HEAD LINER** FLUID: ALLISON TRANS FLUID GAL 4 CAB-INTERIOR ACCESSORIES 1 LIGHT; LIGHT LED RED TIR 6 HEATING AND VENTILATION LIGHT; LIGHT LED RED TIR 6 A/C FILTER SCREENS 9IP; MOLD R/H AIR CONDITIONING WINDOW; MOLD L/H LIGHT: LIGHT LED RED TIR 6 LIGHT; LIGHT LED RED TIR 6 VENT; 18-2640 VENT A/C NEW # 1719 9IP; DASH VENT FILTER; 78R5360M 2PK FILTER AIR COND 1 1 VENT; 18-2640 VENT A/C NEW # 1719 VENT: 18-2640 VENT A/C NEW # 1719

#### CSHOP-2015-368

SPARE ENGINE AT 39 NEEDS SHORELINE FIXED ASAP. Comments:

> Date Opened: 4-30-2015 Date Finished 4-30-2015 77,028 Meter 1 Reading:

**TASKS PERFORMED** Q **PARTS** 

**ELECTRICAL OUTLETS 110 VOLT** 

9IP; HINGE PILLAR RESCUE **BODY EXTERIOR** 

CSHOP-2015-4542

Comments: CHANGE BATTERIES ON SE11

Date Opened: 12-18-2015 Date Finished 12-18-2015 Meter 1 Reading: 79,229

TASKS PERFORMED Q PARTS

BATTERY 4 BATTERY; BATTERY EPA TAX \$1.50 PER BATTERY

4 BATTERY; BATTERY 950CCA HP-31D

CSHOP-2015-576

Comments: SPARE ENIGINE AT 55 MISSING LEFT INTAKE HANDLE.

Date Opened: 5-11-2015 Date Finished 6-22-2015 Meter 1 Reading: 77,228

TASKS PERFORMED Q PARTS

TRAVEL TO BE CHARGED TO WORK ORDER

FIRE PUMP PLUMBING
FIRE PUMP
FIRE APPARATUS

1 VALVE; 2.5 VLV W SS BALL
9IP; 8920 VALVE ASSY. 2IN
VALVE; 2.5 VLV W SS BALL
1 VALVE; 2.5 VLV W SS BALL

DIAGNOSE ELECTRICAL

1 VALVE; 2.5 VLV W SS BALL

1 9IP; REMOTE HANDLE

AIR CONDITIONING

1 ALTERNATOR; 320 UPGRADE ALTERNATOR

CSHOP-2016-1369

Comments: SPARE ENGINE 11 HEADLIGHT OUT

Date Opened: 3-22-2016 Date Finished 3-29-2016 Meter 1 Reading: 81,249

TASKS PERFORMED Q PARTS

LIGHTING SYSTEM

1 LIGHT; HEADLIGHT EXTRA BRIGHT

CSHOP-2016-1935

Comments: SPARE ENGINE AT ST 36

Date Opened: 4-25-2016 Date Finished 6-29-2016 Meter 1 Reading: 83,314

TASKS PERFORMED Q PARTS

TRAVEL TO BE CHARGED TO WORK ORDER 1 SWITCH; NC SW PARK BK SPADE TYPE CONNECTOR

Service Requests: 04/24/2016

ervice Requests:

05/12/2016 LIGHTS / 18: LEAKING / REPAIR

BRAKES / 18: LEAKING / D AIR LEAK ON BRAKES. VERY LOUD.

-OIC SCENE LIGHT NEEDS A QUARTZ BULB -MISSING INTAKE SCREENS ON THE LEFT (D/O) AND RIGHT (OIC) 3"

INTAKES. -I SAW THAT THERE WAS A PREVIOUS ISSUE WITH MIV. I EXERCISED VALVE AND WAS ABLE TO CLOSE.

05/12/2016 ENGINE / 19: LOOSE / REPAIR

TOP ACCESS DOOR TO THE WATER TANK IS MISSING THE DEBRIS SCREEN

05/12/2016 ENGINE / 19: LOOSE / REPAIR

WHEN PLUGGING THE SHORE LINE IN THE CHARGING PORT. THE LIGHT INDICATOR IS NOT WORKING. NOT SURE IF

IT IS CHARGING.

CSHOP-2016-2344

Comments: E36

Date Opened: 5-16-2016 Date Finished 5-25-2016 Meter 1 Reading: 82,091

TASKS PERFORMED NO PARTS USED

WINDSHIELD

**Service Requests:** 

05/15/2016 W/S WIPER / 19: LOOSE / OVERHAUL

WIND WASHER LINE OOS. FITTINGS THAT CONNECT LINES ARE BROKEN/ DRY ROTTED

CSHOP-2016-2400

Comments: SE AT ST36

Date Opened: 5-18-2016 Date Finished 5-29-2016 Meter 1 Reading: 82,871

TASKS PERFORMED NO PARTS USED

LIGHTING SYSTEM TIRES & WHEELS AIR CONDITIONING

Service Requests:

05/18/2016 A/C / 19: LOOSE / ZX

FRONT A/C WORKS INTERMITTENT

05/18/2016 TIRES / 19: LOOSE / Q

FR (FRONT OIC SIDE) TIRE HAS A QUESTIONABLE GOUGE THAT MAY LEAD TO TIRE SEPARATION IN THE FUTURE.

05/18/2016 LIGHTS / 18: LEAKING / Z

SPOT LIGHT NOT WORKING CORRECTLY LEFT AND RIGHT WORKS AND UP AND DOWN DOES NOT WORK

CSHOP-2016-2579

Comments: DELIVERED OIL CAP TO STATION

TASKS PERFORMED Q PARTS

FIRE FIGHTING EQUIPMENT

AIR SYSTEM

AIR CONDITIONING

1 9IP; K1200 BELT

CAP; OIL CAP HONDA

A/C; FREON LB

CSHOP-2016-2835

Comments: SE AT 34, SHORE CHARGER INOP

Date Opened: 6-13-2016 Date Finished 6-14-2016 Meter 1 Reading: 82,871

TASKS PERFORMED Q PARTS

CHARGING SYSTEM 1 CHARGER; CHARGER 2000

**Service Requests:** 

06/13/2016 SERVICE REQUEST / 12: BROKEN / EXCHANGE - NEW

SHORT LINE BATTERY CHARGER IS NOT WORKING

CSHOP-2016-2878

Comments: **SPARE ENGINE AT ST34** 

> Date Opened: 6-16-2016 Date Finished 6-22-2016 Meter 1 Reading: 83,211

**TASKS PERFORMED** 

**NO PARTS USED** 

WAIT TIME TO BE CHARGED TO WORK ORDER TRAVEL TO BE CHARGED TO WORK ORDER AIR CONDITIONING

**Service Requests:** 

A/C / 19: LOOSE / REPAIR 06/16/2016

FRONT A/C QUIT BLOWING IN SPARE ENGINE. REAR A/C IS STILL BLOWING COLD TO COOL ENGINE.

CSHOP-2016-3434

Date Opened: 7-18-2016 Date Finished 7-18-2016 Meter 1 Reading: 83,803

**TASKS PERFORMED NO PARTS USED** 

**FRONT TIRES** 

DAN CALLAGHAN ENTERPRISES **VENDOR?** 

CSHOP-2016-3785

REPAIRS FROM PM Comments:

> Date Opened: 8-4-2016 10-17-2016 Date Finished 85,212 Meter 1 Reading: Q

> > 2

2

2

1

8

**TASKS PERFORMED** 

TRAVEL TO BE CHARGED TO WORK ORDER

FIRE PUMP CONTROLS FIRE PUMP PLUMBING

FIRE PUMP

COOLING SYSTEM LIGHTING SYSTEM

**FLUID** 

TIRES & WHEELS

DOOR HANDLES INSIDE-OUTSIDE

9IP; PLUG RAD. DRAIN **REAR TIRES** 

**CUMMINS: 4940575 HEAD CORROSION RESISTER** 

PUMP; SC5025 SUCTION SCREEN

VALVE: GREASE ZERK W/CHECK VLV

9IP; 4940547 SHAFT SHUT-OFF VALVE

FLUID; COOLANT ANTIFREEZE GAL

9IP: SCREW SHUTOFF VALVE

9IP; GASKET 2 1/2""

ORING: ORING KIT

9IP; SHAFT SHUT-OFF VALVE

9IP; O-RING SHUT-OFF VALVE

1 9IP; GASKET 4942874

**PARTS** 

2 9IP: O-RING WATER SHUT OFF

HANDLE; HANDLE-WINDOW

**Service Requests:** 

LIGHTS / 44: WORN...NORMAL WEAR / BULB WAS REPLACED 08/01/2016

OFFICER SIDE TELESCOPING LIGHT BULB IS OUT (1 OF 2). PUMP HOT LIGHT OUT ON PUMP PANEL

08/04/2016 TIRES / 44: WORN / EXCHANGE - NEW

DRIVER SIDE FRONT HAS LOW TREAD NEEDS REPLACING SOON

CSHOP-2016-4062

Date Opened: 8-17-2016 Date Finished 8-17-2016 Meter 1 Reading: 85,039

TASKS PERFORMED NO PARTS USED

QUARTZ LIGHT LIGHTING SYSTEM AIR CONDITIONING

**Service Requests:** 

08/14/2016 A/C / 19: LOOSE / S

AIR CONDITION WORKS INTERMITTENTLY. TURNS ON AND OFF ON ITS OWN.

08/15/2016 LIGHTS / 19: LOOSE / Z

RIGHT SCENE LIGHT PARTIALLY BURNT OUT. TWO-THIRDS OUT.

08/15/2016 LIGHTS / 18: LEAKING / XS

RIGHT SCENE LIGHT PARTIALLY, TWO-THIRDS, BURNT OUT.

CSHOP-2016-4138

Date Opened: 8-22-2016 Date Finished 8-22-2016 Meter 1 Reading: 85,687

TASKS PERFORMED NO PARTS USED

**FRONT TIRES** 

**VENDOR?** DAN CALLAGHAN ENTERPRISES

CSHOP-2016-4386

Comments: SE11 C INSPECTION BY H2

Date Opened: 9-8-2016 Date Finished 9-20-2016 Meter 1 Reading: 85,700

TASKS PERFORMED Q PARTS

PM SERVICE C 1 FILTER; FILTER FUEL WIX 33422 PS8689 FRAM

1 FILTER; FILTER FUEL 33231

1 FILTER; 24070 WIX FILTER WATER

1 FILTER; OIL FILTER 51748

26 FLUID; SYN OIL BULK QTS

1 FILTER; AIR FILTER 46744 WIX

**VENDOR?** H2 FIRE SERVICES

#### CSHOP-2016-4925

Comments: A INSPECTION

> Date Opened: 10-17-2016 Date Finished 10-18-2016 Meter 1 Reading: 85,696

#### **TASKS PERFORMED**

A INSPECTION

GROUND LIGHT BODY

**PUMP PANEL** 

DOOR PROP CYLINDER

DOOR LATCH

**RADIO** 

WASHER PUMP

WIPERS-WASHER

**COOLING SYSTEM** 

PARK-CLEARANCE LIGHTS

INDICATOR LIGHT

**TIRE** 

WINDOW REGULATOR

DOOR **FENDER**  Q **PARTS** 

STRUT; GSS1783UQ STRUT-LIFT 2

1 9IP; WASHER PUMP W/GROMMET

1 9IP; TEE PLASTIC

2 FLUID; COOLANT ANTIFREEZE GAL

LIGHT; LIGHT MARKER LEDAMBER

9IP; BATTERY ON DISPLAY

#### CSHOP-2016-5411

Date Opened: 11-18-2016 Date Finished 2-28-2017 88,066 Meter 1 Reading:

**TASKS PERFORMED** 

Q **PARTS** 

FIRE APPARATUS **QUARTZ LIGHT** 

1 9IP; BULB QUARTZ HAL. 12V 150W 2 9IP; BULB QUARTZ HAL. 12V 150W

#### **Service Requests:**

11/16/2016 SERVICE REQUEST / 11: BINDS/STICKS / OPERATE

SERVICE REQUEST PRESSURE RELIEF VALVE LIGHT NOT WORKING

12/04/2016 LIGHTS / 12: BROKEN / REPAIR FAULT

VEHICLE LIGHTS NOT WORKING DRIVER SIDE TELESCOPIC SCENE LIGHT - BULB NEEDS TO BE REPLACED

#### CSHOP-2016-5437

Comments: ON-CALL E19

> Date Opened: 11-21-2016 Date Finished 11-22-2016 86,414 Meter 1 Reading:

**PARTS TASKS PERFORMED** Q

STARTER 1 STARTER; 6808 38MT 12T STARTER

#### **Service Requests:**

11/20/2016 SERVICE REQUEST / 12: BROKEN / REPAIR

SERVICE REQUEST TRUCK NOT STARTING PERIODICLY

CSHOP-2016-565

Comments: E46

Date Opened: 2-4-2016 Date Finished 2-5-2016 Meter 1 Reading: 79,304

TASKS PERFORMED NO PARTS USED

TRAVEL TO BE CHARGED TO WORK ORDER HYDRAULIC SYSTEM

**Service Requests:** 

02/04/2016 SERVICE REQUEST / 18: LEAKING / REPAIR

HURST CUTTERS HANDLE IS MISSING A SCREW. UNSAFE TO HANDLE AND OPERATE

CSHOP-2016-6042

Comments: SE-11 AT STATION 19 HAS FOG LIGHT OUT.

TASKS PERFORMED Q PARTS

TRAVEL TO BE CHARGED TO WORK ORDER

LIGHTING SYSTEM

1 BULB; LIGHT BULB BP1255/H3 H

**Service Requests:** 

12/27/2016 SERVICE REQUEST / 12: BROKEN / REPAIR

SERVICE REQUEST LEFT SIDED FOG LAMP IS OUT.

CSHOP-2016-672

Comments: SE @ ST46

Date Opened: 2-10-2016 Date Finished 4-19-2016 Meter 1 Reading: 81,649

TASKS PERFORMED NO PARTS USED

LIGHTING SYSTEM AIR SYSTEM FUEL GAUGE

**Service Requests:** 

02/10/2016 SERVICE REQUEST / 19: LOOSE / REPAIR

EMERGENCY RED STROBE LIGHT ON GRILL DRIVERS SIDE NEEDS TO BE REPLACED NOT WORKING PROPERLY.

POWERS ON AND OFF AT WILL POSS SHORT.

02/18/2016 BRAKES / 19: LOOSE / REPAIR

TRUCK CURRENTLY AT STATION 46. HAS AIR LEAK IN AIR SYSTEM AND WILL LEAK DOWN TO ALMOST 0 OVERNIGHT.

02/18/2016 SERVICE REQUEST / 19: LOOSE / REPAIR

WATER LEAKING FROM UNDER THE ENGINE. BRACKET FOR HALIGAN

02/22/2016 SERVICE REQUEST / 19: LOOSE / REPAIR

PUMP IS LEAKING WATER. FUEL GAUGE DOES NOT SHOW FULL WHEN FULL. ENGINE HR METER NOT WORKING.

CSHOP-2017-1155

TASKS PERFORMED NO PARTS USED

TRAVEL TO BE CHARGED TO WORK ORDER AIR CONDITIONING

**Service Requests:** 

02/23/2017 A/C / 38: SHORTED / REPAIR

A/C ISSUE IN THE FRONT IS NOT WORKING. WHEN THE TRUCK IS OFF THERE IS AN AUDIBLE AIR LEAK

CSHOP-2017-1367

INTAKE VALVE HANDLE BROKEN & VACUUM LEAK

TASKS PERFORMED Q PARTS

FIRE APPARATUS

1 9IP; 4 IN CLAMP

EXHAUST SYSTEM

1 9IP; CLAMP 4"" 33969

WATER PUMP 1 5TN; HALE HANDLE SHORT SWING

**Service Requests:** 

03/06/2017 SERVICE REQUEST / 49: CAN NOT DUPLICATE CONCERN / REAR DISCHARGE VALVE WAS LEAKI

CSHOP-2017-1523

Comments: SPARE RESCUE AT 20

Date Opened: 3-13-2017 Date Finished 3-17-2017 Meter 1 Reading: 88,479

TASKS PERFORMED Q PARTS

TRAVEL TO BE CHARGED TO WORK ORDER

1 2TP; VALVE

AIR SYSTEM TWD; TWD

**Service Requests:** 

03/12/2017 LIGHTS / 23: NOT CONNECTED / REPAIR

LED EMERGENCY LIGHT OVER DRIVERS STEP NOT WORKING. ALSO PLEASE CHECK ON LARGE AIRLEAK. TRUCK IN

5AB; 3-3.5 BALL KIT COMPOSITE

LOSING AIR RAPIDLY, IT CAN BE HEARD COMING FORM UNDER DRIVERS SIDE REAR STEP.

CSHOP-2017-1879

TASKS PERFORMED Q PARTS

TRAVEL TO BE CHARGED TO WORK ORDER

INTAKE VALVE

HEADLIGHTS LOW BEAM

1 LMP; HALOGEN LAMP

Service Requests:

03/28/2017 SERVICE REQUEST / 12: BROKEN / INSPECT

INTAKE LEVER ON THE DRIVER SIDE ONLY OPENS HALF WAY

CSHOP-2017-2129

TASKS PERFORMED Q PARTS

WAIT TIME TO BE CHARGED TO WORK ORDER TRAVEL TO BE CHARGED TO WORK ORDER

PRIMING PUMP FIRE PUMP

9RR; 9RR

**Service Requests:** 

04/12/2017 SERVICE REQUEST / 38: SHORTED / EXCHANGE - NEW

SERVICE REQUEST. PUMP PRIMER NOT WORKING. NOT TURNING ON WHEN PULLED.

CSHOP-2017-2494

Comments: SPARE ENGINE AT STATION 20

TASKS PERFORMED NO PARTS USED

TRAVEL TO BE CHARGED TO WORK ORDER AIR SYSTEM

**Service Requests:** 

04/27/2017 BRAKES / 18: LEAKING / REPAIR

AIR LEAK. IF THE ENGINE IS PARKED FOR LONG PERIODS AT A TIME AND THEN STARTED IT TAKES TIME FOR THE AIR

TO BUILD UP SO THE TRUCK WILL MOVE.

CSHOP-2017-2563

Date Opened: 5-1-2017 Date Finished 5-3-2017 Meter 1 Reading: 89,519

TASKS PERFORMED NO PARTS USED

TRAVEL TO BE CHARGED TO WORK ORDER PRIMING PUMP FIRE PUMP

TRIMINO FORM THRE

**Service Requests:** 

05/01/2017 SERVICE REQUEST / 23: NOT CONNECTED / REPAIR

SECONDARY PRIMER MOTOR IS NOT WORKING. SIDE PRIMER. THIS IS A SPARE ENGINE THAT IS CURRENTLY AT

STATION 20

| CSHOP-2017-2644  Date Opened: 5-5-2017                                                                                                                                 | Date Finished       | 5-22                          | 2-2017                                    | Meter 1 Reading:                                                                    | 90,225                     |
|------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------------|-------------------------------|-------------------------------------------|-------------------------------------------------------------------------------------|----------------------------|
| TASKS PERFORMED                                                                                                                                                        |                     | Q                             | PARTS                                     |                                                                                     | •                          |
|                                                                                                                                                                        |                     | -                             |                                           |                                                                                     |                            |
| FIRE PUMP                                                                                                                                                              |                     | 1                             | FIL: NAP                                  | A HYDRAULIC FILTI                                                                   | FR                         |
| LIGHTING SYSTEM                                                                                                                                                        |                     | 13                            |                                           | EAR OIL BULK                                                                        |                            |
| REPAIR FROM PM - POWER STEE                                                                                                                                            | RING                | 2                             |                                           | LK TRANS SYN                                                                        |                            |
| TRANSFER CASE                                                                                                                                                          |                     | 22                            | 90C; BI                                   | JLK TRANS SYN                                                                       |                            |
| TRANSMISSION                                                                                                                                                           |                     | 3                             |                                           | AR OIL BULK                                                                         |                            |
| REAR ASSEMBLY                                                                                                                                                          |                     | 3                             | GEAR; G                                   | EAR OIL SYN QT                                                                      |                            |
| AIR DRIER DOOR WEATHER MOLDING                                                                                                                                         |                     | 1                             | FIL; NAP                                  | A TRANS FILTER                                                                      |                            |
| AIR CONDITIONING                                                                                                                                                       |                     | 1                             | TWD; AD                                   | -9KIT                                                                               |                            |
| AIR CONDITIONING                                                                                                                                                       |                     | 1                             | 9IP; DRY                                  | ER KIT AD9 -NEW                                                                     |                            |
|                                                                                                                                                                        |                     | 4                             | 9IP; SEA                                  |                                                                                     |                            |
|                                                                                                                                                                        |                     | 1                             | 9IP; MOL                                  |                                                                                     |                            |
|                                                                                                                                                                        |                     | 1                             | •                                         | /ER, SIL PLATE RH                                                                   |                            |
|                                                                                                                                                                        |                     | 6                             |                                           | A 10194654                                                                          |                            |
|                                                                                                                                                                        |                     | 1                             |                                           | 5360M 2PK FILTER                                                                    | AIR COND                   |
|                                                                                                                                                                        |                     | 2                             | 9HY; FIT                                  | TINGS                                                                               |                            |
| Service Requests:  05/05/2017 SERVICE REQUEST. SPA                                                                                                                     |                     |                               | — — — -<br>ED                             |                                                                                     |                            |
| 05/05/2017 SERVICE REQUEST. SPA                                                                                                                                        | ARE E20 REAR DISCHA | RGE IS N                      | — — — —<br>ED<br>OT OPENING PF            | — — — — — — ROPERLY.                                                                | 90.225                     |
| 05/05/2017 SERVICE REQUEST. SPA<br>SERVICE REQUEST. SPA<br>CSHOP-2017-2937<br>Date Opened: 5-17-2017                                                                   |                     | 5-18                          | — — — — — — — — — — — — — — — — — — —     |                                                                                     | 90,225                     |
| 05/05/2017 SERVICE REQUEST. SPA                                                                                                                                        | ARE E20 REAR DISCHA | RGE IS N                      | — — — —<br>ED<br>OT OPENING PF            | — — — — — — ROPERLY.                                                                | 90,225                     |
| 05/05/2017 SERVICE REQUEST. SPA  SERVICE REQUEST. SPA  CSHOP-2017-2937  Date Opened: 5-17-2017  TASKS PERFORMED                                                        | ARE E20 REAR DISCHA | 5-18<br>Q                     | ED OT OPENING PR                          | ROPERLY.  Meter 1 Reading:                                                          |                            |
| 05/05/2017 SERVICE REQUEST. SPA<br>SERVICE REQUEST. SPA<br>CSHOP-2017-2937<br>Date Opened: 5-17-2017                                                                   | ARE E20 REAR DISCHA | 5-18<br>Q<br>1                | OT OPENING PERSONAL PARTS  FIL; FUE       | POPERLY.  Meter 1 Reading:  L WATER SEPARAT                                         | OR                         |
| 05/05/2017 SERVICE REQUEST. SPA  SERVICE REQUEST. SPA  CSHOP-2017-2937  Date Opened: 5-17-2017  TASKS PERFORMED                                                        | ARE E20 REAR DISCHA | 5-18<br>Q<br>1                | B-2017 PARTS FIL; FUE FIL; NAP            | Meter 1 Reading:  L WATER SEPARAT                                                   | OR<br>:R                   |
| 05/05/2017 SERVICE REQUEST. SPA  SERVICE REQUEST. SPA  CSHOP-2017-2937  Date Opened: 5-17-2017  TASKS PERFORMED                                                        | ARE E20 REAR DISCHA | 5-18<br>Q<br>1<br>1<br>4      | PARTS  FIL; FUE FIL; NAP MAC; NC          | Meter 1 Reading:  L WATER SEPARAT AGOLD FUEL FILTE N-CHLOR BRAKE (                  | OR<br>ER<br>CLNR           |
| 05/05/2017 SERVICE REQUEST. SPA  SERVICE REQUEST. SPA  CSHOP-2017-2937  Date Opened: 5-17-2017  TASKS PERFORMED                                                        | ARE E20 REAR DISCHA | 5-18<br>Q<br>1                | PARTS  FIL; FUE FIL; NAP MAC; NC          | Meter 1 Reading:  L WATER SEPARAT                                                   | OR<br>ER<br>CLNR           |
| 05/05/2017 SERVICE REQUEST. SPA  CSHOP-2017-2937 Date Opened: 5-17-2017  TASKS PERFORMED  PM SERVICE B                                                                 | ARE E20 REAR DISCHA | 5-18<br>Q<br>1<br>1<br>4      | PARTS  FIL; FUE FIL; NAP MAC; NC          | Meter 1 Reading:  L WATER SEPARAT AGOLD FUEL FILTE N-CHLOR BRAKE (                  | OR<br>ER<br>CLNR           |
| 05/05/2017 SERVICE REQUEST. SPA  CSHOP-2017-2937 Date Opened: 5-17-2017  TASKS PERFORMED  PM SERVICE B  CSHOP-2017-3174                                                | ARE E20 REAR DISCHA | 5-18<br>Q<br>1<br>1<br>4      | PARTS  FIL; FUE FIL; NAP MAC; NC          | Meter 1 Reading:  L WATER SEPARAT AGOLD FUEL FILTE N-CHLOR BRAKE (                  | OR<br>ER<br>CLNR           |
| 05/05/2017 SERVICE REQUEST. SPA  CSHOP-2017-2937 Date Opened: 5-17-2017  TASKS PERFORMED  PM SERVICE B  CSHOP-2017-3174 Comments: QUALITY CHECK                        | Date Finished       | 5-18<br>Q<br>1<br>1<br>4<br>1 | PARTS  FIL; FUE FIL; NAP MAC; NO FIL; NAP | Meter 1 Reading:  L WATER SEPARAT AGOLD FUEL FILTE N-CHLOR BRAKE ( AGOLD OIL FILTER | OR<br>ER<br>CLNR           |
| 05/05/2017 SERVICE REQUEST. SPA  CSHOP-2017-2937 Date Opened: 5-17-2017  TASKS PERFORMED  PM SERVICE B  CSHOP-2017-3174 Comments: QUALITY CHECK Date Opened: 5-30-2017 | ARE E20 REAR DISCHA | 5-18<br>Q<br>1<br>1<br>4<br>1 | PARTS  FIL; FUE FIL; NAP MAC; NO FIL; NAP | Meter 1 Reading:  L WATER SEPARAT AGOLD FUEL FILTE N-CHLOR BRAKE (                  | OR<br>ER<br>CLNR           |
| 05/05/2017 SERVICE REQUEST. SPA  CSHOP-2017-2937 Date Opened: 5-17-2017  TASKS PERFORMED  PM SERVICE B  CSHOP-2017-3174 Comments: QUALITY CHECK                        | Date Finished       | 5-18<br>Q<br>1<br>1<br>4<br>1 | PARTS  FIL; FUE FIL; NAP MAC; NO FIL; NAP | Meter 1 Reading:  L WATER SEPARAT AGOLD FUEL FILTE N-CHLOR BRAKE ( AGOLD OIL FILTER | OR<br>ER<br>CLNR           |
| 05/05/2017 SERVICE REQUEST. SPA  CSHOP-2017-2937 Date Opened: 5-17-2017  TASKS PERFORMED  PM SERVICE B  CSHOP-2017-3174 Comments: QUALITY CHECK Date Opened: 5-30-2017 | Date Finished       | 5-18<br>Q<br>1<br>1<br>4<br>1 | PARTS  FIL; FUE FIL; NAP MAC; NC FIL; NAP | Meter 1 Reading:  L WATER SEPARAT AGOLD FUEL FILTE N-CHLOR BRAKE ( AGOLD OIL FILTER | OR<br>ER<br>CLNR<br>90,240 |

CSHOP-2017-3233

SPARE AT ST 91 NEEDS SILICONE Comments:

> Date Opened: 6-2-2017 Date Finished 6-21-2017 Meter 1 Reading: 90,765

**TASKS PERFORMED NO PARTS USED** 

CONTROL VALVE FIRE PUMP **SEAT BELTS** 

Service Requests:

06/01/2017 SEATS / 12: BROKEN / REPAIR

SEAT ISSUE ON SE11 AT STATION 91 THE DRIVERS SIDE REAR SEAT BELT FEMALE BUCKLE WILL INTERMITTENTLY

06/04/2017 SERVICE REQUEST / 12: BROKEN / REPAIR

SERVICE REQUEST SE11 AT STATION 91, THE DRIVERS SIDE 2.5" INTAKE VALVE WILL NOT OPEN ALL THE WAY

CSHOP-2017-3606

Date Opened: 6-19-2017 Date Finished 6-30-2017 91,025 Meter 1 Reading:

**PARTS TASKS PERFORMED** Q

TRAVEL TO BE CHARGED TO WORK ORDER

2 9IP; RH DOOR LATCH NEW **DOOR** 2 NCB; WHITE LITHIUM GREASE

**Service Requests:** 

06/18/2017 DOOR / 12: BROKEN / REPAIR

VEHICLE DOORS, DRIVER DOOR IS VERY HARD TO OPEN FROM THE OUTSIDE. THE LATCH SEEMS TO BE GETTING

STUCK AND THE HANDLE HAS TO BE PULLED SEVERAL TIMES FOR DOOR TO OPEN

CSHOP-2017-3706

Comments: @91

> Date Opened: 6-23-2017 Date Finished 6-30-2017 91,025 Meter 1 Reading:

Q **PARTS TASKS PERFORMED** 

TRAVEL TO BE CHARGED TO WORK ORDER

**ELECTRICAL** 

1 ECH; MAS DISCONNECT SWITCH

**Service Requests:** 

SERVICE REQUEST / 12: BROKEN / REPAIR 06/23/2017

SERVICE REQUEST SE AT STATION 91 THE BATTERY SWITCH HANDLE IS BROKEN OFF, (BUT IS IN USE WITH VISE

GRIPS). ALSO IT SOUNDS LIKE THE VEINS IN THE ELECTRIC PRIMER ARE BROKEN OFF AND MAKING ALL KINDS OF

NOISE.

CSHOP-2017-4086

Date Opened: 7-12-2017 7-24-2017 Date Finished 91,813 Meter 1 Reading:

**TASKS PERFORMED PARTS** 

DOOR PANEL 1 9IP; LATCH TRIGER W/O LOCK

Service Requests:

07/11/2017 BODY / 44: WORN / EXCHANGE - NEW

ONE OF THE LATCHES FOR TRASH LINE DOOR IS BROKEN.

CSHOP-2017-4145

Date Opened: 7-17-2017 Date Finished 9-6-2017 Meter 1 Reading: 92,225

TASKS PERFORMED

Q PARTS

QUALITY CHECK-REPAIRS FIRE PUMP CONTROLS FIRE PUMP PLUMBING

RELIEF VALVE FIRE PUMP

STEP

WIPERS-WASHER LIGHTING SYSTEM

TRANSFER CASE

SAFTEY-EMERGENCY EQUIPMENT

1 9IP; HALE GREEN INDICATOR

1 9IP; TPM/QG HALE REPAIR KIT

2 9IP; HALE RED INDICATOR LED

1 9IP; 7001-5 SEAL PUMP

1 SEAL; SEAL SAME AS 29867 C/R

2 1AN; WIPER BLADE 24 IN

1 9IP: GASKET GEARBOX COVER

1 1WL; CLR LENS FREED BAR LNG

1 9IP; 14 IN

1 MMM; LENS RENEWAL KIT

2 9IP; LIGHT 500 TIR LED

2 LIT; LED M C LAMP

1 9IP; TPM/QG HALE REPAIR KIT

2 BK; PTEX ULTRA BLACK 30Z

2 9AP; MAN SAVER 20"

1 NONSTOCK; FREIGHT CHARGE

2 CAP: 9ECAPR END CAP RED

2 9IP: 9ECAPR END CAP RED

#### **Service Requests:**

07/15/2017

BODY / 12: BROKEN / INSTALLED NEW PEDESTAL AND NEW LENSES

PASSENGER SIDE BACK LIGHT AT TOP BY HOSE BED WAS HANGING DOWN ON THE SHIFT BEFORE. THAT SHIFT

**NO PARTS USED** 

USED ZIP TIES TO HANG THE LIGHT BACK UP CORRECTLY.

CSHOP-2017-4264

Date Opened: 7-21-2017 Date Finished 7-2

7-21-2017 Meter 1 Reading: 91,813

**TASKS PERFORMED** 

FUEL SYSTEM

CSHOP-2017-4319

TASKS PERFORMED Q PARTS

TRAVEL TO BE CHARGED TO WORK ORDER

FIRE APPARATUS LIGHTING SYSTEM

5TN; BALL VALVE 2 1/2

#### Service Requests:

07/25/2017

LIGHTS / 12: BROKEN / REPAIR

ON SE AT STATION 91 THE TELE LIGHTS ARE BOTH NOT WORKING FROM THE PUMP PANEL SWITCHES, ALSO THE DRIVERS SIDE 2.5" INTAKE VALVE WILL NOT OPEN COMPLETELY, AND LASTLY WHEN THE PUMP IS IN GEAR THE

PUMP IS DUMPING WATER OUT THE BACK OF THE ENGINE BETWEEN THE TIRES

#### CSHOP-2017-6297

Comments: L/R PLACARD FRAME LOOSE HOSE BED COVER TORN / MISSING HOLD DOWNS RIGHT TELELIGHT BULB BURNED

OUT, LIGHT UP WARNING INOP CROSS LAY #2 GAUGE FILLED WITH WATER MULTIPLE DISCHARGE CAP CHAINS BROKEN COOLANT LEAK AT UPPER RADIATOR HOSE ENGINE OIL AT ADD LINE AIR SYSTEM BLEEDS DOWN TO 0

| PUMP PANEL EQUIPMENT MOUNTING BRACKETS DISCHARGE GAUGE HOSE BED BODY PRE TRIP INSPECTION HOSE UPPER OIL QUARTZ LIGHT AIR SYSTEM ALARM-BUZZER-WARNING LIGHT  1 8HD; WIRE ROPE 5TN; GAUGE 3.5 1 5TN; GAUGE 3.5 1 9P; PLUG RAD. DRAIN 90C; COOLANT 90C; COOLANT 4 90C; SYN 15W40 4 90C; SYN 15W40 4 FLUID; SYN 0IL BULK QTS 2 BK; SPRAYER 2 2FR; INNER POLE LIGHT MAGNET | TASKS PERFORMED                                                                                                      | Q                                      | PARTS                                                                                                                                                                                   |
|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------------------------------------------------------------------------------------|----------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
|                                                                                                                                                                                                                                                                                                                                                                       | EQUIPMENT MOUNTING BRACKETS DISCHARGE GAUGE HOSE BED BODY PRE TRIP INSPECTION HOSE UPPER OIL QUARTZ LIGHT AIR SYSTEM | 1<br>3<br>-3<br>4<br>-4<br>4<br>1<br>2 | 5TN; GAUGE 3.5 FLUID; COOLANT ANTIFREEZE GAL 9IP; PLUG RAD. DRAIN 9OC; COOLANT 9OC; COOLANT 9OC; SYN 15W40 9OC; SYN 15W40 FLUID; SYN OIL BULK QTS 9AP; QUARTZ BULB 12V 150W BK; SPRAYER |

#### CSHOP-2017-6606

Comments: SPARE ENGINE AT ST19

Date Opened: 11-15-2017 Date Finished 11-15-2017 Meter 1 Reading: 93,301

#### **TASKS PERFORMED**

TRAVEL TO BE CHARGED TO WORK ORDER

DIAGNOSE ELECTRICAL

ELECTRICAL BRAKES

AIR CONDITIONING

Q PARTS

2 MBI; GRIP/KIT

2 TWD; BRAKE DRUM

#### **Service Requests:**

| 11/15/2017 | SERVICE REQUEST / 19: LOOSE / PLACED PLUG AT REAR OF 12V OUTLET  12V SYSTEM NOT WORKING AND UNABLE TO CHARGE TABLET. ALSO NEED IT TO WORK EVEN WHILE THE ENGINE IS  OFF. |
|------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| 11/15/2017 | SERVICE REQUEST / 18: LEAKING / REPAIRED LOW SIDE HOSE COMPRESSION FITTING AT COM                                                                                        |

#### CSHOP-2017-6767

Date Opened: 11-27-2017 Date Finished 11-30-2017 Meter 1 Reading: 93,686

TASKS PERFORMED NO PARTS USED

ELECTRICAL AIR CONDITIONING

#### **Service Requests:**

| 11/24/2017 | A/C / 12: BROKEN / REPAIR A/C ISSUE BLOWER BARELY WORKING AND NO COOL AIR IN FRONT A/C      |
|------------|---------------------------------------------------------------------------------------------|
| 11/24/2017 | SERVICE REQUEST / 12: BROKEN / REPAIR                                                       |
|            | SERVICE REQUEST 12 V CHARGING SYSTEM FOR SAFETY PAD NOT WORKING UNABLE TO CHARGE SAFETY PAD |

CSHOP-2017-6890

Comments: E19

Date Opened: 12-3-2017 Date Finished 12-5-2017 Meter 1 Reading: 93,938

TASKS PERFORMED Q PARTS

TRAVEL TO BE CHARGED TO WORK ORDER EQUIPMENT MOUNTING BRACKETS 2 9ME; STRAP

**Service Requests:** 

12/03/2017 SERVICE REQUEST / 12: BROKEN / EXCHANGE - NEW

SERVICE REQUEST- NEED VELCRO REPLACED FOR HOSE CLAMP ON REAR OF TRUCK

CSHOP-2017-6964

Comments: SE AT 19

TASKS PERFORMED Q PARTS

TRAVEL TO BE CHARGED TO WORK ORDER

QUARTZ LIGHT AIR CONDITIONING 1 2FL; HOSE ASSEMBLY

**Service Requests:** 

12/05/2017 LIGHTS / 12: BROKEN / REPAIR

VEHICLE LIGHTS NOT WORKING OFFICER'S SIDE TELESCOPIC WORK LIGHT - BULB NEEDS REPLACED

12/06/2017 A/C / 12: BROKEN / INSPECT

A/C NOT WORKING IN THE CAB OF E-19.

CSHOP-2017-7298

Comments: E19

Date Opened: 12-21-2017 Date Finished 12-27-2017 Meter 1 Reading: 94,840

TASKS PERFORMED NO PARTS USED

TRAVEL TO BE CHARGED TO WORK ORDER ALTERNATOR-GENERATOR

**Service Requests:** 

12/21/2017 SERVICE REQUEST / 49: CAN NOT DUPLICATE CONCERN / INSPECT

SERVICE REQUEST GENERATOR WIRES / CONNECTIONS 1. WIRE THAT CONNECTS TO THE CIRCLE D LIGHT DOES

NOT WORK 2. THE WIRE THAT SPLITS ONE LINE INTO TWO DOES NOT WORK

CSHOP-2018-1724

Comments:

AT 21

Date Opened: 3-26-2018 Date Finished

3-27-2018

Meter 1 Reading:

96,836

**TASKS PERFORMED** 

**NO PARTS USED** 

TRAVEL TO BE CHARGED TO WORK ORDER ELECTRICAL

**Service Requests:** 

03/26/2018

SERVICE REQUEST / 38: SHORTED / REPAIR

12 VOLT CHARGING PLUGS INSIDE CAB NOT WORKING UNLESS TRUCK BATTERIES AND IGNITION ARE ON. SO WE

CANT CHARGE OUR SAFTEYPAD WHEN TRUCK IS AT THE STATION.

CSHOP-2018-2204

Comments: SPARE ENGINE AT ST21

Date Opened: 4-20-2018 Date Finished 4-23-2018

4-23-2018 Meter 1 Reading: 97,664

TASKS PERFORMED NO PARTS USED

TRAVEL TO BE CHARGED TO WORK ORDER

RELIEF VALVE

Service Requests:

04/20/2018 SERVICE REQUEST / 19: LOOSE / ADJUST

THE RELIEF VALVE LIGHT IS NOT WORKING ON SPARE E21.

CSHOP-2018-2647

Date Opened: 5-15-2018 Date Finished 5-21-2018 Meter 1 Reading: 98,602

TASKS PERFORMED NO PARTS USED

**CONTROL VALVE** 

**Service Requests:** 

05/15/2018

SERVICE REQUEST / 49: CAN NOT DUPLICATE CONCERN / INSPECT

TYPE PROBLEM INTO DESCRIPTION SPARE E21 DISCHARGE NUMBER 1 HAS A LEAK DUE TO A VISIBLE BROKEN

GASKET AT THE BALL VALVE.

CSHOP-2018-267

Comments: E19 COOLANT LEAK

Date Opened: 1-11-2018 Date Finished 3-16-2018 Meter 1 Reading: 96,505

**TASKS PERFORMED** 

FIRE APPARATUS WIPER BLADES COOLING SYSTEM OIL PAN-GASKET QUARTZ LIGHT BATTERY

BRAKES AIR DRIER AIR HORN MIRRORS

**BODY EXTERIOR** 

INSTRUMENTS-GAUGES-METERS

AIR CONDITIONING

Q PARTS

2 1AN; WIPER BLADES

5 PAF; ANTIFRZ

1 NTH; REGULATR

NBH; TENSIONER-HEAVY DUTY

12 9AP; BRAKE CLEANER

1 2FL; GASKET

4 1AD; BATTERY 31 SERIES

9IP; VALVE CHECK AD9

1 TWD; AD-9KIT

1 TWD; AD-9KIT MINOR

2 9HD; KIT

1 GRO; CONVEX MIRROR

-1 GRO; CONVEX MIRROR

1 GRO; CONVEX MIRROR

2 5TN; MIRROR REPLACEMENT

1 9IP; HOOD CABLE

1 2TK; FILTER

**Service Requests:** 

01/11/2018 RADIATOR / 12: BROKEN / REPAIR

RADIATOR LEAKING

CSHOP-2018-2961

Date Opened: 5-29-2018

Date Finished

6-8-2018

**NO PARTS USED** 

Meter 1 Reading:

98,769

**TASKS PERFORMED** 

TIRES & WHEELS

**Service Requests:** 

05/28/2018

TIRES / 18: LEAKING / REPAIR

BAD TIRES, SPARE ENGINE AT 45 NEEDS A LEFT REAR (OUTSIDE) TIRE

CSHOP-2018-3483

Date Opened: 6-21-2018

Date Finished

6-21-2018

Meter 1 Reading:

99,096

**TASKS PERFORMED** 

**NO PARTS USED** 

**TIRES ALL** 

**VENDOR?** 

DAN CALLAGHAN ENTERPRISES

CSHOP-2018-3672

Date Opened: 6-29-2018 Date Finished 8-2-2018 Meter 1 Reading: 99,626

**TASKS PERFORMED** Q **PARTS** 

**QUALITY CHECK-REPAIRS** 

**TIRE** 

1 1WL; LEDSTROBELIGHTRED

- -5 90C; GEAR OIL BULK
- 5 9OC; GEAR OIL BULK
- 1 9IP; BALLAST4CHANNELLEDLIGHTBAR01026974
- 1 MMM; TAPE
- 5 GEAR: GEAR OIL SYN QT
- 1WL; CORNER LIGHT RED 1
- 2 5TN; GAUGE35
- 1 5SC; GAUGE4530TO600PSI
- 5TN; GAUGE450600WH 1
- 2 **GRO; 3 CENTER LED YELLOW**

9LH; HONDA, PETCOCK GASKET

**Service Requests:** 

06/29/2018

TIRES / 18: LEAKING / REPAIR

BAD TIRES. FRONT DRIVER TIRE DOWN TREAD WARE

CSHOP-2018-38

Date Opened: 1-2-2018 Date Finished 1-26-2018 Meter 1 Reading: 95,770

**PARTS TASKS PERFORMED** Q

FIRE FIGHTING EQUIPMENT

SIREN

1

CSHOP-2018-4927

Date Opened: 8-30-2018 Date Finished 8-30-2018 99,626 Meter 1 Reading:

**NO PARTS USED TASKS PERFORMED** 

TRAVEL TO BE CHARGED TO WORK ORDER DIAGNOSE ELECTRICAL

**Service Requests:** 

08/30/2018 SERVICE REQUEST / 18: LEAKING / REPAIR

TYPE PROBLEM INTO DESCRIPTION UNABLE TO THROTTLE UP ENGINE AFTER PUTTING INTO PUMP LIGHTS NOT

WORKING ON THROTTLE ON PUMP PANEL

08/30/2018 ENGINE / 18: LEAKING / REPAIR

CSHOP-2018-591

Comments: E19

Date Opened: 1-29-2018 Date Finished 1-30-2018 Meter 1 Reading: 96,105

TASKS PERFORMED NO PARTS USED

TRAVEL TO BE CHARGED TO WORK ORDER LIGHTING SYSTEM

**Service Requests:** 

01/27/2018 LIGHTS / 49: CAN NOT DUPLICATE CONCERN / INSPECT

VEHICLE LIGHTS NOT WORKING THE LEFT AND RIGHT SCENE LIGHTS ARE NOT WORKING. ALSO THE PANEL LIGHTS

ARE NOT WORKING

01/27/2018 LIGHTS / 49: CAN NOT DUPLICATE CONCERN / INSPECT

VEHICLE LIGHTS NOT WORKING, THE 2 TELESCOPING SCENE LIGHTS ARE WORKING INTERMITTENTLY.

CSHOP-2018-5951

TASKS PERFORMED Q PARTS

PUMP PANEL FIRE PUMP

THROTTLE CONTROLS

**FILTER** 

**FAULT CODE** 

SHORELINE CHARGER

2 5HP; KNOB

1 NONSTOCK; FREIGHT CHARGE

1 5CS; CAPTAIN GOV. KIT

1 1FD; MOTORCRAFT COOLANT GOLD

1 5EF; SWITCH

-1 5CS; GOVERNOR 108

1 5CS; GOVERNOR 108

1 5FR; REBUILD LABOR

1 FIL; NAPAGOLD FUEL FILTER

1 FIL; FUEL WATER SEPARATOR

1 9IP; N122WSKL4000 SENSOR WATER IN FUEL

2 2FL; FASTENERS, FUSE COVER

1 6KU; AC2000 12V PLC TEN8

2FL; COVER FUSE PANEL

CSHOP-2018-7291

PM SERVICE C

TASKS PERFORMED NO PARTS USED

**ENGINE AND ACCESSORIES** 

CSHOP-2018-961

Date Opened: 2-14-2018 Date Finished 2-27-2018 Meter 1 Reading: 96,357

TASKS PERFORMED Q PARTS

1 FIL; NAPAGOLD OIL FILTER

1 FIL; FUEL WATER SEPARATOR

1 FIL; NAPAGOLD FUEL FILTER

26 9IP; 15W40 MOTOR OIL NON SYN

1 FIL; NAPAGOLD AIR FILTER

| CSF | 4OI | P-2 | 01 | 9-1 | 0 | 07 |
|-----|-----|-----|----|-----|---|----|
|     |     |     |    |     |   |    |

| <b>CSHOP-2019-1007</b> Date Opened: 2-22-2019                                                                                                                                            | Date Finished | 4-17                                                                            | '-2019                                                                                                                                                  | Meter 1 Reading:                                                 | 101,300 |
|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------|---------------------------------------------------------------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------------------------------|---------|
| TASKS PERFORMED                                                                                                                                                                          |               | Q                                                                               | PARTS                                                                                                                                                   | ,                                                                | ,       |
| FIRE PUMP PLUMBING SIDE COMPARTMENT BODY LID-SCREEN WIPER BLADES OIL TURN SIGNAL LIGHTS DIAGNOSE ELECTRICAL STEERING BRAKES BUMPER REAR BODY DAMAGE ACCIDENT DOOR PANEL AIR CONDITIONING |               | 2<br>2<br>2<br>1<br>1<br>10<br>10<br>10<br>1<br>2<br>2<br>1<br>1<br>1<br>1<br>3 | BK; PTE<br>9AP; TH<br>5HP; FL<br>9HY; PIF<br>1AN; WII<br>2FL; LAN<br>STUDS<br>9IP; 13<br>SEAL<br>CR; HUE<br>9IP; 410<br>8GR; GF<br>LIT; LAN<br>9IP; HAN | PER BLADES MP ASSY W/STUDS -3052 NUT                             | RMATEX  |
| CSHOP-2019-2512 Comments: QC Date Opened: 5-13-2019                                                                                                                                      | Date Finished | 5-23                                                                            | 3-2019                                                                                                                                                  | Meter 1 Reading:                                                 | 102,056 |
| TASKS PERFORMED                                                                                                                                                                          |               | Q                                                                               | PARTS                                                                                                                                                   |                                                                  |         |
| QUALITY CHECK-REPAIRS<br>COOLING SYSTEM<br>AIR SYSTEM<br>DOOR PANEL                                                                                                                      |               | 1<br>1<br>1                                                                     |                                                                                                                                                         | LVE<br>R PRESSURE VALVE<br>LDING LH                              |         |
| CSHOP-2019-2780  Date Opened: 5-30-2019  TASKS PERFORMED                                                                                                                                 | Date Finished |                                                                                 | 2019<br>ARTS USED                                                                                                                                       | Meter 1 Reading:                                                 | 102,176 |
| FIRE APPARATUS<br>U-BOLTS<br>DOOR PANEL                                                                                                                                                  |               |                                                                                 |                                                                                                                                                         |                                                                  |         |
| CSHOP-2019-2964  Date Opened: 6-7-2019                                                                                                                                                   | Date Finished | 7-29                                                                            | 9-2019                                                                                                                                                  | Meter 1 Reading:                                                 | 0       |
| TASKS PERFORMED                                                                                                                                                                          |               | Q                                                                               | PARTS                                                                                                                                                   |                                                                  |         |
| REPAIR FROM PM - DECALS/CLEA                                                                                                                                                             | NLINESS       | 2<br>2<br>2<br>2                                                                | 9PB; LAI<br>9PB; SM                                                                                                                                     | RGE PLACARD<br>RGE PLACARD HOL<br>ALL PLACARD HOL<br>ALL PLACARD |         |

CSHOP-2019-3528

Comments: BATT 7 SPARE AT 73 DISCHARGE #1 NOT CLOSING ALL THE WAY ALSO DO A PRE TRIP BEFORE SENDING OUT

TASKS PERFORMED Q PARTS

FIRE PUMP CONTROLS

BACK-UP ALARM

1 BK; BACK-UP ALARM

**Service Requests:** 

07/05/2019 ALARMS / 12: BROKEN / EXCHANGE - NEW

BACK UP ALARM DOES NOT SOUND

07/12/2019 SERVICE REQUEST / 19: LOOSE / REPAIR

TANK FILL/RECIRCULATE VALVE COMPROMISED. WHERE THE LEVER CONNECTS TO THE BALL VALVE IN THE PUMP COMPARTMENT THE BOLT AND WASHER THAT ACTS TO KEEP THE LEVER ARM CONNECTED TO THE VALVE HAS VIBRATED OUT AND GONE MISSING. THE LEVER ARM HAS DISCONNECTED FROM THE VALVE AND EASILY FALLS OFF THE VALVE. THE TRUCK CAN REMAIN IN SERVICE FOR TIME BEING AS IT IS EASILY ACCESSIBLE AND CAN BE

OVERCOME, BUT NEEDS TO BE ADDRESSED TODAY. THANK YOU

CSHOP-2019-4751

Date Opened: 9-7-2019 Date Finished 11-21-2019 Meter 1 Reading: 103,024

TASKS PERFORMED Q PARTS

FIRE FIGHTING EQUIPMENT 1 5TF; REED SWITCH KIT, EXTENDA GUN

**Service Requests:** 

09/07/2019 ALARMS / 12: BROKEN / ADJUST

CABLE BROKEN IN THE DECK GUN SENSOR BUZZER GOING OFF WITH TELESCOPE IN THE DOWN POSITION

CSHOP-2019-4818

Date Opened: 9-11-2019 Date Finished 9-12-2019 Meter 1 Reading: 102,859

TASKS PERFORMED NO PARTS USED

**COOLING SYSTEM** 

Service Requests:

09/11/2019 RADIATOR / 18: LEAKING / REPAIR

RADIATOR LEAKING

CSHOP-2019-4819

Date Opened: 9-11-2019 Date Finished 9-12-2019 Meter 1 Reading: 102,859

TASKS PERFORMED NO PARTS USED

A/C BELT REAR A/C

Service Requests:

09/11/2019 SERVICE REQUEST / 19: LOOSE / REPAIR

TYPE PROBLEM INTO DESCRIPTION BELT IS LOOSE SQUEAKING.

| CS | HO | P-20 | 119 | -621 |
|----|----|------|-----|------|
|    |    |      |     |      |

Date Opened: 1-31-2019 Date Finished 2-8-2019 Meter 1 Reading: 100,926 **TASKS PERFORMED** PARTS PRIMING PUMP FIRE PUMP 1 5HP; ESP12 MOTORPRIMER PUMP WPVG PRIMER VLV -4 5TN; VANE, IMPREGNATED ESP12 4 5TN; VANE, IMPREGNATED ESP12 CSHOP-2019-979 Date Opened: 2-21-2019 101,300 Date Finished 3-4-2019 Meter 1 Reading: Q **PARTS TASKS PERFORMED** PM SERVICE B -1 FIL; NAPAGOLD FUEL FILTER 2 FIL; NAPAGOLD FUEL FILTER 12 9AP; BRAKE CLEAN FIL; NAPAGOLD AIR FILTER 1 1 FIL; NAPAGOLD OIL FILTER

26

4PC; 15W40 PREMIUM BLUE OIL

CSHOP-2020-1510

Date Opened: 3-16-2020 Date Finished 5-5-2020 Meter 1 Reading: 103,311

Q

1

1

#### TASKS PERFORMED

FOAM SYSTEM

FIRE FIGHTING EQUIPMENT

FIRE PUMP PLUMBING

PUMP PANEL

CONTROL VALVE FIRE PUMP

**GEAR BOX FIRE PUMP** 

DISCHARGE GAUGE

DOOR PROP CYLINDER

CONTROL VALVE

WIPERS-WASHER

COOLING SYSTEM

SERPENTINE BELT

ENGINE AND ACCESSORIES

LIGHTING SYSTEM

REPAIR FROM PM - POWER STEERING

**ELECTRICAL** 

**FILTER** 

REPAIR FROM PM - DIFFERENTIALS

REPAIR FROM PM - DECALS/CLEANLINESS

REPAIR FROM PM - TRANSMISSION

AIR SYSTEM

**BODY EXTERIOR** 

DOOR HANDLES INSIDE-OUTSIDE

A/C FILTER SCREENS

A/C SYSTEM

#### PARTS

1 2FR; TANKVISION FOAM KIT

5TF; REED SWITCH KIT EXTENDA GUN

1 5TF; GAUGE CROSSFIRE

5AB; BEARING KIT 14 BRONZE 50

1 GRO; SWITCH

5HP; HALE 2 5 VALVE REPAIR KIT

3 4PC; GEAR OIL SYN BULK DELO

4 5CS; GAUGE 3 5 30 600 WH

2 5AH; GAS SPRING, 20", 94LB

2 8AM; TOURQUE SEAL BLUE

1 5HP; MIVHANDLE

2 5HP; HALE RELIEF VALVE STRAINER

1 5HP; 5HP

1 5HP; CONTROL INDICATOR PMD

2FL; SWITCH WIPER CONTOLLER

2 1AN; WIPER BLADE 24 IN

FIL; NAPA COOLANT FILTER

BRG; ALTERNATOR BEARING

NBH; TENSIONER HEAVY DUTY

1 NBH; V BELT

NBH; SERPENTINE BELT

1 NBH; V BELT

2CU; OIL PRESSURE SWITCH

9ES; BULB 150W HALOGEN

FIL; NAPA HYDRAULIC FILTER

2 NOL; TRAN FLU QT DEXRON3I

1 ECH; SWITCH

1 FIL: NAPAGOLD AIR FILTER

14 4PC; GEAR OIL SYN BULK DELO

2 7CF; LETTERING ENGINE

1 2DD; FILTER KIT TRANS SUMP 4

19 9OC; BULK TRANS SYN

1 TWD; AD 9KIT

3 TWD; C 1COCK DRAIN

1 5SC; 4 WAY VALVE AIR SWITCH

1 TWD; AD 9KIT MINOR

4 5SC; BUCKLE ASSY W STRAPS

1 6ZA; 11 TO 16 VARIABLE STRAP

1 6ZA; 6ZA

6ZA; STRAP 25 44

1 6ZA; 6ZA

1 6ZA; STRAP 16 25

1 2FL; HANDLE DOOR

1 9IP; WINDOW HANDLE M2

1 2RD; FILTER 17 5X5 5 MASTER PK 2

1 9XX; AC FREON 10199801

2 9XX; AC FREON 10199801

#### **Service Requests:**

03/15/2020 SERVICE REQUEST / 18: LEAKING / REPAIRED

PUMP DESCRIPTION DISCHARGE #1 WILL NOT SHUT, SE11 IS AT STATION 73

CSHOP-2020-1563

Comments: SPARE ENGINE AT 73 BRAKES SNAP AND PULL SEVERELY WHEN FIRMLY APPLYING CAB A/C INOP TRANS RETARDER

**LEAKING** 

Date Opened: 3-18-2020 Date Finished 4-27-2020 Meter 1 Reading: 103,311

TASKS PERFORMED NO PARTS USED

FIRE PUMP PLUMBING

**Service Requests:** 

03/17/2020 SERVICE REQUEST / 18: LEAKING / REPAIR

BALL BEARING ON SPARE FREIGHTLINER 3' INCH INTAKE ON OFFICER SIDE FELL OUT / LEAKING WHEN HOOKED TO

**HYDRANT** 

CSHOP-2020-1868

Comments: TEMP BATT SPARE AT 74

Date Opened: 4-7-2020 Date Finished 4-15-2020 Meter 1 Reading: 103,024

TASKS PERFORMED NO PARTS USED

TRAVEL TO BE CHARGED TO WORK ORDER

CONTROL VALVE FIRE PUMP

**Service Requests:** 

04/02/2020 SERVICE REQUEST / 12: BROKEN / REPAIR

RELIEF VALVE WHEEL KEEPS GETTING JAMMED WHILE SPINNING.

CSHOP-2020-1913

Date Opened: 4-8-2020 Date Finished 4-27-2020 Meter 1 Reading: 103,311

TASKS PERFORMED Q PARTS

PM SERVICE C

1 TWD; SEPARATR
1 FIL; NAPAGOLD OIL FILTER

1 FIL; FUEL WATER SEPARATOR

1 FIL; NAPAGOLD FUEL FILTER

-1 FIL; NAPAGOLD FUEL FILTER

28 4PC; 15W40 PREMIUM BLUE OIL

CSHOP-2020-2572

Date Opened: 5-14-2020 Date Finished 5-20-2020 Meter 1 Reading: 103,024

TASKS PERFORMED Q PARTS

QUALITY CHECK-REPAIRS

2 LMP; LAMP, RO BPAK

FOAM SYSTEM RETARDER

CSHOP-2020-6251

Date Opened: 12-1-2020 Date Finished 12-14-2020 Meter 1 Reading: 104,536

TASKS PERFORMED Q PARTS

**EQUIPMENT MOUNTING BRACKETS** 

LIGHTING SYSTEM

WIRING ELECTRICAL PARK BRAKE

SIREN

4 1WL; M4 LED FLASHER RED W/CLR LENS

CSHOP-2020-6586

Date Opened: 12-17-2020 Date Finished 12-17-2020 Meter 1 Reading: 104,536

TASKS PERFORMED NO PARTS USED

TRAVEL TO BE CHARGED TO WORK ORDER BATTERY

**Service Requests:** 

12/16/2020 ENGINE / 38: SHORTED / REPAIR

SPARE ENGINE BATT 7 WILL NOT CRANK, THE TRUCK HAS BEEN PLUGGED IN AND ONLY SHOWS ONE BAR ON THE

CHARGING GAUGE

CSHOP-2021-634

Date Opened: 2-4-2021 Date Finished 2-8-2021 Meter 1 Reading: 104,632

TASKS PERFORMED Q PARTS

ROOF 1 BK; SPRAYER

SPOT LIGHTS
QUARTZ LIGHT

-2 MMM; MARINE ADH SEAL WHITE

BATTERY 2 MMM; MARINE ADH SEAL WHITE

CHARGING SYSTEM 2 MMM; MMM

REPAIR FROM PM - DECALS/CLEANLINESS 2 9ES; BULB 150W HALOGEN

SAFTEY-EMERGENCY EQUIPMENT

4 1AD; 1000 CCA 31 SERIES BATTERY

RADIO-2018-523

Comments: REMOVE 10141691, INSTALL 10208466 INTO SE11 - 10155548

Date Opened: 5-21-2018 Date Finished 5-21-2018 Meter 1 Reading: 0

TASKS PERFORMED NO PARTS USED

MOBILE RELATED

Service Requests:

05/21/2018 RADIO / /

REMOVE & INSTALL MOBILE RADIO INTO SPARE ENGINE 11