

1/28/2026
2:45:46 PM

Palm Beach County Fleet Management Asset Maintenance History
10200825 2016 FORD F450 Utility Body, 16,500 Gvwr, Medium Duty Crane

Total Hours: 230.00 Labor: 16,113.50 Parts: 21,883.67 Comm: 15,621.05 Charged: 53618.21

Work Order: 1608734 **Meter:** 362 **In Date:** 08/23/2016 **Closed:** 08/29/2016
Problem: fill def fluid

Work Completed

Parts Issued

Quantity

- Fill def fluid			Def Quart		3.00
- R&r crane rest clean and reseal			Ptex Ultra Grey 3oz		1.00
	Hours: 0.50	Comm: 0.00	Labor: 30.00	Parts: 12.09	Total: 42.09

Work Order: 1609295 **Meter:** 363 **In Date:** 09/07/2016 **Closed:** 09/07/2016
Problem: 1061 - Pre Delivery Inspection

Work Completed

- Pre Delivery Inspection					
	Hours: 3.00	Comm: 0.00	Labor: 180.00	Parts: 0.00	Total: 180.00

Work Order: 1610408 **Meter:** 384 **In Date:** 10/04/2016 **Closed:** 10/13/2016
Problem: remove rack from old truck install on new truck

Work Completed

Parts Issued

Quantity

- remove old rack and install on new truck. seal all holes			Marine Adh Seal White		1.00
- Shop Supplies			Shop Supplies		1.00
	Hours: 3.00	Comm: 0.00	Labor: 180.00	Parts: 17.39	Total: 197.39

Work Order: 1611471 **Meter:** 1065 **In Date:** 11/04/2016 **Closed:** 11/07/2016
Problem: Replace rear tire

Work Completed

- rear tire					
	Hours: 0.00	Comm: 426.40	Labor: 0.00	Parts: 0.00	Total: 426.40

1/28/2026
2:45:46 PM

Palm Beach County Fleet Management Asset Maintenance History
10200825 2016 FORD F450 Utility Body, 16,500 Gvwr, Medium Duty Crane

Work Order: 1613070 **Meter:** 2281 **In Date:** 12/27/2016 **Closed:** 02/16/2017
Problem: Step, Strobe, And Vice

Work Completed

- Weld fab new rear step and install vice on rear bumper
- Fab strobe light bracket and install strobe
- Def
- Shop Supplies

Parts Issued

Quantity

Gray Sea	1.00
Gl Whit	1.00
Strobe Lp Led	1.00
Ridgid Vise 6inch F-60	1.00
Fab Loom-split Poly	8.00
Def Bulk Qts	8.00
Shop Supplies	1.00

Hours: 16.50

Comm: 0.00

Labor: 990.00 Parts: 802.46 Total: 1,792.46

Work Order: 1706181 **Meter:** 6325 **In Date:** 06/22/2017 **Closed:** 07/25/2017
Problem: pm

Work Completed

- pm
- pm crane
- add Def
- Shop Supplies

Parts Issued

Quantity

15-40 Oil	15.00
Napagold Oil Filter	1.00
Napagold Fuel Filter	1.00
Air Filter (gold), Air Panel	1.00
Wiper Blade	2.00
Washer Fluid Concentr	1.00
Napa Hydraulic Filtr	1.00
Def Bulk Qts	15.00
Shop Supplies	1.00

Hours: 6.50

Comm: 0.00

Labor: 390.00 Parts: 155.98 Total: 545.98

1/28/2026
2:45:46 PM

Palm Beach County Fleet Management Asset Maintenance History
10200825 2016 FORD F450 Utility Body, 16,500 Gvwr, Medium Duty Crane

Work Order: 1804196
Problem: pm

Meter: 12727

In Date: 04/23/2018 **Closed:** 05/17/2018

Work Completed

- Pm
- Pm Crain
- Def
- Test Run
- Repair strobe light
- Shop Supplies

Parts Issued

Quantity

15-40 Oil	15.00
Non-chlor Brake Clnr	3.00
Napagold Oil Filter	1.00
Napagold Fuel Filter	1.00
Air Filter (gold), Air Panel	1.00
Used Fire X Refurbished	1.00
Wiper Blade	2.00
Washer Fluid Concentr	1.00
Napa Hydraulic Filtr	1.00
Aw68 Hydro Fluid Hydr	5.00
Blue Df	2.00
Shop Supplies	1.00

Hours: 8.00

Comm: 0.00

Labor: 480.00

Parts: 193.70

Total: 673.70

1/28/2026
2:45:46 PM

Palm Beach County Fleet Management Asset Maintenance History
10200825 2016 FORD F450 Utility Body, 16,500 Gvwr, Medium Duty Crane

- Recall: Emissions Recall 20e08: The Diesel Particulate Filter may develop a crack during regeneration, which may result in loss of filtration and efficiency.
- Recall: Safety Recall 22s35 Dust contamination in clockspring causing air bag light.
- Recall: Safety Recall # 22s35/22v337 Parts now available for dust contamination to clock spring air bag system
- Replaced both hood struts.
- Crankcase filter replacment.
- Found starter to be faulty removed and replaced starter assembly..
- Remove and replace oil filter housing seal.
- Add def
- Remove and replaced leaking batteries and replaced battery hold downs.
- Replaced license plate light found leds to be damaged
- Upon inspection found all cab mounts to be completely deteriorated Removed and replaced all cab mounts. Torched and removed siezed cab bolts had to remove front end to gain access to stripped hardware internally.
- Upon inspection found hydraulic tank hose to have dry rot cracks followed by the cab resting on hoses due to bad cab mounts causing leaks from hydraulic hoses..
- Replaced front bump stops.
- Replaced rear bump stops
- Found pintle pin to be missing replaced pintle pin..
- Found ac system to have a leak removed and replaced ac compressor, condenser evaporator, blower motor, blower motor resistor and actuators. along with heater core and lines.
- Cooling system service
- crane pm
- Hitch ball loose and threads damaged. R&r hitch ball.
- Taillights more then 50% out removed and replaced tail lights
- to ford 2xs
- Shop Supplies

Parts Issued	Quantity
Non-chlor Brake Clnr	4.00
Air Filter (gold), Air Panel	1.00
Hot Shot's Lx4	1.00
Fuel Filter	1.00
Washer Fluid Concentr	1.00
Wiper Blade	2.00
Blue Df	2.00
Battery Bracket	2.00
Battery	2.00
Vert Led Tag Light	1.00
Lift Support	1.00
Lift Support	1.00
Separator	1.00
Starter	1.00
Gasket	1.00
Hose Made Mako	1.00
Bumper Stop	2.00
Bummpet Stop	2.00
Pintle Pin W/clip	1.00
A/c Condenser	1.00
Blower Motor	1.00
A/c Compressor	1.00
Evaporator Core	1.00
A/c Resistor	1.00
A/c Actuator	1.00
A/c Door Actuator	1.00
Seal	1.00
Seal Kits	5.00
Kit O	1.00
clamp	1.00

1/28/2026
2:45:46 PM

Palm Beach County Fleet Management Asset Maintenance History
10200825 2016 FORD F450 Utility Body, 16,500 Gvwr, Medium Duty Crane

Parts Issued	Quantity
Napa Hydraulic Filtr	1.00
Cab Mounts	1.00
degas tank	1.00
Coolent	4.00
Distilled Water 1gal	4.00
A/ctube Assy	1.00
Line	1.00
A/c Suction Hose	1.00
sensor	1.00
Led Sup Mdl 44 42 Dio	2.00
2141 Hitch Ball 1in	1.00
Shop Supplies	1.00
Hours: 52.00	Comm: 0.00
Labor: 3,796.00	Parts: 4,343.60
Total: 8,139.60	

Work Order: 2408978 **Meter:** 49133 **In Date:** 09/18/2024 **Closed:**

Problem: Replace the driver seat.

Work Completed

- Operator states stitching coming apart removed and replaced all three seats

Hours: 0.00 Comm: 0.00 Labor: 0.00 Parts: 0.00 Total: 0.00

Work Order: 2410939 **Meter:** 50072 **In Date:** 11/14/2024 **Closed:** 06/30/2025

Problem: Transmission not engaging/low power, wire hanging under truck. A/C blowing hot. Needs to go to SE Shop

Work Completed

- Pm Service
- Transmission service operator states transmission not engaging
- operator states ac system not operating
- Remove and replaced damaged pto wiring
- Found pto hoses to be leaking and fittings to be damaged removed and replaced fittings and hoses

Parts Issued	Quantity
oil auto	17.00
trans pan gasket	1.00
Transmission Filter	1.00
Hose Made Mako	1.00
Coolent	8.00
Distilled Water 1gal	8.00
Radiator	1.00
Thermostat	2.00

1/28/2026
2:45:46 PM

Palm Beach County Fleet Management Asset Maintenance History
10200825 2016 FORD F450 Utility Body, 16,500 Gvwr, Medium Duty Crane

- upon ac system inspection found fan clutch to be faulty and found radiators to be leaking removed and replaced fan clutch and all related pulleys and belts
- Add Def and conditioner
- Repair a/c system
- Replaced both headlight bulbs
- Found front brakes to be low on pad life and rotors to be damaged removed and replaced front brakes
- found rear brakes to be worn removed and replaced rear brake pads calipers and rotors along with new seals
- Service Rear axle assembly
- To Ford for repairs
- repair by Ford
- test run
- Installed second secondary radiator after Ford lifted cab and cracked radiator upon reinstallation. was told to install new radiator as its to late to return it to ford. Disassembled front end and replaced secondary radiator along with seals and cool
- Shop Supplies

Parts Issued	Quantity
Radiator Hose	2.00
Radiator Hose	1.00
clutch assy	1.00
radiator	1.00
Cap Assy	1.00
Cleaner Coolent	2.00
Washer Fluid Concentr	1.00
Wiper Blade	2.00
15-40 Oil	15.00
Napagold Oil Filter	1.00
Air Filter (gold), Air Panel	1.00
Used Fire X Refurbished	1.00
Non-chlor Brake Clnr	6.00
Hot Shot's Lx4	1.00
Fuel Filter	1.00
Pto Pressure Switch	1.00
Non-chlor Brake Clnr	5.00
Pump Assy	1.00
Blue Df	2.00
Non-chlor Brake Clnr	3.00
Ester Oil	1.00
A/c Condenser	1.00
A/c Compressor	1.00
Seal	1.00
Seal Kits	2.00
Wire Asm	1.00
H13/9008 Led Light	2.00
Front Rotor	2.00
Pads Front	1.00
Rear Brake Caliper	1.00

1/28/2026
2:45:46 PM

Palm Beach County Fleet Management Asset Maintenance History
10200825 2016 FORD F450 Utility Body, 16,500 Gvwr, Medium Duty Crane

Parts Issued	Quantity
Front Brake Caliper	1.00
Brake Rotor	2.00
Friction Modifier	2.00
75w140 Ford Axle Lube	4.00
Oil Seal	2.00
F81z1001ba Seal Ring	2.00
Front Brake Caliper	1.00
Rear Brake Caliper	1.00
Pads Front	1.00
Brake Shoes	1.00
Clock Spring	1.00
Steering Wheel	1.00
Radiator	1.00
Cover	1.00
Shop Supplies	1.00

Hours: 44.00 Comm: 8,418.32 Labor: 3,212.00 Parts: 7,958.24 Total: 19,588.56

Work Order: 2503107 **Meter:** 49980 **In Date:** 03/28/2025 **Closed:** 04/04/2025
Problem: Tow-Transport to dealership from HE Shop

Work Completed

- Tow From: Vista Fleet He Shop To: Al Packer Ford - 1530 N Military Trl,
Wpb

Hours: 0.00 Comm: 216.00 Labor: 0.00 Parts: 0.00 Total: 216.00

Work Order: 2506689 **Meter:** 50072 **In Date:** 07/10/2025 **Closed:** 07/18/2025
Problem: Tires: All Wear. Replace Tire

Work Completed

- Tire Service: jpp Problem: Tires: All Wear. Replace Tire

Hours: 0.00 Comm: 2,309.10 Labor: 0.00 Parts: 0.00 Total: 2,309.10

Work Order: 2507927 **Meter:** 50290 **In Date:** 08/25/2025 **Closed:** 11/10/2025
Problem: PM/Check engine light is on/door ajar light on constantly

1/28/2026
2:45:46 PM

Palm Beach County Fleet Management Asset Maintenance History
10200825 2016 FORD F450 Utility Body, 16,500 Gvwr, Medium Duty Crane

Work Completed

Parts Issued

Quantity

- Preventive Maint. Service (mobile tech svcs. and repairs)
- crane Pm
- crankcase filter svc.
- Ps fluid svc.
- add Def
- check engine light on - needed regen. codes for nox, temp. perform regen. ok at this time.
- door ajar light on constantly - adjust. ok .
- steering loose - replace steering and track bar. replace shocks, stabilizer, and sway bar links
- alignment
- stickers unreadable on crane - replace 2 angle and chart stickers
- to weber
- test drive / check over / order parts
- a/c warm - found leak at shraider valve. replace and recharge.
- Shop Supplies

15-40 Oil	15.00
Used Fire X Refurbished	1.00
Napagold Oil Filter	1.00
Air Filter (gold), Air Panel	1.00
Fuel Filter	1.00
Wiper Blade	2.00
Napa Hydraulic Filtr	1.00
Aw68 Hydro Fluid Hydr	15.00
Separator	1.00
Fluld Trans Oil	2.00
Blue Df	1.00
Reservoir	1.00
Track Bar	1.00
Damper Asy	1.00
Rod	1.00
End Assy	1.00
Tube Asm	1.00
Rod Asm	1.00
Tie Rod End	1.00
Nut	2.00
Nut	1.00
Nut	1.00
Link	2.00
Ball Joint	1.00
Draglink	1.00
Front Shock Absorber	4.00
Angle Sticker	1.00
Decal	1.00
Decal-loadchart	1.00
Sway Bar Buching	2.00

1/28/2026
2:45:46 PM

Palm Beach County Fleet Management Asset Maintenance History
10200825 2016 FORD F450 Utility Body, 16,500 Gvwr, Medium Duty Crane

Parts Issued	Quantity
Insulator Nut	2.00
Freon He Shop	3.00
A/c Cap	1.00
Cap	1.00
Valve	1.00
High Side Schrader Valve	1.00
Parts And Service Weber Wheel	1.00
Shop Supplies	1.00
Labor: 1,204.50	Parts: 2,627.72
Total: 6,218.91	

Hours: 16.50 Comm: 2,386.69

Work Order: 2511268 **Meter:** 50358 **In Date:** 12/04/2025 **Closed:** 12/17/2025
Problem: Remove welder (10210635) from this asset to be installed onto new asset (CA2-37597)

Work Completed

Parts Issued	Quantity
Shop Supplies	1.00

- remove old welder from asset , use forklift to transport from parking lot to shop area.
- Shop Supplies

Hours: 4.00 Comm: 0.00 Labor: 292.00 Parts: 2.65 Total: 294.65

Work Order: 2511749 **Meter:** 50358 **In Date:** 12/18/2025 **Closed:** 12/18/2025
Problem: Transition Prep Charge

Work Completed

Labor: 146.00	Parts: 0.00	Total: 146.00
---------------	-------------	---------------

- Transition Prep Charge

Hours: 2.00 Comm: 0.00

Total Hours: 230.00 Total Labor: 16,113.50 Total Comm: 15,621.05 Total Parts: 21,883.67