



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 4



Work Order No. 56598041
Invoice No. 55345 - 56598041

Client Department:

Department: 55345M

Work Order Description

Driver said bus shut off on get on the ramp to 195

Requested By: HPIERRE

Created By: HPIERRE

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 2 - Medium

Driver:

Phone:

ETA:

Meter: 324,024 - DH

Chronology

Reported	Apr 7, 2023 12:45:12 PM	Apr 7, 2023 12:45:12 PM
Started	Apr 7, 2023 12:47:00 PM	
Completed	Apr 17, 2023 8:25:00 PM	Apr 17, 2023 8:25:00 PM
Down Time		

Work Order Notes

Line 10 To file warranty be sure to do the following:

- 1) Enter a COMPLAINT statement for each activity.
- 2) Enter CAUSE statement in the Notes field of each activity.
- 3) Enter CORRECTION statement in the Comment section of each activity.

Complaint: driver said bud dhut off on getting on l 95

Cause: preventive maintenance

Correction: need raduis arms bushing both, hydro booster , sharks valve cover gasket both side ,upper radiator hose ,tie rod end both, heater hose leaking ,ball joint both side ,draing plug leaking and control arm completed
Line 20 Remove and replaced upper radiator hose. Refilled coolant to spec.

Remove and replaced hydro boost assembly. Refilled power steering to spec. Line 30 Unable to duplicate at this time Line 40 Remove and replaced Left and Right side valve covers.

Remove and replaced both coolant heater hose assemblies.

Activity Header

Activity: 5 999 TOTAL VEHICLE

Activity Note: Personal Risk Assessment

Reason for Repair: SW Shop Work Order

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
07-Apr-23	Pierre,Hubert J	0.73	65	47.45

Activity Sublet

No Data Available

Activity Checklist

Check List																				
5 Desc: Personal Risk Assessment																				
Task: PRA and Meter Readings Performed by: EARJOHNSON Performed on: 09-APR-23																				
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO														
1 - Are you properly trained to perform the task?	Done		EARJOHNSON	Apr 9, 2023 6:58:48 PM	No															
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		EARJOHNSON	Apr 9, 2023 6:58:48 PM	No															
4 - Are you wearing the appropriate PPE?	Done		EARJOHNSON	Apr 9, 2023 6:58:48 PM	No															
7 - Have you performed the proper LOTO?	Done		EARJOHNSON	Apr 9, 2023 6:58:48 PM	No															
10 - Are you aware of the potential risks of performing this repair?	Done		EARJOHNSON	Apr 9, 2023 6:58:48 PM	No															
11 - Have you successfully completed the Personal Risk Assessment?	Done		EARJOHNSON	Apr 9, 2023 6:58:48 PM	No															
Activity Sub Total																				
			<table border="1"> <thead> <tr> <th colspan="2">Activity 5 Sub Total</th> </tr> </thead> <tbody> <tr> <td>Parts:</td> <td>0.00</td> </tr> <tr> <td>Labor:</td> <td>47.45</td> </tr> <tr> <td>Labor Hours:</td> <td>0.73</td> </tr> <tr> <td>Sublet Parts:</td> <td>0.00</td> </tr> <tr> <td>Sublet Labor:</td> <td>0.00</td> </tr> <tr> <td>Activity Sub Total</td> <td>47.45</td> </tr> </tbody> </table>				Activity 5 Sub Total		Parts:	0.00	Labor:	47.45	Labor Hours:	0.73	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	47.45
Activity 5 Sub Total																				
Parts:	0.00																			
Labor:	47.45																			
Labor Hours:	0.73																			
Sublet Parts:	0.00																			
Sublet Labor:	0.00																			
Activity Sub Total	47.45																			



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 4



Work Order No. 56598041
Invoice No. 55345 - 56598041

Client Department:

Department: 55345M

Work Order Description

Driver said bus shut off on get on the ramp to 195

Requested By: HPIERRE

Created By: HPIERRE

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 2 - Medium

Driver:

Phone:

ETA:

Meter: 324,024 - DH

Activity Header

Activity: 15 999 TOTAL VEHICLE

Activity Note: HYDROBOST LEAKING

Reason for Repair: 08 Preventive Maintenance

Work Accomplished:

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
07-Apr-23	DC2Z-2005-A	BOOSTER, BRAKE, POWER, HYDRAULIC SAME AS BRB-103	1	204.91	204.91

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
09-Apr-23	Earl Johnson	2.72	65	176.8

Activity Sublet

No Data Available

Activity Checklist

No Data Available

No Data Available

Activity Sub Total

Activity 15 Sub Total	
Parts:	204.91
Labor:	176.80
Labor Hours:	2.72
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	381.71



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 4



Work Order No. 56598041
Invoice No. 55345 - 56598041

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Driver said bus shut off on get on the ramp to 195		Ford E450 Champion Challenger	
Requested By:	HPIERRE	Status:	40 - Closed (40)
Created By:	HPIERRE	Priority:	2 - Medium
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	324,024 - DH

Activity Header
Activity:25 999 TOTAL VEHICLE
Activity Note: VALVE COVERS LEAKING OIL
Reason for Repair: 03 Consumption, Oil
Work Accomplished:
Part Failure:
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
17-Apr-23	BC2Z-18472-CA	TUBE, HEATER, WATER	1	57.45	57.45
07-Apr-23	DC2Z-6582-D	COVER, VALVE, LH, V10	1	96.6	96.6
17-Apr-23	BC2Z-18472-DA	TUBE, HEATER, WATER	1	56.91	56.91
07-Apr-23	DC2Z-6582-C	COVER, VALVE, RH, V10	1	87.15	87.15

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
16-Apr-23	Earl Johnson	3.55	65	230.75
14-Apr-23	Earl Johnson	0.78	65	50.7
16-Apr-23	Earl Johnson	4.8	65	312
17-Apr-23	Earl Johnson	4.28	65	278.2

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available

Activity Sub Total		Activity 25 Sub Total	
		Parts:	298.11
		Labor:	871.65
		Labor Hours:	13.41
		Sublet Parts:	0.00
		Sublet Labor:	0.00
		Activity Sub Total	1,169.76



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 4 of 4



Work Order No. 56598041
Invoice No. 55345 - 56598041

Client Department:

Department: 55345M

Work Order Description

Driver said bus shut off on get on the ramp to 195

Requested By: HPIERRE

Created By: HPIERRE

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 2 - Medium

Driver:

Phone:

ETA:

Meter: 324,024 - DH

Activity Header

Activity: 35 042/999 COOLING SYSTEM, GENERAL

Activity Note: UPPER RADIATOR HOSE

Reason for Repair: 05 Inspection, Routine

Work Accomplished:

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
10-Apr-23	KM-4590	HOSE, RADIATOR, UPPER, FORD	1	15.53	15.53

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
08-Apr-23	Earl Johnson	1.23	65	79.95
07-Apr-23	Earl Johnson	2.22	65	144.3

Activity Sublet

No Data Available

Activity Checklist

No Data Available

No Data Available

Activity Sub Total

Activity 35 Sub Total

Parts:	15.53
Labor:	224.25
Labor Hours:	3.45
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	239.78

Work Order Footer

Work Order 56598041 Total

Parts:	518.55
Labor:	1,320.15
Labor Hours:	20.31
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	1,838.70



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 56576861
Invoice No. 55345 - 56576861

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Drive side head lamp out		Ford E450 Champion Challenger	
Requested By:	JUHURST	Status:	40 - Closed (40)
Created By:	JUHURST	Priority:	2 - Medium
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	323,313 - DH

Chronology		
Reported	Apr 3, 2023 1:40:21 PM	Apr 3, 2023 1:40:21 PM
Started	Apr 3, 2023 1:44:00 PM	
Completed	Apr 3, 2023 2:09:00 PM	Apr 3, 2023 2:09:00 PM
Down Time		

Work Order Notes

- Line 10 To file warranty be sure to do the following:
- 1) Enter a COMPLAINT statement for each activity.
 - 2) Enter CAUSE statement in the Notes field of each activity.
 - 3) Enter CORRECTION statement in the Comment section of each activity.

Complaint: Vehicle in left head lamp out

Cause: blown out

Correction: Removed and and replace new lamp part # H13 after return vehicle back to work

Activity Header							
Activity:5 999 TOTAL VEHICLE							
Activity Note: Personal Risk Assessment							
Reason for Repair: SW Shop Work Order							
Work Accomplished: 06 Inspect							
Part Failure:							
Activity Comments:							
Activity Parts							
No Data Available							
Activity Labor							
No Data Available							
Activity Sublet							
No Data Available							
Activity Checklist							
Check List							
5 Desc: Personal Risk Assessment							
Task: PRA and Meter Readings Performed by: JUHURST Performed on: 03-APR-23							
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO	
1 - Are you properly trained to perform the task?	Done		JUHURST	Apr 3, 2023 2:07:16 PM	No		
2 - If task requires lifting, are lifts secured, are jack	Done		JUHURST	Apr 3, 2023	No		

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
stands used correctly?				2:07:16 PM		
4 - Are you wearing the appropriate PPE?	Done		JUHURST	Apr 3, 2023 2:07:16 PM	No	
7 - Have you performed the proper LOTO?	Done		JUHURST	Apr 3, 2023 2:07:16 PM	No	
10 - Are you aware of the potential risks of performing this repair?	Done		JUHURST	Apr 3, 2023 2:07:16 PM	No	
11 - Have you successfully completed the Personal Risk Assessment?	Done		JUHURST	Apr 3, 2023 2:07:16 PM	No	

Activity Sub Total

Activity 5 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 56576861
Invoice No. 55345 - 56576861

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Drive side head lamp out		Ford E450 Champion Challenger	
Requested By:	JUHURST	Status:	40 - Closed (40)
Created By:	JUHURST	Priority:	2 - Medium
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	323,313 - DH

Activity Header
Activity: 15 030 ELECTRICAL GROUP
Activity Note: Drive side lamp out
Reason for Repair: 11 Routine
Work Accomplished:
Part Failure:
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
03-Apr-23	H13BP	BULB, HEADLAMP, HALOGEN	1	13.2	13.2

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
03-Apr-23	Junior Hurst	0.4	65	26

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available

Activity Sub Total		Activity 15 Sub Total	
Parts:			13.20
Labor:			26.00
Labor Hours:			0.40
Sublet Parts:			0.00
Sublet Labor:			0.00
Activity Sub Total			39.20

Work Order Footer		Work Order 56576861 Total	
Parts:			13.20
Labor:			26.00
Labor Hours:			0.40
Sublet Parts:			0.00
Sublet Labor:			0.00
Activity Sub Total			39.20



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 56515052
Invoice No. 55345 - 56515052

Client Department:
Department: 55345M
Work Order Description
FOLLOWUP-FT Medium Duty
Requested By: EARJOHNSON
Created By: EARJOHNSON
Assigned To:
Class: -
Arrangement: Unassigned
Potential Warranty: No

Equipment No.: 4514-P
VIN: 1FDFE4FS7EDB17176
Ford E450 Champion Challenger
Status: 40 - Closed (40)
Priority: 3 - High
Driver:
Phone:
ETA:
Meter: 321,669 - DH

Chronology		
Reported	Mar 16, 2023 8:41:23 PM	Mar 16, 2023 8:41:23 PM
Started	Mar 16, 2023 9:45:00 PM	
Completed	Mar 17, 2023 12:22:00 AM	Mar 17, 2023 12:22:00 AM
Down Time		

Work Order Notes

Line 10 Rotated RF tire to LRO. Replaced RF tire. Mounted, balanced, installed and torqued to spec.
Part# 192659 Qty.1. Line 20 Resecured bridgeplate hinge bolt and lubricated.

No propane fuel caps in stock.

Activity Header				
Activity: 10 017/009 INFLATION & MONITORING, PRESSURE, TIRE				
Activity Note: LRO tire tread depth below spec, rotated RF to LRO.				
Reason for Repair: FW Follow Up				
Work Accomplished:				
Part Failure:				
Activity Comments:				
Activity Parts				
No Data Available				
Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
16-Mar-23	Earl Johnson	0.62	65	40.3
Activity Sublet				
No Data Available				
Activity Checklist				
No Data Available				
No Data Available				
Activity Sub Total				
			Activity 10 Sub Total	
			Parts:	0.00
			Labor:	40.30
			Labor Hours:	0.62
			Sublet Parts:	0.00
			Sublet Labor:	0.00
			Activity Sub Total	40.30



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 56515052
Invoice No. 55345 - 56515052

Client Department:			
Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FD4E4FS7EDB17176
FOLLOWUP-FT Medium Duty			Ford E450 Champion Challenger
Requested By:	EARJOHNSON	Status:	40 - Closed (40)
Created By:	EARJOHNSON	Priority:	3 - High
Assigned To:		Driver:	
Class:	-	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	321,669 - DH

Activity Header
Activity:30 044/001/001 TANK, FUEL, LIQUID
Activity Note: No fuel cap.
Reason for Repair: FW Follow Up
Work Accomplished:
Part Failure:
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
17-Mar-23	192659	TIRE, LT225/75R16, R500 HD, BSW, E/10PR, DURAVIS, BRIDGESTONE	1	149.41	149.41

Activity Labor
No Data Available

Activity Sublet
No Data Available


Activity Checklist
No Data Available
No Data Available

Activity Sub Total		Activity 30 Sub Total	
Parts:	149.41	Labor:	0.00
Labor Hours:	0.00	Sublet Parts:	0.00
Sublet Labor:	0.00	Sublet Labor:	0.00
Activity Sub Total		149.41	

Work Order Footer		Work Order 56515052 Total	
Parts:	149.41	Labor:	40.30
Labor Hours:	0.62	Sublet Parts:	0.00
Sublet Labor:	0.00	Sublet Labor:	0.00
Activity Sub Total		189.71	



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 56195703
Invoice No. 55345 - 56195703

Client Department:

Department: 55345M

Work Order Description
55345-MEDIUM DUTY PMA

Requested By: SPACE

Created By: SPACE

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 3 - High

Driver:

Phone:

ETA:

Meter: 321,669 - DH

Chronology

Reported	Mar 16, 2023 12:00:00 AM	Mar 16, 2023 12:00:00 AM
Started	Mar 16, 2023 3:47:00 PM	
Completed	Mar 16, 2023 9:44:00 PM	Mar 16, 2023 9:44:00 PM
Down Time		

Work Order Notes

Line 10 Complaint: PM A service.

Cause: Due by mileage.

Correction: LOF engine oil and filter. Performed tire and brake inspection.

Activity Header

Activity: 5 999/999/999 TOTAL VEHICLE

Activity Note: Personal Risk Assessment

Reason for Repair: SW Shop Work Order

Work Accomplished: 06 Inspect

Part Failure: 00 No Failure

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: Personal Risk Assessment

Task: PRA and Meter Readings Performed by: EARJOHNSON Performed on: 16-MAR-23

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		EARJOHNSON	Mar 16, 2023 9:38:59 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		EARJOHNSON	Mar 16, 2023 9:38:59 PM	No	
4 - Are you wearing the appropriate PPE?	Done		EARJOHNSON	Mar 16, 2023 9:38:59 PM	No	
7 - Have you performed the proper LOTO?	Done		EARJOHNSON	Mar 16, 2023 9:38:59 PM	No	
10 - Are you aware of the potential risks of performing this repair?	Done		EARJOHNSON	Mar 16, 2023 9:38:59 PM	No	
11 - Have you successfully completed the	Done		EARJOHNSON	Mar 16, 2023	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO	
Personal Risk Assessment?				9:38:59 PM			
Activity Sub Total				Activity 5 Sub Total			
				Parts:		0.00	
				Labor:		0.00	
				Labor Hours:		0.00	
				Sublet Parts:		0.00	
				Sublet Labor:		0.00	
				Activity Sub Total		0.00	



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 56195703
Invoice No. 55345 - 56195703

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
55345-MEDIUM DUTY PMA		Ford E450 Champion Challenger	
Requested By:	SPACE	Status:	40 - Closed (40)
Created By:	SPACE	Priority:	3 - High
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	321,669 - DH

Activity Header
Activity:10 999/999/999 TOTAL VEHICLE
Activity Note: Medium Duty PM Inspection
Reason for Repair: 08 Preventive Maintenance
Work Accomplished:
Part Failure:
Activity Comments:

Activity Parts
No Data Available

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
16-Mar-23	Earl Johnson	4.08	65	265.2

Activity Sublet
No Data Available

Check List						
10 Desc: Medium Duty PM Inspection Task: First Transit North America Medium Duty PM Inspection Sheet Performed by: EARJOHNSON Performed on: 16-MAR-23						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,000 - SECTION 1 - Preparation Inspection	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
10,100 - INSPECT_Auto-Transmission Operation/Controller; Neutral Safety Switch	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
10,200 - !FRA!INSPECT_Starter Operation	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
10,300 - !FRA!INSPECT_Warning Lights and Alarms	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
10,400 - !FRA!INSPECT_Back Up Alarm	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
10,500 - !FRA!INSPECT_Engine Operation, OBSERVE_Exhaust for Excessive Smoke	Done		EARJOHNSON	Mar 16, 2023	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
				8:41:22 PM		
10,600 - Check Driver's Pre-trip or DVIR/EVIR & Authorization Forms	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
10,700 - INSPECT_All Exterior Lights (Turn on until Completion of this section)	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
10,800 - CHECK_All Destination Signage	-	NA	EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
10,900 - *RPT*INSPECT_Body Damage, Corrosion;DOCUMENT_Issues	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
11,000 - INSPECT_Fuel Tank Cap, and Doors	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
11,200 - INSPECT_License Plate, Bracket, Bumpers	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
20,000 - SECTION 2 - Test Drive and Operator Area Inspection	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
20,100 - INSPECT_Driver Seat condition/operation/seatbelt	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
20,200 - CHECK_Public Address System	-	NA	EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
20,300 - TEST DRIVE_INSPECT_Proper Operation; Drive into Shop	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
20,400 - *RPT*INSPECT_Steering Wheel for Play,Bind; Horn Op; Turn Signal Cancelation	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
20,500 - PERFORM_Brake Test (Apply hard enough to check wheel pull and Application)	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
20,600 - RECORD_Brake Performance Test E.T.	Second*	NA	EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
20,700 - RECORD_Brake Performance Test Speed	Miles per Hour	NA	EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
20,800 - RECORD_Brake Performance	FEET	NA	EARJOHNSON	Mar 16,	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
Test Distance				2023 8:41:22 PM		
20,900 - RECORD_Brake Performance Test Adj Distance (20mph)	FEET	NA	EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
21,000 - RECORD_Brake Performance Test Ave GX	Gravitational Force	NA	EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
21,100 - ADD_Image of Brake Test Results to PM Work Order	-	NA	EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
21,200 - *RPT*FRA INSPECT_Lighting/Operation of all Gauges	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
21,300 - *RPT*INSPECT_Windshields, Sun Visors	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
21,400 - INSPECT_Wiper/Washer Operation, Condition	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
21,500 - INSPECT_High Idle Control	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
21,600 - *RPT*!FRA!INSPECT_HVAC Controls, Operation	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
21,700 - *RPT*!FRA!INSPECT_Operation of all Switches and Accessories	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
21,800 - INSPECT_Parking Brake Operation	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
21,900 - !FRA!TEST_Service Brake Backup System (Stationary Brake Tests HYD)	-	NA	EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
22,000 - INSPECT_VIN, Tire Pressure Decal, Data Tags	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
22,100 - *RPT*INSPECT_Drivers Door Hinges, Handles, Controls and Panels	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
22,200 - !FRA!INSPECT_Under Dash Wiring for Proper Routing/Chafing/Securement	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
22,250 - INSPECT_Driver Floor Area for Water Leaks	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
22,300 - *RPT*INSPECT for WEAR_Pedal Pads, Accelerator, Brake, Parking Brake	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
22,400 - INSPECT_Engine Fault Codes	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
30,000 - SECTION 3 - EXTERIOR INSPECTION	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
31,000 - SSF (Street Side Front)	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
31,010 - *RPT*!FRA!INSPECT_Mirror Mountings, Brackets, Glass	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
31,020 - *RPT*INSPECT_FRONT Springs, Shocks, Spring Shackles	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
31,030 - INSPECT_Mud Flaps, Brackets	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
31,040 - INSPECT_Wiper Blades, Arms	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
32,000 - Engine Inspection	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
32,010 - INSPECT_Hood, Springs and Props	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
32,020 - !FRA!INSPECT_Engine Compartment Condition for Fire Risk Avoidance	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
32,030 - !FRA!INSPECT_for Fluid Leaks, Levels	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
32,040 - !FRA!INSPECT_Hyd_Brake Fluid with Test Strips	-	NA	EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
32,050 - !FRA! INSPECT_RECORD_Coolant Recovery with Refractometer; Test Strips	Degree Fahrenheit	NA	EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
32,060 - PRESSURE TEST_Cooling Systems (Radiator, Cap, hoses and clamps)	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
32,070 - *RPT*INSPECT_Radiator and Mountings, Cores	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
32,080 - *RPT*INSPECT_Fan Assembly, Shroud, Tensioner, Belts, All Belt Driven Components	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
32,090 - *RPT*!FRA!INSPECT_Mounting, Installation of Alternator, AC Compressor	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
32,100 - INSPECT_Intake System	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
32,140 - *RPT*!FRA!RECORD_Underhood Battery Voltages (volts)	13 Volt*	At idle, with loads.	EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
33,000 - CSF (Curb Side Front)	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
33,010 - *RPT*!FRA!INSPECT_Mirror Mountings, Brackets, Glass	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
33,020 - *RPT*INSPECT_FRONT Springs, Shocks, Spring Shackles	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
33,030 - INSPECT_Mud Flaps, Brackets	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
33,040 - INSPECT_Wiper Blades, Arms	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
33,050 - !FRA!INSPECT_LUBE_Battery Box, Batteries, Tray Slides, Hold Downs	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
33,060 - *RPT*!FRA!RECORD_Side Mounted Battery Voltages (volts)	12.6 Volt*		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
33,070 - INSPECT_Entry door, OPEN_with external lock/switch (if equipped)	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
40,000 - SECTION 4 - Interior Inspection	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
40,100 - *RPT*INSPECT_Step-Well, Step-Tread, Hand Rails, Step-well Light	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
40,200 - INSPECT_Insurance/Registration/Regulatory Forms Dates	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
40,250 - INSPECT_Overhead Compartment for Water Leaks	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
40,300 - INSPECT_Safety Equipment, Fire Extinguisher/Suppression	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
40,400 - INSPECT_Camera Systems, Filter, Electrical Inputs/Outputs-SOP M038	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
40,600 - !FRA!CHECK for HOTSPOTS_Interior Elec Panel Fuses/Circuit Breakers/Connectors	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
40,700 - CHECK_Passenger Stop Request System	-	NA	EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
40,800 - *RPT*INSPECT_Seats, Covering, Belts, Loose Cushions, Operation	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
40,900 - *RPT*!FRA!INSPECT_Interior Lights; Mirrors	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
41,000 - !FRA!INSPECT_Interior Cleanliness/Potential Projectiles	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
41,100 - INSPECT_All ADA Equip (Lift Seat Belt, floor hold Downs, Belts, Cover, Alarms)	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
41,200 - INSPECT_CLEAN_AC Filter	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
41,300 - INSPECT_Emergency Windows, Hatches, Doors, Associated Alarms and Lights	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
41,400 - *RPT*INSPECT_Interior Body, Floor, Stanchions	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
41,500 - *RPT*INSPECT_Passenger Doors, Glass, Seal	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
50,000 - SECTION 5 - UNDER VEHICLE INSPECTION	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
50,100 - *RPT*INSPECT_Steering components-Drag Link, Tie Rods ends and Steering Damper	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
50,200 - INSPECT_Ball Joint Play	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
50,300 - !FRA!INSPECT_Front Wheel Bearings for Play	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
50,400 - LUBE_All Chassis Components	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
50,500 - !FRA!CHANGE_Engine oil, filters	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
50,700 - INSPECT_Tire Condition	-	LRO tire tread depth below spec, rotated RF to LRO.	EARJOHNSON	Mar 16, 2023 8:41:22 PM	Yes	56515052
50,800 - INSPECT_Tire Valve Stems, Double Check Caps	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
50,900 - !FRA!INSPECT_Wheels for Cracks, Loose Lugs/Indicators, Outer Hub Leaks	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
51,000 - RECORD_LF-Tire Tread Depth (32nds)	10 32nds of an inch		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
51,100 - RECORD_LF-Tire Air Pressure (psi)	70 Pounds per Square Inch		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
51,200 - RECORD_RF-Tire Tread Depth (32nds)	8 32nds of an inch		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
51,300 - RECORD_RF-Air Pressure (psi)	70 Pounds per Square Inch		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
51,400 - !FRA!INSPECT_FRONT ABS Tone Rings, Sensors, Routing of Cables	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
51,500 - !FRA!INSPECT_Wheel Seals for Leaks	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
51,600 - !FRA!INSPECT_ Front Brake Assemblies	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
51,700 - MEASURE_RECORD_LF - Brake Lining, Pad Thickness (32nds)	8 32nds of an inch		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
51,800 - MEASURE_RECORD_RF - Brake Lining, Pad Thickness (32nds)	8 32nds of an inch		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
51,900 - INSPECT VISUALLY_RECORD_LF Rotor Condition (inches)	1.543 Inch		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
52,000 - INSPECT VISUALLY_RECORD_RF Rotor Condition (inches)	1.55 Inch		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
52,100 - INSPECT_Vibration Damper	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
52,200 - !FRA!INSPECT_Battery Cable Routing from Battery Box to Starter	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
52,400 - !FRA!INSPECT_Starter Mounting	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
52,500 - !FRA!INSPECT_Engine Exhaust System	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
52,700 - INSPECT_Engine, Transmission Mounts	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
52,800 - !FRA!INSPECT_Engine, Transmission for Fluid Leaks	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
52,900 - INSPECT_Shift Cable Adjustment - All Transmissions	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
53,000 - !FRA!INSPECT_Transmission Breather and Clean	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
53,100 - *RPT*!FRA!INSPECT_Parking Brake Cables, Shoes for Wear, Contamination	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
53,200 - *RPT*INSPECT_A/C Condensor, Fans, Safety Grills	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
53,300 - *RPT*INSPECT_Driveline, Hanger Bearings, U-Joints, Slip Joints, Safety Loop	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
53,400 - *RPT*INSPECT_All Body Mounts and Chassis Frame for Corrosion, Cracks	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
53,500 - !FRA!INSPECT_Fuel Tank, Mountings, Lines	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
53,600 - INSPECT_Tire Condition	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
53,700 - INSPECT_Tire Valve Stems, Double Check Caps	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
53,800 - INSPECT_Mismatched Tire Tread, Casing Design	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
53,900 - INSPECT_Dual Mating Tires w/Square	-	NA	EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
54,000 - !FRA!INSPECT_Wheels for Cracks, Loose Lugs/Indicators, Outer Hub Leaks	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
54,100 - INSPECT_Mud Flaps, Brackets	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
54,200 - RECORD_RRO-Tire Tread Depth (32nds)	7 32nds of an inch		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
54,300 - RECORD_RRI-Tire Tread Depth (32nds)	8 32nds of an inch		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
54,400 - RECORD_RRO-Air Pressure (psi)	65 Pounds per Square Inch		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
54,500 - RECORD_RRI-Air Pressure (psi)	65 Pounds per Square Inch		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
54,600 - RECORD_LRO-Tire Tread Depth (32nds)	4 32nds of an inch		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
54,700 - RECORD_LRI-Tire Tread Depth (32nds)	8 32nds of an inch		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
54,800 - RECORD_LRO-Air Pressure (psi)	65 Pounds per Square Inch		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
54,900 - RECORD_LRI-Air Pressure (psi)	65 Pounds per Square Inch		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
55,000 - !FRA!INSPECT_ REAR Brake Assemblies	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
55,100 - !FRA!INSPECT_ REAR Hubs, Wheel Seals for Oil Leaks	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
55,200 - !FRA!INSPECT_ REAR ABS Tone Rings, Sensors, Routing Of Cables (if equipped)	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
55,300 - MEASURE_RECORD_LR - Brake Lining, Pad Thickness (32nds)	7 32nds of an inch		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
55,400 - MEASURE_RECORD_RR - Brake Lining, Pad Thickness (32nds)	7 32nds of an inch		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
55,500 - INSPECT VISUALLY_MEASURE_RECORD_LR Drum, Rotor Condition (inches)	1.64 Inch		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
55,600 - INSPECT VISUALLY_MEASURE_RECORD_RR Drum, Rotor Condition (inches)	1.643 Inch		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
55,700 - CHECK_Spring Brake Inversion Valve	-	NA	EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
55,800 - CHECK_Double Check Valve - Primary, Secondary	-	NA	EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
55,900 - !FRA!INSPECT_ Under Body Exhaust System	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
56,000 - *RPT*INSPECT_ REAR Axle Housing, Breather; CLEAN_Breather	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
56,100 - *RPT*INSPECT_ REAR Springs, Shocks, Suspension, Airbags	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
60,000 - SECTION 6 - Wheelchair Inspection	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
60,100 - RECORD_Wheelchair Cycle Count	15393 Cycles		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
60,200 - CHECK_Lift Access Door for Ease of Opening,Latch Security,Door Hold Back	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
60,300 - CHECK_Platform Emergency Release Mechanism for Ease of Operation	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
60,400 - OPERATE_Lift thru Complete Cycle;CHECK_Noises,Jerky Op,Too Fast-Slow,Drift Down	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
60,500 - INSPECT_Bridgeplate Operation	-	Bridgeplate binding.	EARJOHNSON	Mar 16, 2023 8:41:22 PM	Yes	56515052
60,600 - INSPECT_All Pivot Points for Wear and Looseness	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
60,700 - INSPECT_Rollers for Wear and Smooth Rotation	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
60,800 - INSPECT_Operation of Platform Barrier Mechanism	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
60,900 - INSPECT_Cam Slots for Wear and Proper Alignment	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
61,000 - INSPECT_Cable Condition (If Applicable)	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
61,100 - INSPECT_Hydraulic Hoses for Leaks, Chafing or Cracks	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
61,200 - INSPECT_Electrical Connections and Routing of Wires and Cables	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
61,300 - INSPECT_Operation and Adjustment of All Safety Switches	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
61,400 - INSPECT_All Lift Mounting Brackets for Loose Bolts Broken Welds, etc.	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
61,500 - INSPECT_Manual Back-up Raise/Lower System (If Applicable)	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
61,600 - INSPECT_HydrPump Reservoir Oil Level. Consult SrvManual for Fluid to Use.	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
61,700 - CHECK_Operator Decals for Proper Positioning;CONSULT_Service Manual	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
61,800 - CHECK_WC Holddowns Inside Vehicle for Secure Mounting,Proper Operation	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
61,900 - CLEAN_Linkages and Mechanisms	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
62,000 - LUBRICATE_Linkages and Mechanisms (DO NOT OVER Lubricate)	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
62,100 - INSPECT_Emergency Platform Release Mechanism	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
62,200 - INSPECT_Platform Barrier Latch Mechanism	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
62,300 - INSPECT_Bridgeplate Hinge	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
62,400 - INSPECT_All Pivot Points	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
62,500 - INSPECT_Cams and Slots	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
62,600 - INSPECT_Rollers	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
62,700 - INSPECT_All Linkages	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
70,000 - SECTION 7 - ALTERNATIVE FUELS INSPECTION	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
70,300 - INSPECT_Condition of Fuel Pressure Gauge	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
70,400 - PROVIDE PROOF_Tank_Dents/Scratches and Re-Certification	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
70,500 - INSPECT_Tank test date, labels-Reference-ST.4 FMMVSS 304 & ANSI-CSA NGV2	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
70,600 - INSPECT_Tank Lines to Ensure Secure Mounting, Insulation Against Vibration	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
70,700 - INSPECT_Filling Nozzle for Securely Fitting Cap	-	No fuel cap.	EARJOHNSON	Mar 16, 2023 8:41:22 PM	Yes	56515052
70,800 - INSPECT_Pressure Relief Device's Venting System, Valves, Ducting to MNFR Specs	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
80,000 - SECTION 8 - PMI Report Completion	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
80,100 - COMPLETE_PM Report; Follow-ups	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	
80,200 - RETURN_Vehicle to Predetermined Location	Done		EARJOHNSON	Mar 16, 2023 8:41:22 PM	No	

Activity Sub Total

Activity 10 Sub Total

Parts:	0.00
Labor:	265.20
Labor Hours:	4.08
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	265.20



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 56195703
Invoice No. 55345 - 56195703

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
55345-MEDIUM DUTY PMA		Ford E450 Champion Challenger	
Requested By:	SPACE	Status:	40 - Closed (40)
Created By:	SPACE	Priority:	3 - High
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	321,669 - DH

Activity Header
Activity:20 999/999/999 TOTAL VEHICLE
Activity Note: Medium Duty PMA Service
Reason for Repair: 08 Preventive Maintenance
Work Accomplished: A PM Level A
Part Failure:
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
16-Mar-23	B329	FILTER, OIL, SPIN-ON SEE P550965	1	2.51	2.51

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
16-Mar-23	Earl Johnson	1.05	65	68.25

Activity Sublet
No Data Available

Activity Checklist						
Check List						
20 Desc: Medium Duty PMA Service						
Task: 55345-Medium Duty PMA Inspection Performed by: EARJOHNSON Performed on: 16-MAR-23						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
100,000 - "A" PMI SERVICING ITEMS	Done		EARJOHNSON	Mar 16, 2023 9:37:45 PM	No	
101,000 - FRA Change Oil Filters	Yes		EARJOHNSON	Mar 16, 2023 9:37:45 PM	No	
102,000 - FRA Drain Engine Oil	Yes		EARJOHNSON	Mar 16, 2023 9:37:45 PM	No	
103,000 - FRA Check Transmission Fluid	Done		EARJOHNSON	Mar 16, 2023 9:37:45 PM	No	
104,000 - Lubricate Chassis	Done		EARJOHNSON	Mar 16, 2023 9:37:45 PM	No	
105,000 - Replace or Clean A/C Filters	Done		EARJOHNSON	Mar 16, 2023 9:37:45 PM	No	
106,000 - Drain Water from Fuel Water Separator (where applicable)	-	NA	EARJOHNSON	Mar 16, 2023 9:37:45 PM	No	
107,000 - FRA Change Primary Fuel Filter	No		EARJOHNSON	Mar 16, 2023 9:37:45 PM	No	
108,000 - Lube all pivoting Mechanisms	Done		EARJOHNSON	Mar 16, 2023 9:37:45 PM	No	

Activity Sub Total	Activity 20 Sub Total	
	Parts:	2.51
	Labor:	68.25
	Labor Hours:	1.05
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	70.76
Work Order Footer	Work Order 56195703 Total	
	Parts:	2.51
	Labor:	333.45
	Labor Hours:	5.13
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	335.96



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 56492027
Invoice No. 55345 - 56492027

Client Department:

Department: 55345M

Work Order Description

Road Call OverHeating

Requested By: TDELVA

Created By: TDELVA

Assigned To:

Class: WORC - WORK ORDER ROAD CALL

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 3 - High

Driver:

Phone:

ETA:

Meter: 321,159 - DH

Chronology

Reported	Mar 10, 2023 9:47:56 AM	Mar 10, 2023 9:47:56 AM
Started	Mar 10, 2023 9:48:00 AM	
Completed	Mar 14, 2023 11:52:00 AM	Mar 14, 2023 11:52:00 AM
Down Time		

Work Order Notes

Line 10 To file warranty be sure to do the following:

- 1) Enter a COMPLAINT statement for each activity.
- 2) Enter CAUSE statement in the Notes field of each activity.
- 3) Enter CORRECTION statement in the Comment section of each activity.

Complaint: Driver stated that vehicle's overheating

Cause: Broken engine belt and broken tensioner bearing

Correction: Replaced Engine belt and replaced all idler pulleys and Bearing Line 20 Coolant reservoir is leaking Line 30 Replaced coolant reservoir Line 40 Please charge part.

Activity Header

Activity: 5 999 TOTAL VEHICLE

Activity Note: PRAMETER

Reason for Repair: SW Shop Work Order

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: PRAMETER

Task: PRA and Meter Readings Performed by: TDELVA Performed on: 10-MAR-23

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		TDELVA	Mar 10, 2023 12:32:13 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		TDELVA	Mar 10, 2023 12:32:13 PM	No	
4 - Are you wearing the appropriate PPE?	Done		TDELVA	Mar 10, 2023	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO	
				12:32:13 PM			
7 - Have you performed the proper LOTO?	Done		TDELVA	Mar 10, 2023 12:32:13 PM	No		
10 - Are you aware of the potential risks of performing this repair?	Done		TDELVA	Mar 10, 2023 12:32:13 PM	No		
11 - Have you successfully completed the Personal Risk Assessment?	Done		TDELVA	Mar 10, 2023 12:32:13 PM	No		
Activity Sub Total							
				Activity 5 Sub Total			
				Parts:			0.00
				Labor:			0.00
				Labor Hours:			0.00
				Sublet Parts:			0.00
				Sublet Labor:			0.00
				Activity Sub Total			0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 56492027
Invoice No. 55345 - 56492027

Client Department:

Department: 55345M

Work Order Description

Road Call OverHeating

Requested By: TDELVA

Created By: TDELVA

Assigned To:

Class: WORC - WORK ORDER ROAD CALL

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 3 - High

Driver:

Phone:

ETA:

Meter: 321,159 - DH

Activity Header

Activity: 10 999 TOTAL VEHICLE

Activity Note: ROAD CALL

Reason for Repair: 10 Road Call

Work Accomplished:

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
10-Mar-23	89026	PULLEY, IDLER, SMOOTH	1	14.71	14.71

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
10-Mar-23	Delva,Terry	2.92	65	189.8

Activity Sublet

No Data Available

Activity Checklist

No Data Available

No Data Available

Activity Sub Total

Activity 10 Sub Total	
Parts:	14.71
Labor:	189.80
Labor Hours:	2.92
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	204.51



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 56492027
Invoice No. 55345 - 56492027

Client Department:

Department: 55345M

Work Order Description

Road Call OverHeating

Requested By: TDELVA

Created By: TDELVA

Assigned To:

Class: WORC - WORK ORDER ROAD CALL

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 3 - High

Driver:

Phone:

ETA:

Meter: 321,159 - DH

Activity Header

Activity:20 040/000/000 ENGINE/MOTOR SYSTEMS GROUP

Activity Note:

Reason for Repair: 05 Inspection, Routine

Work Accomplished:

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
14-Mar-23	603-811	TANK, OVERFLOW, COOLANT	1	80.99	80.99

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
10-Mar-23	Delva,Terry	0.93	65	60.45

Activity Sublet

No Data Available

Activity Checklist

No Data Available

No Data Available

Activity Sub Total

Activity 20 Sub Total	
Parts:	80.99
Labor:	60.45
Labor Hours:	0.93
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	141.44

Work Order Footer

Work Order 56492027 Total	
Parts:	95.70
Labor:	250.25
Labor Hours:	3.85
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	345.95



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 56483457
Invoice No. 55345 - 56483457

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Check AC.		Ford E450 Champion Challenger	
Requested By:	EARJOHNSON	Status:	40 - Closed (40)
Created By:	EARJOHNSON	Priority:	2 - Medium
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	320,666 - DH

Chronology		
Reported	Mar 7, 2023 5:05:02 PM	Mar 7, 2023 5:05:02 PM
Started	Mar 7, 2023 5:07:00 PM	
Completed	Mar 7, 2023 7:28:00 PM	Mar 7, 2023 7:28:00 PM
Down Time		

Work Order Notes

- Line 10 To file warranty be sure to do the following:
- 1) Enter a COMPLAINT statement for each activity.
 - 2) Enter CAUSE statement in the Notes field of each activity.
 - 3) Enter CORRECTION statement in the Comment section of each activity.
- =====

Complaint: Check front and rear AC systems.

Cause: Front AC system operates properly, pressures within spec.
Rear AC compressor cycling (low charge pressre).

Correction: Recovered rear AC freon (2.00lbs). Vacuum, leak tested, added PAG oil and recharged to spec. Rear AC operates properly. Outlet temp 47*.

Activity Header Activity: 5 999 TOTAL VEHICLE Activity Note: Personal Risk Assessment Reason for Repair: SW Shop Work Order Work Accomplished: 06 Inspect Part Failure: Activity Comments:		
Activity Parts No Data Available		
Activity Labor No Data Available		
Activity Sublet No Data Available		
Activity Checklist <table border="1"><tr><th>Check List</th></tr><tr><td>5 Desc: Personal Risk Assessment Task: PRA and Meter Readings Performed by: EARJOHNSON Performed on: 07-MAR-23</td></tr></table>	Check List	5 Desc: Personal Risk Assessment Task: PRA and Meter Readings Performed by: EARJOHNSON Performed on: 07-MAR-23
Check List		
5 Desc: Personal Risk Assessment Task: PRA and Meter Readings Performed by: EARJOHNSON Performed on: 07-MAR-23		

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		EARJOHNSON	Mar 7, 2023 7:19:00 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		EARJOHNSON	Mar 7, 2023 7:19:00 PM	No	
4 - Are you wearing the appropriate PPE?	Done		EARJOHNSON	Mar 7, 2023 7:19:00 PM	No	
7 - Have you performed the proper LOTO?	Done		EARJOHNSON	Mar 7, 2023 7:19:00 PM	No	
10 - Are you aware of the potential risks of performing this repair?	Done		EARJOHNSON	Mar 7, 2023 7:19:00 PM	No	
11 - Have you successfully completed the Personal Risk Assessment?	Done		EARJOHNSON	Mar 7, 2023 7:19:00 PM	No	

Activity Sub Total

Activity 5 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 56483457
Invoice No. 55345 - 56483457

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Check AC.		Ford E450 Champion Challenger	
Requested By:	EARJOHNSON	Status:	40 - Closed (40)
Created By:	EARJOHNSON	Priority:	2 - Medium
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	320,666 - DH

Activity Header
Activity: 15 001/000/000 AIR CONDITIONING, HEATING AND VENTILATION
Activity Note: Check AC .
Reason for Repair: 04 Driver's Report
Work Accomplished: 03 Replace New
Part Failure:
Activity Comments:

Activity Parts
No Data Available

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
07-Mar-23	Earl Johnson	0.15	65	9.75
07-Mar-23	Earl Johnson	2.18	65	141.7

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available

Activity Sub Total		Activity 15 Sub Total	
		Parts:	0.00
		Labor:	151.45
		Labor Hours:	2.33
		Sublet Parts:	0.00
		Sublet Labor:	0.00
		Activity Sub Total	151.45

Work Order Footer		Work Order 56483457 Total	
		Parts:	0.00
		Labor:	151.45
		Labor Hours:	2.33
		Sublet Parts:	0.00
		Sublet Labor:	0.00
		Activity Sub Total	151.45



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 4



Work Order No. 56381700
Invoice No. 55345 - 56381700

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
FOLLOW UP TO QCC INSP		Ford E450 Champion Challenger	
Requested By:	AOWENS	Status:	40 - Closed (40)
Created By:	AOWENS	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	320,666 - DH

Chronology		
Reported	Feb 6, 2023 5:09:57 PM	Feb 6, 2023 5:09:57 PM
Started	Feb 6, 2023 5:15:00 PM	
Completed	Feb 14, 2023 10:46:00 PM	Feb 14, 2023 10:46:00 PM
Down Time		

Work Order Notes

Line 10 Have you completed a satisfactory Personal Risk Assessment? Yes() No ().
If the answer is NO stop what you are doing, complete an IP Safety Contact Slip and see your supervisor for further instructions.

=====

To file warranty be sure to do the following:

- 1) Enter a COMPLAINT statement for each activity.
- 2) Enter CAUSE statement in the Notes field of each activity.
- 3) Enter CORRECTION statement in the Comment section of each activity.

=====


Complaint:

Cause:

Correction: Line 20 Remove and replaced 3 interior lights. Line 30 Confirmed that camera system operates properly.

Activity Header Activity: 10 Activity Note: Entrance door will not close Reason for Repair: Work Accomplished: Part Failure: Activity Comments:
Activity Parts No Data Available
Activity Labor No Data Available
Activity Sublet No Data Available
Activity Checklist No Data Available No Data Available

Activity Sub Total															
	<table><tr><td colspan="2">Activity 10 Sub Total</td></tr><tr><td>Parts:</td><td>0.00</td></tr><tr><td>Labor:</td><td>0.00</td></tr><tr><td>Labor Hours:</td><td>0.00</td></tr><tr><td>Sublet Parts:</td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td>0.00</td></tr></table>	Activity 10 Sub Total		Parts:	0.00	Labor:	0.00	Labor Hours:	0.00	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	0.00
Activity 10 Sub Total															
Parts:	0.00														
Labor:	0.00														
Labor Hours:	0.00														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	0.00														



Work Order

55345 - Palm Tran Connection
v 3.0
Activity 2 of 4



Work Order No. 56381700
Invoice No. 55345 - 56381700

Client Department:

Department: 55345M

Work Order Description

FOLLOW UP TO QCC INSP

Requested By: AOWENS

Created By: AOWENS

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 320,666 - DH

Activity Header

Activity:20

Activity Note: Check Engine Light On Code P009E

Reason for Repair:

Work Accomplished:

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

No Data Available

No Data Available

Activity Sub Total	
--------------------	--

Activity 20 Sub Total

Parts:	0.00
--------	------

Labor:	0.00
--------	------

Labor Hours:	0.00
--------------	------

Sublet Parts:	0.00
---------------	------

Sublet Labor:	0.00
---------------	------

Activity Sub Total	0.00
---------------------------	-------------



Work Order

55345 - Palm Tran Connection
v 3.0
Activity 3 of 4



Work Order No. 56381700
Invoice No. 55345 - 56381700

Client Department:

Department: 55345M

Work Order Description

FOLLOW UP TO QCC INSP

Requested By: AOWENS

Created By: AOWENS

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty:	No
---------------------	----

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 320,666 - DH

Activity Header

Activity:30

Activity Note: WHEEL CHAIR LIGHT IS OUT

Reason for Repair:

Work Accomplished:

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

No Data Available

No Data Available

Activity Sub Total

Activity 30 Sub Total

Parts:	0.00
--------	------

Labor:	0.00
--------	------

Labor Hours:	0.00
--------------	------

Sublet Parts:	0.00
---------------	------

Sublet Labor:	0.00
---------------	------

Activity Sub Total	0.00
---------------------------	-------------



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 4 of 4



Work Order No. 56381700
Invoice No. 55345 - 56381700

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FD4E4FS7EDB17176
FOLLOW UP TO QCC INSP		Ford E450 Champion Challenger	
Requested By:	AOWENS	Status:	40 - Closed (40)
Created By:	AOWENS	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	320,666 - DH

Activity Header
Activity:40
Activity Note: Interior Light Out
Reason for Repair:
Work Accomplished:
Part Failure:
Activity Comments:

Activity Parts
No Data Available

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
06-Feb-23	Earl Johnson	1.05	65	68.25
14-Feb-23	Earl Johnson	0.4	65	26
14-Feb-23	Earl Johnson	0.57	65	37.05

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available

Activity Sub Total		Activity 40 Sub Total	
		Parts:	0.00
		Labor:	131.30
		Labor Hours:	2.02
		Sublet Parts:	0.00
		Sublet Labor:	0.00
		Activity Sub Total	131.30

Work Order Footer		Work Order 56381700 Total	
		Parts:	0.00
		Labor:	131.30
		Labor Hours:	2.02
		Sublet Parts:	0.00
		Sublet Labor:	0.00
		Activity Sub Total	131.30



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 54825094
Invoice No. 55345 - 54825094

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
QCC FLEET INSPECTION		Ford E450 Champion Challenger	
Requested By:	DKNOTT	Status:	40 - Closed (40)
Created By:	DKNOTT	Priority:	3 - High
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	320,666 -

Chronology		
Reported	Feb 6, 2023 4:01:10 PM	Feb 6, 2023 4:01:10 PM
Started	Feb 6, 2023 4:02:00 PM	
Completed	Feb 6, 2023 5:32:00 PM	Feb 6, 2023 5:32:00 PM
Down Time		

Work Order Notes

Line 10

PERFROM QCC INSPECTIONS

CHECK ENGINE LIGHT ON P009E

Activity Header							
Activity:10 999/999/999 TOTAL VEHICLE							
Activity Note: PERSONAL RISK ASSESSMENT							
Reason for Repair:		05 Inspection, Routine					
Work Accomplished:		06 Inspect					
Part Failure:		00 No Failure					
Activity Comments:							
Activity Parts							
No Data Available							
Activity Labor							
No Data Available							
Activity Sublet							
No Data Available							
Activity Checklist							
Check List							
10 Desc: PERSONAL RISK ASSESSMENT							
Task: PRA and Meter Readings Performed by: AOWENS Performed on: 06-FEB-23							
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO	
1 - Are you properly trained to perform the task?	Done		AOWENS	Feb 6, 2023 5:13:40 PM	No		
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		AOWENS	Feb 6, 2023 5:13:40 PM	No		

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
4 - Are you wearing the appropriate PPE?	Done		AOWENS	Feb 6, 2023 5:13:40 PM	No	
7 - Have you performed the proper LOTO?	Done		AOWENS	Feb 6, 2023 5:13:40 PM	No	
10 - Are you aware of the potential risks of performing this repair?	Done		AOWENS	Feb 6, 2023 5:13:40 PM	No	
11 - Have you successfully completed the Personal Risk Assessment?	Done		AOWENS	Feb 6, 2023 5:13:40 PM	No	

Activity Sub Total

Activity 10 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 54825094
Invoice No. 55345 - 54825094

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
QCC FLEET INSPECTION		Ford E450 Champion Challenger	
Requested By:	DKNOTT	Status:	40 - Closed (40)
Created By:	DKNOTT	Priority:	3 - High
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	320,666 -

Activity Header
Activity:20 999/999/999 TOTAL VEHICLE
Activity Note: QCC FLEET INSPECTION
Reason for Repair: 05 Inspection, Routine
Work Accomplished: 06 Inspect
Part Failure:
Activity Comments:

Activity Parts
No Data Available

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
06-Feb-23	Owens,Arthur	1.35	65	87.75

Activity Sublet
No Data Available

Check List						
20 Desc: QCC FLEET INSPECTION						
Task: 55345 QCC FLEET INSPECTION Performed by: AOWENS Performed on: 06-FEB-23						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - EXTERIOR CIRCLE INSPECTION	Done		AOWENS	Feb 6, 2023 5:11:48 PM	No	
20 - Cleanliness	A		AOWENS	Feb 6, 2023 5:11:48 PM	No	
30 - Entrance Door Operation/Seals/Glass	D	Entrance door will not close	AOWENS	Feb 6, 2023 5:11:48 PM	Yes	56381700
40 - Body/Fenders/Bumpers	C		AOWENS	Feb 6, 2023 5:11:48 PM	No	
50 - Tires/Wheels/Lugs	A		AOWENS	Feb 6, 2023 5:11:48 PM	No	
60 - Mirrors and Attachments	A		AOWENS	Feb 6, 2023 5:11:48 PM	No	
70 - Lights and Accessories			AOWENS	Feb 6, 2023 5:11:48 PM	No	
80 - Compartment Doors	A		AOWENS	Feb 6, 2023 5:11:48 PM	No	
90 - Battery Compartment	A		AOWENS	Feb 6, 2023 5:11:48 PM	No	
100 - Check All Fluids	A		AOWENS	Feb 6, 2023 5:11:48 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
110 - Belt Drives	A		AOWENS	Feb 6, 2023 5:11:48 PM	No	
120 - Air Induction	A		AOWENS	Feb 6, 2023 5:11:48 PM	No	
130 - Exhaust System	A		AOWENS	Feb 6, 2023 5:11:48 PM	No	
140 - Engine Compartmetn Wiring	A		AOWENS	Feb 6, 2023 5:11:48 PM	No	
150 - DRIVERS AREA INSPECTION	Done		AOWENS	Feb 6, 2023 5:11:48 PM	No	
160 - Air System	A		AOWENS	Feb 6, 2023 5:11:48 PM	No	
170 - Audible Warnings	A		AOWENS	Feb 6, 2023 5:11:48 PM	No	
180 - Dash and Gauges	B	Check Engine Light On Code P009E	AOWENS	Feb 6, 2023 5:11:48 PM	Yes	56381700
190 - Accessory components	A		AOWENS	Feb 6, 2023 5:11:48 PM	No	
200 - Exit Door Operation	A		AOWENS	Feb 6, 2023 5:11:48 PM	No	
210 - Exit Door Interlock	A		AOWENS	Feb 6, 2023 5:11:48 PM	No	
220 - Fare box and ticket cutter.	E		AOWENS	Feb 6, 2023 5:11:48 PM	No	
230 - Fast Idle	A		AOWENS	Feb 6, 2023 5:11:48 PM	No	
240 - Glass & Mirrors	A		AOWENS	Feb 6, 2023 5:11:48 PM	No	
250 - Floor Covering	A		AOWENS	Feb 6, 2023 5:11:48 PM	No	
260 - Horn and Lamps	A		AOWENS	Feb 6, 2023 5:11:48 PM	No	
270 - Start Function	A		AOWENS	Feb 6, 2023 5:11:48 PM	No	
280 - PA System	E		AOWENS	Feb 6, 2023 5:11:48 PM	No	
290 - Pedal Condition and Adjustment	A		AOWENS	Feb 6, 2023 5:11:48 PM	No	
300 - Reverse System	A		AOWENS	Feb 6, 2023 5:11:48 PM	No	
310 - Seat	B	Seat Ripped	AOWENS	Feb 6, 2023 5:11:48 PM	No	
320 - Steering Wheel & Column	A		AOWENS	Feb 6, 2023 5:11:48 PM	No	
330 - Sun Visor	A		AOWENS	Feb 6, 2023 5:11:48 PM	No	
340 - Turn Signals Switch	A		AOWENS	Feb 6, 2023 5:11:48 PM	No	
350 - Electrical Compartment	A		AOWENS	Feb 6, 2023 5:11:48 PM	No	
360 - Wheel Chair Operation	D	WHEEL CHAIR LIGHT IS OUT	AOWENS	Feb 6, 2023 5:11:48 PM	Yes	56381700

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
370 - INTERIOR CIRCLE	Done		AOWENS	Feb 6, 2023 5:11:48 PM	No	
380 - Cleanliness	A		AOWENS	Feb 6, 2023 5:11:48 PM	No	
390 - HVAC	A		AOWENS	Feb 6, 2023 5:11:48 PM	No	
400 - Interior Passenger Area	B	Interior Light Out	AOWENS	Feb 6, 2023 5:11:48 PM	Yes	56381700
410 - Stop Request	E		AOWENS	Feb 6, 2023 5:11:48 PM	No	
420 - Safety Equipment	A		AOWENS	Feb 6, 2023 5:11:48 PM	No	
430 - UNDERCARRIAGE	Done		AOWENS	Feb 6, 2023 5:11:48 PM	No	
440 - Air System	A		AOWENS	Feb 6, 2023 5:11:48 PM	No	
450 - Steering components	A		AOWENS	Feb 6, 2023 5:11:48 PM	No	
460 - Brake Inspection	C	REAR BRAKES GOING TO NEED SERVICE NEXT PM	AOWENS	Feb 6, 2023 5:11:48 PM	No	
470 - Suspension Components	A		AOWENS	Feb 6, 2023 5:11:48 PM	No	
480 - Frame	A		AOWENS	Feb 6, 2023 5:11:48 PM	No	
490 - Fluid Leakage	A		AOWENS	Feb 6, 2023 5:11:48 PM	No	
500 - Fuel System	A		AOWENS	Feb 6, 2023 5:11:48 PM	No	

Activity Sub Total


Activity 20 Sub Total	
Parts:	0.00
Labor:	87.75
Labor Hours:	1.35
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	87.75

Work Order Footer

Work Order 54825094 Total	
Parts:	0.00
Labor:	87.75
Labor Hours:	1.35
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	87.75



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 56244625
Invoice No. 55345 - 56244625

Client Department:

Department: 55345M

Work Order Description

Road Call vehicle overheated

Requested By: TDELVA

Created By: TDELVA

Assigned To:

Class: WORC - WORK ORDER ROAD CALL

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 3 - High

Driver:

Phone:

ETA:

Meter: 320,266 - DH

Chronology

Reported	Dec 20, 2022 2:38:51 PM	Dec 20, 2022 2:38:51 PM
Started	Dec 20, 2022 2:41:00 PM	
Completed	Dec 28, 2022 3:23:00 PM	Dec 28, 2022 3:23:00 PM
Down Time		

Work Order Notes

Line 10 To file warranty be sure to do the following:

- 1) Enter a COMPLAINT statement for each activity.
- 2) Enter CAUSE statement in the Notes field of each activity.
- 3) Enter CORRECTION statement in the Comment section of each activity.

Complaint: Driver stated that vehicle overheating

Cause: No coolant

Correction: Add coolant and drive vehicle back to base for diagnostic and repair Line 20 C: coolant leak

C: check coolant system found rear heater valve leaking

C: replaced valve retest system ok at this time

part: 1 new heater valve

Activity Header

Activity: 5 999 TOTAL VEHICLE

Activity Note: PRAMETER

Reason for Repair: SW Shop Work Order

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: PRAMETER

Task: PRA and Meter Readings Performed by: TDELVA Performed on: 20-DEC-22

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		TDELVA	Dec 20, 2022 4:02:07 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		TDELVA	Dec 20, 2022 4:02:07 PM	No	
4 - Are you wearing the appropriate PPE?	Done		TDELVA	Dec 20, 2022 4:02:07 PM	No	
7 - Have you performed the proper LOTO?	Done		TDELVA	Dec 20, 2022 4:02:07 PM	No	
10 - Are you aware of the potential risks of performing this repair?	Done		TDELVA	Dec 20, 2022 4:02:07 PM	No	
11 - Have you successfully completed the Personal Risk Assessment?	Done		TDELVA	Dec 20, 2022 4:02:07 PM	No	

Activity Sub Total

Activity 5 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 56244625
Invoice No. 55345 - 56244625

Client Department:

Department: 55345M

Work Order Description

Road Call vehicle overheated

Requested By: TDELVA

Created By: TDELVA

Assigned To:

Class: WORC - WORK ORDER ROAD CALL

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 3 - High

Driver:

Phone:

ETA:

Meter: 320,266 - DH

Activity Header

Activity: 10 999 TOTAL VEHICLE

Activity Note: ROAD CALL

Reason for Repair: 10 Road Call

Work Accomplished:

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
20-Dec-22	Delva, Terry	1.88	0	0

Activity Sublet

No Data Available

Activity Checklist

No Data Available

No Data Available

Activity Sub Total

Activity 10 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	1.88
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 56244625
Invoice No. 55345 - 56244625

Client Department:

Department: 55345M

Work Order Description

Road Call vehicle overheated

Requested By: TDELVA

Created By: TDELVA

Assigned To:

Class: WORC - WORK ORDER ROAD CALL

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 3 - High

Driver:

Phone:

ETA:

Meter: 320,266 - DH

Activity Header

Activity:20 042 COOLING SYSTEM

Activity Note: check cooling system for overheating condition

Reason for Repair: 04 Driver's Report

Work Accomplished: 09 Troubleshooting

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
29-Dec-22	74612	VALVE, CONTROL, HEATER	1	10.41	10.41

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
28-Dec-22	Perez,Javier	3.75	0	0

Activity Sublet

No Data Available

Activity Checklist

No Data Available

No Data Available

Activity Sub Total


Activity 20 Sub Total	
Parts:	10.41
Labor:	0.00
Labor Hours:	3.75
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	10.41

Work Order Footer

Work Order 56244625 Total	
Parts:	10.41
Labor:	0.00
Labor Hours:	5.63
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	10.41



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 56233532
Invoice No. 55345 - 56233532

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
CANCELLED W.O		Ford E450 Champion Challenger	
Requested By:	CVERGARA	Status:	99 - Cancelled (99)
Created By:	CVERGARA	Priority:	-
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	320,266 - DH

Chronology

Reported	Dec 16, 2022 1:41:00 PM	Dec 16, 2022 1:41:00 PM
Started		
Completed	Dec 19, 2022 1:06:25 PM	Dec 19, 2022 1:06:25 PM
Down Time		

Work Order Notes

Activity Header

Activity: 10 999/999/999 TOTAL VEHICLE
Activity Note: PERSONAL RISK ASSESMENT
Reason for Repair: 05 Inspection, Routine
Work Accomplished: 06 Inspect
Part Failure: 00 No Failure
Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: PERSONAL RISK ASSESMENT

Task: PRA and Meter Readings Performed by: Performed on:

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	-				No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	-				No	
4 - Are you wearing the appropriate PPE?	-				No	
7 - Have you performed the proper LOTO?	-				No	
10 - Are you aware of the potential risks of performing this repair?	-				No	
11 - Have you successfully completed the Personal Risk Assessment?	-				No	

Activity Sub Total

Activity 10 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	0.00

	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 56233532
Invoice No. 55345 - 56233532

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
CANCELLED W.O		Ford E450 Champion Challenger	
Requested By:	CVERGARA	Status:	99 - Cancelled (99)
Created By:	CVERGARA	Priority:	-
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	320,266 - DH

Activity Header															
Activity:20 031/001/001 ALTERNATOR															
Activity Note: BATTERY LIGHT ON CHACK BATTERY AND CHARGING SYSTEM															
Reason for Repair:	05 Inspection, Routine														
Work Accomplished:	03 Replace New														
Part Failure:	43 Weak														
Activity Comments:															
Activity Parts															
No Data Available															
Activity Labor															
No Data Available															
Activity Sublet															
No Data Available															
Activity Checklist															
No Data Available															
No Data Available															
Activity Sub Total															
<table><tr><td colspan="2">Activity 20 Sub Total</td></tr><tr><td>Parts:</td><td>0.00</td></tr><tr><td>Labor:</td><td>0.00</td></tr><tr><td>Labor Hours:</td><td>0.00</td></tr><tr><td>Sublet Parts:</td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td>0.00</td></tr></table>		Activity 20 Sub Total		Parts:	0.00	Labor:	0.00	Labor Hours:	0.00	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	0.00
Activity 20 Sub Total															
Parts:	0.00														
Labor:	0.00														
Labor Hours:	0.00														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	0.00														
Work Order Footer															
<table><tr><td colspan="2">Work Order 56233532 Total</td></tr><tr><td>Parts:</td><td>0.00</td></tr><tr><td>Labor:</td><td>0.00</td></tr><tr><td>Labor Hours:</td><td>0.00</td></tr><tr><td>Sublet Parts:</td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td>0.00</td></tr></table>		Work Order 56233532 Total		Parts:	0.00	Labor:	0.00	Labor Hours:	0.00	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	0.00
Work Order 56233532 Total															
Parts:	0.00														
Labor:	0.00														
Labor Hours:	0.00														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	0.00														



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 56112098
Invoice No. 55345 - 56112098

Client Department:

Department: 55345M

Work Order Description

W.O CANCELLED

Requested By: CVERGARA

Created By: CVERGARA

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 99 - Cancelled (99)

Priority: -

Driver:

Phone:

ETA:

Meter: 317,451 - DH

Chronology

Reported	Nov 8, 2022 9:02:00 AM	Nov 8, 2022 9:02:00 AM
Started		
Completed	Dec 19, 2022 11:19:15 AM	Dec 19, 2022 11:19:15 AM
Down Time		

Work Order Notes

Activity Header

Activity: 10 999/999/999 TOTAL VEHICLE

Activity Note: PRA

Reason for Repair: SW Shop Work Order

Work Accomplished: 06 Inspect

Part Failure: 00 No Failure

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: PRA

Task: PRA and Meter Readings Performed by: Performed on:

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	-				No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	-				No	
4 - Are you wearing the appropriate PPE?	-				No	
7 - Have you performed the proper LOTO?	-				No	
10 - Are you aware of the potential risks of performing this repair?	-				No	
11 - Have you successfully completed the Personal Risk Assessment?	-				No	

Activity Sub Total


Activity 10 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	0.00

	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 56112098
Invoice No. 55345 - 56112098

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FD4E4FS7EDB17176
W.O CANCELLED		Ford E450 Champion Challenger	
Requested By:	CVERGARA	Status:	99 - Cancelled (99)
Created By:	CVERGARA	Priority:	-
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	317,451 - DH

Activity Header															
Activity: 20 174/011/000 COMPONENTS, DOOR, ENTRANCE, OPENING, OUTWARD, BUS															
Activity Note: per driver rear door does not open from outside															
Reason for Repair: 04 Driver's Report															
Work Accomplished:															
Part Failure:															
Activity Comments:															
Activity Parts															
No Data Available															
Activity Labor															
No Data Available															
Activity Sublet															
No Data Available															
Activity Checklist															
No Data Available															
No Data Available															
Activity Sub Total															
<table><tr><td colspan="2">Activity 20 Sub Total</td></tr><tr><td>Parts:</td><td>0.00</td></tr><tr><td>Labor:</td><td>0.00</td></tr><tr><td>Labor Hours:</td><td>0.00</td></tr><tr><td>Sublet Parts:</td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td>0.00</td></tr></table>		Activity 20 Sub Total		Parts:	0.00	Labor:	0.00	Labor Hours:	0.00	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	0.00
Activity 20 Sub Total															
Parts:	0.00														
Labor:	0.00														
Labor Hours:	0.00														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	0.00														
Work Order Footer															
<table><tr><td colspan="2">Work Order 56112098 Total</td></tr><tr><td>Parts:</td><td>0.00</td></tr><tr><td>Labor:</td><td>0.00</td></tr><tr><td>Labor Hours:</td><td>0.00</td></tr><tr><td>Sublet Parts:</td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td>0.00</td></tr></table>		Work Order 56112098 Total		Parts:	0.00	Labor:	0.00	Labor Hours:	0.00	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	0.00
Work Order 56112098 Total															
Parts:	0.00														
Labor:	0.00														
Labor Hours:	0.00														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	0.00														



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 56237017
Invoice No. 55345 - 56237017

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Battery Light On		Ford E450 Champion Challenger	
Requested By:	DARTHURS	Status:	40 - Closed (40)
Created By:	DARTHURS	Priority:	2 - Medium
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	320,266 - DH

Chronology		
Reported	Dec 18, 2022 2:08:10 PM	Dec 18, 2022 2:08:10 PM
Started	Dec 18, 2022 2:16:00 PM	
Completed	Dec 18, 2022 5:05:00 PM	Dec 18, 2022 5:05:00 PM
Down Time		

Work Order Notes

- Line 10 To file warranty be sure to do the following:
- 1) Enter a COMPLAINT statement for each activity.
 - 2) Enter CAUSE statement in the Notes field of each activity.
 - 3) Enter CORRECTION statement in the Comment section of each activity.
- =====

Complaint: Battery Light On

Cause: Bad Alternator

Correction: Check Alternator No out Put Check battery Voltage 10,11 volts. Charge both battery& Replace.
alternator.& Recharge (14,02) Volts all is ok at this time.
parts # GC2Z-10346-C Qty (1)

Activity Header						
Activity:5 999 TOTAL VEHICLE						
Activity Note: Personal Risk Assessment						
Reason for Repair: SW Shop Work Order						
Work Accomplished: 06 Inspect						
Part Failure:						
Activity Comments:						
Activity Parts						
No Data Available						
Activity Labor						
No Data Available						
Activity Sublet						
No Data Available						
Activity Checklist						
Check List						
5 Desc: Personal Risk Assessment						
Task: PRA and Meter Readings Performed by: DARTHURS Performed on: 18-DEC-22						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		DARTHURS	Dec 18, 2022	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
				2:17:31 PM		
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		DARTHURS	Dec 18, 2022 2:17:31 PM	No	
4 - Are you wearing the appropriate PPE?	Done		DARTHURS	Dec 18, 2022 2:17:31 PM	No	
7 - Have you performed the proper LOTO?	Done		DARTHURS	Dec 18, 2022 2:17:31 PM	No	
10 - Are you aware of the potential risks of performing this repair?	Done		DARTHURS	Dec 18, 2022 2:17:31 PM	No	
11 - Have you successfully completed the Personal Risk Assessment?	Done		DARTHURS	Dec 18, 2022 2:17:31 PM	No	

Activity Sub Total

Activity 5 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 56237017
Invoice No. 55345 - 56237017

Client Department:

Department: 55345M

Work Order Description

Battery Light On

Requested By: DARTHURS

Created By: DARTHURS

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 2 - Medium

Driver:

Phone:

ETA:

Meter: 320,266 - DH

Activity Header

Activity: 15 079 DEVICES, SAFETY/STABILITY, TRAILER

Activity Note: Check Alternator

Reason for Repair: 05 Inspection, Routine

Work Accomplished:

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
18-Dec-22	GC2Z-10346-C	ALTERNATOR, 6.8L, E350	1	238.75	238.75

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
18-Dec-22	Arthurs,Durvin	2.57	0	0

Activity Sublet

No Data Available

Activity Checklist

No Data Available

No Data Available

Activity Sub Total

Activity 15 Sub Total

Parts:	238.75
Labor:	0.00
Labor Hours:	2.57
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	238.75

Work Order Footer

Work Order 56237017 Total

Parts:	238.75
Labor:	0.00
Labor Hours:	2.57
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	238.75



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 56186293
Invoice No. 55345 - 56186293

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
cutting out		Ford E450 Champion Challenger	
Requested By:	JUHURST	Status:	40 - Closed (40)
Created By:	JUHURST	Priority:	2 - Medium
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	320,150 - DH

Chronology		
Reported	Dec 2, 2022 5:14:56 PM	Dec 2, 2022 5:14:56 PM
Started	Dec 2, 2022 5:27:00 PM	
Completed	Dec 5, 2022 4:13:00 PM	Dec 5, 2022 4:13:00 PM
Down Time		

Work Order Notes

- Line 10 To file warranty be sure to do the following:
- 1) Enter a COMPLAINT statement for each activity.
 - 2) Enter CAUSE statement in the Notes field of each activity.
 - 3) Enter CORRECTION statement in the Comment section of each activity.
- =====

Complaint: per driver unit cutting off

Cause: throttle body need cleaning. need more time to on unit

Correction: change wiper blades part # 40520. two Line 20 REMOVED THROTTLE BODY FROM INTAKE AND CLEAN AFTER CHECK COILS AND INJECTOR ALSO VACUUM LINE ROAD TEST VEHICLE NOW WORKING ASDESIGN RETURN VEHICLE BACK TO WORK

Activity Header																					
Activity:5 999 TOTAL VEHICLE																					
Activity Note: Personal Risk Assessment																					
Reason for Repair: SW Shop Work Order																					
Work Accomplished: 06 Inspect																					
Part Failure:																					
Activity Comments:																					
Activity Parts																					
No Data Available																					
Activity Labor																					
No Data Available																					
Activity Sublet																					
No Data Available																					
Activity Checklist																					
Check List 5 Desc: Personal Risk Assessment Task: PRA and Meter Readings Performed by: JUHURST Performed on: 05-DEC-22 <table border="1"><thead><tr><th>Inspection Item</th><th>RESULTS</th><th>Inspector's Note</th><th>Inspector</th><th>Date Inspected</th><th>Follow Up Needed</th><th>Follow Up WO</th></tr></thead><tbody><tr><td>1 - Are you properly trained to perform the task?</td><td>Done</td><td></td><td>JUHURST</td><td>Dec 5, 2022</td><td>No</td><td></td></tr></tbody></table>								Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO	1 - Are you properly trained to perform the task?	Done		JUHURST	Dec 5, 2022	No	
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO															
1 - Are you properly trained to perform the task?	Done		JUHURST	Dec 5, 2022	No																

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
				4:11:44 PM		
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		JUHURST	Dec 5, 2022 4:11:44 PM	No	
4 - Are you wearing the appropriate PPE?	Done		JUHURST	Dec 5, 2022 4:11:44 PM	No	
7 - Have you performed the proper LOTO?	Done		JUHURST	Dec 5, 2022 4:11:44 PM	No	
10 - Are you aware of the potential risks of performing this repair?	Done		JUHURST	Dec 5, 2022 4:11:44 PM	No	
11 - Have you successfully completed the Personal Risk Assessment?	Done		JUHURST	Dec 5, 2022 4:11:44 PM	No	

Activity Sub Total

Activity 5 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 56186293
Invoice No. 55345 - 56186293

Client Department:

Department: 55345M

Work Order Description

cutting out

Requested By: JUHURST

Created By: JUHURST

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 2 - Medium

Driver:

Phone:

ETA:

Meter: 320,150 - DH

Activity Header

Activity: 15 020 GROUP, DRIVETRAIN

Activity Note: cutting out

Reason for Repair: 11 Routine

Work Accomplished:

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
02-Dec-22	40520	BLADE, WIPER, WINDSHIELD, 20"	2	4.07	8.14

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
05-Dec-22	Junior Hurst	3.6	0	0
02-Dec-22	Junior Hurst	2.27	0	0

Activity Sublet

No Data Available

Activity Checklist

No Data Available

No Data Available

Activity Sub Total

Activity 15 Sub Total

Parts:	8.14
Labor:	0.00
Labor Hours:	5.87
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	8.14


Work Order Footer

Work Order 56186293 Total

Parts:	8.14
Labor:	0.00
Labor Hours:	5.87
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	8.14



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 56183282
Invoice No. 55345 - 56183282

Client Department:

Department: 55345M

Work Order Description

55345 PER DVIR (Check Transmission And Interior Light)

Requested By: AOWENS

Created By: AOWENS

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 2 - Medium

Driver:

Phone:

ETA:

Meter: 319,939 - DH

Chronology

Reported	Dec 1, 2022 10:59:00 PM	Dec 1, 2022 10:59:00 PM
Started	Dec 1, 2022 11:00:00 PM	
Completed	Dec 2, 2022 12:34:00 AM	Dec 2, 2022 12:34:00 AM
Down Time		

Work Order Notes

Line 10 Complaint: Check transmission/ dome light.

Cause: Unknown/ door jamb switch damaged.

Correction: Road tested vehicle without any issues, transmission fluid filled to spec/ driver door jamb switch needs to be replaced.

Activity Header

Activity: 10 999/999/999 TOTAL VEHICLE

Activity Note: PRA

Reason for Repair: SW Shop Work Order

Work Accomplished: 06 Inspect

Part Failure: 00 No Failure

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: PRA

Task: PRA and Meter Readings Performed by: EARJOHNSON Performed on: 01-DEC-22

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		EARJOHNSON	Dec 1, 2022 11:59:55 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		EARJOHNSON	Dec 1, 2022 11:59:55 PM	No	
4 - Are you wearing the appropriate PPE?	Done		EARJOHNSON	Dec 1, 2022 11:59:55 PM	No	
7 - Have you performed the proper LOTO?	Done		EARJOHNSON	Dec 1, 2022 11:59:55 PM	No	
10 - Are you aware of the potential risks of performing this repair?	Done		EARJOHNSON	Dec 1, 2022 11:59:55 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
11 - Have you successfully completed the Personal Risk Assessment?	Done		EARJOHNSON	Dec 1, 2022 11:59:55 PM	No	
Activity Sub Total			Activity 10 Sub Total			
			Parts:		0.00	
			Labor:		0.00	
			Labor Hours:		0.00	
			Sublet Parts:		0.00	
			Sublet Labor:		0.00	
			Activity Sub Total		0.00	



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 56183282
Invoice No. 55345 - 56183282

Client Department:

Department: 55345M

Work Order Description

55345 PER DVIR (Check Transmission And Interior Light)

Requested By: AOWENS

Created By: AOWENS

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 2 - Medium

Driver:

Phone:

ETA:

Meter: 319,939 - DH

Activity Header

Activity:20 079 DEVICES, SAFETY/STABILITY, TRAILER

Activity Note: Check Transmission

Reason for Repair: 05 Inspection, Routine

Work Accomplished:

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
01-Dec-22	Earl Johnson	0.87	0	0

Activity Sublet

No Data Available

Activity Checklist

No Data Available

No Data Available

Activity Sub Total

Activity 20 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	0.87
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 56183282
Invoice No. 55345 - 56183282

Client Department:

Department: 55345M

Work Order Description

55345 PER DVIR (Check Transmission And Interior Light)

Requested By: AOWENS

Created By: AOWENS

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 2 - Medium

Driver:

Phone:

ETA:

Meter: 319,939 - DH

Activity Header

Activity:30 079 DEVICES, SAFETY/STABILITY, TRAILER

Activity Note: Check Interior light

Reason for Repair: 05 Inspection, Routine

Work Accomplished:

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
02-Dec-22	Earl Johnson	0.07	0	0
01-Dec-22	Earl Johnson	0.05	0	0

Activity Sublet

No Data Available

Activity Checklist

No Data Available

No Data Available

Activity Sub Total

Activity 30 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	0.12
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00


Work Order Footer

Work Order 56183282 Total

Parts:	0.00
Labor:	0.00
Labor Hours:	0.99
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 55923658
Invoice No. 55345 - 55923658

Client Department:

Department: 55345M

Work Order Description

55345-LIGHT DUTY PMA

Requested By: DARTHURS

Created By: DARTHURS

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 3 - High

Driver:

Phone:

ETA:

Meter: 316,924 - DH

Chronology

Reported	Oct 31, 2022 12:00:00 AM	Oct 31, 2022 12:00:00 AM
Started	Nov 2, 2022 2:33:00 PM	
Completed	Nov 2, 2022 8:41:00 PM	Nov 2, 2022 8:41:00 PM
Down Time		

Work Order Notes

Line 10 COMPLAINT: Vehicle came in for service

CAUSE: Service due by Mileage

CORRECTION: Service job complete also change oil filter part # B329 wash rear A/C change lift side engine mount Part # F7UZ-6038EB. FRONT AND REAR A/C WORKING ASDSIGN. RETURN VEHICLE BACK TO WORK

Activity Header

Activity: 5 999/999/999 TOTAL VEHICLE

Activity Note: PERSONAL RISK ASSESSMENT

Reason for Repair: SW Shop Work Order

Work Accomplished: 06 Inspect

Part Failure: 00 No Failure

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: PERSONAL RISK ASSESSMENT


Task: PRA and Meter Readings Performed by: JUHURST Performed on: 02-NOV-22

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		JUHURST	Nov 2, 2022 7:42:23 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		JUHURST	Nov 2, 2022 7:42:23 PM	No	
4 - Are you wearing the appropriate PPE?	Done		JUHURST	Nov 2, 2022 7:42:23 PM	No	
7 - Have you performed the proper LOTO?	Done		JUHURST	Nov 2, 2022 7:42:23 PM	No	
10 - Are you aware of the potential risks of performing this repair?	Done		JUHURST	Nov 2, 2022 7:42:23 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO	
11 - Have you successfully completed the Personal Risk Assessment?	Done		JUHURST	Nov 2, 2022 7:42:23 PM	No		
Activity Sub Total							
				Activity 5 Sub Total			
				Parts:			0.00
				Labor:			0.00
				Labor Hours:			0.00
				Sublet Parts:			0.00
				Sublet Labor:			0.00
				Activity Sub Total			0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 55923658
Invoice No. 55345 - 55923658

Client Department:

Department: 55345M

Work Order Description

55345-LIGHT DUTY PMA

Requested By: DARTHURS

Created By: DARTHURS

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 3 - High

Driver:

Phone:

ETA:

Meter: 316,924 - DH

Activity Header

Activity: 10

Activity Note: Light Duty PMI

Reason for Repair:

Work Accomplished:

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
02-Nov-22	F7UZ-6038-EB	INSULATOR, SUPPORT, ENGINE, FRONT, LH	1	43.69	43.69
02-Nov-22	B329	FILTER, OIL, SPIN-ON SEE P550965	1	4.11	4.11

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
02-Nov-22	Junior Hurst	5.92	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List						
10 Desc: Light Duty PMI Task: First Transit North America Light Duty PM Inspection Sheet Performed by: JUHURST Performed on: 02-NOV-22						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,000 - SECTION 1 - Preparation Inspection	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
10,100 - INSPECT_Auto-Transmission Operation/Controller; Neutral Safety Switch	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
10,200 - !FRA!INSPECT_Starter Operation	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
10,300 - !FRA!INSPECT_Warning Lights and Alarms	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
10,400 - !FRA!INSPECT_Back Up Alarm	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
10,500 - !FRA!INSPECT_Engine Operation, OBSERVE_Exhaust for Excessive Smoke	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
10,600 - Check Driver's Pre-trip or DVIR/EVIR & Authorization Forms	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
10,700 - INSPECT_All Exterior Lights (Turn on until Completion of this section)	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
10,800 - *RPT*INSPECT_Body Damage,	Done		JUHURST	Nov 2, 2022	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
Corrosion;DOCUMENT_Issues				8:19:11 PM		
10,900 - INSPECT_Fuel Tank Cap, and Doors	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
11,100 - INSPECT_License Plate, Bracket, Bumpers	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
20,000 - SECTION 2 - Test Drive and Operator Area Inspection	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
20,100 - INSPECT_Driver Seat condition/operation/seatbelt	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
20,200 - TEST DRIVE_INSPECT_Proper Operation; Drive into Shop	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
20,300 - *RPT*INSPECT_Steering Wheel for Play/Bind/Horn Op./Turn Signal Cancelation	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
20,400 - PERFORM_Brake Test (Apply hard enough to check wheel pull and Application)	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
20,500 - *RPT*FRA INSPECT_Lighting/Operation of all Gauges	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
20,600 - *RPT*INSPECT_Windshields, Sun Visors	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
20,700 - INSPECT_Wiper/Washer Operation, Condition	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
20,800 - INSPECT_High Idle Control	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
20,900 - *RPT*!FRA!INSPECT_HVAC Controls, Operation	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
21,000 - *RPT*!FRA!INSPECT_Operation of all Switches and Accessories	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
21,100 - INSPECT_Parking Brake Operation	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
21,200 - !FRA!TEST_Service Brake Backup System (Stationary Brake Tests HYD)	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
21,300 - INSPECT_VIN, Tire Pressure Decal, Data Tags	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
21,400 - *RPT*INSPECT_Drivers Door Hinges, Handles, Controls and Panels	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
21,500 - !FRA!INSPECT_Under Dash Wiring for Proper Routing/Chafing/Securement	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
21,550 - INSPECT_Driver Floor Area for Rust/Water Leaks	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
21,600 - *RPT*INSPECT for WEAR_Pedal Pads, Accelerator, Brake, Parking Brake	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
21,700 - INSPECT_Engine Fault Codes	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
30,000 - SECTION 3 - EXTERIOR INSPECTION - Front	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
31,000 - SSF (Street Side Front)	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
31,010 - *RPT*!FRA!INSPECT_Mirror Mountings, Brackets, Glass	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
31,020 - *RPT*INSPECT_FRONT Springs, Shocks, Spring Shackles	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
31,030 - INSPECT_Mud Flaps, Brackets	Done		JUHURST	Nov 2, 2022	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
				8:19:11 PM		
31,040 - INSPECT_Wiper Blades, Arms	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
32,000 - Engine Inspection	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
32,010 - INSPECT_Hood, Springs and Props	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
32,020 - !FRA!INSPECT_Engine Compartment Condition for Fire Risk Avoidance	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
32,030 - !FRA!INSPECT_for Fluid Leaks, Levels	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
32,040 - !FRA!INSPECT_Hyd_Brake Fluid with Test Strips	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
32,050 - !FRA!INSPECT_RECORD_Coolant Recovery with Refractometer; Test Strips	26 Degree Fahrenheit		JUHURST	Nov 2, 2022 8:19:11 PM	No	
32,060 - PRESSURE TEST_Cooling Systems (Radiator, Cap, hoses and clamps)	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
32,070 - *RPT*INSPECT_Radiator and Mountings, Cores	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
32,080 - *RPT*INSPECT_Fan Assembly, Shroud, Tensioner, Belts, All Belt Driven Components	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
32,090 - *RPT*!FRA!INSPECT_Mounting, Installation of Alternator, AC Compressor	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
32,100 - INSPECT_Intake System	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
32,140 - *RPT*!FRA!RECORD_Underhood Battery Voltages (volts)	14 Volt*		JUHURST	Nov 2, 2022 8:19:11 PM	No	
33,010 - CSF (Curb Side Front)	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
33,020 - *RPT*!FRA!INSPECT_Mirror Mountings, Brackets, Glass	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
33,030 - *RPT*INSPECT_FRONT Springs, Shocks, Spring Shackles	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
33,040 - INSPECT_Mud Flaps, Brackets	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
33,050 - INSPECT_Wiper Blades, Arms	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
33,060 - !FRA!INSPECT_LUBE_Battery Box, Batteries, Tray Slides, Hold Downs	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
33,070 - *RPT*!FRA!RECORD_Side Mounted Battery Voltages (volts)	14 Volt*		JUHURST	Nov 2, 2022 8:19:11 PM	No	
33,080 - INSPECT_Entry door, OPEN_with external lock/switch (if equipped)	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
40,000 - SECTION 4 - Interior Inspection	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
40,100 - *RPT*INSPECT_Step-Well, Step-Tread, Hand Rails, Step-well Light	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
40,200 - INSPECT_Insurance/Registration/Regulatory Forms Dates	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
40,250 - INSPECT_Overhead Compartment for Water Leaks	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
40,300 - INSPECT_Safety Equipment, Fire Extinguisher/Suppression	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
40,400 - INSPECT_Camera Systems, Filter, Electrical Inputs/Outputs-SOP M038	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
40,600 - !FRA!CHECK for HOTSPOTS_Interior Elec Panel Fuses/Circuit Breakers/Connectors	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
40,700 - *RPT*INSPECT_Seats, Covering, Belts, Loose Cushions, Operation	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
40,800 - *RPT*!FRA!INSPECT_Interior Lights; Mirrors	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
40,900 - !FRA!INSPECT_Interior Cleanliness/Potential Projectiles	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
41,000 - INSPECT_All ADA Equip (Lift Seat Belt, floor hold Downs, Belts, Cover, Alarms)	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
41,100 - INSPECT_CLEAN_AC Filter	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
41,200 - INSPECT_Emergency Windows,Hatches,Doors,Alarms/Lights;CHECK_for Leaks	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
41,300 - *RPT*INSPECT_Interior Body, Floor, Stanchions	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
41,400 - *RPT*INSPECT_Passenger Doors, Glass, Seal	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
50,000 - SECTION 5 - UNDER VEHICLE INSPECTION	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
50,100 - *RPT*INSPECT_Steering components-Drag Link, Tie Rods ends and Steering Damper	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
50,200 - INSPECT_Ball Joint Play	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
50,300 - !FRA!INSPECT_Front Wheel Bearings for Play	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
50,400 - LUBE_All Chassis Components	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
50,500 - !FRA!CHANGE_Engine oil,filters	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
50,700 - INSPECT_Tire Condition	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
50,800 - INSPECT_Tire Valve Stems, Double Check Caps	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
50,900 - !FRA!INSPECT_Wheels for Cracks, Loose Lugs/Indicators, Outer Hub Leaks	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
51,000 - RECORD_LF-Tire Tread Depth (32nds)	10 32nds of an inch		JUHURST	Nov 2, 2022 8:19:11 PM	No	
51,100 - RECORD_LF-Tire Air Pressure (psi)	65 Pounds per Square Inch		JUHURST	Nov 2, 2022 8:19:11 PM	No	
51,200 - RECORD_RF-Tire Tread Depth (32nds)	9 32nds of an inch		JUHURST	Nov 2, 2022 8:19:11 PM	No	
51,300 - RECORD_RF-Air Pressure (psi)	65 Pounds per Square Inch		JUHURST	Nov 2, 2022 8:19:11 PM	No	
51,400 - !FRA!INSPECT_FRONT ABS Tone Rings, Sensors, Routing of Cables	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
51,500 - !FRA!INSPECT_Wheel Seals for Leaks	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
51,600 - !FRA!INSPECT_ Front Brake Assemblies	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
51,700 - MEASURE_RECORD_LF - Brake Lining, Pad Thickness (32nds)	10 32nds of an inch		JUHURST	Nov 2, 2022 8:19:11 PM	No	
51,800 - MEASURE_RECORD_RF - Brake Lining, Pad Thickness (32nds)	10 32nds of an inch		JUHURST	Nov 2, 2022 8:19:11 PM	No	
51,900 - INSPECT VISUALLY_RECORD_LF Rotor Condition (inches)	1.2299 Inch		JUHURST	Nov 2, 2022 8:19:11 PM	No	
52,000 - INSPECT VISUALLY_RECORD_RF Rotor Condition (inches)	1.2299 Inch		JUHURST	Nov 2, 2022 8:19:11 PM	No	
52,100 - INSPECT_Vibration Damper	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
52,200 - !FRA!INSPECT_Battery Cable Routing from Battery Box to Starter	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
52,400 - !FRA!INSPECT_Starter Mounting	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
52,500 - !FRA!INSPECT_Engine Exhaust System	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
52,700 - INSPECT_Engine, Transmission Mounts	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
52,800 - !FRA!INSPECT_Engine, Transmission for Fluid Leaks	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
52,900 - INSPECT_Shift Cable Adjustment - All Transmissions	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
53,000 - !FRA!INSPECT_Transmission Breather and Clean	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
53,100 - *RPT*!FRA!INSPECT_Parking Brake Cables, Shoes for Wear, Contamination	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
53,200 - *RPT*INSPECT_A/C Condensor, Fans, Safety Grills	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
53,300 - *RPT*INSPECT_Driveline, Hanger Bearings, U-Joints, Slip Joints, Safety Loop	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
53,400 - *RPT*INSPECT_All Body Mounts and Chassis Frame for Corrosion, Cracks	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
53,500 - !FRA!INSPECT_Fuel Tank, Mountings, Lines	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
53,600 - INSPECT_Tire Condition	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
53,700 - INSPECT_Tire Valve Stems, Double Check Caps	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
53,800 - INSPECT_Mismatched Tire Tread, Casing Design	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
53,900 - INSPECT_Dual Mating Tires w/Square	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
54,000 - !FRA!INSPECT_Wheels for Cracks, Loose Lugs/Indicators, Outer Hub Leaks	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
54,100 - INSPECT_Mud Flaps, Brackets	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
54,200 - RECORD_RRO-Tire Tread Depth (32nds)	9 32nds of an inch		JUHURST	Nov 2, 2022 8:19:11 PM	No	
54,300 - RECORD_RRI-Tire Tread Depth (32nds)	9 32nds of an inch		JUHURST	Nov 2, 2022 8:19:11 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
54,400 - RECORD_RRO-Air Pressure (psi)	65 Pounds per Square Inch		JUHURST	Nov 2, 2022 8:19:11 PM	No	
54,500 - RECORD_RRI-Air Pressure (psi)	65 Pounds per Square Inch		JUHURST	Nov 2, 2022 8:19:11 PM	No	
54,600 - RECORD_LRO-Tire Tread Depth (32nds)	6 32nds of an inch		JUHURST	Nov 2, 2022 8:19:11 PM	No	
54,700 - RECORD_LRI-Tire Tread Depth (32nds)	7 32nds of an inch		JUHURST	Nov 2, 2022 8:19:11 PM	No	
54,800 - RECORD_LRO-Air Pressure (psi)	65 Pounds per Square Inch		JUHURST	Nov 2, 2022 8:19:11 PM	No	
54,900 - RECORD_LRI-Air Pressure (psi)	65 Pounds per Square Inch		JUHURST	Nov 2, 2022 8:19:11 PM	No	
55,000 - !FRA!INSPECT_ REAR Brake Assemblies	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
55,100 - !FRA!INSPECT_ REAR Hubs, Wheel Seals for Oil Leaks	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
55,200 - !FRA!INSPECT_ REAR ABS Tone Rings, Sensors, Routing Of Cables (if equipped)	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
55,300 - MEASURE_RECORD_LR - Brake Lining, Pad Thickness (32nds)	8 32nds of an inch		JUHURST	Nov 2, 2022 8:19:11 PM	No	
55,400 - MEASURE_RECORD_RR - Brake Lining, Pad Thickness (32nds)	8 32nds of an inch		JUHURST	Nov 2, 2022 8:19:11 PM	No	
55,500 - INSPECT VISUALLY_MEASURE_RECORD_LR Drum, Rotor Condition (inches)	1.2299 Inch		JUHURST	Nov 2, 2022 8:19:11 PM	No	
55,600 - INSPECT VISUALLY_MEASURE_RECORD_RR Drum, Rotor Condition (inches)	1.2299 Inch		JUHURST	Nov 2, 2022 8:19:11 PM	No	
55,700 - !FRA!INSPECT_ Under Body Exhaust System	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
55,800 - *RPT*INSPECT_ REAR Axle Housing, Breather; CLEAN_Breather	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
55,900 - *RPT*INSPECT_ REAR Springs, Shocks, Suspension, Airbags	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
60,000 - SECTION 6 - Wheelchair Inspection	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
60,100 - RECORD_Wheelchair Cycle Count	4710 Cycles		JUHURST	Nov 2, 2022 8:19:11 PM	No	
60,200 - CHECK_Lift Access Door for Ease of Opening,Latch Security,Door Hold Back	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
60,300 - CHECK_Platform Emergency Release Mechanism for Ease of Operation	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
60,400 - OPERATE_Lift thru Complete Cycle;CHECK_Noises,Jerky Op,Too Fast-Slow,Drift Down	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
60,500 - INSPECT_Bridgeplate Operation	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
60,600 - INSPECT_All Pivot Points for Wear and Looseness	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
60,700 - INSPECT_Rollers for Wear and Smooth Rotation	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
60,800 - INSPECT_Operation of Platform Barrier Mechanism	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
60,900 - INSPECT_Cam Slots for Wear and Proper Alignment	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
61,000 - INSPECT_Cable Condition (If Applicable)	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
61,100 - INSPECT_Hydraulic Hoses for Leaks, Chafing or Cracks	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
61,200 - INSPECT_Electrical Connections and Routing of Wires and Cables	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
61,300 - INSPECT_Operation and Adjustment of All Safety Switches	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
61,400 - INSPECT_All Lift Mounting Brackets for Loose Bolts Broken Welds, etc.	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
61,500 - INSPECT_Manual Back-up Raise/Lower System (If Applicable)	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
61,600 - INSPECT_HydrPump Reservoir Oil Level. Consult SvcManual for Fluid to Use.	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
61,700 - CHECK_Operator Decals for Proper Positioning;CONSULT_Service Manual	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
61,800 - CHECK_WC Holddowns Inside Vehicle for Secure Mounting,Proper Operation	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
61,900 - CLEAN_Linkages and Mechanisms	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
62,000 - LUBRICATE_Linkages and Mechanisms (DO NOT OVER Lubricate)	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
62,100 - INSPECT_Emergency Platform Release Mechanism	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
62,200 - INSPECT_Platform Barrier Latch Mechanism	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
62,300 - INSPECT_Bridgeplate Hinge	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
62,400 - INSPECT_All Pivot Points	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
62,500 - INSPECT_Cams and Slots	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
62,600 - INSPECT_Rollers	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
62,700 - INSPECT_All Linkages	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
70,000 - SECTION 7 - ALTERNATIVE FUELS INSPECTION	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
70,300 - INSPECT_Condition of Fuel Pressure Gauge	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
70,400 - PROVIDE PROOF_Tank_Dents/Scratches and Re-Certification	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
70,500 - INSPECT_Tank test date, labels-Reference-ST.4 FMMVSS 304 & ANSI-CSA NGV2	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
70,600 - INSPECT_Tank Lines to Ensure Secure Mounting, Insulation Against Vibration	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
70,700 - INSPECT_Filling Nozzle for Securely Fitting Cap	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
70,800 - INSPECT_Pressure Relief Device's Venting System, Valves, Ducting to MNFR Specs	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
80,000 - SECTION 8 - PMI Report Completion	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
80,100 - COMPLETE_PM Report; Follow-ups	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	
80,200 - RETURN_Vehicle to Predetermined Location	Done		JUHURST	Nov 2, 2022 8:19:11 PM	No	

Activity Sub Total

Activity 10 Sub Total	
Parts:	47.80
Labor:	0.00
Labor Hours:	5.92
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	47.80



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 55923658
Invoice No. 55345 - 55923658

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FD4E4FS7EDB17176
55345-LIGHT DUTY PMA		Ford E450 Champion Challenger	
Requested By:	DARTHURS	Status:	40 - Closed (40)
Created By:	DARTHURS	Priority:	3 - High
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	316,924 - DH

Activity Header						
Activity:20 999 TOTAL VEHICLE						
Activity Note: PM A						
Reason for Repair:		08 Preventive Maintenance				
Work Accomplished:		A PM Level A				
Part Failure:						
Activity Comments:						
Activity Parts						
No Data Available						
Activity Labor						
No Data Available						
Activity Sublet						
No Data Available						
Activity Checklist						
Check List						
20 Desc: PM A						
Task: PM A SERVICE Performed by: JUHURST Performed on: 02-NOV-22						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
100,000 - "A" PMI SERVICING ITEMS	Done		JUHURST	Nov 2, 2022 8:30:41 PM	No	
101,000 - FRA Change Oil Filters	Yes		JUHURST	Nov 2, 2022 8:30:41 PM	No	
102,000 - FRA Drain Engine Oil	Yes		JUHURST	Nov 2, 2022 8:30:41 PM	No	
103,000 - FRA Check Transmission Fluid	Done		JUHURST	Nov 2, 2022 8:30:41 PM	No	
104,000 - Lubricate Chassis	Done		JUHURST	Nov 2, 2022 8:30:41 PM	No	
105,000 - Replace or Clean A/C Filters	Done		JUHURST	Nov 2, 2022 8:30:41 PM	No	
107,000 - FRA Change Primary Fuel Filter	Yes		JUHURST	Nov 2, 2022 8:30:41 PM	No	
108,000 - Lube all pivoting Mechanisms	Done		JUHURST	Nov 2, 2022 8:30:41 PM	No	
Activity Sub Total						
				Activity 20 Sub Total		
				Parts:	0.00	
				Labor:	0.00	
				Labor Hours:	0.00	
				Sublet Parts:	0.00	

		Sublet Labor:	0.00
		Activity Sub Total	0.00
Work Order Footer			
		Work Order 55923658 Total	
		Parts:	47.80
		Labor:	0.00
		Labor Hours:	5.92
		Sublet Parts:	0.00
		Sublet Labor:	0.00
		Activity Sub Total	47.80



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 56084701
Invoice No. 55345 - 56084701

Client Department:

Department: 55345M

Work Order Description

WC lift malfunction.

Requested By: EARJOHNSON

Created By: EARJOHNSON

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 2 - Medium

Driver:

Phone:

ETA:

Meter: 316,379 - DH

Chronology

Reported	Oct 30, 2022 1:40:04 PM	Oct 30, 2022 1:40:04 PM
Started	Oct 30, 2022 1:41:00 PM	
Completed	Oct 30, 2022 4:22:00 PM	Oct 30, 2022 4:22:00 PM
Down Time		

Work Order Notes

Line 10 To file warranty be sure to do the following:

- 1) Enter a COMPLAINT statement for each activity.
- 2) Enter CAUSE statement in the Notes field of each activity.
- 3) Enter CORRECTION statement in the Comment section of each activity.

Complaint: WC lift malfunction.

Cause: Unknown.

Correction: Ran lift through 5 consecutive cycles, loaded with no issues. Will monitor.

Activity Header

Activity: 5 999 TOTAL VEHICLE

Activity Note: Personal Risk Assessment

Reason for Repair: SW Shop Work Order

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: Personal Risk Assessment

Task: PRA and Meter Readings Performed by: EARJOHNSON Performed on: 30-OCT-22

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		EARJOHNSON	Oct 30, 2022 4:20:19 PM	No	
2 - If task requires lifting, are lifts secured, are	Done		EARJOHNSON	Oct 30, 2022	No	


Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
jack stands used correctly?				4:20:19 PM		
4 - Are you wearing the appropriate PPE?	Done		EARJOHNSON	Oct 30, 2022 4:20:19 PM	No	
7 - Have you performed the proper LOTO?	Done		EARJOHNSON	Oct 30, 2022 4:20:19 PM	No	
10 - Are you aware of the potential risks of performing this repair?	Done		EARJOHNSON	Oct 30, 2022 4:20:19 PM	No	
11 - Have you successfully completed the Personal Risk Assessment?	Done		EARJOHNSON	Oct 30, 2022 4:20:19 PM	No	

Activity Sub Total

Activity 5 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 56084701
Invoice No. 55345 - 56084701

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FD4E4FS7EDB17176
WC lift malfunction.		Ford E450 Champion Challenger	
Requested By:	EARJOHNSON	Status:	40 - Closed (40)
Created By:	EARJOHNSON	Priority:	2 - Medium
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	316,379 - DH

Activity Header
Activity: 15 068/003/000 SYSTEM, HYDRAULIC, LIFTING/UNLOADING
Activity Note: WC lift malfunction.
Reason for Repair: 05 Inspection, Routine
Work Accomplished: 03 Replace New
Part Failure:
Activity Comments:

Activity Parts
No Data Available

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
30-Oct-22	Earl Johnson	2.63	0	0

Activity Sublet
No Data Available


Activity Checklist
No Data Available
No Data Available

Activity Sub Total		Activity 15 Sub Total	
Parts:	0.00	Parts:	0.00
Labor:	0.00	Labor:	0.00
Labor Hours:	2.63	Labor Hours:	2.63
Sublet Parts:	0.00	Sublet Parts:	0.00
Sublet Labor:	0.00	Sublet Labor:	0.00
Activity Sub Total		Activity Sub Total	
		0.00	

Work Order Footer		Work Order 56084701 Total	
Parts:	0.00	Parts:	0.00
Labor:	0.00	Labor:	0.00
Labor Hours:	2.63	Labor Hours:	2.63
Sublet Parts:	0.00	Sublet Parts:	0.00
Sublet Labor:	0.00	Sublet Labor:	0.00
Activity Sub Total		Activity Sub Total	
		0.00	



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 55956529
Invoice No. 55345 - 55956529

Client Department:

Department: 55345M

Work Order Description

Road Call no start condition

Requested By: CVERGARA

Created By: CVERGARA

Assigned To:

Class: WORC - WORK ORDER ROAD CALL

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 3 - High

Driver:

Phone:

ETA:

Meter: 313,292 - DH

Chronology

Reported	Sep 16, 2022 10:57:00 AM	Sep 16, 2022 10:57:00 AM
Started	Sep 16, 2022 11:00:00 AM	
Completed	Sep 16, 2022 1:02:00 PM	Sep 16, 2022 1:02:00 PM
Down Time		

Work Order Notes

Line 10 To file warranty be sure to do the following:

- 1) Enter a COMPLAINT statement for each activity.
- 2) Enter CAUSE statement in the Notes field of each activity.
- 3) Enter CORRECTION statement in the Comment section of each activity.

Complaint: road call bus won't start

Cause: drive said bus won't start

Correction: drive don't know are to start the bus ,start the bus completed

Activity Header

Activity: 5 999 TOTAL VEHICLE

Activity Note: PRAMETER

Reason for Repair: SW Shop Work Order

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: PRAMETER

Task: PRA and Meter Readings Performed by: HPIERRE Performed on: 16-SEP-22

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		HPIERRE	Sep 16, 2022 1:02:05 PM	No	
2 - If task requires lifting, are lifts secured, are jack	Done		HPIERRE	Sep 16, 2022	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
stands used correctly?				1:02:05 PM		
4 - Are you wearing the appropriate PPE?	Done		HPIERRE	Sep 16, 2022 1:02:05 PM	No	
7 - Have you performed the proper LOTO?	Done		HPIERRE	Sep 16, 2022 1:02:05 PM	No	
10 - Are you aware of the potential risks of performing this repair?	Done		HPIERRE	Sep 16, 2022 1:02:05 PM	No	
11 - Have you successfully completed the Personal Risk Assessment?	Done		HPIERRE	Sep 16, 2022 1:02:05 PM	No	

Activity Sub Total

Activity 5 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 55956529
Invoice No. 55345 - 55956529

Client Department:

Department: 55345M

Work Order Description

Road Call no start condition

Requested By: CVERGARA

Created By: CVERGARA

Assigned To:

Class: WORC - WORK ORDER ROAD CALL

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 3 - High

Driver:

Phone:

ETA:

Meter: 313,292 - DH

Activity Header

Activity: 10 999 TOTAL VEHICLE

Activity Note: ROAD CALL

Reason for Repair: 10 Road Call

Work Accomplished:

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
16-Sep-22	Pierre,Hubert J	1.95	0	0

Activity Sublet

No Data Available

Activity Checklist

No Data Available

No Data Available

Activity Sub Total

Activity 10 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	1.95
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00

Work Order Footer

Work Order 55956529 Total

Parts:	0.00
Labor:	0.00
Labor Hours:	1.95
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 1



Work Order No. 55923621
Invoice No. 55345 - 55923621

Client Department:
Department: 55345M
Work Order Description
FOLLOWUP-FT Light Duty
Requested By: DARTHURS
Created By: DARTHURS
Assigned To:
Class: -
Arrangement: Unassigned
Potential Warranty: No
Equipment No.: 4514-P
VIN: 1FDFE4FS7EDB17176
Ford E450 Champion Challenger
Status: 40 - Closed (40)
Priority: 3 - High
Driver:
Phone:
ETA:
Meter: 312,210 - DH

Chronology		
Reported	Sep 7, 2022 8:53:26 PM	Sep 7, 2022 8:53:26 PM
Started	Sep 7, 2022 9:33:00 PM	
Completed	Sep 7, 2022 10:11:00 PM	Sep 7, 2022 10:11:00 PM
Down Time		

Work Order Notes

Line 10 One Front Clearance Light Out. Remove & Replace Clearance Light.
Parts #3974688 Qty (1)

Activity Header
Activity: 10 034/003/000 LAMPS, SIGNAL, PARKING & BACKUP
Activity Note: Clearance Light out
Reason for Repair: FW Follow Up
Work Accomplished:
Part Failure:
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
07-Sep-22	3974688	LAMP, LED, AMBER	1	8.9	8.9

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
07-Sep-22	Arthurs,Durvin	0.62	0	0

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available

Activity Sub Total		Activity 10 Sub Total	
Parts:	8.90	Labor:	0.00
Labor Hours:	0.62	Sublet Parts:	0.00
Sublet Labor:	0.00	Sublet Labor:	0.00
Activity Sub Total		8.90	

Work Order Footer		Work Order 55923621 Total	
Parts:	8.90	Labor:	0.00
Labor Hours:	0.62	Sublet Parts:	0.00
Sublet Labor:	0.00	Sublet Labor:	0.00

	Activity Sub Total	8.90
--	---------------------------	-------------



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 55809306
Invoice No. 55345 - 55809306

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
55345-LIGHT DUTY PMC		Ford E450 Champion Challenger	
Requested By:	DARTHURS	Status:	40 - Closed (40)
Created By:	DARTHURS	Priority:	3 - High
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	312,210 - DH

Chronology

Reported	Sep 2, 2022 12:00:00 AM	Sep 2, 2022 12:00:00 AM
Started	Sep 2, 2022 1:08:00 PM	
Completed	Sep 7, 2022 9:32:00 PM	Sep 7, 2022 9:32:00 PM
Down Time		

Work Order Notes

Line 10 Perform PMC Service. Change Oil & Filter.lube all Pivoting Points. Check Brakes Clewn Batteries. Drain & Fill Differential
parts # B 329 Qty (1)
Oil 10W30 Qty (7,0) Qts

Activity Header

Activity:5 999/999/999 TOTAL VEHICLE
Activity Note: PERSONAL RISK ASSESSMENT
Reason for Repair: SW Shop Work Order
Work Accomplished: 06 Inspect
Part Failure: 00 No Failure
Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
07-Sep-22	B329	FILTER, OIL, SPIN-ON SEE P550965	1	7.57	7.57

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: PERSONAL RISK ASSESSMENT

Task: PRA and Meter Readings Performed by: DARTHURS Performed on: 07-SEP-22

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		DARTHURS	Sep 7, 2022 9:02:53 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		DARTHURS	Sep 7, 2022 9:02:53 PM	No	
4 - Are you wearing the appropriate PPE?	Done		DARTHURS	Sep 7, 2022 9:02:53 PM	No	
7 - Have you performed the proper LOTO?	Done		DARTHURS	Sep 7, 2022 9:02:53 PM	No	
10 - Are you aware of the potential risks of performing this repair?	Done		DARTHURS	Sep 7, 2022 9:02:53 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
11 - Have you successfully completed the Personal Risk Assessment?	Done		DARTHURS	Sep 7, 2022 9:02:53 PM	No	

Activity Sub Total

Activity 5 Sub Total	
Parts:	7.57
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	7.57



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 55809306
Invoice No. 55345 - 55809306

Client Department:

Department: 55345M

Work Order Description

55345-LIGHT DUTY PMC

Requested By: DARTHURS

Created By: DARTHURS

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 3 - High

Driver:

Phone:

ETA:

Meter: 312,210 - DH

Activity Header

Activity: 10 079 DEVICES, SAFETY/STABILITY, TRAILER

Activity Note: Light Duty PMI

Reason for Repair: 05 Inspection, Routine

Work Accomplished:

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
07-Sep-22	Arthurs,Durvin	3.08	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List						
10 Desc: Light Duty PMI						
Task: First Transit North America Light Duty PM Inspection Sheet Performed by: DARTHURS Performed on: 07-SEP-22						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,000 - SECTION 1 - Preparation Inspection	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
10,100 - INSPECT_Auto-Transmission Operation/Controller; Neutral Safety Switch	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
10,200 - !FRA!INSPECT_Starter Operation	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
10,300 - !FRA!INSPECT_Warning Lights and Alarms	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
10,400 - !FRA!INSPECT_Back Up Alarm	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
10,500 - !FRA!INSPECT_Engine Operation, OBSERVE_Exhaust for Excessive Smoke	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
10,600 - Check Driver's Pre-trip or DVIR/EVIR & Authorization Forms	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
10,700 - INSPECT_All Exterior Lights (Turn on until Completion of this section)	-	Clearance Light out	DARTHURS	Sep 7, 2022 8:58:32 PM	Yes	55923621
10,800 - *RPT*INSPECT_Body Damage, Corrosion;DOCUMENT_Issues	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
10,900 - INSPECT_Fuel Tank Cap, and Doors	Done		DARTHURS	Sep 7, 2022	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
				8:58:32 PM		
11,100 - INSPECT_License Plate, Bracket, Bumpers	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
20,000 - SECTION 2 - Test Drive and Operator Area Inspection	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
20,100 - INSPECT_Driver Seat condition/operation/seatbelt	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
20,200 - TEST DRIVE_INSPECT_Proper Operation; Drive into Shop	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
20,300 - *RPT*INSPECT_Steering Wheel for Play/Bind/Horn Op./Turn Signal Cancelation	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
20,400 - PERFORM_Brake Test (Apply hard enough to check wheel pull and Application)	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
20,500 - *RPT*FRA INSPECT_Lighting/Operation of all Gauges	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
20,600 - *RPT*INSPECT_Windshields, Sun Visors	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
20,700 - INSPECT_Wiper/Washer Operation, Condition	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
20,800 - INSPECT_High Idle Control	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
20,900 - *RPT*!FRA!INSPECT_HVAC Controls, Operation	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
21,000 - *RPT*!FRA!INSPECT_Operation of all Switches and Accessories	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
21,100 - INSPECT_Parking Brake Operation	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
21,200 - !FRA!TEST_Service Brake Backup System (Stationary Brake Tests HYD)	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
21,300 - INSPECT_VIN, Tire Pressure Decal, Data Tags	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
21,400 - *RPT*INSPECT_Drivers Door Hinges, Handles, Controls and Panels	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
21,500 - !FRA!INSPECT_Under Dash Wiring for Proper Routing/Chafing/Securement	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
21,550 - INSPECT_Driver Floor Area for Rust/Water Leaks	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
21,600 - *RPT*INSPECT for WEAR_Pedal Pads, Accelerator, Brake, Parking Brake	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
21,700 - INSPECT_Engine Fault Codes	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
30,000 - SECTION 3 - EXTERIOR INSPECTION - Front	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
31,000 - SSF (Street Side Front)	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
31,010 - *RPT*!FRA!INSPECT_Mirror Mountings, Brackets, Glass	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
31,020 - *RPT*INSPECT_FRONT Springs, Shocks, Spring Shackles	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
31,030 - INSPECT_Mud Flaps, Brackets	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
31,040 - INSPECT_Wiper Blades, Arms	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
32,000 - Engine Inspection	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
32,010 - INSPECT_Hood, Springs and Props	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
32,020 - !FRA!INSPECT_Engine Compartment Condition for Fire Risk Avoidance	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
32,030 - !FRA!INSPECT_for Fluid Leaks, Levels	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
32,040 - !FRA!INSPECT_Hyd_Brake Fluid with Test Strips	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
32,050 - !FRA!INSPECT_RECORD_Coolant Recovery with Refractometer; Test Strips	Degree Fahrenheit	NA	DARTHURS	Sep 7, 2022 8:58:32 PM	No	
32,060 - PRESSURE TEST_Cooling Systems (Radiator, Cap, hoses and clamps)	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
32,070 - *RPT*INSPECT_Radiator and Mountings, Cores	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
32,080 - *RPT*INSPECT_Fan Assembly, Shroud, Tensioner, Belts, All Belt Driven Components	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
32,090 - *RPT*!FRA!INSPECT_Mounting, Installation of Alternator, AC Compressor	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
32,100 - INSPECT_Intake System	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
32,140 - *RPT*!FRA!RECORD_Underhood Battery Voltages (volts)	0 Volt*		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
33,010 - CSF (Curb Side Front)	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
33,020 - *RPT*!FRA!INSPECT_Mirror Mountings, Brackets, Glass	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
33,030 - *RPT*INSPECT_FRONT Springs, Shocks, Spring Shackles	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
33,040 - INSPECT_Mud Flaps, Brackets	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
33,050 - INSPECT_Wiper Blades, Arms	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
33,060 - !FRA!INSPECT_LUBE_Battery Box, Batteries, Tray Slides, Hold Downs	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
33,070 - *RPT*!FRA!RECORD_Side Mounted Battery Voltages (volts)	13.98 Volt*		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
33,080 - INSPECT_Entry door, OPEN_with external lock/switch (if equipped)	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
40,000 - SECTION 4 - Interior Inspection	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
40,100 - *RPT*INSPECT_Step-Well, Step-Tread, Hand Rails, Step-well Light	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
40,200 - INSPECT_Insurance/Registration/Regulatory Forms Dates	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
40,250 - INSPECT_Overhead Compartment for Water Leaks	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
40,300 - INSPECT_Safety Equipment, Fire	Done		DARTHURS	Sep 7, 2022	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
Extinguisher/Suppression				8:58:32 PM		
40,400 - INSPECT_Camera Systems, Filter, Electrical Inputs/Outputs-SOP M038	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
40,600 - !FRA!CHECK for HOTSPOTS_Interior Elec Panel Fuses/Circuit Breakers/Connectors	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
40,700 - *RPT*INSPECT_Seats, Covering, Belts, Loose Cushions, Operation	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
40,800 - *RPT*!FRA!INSPECT_Interior Lights; Mirrors	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
40,900 - !FRA!INSPECT_Interior Cleanliness/Potential Projectiles	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
41,000 - INSPECT_All ADA Equip (Lift Seat Belt, floor hold Downs, Belts, Cover, Alarms)	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
41,100 - INSPECT_CLEAN_AC Filter	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
41,200 - INSPECT_Emergency Windows,Hatches,Doors,Alarms/Lights;CHECK_for Leaks	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
41,300 - *RPT*INSPECT_Interior Body, Floor, Stanchions	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
41,400 - *RPT*INSPECT_Passenger Doors, Glass, Seal	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
50,000 - SECTION 5 - UNDER VEHICLE INSPECTION	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
50,100 - *RPT*INSPECT_Steering components-Drag Link, Tie Rods ends and Steering Damper	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
50,200 - INSPECT_Ball Joint Play	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
50,300 - !FRA!INSPECT_Front Wheel Bearings for Play	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
50,400 - LUBE_All Chassis Components	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
50,500 - !FRA!CHANGE_Engine oil,filters	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
50,700 - INSPECT_Tire Condition	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
50,800 - INSPECT_Tire Valve Stems, Double Check Caps	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
50,900 - !FRA!INSPECT_Wheels for Cracks, Loose Lugs/Indicators, Outer Hub Leaks	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
51,000 - RECORD_LF-Tire Tread Depth (32nds)	10 32nds of an inch		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
51,100 - RECORD_LF-Tire Air Pressure (psi)	70 Pounds per Square Inch		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
51,200 - RECORD_RF-Tire Tread Depth (32nds)	11 32nds of an inch		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
51,300 - RECORD_RF-Air Pressure (psi)	70 Pounds per Square Inch		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
51,400 - !FRA!INSPECT_FRONT ABS Tone Rings, Sensors, Routing of Cables	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
51,500 - !FRA!INSPECT_Wheel Seals for Leaks	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
51,600 - !FRA!INSPECT_ Front Brake Assemblies	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
51,700 - MEASURE_RECORD_LF - Brake Lining, Pad Thickness (32nds)	10 32nds of an inch		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
51,800 - MEASURE_RECORD_RF - Brake Lining, Pad Thickness (32nds)	10 32nds of an inch		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
51,900 - INSPECT VISUALLY_RECORD_LF Rotor Condition (inches)	1.554 Inch		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
52,000 - INSPECT VISUALLY_RECORD_RF Rotor Condition (inches)	1.554 Inch		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
52,100 - INSPECT_Vibration Damper	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
52,200 - !FRA!INSPECT_Battery Cable Routing from Battery Box to Starter	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
52,400 - !FRA!INSPECT_Starter Mounting	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
52,500 - !FRA!INSPECT_Engine Exhaust System	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
52,700 - INSPECT_Engine, Transmission Mounts	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
52,800 - !FRA!INSPECT_Engine, Transmission for Fluid Leaks	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
52,900 - INSPECT_Shift Cable Adjustment - All Transmissions	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
53,000 - !FRA!INSPECT_Transmission Breather and Clean	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
53,100 - *RPT*!FRA!INSPECT_Parking Brake Cables, Shoes for Wear, Contamination	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
53,200 - *RPT*INSPECT_A/C Condensor, Fans, Safety Grills	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
53,300 - *RPT*INSPECT_Driveline, Hanger Bearings, U-Joints, Slip Joints, Safety Loop	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
53,400 - *RPT*INSPECT_All Body Mounts and Chassis Frame for Corrosion, Cracks	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
53,500 - !FRA!INSPECT_Fuel Tank, Mountings, Lines	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
53,600 - INSPECT_Tire Condition	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
53,700 - INSPECT_Tire Valve Stems, Double Check Caps	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
53,800 - INSPECT_Mismatched Tire Tread, Casing Design	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
53,900 - INSPECT_Dual Mating Tires w/Square	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
54,000 - !FRA!INSPECT_Wheels for Cracks, Loose Lugs/Indicators, Outer Hub Leaks	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
54,100 - INSPECT_Mud Flaps, Brackets	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
54,200 - RECORD_RRO-Tire Tread Depth (32nds)	12 32nds of an inch		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
54,300 - RECORD_RRI-Tire Tread Depth (32nds)	12 32nds of an inch		DARTHURS	Sep 7, 2022 8:58:32 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
54,400 - RECORD_RRO-Air Pressure (psi)	65 Pounds per Square Inch		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
54,500 - RECORD_RRI-Air Pressure (psi)	65 Pounds per Square Inch		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
54,600 - RECORD_LRO-Tire Tread Depth (32nds)	7 32nds of an inch		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
54,700 - RECORD_LRI-Tire Tread Depth (32nds)	9 32nds of an inch		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
54,800 - RECORD_LRO-Air Pressure (psi)	65 Pounds per Square Inch		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
54,900 - RECORD_LRI-Air Pressure (psi)	65 Pounds per Square Inch		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
55,000 - !FRA!INSPECT_ REAR Brake Assemblies	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
55,100 - !FRA!INSPECT_ REAR Hubs, Wheel Seals for Oil Leaks	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
55,200 - !FRA!INSPECT_REAR ABS Tone Rings, Sensors, Routing Of Cables (if equipped)	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
55,300 - MEASURE_RECORD_LR - Brake Lining, Pad Thickness (32nds)	10 32nds of an inch		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
55,400 - MEASURE_RECORD_RR - Brake Lining, Pad Thickness (32nds)	10 32nds of an inch		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
55,500 - INSPECT VISUALLY_MEASURE_RECORD_LR Drum, Rotor Condition (inches)	1.665 Inch		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
55,600 - INSPECT VISUALLY_MEASURE_RECORD_RR Drum, Rotor Condition (inches)	1.665 Inch		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
55,700 - !FRA!INSPECT_ Under Body Exhaust System	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
55,800 - *RPT*INSPECT_ REAR Axle Housing, Breather; CLEAN_Breather	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
55,900 - *RPT*INSPECT_ REAR Springs, Shocks, Suspension, Airbags	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
60,000 - SECTION 6 - Wheelchair Inspection	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
60,100 - RECORD_Wheelchair Cycle Count	14.894 Cycles		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
60,200 - CHECK_Lift Access Door for Ease of Opening,Latch Security,Door Hold Back	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
60,300 - CHECK_Platform Emergency Release Mechanism for Ease of Operation	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
60,400 - OPERATE_Lift thru Complete Cycle;CHECK_Noises,Jerky Op,Too Fast-Slow,Drift Down	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
60,500 - INSPECT_Bridgeplate Operation	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
60,600 - INSPECT_All Pivot Points for Wear and Looseness	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
60,700 - INSPECT_Rollers for Wear and Smooth Rotation	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
60,800 - INSPECT_Operation of Platform Barrier	Done		DARTHURS	Sep 7, 2022	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
Mechanism				8:58:32 PM		
60,900 - INSPECT_Cam Slots for Wear and Proper Alignment	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
61,000 - INSPECT_Cable Condition (If Applicable)	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
61,100 - INSPECT_Hydraulic Hoses for Leaks, Chafing or Cracks	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
61,200 - INSPECT_Electrical Connections and Routing of Wires and Cables	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
61,300 - INSPECT_Operation and Adjustment of All Safety Switches	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
61,400 - INSPECT_All Lift Mounting Brackets for Loose Bolts Broken Welds, etc.	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
61,500 - INSPECT_Manual Back-up Raise/Lower System (If Applicable)	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
61,600 - INSPECT_HydrPump Reservoir Oil Level. Consult SvcManual for Fluid to Use.	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
61,700 - CHECK_Operator Decals for Proper Positioning;CONSULT_Service Manual	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
61,800 - CHECK_WC Holddowns Inside Vehicle for Secure Mounting;Proper Operation	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
61,900 - CLEAN_Linkages and Mechanisms	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
62,000 - LUBRICATE_Linkages and Mechanisms (DO NOT OVER Lubricate)	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
62,100 - INSPECT_Emergency Platform Release Mechanism	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
62,200 - INSPECT_Platform Barrier Latch Mechanism	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
62,300 - INSPECT_Bridgeplate Hinge	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
62,400 - INSPECT_All Pivot Points	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
62,500 - INSPECT_Cams and Slots	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
62,600 - INSPECT_Rollers	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
62,700 - INSPECT_All Linkages	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
70,000 - SECTION 7 - ALTERNATIVE FUELS INSPECTION	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
70,300 - INSPECT_Condition of Fuel Pressure Gauge	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
70,400 - PROVIDE PROOF_Tank_Dents/Scratches and Re-Certification	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
70,500 - INSPECT_Tank test date, labels-Reference-ST.4 FMMVSS 304 & ANSI-CSA NGV2	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
70,600 - INSPECT_Tank Lines to Ensure Secure Mounting, Insulation Against Vibration	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
70,700 - INSPECT_Filling Nozzle for Securely Fitting Cap	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
70,800 - INSPECT_ Pressure Relief Device's Venting System, Valves, Ducting to MNFR Specs	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
80,000 - SECTION 8 - PMI Report Completion	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
80,100 - COMPLETE_PM Report; Follow-ups	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	
80,200 - RETURN_Vehicle to Predetermined Location	Done		DARTHURS	Sep 7, 2022 8:58:32 PM	No	

Activity Sub Total

Activity 10 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	3.08
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 55809306
Invoice No. 55345 - 55809306

Client Department:

Department: 55345M

Work Order Description

55345-LIGHT DUTY PMC

Requested By: DARTHURS

Created By: DARTHURS

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 3 - High

Driver:

Phone:

ETA:

Meter: 312,210 - DH

Activity Header

Activity: 20 999 TOTAL VEHICLE

Activity Note: PM C

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: C PM Level C

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
07-Sep-22	Arthurs,Durvin	0.37	0	0
02-Sep-22	Junior Hurst	0.67	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

20 Desc: PM C

Task: PM C SERVICE Performed by: DARTHURS Performed on: 07-SEP-22

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
100,000 - "A" PMI SERVICING ITEMS	Done		DARTHURS	Sep 7, 2022 9:01:55 PM	No	
101,000 - FRA Change Oil Filters	Yes		DARTHURS	Sep 7, 2022 9:01:55 PM	No	
102,000 - FRA Drain Engine Oil	Yes		DARTHURS	Sep 7, 2022 9:01:55 PM	No	
103,000 - FRA Check Transmission Fluid	Done		DARTHURS	Sep 7, 2022 9:01:55 PM	No	
104,000 - Lubricate Chassis	Done		DARTHURS	Sep 7, 2022 9:01:55 PM	No	
105,000 - Replace or Clean A/C Filters	Done		DARTHURS	Sep 7, 2022 9:01:55 PM	No	
107,000 - FRA Change Primary Fuel Filter	-	NA	DARTHURS	Sep 7, 2022 9:01:55 PM	No	
108,000 - Lube all pivoting Mechanisms	Done		DARTHURS	Sep 7, 2022 9:01:55 PM	No	
200,000 - "B" PMI SERVICING ITEMS (12 MONTH)	Done		DARTHURS	Sep 7, 2022 9:01:55 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
201,000 - Service Crankcase Breather	-	NA	DARTHURS	Sep 7, 2022 9:01:55 PM	No	
203,000 - FRA Change Automatic Transmission Fluid	No		DARTHURS	Sep 7, 2022 9:01:55 PM	No	
204,000 - FRA Change Power Steering Fluid and Filter	No		DARTHURS	Sep 7, 2022 9:01:55 PM	No	
205,000 - Complete Engine Diagnostics and Clear Codes when Completed	Done		DARTHURS	Sep 7, 2022 9:01:55 PM	No	
300,000 - "C" PMI SERVICING ITEMS (24 MONTH)	Done		DARTHURS	Sep 7, 2022 9:01:55 PM	No	
301,000 - Check and Lubricate Door Linkages	Done		DARTHURS	Sep 7, 2022 9:01:55 PM	No	
302,000 - Check Toe-In and Record Reading	-	NA	DARTHURS	Sep 7, 2022 9:01:55 PM	No	
302,001 - Record Toe-In Reading	Inches, fraction-actual	NA	DARTHURS	Sep 7, 2022 9:01:55 PM	No	
304,000 - 1st "C" PMI ONLY: Tune Up Per Engine Mfg's Specifications	No		DARTHURS	Sep 7, 2022 9:01:55 PM	No	
305,000 - FRA Change Differential Fluid	Yes		DARTHURS	Sep 7, 2022 9:01:55 PM	No	

Activity Sub Total

Activity 20 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	1.04
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00

Work Order Footer

Work Order 55809306 Total	
Parts:	7.57
Labor:	0.00
Labor Hours:	4.12
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	7.57



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 55877152
Invoice No. 55345 - 55877152

Client Department:

Department: 55345M

Work Order Description

check engine light on

Requested By: CVERGARA

Created By: CVERGARA

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: -

Driver:

Phone:

ETA:

Meter: 310,526 - DH

Chronology

Reported	Aug 22, 2022 2:18:00 PM	Aug 22, 2022 2:18:00 PM
Started	Aug 22, 2022 12:00:00 AM	
Completed	Aug 23, 2022 1:31:00 PM	Aug 23, 2022 1:31:00 PM
Down Time		

Work Order Notes

Line 10 vehicle came in for check engine light and camera issue (engine and found the # 9 cylinder misfire cord p009E. remove the spark plug now unit working perfect) after check camera and all camera are working will monitor return vehicle back to work

Activity Header

Activity: 10 999/999/999 TOTAL VEHICLE

Activity Note: PRA

Reason for Repair: SW Shop Work Order

Work Accomplished: 06 Inspect

Part Failure: 00 No Failure

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: PRA

Task: PRA and Meter Readings Performed by: JUHURST Performed on: 23-AUG-22

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		JUHURST	Aug 23, 2022 12:48:18 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		JUHURST	Aug 23, 2022 12:48:18 PM	No	
4 - Are you wearing the appropriate PPE?	Done		JUHURST	Aug 23, 2022 12:48:18 PM	No	
7 - Have you performed the proper LOTO?	Done		JUHURST	Aug 23, 2022 12:48:18 PM	No	
10 - Are you aware of the potential risks of performing this repair?	Done		JUHURST	Aug 23, 2022 12:48:18 PM	No	
11 - Have you successfully completed the Personal Risk Assessment?	Done		JUHURST	Aug 23, 2022 12:48:18 PM	No	

Activity Sub Total

	Activity 10 Sub Total	
	Parts:	0.00
	Labor:	0.00
	Labor Hours:	0.00
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 55877152
Invoice No. 55345 - 55877152

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
check engine light on		Ford E450 Champion Challenger	
Requested By:	CVERGARA	Status:	40 - Closed (40)
Created By:	CVERGARA	Priority:	-
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	310,526 - DH

Activity Header					
Activity: 20 040 ENGINE/MOTOR SYSTEMS GROUP					
Activity Note: check engine light on					
Reason for Repair: 05 Inspection, Routine					
Work Accomplished: 09 Troubleshooting					
Part Failure:					
Activity Comments:					
Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
23-Aug-22	SP521	PLUG, SPARK, 5.4L, FORD	1	4.92	4.92
Activity Labor					
Booked Date	Technician	Hours	Shop Rate	Extended	
22-Aug-22	Junior Hurst	1.5	0	0	
Activity Sublet					
No Data Available					
Activity Checklist					
No Data Available					
No Data Available					
Activity Sub Total					
			Activity 20 Sub Total		
			Parts:	4.92	
			Labor:	0.00	
			Labor Hours:	1.50	
			Sublet Parts:	0.00	
			Sublet Labor:	0.00	
			Activity Sub Total	4.92	



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 55877152
Invoice No. 55345 - 55877152

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FD4E4FS7EDB17176
check engine light on		Ford E450 Champion Challenger	
Requested By:	CVERGARA	Status:	40 - Closed (40)
Created By:	CVERGARA	Priority:	-
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	310,526 - DH

Activity Header															
Activity: 30 053/004/000 SAFETY EQUIPMENT															
Activity Note: check angel trax video recording system for proper operation															
Reason for Repair: 05 Inspection, Routine															
Work Accomplished:															
Part Failure:															
Activity Comments:															
Activity Parts															
No Data Available															
Activity Labor															
No Data Available															
Activity Sublet															
No Data Available															
Activity Checklist															
No Data Available															
No Data Available															
Activity Sub Total															
<table><tr><td colspan="2">Activity 30 Sub Total</td></tr><tr><td>Parts:</td><td>0.00</td></tr><tr><td>Labor:</td><td>0.00</td></tr><tr><td>Labor Hours:</td><td>0.00</td></tr><tr><td>Sublet Parts:</td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td>0.00</td></tr></table>		Activity 30 Sub Total		Parts:	0.00	Labor:	0.00	Labor Hours:	0.00	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	0.00
Activity 30 Sub Total															
Parts:	0.00														
Labor:	0.00														
Labor Hours:	0.00														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	0.00														
Work Order Footer															
<table><tr><td colspan="2">Work Order 55877152 Total</td></tr><tr><td>Parts:</td><td>4.92</td></tr><tr><td>Labor:</td><td>0.00</td></tr><tr><td>Labor Hours:</td><td>1.50</td></tr><tr><td>Sublet Parts:</td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td>4.92</td></tr></table>		Work Order 55877152 Total		Parts:	4.92	Labor:	0.00	Labor Hours:	1.50	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	4.92
Work Order 55877152 Total															
Parts:	4.92														
Labor:	0.00														
Labor Hours:	1.50														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	4.92														



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 55702233
Invoice No. 55345 - 55702233

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
FOLLOWUP-FT Light Duty			Ford E450 Champion Challenger
Requested By:	JUHURST	Status:	40 - Closed (40)
Created By:	JUHURST	Priority:	3 - High
Assigned To:		Driver:	
Class:	-	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	302,630 - DH

Chronology

Reported	Jun 17, 2022 6:47:15 PM	Jun 17, 2022 6:47:15 PM
Started	Aug 22, 2022 2:22:00 PM	
Completed	Aug 22, 2022 8:17:00 PM	Aug 22, 2022 8:17:00 PM
Down Time		

Work Order Notes

Line 10 VEHICLE CAME IN FOR check engine light check and found the # nine cylinder mis fire removed spark plug from cylinder 9 replaced new one part # 521 , unit now working . All tthe camera is working will monitor vehicle return back to work

Activity Header

Activity:10 027/033/010 SWITCH, STARTER, NEUTRAL

Activity Note:

Reason for Repair: FW Follow Up

Work Accomplished:

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
22-Aug-22	SP521	PLUG, SPARK, 5.4L, FORD	1	4.92	4.92

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
22-Aug-22	Junior Hurst	2.52	0	0

Activity Sublet

No Data Available

Activity Checklist


No Data Available

No Data Available

Activity Sub Total

Activity 10 Sub Total

Parts:	4.92
Labor:	0.00
Labor Hours:	2.52
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	4.92

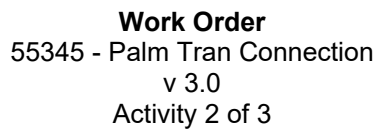



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 55702233
Invoice No. 55345 - 55702233

Client Department:			
Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
FOLLOWUP-FT Light Duty			Ford E450 Champion Challenger
Requested By:	JUHURST	Status:	40 - Closed (40)
Created By:	JUHURST	Priority:	3 - High
Assigned To:		Driver:	
Class:	-	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	302,630 - DH

Activity Header															
Activity: 30 043/003/016 SUPPORT & INSULATOR, PIPE, TAIL, REAR															
Activity Note: two Engine mounts need replace															
Reason for Repair: FW Follow Up															
Work Accomplished:															
Part Failure:															
Activity Comments:															
Activity Parts															
No Data Available															
Activity Labor															
No Data Available															
Activity Sublet															
No Data Available															
Activity Checklist															
No Data Available															
No Data Available															
Activity Sub Total															
<table><tr><td colspan="2">Activity 30 Sub Total</td></tr><tr><td>Parts:</td><td>0.00</td></tr><tr><td>Labor:</td><td>0.00</td></tr><tr><td>Labor Hours:</td><td>0.00</td></tr><tr><td>Sublet Parts:</td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td>0.00</td></tr></table>		Activity 30 Sub Total		Parts:	0.00	Labor:	0.00	Labor Hours:	0.00	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	0.00
Activity 30 Sub Total															
Parts:	0.00														
Labor:	0.00														
Labor Hours:	0.00														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	0.00														
Work Order Footer															
<table><tr><td colspan="2">Work Order 55702233 Total</td></tr><tr><td>Parts:</td><td>4.92</td></tr><tr><td>Labor:</td><td>0.00</td></tr><tr><td>Labor Hours:</td><td>2.52</td></tr><tr><td>Sublet Parts:</td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td>4.92</td></tr></table>		Work Order 55702233 Total		Parts:	4.92	Labor:	0.00	Labor Hours:	2.52	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	4.92
Work Order 55702233 Total															
Parts:	4.92														
Labor:	0.00														
Labor Hours:	2.52														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	4.92														



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 55868712
Invoice No. 55345 - 55868712

Client Department:

Department: 55345M

Work Order Description

55345 PER DVIR (Check Rear AC)

Requested By: AOWENS

Created By: AOWENS

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 2 - Medium

Driver:

Phone:

ETA:

Meter: 310,098 - DH

Chronology

Reported	Aug 18, 2022 5:24:00 PM	Aug 18, 2022 5:24:00 PM
Started	Aug 18, 2022 5:25:00 PM	
Completed	Aug 19, 2022 12:17:00 AM	Aug 19, 2022 12:17:00 AM
Down Time		

Work Order Notes

Line 10 Complaint: Check AC.

Cause: Low charge (compressor cycling).

Correction: Recovered freon, Remove and replaced orifice tube. Vacuum, leak tested, added PAG oil and recharged to spec.

Activity Header

Activity: 10 999/999/999 TOTAL VEHICLE

Activity Note: PRA

Reason for Repair: SW Shop Work Order

Work Accomplished: 06 Inspect

Part Failure: 00 No Failure

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: PRA


Task: PRA and Meter Readings Performed by: EARJOHNSON Performed on: 18-AUG-22

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		EARJOHNSON	Aug 18, 2022 10:03:45 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		EARJOHNSON	Aug 18, 2022 10:03:45 PM	No	
4 - Are you wearing the appropriate PPE?	Done		EARJOHNSON	Aug 18, 2022 10:03:45 PM	No	
7 - Have you performed the proper LOTO?	Done		EARJOHNSON	Aug 18, 2022 10:03:45 PM	No	
10 - Are you aware of the potential risks of performing this repair?	Done		EARJOHNSON	Aug 18, 2022 10:03:45 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
11 - Have you successfully completed the Personal Risk Assessment?	Done		EARJOHNSON	Aug 18, 2022 10:03:45 PM	No	
Activity Sub Total						
			Activity 10 Sub Total			
			Parts:		0.00	
			Labor:		0.00	
			Labor Hours:		0.00	
			Sublet Parts:		0.00	
			Sublet Labor:		0.00	
			Activity Sub Total		0.00	



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 55868712
Invoice No. 55345 - 55868712

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
55345 PER DVIR (Check Rear AC)		Ford E450 Champion Challenger	
Requested By:	AOWENS	Status:	40 - Closed (40)
Created By:	AOWENS	Priority:	2 - Medium
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	310,098 - DH

Activity Header
Activity:20 001 AIR CONDITIONING, HEATING AND VENTILATION
Activity Note: Check Rear AC
Reason for Repair: 05 Inspection, Routine
Work Accomplished: 09 Troubleshooting
Part Failure:
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
18-Aug-22	3411885	TUBE, ORIFICE, A/C, FORD	1	0.77	0.77

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
18-Aug-22	Earl Johnson	1.15	0	0

Activity Sublet
No Data Available


Activity Checklist
No Data Available
No Data Available

Activity Sub Total	
Activity 20 Sub Total	
Parts:	0.77
Labor:	0.00
Labor Hours:	1.15
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.77

Work Order Footer	
Work Order 55868712 Total	
Parts:	0.77
Labor:	0.00
Labor Hours:	1.15
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.77



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 55745423
Invoice No. 55345 - 55745423

Client Department:

Department: 55345M

Work Order Description

check fuel gauge

Requested By: CVERGARA

Created By: CVERGARA

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: -

Driver:

Phone:

ETA:

Meter: 308,033 - DH

Chronology

Reported	Jul 4, 2022 7:57:00 AM	Jul 4, 2022 7:57:00 AM
Started	Aug 2, 2022 9:41:00 AM	
Completed	Aug 2, 2022 11:00:00 AM	Aug 2, 2022 11:00:00 AM
Down Time		

Work Order Notes

Line 10 mount and balance one tire complete Line 20 complaint. fuel gauge is not working properly
cause. bad flim

Correction .removed and replaced flim with know good part

Activity Header

Activity: 10 999/999/999 TOTAL VEHICLE

Activity Note:

Reason for Repair: SW Shop Work Order

Work Accomplished: 06 Inspect

Part Failure: 00 No Failure

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc:

Task: PRA and Meter Readings Performed by: RAUODRIGUEZ Performed on: 02-AUG-22

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		RAUODRIGUEZ	Aug 2, 2022 10:41:05 AM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		RAUODRIGUEZ	Aug 2, 2022 10:41:05 AM	No	
4 - Are you wearing the appropriate PPE?	Done		RAUODRIGUEZ	Aug 2, 2022 10:41:05 AM	No	
7 - Have you performed the proper LOTO?	Done		RAUODRIGUEZ	Aug 2, 2022 10:41:05 AM	No	
10 - Are you aware of the potential risks of performing this repair?	Done		RAUODRIGUEZ	Aug 2, 2022 10:41:05 AM	No	
11 - Have you successfully completed the	Done		RAUODRIGUEZ	Aug 2, 2022	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO	
Personal Risk Assessment?				10:41:05 AM			
Activity Sub Total				Activity 10 Sub Total			
				Parts:		0.00	
				Labor:		0.00	
				Labor Hours:		0.00	
				Sublet Parts:		0.00	
				Sublet Labor:		0.00	
				Activity Sub Total		0.00	



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 55745423
Invoice No. 55345 - 55745423

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
check fuel gauge		Ford E450 Champion Challenger	
Requested By:	CVERGARA	Status:	40 - Closed (40)
Created By:	CVERGARA	Priority:	-
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	308,033 - DH

Activity Header
Activity:20 044/001/100 UNIT, SENDING, GAUGE, FUEL
Activity Note: CHECK FUEL GAUGE PROPER OPERATION
Reason for Repair: 04 Driver's Report
Work Accomplished:
Part Failure:
Activity Comments:

Activity Parts
No Data Available

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
02-Aug-22	Rodriguez,Raul	1.32	0	0

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available

Activity Sub Total		Activity 20 Sub Total	
Parts:			0.00
Labor:			0.00
Labor Hours:			1.32
Sublet Parts:			0.00
Sublet Labor:			0.00
Activity Sub Total			0.00

Work Order Footer		Work Order 55745423 Total	
Parts:			0.00
Labor:			0.00
Labor Hours:			1.32
Sublet Parts:			0.00
Sublet Labor:			0.00
Activity Sub Total			0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 55809206
Invoice No. 55345 - 55809206

Client Department:
Department: 55345M
Work Order Description
FOLLOWUP-FT Light Duty
Requested By: DARTHURS
Created By: DARTHURS
Assigned To:
Class: -
Arrangement: Unassigned
Potential Warranty: No
Equipment No.: 4514-P
VIN: 1FDFE4FS7EDB17176
Ford E450 Champion Challenger
Status: 40 - Closed (40)
Priority: 3 - High
Driver:
Phone:
ETA:
Meter: 307,414 - DH

Chronology		
Reported	Jul 27, 2022 6:50:49 PM	Jul 27, 2022 6:50:49 PM
Started	Jul 27, 2022 7:36:00 PM	
Completed	Jul 27, 2022 10:40:00 PM	Jul 27, 2022 10:40:00 PM
Down Time		

Work Order Notes

Line 10 Right Motor Mount / Front Brakes / Rear Tires
Mount & Balance Four Tires ,Rotate Front To L/R & (2) New On Front & (2) New On R /R Remove & Replace Front Brakes & Remove & Replace Right Side Motor Mount ,
parts 5U9Z-6039-AA Qty (1)
parts #8C2Z-2V001-D Qty (1)
parts # 192-659 Qty (4)

Activity Header
Activity:10 027/001/013 HARDWARE, MOUNTING, CASE, TRANSMISSION, AUTOMATIC APFI - 027-001-001
Activity Note: Right Engine Mount
Reason for Repair: FW Follow Up
Work Accomplished:
Part Failure:
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
27-Jul-22	5U9Z-6038-AA	MOUNT, ENGINE, RH	1	33.64	33.64

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
27-Jul-22	Arthurs,Durvin	0.58	0	0

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available

Activity Sub Total															
<table><tr><th colspan="2">Activity 10 Sub Total</th></tr><tr><td>Parts:</td><td>33.64</td></tr><tr><td>Labor:</td><td>0.00</td></tr><tr><td>Labor Hours:</td><td>0.58</td></tr><tr><td>Sublet Parts:</td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td>33.64</td></tr></table>	Activity 10 Sub Total		Parts:	33.64	Labor:	0.00	Labor Hours:	0.58	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	33.64	
Activity 10 Sub Total															
Parts:	33.64														
Labor:	0.00														
Labor Hours:	0.58														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	33.64														



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 55809206
Invoice No. 55345 - 55809206

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
FOLLOWUP-FT Light Duty		Ford E450 Champion Challenger	
Requested By:	DARTHURS	Status:	40 - Closed (40)
Created By:	DARTHURS	Priority:	3 - High
Assigned To:		Driver:	
Class:	-	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	307,414 - DH

Activity Header
Activity:20 017/008/004 CAP, VALVE, TIRE
Activity Note: Rear Tires
Reason for Repair: FW Follow Up
Work Accomplished:
Part Failure:
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
27-Jul-22	192659	TIRE, LT225/75R16, R500 HD, BSW, E/10PR, DURAVIS, BRIDGESTONE	4	145.11	580.44

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
27-Jul-22	Arthurs,Durvin	1.18	0	0

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available

Activity Sub Total		Activity 20 Sub Total	
Parts:			580.44
Labor:			0.00
Labor Hours:			1.18
Sublet Parts:			0.00
Sublet Labor:			0.00
Activity Sub Total			580.44



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 55809206
Invoice No. 55345 - 55809206

Client Department:			
Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
FOLLOWUP-FT Light Duty			Ford E450 Champion Challenger
Requested By:	DARTHURS	Status:	40 - Closed (40)
Created By:	DARTHURS	Priority:	3 - High
Assigned To:		Driver:	
Class:	-	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	307,414 - DH

Activity Header
Activity:30 079 DEVICES, SAFETY/STABILITY, TRAILER
Activity Note: Front Brakes
Reason for Repair: 05 Inspection, Routine
Work Accomplished:
Part Failure:
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
27-Jul-22	8C2Z-2V001-D	PADS, BRAKE, DISC, FRONT	1	43.87	43.87

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
27-Jul-22	Arthurs,Durvin	0.83	0	0

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available

Activity Sub Total		Activity 30 Sub Total	
Parts:	43.87	Labor:	0.00
Labor Hours:	0.83	Sublet Parts:	0.00
Sublet Labor:	0.00	Sublet Labor:	0.00
Activity Sub Total		43.87	

Work Order Footer		Work Order 55809206 Total	
Parts:	657.95	Labor:	0.00
Labor Hours:	2.59	Sublet Parts:	0.00
Sublet Labor:	0.00	Sublet Labor:	0.00
Activity Sub Total		657.95	



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 55702294
Invoice No. 55345 - 55702294

Client Department:

Department: 55345M

Work Order Description

55345-LIGHT DUTY PMA

Requested By: JUHURST

Created By: JUHURST

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 3 - High

Driver:

Phone:

ETA:

Meter: 307,414 - DH

Chronology

Reported	Jul 21, 2022 12:00:00 AM	Jul 21, 2022 12:00:00 AM
Started	Jul 27, 2022 4:38:00 PM	
Completed	Jul 27, 2022 7:34:00 PM	Jul 27, 2022 7:34:00 PM
Down Time		

Work Order Notes

Line 10 COMPLAINT: Perform PMA Service.

CAUSE: Service Due by Mileage

CORRECTION: Change Oil & Filter Lube all Pivoting Points. Check Brakes Clean batteries,
parts # B329 Qty (1)

Oil 5W30 Qty (7,0) Qts

Activity Header

Activity: 5 999/999/999 TOTAL VEHICLE

Activity Note: PERSONAL RISK ASSESSMENT

Reason for Repair: SW Shop Work Order

Work Accomplished: 06 Inspect

Part Failure: 00 No Failure

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: PERSONAL RISK ASSESSMENT

Task: PRA and Meter Readings Performed by: DARTHURS Performed on: 27-JUL-22

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		DARTHURS	Jul 27, 2022 6:50:26 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		DARTHURS	Jul 27, 2022 6:50:26 PM	No	
4 - Are you wearing the appropriate PPE?	Done		DARTHURS	Jul 27, 2022 6:50:26 PM	No	
7 - Have you performed the proper LOTO?	Done		DARTHURS	Jul 27, 2022 6:50:26 PM	No	
10 - Are you aware of the potential risks of performing this repair?	Done		DARTHURS	Jul 27, 2022 6:50:26 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO																													
11 - Have you successfully completed the Personal Risk Assessment?	Done		DARTHURS	Jul 27, 2022 6:50:26 PM	No																														
Activity Sub Total			<table><tr><td colspan="2">Activity 5 Sub Total</td><td></td><td></td></tr><tr><td>Parts:</td><td></td><td>0.00</td><td></td></tr><tr><td>Labor:</td><td></td><td>0.00</td><td></td></tr><tr><td>Labor Hours:</td><td></td><td>0.00</td><td></td></tr><tr><td>Sublet Parts:</td><td></td><td>0.00</td><td></td></tr><tr><td>Sublet Labor:</td><td></td><td>0.00</td><td></td></tr><tr><td>Activity Sub Total</td><td></td><td>0.00</td><td></td></tr></table>					Activity 5 Sub Total				Parts:		0.00		Labor:		0.00		Labor Hours:		0.00		Sublet Parts:		0.00		Sublet Labor:		0.00		Activity Sub Total		0.00	
Activity 5 Sub Total																																			
Parts:		0.00																																	
Labor:		0.00																																	
Labor Hours:		0.00																																	
Sublet Parts:		0.00																																	
Sublet Labor:		0.00																																	
Activity Sub Total		0.00																																	



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 55702294
Invoice No. 55345 - 55702294

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
55345-LIGHT DUTY PMA		Ford E450 Champion Challenger	
Requested By:	JUHURST	Status:	40 - Closed (40)
Created By:	JUHURST	Priority:	3 - High
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	307,414 - DH

Activity Header
Activity:10 079 DEVICES, SAFETY/STABILITY, TRAILER
Activity Note: Light Duty PMI
Reason for Repair: 05 Inspection, Routine
Work Accomplished:
Part Failure:
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
27-Jul-22	B329	FILTER, OIL, SPIN-ON SEE P550965	1	2.19	2.19

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
27-Jul-22	Arthurs,Durvin	2.18	0	0

Activity Sublet
No Data Available

Activity Checklist						
Check List						
10 Desc: Light Duty PMI						
Task: First Transit North America Light Duty PM Inspection Sheet Performed by: DARTHURS Performed on: 27-JUL-22						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,000 - SECTION 1 - Preparation Inspection	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
10,100 - INSPECT_Auto-Transmission Operation/Controller; Neutral Safety Switch	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
10,200 - !FRA!INSPECT_Starter Operation	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
10,300 - !FRA!INSPECT_Warning Lights and Alarms	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
10,400 - !FRA!INSPECT_Back Up Alarm	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
10,500 - !FRA!INSPECT_Engine Operation, OBSERVE_ Exhaust for Excessive Smoke	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
10,600 - Check Driver's Pre-trip or DVIR/EVIR & Authorization Forms	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
10,700 - INSPECT_All Exterior Lights (Turn on until Completion of this section)	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
10,800 - *RPT*INSPECT_Body Damage, Corrosion;DOCUMENT_Issues	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,900 - INSPECT_Fuel Tank Cap, and Doors	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
11,100 - INSPECT_License Plate, Bracket, Bumpers	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
20,000 - SECTION 2 - Test Drive and Operator Area Inspection	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
20,100 - INSPECT_Driver Seat condition/operation/seatbelt	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
20,200 - TEST DRIVE_INSPECT_Proper Operation; Drive into Shop	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
20,300 - *RPT*INSPECT_Steering Wheel for Play/Bind/Horn Op./Turn Signal Cancelation	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
20,400 - PERFORM_Brake Test (Apply hard enough to check wheel pull and Application)	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
20,500 - *RPT*FRA INSPECT_Lighting/Operation of all Gauges	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
20,600 - *RPT*INSPECT_Windshields, Sun Visors	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
20,700 - INSPECT_Wiper/Washer Operation, Condition	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
20,800 - INSPECT_High Idle Control	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
20,900 - *RPT*!FRA!INSPECT_HVAC Controls, Operation	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
21,000 - *RPT*!FRA!INSPECT_Operation of all Switches and Accessories	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
21,100 - INSPECT_Parking Brake Operation	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
21,200 - !FRA!TEST_Service Brake Backup System (Stationary Brake Tests HYD)	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
21,300 - INSPECT_VIN, Tire Pressure Decal, Data Tags	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
21,400 - *RPT*INSPECT_Drivers Door Hinges, Handles, Controls and Panels	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
21,500 - !FRA!INSPECT_Under Dash Wiring for Proper Routing/Chafing/Securement	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
21,550 - INSPECT_Driver Floor Area for Rust/Water Leaks	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
21,600 - *RPT*INSPECT for WEAR_Pedal Pads, Accelerator, Brake, Parking Brake	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
21,700 - INSPECT_Engine Fault Codes	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
30,000 - SECTION 3 - EXTERIOR INSPECTION - Front	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
31,000 - SSF (Street Side Front)	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
31,010 - *RPT*!FRA!INSPECT_Mirror Mountings, Brackets, Glass	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
31,020 - *RPT*INSPECT_FRONT Springs, Shocks, Spring Shackles	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
31,030 - INSPECT_Mud Flaps, Brackets	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
31,040 - INSPECT_Wiper Blades, Arms	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
32,000 - Engine Inspection	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
32,010 - INSPECT_Hood, Springs and Props	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
32,020 - !FRA!INSPECT_Engine Compartment Condition for Fire Risk Avoidance	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
32,030 - !FRA!INSPECT_for Fluid Leaks, Levels	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
32,040 - !FRA!INSPECT_Hyd_Brake Fluid with Test Strips	-	NA	DARTHURS	Jul 27, 2022 6:48:11 PM	No	
32,050 - !FRA!INSPECT_RECORD_Coolant Recovery with Refractometer; Test Strips	Degree Fahrenheit	NA	DARTHURS	Jul 27, 2022 6:48:11 PM	No	
32,060 - PRESSURE TEST_Cooling Systems (Radiator, Cap, hoses and clamps)	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
32,070 - *RPT*INSPECT_Radiator and Mountings, Cores	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
32,080 - *RPT*INSPECT_Fan Assembly, Shroud, Tensioner, Belts, All Belt Driven Components	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
32,090 - *RPT*!FRA!INSPECT_Mounting, Installation of Alternator, AC Compressor	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
32,100 - INSPECT_Intake System	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
32,140 - *RPT*!FRA!RECORD_Underhood Battery Voltages (volts)	0 Volt*		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
33,010 - CSF (Curb Side Front)	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
33,020 - *RPT*!FRA!INSPECT_Mirror Mountings, Brackets, Glass	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
33,030 - *RPT*INSPECT_FRONT Springs, Shocks, Spring Shackles	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
33,040 - INSPECT_Mud Flaps, Brackets	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
33,050 - INSPECT_Wiper Blades, Arms	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
33,060 - !FRA!INSPECT_LUBE_Battery Box, Batteries, Tray Slides, Hold Downs	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
33,070 - *RPT*!FRA!RECORD_Side Mounted Battery Voltages (volts)	13.96 Volt*		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
33,080 - INSPECT_Entry door, OPEN_with external lock/switch (if equipped)	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
40,000 - SECTION 4 - Interior Inspection	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
40,100 - *RPT*INSPECT_Step-Well, Step-Tread, Hand Rails, Step-well Light	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
40,200 - INSPECT_Insurance/Registration/Regulatory Forms Dates	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
40,250 - INSPECT_Overhead Compartment for Water Leaks	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
40,300 - INSPECT_Safety Equipment, Fire	Done		DARTHURS	Jul 27, 2022	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
Extinguisher/Suppression				6:48:11 PM		
40,400 - INSPECT_Camera Systems, Filter, Electrical Inputs/Outputs-SOP M038	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
40,600 - !FRA!CHECK for HOTSPOTS_Interior Elec Panel Fuses/Circuit Breakers/Connectors	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
40,700 - *RPT*INSPECT_Seats, Covering, Belts, Loose Cushions, Operation	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
40,800 - *RPT*!FRA!INSPECT_Interior Lights; Mirrors	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
40,900 - !FRA!INSPECT_Interior Cleanliness/Potential Projectiles	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
41,000 - INSPECT_All ADA Equip (Lift Seat Belt, floor hold Downs, Belts, Cover, Alarms)	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
41,100 - INSPECT_CLEAN_AC Filter	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
41,200 - INSPECT_Emergency Windows,Hatches,Doors,Alarms/Lights;CHECK_for Leaks	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
41,300 - *RPT*INSPECT_Interior Body, Floor, Stanchions	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
41,400 - *RPT*INSPECT_Passenger Doors, Glass, Seal	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
50,000 - SECTION 5 - UNDER VEHICLE INSPECTION	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
50,100 - *RPT*INSPECT_Steering components-Drag Link, Tie Rods ends and Steering Damper	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
50,200 - INSPECT_Ball Joint Play	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
50,300 - !FRA!INSPECT_Front Wheel Bearings for Play	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
50,400 - LUBE_All Chassis Components	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
50,500 - !FRA!CHANGE_Engine oil,filters	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
50,700 - INSPECT_Tire Condition	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
50,800 - INSPECT_Tire Valve Stems, Double Check Caps	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
50,900 - !FRA!INSPECT_Wheels for Cracks, Loose Lugs/Indicators, Outer Hub Leaks	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
51,000 - RECORD_LF-Tire Tread Depth (32nds)	10 32nds of an inch		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
51,100 - RECORD_LF-Tire Air Pressure (psi)	70 Pounds per Square Inch		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
51,200 - RECORD_RF-Tire Tread Depth (32nds)	8 32nds of an inch		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
51,300 - RECORD_RF-Air Pressure (psi)	70 Pounds per Square Inch		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
51,400 - !FRA!INSPECT_FRONT ABS Tone Rings, Sensors, Routing of Cables	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
51,500 - !FRA!INSPECT_Wheel Seals for Leaks	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
51,600 - !FRA!INSPECT_ Front Brake Assemblies	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
51,700 - MEASURE_RECORD_LF - Brake Lining, Pad Thickness (32nds)	4 32nds of an inch		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
51,800 - MEASURE_RECORD_RF - Brake Lining, Pad Thickness (32nds)	5 32nds of an inch		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
51,900 - INSPECT VISUALLY_RECORD_LF Rotor Condition (inches)	1.554 Inch		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
52,000 - INSPECT VISUALLY_RECORD_RF Rotor Condition (inches)	1.554 Inch		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
52,100 - INSPECT_Vibration Damper	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
52,200 - !FRA!INSPECT_Battery Cable Routing from Battery Box to Starter	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
52,400 - !FRA!INSPECT_Starter Mounting	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
52,500 - !FRA!INSPECT_Engine Exhaust System	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
52,700 - INSPECT_Engine, Transmission Mounts	-	Right Engine Mount	DARTHURS	Jul 27, 2022 6:48:11 PM	Yes	55809206
52,800 - !FRA!INSPECT_Engine, Transmission for Fluid Leaks	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
52,900 - INSPECT_Shift Cable Adjustment - All Transmissions	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
53,000 - !FRA!INSPECT_Transmission Breather and Clean	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
53,100 - *RPT*!FRA!INSPECT_Parking Brake Cables, Shoes for Wear, Contamination	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
53,200 - *RPT*INSPECT_A/C Condensor, Fans, Safety Grills	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
53,300 - *RPT*INSPECT_Driveline, Hanger Bearings, U-Joints, Slip Joints, Safety Loop	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
53,400 - *RPT*INSPECT_All Body Mounts and Chassis Frame for Corrosion, Cracks	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
53,500 - !FRA!INSPECT_Fuel Tank, Mountings, Lines	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
53,600 - INSPECT_Tire Condition	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
53,700 - INSPECT_Tire Valve Stems, Double Check Caps	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
53,800 - INSPECT_Mismatched Tire Tread, Casing Design	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
53,900 - INSPECT_Dual Mating Tires w/Square	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
54,000 - !FRA!INSPECT_Wheels for Cracks, Loose Lugs/Indicators, Outer Hub Leaks	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
54,100 - INSPECT_Mud Flaps, Brackets	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
54,200 - RECORD_RRO-Tire Tread Depth (32nds)	2 32nds of an inch		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
54,300 - RECORD_RRI-Tire Tread Depth (32nds)	2 32nds of an		DARTHURS	Jul 27, 2022	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
	inch			6:48:11 PM		
54,400 - RECORD_RRO-Air Pressure (psi)	65 Pounds per Square Inch		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
54,500 - RECORD_RRI-Air Pressure (psi)	65 Pounds per Square Inch		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
54,600 - RECORD_LRO-Tire Tread Depth (32nds)	2 32nds of an inch		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
54,700 - RECORD_LRI-Tire Tread Depth (32nds)	2 32nds of an inch	Rear Tires	DARTHURS	Jul 27, 2022 6:48:11 PM	Yes	55809206
54,800 - RECORD_LRO-Air Pressure (psi)	65 Pounds per Square Inch		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
54,900 - RECORD_LRI-Air Pressure (psi)	65 Pounds per Square Inch		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
55,000 - !FRA!INSPECT_ REAR Brake Assemblies	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
55,100 - !FRA!INSPECT_ REAR Hubs, Wheel Seals for Oil Leaks	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
55,200 - !FRA!INSPECT_ REAR ABS Tone Rings, Sensors, Routing Of Cables (if equipped)	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
55,300 - MEASURE_RECORD_LR - Brake Lining, Pad Thickness (32nds)	12 32nds of an inch		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
55,400 - MEASURE_RECORD_RR - Brake Lining, Pad Thickness (32nds)	12 32nds of an inch		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
55,500 - INSPECT VISUALLY_MEASURE_RECORD_ LR Drum, Rotor Condition (inches)	1.665 Inch		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
55,600 - INSPECT VISUALLY_MEASURE_RECORD_ RR Drum, Rotor Condition (inches)	1.665 Inch		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
55,700 - !FRA!INSPECT_ Under Body Exhaust System	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
55,800 - *RPT*INSPECT_ REAR Axle Housing, Breather; CLEAN_Breather	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
55,900 - *RPT*INSPECT_ REAR Springs, Shocks, Suspension, Airbags	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
60,000 - SECTION 6 - Wheelchair Inspection	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
60,100 - RECORD_Wheelchair Cycle Count	14748 Cycles		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
60,200 - CHECK_ Lift Access Door for Ease of Opening,Latch Security,Door Hold Back	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
60,300 - CHECK_Platform Emergency Release Mechanism for Ease of Operation	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
60,400 - OPERATE_Lift thru Complete Cycle;CHECK_Noises,Jerky Op,Too Fast-Slow,Drift Down	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
60,500 - INSPECT_ Bridgeplate Operation	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
60,600 - INSPECT_All Pivot Points for Wear and Looseness	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
60,700 - INSPECT_Rollers for Wear and Smooth Rotation	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
60,800 - INSPECT_Operation of Platform Barrier Mechanism	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
60,900 - INSPECT_Cam Slots for Wear and Proper Alignment	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
61,000 - INSPECT_Cable Condition (If Applicable)	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
61,100 - INSPECT_Hydraulic Hoses for Leaks, Chafing or Cracks	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
61,200 - INSPECT_Electrical Connections and Routing of Wires and Cables	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
61,300 - INSPECT_Operation and Adjustment of All Safety Switches	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
61,400 - INSPECT_All Lift Mounting Brackets for Loose Bolts Broken Welds, etc.	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
61,500 - INSPECT_Manual Back-up Raise/Lower System (If Applicable)	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
61,600 - INSPECT_HydrPump Reservoir Oil Level. Consult SrvManual for Fluid to Use.	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
61,700 - CHECK_Operator Decals for Proper Positioning;CONSULT_Service Manual	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
61,800 - CHECK_WC Holddowns Inside Vehicle for Secure Mounting,Proper Operation	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
61,900 - CLEAN_Linkages and Mechanisms	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
62,000 - LUBRICATE_Linkages and Mechanisms (DO NOT OVER Lubricate)	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
62,100 - INSPECT_Emergency Platform Release Mechanism	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
62,200 - INSPECT_Platform Barrier Latch Mechanism	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
62,300 - INSPECT_Bridgeplate Hinge	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
62,400 - INSPECT_All Pivot Points	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
62,500 - INSPECT_Cams and Slots	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
62,600 - INSPECT_Rollers	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
62,700 - INSPECT_All Linkages	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
70,000 - SECTION 7 - ALTERNATIVE FUELS INSPECTION	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
70,300 - INSPECT_Condition of Fuel Pressure Gauge	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
70,400 - PROVIDE PROOF_Tank_Dents/Scratches and Re-Certification	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
70,500 - INSPECT_Tank test date, labels-Reference-ST.4 FMMVSS 304 & ANSI-CSA NGV2	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
70,600 - INSPECT_Tank Lines to Ensure Secure Mounting, Insulation Against Vibration	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
70,700 - INSPECT_Filling Nozzle for Securely Fitting Cap	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
70,800 - INSPECT_ Pressure Relief Device's Venting System, Valves, Ducting to MNFR Specs	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
80,000 - SECTION 8 - PMI Report Completion	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
80,100 - COMPLETE_PM Report; Follow-ups	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	
80,200 - RETURN_Vehicle to Predetermined Location	Done		DARTHURS	Jul 27, 2022 6:48:11 PM	No	

Activity Sub Total

Activity 10 Sub Total	
Parts:	2.19
Labor:	0.00
Labor Hours:	2.18
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	2.19



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 55702294
Invoice No. 55345 - 55702294

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
55345-LIGHT DUTY PMA		Ford E450 Champion Challenger	
Requested By:	JUHURST	Status:	40 - Closed (40)
Created By:	JUHURST	Priority:	3 - High
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	307,414 - DH

Activity Header
Activity:20 999 TOTAL VEHICLE
Activity Note: PM A
Reason for Repair: 08 Preventive Maintenance
Work Accomplished: A PM Level A
Part Failure:
Activity Comments:

Activity Parts
No Data Available

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
27-Jul-22	Arthurs,Durvin	0.37	0	0

Activity Sublet
No Data Available

Activity Checklist						
Check List						
20 Desc: PM A						
Task: PM A SERVICE Performed by: DARTHURS Performed on: 27-JUL-22						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
100,000 - "A" PMI SERVICING ITEMS	Done		DARTHURS	Jul 27, 2022 6:49:31 PM	No	
101,000 - FRA Change Oil Filters	Yes		DARTHURS	Jul 27, 2022 6:49:31 PM	No	
102,000 - FRA Drain Engine Oil	Yes		DARTHURS	Jul 27, 2022 6:49:31 PM	No	
103,000 - FRA Check Transmission Fluid	Done		DARTHURS	Jul 27, 2022 6:49:31 PM	No	
104,000 - Lubricate Chassis	Done		DARTHURS	Jul 27, 2022 6:49:31 PM	No	
105,000 - Replace or Clean A/C Filters	Done		DARTHURS	Jul 27, 2022 6:49:31 PM	No	
107,000 - FRA Change Primary Fuel Filter	No		DARTHURS	Jul 27, 2022 6:49:31 PM	No	
108,000 - Lube all pivoting Mechanisms	Done		DARTHURS	Jul 27, 2022 6:49:31 PM	No	

Activity Sub Total	
Activity 20 Sub Total	
Parts:	0.00
Labor:	0.00

	Labor Hours:	0.37
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	0.00
Work Order Footer		
	Work Order 55702294 Total	
	Parts:	2.19
	Labor:	0.00
	Labor Hours:	2.55
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	2.19



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 55794542
Invoice No. 55345 - 55794542

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
check bus for coolant smell		Ford E450 Champion Challenger	
Requested By:	CVERGARA	Status:	40 - Closed (40)
Created By:	CVERGARA	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	306,917 - DH

Chronology		
Reported	Jul 22, 2022 8:49:00 AM	Jul 22, 2022 8:49:00 AM
Started	Jul 22, 2022 8:51:00 AM	
Completed	Jul 22, 2022 1:19:00 PM	Jul 22, 2022 1:19:00 PM
Down Time		

Work Order Notes

- Line 10 To file warranty be sure to do the following:
- 1) Enter a COMPLAINT statement for each activity.
 - 2) Enter CAUSE statement in the Notes field of each activity.
 - 3) Enter CORRECTION statement in the Comment section of each activity.

Complaint: Smell coolant

Cause: unknown

Correction: inspect vehicle for coolant leaks...
No coolant leaks found
under monitor...

Activity Header							
Activity:5 999 TOTAL VEHICLE							
Activity Note: Personal Risk Assessment							
Reason for Repair: SW Shop Work Order							
Work Accomplished: 06 Inspect							
Part Failure:							
Activity Comments:							
Activity Parts							
No Data Available							
Activity Labor							
No Data Available							
Activity Sublet							
No Data Available							
Activity Checklist							
Check List							
5 Desc: Personal Risk Assessment							
Task: PRA and Meter Readings Performed by: TDELVA Performed on: 22-JUL-22							
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO	
1 - Are you properly trained to perform the task?	Done		TDELVA	Jul 22, 2022 1:19:17 PM	No		

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		TDELVA	Jul 22, 2022 1:19:17 PM	No	
4 - Are you wearing the appropriate PPE?	Done		TDELVA	Jul 22, 2022 1:19:17 PM	No	
7 - Have you performed the proper LOTO?	Done		TDELVA	Jul 22, 2022 1:19:17 PM	No	
10 - Are you aware of the potential risks of performing this repair?	Done		TDELVA	Jul 22, 2022 1:19:17 PM	No	
11 - Have you successfully completed the Personal Risk Assessment?	Done		TDELVA	Jul 22, 2022 1:19:17 PM	No	

Activity Sub Total

Activity 5 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 55794542
Invoice No. 55345 - 55794542

Client Department:

Department: 55345M

Work Order Description

check bus for coolant smell

Requested By: CVERGARA

Created By: CVERGARA

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 306,917 - DH

Activity Header

Activity: 15 042 COOLING SYSTEM

Activity Note: check bus for coolant leaks

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 09 Troubleshooting

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
22-Jul-22	H13BP	BULB, HEADLAMP, HALOGEN	1	12.2	12.2

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
22-Jul-22	Delva, Terry	2.55	0	0

Activity Sublet

No Data Available

Activity Checklist

No Data Available

No Data Available

Activity Sub Total

Activity 15 Sub Total

Parts:	12.20
Labor:	0.00
Labor Hours:	2.55
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	12.20

Work Order Footer

Work Order 55794542 Total

Parts:	12.20
Labor:	0.00
Labor Hours:	2.55
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	12.20



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 55764309
Invoice No. 55345 - 55764309

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
w/c lift not working		Ford E450 Champion Challenger	
Requested By:	CVERGARA	Status:	40 - Closed (40)
Created By:	CVERGARA	Priority:	2 - Medium
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	305,489 - DH

Chronology		
Reported	Jul 11, 2022 3:11:00 PM	Jul 11, 2022 3:11:00 PM
Started	Jul 11, 2022 3:18:00 PM	
Completed	Jul 11, 2022 5:07:00 PM	Jul 11, 2022 5:07:00 PM
Down Time		

Work Order Notes

- Line 10 To file warranty be sure to do the following:
- 1) Enter a COMPLAINT statement for each activity.
 - 2) Enter CAUSE statement in the Notes field of each activity.
 - 3) Enter CORRECTION statement in the Comment section of each activity.

Complaint: Driver call for the lift not working

Cause: the valve for the lift was open

Correction: i lock it and the lift is now working perfect driver go on working

Activity Header							
Activity:5 999 TOTAL VEHICLE							
Activity Note: PRAMETER							
Reason for Repair: SW Shop Work Order							
Work Accomplished: 06 Inspect							
Part Failure:							
Activity Comments:							
Activity Parts							
No Data Available							
Activity Labor							
No Data Available							
Activity Sublet							
No Data Available							
Activity Checklist							
Check List							
5 Desc: PRAMETER							
Task: PRA and Meter Readings Performed by: JUHURST Performed on: 11-JUL-22							
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO	
1 - Are you properly trained to perform the task?	Done		JUHURST	Jul 11, 2022 5:06:10 PM	No		
2 - If task requires lifting, are lifts secured, are jack	Done		JUHURST	Jul 11, 2022	No		

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
stands used correctly?				5:06:10 PM		
4 - Are you wearing the appropriate PPE?	Done		JUHURST	Jul 11, 2022 5:06:10 PM	No	
7 - Have you performed the proper LOTO?	Done		JUHURST	Jul 11, 2022 5:06:10 PM	No	
10 - Are you aware of the potential risks of performing this repair?	Done		JUHURST	Jul 11, 2022 5:06:10 PM	No	
11 - Have you successfully completed the Personal Risk Assessment?	Done		JUHURST	Jul 11, 2022 5:06:10 PM	No	

Activity Sub Total

Activity 5 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 55764309
Invoice No. 55345 - 55764309

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
w/c lift not working		Ford E450 Champion Challenger	
Requested By:	CVERGARA	Status:	40 - Closed (40)
Created By:	CVERGARA	Priority:	2 - Medium
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	305,489 - DH

Activity Header
Activity:10 055/023/000 LIFT, WHEELCHAIR, PASSENGER
Activity Note: wheel chair lift not working
Reason for Repair: 01 Breakdown
Work Accomplished: 06 Inspect
Part Failure:
Activity Comments:

Activity Parts
No Data Available

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
11-Jul-22	Junior Hurst	1.8	0	0

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available

Activity Sub Total															
<table><tr><th colspan="2">Activity 10 Sub Total</th></tr><tr><td>Parts:</td><td>0.00</td></tr><tr><td>Labor:</td><td>0.00</td></tr><tr><td>Labor Hours:</td><td>1.80</td></tr><tr><td>Sublet Parts:</td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td>0.00</td></tr></table>	Activity 10 Sub Total		Parts:	0.00	Labor:	0.00	Labor Hours:	1.80	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	0.00	
Activity 10 Sub Total															
Parts:	0.00														
Labor:	0.00														
Labor Hours:	1.80														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	0.00														

Work Order Footer															
<table><tr><th colspan="2">Work Order 55764309 Total</th></tr><tr><td>Parts:</td><td>0.00</td></tr><tr><td>Labor:</td><td>0.00</td></tr><tr><td>Labor Hours:</td><td>1.80</td></tr><tr><td>Sublet Parts:</td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td>0.00</td></tr></table>	Work Order 55764309 Total		Parts:	0.00	Labor:	0.00	Labor Hours:	1.80	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	0.00	
Work Order 55764309 Total															
Parts:	0.00														
Labor:	0.00														
Labor Hours:	1.80														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	0.00														



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 55612088
Invoice No. 55345 - 55612088

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
55345-LIGHT DUTY PMA		Ford E450 Champion Challenger	
Requested By:	JUHURST	Status:	40 - Closed (40)
Created By:	JUHURST	Priority:	3 - High
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	302,630 - DH

Chronology		
Reported	Jun 15, 2022 12:00:00 AM	Jun 15, 2022 12:00:00 AM
Started	Jun 17, 2022 4:06:00 PM	
Completed	Jun 17, 2022 7:53:00 PM	Jun 17, 2022 7:53:00 PM
Down Time		

Work Order Notes

Line 10 PERFORMED PMA INSPECTION AND SERVICE

Activity Header							
Activity:5 999/999/999 TOTAL VEHICLE							
Activity Note: PERSONAL RISK ASSESSMENT							
Reason for Repair: SW Shop Work Order							
Work Accomplished: 06 Inspect							
Part Failure: 00 No Failure							
Activity Comments:							
Activity Parts							
No Data Available							
Activity Labor							
No Data Available							
Activity Sublet							
No Data Available							
Activity Checklist							
Check List							
5 Desc: PERSONAL RISK ASSESSMENT							
Task: PRA and Meter Readings Performed by: JUHURST Performed on: 17-JUN-22							
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO	
1 - Are you properly trained to perform the task?	Done		JUHURST	Jun 17, 2022 3:59:24 PM	No		
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		JUHURST	Jun 17, 2022 3:59:24 PM	No		
4 - Are you wearing the appropriate PPE?	Done		JUHURST	Jun 17, 2022 3:59:24 PM	No		
7 - Have you performed the proper LOTO?	Done		JUHURST	Jun 17, 2022 3:59:24 PM	No		
10 - Are you aware of the potential risks of performing this repair?	Done		JUHURST	Jun 17, 2022 3:59:24 PM	No		
11 - Have you successfully completed the Personal Risk Assessment?	Done		JUHURST	Jun 17, 2022 3:59:24 PM	No		
Activity Sub Total							
				Activity 5 Sub Total			
				Parts:		0.00	

	Labor:	0.00
	Labor Hours:	0.00
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 55612088
Invoice No. 55345 - 55612088

Client Department:

Department: 55345M

Work Order Description

55345-LIGHT DUTY PMA

Requested By: JUHURST

Created By: JUHURST

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 3 - High

Driver:

Phone:

ETA:

Meter: 302,630 - DH

Activity Header

Activity: 10

Activity Note: Light Duty PMI

Reason for Repair:

Work Accomplished:

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
17-Jun-22	B329	FILTER, OIL, SPIN-ON SEE P550965	1	2.14	2.14

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
17-Jun-22	Junior Hurst	3.45	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: Light Duty PMI

Task: First Transit North America Light Duty PM Inspection Sheet Performed by: JUHURST Performed on: 17-JUN-22

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,000 - SECTION 1 - Preparation Inspection	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
10,100 - INSPECT_Auto-Transmission Operation/Controller; Neutral Safety Switch	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	55702233
10,200 - !FRA!INSPECT_Starter Operation	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
10,300 - !FRA!INSPECT_Warning Lights and Alarms	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
10,400 - !FRA!INSPECT_Back Up Alarm	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
10,500 - !FRA!INSPECT_Engine Operation, OBSERVE_ Exhaust for Excessive Smoke	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
10,600 - Check Driver's Pre-trip or DVIR/EVIR &	Done		JUHURST	Jun 17,	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
Authorization Forms				2022 7:31:19 PM		
10,700 - INSPECT_All Exterior Lights (Turn on until Completion of this section)	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
10,800 - *RPT*INSPECT_Body Damage, Corrosion;DOCUMENT_Issues	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
10,900 - INSPECT_Fuel Tank Cap, and Doors	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
11,100 - INSPECT_License Plate, Bracket, Bumpers	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
20,000 - SECTION 2 - Test Drive and Operator Area Inspection	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
20,100 - INSPECT_Driver Seat condition/operation/seatbelt	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
20,200 - TEST DRIVE_INSPECT_Proper Operation; Drive into Shop	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
20,300 - *RPT*INSPECT_Steering Wheel for Play/Bind/Horn Op./Turn Signal Cancelation	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
20,400 - PERFORM_Brake Test (Apply hard enough to check wheel pull and Application)	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
20,500 - *RPT*FRA INSPECT_Lighting/Operation of all Gauges	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
20,600 - *RPT*INSPECT_Windshields, Sun Visors	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
20,700 - INSPECT_Wiper/Washer Operation, Condition	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
20,800 - INSPECT_High Idle Control	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
20,900 - *RPT*!FRA!INSPECT_HVAC Controls, Operation	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
21,000 - *RPT*!FRA!INSPECT_Operation of all Switches and Accessories	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
21,100 - INSPECT_Parking Brake Operation	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
21,200 - !FRA!TEST_Service Brake Backup System (Stationary Brake Tests HYD)	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
21,300 - INSPECT_VIN, Tire Pressure Decal, Data Tags	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
21,400 - *RPT*INSPECT_Drivers Door Hinges, Handles, Controls and Panels	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
21,500 - !FRA!INSPECT_Under Dash Wiring for Proper Routing/Chafing/Securement	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
21,550 - INSPECT_Driver Floor Area for Rust/Water Leaks	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
21,600 - *RPT*INSPECT for WEAR_Pedal Pads, Accelerator, Brake, Parking Brake	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
21,700 - INSPECT_Engine Fault Codes	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
30,000 - SECTION 3 - EXTERIOR INSPECTION - Front	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
31,000 - SSF (Street Side Front)	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
31,010 - *RPT*!FRA!INSPECT_Mirror Mountings, Brackets, Glass	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
31,020 - *RPT*INSPECT_FRONT Springs, Shocks, Spring Shackles	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
31,030 - INSPECT_Mud Flaps, Brackets	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
31,040 - INSPECT_Wiper Blades, Arms	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
32,000 - Engine Inspection	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
32,010 - INSPECT_Hood, Springs and Props	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
32,020 - !FRA!INSPECT_Engine Compartment Condition for Fire Risk Avoidance	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
32,030 - !FRA!INSPECT_for Fluid Leaks, Levels	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
32,040 - !FRA!INSPECT_Hyd_Brake Fluid with Test Strips	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
32,050 - !FRA!INSPECT_RECORD_Coolant Recovery with Refractometer; Test Strips	26 Degree Fahrenheit		JUHURST	Jun 17, 2022 7:31:19 PM	No	
32,060 - PRESSURE TEST_Cooling Systems (Radiator, Cap, hoses and clamps)	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
32,070 - *RPT*INSPECT_Radiator and Mountings, Cores	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
32,080 - *RPT*INSPECT_Fan Assembly, Shroud, Tensioner, Belts, All Belt Driven Components	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
32,090 - *RPT*!FRA!INSPECT_Mounting, Installation of Alternator, AC Compressor	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
32,100 - INSPECT_Intake System	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
32,140 - *RPT*!FRA!RECORD_Underhood Battery Voltages (volts)	14 Volt*		JUHURST	Jun 17, 2022 7:31:19 PM	No	
33,010 - CSF (Curb Side Front)	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
33,020 - *RPT*!FRA!INSPECT_Mirror Mountings, Brackets, Glass	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
33,030 - *RPT*INSPECT_FRONT Springs, Shocks, Spring Shackles	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
33,040 - INSPECT_Mud Flaps, Brackets	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
33,050 - INSPECT_Wiper Blades, Arms	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
33,060 - !FRA!INSPECT_LUBE_Battery Box, Batteries, Tray Slides, Hold Downs	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
33,070 - *RPT*!FRA!RECORD_Side Mounted Battery Voltages (volts)	14 Volt*		JUHURST	Jun 17, 2022 7:31:19 PM	No	
33,080 - INSPECT_Entry door, OPEN_with external lock/switch (if equipped)	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
40,000 - SECTION 4 - Interior Inspection	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
40,100 - *RPT*INSPECT_Step-Well, Step-Tread, Hand Rails, Step-well Light	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
40,200 - INSPECT_Insurance/Registration/Regulatory Forms Dates	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
40,250 - INSPECT_Overhead Compartment for Water Leaks	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
40,300 - INSPECT_Safety Equipment, Fire Extinguisher/Suppression	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
40,400 - INSPECT_Camera Systems, Filter, Electrical Inputs/Outputs-SOP M038	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
40,600 - !FRA!CHECK for HOTSPOTS_Interior Elec Panel Fuses/Circuit Breakers/Connectors	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
40,700 - *RPT*INSPECT_Seats, Covering, Belts, Loose Cushions, Operation	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
40,800 - *RPT*!FRA!INSPECT_Interior Lights; Mirrors	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
40,900 - !FRA!INSPECT_Interior Cleanliness/Potential Projectiles	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
41,000 - INSPECT_All ADA Equip (Lift Seat Belt, floor hold Downs, Belts, Cover, Alarms)	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
41,100 - INSPECT_CLEAN_AC Filter	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
41,200 - INSPECT_Emergency Windows,Hatches,Doors,Alarms/Lights;CHECK_for Leaks	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
41,300 - *RPT*INSPECT_Interior Body, Floor, Stanchions	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
41,400 - *RPT*INSPECT_Passenger Doors, Glass, Seal	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
50,000 - SECTION 5 - UNDER VEHICLE INSPECTION	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
50,100 - *RPT*INSPECT_Steering components-Drag Link, Tie Rods ends and Steering Damper	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
50,200 - INSPECT_Ball Joint Play	Done	Balljoint need replace	JUHURST	Jun 17, 2022 7:31:19 PM	Yes	55702233
50,300 - !FRA!INSPECT_Front Wheel Bearings for Play	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
50,400 - LUBE_All Chassis Components	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
50,500 - !FRA!CHANGE_Engine oil,filters	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
50,700 - INSPECT_Tire Condition	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
50,800 - INSPECT_Tire Valve Stems, Double Check Caps	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
50,900 - !FRA!INSPECT_Wheels for Cracks, Loose Lugs/Indicators, Outer Hub Leaks	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
51,000 - RECORD_LF-Tire Tread Depth (32nds)	12 32nds of an inch		JUHURST	Jun 17, 2022 7:31:19 PM	No	
51,100 - RECORD_LF-Tire Air Pressure (psi)	65 Pounds per Square Inch		JUHURST	Jun 17, 2022 7:31:19 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
51,200 - RECORD_RF-Tire Tread Depth (32nds)	10 32nds of an inch		JUHURST	Jun 17, 2022 7:31:19 PM	No	
51,300 - RECORD_RF-Air Pressure (psi)	65 Pounds per Square Inch		JUHURST	Jun 17, 2022 7:31:19 PM	No	
51,400 - !FRA!INSPECT_FRONT ABS Tone Rings, Sensors, Routing of Cables	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
51,500 - !FRA!INSPECT_Wheel Seals for Leaks	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
51,600 - !FRA!INSPECT_Front Brake Assemblies	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
51,700 - MEASURE_RECORD_LF - Brake Lining, Pad Thickness (32nds)	12 32nds of an inch		JUHURST	Jun 17, 2022 7:31:19 PM	No	
51,800 - MEASURE_RECORD_RF - Brake Lining, Pad Thickness (32nds)	12 32nds of an inch		JUHURST	Jun 17, 2022 7:31:19 PM	No	
51,900 - INSPECT VISUALLY_RECORD_LF Rotor Condition (inches)	1.2299 Inch		JUHURST	Jun 17, 2022 7:31:19 PM	No	
52,000 - INSPECT VISUALLY_RECORD_RF Rotor Condition (inches)	1.2299 Inch		JUHURST	Jun 17, 2022 7:31:19 PM	No	
52,100 - INSPECT_Vibration Damper	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
52,200 - !FRA!INSPECT_Battery Cable Routing from Battery Box to Starter	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
52,400 - !FRA!INSPECT_Starter Mounting	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
52,500 - !FRA!INSPECT_Engine Exhaust System	Done	two Engine mounts need replace	JUHURST	Jun 17, 2022 7:31:19 PM	Yes	55702233
52,700 - INSPECT_Engine, Transmission Mounts	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
52,800 - !FRA!INSPECT_Engine, Transmission for Fluid Leaks	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
52,900 - INSPECT_Shift Cable Adjustment - All Transmissions	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
53,000 - !FRA!INSPECT_Transmission Breather and Clean	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
53,100 - *RPT*!FRA!INSPECT_Parking Brake Cables, Shoes for Wear, Contamination	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
53,200 - *RPT*INSPECT_A/C Condensor, Fans, Safety Grills	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
53,300 - *RPT*INSPECT_Driveline, Hanger Bearings, U-Joints, Slip Joints, Safety Loop	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
53,400 - *RPT*INSPECT_All Body Mounts and Chassis Frame for Corrosion, Cracks	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
53,500 - !FRA!INSPECT_Fuel Tank, Mountings, Lines	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
53,600 - INSPECT_Tire Condition	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
53,700 - INSPECT_Tire Valve Stems, Double Check Caps	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
53,800 - INSPECT_Mismatched Tire Tread, Casing Design	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
53,900 - INSPECT_Dual Mating Tires w/Square	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
54,000 - !FRA!INSPECT_Wheels for Cracks, Loose Lugs/Indicators, Outer Hub Leaks	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
54,100 - INSPECT_Mud Flaps, Brackets	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
54,200 - RECORD_RRO-Tire Tread Depth (32nds)	7 32nds of an inch		JUHURST	Jun 17, 2022 7:31:19 PM	No	
54,300 - RECORD_RRI-Tire Tread Depth (32nds)	6 32nds of an inch		JUHURST	Jun 17, 2022 7:31:19 PM	No	
54,400 - RECORD_RRO-Air Pressure (psi)	65 Pounds per Square Inch		JUHURST	Jun 17, 2022 7:31:19 PM	No	
54,500 - RECORD_RRI-Air Pressure (psi)	65 Pounds per Square Inch		JUHURST	Jun 17, 2022 7:31:19 PM	No	
54,600 - RECORD_LRO-Tire Tread Depth (32nds)	7 32nds of an inch		JUHURST	Jun 17, 2022 7:31:19 PM	No	
54,700 - RECORD_LRI-Tire Tread Depth (32nds)	6 32nds of an inch		JUHURST	Jun 17, 2022 7:31:19 PM	No	
54,800 - RECORD_LRO-Air Pressure (psi)	65 Pounds per Square Inch		JUHURST	Jun 17, 2022 7:31:19 PM	No	
54,900 - RECORD_LRI-Air Pressure (psi)	65 Pounds per Square Inch		JUHURST	Jun 17, 2022 7:31:19 PM	No	
55,000 - !FRA!INSPECT_REAR Brake Assemblies	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
55,100 - !FRA!INSPECT_REAR Hubs, Wheel Seals for Oil Leaks	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
55,200 - !FRA!INSPECT_REAR ABS Tone Rings, Sensors, Routing Of Cables (if equipped)	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
55,300 - MEASURE_RECORD_LR - Brake Lining, Pad Thickness (32nds)	10 32nds of an inch		JUHURST	Jun 17, 2022 7:31:19 PM	No	
55,400 - MEASURE_RECORD_RR - Brake Lining, Pad Thickness (32nds)	10 32nds of an inch		JUHURST	Jun 17, 2022 7:31:19 PM	No	
55,500 - INSPECT VISUALLY_MEASURE_RECORD_LR Drum, Rotor Condition (inches)	1.269 Inch		JUHURST	Jun 17, 2022 7:31:19 PM	No	
55,600 - INSPECT VISUALLY_MEASURE_RECORD_RR Drum, Rotor Condition (inches)	1.269 Inch		JUHURST	Jun 17, 2022 7:31:19 PM	No	
55,700 - !FRA!INSPECT_ Under Body Exhaust System	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
55,800 - *RPT*INSPECT_REAR Axle Housing, Breather; CLEAN_Breather	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
55,900 - *RPT*INSPECT_REAR Springs, Shocks, Suspension, Airbags	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
60,000 - SECTION 6 - Wheelchair Inspection	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
60,100 - RECORD_Wheelchair Cycle Count	14491 Cycles		JUHURST	Jun 17, 2022 7:31:19 PM	No	
60,200 - CHECK_Lift Access Door for Ease of Opening,Latch Security,Door Hold Back	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
60,300 - CHECK_Platform Emergency Release Mechanism for Ease of Operation	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
60,400 - OPERATE_Lift thru Complete Cycle;CHECK_Noises,Jerky Op,Too Fast-Slow,Drift Down	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
60,500 - INSPECT_Bridgeplate Operation	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
60,600 - INSPECT_All Pivot Points for Wear and Looseness	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
60,700 - INSPECT_Rollers for Wear and Smooth Rotation	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
60,800 - INSPECT_Operation of Platform Barrier Mechanism	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
60,900 - INSPECT_Cam Slots for Wear and Proper Alignment	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
61,000 - INSPECT_Cable Condition (If Applicable)	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
61,100 - INSPECT_Hydraulic Hoses for Leaks, Chafing or Cracks	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
61,200 - INSPECT_Electrical Connections and Routing of Wires and Cables	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
61,300 - INSPECT_Operation and Adjustment of All Safety Switches	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
61,400 - INSPECT_All Lift Mounting Brackets for Loose Bolts Broken Welds, etc.	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
61,500 - INSPECT_Manual Back-up Raise/Lower System (If Applicable)	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
61,600 - INSPECT_HydrPump Reservoir Oil Level. Consult SvcManual for Fluid to Use.	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
61,700 - CHECK_Operator Decals for Proper Positioning;CONSULT_Service Manual	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
61,800 - CHECK_WC Holddowns Inside Vehicle for Secure Mounting,Proper Operation	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
61,900 - CLEAN_Linkages and Mechanisms	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
62,000 - LUBRICATE_Linkages and Mechanisms (DO NOT OVER Lubricate)	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
62,100 - INSPECT_Emergency Platform Release Mechanism	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
62,200 - INSPECT_Platform Barrier Latch Mechanism	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
62,300 - INSPECT_Bridgeplate Hinge	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
62,400 - INSPECT_All Pivot Points	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
62,500 - INSPECT_Cams and Slots	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
62,600 - INSPECT_Rollers	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
62,700 - INSPECT_All Linkages	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
70,000 - SECTION 7 - ALTERNATIVE FUELS INSPECTION	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
70,300 - INSPECT_Condition of Fuel Pressure Gauge	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
70,400 - PROVIDE PROOF_Tank_Dents/Scratches and Re-Certification	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
70,500 - INSPECT_Tank test date, labels-Reference-ST.4 FMMVSS 304 & ANSI-CSA NGV2	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
70,600 - INSPECT_Tank Lines to Ensure Secure Mounting, Insulation Against Vibration	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
70,700 - INSPECT_Filling Nozzle for Securely Fitting Cap	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
70,800 - INSPECT_Pressure Relief Device's Venting System, Valves, Ducting to MNFR Specs	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
80,000 - SECTION 8 - PMI Report Completion	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
80,100 - COMPLETE_PM Report; Follow-ups	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	
80,200 - RETURN_Vehicle to Predetermined Location	Done		JUHURST	Jun 17, 2022 7:31:19 PM	No	

Activity Sub Total

Activity 10 Sub Total	
Parts:	2.14
Labor:	0.00
Labor Hours:	3.45
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	2.14



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 55612088
Invoice No. 55345 - 55612088

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FD4E4FS7EDB17176
55345-LIGHT DUTY PMA		Ford E450 Champion Challenger	
Requested By:	JUHURST	Status:	40 - Closed (40)
Created By:	JUHURST	Priority:	3 - High
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	302,630 - DH

Activity Header
Activity:20 999 TOTAL VEHICLE
Activity Note: PM A
Reason for Repair: 08 Preventive Maintenance
Work Accomplished: A PM Level A
Part Failure:
Activity Comments:

Activity Parts
No Data Available

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
17-Jun-22	Junior Hurst	0.22	0	0

Activity Sublet
No Data Available


Check List						
20 Desc: PM A Task: PM A SERVICE Performed by: JUHURST Performed on: 17-JUN-22						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
100,000 - "A" PMI SERVICING ITEMS	Done		JUHURST	Jun 17, 2022 7:51:12 PM	No	
101,000 - FRA Change Oil Filters	Yes		JUHURST	Jun 17, 2022 7:51:12 PM	No	
102,000 - FRA Drain Engine Oil	Yes		JUHURST	Jun 17, 2022 7:51:12 PM	No	
103,000 - FRA Check Transmission Fluid	Done		JUHURST	Jun 17, 2022 7:51:12 PM	No	
104,000 - Lubricate Chassis	Done		JUHURST	Jun 17, 2022 7:51:12 PM	No	
105,000 - Replace or Clean A/C Filters	Done		JUHURST	Jun 17, 2022 7:51:12 PM	No	
107,000 - FRA Change Primary Fuel Filter	No		JUHURST	Jun 17, 2022 7:51:12 PM	No	
108,000 - Lube all pivoting Mechanisms	Done		JUHURST	Jun 17, 2022 7:51:12 PM	No	

Activity Sub Total		Activity 20 Sub Total	
Parts:		Labor:	

	Labor Hours:	0.22
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	0.00
Work Order Footer		
	Work Order 55612088 Total	
	Parts:	2.14
	Labor:	0.00
	Labor Hours:	3.67
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	2.14



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 55679281
Invoice No. 55345 - 55679281

Client Department:

Department: 55345M

Work Order Description

CHECK AND WRENCH LIGHT ON

Requested By: CVERGARA

Created By: CVERGARA

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: -

Driver:

Phone:

ETA:

Meter: 301,637 - DH

Chronology

Reported	Jun 9, 2022 2:17:00 PM	Jun 9, 2022 2:17:00 PM
Started	Jun 10, 2022 7:30:00 AM	
Completed	Jun 13, 2022 1:35:00 PM	Jun 13, 2022 1:35:00 PM
Down Time		

Work Order Notes

Line 10 check engine light and wrench light is on

PO713 transmission wire harness

replaced transmission wires harness temperature sensor valve body gasket add fluids completed

Activity Header

Activity: 10 999/999/999 TOTAL VEHICLE

Activity Note: PRA

Reason for Repair: SW Shop Work Order

Work Accomplished: 06 Inspect

Part Failure: 00 No Failure

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: PRA

Task: PRA and Meter Readings Performed by: HPIERRE Performed on: 13-JUN-22

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		HPIERRE	Jun 13, 2022 1:35:07 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		HPIERRE	Jun 13, 2022 1:35:07 PM	No	
4 - Are you wearing the appropriate PPE?	Done		HPIERRE	Jun 13, 2022 1:35:07 PM	No	
7 - Have you performed the proper LOTO?	Done		HPIERRE	Jun 13, 2022 1:35:07 PM	No	
10 - Are you aware of the potential risks of performing this repair?	Done		HPIERRE	Jun 13, 2022 1:35:07 PM	No	
11 - Have you successfully completed the Personal	Done		HPIERRE	Jun 13, 2022	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO	
Risk Assessment?				1:35:07 PM			
Activity Sub Total				Activity 10 Sub Total			
				Parts:		0.00	
				Labor:		0.00	
				Labor Hours:		0.00	
				Sublet Parts:		0.00	
				Sublet Labor:		0.00	
				Activity Sub Total		0.00	



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 55679281
Invoice No. 55345 - 55679281

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
CHECK AND WRENCH LIGHT ON		Ford E450 Champion Challenger	
Requested By:	CVERGARA	Status:	40 - Closed (40)
Created By:	CVERGARA	Priority:	-
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	301,637 - DH

Activity Header
Activity:20 027/000/000 TRANSMISSION, MAIN, AUTOMATIC
Activity Note: CHECK ENGINE LIGHT ON PO 713 PERFORM REPAIR PROCEDURE
Reason for Repair: 04 Driver's Report
Work Accomplished:
Part Failure:
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
13-Jun-22	20021	FILTER, TRANSMISSION 20021	1	17.44	17.44
10-Jun-22	BC3Z-7H141-A	SENSOR, TEMPERATURE, TRANSMISSION	1	9.31	9.31
10-Jun-22	4C3Z-7G276-AA	HARNESS, SOLENOID, INTERNAL, TRANSMISSION, 5R110W	1	153.72	153.72
10-Jun-22	8C3Z-7C155-A	GASKET, BODY, VALVE, TRANSMISSION, 5R110	1	8.21	8.21

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
10-Jun-22	Pierre,Hubert J	5.08	0	0

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available

Activity Sub Total		Activity 20 Sub Total	
Parts:			188.68
Labor:			0.00
Labor Hours:			5.08
Sublet Parts:			0.00
Sublet Labor:			0.00
Activity Sub Total			188.68

Work Order Footer		Work Order 55679281 Total	
Parts:			188.68
Labor:			0.00
Labor Hours:			5.08
Sublet Parts:			0.00
Sublet Labor:			0.00
Activity Sub Total			188.68



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 55668976
Invoice No. 55345 - 55668976

Client Department:

Department: 55345M

Work Order Description

FLAT TIRE

Requested By: CVERGARA

Created By: CVERGARA

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: -

Driver:

Phone:

ETA:

Meter: 301,018 - DH

Chronology

Reported	Jun 6, 2022 3:00:00 PM	Jun 6, 2022 3:00:00 PM
Started	Jun 6, 2022 3:21:00 PM	
Completed	Jun 6, 2022 4:42:00 PM	Jun 6, 2022 4:42:00 PM
Down Time		

Work Order Notes

Line 10 vehicle came to shop for right rear outer tire flat. worn out. removed and replace one good used tire to rear of unit check unit after return vehicle back to work

Activity Header

Activity: 10 999/999/999 TOTAL VEHICLE

Activity Note: PERSONAL RISK ASSESMENT

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure: 00 No Failure

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: PERSONAL RISK ASSESMENT


Task: PRA and Meter Readings Performed by: JUHURST Performed on: 06-JUN-22

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		JUHURST	Jun 6, 2022 4:41:31 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		JUHURST	Jun 6, 2022 4:41:31 PM	No	
4 - Are you wearing the appropriate PPE?	Done		JUHURST	Jun 6, 2022 4:41:31 PM	No	
7 - Have you performed the proper LOTO?	Done		JUHURST	Jun 6, 2022 4:41:31 PM	No	
10 - Are you aware of the potential risks of performing this repair?	Done		JUHURST	Jun 6, 2022 4:41:31 PM	No	
11 - Have you successfully completed the Personal Risk Assessment?	Done		JUHURST	Jun 6, 2022 4:41:31 PM	No	

Activity Sub Total


Activity 10 Sub Total

	Parts:	0.00
	Labor:	0.00
	Labor Hours:	0.00
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	0.00

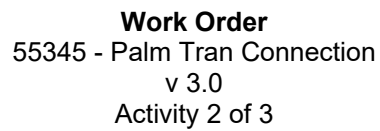



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 55668976
Invoice No. 55345 - 55668976

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FD4E4FS7EDB17176
FLAT TIRE		Ford E450 Champion Challenger	
Requested By:	CVERGARA	Status:	40 - Closed (40)
Created By:	CVERGARA	Priority:	-
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	301,018 - DH

Activity Header				
Activity:30 017/001/000 TIRE, PNEUMATIC				
Activity Note: REAR TIRES				
Reason for Repair:				
Work Accomplished:				
Part Failure:				
Activity Comments:				
Activity Parts				
No Data Available				
Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
06-Jun-22	Junior Hurst	1.35	0	0
Activity Sublet				
No Data Available				
Activity Checklist				
No Data Available				
No Data Available				
Activity Sub Total				
			Activity 30 Sub Total	
			Parts:	0.00
			Labor:	0.00
			Labor Hours:	1.35
			Sublet Parts:	0.00
			Sublet Labor:	0.00
			Activity Sub Total	0.00
Work Order Footer				
			Work Order 55668976 Total	
			Parts:	0.00
			Labor:	0.00
			Labor Hours:	1.35
			Sublet Parts:	0.00
			Sublet Labor:	0.00
			Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 1



Work Order No. 55612053
Invoice No. 55345 - 55612053

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
FOLLOWUP-FT Light Duty			Ford E450 Champion Challenger
Requested By:	JUHURST	Status:	40 - Closed (40)
Created By:	JUHURST	Priority:	3 - High
Assigned To:		Driver:	
Class:	-	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	297,854 - DH

Chronology

Reported	May 16, 2022 4:23:15 PM	May 16, 2022 4:23:15 PM
Started	May 16, 2022 4:33:00 PM	
Completed	May 16, 2022 5:32:00 PM	May 16, 2022 5:32:00 PM
Down Time		

Work Order Notes

Line 10 change right front signal lamp part # 3157 one. now working asdsign also change rear A/C filter. no part #

Activity Header

Activity: 10 015/001/001 WHEEL, STEERING

Activity Note: right front signal need change

Reason for Repair: FW Follow Up

Work Accomplished:

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
16-May-22	PA4075	FILTER, AIR SEE P546597	1	7.05	7.05
16-May-22	B329	FILTER, OIL, SPIN-ON SEE P550965	1	1.99	1.99
17-May-22	B329	FILTER, OIL, SPIN-ON SEE P550965	-1	1.99	-1.99
16-May-22	3157	LAMP, WEDGE-MOUNT, PLASTIC SAME AS GE3157	1	0.98	0.98

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
16-May-22	Junior Hurst	0.97	0	0

Activity Sublet

No Data Available

Activity Checklist

No Data Available

No Data Available

Activity Sub Total

Activity 10 Sub Total

Parts:	8.03
Labor:	0.00
Labor Hours:	0.97
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	8.03

Work Order Footer

Work Order 55612053 Total

Parts:	8.03
--------	------

	Labor:	0.00
	Labor Hours:	0.97
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	8.03



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 55522428
Invoice No. 55345 - 55522428

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
55345-LIGHT DUTY PMB		Ford E450 Champion Challenger	
Requested By:	DARTHURS	Status:	40 - Closed (40)
Created By:	DARTHURS	Priority:	3 - High
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	297,854 - DH

Chronology		
Reported	May 11, 2022 12:00:00 AM	May 11, 2022 12:00:00 AM
Started	May 13, 2022 4:07:00 PM	
Completed	May 16, 2022 4:31:00 PM	May 16, 2022 4:31:00 PM
Down Time		

Work Order Notes

Line 10 PERFORMED PMB & SERVICE

Activity Header						
Activity:5 999/999/999 TOTAL VEHICLE						
Activity Note: PERSONAL RISK ASSESSMENT						
Reason for Repair: SW Shop Work Order						
Work Accomplished: 06 Inspect						
Part Failure: 00 No Failure						
Activity Comments:						
Activity Parts						
No Data Available						
Activity Labor						
No Data Available						
Activity Sublet						
No Data Available						
Activity Checklist						
Check List						
5 Desc: PERSONAL RISK ASSESSMENT						
Task: PRA and Meter Readings Performed by: JUHURST Performed on: 16-MAY-22						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		JUHURST	May 16, 2022 1:51:55 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		JUHURST	May 16, 2022 1:51:55 PM	No	
4 - Are you wearing the appropriate PPE?	Done		JUHURST	May 16, 2022 1:51:55 PM	No	
7 - Have you performed the proper LOTO?	Done		JUHURST	May 16, 2022 1:51:55 PM	No	
10 - Are you aware of the potential risks of performing this repair?	Done		JUHURST	May 16, 2022 1:51:55 PM	No	
11 - Have you successfully completed the Personal Risk Assessment?	Done		JUHURST	May 16, 2022 1:51:55 PM	No	
Activity Sub Total						
				Activity 5 Sub Total		
Parts:				0.00		

	Labor:	0.00
	Labor Hours:	0.00
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 55522428
Invoice No. 55345 - 55522428

Client Department:

Department: 55345M

Work Order Description

55345-LIGHT DUTY PMB

Requested By: DARTHURS

Created By: DARTHURS

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 3 - High

Driver:

Phone:

ETA:

Meter: 297,854 - DH

Activity Header

Activity: 10

Activity Note: Light Duty PMI

Reason for Repair:

Work Accomplished:

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
16-May-22	Junior Hurst	1.58	0	0
16-May-22	Junior Hurst	0.78	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: Light Duty PMI

Task: First Transit North America Light Duty PM Inspection Sheet Performed by: JUHURST Performed on: 16-MAY-22

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,000 - SECTION 1 - Preparation Inspection	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
10,100 - INSPECT_Auto-Transmission Operation/Controller; Neutral Safety Switch	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
10,200 - !FRA!INSPECT_Starter Operation	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
10,300 - !FRA!INSPECT_Warning Lights and Alarms	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
10,400 - !FRA!INSPECT_Back Up Alarm	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
10,500 - !FRA!INSPECT_Engine Operation, OBSERVE_Exhaust for Excessive Smoke	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
10,600 - Check Driver's Pre-trip or DVIR/EVIR & Authorization Forms	Done		JUHURST	May 16, 2022	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
				4:26:01 PM		
10,700 - INSPECT_All Exterior Lights (Turn on until Completion of this section)	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
10,800 - *RPT*INSPECT_Body Damage, Corrosion;DOCUMENT_Issues	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
10,900 - INSPECT_Fuel Tank Cap, and Doors	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
11,100 - INSPECT_License Plate, Bracket, Bumpers	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
20,000 - SECTION 2 - Test Drive and Operator Area Inspection	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
20,100 - INSPECT_Driver Seat condition/operation/seatbelt	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
20,200 - TEST DRIVE_INSPECT_Proper Operation; Drive into Shop	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
20,300 - *RPT*INSPECT_Steering Wheel for Play/Bind/Horn Op./Turn Signal Cancelation	Done	right front signal need change	JUHURST	May 16, 2022 4:26:01 PM	Yes	55612053
20,400 - PERFORM_Brake Test (Apply hard enough to check wheel pull and Application)	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
20,500 - *RPT*FRA INSPECT_Lighting/Operation of all Gauges	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
20,600 - *RPT*INSPECT_Windshields, Sun Visors	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
20,700 - INSPECT_Wiper/Washer Operation, Condition	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
20,800 - INSPECT_High Idle Control	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
20,900 - *RPT*!FRA!INSPECT_HVAC Controls, Operation	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
21,000 - *RPT*!FRA!INSPECT_Operation of all Switches and Accessories	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
21,100 - INSPECT_Parking Brake Operation	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
21,200 - !FRA!TEST_Service Brake Backup System (Stationary Brake Tests HYD)	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
21,300 - INSPECT_VIN, Tire Pressure Decal, Data Tags	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
21,400 - *RPT*INSPECT_Drivers Door Hinges,	Done		JUHURST	May 16,	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
Handles, Controls and Panels				2022 4:26:01 PM		
21,500 - !FRA!INSPECT_Under Dash Wiring for Proper Routing/Chafing/Securement	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
21,550 - INSPECT_Driver Floor Area for Rust/Water Leaks	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
21,600 - *RPT*INSPECT for WEAR_Pedal Pads, Accelerator, Brake, Parking Brake	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
21,700 - INSPECT_Engine Fault Codes	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
30,000 - SECTION 3 - EXTERIOR INSPECTION - Front	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
31,000 - SSF (Street Side Front)	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
31,010 - *RPT*!FRA!INSPECT_Mirror Mountings, Brackets, Glass	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
31,020 - *RPT*INSPECT_FRONT Springs, Shocks, Spring Shackles	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
31,030 - INSPECT_Mud Flaps, Brackets	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
31,040 - INSPECT_Wiper Blades, Arms	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
32,000 - Engine Inspection	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
32,010 - INSPECT_Hood, Springs and Props	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
32,020 - !FRA!INSPECT_Engine Compartment Condition for Fire Risk Avoidance	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
32,030 - !FRA!INSPECT_for Fluid Leaks, Levels	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
32,040 - !FRA!INSPECT_Hyd_Brake Fluid with Test Strips	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
32,050 - !FRA!INSPECT_RECORD_Coolant Recovery with Refractometer; Test Strips	26 Degree Fahrenheit		JUHURST	May 16, 2022 4:26:01 PM	No	
32,060 - PRESSURE TEST_Cooling Systems (Radiator, Cap, hoses and clamps)	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
32,070 - *RPT*INSPECT_Radiator and Mountings, Cores	Done		JUHURST	May 16, 2022 4:26:01 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
32,080 - *RPT*!INSPECT_Fan Assembly, Shroud, Tensioner, Belts, All Belt Driven Components	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
32,090 - *RPT*!FRA!INSPECT_Mounting, Installation of Alternator, AC Compressor	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
32,100 - INSPECT_Intake System	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
32,140 - *RPT*!FRA!RECORD_Underhood Battery Voltages (volts)	14 Volt*		JUHURST	May 16, 2022 4:26:01 PM	No	
33,010 - CSF (Curb Side Front)	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
33,020 - *RPT*!FRA!INSPECT_Mirror Mountings, Brackets, Glass	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
33,030 - *RPT*!INSPECT_FRONT Springs, Shocks, Spring Shackles	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
33,040 - INSPECT_Mud Flaps, Brackets	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
33,050 - INSPECT_Wiper Blades, Arms	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
33,060 - !FRA!INSPECT_LUBE_Battery Box, Batteries, Tray Slides, Hold Downs	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
33,070 - *RPT*!FRA!RECORD_Side Mounted Battery Voltages (volts)	14 Volt*		JUHURST	May 16, 2022 4:26:01 PM	No	
33,080 - INSPECT_Entry door, OPEN_with external lock/switch (if equipped)	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
40,000 - SECTION 4 - Interior Inspection	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
40,100 - *RPT*!INSPECT_Step-Well, Step-Tread, Hand Rails, Step-well Light	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
40,200 - INSPECT_Insurance/Registration/Regulatory Forms Dates	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
40,250 - INSPECT_Overhead Compartment for Water Leaks	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
40,300 - INSPECT_Safety Equipment, Fire Extinguisher/Suppression	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
40,400 - INSPECT_Camera Systems, Filter, Electrical Inputs/Outputs-SOP M038	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
40,600 - !FRA!CHECK for HOTSPOTS_Interior Elec Panel Fuses/Circuit Breakers/Connectors	Done		JUHURST	May 16, 2022 4:26:01 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
40,700 - *RPT*INSPECT_Seats, Covering, Belts, Loose Cushions, Operation	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
40,800 - *RPT*!FRA!INSPECT_Interior Lights; Mirrors	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
40,900 - !FRA!INSPECT_Interior Cleanliness/Potential Projectiles	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
41,000 - INSPECT_All ADA Equip (Lift Seat Belt, floor hold Downs, Belts, Cover, Alarms)	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
41,100 - INSPECT_CLEAN_AC Filter	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
41,200 - INSPECT_Emergency Windows,Hatches,Doors,Alarms/Lights;CHECK_for Leaks	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
41,300 - *RPT*INSPECT_Interior Body, Floor, Stanchions	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
41,400 - *RPT*INSPECT_Passenger Doors, Glass, Seal	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
50,000 - SECTION 5 - UNDER VEHICLE INSPECTION	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
50,100 - *RPT*INSPECT_Steering components-Drag Link, Tie Rods ends and Steering Damper	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
50,200 - INSPECT_Ball Joint Play	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
50,300 - !FRA!INSPECT_Front Wheel Bearings for Play	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
50,400 - LUBE_All Chassis Components	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
50,500 - !FRA!CHANGE_Engine oil,filters	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
50,700 - INSPECT_Tire Condition	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
50,800 - INSPECT_Tire Valve Stems, Double Check Caps	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
50,900 - !FRA!INSPECT_Wheels for Cracks, Loose Lugs/Indicators, Outer Hub Leaks	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
51,000 - RECORD_LF-Tire Tread Depth (32nds)	13 32nds of an inch		JUHURST	May 16, 2022 4:26:01 PM	No	
51,100 - RECORD_LF-Tire Air Pressure (psi)	65 Pounds per Square Inch		JUHURST	May 16, 2022 4:26:01 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
51,200 - RECORD_RF-Tire Tread Depth (32nds)	13 32nds of an inch		JUHURST	May 16, 2022 4:26:01 PM	No	
51,300 - RECORD_RF-Air Pressure (psi)	65 Pounds per Square Inch		JUHURST	May 16, 2022 4:26:01 PM	No	
51,400 - !FRA!INSPECT_FRONT ABS Tone Rings, Sensors, Routing of Cables	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
51,500 - !FRA!INSPECT_Wheel Seals for Leaks	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
51,600 - !FRA!INSPECT_Front Brake Assemblies	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
51,700 - MEASURE_RECORD_LF - Brake Lining, Pad Thickness (32nds)	8 32nds of an inch		JUHURST	May 16, 2022 4:26:01 PM	No	
51,800 - MEASURE_RECORD_RF - Brake Lining, Pad Thickness (32nds)	8 32nds of an inch		JUHURST	May 16, 2022 4:26:01 PM	No	
51,900 - INSPECT VISUALLY_RECORD_LF Rotor Condition (inches)	1.299 Inch		JUHURST	May 16, 2022 4:26:01 PM	No	
52,000 - INSPECT VISUALLY_RECORD_RF Rotor Condition (inches)	1.299 Inch		JUHURST	May 16, 2022 4:26:01 PM	No	
52,100 - INSPECT_Vibration Damper	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
52,200 - !FRA!INSPECT_Battery Cable Routing from Battery Box to Starter	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
52,400 - !FRA!INSPECT_Starter Mounting	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
52,500 - !FRA!INSPECT_Engine Exhaust System	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
52,700 - INSPECT_Engine, Transmission Mounts	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
52,800 - !FRA!INSPECT_Engine, Transmission for Fluid Leaks	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
52,900 - INSPECT_Shift Cable Adjustment - All Transmissions	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
53,000 - !FRA!INSPECT_Transmission Breather and Clean	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
53,100 - *RPT*!FRA!INSPECT_Parking Brake Cables, Shoes for Wear, Contamination	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
53,200 - *RPT*INSPECT_A/C Condensor, Fans, Safety Grills	Done		JUHURST	May 16, 2022 4:26:01 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
53,300 - *RPT*INSPECT_Driveline, Hanger Bearings, U-Joints, Slip Joints, Safety Loop	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
53,400 - *RPT*INSPECT_All Body Mounts and Chassis Frame for Corrosion, Cracks	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
53,500 - !FRA!INSPECT_Fuel Tank, Mountings, Lines	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
53,600 - INSPECT_Tire Condition	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
53,700 - INSPECT_Tire Valve Stems, Double Check Caps	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
53,800 - INSPECT_Mismatched Tire Tread, Casing Design	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
53,900 - INSPECT_Dual Mating Tires w/Square	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
54,000 - !FRA!INSPECT_Wheels for Cracks, Loose Lugs/Indicators, Outer Hub Leaks	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
54,100 - INSPECT_Mud Flaps, Brackets	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
54,200 - RECORD_RRO-Tire Tread Depth (32nds)	6 32nds of an inch		JUHURST	May 16, 2022 4:26:01 PM	No	
54,300 - RECORD_RRI-Tire Tread Depth (32nds)	6 32nds of an inch		JUHURST	May 16, 2022 4:26:01 PM	No	
54,400 - RECORD_RRO-Air Pressure (psi)	65 Pounds per Square Inch		JUHURST	May 16, 2022 4:26:01 PM	No	
54,500 - RECORD_RRI-Air Pressure (psi)	65 Pounds per Square Inch		JUHURST	May 16, 2022 4:26:01 PM	No	
54,600 - RECORD_LRO-Tire Tread Depth (32nds)	6 32nds of an inch		JUHURST	May 16, 2022 4:26:01 PM	No	
54,700 - RECORD_LRI-Tire Tread Depth (32nds)	6 32nds of an inch		JUHURST	May 16, 2022 4:26:01 PM	No	
54,800 - RECORD_LRO-Air Pressure (psi)	65 Pounds per Square Inch		JUHURST	May 16, 2022 4:26:01 PM	No	
54,900 - RECORD_LRI-Air Pressure (psi)	65 Pounds per Square Inch		JUHURST	May 16, 2022 4:26:01 PM	No	
55,000 - !FRA!INSPECT_REAR Brake Assemblies	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
55,100 - !FRA!INSPECT_REAR Hubs, Wheel Seals for Oil Leaks	Done		JUHURST	May 16, 2022 4:26:01 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
55,200 - !FRA!INSPECT_REAR ABS Tone Rings, Sensors, Routing Of Cables (if equipped)	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
55,300 - MEASURE_RECORD_LR - Brake Lining, Pad Thickness (32nds)	10 32nds of an inch		JUHURST	May 16, 2022 4:26:01 PM	No	
55,400 - MEASURE_RECORD_RR - Brake Lining, Pad Thickness (32nds)	10 32nds of an inch		JUHURST	May 16, 2022 4:26:01 PM	No	
55,500 - INSPECT VISUALLY_MEASURE_RECORD_LR Drum, Rotor Condition (inches)	1.269 Inch		JUHURST	May 16, 2022 4:26:01 PM	No	
55,600 - INSPECT VISUALLY_MEASURE_RECORD_RR Drum, Rotor Condition (inches)	1.269 Inch		JUHURST	May 16, 2022 4:26:01 PM	No	
55,700 - !FRA!INSPECT_ Under Body Exhaust System	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
55,800 - *RPT*INSPECT_REAR Axle Housing, Breather; CLEAN_Breather	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
55,900 - *RPT*INSPECT_REAR Springs, Shocks, Suspension, Airbags	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
60,000 - SECTION 6 - Wheelchair Inspection	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
60,100 - RECORD_Wheelchair Cycle Count	14255 Cycles		JUHURST	May 16, 2022 4:26:01 PM	No	
60,200 - CHECK_Lift Access Door for Ease of Opening,Latch Security,Door Hold Back	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
60,300 - CHECK_Platform Emergency Release Mechanism for Ease of Operation	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
60,400 - OPERATE_Lift thru Complete Cycle;CHECK_Noises,Jerky Op,Too Fast-Slow,Drift Down	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
60,500 - INSPECT_Bridgeplate Operation	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
60,600 - INSPECT_All Pivot Points for Wear and Looseness	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
60,700 - INSPECT_Rollers for Wear and Smooth Rotation	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
60,800 - INSPECT_Operation of Platform Barrier Mechanism	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
60,900 - INSPECT_Cam Slots for Wear and Proper Alignment	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
61,000 - INSPECT_Cable Condition (If Applicable)	Done		JUHURST	May 16, 2022 4:26:01 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
61,100 - INSPECT_Hydraulic Hoses for Leaks, Chafing or Cracks	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
61,200 - INSPECT_Electrical Connections and Routing of Wires and Cables	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
61,300 - INSPECT_Operation and Adjustment of All Safety Switches	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
61,400 - INSPECT_All Lift Mounting Brackets for Loose Bolts Broken Welds, etc.	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
61,500 - INSPECT_Manual Back-up Raise/Lower System (If Applicable)	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
61,600 - INSPECT_HydrPump Reservoir Oil Level. Consult SvcManual for Fluid to Use.	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
61,700 - CHECK_Operator Decals for Proper Positioning;CONSULT_Service Manual	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
61,800 - CHECK_WC Holddowns Inside Vehicle for Secure Mounting,Proper Operation	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
61,900 - CLEAN_Linkages and Mechanisms	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
62,000 - LUBRICATE_Linkages and Mechanisms (DO NOT OVER Lubricate)	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
62,100 - INSPECT_Emergency Platform Release Mechanism	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
62,200 - INSPECT_Platform Barrier Latch Mechanism	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
62,300 - INSPECT_Bridgeplate Hinge	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
62,400 - INSPECT_All Pivot Points	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
62,500 - INSPECT_Cams and Slots	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
62,600 - INSPECT_Rollers	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
62,700 - INSPECT_All Linkages	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
70,000 - SECTION 7 - ALTERNATIVE FUELS INSPECTION	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
70,300 - INSPECT_Condition of Fuel Pressure Gauge	Done		JUHURST	May 16, 2022 4:26:01 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
70,400 - PROVIDE PROOF_Tank_Dents/Scratches and Re-Certification	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
70,500 - INSPECT_Tank test date, labels-Reference-ST.4 FMMVSS 304 & ANSI-CSA NGV2	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
70,600 - INSPECT_Tank Lines to Ensure Secure Mounting, Insulation Against Vibration	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
70,700 - INSPECT_Filling Nozzle for Securely Fitting Cap	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
70,800 - INSPECT_Pressure Relief Device's Venting System, Valves, Ducting to MNFR Specs	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
80,000 - SECTION 8 - PMI Report Completion	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
80,100 - COMPLETE_PM Report; Follow-ups	Done		JUHURST	May 16, 2022 4:26:01 PM	No	
80,200 - RETURN_Vehicle to Predetermined Location	Done		JUHURST	May 16, 2022 4:26:01 PM	No	

Activity Sub Total

Activity 10 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	2.36
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 55522428
Invoice No. 55345 - 55522428

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
55345-LIGHT DUTY PMB		Ford E450 Champion Challenger	
Requested By:	DARTHURS	Status:	40 - Closed (40)
Created By:	DARTHURS	Priority:	3 - High
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	297,854 - DH

Activity Header
Activity:20 999 TOTAL VEHICLE
Activity Note: PM B
Reason for Repair: 08 Preventive Maintenance
Work Accomplished: B PM Level B
Part Failure:
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
17-May-22	B329	FILTER, OIL, SPIN-ON SEE P550965	1	1.99	1.99

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
16-May-22	Junior Hurst	0.25	0	0

Activity Sublet
No Data Available

Activity Checklist							
Check List							
20 Desc: PM B							
Task: PM B SERVICE Performed by: JUHURST Performed on: 16-MAY-22							
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO	
100,000 - "A" PMI SERVICING ITEMS	Done		JUHURST	May 16, 2022 3:38:16 PM	No		
101,000 - FRA Change Oil Filters	Yes		JUHURST	May 16, 2022 3:38:16 PM	No		
102,000 - FRA Drain Engine Oil	Yes		JUHURST	May 16, 2022 3:38:16 PM	No		
103,000 - FRA Check Transmission Fluid	Done		JUHURST	May 16, 2022 3:38:16 PM	No		
104,000 - Lubricate Chassis	Done		JUHURST	May 16, 2022 3:38:16 PM	No		
105,000 - Replace or Clean A/C Filters	Done		JUHURST	May 16, 2022 3:38:16 PM	No		
107,000 - FRA Change Primary Fuel Filter	Yes		JUHURST	May 16, 2022 3:38:16 PM	No		
108,000 - Lube all pivoting Mechanisms	Done		JUHURST	May 16, 2022 3:38:16 PM	No		
200,000 - "B" PMI SERVICING ITEMS (12 MONTH)	Done		JUHURST	May 16, 2022 3:38:16 PM	No		

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
201,000 - Service Crankcase Breather	Done		JUHURST	May 16, 2022 3:38:16 PM	No	
203,000 - FRA Change Automatic Transmission Fluid	No		JUHURST	May 16, 2022 3:38:16 PM	No	
204,000 - FRA Change Power Steering Fluid and Filter	Yes		JUHURST	May 16, 2022 3:38:16 PM	No	
205,000 - Complete Engine Diagnostics and Clear Codes when Completed	Done		JUHURST	May 16, 2022 3:38:16 PM	No	

Activity Sub Total

Activity 20 Sub Total

Parts:	1.99
Labor:	0.00
Labor Hours:	0.25
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	1.99

Work Order Footer

Work Order 55522428 Total

Parts:	1.99
Labor:	0.00
Labor Hours:	2.61
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	1.99



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 6



Work Order No. 55480015
Invoice No. 55345 - 55480015

Client Department:

Department: 55345M

Work Order Description

VEHICLE HAS SCRATCHES ON LEFT SIDE AREA

Requested By: CVERGARA

Created By: CVERGARA

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: -

Driver:

Phone:

ETA:

Meter: 290,533 - DH

Chronology

Reported	Mar 31, 2022 7:26:00 AM	Mar 31, 2022 7:26:00 AM
Started	Mar 31, 2022 10:14:00 AM	
Completed	May 13, 2022 2:20:00 PM	May 13, 2022 2:20:00 PM
Down Time		

Work Order Notes

Line 10 unreported damage to lower left side of vehicle

tech clean and touchup paint superficial marks by the affected area Line 20 COMPLAINT: low trade front tires

Cause: preventive maintenance

Correction: replaced 2 front tires Line 30 Complaint: per driver battery light on ,resistor motor blower connection was burned

Cause: tech check batteries voltage is 12.25, check the alternator voltage very low

Correction: replaced the alternator with a good used one, light went off and test drive vehicle

replaced resistor blower motor YH1697

Activity Header

Activity: 10 999/999/999 TOTAL VEHICLE

Activity Note: Personal Risk Assessment

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure: 00 No Failure

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
31-Mar-22	192659	TIRE, LT225/75R16, R500 HD, BSW, E/10PR, DURAVIS, BRIDGESTONE	2	135.26	270.52

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
31-Mar-22	NELSON PIERRE-LOUIS	2	0	0
01-Apr-22	RONALD JOHNSON	0.02	0	0
31-Mar-22	RONALD JOHNSON	0.02	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List																				
10 Desc: Personal Risk Assessment																				
Task: PRA and Meter Readings Performed by: RONAJOHNSON Performed on: 01-APR-22																				
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO														
1 - Are you properly trained to perform the task?	Done		RONAJOHNSON	Apr 1, 2022 4:17:59 AM	No															
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		RONAJOHNSON	Apr 1, 2022 4:17:59 AM	No															
4 - Are you wearing the appropriate PPE?	Done		RONAJOHNSON	Apr 1, 2022 4:17:59 AM	No															
7 - Have you performed the proper LOTO?	Done		RONAJOHNSON	Apr 1, 2022 4:17:59 AM	No															
10 - Are you aware of the potential risks of performing this repair?	Done		RONAJOHNSON	Apr 1, 2022 4:17:59 AM	No															
11 - Have you successfully completed the Personal Risk Assessment?	Done		RONAJOHNSON	Apr 1, 2022 4:17:59 AM	No															
Activity Sub Total																				
				<table border="1"> <thead> <tr> <th colspan="2">Activity 10 Sub Total</th> </tr> </thead> <tbody> <tr> <td>Parts:</td> <td>270.52</td> </tr> <tr> <td>Labor:</td> <td>0.00</td> </tr> <tr> <td>Labor Hours:</td> <td>2.04</td> </tr> <tr> <td>Sublet Parts:</td> <td>0.00</td> </tr> <tr> <td>Sublet Labor:</td> <td>0.00</td> </tr> <tr> <td>Activity Sub Total</td> <td>270.52</td> </tr> </tbody> </table>			Activity 10 Sub Total		Parts:	270.52	Labor:	0.00	Labor Hours:	2.04	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	270.52
Activity 10 Sub Total																				
Parts:	270.52																			
Labor:	0.00																			
Labor Hours:	2.04																			
Sublet Parts:	0.00																			
Sublet Labor:	0.00																			
Activity Sub Total	270.52																			



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 6



Work Order No. 55480015
Invoice No. 55345 - 55480015

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
VEHICLE HAS SCRATCHES ON LEFT SIDE AREA		Ford E450 Champion Challenger	
Requested By:	CVERGARA	Status:	40 - Closed (40)
Created By:	CVERGARA	Priority:	-
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	290,533 - DH

Activity Header				
Activity: 20 002 CAB & SHEET METAL				
Activity Note: PAINT SCRATCHES ON LEFT SIDE OF THE BUS REAR AC CONDENSOR AREA				
Reason for Repair: 41 Abuse of Equipment - 56210				
Work Accomplished: 15 Paint Prep, & Repaint				
Part Failure:				
Activity Comments:				
Activity Parts				
No Data Available				
Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
31-Mar-22	RONALD JOHNSON	0.02	0	0
Activity Sublet				
No Data Available				
Activity Checklist				
No Data Available				
No Data Available				
Activity Sub Total				
			Activity 20 Sub Total	
			Parts:	0.00
			Labor:	0.00
			Labor Hours:	0.02
			Sublet Parts:	0.00
			Sublet Labor:	0.00
			Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 6



Work Order No. 55480015
Invoice No. 55345 - 55480015

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
VEHICLE HAS SCRATCHES ON LEFT SIDE AREA		Ford E450 Champion Challenger	
Requested By:	CVERGARA	Status:	40 - Closed (40)
Created By:	CVERGARA	Priority:	-
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	290,533 - DH

Activity Header					
Activity: 30 002/011/003 BELT & RETAINER, SEAT					
Activity Note: DRIVER' SEAT CUSHIONG AND COVER NEEDS REPLACEMENT					
Reason for Repair: 05 Inspection, Routine					
Work Accomplished:					
Part Failure:					
Activity Comments:					
Activity Parts					
No Data Available					
Activity Labor					
Booked Date	Technician	Hours	Shop Rate	Extended	
31-Mar-22	RONALD JOHNSON	1.75	0	0	
15-Apr-22	RONALD JOHNSON	1.58	0	0	
15-Apr-22	RONALD JOHNSON	0.02	0	0	
Activity Sublet					
No Data Available					
Activity Checklist					
No Data Available					
No Data Available					
Activity Sub Total					
			Activity 30 Sub Total		
			Parts:	0.00	
			Labor:	0.00	
			Labor Hours:	3.35	
			Sublet Parts:	0.00	
			Sublet Labor:	0.00	
			Activity Sub Total	0.00	



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 4 of 6



Work Order No. 55480015
Invoice No. 55345 - 55480015

Client Department:

Department: 55345M
Work Order Description
VEHICLE HAS SCRATCHES ON LEFT SIDE AREA
Requested By: CVERGARA
Created By: CVERGARA
Assigned To:
Class: WO - WORK ORDER
Arrangement: Unassigned
Potential Warranty: No

Equipment No.: 4514-P
VIN: 1FDFE4FS7EDB17176
Ford E450 Champion Challenger
Status: 40 - Closed (40)
Priority: -
Driver:
Phone:
ETA:
Meter: 290,533 - DH

Activity Header				
Activity:40 017/001/000 TIRE, PNEUMATIC				
Activity Note: FRONT TIRES REPLACED				
Reason for Repair: 08 Preventive Maintenance				
Work Accomplished:				
Part Failure:				
Activity Comments:				
Activity Parts				
No Data Available				
Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
31-Mar-22	RONALD JOHNSON	1	0	0
Activity Sublet				
No Data Available				
Activity Checklist				
No Data Available				
No Data Available				
Activity Sub Total				
			Activity 40 Sub Total	
			Parts:	0.00
			Labor:	0.00
			Labor Hours:	1.00
			Sublet Parts:	0.00
			Sublet Labor:	0.00
			Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 5 of 6



Work Order No. 55480015
Invoice No. 55345 - 55480015

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
VEHICLE HAS SCRATCHES ON LEFT SIDE AREA		Ford E450 Champion Challenger	
Requested By:	CVERGARA	Status:	40 - Closed (40)
Created By:	CVERGARA	Priority:	-
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	290,533 - DH

Activity Header				
Activity:50 031/001/001 ALTERNATOR				
Activity Note: CHECK BATTERIES AND CHARGING SYSTEM				
Reason for Repair: 04 Driver's Report				
Work Accomplished:				
Part Failure:				
Activity Comments:				
Activity Parts				
No Data Available				
Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
25-Apr-22	NELSON PIERRE-LOUIS	1.5	0	0
Activity Sublet				
No Data Available				
Activity Checklist				
No Data Available				
No Data Available				
Activity Sub Total				
			Activity 50 Sub Total	
			Parts:	0.00
			Labor:	0.00
			Labor Hours:	1.50
			Sublet Parts:	0.00
			Sublet Labor:	0.00
			Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 6 of 6



Work Order No. 55480015
Invoice No. 55345 - 55480015

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
VEHICLE HAS SCRATCHES ON LEFT SIDE AREA		Ford E450 Champion Challenger	
Requested By:	CVERGARA	Status:	40 - Closed (40)
Created By:	CVERGARA	Priority:	-
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	290,533 - DH

Activity Header
Activity:60 001/001/082 MOTOR, BLOWER
Activity Note: FRONT AC BLOWER MOTOR RESISTOR
Reason for Repair: 05 Inspection, Routine
Work Accomplished:
Part Failure:
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
25-Apr-22	PT766	CONNECTOR, RESISTOR, MOTOR, BLOWER	1	13.65	13.65
27-May-22	YH-1697	RESISTOR, MOTOR, BLOWER, HEATER SAME AS 4C2Z-19A706-AA	1	19.3	19.3

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
25-Apr-22	NELSON PIERRE-LOUIS	1.42	0	0

Activity Sublet
No Data Available


Activity Checklist
No Data Available
No Data Available

Activity Sub Total	
Activity 60 Sub Total	
Parts:	32.95
Labor:	0.00
Labor Hours:	1.42
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	32.95

Work Order Footer	
Work Order 55480015 Total	
Parts:	303.47
Labor:	0.00
Labor Hours:	9.33
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	303.47



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 55552749
Invoice No. 55345 - 55552749

Client Department:

Department: 55345M

Work Order Description

Road Call front tire flat

Requested By: CVERGARA

Created By: CVERGARA

Assigned To:

Class: WORC - WORK ORDER ROAD CALL

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 3 - High

Driver:

Phone:

ETA:

Meter: 294,439 - DH

Chronology

Reported	Apr 26, 2022 9:19:00 AM	Apr 26, 2022 9:19:00 AM
Started	Apr 26, 2022 9:21:00 AM	
Completed	Apr 26, 2022 12:21:00 PM	Apr 26, 2022 12:21:00 PM
Down Time		

Work Order Notes

Line 10 To file warranty be sure to do the following:

- 1) Enter a COMPLAINT statement for each activity.
- 2) Enter CAUSE statement in the Notes field of each activity.
- 3) Enter CORRECTION statement in the Comment section of each activity.

Complaint: Driver stated that Left front tire flat and damage

Cause: Nail in tire

Correction: replaced left front tire with a new one

Activity Header

Activity: 5 999 TOTAL VEHICLE

Activity Note: PRAMETER

Reason for Repair: SW Shop Work Order

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: PRAMETER

Task: PRA and Meter Readings Performed by: TDELVA Performed on: 26-APR-22

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		TDELVA	Apr 26, 2022 10:54:52 AM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		TDELVA	Apr 26, 2022 10:54:52 AM	No	
4 - Are you wearing the appropriate PPE?	Done		TDELVA	Apr 26, 2022 10:54:52 AM	No	
7 - Have you performed the proper LOTO?	Done		TDELVA	Apr 26, 2022	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
				10:54:52 AM		
10 - Are you aware of the potential risks of performing this repair?	Done		TDELVA	Apr 26, 2022 10:54:52 AM	No	
11 - Have you successfully completed the Personal Risk Assessment?	Done		TDELVA	Apr 26, 2022 10:54:52 AM	No	

Activity Sub Total

Activity 5 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 55552749
Invoice No. 55345 - 55552749

Client Department:

Department: 55345M

Work Order Description

Road Call front tire flat

Requested By: CVERGARA

Created By: CVERGARA

Assigned To:

Class: WORC - WORK ORDER ROAD CALL

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 3 - High

Driver:

Phone:

ETA:

Meter: 294,439 - DH

Activity Header

Activity: 10 999 TOTAL VEHICLE

Activity Note: ROAD CALL

Reason for Repair: 10 Road Call

Work Accomplished:

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
26-Apr-22	192659	TIRE, LT225/75R16, R500 HD, BSW, E/10PR, DURAVIS, BRIDGESTONE	1	135.26	135.26

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
26-Apr-22	Rodriguez,Raul	1.7833333	0	0
26-Apr-22	Delva,Terry	1.53	0	0

Activity Sublet

No Data Available

Activity Checklist

No Data Available

No Data Available

Activity Sub Total

Activity 10 Sub Total

Parts:	135.26
Labor:	0.00
Labor Hours:	3.31
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	135.26

Work Order Footer

Work Order 55552749 Total

Parts:	135.26
Labor:	0.00
Labor Hours:	3.31
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	135.26



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 55522415
Invoice No. 55345 - 55522415

Client Department:
Department: 55345M
Work Order Description
FOLLOWUP-FT Light Duty
Requested By: DARTHURS
Created By: DARTHURS
Assigned To:
Class: -
Arrangement: Unassigned
Potential Warranty: No
Equipment No.: 4514-P
VIN: 1FDFE4FS7EDB17176
Ford E450 Champion Challenger
Status: 40 - Closed (40)
Priority: 3 - High
Driver:
Phone:
ETA:
Meter: 292,927 - DH

Chronology		
Reported	Apr 14, 2022 11:07:00 PM	Apr 14, 2022 11:07:00 PM
Started	Apr 14, 2022 11:30:00 PM	
Completed	Apr 15, 2022 7:35:00 PM	Apr 15, 2022 7:35:00 PM
Down Time		

Work Order Notes

Line 10 Remove & Replace R/R Hub Seal & Right Side Emergency Brake Shoes. Replace L/R hub Seal.Remove & Replace both Rear Rotor Replace & Replace Left Side Emergency brakes ,Replace Rear brakes
parts # 8C2Z-2648-A Qty (1)
Parts #BRS179 Qty (2)
parts #8C2Z-2C026-B Qty (2)
parts 8C2Z-2200-B Qty(1)

Activity Header
Activity:10 018/002/046 HUB, AXLE, DRIVE, PREADJUSTED
Activity Note: R/R hub seal leaking
Reason for Repair: FW Follow Up
Work Accomplished:
Part Failure:
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
15-Apr-22	8C2Z-2648-A	SHOE, BRAKE, PARKING	1	36.72	36.72
15-Apr-22	BRS179	SEAL, WHEEL, REAR, E450	1	11.41	11.41
20-Apr-22	BRS179	SEAL, WHEEL, REAR, E450	1	6.79	6.79

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
15-Apr-22	Arthurs,Durvin	0.47	0	0
14-Apr-22	Arthurs,Durvin	0.5	0	0

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available

Activity Sub Total													
<table><tr><th colspan="2">Activity 10 Sub Total</th></tr><tr><td>Parts:</td><td>54.92</td></tr><tr><td>Labor:</td><td>0.00</td></tr><tr><td>Labor Hours:</td><td>0.97</td></tr><tr><td>Sublet Parts:</td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td>0.00</td></tr></table>		Activity 10 Sub Total		Parts:	54.92	Labor:	0.00	Labor Hours:	0.97	Sublet Parts:	0.00	Sublet Labor:	0.00
Activity 10 Sub Total													
Parts:	54.92												
Labor:	0.00												
Labor Hours:	0.97												
Sublet Parts:	0.00												
Sublet Labor:	0.00												

	Activity Sub Total	54.92
--	---------------------------	--------------



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 55522415
Invoice No. 55345 - 55522415

Client Department:
Department: 55345M
Work Order Description
FOLLOWUP-FT Light Duty
Requested By: DARTHURS
Created By: DARTHURS
Assigned To:
Class: -
Arrangement: Unassigned
Potential Warranty: No
Equipment No.: 4514-P
VIN: 1FDFE4FS7EDB17176
Ford E450 Champion Challenger
Status: 40 - Closed (40)
Priority: 3 - High
Driver:
Phone:
ETA:
Meter: 292,927 - DH

Activity Header
Activity: 20 013/002/012 SHOE & LINING, BRAKE, REAR
Activity Note: Rear Brakes
Reason for Repair: FW Follow Up
Work Accomplished:
Part Failure:
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
15-Apr-22	8C2Z-2200-B	PADS, BRAKE, DISC, REAR, E450 SAME AS PFH133020	1	53.13	53.13
15-Apr-22	8C2Z-2C026-B	ROTOR, BRAKE, DISC, REAR, E450	2	135.45	270.9

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
15-Apr-22	Arthurs,Durvin	3.2	0	0

Activity Sublet
No Data Available


Activity Checklist
No Data Available
No Data Available

Activity Sub Total	
Activity 20 Sub Total	
Parts:	324.03
Labor:	0.00
Labor Hours:	3.20
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	324.03

Work Order Footer	
Work Order 55522415 Total	
Parts:	378.95
Labor:	0.00
Labor Hours:	4.17
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	378.95



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 55428153
Invoice No. 55345 - 55428153

Client Department:

Department: 55345M

Work Order Description

55345-LIGHT DUTY PMA

Requested By: DARTHURS

Created By: DARTHURS

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 3 - High

Driver:

Phone:

ETA:

Meter: 292,927 - DH

Chronology

Reported	Apr 12, 2022 12:00:00 AM	Apr 12, 2022 12:00:00 AM
Started	Apr 14, 2022 4:32:00 PM	
Completed	Apr 14, 2022 11:30:00 PM	Apr 14, 2022 11:30:00 PM
Down Time		

Work Order Notes

Line 10 COMPLAINT: Perform PMA Service.

CAUSE: Service due by Mileage

CORRECTION: Change Oil & Filter. Lube all Pivoting Points. Check brakes . Clean battery. Replace A/C filter.Remove Swheel to check brakes. Replace Oil drain Plugs.

parts # B329 Qty (1)

oil 5W30 Qty (7.0) Qt

Activity Header

Activity:5 999/999/999 TOTAL VEHICLE

Activity Note: PERSONAL RISK ASSESSMENT

Reason for Repair: SW Shop Work Order

Work Accomplished: 06 Inspect

Part Failure: 00 No Failure

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
14-Apr-22	B329	FILTER, OIL, SPIN-ON SEE P550965	1	1.99	1.99

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: PERSONAL RISK ASSESSMENT

Task: PRA and Meter Readings Performed by: DARTHURS Performed on: 14-APR-22

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		DARTHURS	Apr 14, 2022 11:10:20 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		DARTHURS	Apr 14, 2022 11:10:20 PM	No	
4 - Are you wearing the appropriate PPE?	Done		DARTHURS	Apr 14, 2022 11:10:20 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
7 - Have you performed the proper LOTO?	Done		DARTHURS	Apr 14, 2022 11:10:20 PM	No	
10 - Are you aware of the potential risks of performing this repair?	Done		DARTHURS	Apr 14, 2022 11:10:20 PM	No	
11 - Have you successfully completed the Personal Risk Assessment?	Done		DARTHURS	Apr 14, 2022 11:10:20 PM	No	


Activity Sub Total

Activity 5 Sub Total

Parts:	1.99
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	1.99



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 55428153
Invoice No. 55345 - 55428153

Client Department:

Department: 55345M

Work Order Description

55345-LIGHT DUTY PMA

Requested By: DARTHURS

Created By: DARTHURS

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 3 - High

Driver:

Phone:

ETA:

Meter: 292,927 - DH

Activity Header

Activity: 10 079 DEVICES, SAFETY/STABILITY, TRAILER

Activity Note: Light Duty PMI

Reason for Repair: 05 Inspection, Routine

Work Accomplished:

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
14-Apr-22	Arthurs,Durvin	1.6	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: Light Duty PMI

Task: First Transit North America Light Duty PM Inspection Sheet Performed by: DARTHURS Performed on: 14-APR-22

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,000 - SECTION 1 - Preparation Inspection	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
10,100 - INSPECT_Auto-Transmission Operation/Controller; Neutral Safety Switch	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
10,200 - !FRA!INSPECT_Starter Operation	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
10,300 - !FRA!INSPECT_Warning Lights and Alarms	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
10,400 - !FRA!INSPECT_Back Up Alarm	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
10,500 - !FRA!INSPECT_Engine Operation, OBSERVE_Exhaust for Excessive Smoke	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
10,600 - Check Driver's Pre-trip or DVIR/EVIR & Authorization Forms	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
10,700 - INSPECT_All Exterior Lights (Turn on until Completion of this section)	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
10,800 - *RPT*INSPECT_Body Damage, Corrosion;DOCUMENT_Issues	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
10,900 - INSPECT_Fuel Tank Cap, and Doors	Done		DARTHURS	Apr 14, 2022	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
				11:06:49 PM		
11,100 - INSPECT_License Plate, Bracket, Bumpers	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
20,000 - SECTION 2 - Test Drive and Operator Area Inspection	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
20,100 - INSPECT_Driver Seat condition/operation/seatbelt	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
20,200 - TEST DRIVE_INSPECT_Proper Operation; Drive into Shop	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
20,300 - *RPT*INSPECT_Steering Wheel for Play/Bind/Horn Op./Turn Signal Cancelation	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
20,400 - PERFORM_Brake Test (Apply hard enough to check wheel pull and Application)	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
20,500 - *RPT*FRA INSPECT_Lighting/Operation of all Gauges	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
20,600 - *RPT*INSPECT_Windshields, Sun Visors	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
20,700 - INSPECT_Wiper/Washer Operation, Condition	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
20,800 - INSPECT_High Idle Control	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
20,900 - *RPT*!FRA!INSPECT_HVAC Controls, Operation	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
21,000 - *RPT*!FRA!INSPECT_Operation of all Switches and Accessories	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
21,100 - INSPECT_Parking Brake Operation	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
21,200 - !FRA!TEST_Service Brake Backup System (Stationary Brake Tests HYD)	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
21,300 - INSPECT_VIN, Tire Pressure Decal, Data Tags	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
21,400 - *RPT*INSPECT_Drivers Door Hinges, Handles, Controls and Panels	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
21,500 - !FRA!INSPECT_Under Dash Wiring for Proper Routing/Chafing/Securement	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
21,550 - INSPECT_Driver Floor Area for Rust/Water Leaks	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
21,600 - *RPT*INSPECT for WEAR_Pedal Pads, Accelerator, Brake, Parking Brake	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
21,700 - INSPECT_Engine Fault Codes	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
30,000 - SECTION 3 - EXTERIOR INSPECTION - Front	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
31,000 - SSF (Street Side Front)	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
31,010 - *RPT*!FRA!INSPECT_Mirror Mountings, Brackets, Glass	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
31,020 - *RPT*INSPECT_FRONT Springs, Shocks, Spring Shackles	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
31,030 - INSPECT_Mud Flaps, Brackets	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
31,040 - INSPECT_Wiper Blades, Arms	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
32,000 - Engine Inspection	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
32,010 - INSPECT_Hood, Springs and Props	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
32,020 - !FRA!INSPECT_Engine Compartment Condition for Fire Risk Avoidance	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
32,030 - !FRA!INSPECT_for Fluid Leaks, Levels	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
32,040 - !FRA!INSPECT_Hyd_Brake Fluid with Test Strips	-	NA	DARTHURS	Apr 14, 2022 11:06:49 PM	No	
32,050 - !FRA!INSPECT_RECORD_Coolant Recovery with Refractometer; Test Strips	Degree Fahrenheit	NA	DARTHURS	Apr 14, 2022 11:06:49 PM	No	
32,060 - PRESSURE TEST_Cooling Systems (Radiator, Cap, hoses and clamps)	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
32,070 - *RPT*INSPECT_Radiator and Mountings, Cores	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
32,080 - *RPT*INSPECT_Fan Assembly, Shroud, Tensioner, Belts, All Belt Driven Components	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
32,090 - *RPT*!FRA!INSPECT_Mounting, Installation of Alternator, AC Compressor	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
32,100 - INSPECT_Intake System	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
32,140 - *RPT*!FRA!RECORD_Underhood Battery Voltages (volts)	0 Volt*		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
33,010 - CSF (Curb Side Front)	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
33,020 - *RPT*!FRA!INSPECT_Mirror Mountings, Brackets, Glass	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
33,030 - *RPT*INSPECT_FRONT Springs, Shocks, Spring Shackles	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
33,040 - INSPECT_Mud Flaps, Brackets	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
33,050 - INSPECT_Wiper Blades, Arms	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
33,060 - !FRA!INSPECT_LUBE_Battery Box, Batteries, Tray Slides, Hold Downs	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
33,070 - *RPT*!FRA!RECORD_Side Mounted Battery Voltages (volts)	13.96 Volt*		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
33,070 - *RPT*!FRA!RECORD_Side Mounted Battery Voltages (volts)	1396 Volt*		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
33,080 - INSPECT_Entry door, OPEN_with external lock/switch (if equipped)	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
40,000 - SECTION 4 - Interior Inspection	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
40,100 - *RPT*INSPECT_Step-Well, Step-Tread, Hand Rails, Step-well Light	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
40,200 - INSPECT_Insurance/Registration/Regulatory Forms Dates	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
40,250 - INSPECT_Overhead Compartment for	Done		DARTHURS	Apr 14, 2022	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
Water Leaks				11:06:49 PM		
40,300 - INSPECT_Safety Equipment, Fire Extinguisher/Suppression	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
40,400 - INSPECT_Camera Systems, Filter, Electrical Inputs/Outputs-SOP M038	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
40,600 - !FRA!CHECK for HOTSPOTS_ Interior Elec Panel Fuses/Circuit Breakers/Connectors	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
40,700 - *RPT*INSPECT_Seats, Covering, Belts, Loose Cushions, Operation	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
40,800 - *RPT*!FRA!INSPECT_Interior Lights; Mirrors	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
40,900 - !FRA!INSPECT_Interior Cleanliness/Potential Projectiles	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
41,000 - INSPECT_All ADA Equip (Lift Seat Belt, floor hold Downs, Belts, Cover, Alarms)	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
41,100 - INSPECT_CLEAN_AC Filter	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
41,200 - INSPECT_Emergency Windows,Hatches,Doors,Alarms/Lights;CHECK_for Leaks	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
41,300 - *RPT*INSPECT_Interior Body, Floor, Stanchions	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
41,400 - *RPT*INSPECT_Passenger Doors, Glass, Seal	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
50,000 - SECTION 5 - UNDER VEHICLE INSPECTION	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
50,100 - *RPT*INSPECT_Steering components-Drag Link, Tie Rods ends and Steering Damper	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
50,200 - INSPECT_Ball Joint Play	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
50,300 - !FRA!INSPECT_Front Wheel Bearings for Play	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
50,400 - LUBE_All Chassis Components	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
50,500 - !FRA!CHANGE_Engine oil,filters	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
50,700 - INSPECT_Tire Condition	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
50,800 - INSPECT_Tire Valve Stems, Double Check Caps	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
50,900 - !FRA!INSPECT_Wheels for Cracks, Loose Lugs/Indicators, Outer Hub Leaks	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
51,000 - RECORD_LF-Tire Tread Depth (32nds)	12 32nds of an inch		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
51,100 - RECORD_LF-Tire Air Pressure (psi)	70 Pounds per Square Inch		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
51,200 - RECORD_RF-Tire Tread Depth (32nds)	12 32nds of an inch		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
51,300 - RECORD_RF-Air Pressure (psi)	70 Pounds per Square Inch		DARTHURS	Apr 14, 2022 11:06:49 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
51,400 - !FRA!INSPECT_FRONT ABS Tone Rings, Sensors, Routing of Cables	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
51,500 - !FRA!INSPECT_Wheel Seals for Leaks	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
51,600 - !FRA!INSPECT_Front Brake Assemblies	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
51,700 - MEASURE_RECORD_LF - Brake Lining, Pad Thickness (32nds)	11 32nds of an inch		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
51,800 - MEASURE_RECORD_RF - Brake Lining, Pad Thickness (32nds)	11 32nds of an inch		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
51,900 - INSPECT VISUALLY_RECORD_LF Rotor Condition (inches)	1.554 Inch		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
52,000 - INSPECT VISUALLY_RECORD_RF Rotor Condition (inches)	1.554 Inch		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
52,100 - INSPECT_Vibration Damper	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
52,200 - !FRA!INSPECT_Battery Cable Routing from Battery Box to Starter	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
52,400 - !FRA!INSPECT_Starter Mounting	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
52,500 - !FRA!INSPECT_Engine Exhaust System	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
52,700 - INSPECT_Engine, Transmission Mounts	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
52,800 - !FRA!INSPECT_Engine, Transmission for Fluid Leaks	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
52,900 - INSPECT_Shift Cable Adjustment - All Transmissions	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
53,000 - !FRA!INSPECT_Transmission Breather and Clean	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
53,100 - *RPT*!FRA!INSPECT_Parking Brake Cables, Shoes for Wear, Contamination	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
53,200 - *RPT*INSPECT_A/C Condensor, Fans, Safety Grills	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
53,300 - *RPT*INSPECT_Driveline, Hanger Bearings, U-Joints, Slip Joints, Safety Loop	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
53,400 - *RPT*INSPECT_All Body Mounts and Chassis Frame for Corrosion, Cracks	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
53,500 - !FRA!INSPECT_Fuel Tank, Mountings, Lines	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
53,600 - INSPECT_Tire Condition	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
53,700 - INSPECT_Tire Valve Stems, Double Check Caps	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
53,800 - INSPECT_Mismatched Tire Tread, Casing Design	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
53,900 - INSPECT_Dual Mating Tires w/Square	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
54,000 - !FRA!INSPECT_Wheels for Cracks, Loose Lugs/Indicators, Outer Hub Leaks	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
54,100 - INSPECT_Mud Flaps, Brackets	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
54,200 - RECORD_RRO-Tire Tread Depth (32nds)	5 32nds of an inch		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
54,300 - RECORD_RRI-Tire Tread Depth (32nds)	5 32nds of an inch		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
54,400 - RECORD_RRO-Air Pressure (psi)	65 Pounds per Square Inch		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
54,500 - RECORD_RRI-Air Pressure (psi)	65 Pounds per Square Inch		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
54,600 - RECORD_LRO-Tire Tread Depth (32nds)	5 32nds of an inch		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
54,700 - RECORD_LRI-Tire Tread Depth (32nds)	5 32nds of an inch		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
54,800 - RECORD_LRO-Air Pressure (psi)	65 Pounds per Square Inch		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
54,900 - RECORD_LRI-Air Pressure (psi)	65 Pounds per Square Inch		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
55,000 - !FRA!INSPECT_ REAR Brake Assemblies	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
55,100 - !FRA!INSPECT_ REAR Hubs, Wheel Seals for Oil Leaks	-	R/R hub seal leaking	DARTHURS	Apr 14, 2022 11:06:49 PM	Yes	55522415
55,200 - !FRA!INSPECT_ REAR ABS Tone Rings, Sensors, Routing Of Cables (if equipped)	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
55,300 - MEASURE_RECORD_LR - Brake Lining, Pad Thickness (32nds)	3 32nds of an inch	Rear Brakes	DARTHURS	Apr 14, 2022 11:06:49 PM	Yes	55522415
55,400 - MEASURE_RECORD_RR - Brake Lining, Pad Thickness (32nds)	4 32nds of an inch		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
55,500 - INSPECT VISUALLY_MEASURE_RECORD_LR Drum, Rotor Condition (inches)	1.654 Inch		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
55,600 - INSPECT VISUALLY_MEASURE_RECORD_RR Drum, Rotor Condition (inches)	1.654 Inch		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
55,700 - !FRA!INSPECT_ Under Body Exhaust System	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
55,800 - *RPT*INSPECT_ REAR Axle Housing, Breather; CLEAN_Breather	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
55,900 - *RPT*INSPECT_ REAR Springs, Shocks, Suspension, Airbags	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
60,000 - SECTION 6 - Wheelchair Inspection	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
60,100 - RECORD_Wheelchair Cycle Count	14035 Cycles		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
60,200 - CHECK_Lift Access Door for Ease of Opening,Latch Security,Door Hold Back	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
60,300 - CHECK_Platform Emergency Release Mechanism for Ease of Operation	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
60,400 - OPERATE_Lift thru Complete Cycle;CHECK_Noises,Jerky Op,Too Fast-Slow,Drift Down	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
60,500 - INSPECT_ Bridgeplate Operation	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
60,600 - INSPECT_All Pivot Points for Wear and Looseness	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
60,700 - INSPECT_Rollers for Wear and Smooth Rotation	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
60,800 - INSPECT_Operation of Platform Barrier Mechanism	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
60,900 - INSPECT_Cam Slots for Wear and Proper Alignment	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
61,000 - INSPECT_Cable Condition (If Applicable)	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
61,100 - INSPECT_Hydraulic Hoses for Leaks, Chafing or Cracks	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
61,200 - INSPECT_Electrical Connections and Routing of Wires and Cables	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
61,300 - INSPECT_Operation and Adjustment of All Safety Switches	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
61,400 - INSPECT_All Lift Mounting Brackets for Loose Bolts Broken Welds, etc.	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
61,500 - INSPECT_Manual Back-up Raise/Lower System (If Applicable)	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
61,600 - INSPECT_HydrPump Reservoir Oil Level. Consult SvcManual for Fluid to Use.	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
61,700 - CHECK_Operator Decals for Proper Positioning;CONSULT_Service Manual	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
61,800 - CHECK_WC Holddowns Inside Vehicle for Secure Mounting,Proper Operation	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
61,900 - CLEAN_Linkages and Mechanisms	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
62,000 - LUBRICATE_Linkages and Mechanisms (DO NOT OVER Lubricate)	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
62,100 - INSPECT_Emergency Platform Release Mechanism	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
62,200 - INSPECT_Platform Barrier Latch Mechanism	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
62,300 - INSPECT_Bridgeplate Hinge	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
62,400 - INSPECT_All Pivot Points	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
62,500 - INSPECT_Cams and Slots	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
62,600 - INSPECT_Rollers	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
62,700 - INSPECT_All Linkages	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
70,000 - SECTION 7 - ALTERNATIVE FUELS INSPECTION	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
70,300 - INSPECT_Condition of Fuel Pressure Gauge	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
70,400 - PROVIDE PROOF_Tank_Dents/Scratches and Re-Certification	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
70,500 - INSPECT_Tank test date, labels-Reference-ST.4 FMMVSS 304 & ANSI-CSA NGV2	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
70,600 - INSPECT_Tank Lines to Ensure Secure Mounting, Insulation Against Vibration	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
70,700 - INSPECT_Filling Nozzle for Securely Fitting Cap	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
70,800 - INSPECT_Pressure Relief Device's Venting System, Valves, Ducting to MNFR Specs	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
80,000 - SECTION 8 - PMI Report Completion	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
80,100 - COMPLETE_PM Report; Follow-ups	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	
80,200 - RETURN_Vehicle to Predetermined Location	Done		DARTHURS	Apr 14, 2022 11:06:49 PM	No	

Activity Sub Total

Activity 10 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	1.60
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00

Activity 20 Sub Total	
Parts:	0.00
Labor:	0.00

	Labor Hours:	0.37
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	0.00
Work Order Footer		
	Work Order 55428153 Total	
	Parts:	1.99
	Labor:	0.00
	Labor Hours:	1.97
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	1.99



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 55503344
Invoice No. 55345 - 55503344

Client Department:

Department: 55345M

Work Order Description

PER PTC COORDINATOR DRIVE CAM NOT RECORDING

Requested By: CVERGARA

Created By: CVERGARA

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: -

Driver:

Phone:

ETA:

Meter: 291,737 - DH

Chronology		
Reported	Apr 8, 2022 8:35:00 AM	Apr 8, 2022 8:35:00 AM
Started	Apr 10, 2022 12:00:00 AM	
Completed	Apr 10, 2022 6:37:00 PM	Apr 10, 2022 6:37:00 PM
Down Time		

Work Order Notes

Line 10 complaint: PTC camera is Not recording

Cause: Hard-drive not fully inserted in

correction: fully inserted Hard-drive and reset device..?
its recording at this time

Activity Header						
Activity: 10 999/999/999 TOTAL VEHICLE						
Activity Note:						
Reason for Repair:		SW Shop Work Order				
Work Accomplished:		06 Inspect				
Part Failure:		00 No Failure				
Activity Comments:						
Activity Parts						
No Data Available						
Activity Labor						
No Data Available						
Activity Sublet						
No Data Available						
Activity Checklist						
Check List						
10 Desc:						
Task: PRA and Meter Readings Performed by: TDELVA Performed on: 10-APR-22						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		TDELVA	Apr 10, 2022 6:37:16 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		TDELVA	Apr 10, 2022 6:37:16 PM	No	
4 - Are you wearing the appropriate PPE?	Done		TDELVA	Apr 10, 2022 6:37:16 PM	No	
7 - Have you performed the proper LOTO?	Done		TDELVA	Apr 10, 2022 6:37:16 PM	No	
10 - Are you aware of the potential risks of performing this repair?	Done		TDELVA	Apr 10, 2022 6:37:16 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO	
11 - Have you successfully completed the Personal Risk Assessment?	Done		TDELVA	Apr 10, 2022 6:37:16 PM	No		
Activity Sub Total							
				Activity 10 Sub Total			
				Parts:			0.00
				Labor:			0.00
				Labor Hours:			0.00
				Sublet Parts:			0.00
				Sublet Labor:			0.00
				Activity Sub Total			0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 55503344
Invoice No. 55345 - 55503344

Client Department:

Department: 55345M

Work Order Description

PER PTC COORDINATOR DRIVE CAM NOT RECORDING

Requested By: CVERGARA

Created By: CVERGARA

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: -

Driver:

Phone:

ETA:

Meter: 291,737 - DH

Activity Header

Activity: 20 036/008/002 CAMERA, SYSTEM, SURVEILLANCE

Activity Note:

Reason for Repair: 05 Inspection, Routine

Work Accomplished:

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
10-Apr-22	Delva, Terry	0.1666666	0	0

Activity Sublet

No Data Available

Activity Checklist

No Data Available

No Data Available

Activity Sub Total

Activity 20 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	0.17
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00


Work Order Footer

Work Order 55503344 Total

Parts:	0.00
Labor:	0.00
Labor Hours:	0.17
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 55463052
Invoice No. 55345 - 55463052

Client Department:

Department: 55345M

Work Order Description

Replace Driver Side Head Light/ No start

Requested By: AOWENS

Created By: AOWENS

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 289,576 - DH

Chronology

Reported	Mar 24, 2022 11:26:00 PM	Mar 24, 2022 11:26:00 PM
Started	Mar 24, 2022 11:29:00 PM	
Completed	Apr 5, 2022 11:20:00 PM	Apr 5, 2022 11:20:00 PM
Down Time		

Work Order Notes

Line 10 To file warranty be sure to do the following:

- 1) Enter a COMPLAINT statement for each activity.
- 2) Enter CAUSE statement in the Notes field of each activity.
- 3) Enter CORRECTION statement in the Comment section of each activity.

Complaint: Vehicle not starting.

Cause: Suspect no fuel in rails.

Correction: Cycled key to KOEO position 10 times to prime fuel lines. Vehicle started up and idled 20 min without any issues. Road tested vehicle without any issues.

Line 20 Replaced 1 headlight bulb.

Activity Header
Activity: 5 999 TOTAL VEHICLE
Activity Note: Personal Risk Assessment
Reason for Repair: SW Shop Work Order
Work Accomplished: 06 Inspect
Part Failure:
Activity Comments:
Activity Parts
No Data Available
Activity Labor
No Data Available
Activity Sublet
No Data Available
Activity Checklist
Check List
5 Desc: Personal Risk Assessment Task: PRA and Meter Readings Performed by: EARJOHNSON Performed on: 05-APR-22

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		EARJOHNSON	Apr 5, 2022 9:29:05 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		EARJOHNSON	Apr 5, 2022 9:29:05 PM	No	
4 - Are you wearing the appropriate PPE?	Done		EARJOHNSON	Apr 5, 2022 9:29:05 PM	No	
7 - Have you performed the proper LOTO?	Done		EARJOHNSON	Apr 5, 2022 9:29:05 PM	No	
10 - Are you aware of the potential risks of performing this repair?	Done		EARJOHNSON	Apr 5, 2022 9:29:05 PM	No	
11 - Have you successfully completed the Personal Risk Assessment?	Done		EARJOHNSON	Apr 5, 2022 9:29:05 PM	No	

Activity Sub Total

Activity 5 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 55463052
Invoice No. 55345 - 55463052

Client Department:

Department: 55345M

Work Order Description

Replace Driver Side Head Light/ No start

Requested By: AOWENS

Created By: AOWENS

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 289,576 - DH

Activity Header

Activity: 15 034/001/000 HEADLAMP

Activity Note: Replace Driver Side Head Light

Reason for Repair: 05 Inspection, Routine

Work Accomplished:

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
05-Apr-22	H13BP	BULB, HEADLAMP, HALOGEN	1	12.2	12.2

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

No Data Available

No Data Available

Activity Sub Total

Activity 15 Sub Total

Parts:	12.20
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	12.20



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 55463052
Invoice No. 55345 - 55463052

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Replace Driver Side Head Light/ No start		Ford E450 Champion Challenger	
Requested By:	AOWENS	Status:	40 - Closed (40)
Created By:	AOWENS	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	289,576 - DH

Activity Header				
Activity:25 032/001/001 BATTERY				
Activity Note: No Start				
Reason for Repair: 05 Inspection, Routine				
Work Accomplished:				
Part Failure:				
Activity Comments:				
Activity Parts				
No Data Available				
Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
05-Apr-22	Earl Johnson	1.85	0	0
Activity Sublet				
No Data Available				
Activity Checklist				
No Data Available				
No Data Available				
Activity Sub Total				
			Activity 25 Sub Total	
			Parts:	0.00
			Labor:	0.00
			Labor Hours:	1.85
			Sublet Parts:	0.00
			Sublet Labor:	0.00
			Activity Sub Total	0.00
Work Order Footer				
			Work Order 55463052 Total	
			Parts:	12.20
			Labor:	0.00
			Labor Hours:	1.85
			Sublet Parts:	0.00
			Sublet Labor:	0.00
			Activity Sub Total	12.20



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 55430097
Invoice No. 55345 - 55430097

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
HYDRO BOOSTER		Ford E450 Champion Challenger	
Requested By:	CVERGARA	Status:	40 - Closed (40)
Created By:	CVERGARA	Priority:	-
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	288,239 - DH

Chronology		
Reported	Mar 14, 2022 7:40:00 AM	Mar 14, 2022 7:40:00 AM
Started	Mar 14, 2022 7:42:00 AM	
Completed	Mar 18, 2022 1:16:00 PM	Mar 18, 2022 1:16:00 PM
Down Time		

Work Order Notes

Line 10 C: brake booster is leaking

C: inspect system found that return line quick connector is leaking

C: replaced line retest system ok at this time

part:
1 new line dc2z-3a714-a

Activity Header							
Activity:10 999/999/999 TOTAL VEHICLE							
Activity Note:							
Reason for Repair:		SW Shop Work Order					
Work Accomplished:		06 Inspect					
Part Failure:		00 No Failure					
Activity Comments:							
Activity Parts							
No Data Available							
Activity Labor							
No Data Available							
Activity Sublet							
No Data Available							
Activity Checklist							
Check List							
10 Desc:							
Task: PRA and Meter Readings Performed by: JAPEREZ Performed on: 18-MAR-22							
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO	
1 - Are you properly trained to perform the task?	Done		JAPEREZ	Mar 18, 2022 1:16:23 PM	No		
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		JAPEREZ	Mar 18, 2022 1:16:23 PM	No		
4 - Are you wearing the appropriate PPE?	Done		JAPEREZ	Mar 18, 2022 1:16:23 PM	No		
7 - Have you performed the proper LOTO?	Done		JAPEREZ	Mar 18, 2022 1:16:23 PM	No		

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO	
10 - Are you aware of the potential risks of performing this repair?	Done		JAPEREZ	Mar 18, 2022 1:16:23 PM	No		
11 - Have you successfully completed the Personal Risk Assessment?	Done		JAPEREZ	Mar 18, 2022 1:16:23 PM	No		
Activity Sub Total							
				Activity 10 Sub Total			
				Parts:			0.00
				Labor:			0.00
				Labor Hours:			0.00
				Sublet Parts:			0.00
				Sublet Labor:			0.00
				Activity Sub Total			0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 55430097
Invoice No. 55345 - 55430097

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
HYDRO BOOSTER		Ford E450 Champion Challenger	
Requested By:	CVERGARA	Status:	40 - Closed (40)
Created By:	CVERGARA	Priority:	-
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	288,239 - DH

Activity Header
Activity:20 013/000/000 BRAKES
Activity Note: hydrobooster leaking
Reason for Repair: 08 Preventive Maintenance
Work Accomplished:
Part Failure:
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
19-Mar-22	DC2Z-3A714-A	LINE, STEERING, POWER, E450	1	49.16	49.16

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
14-Mar-22	Perez,Javier	2.63	0	0
18-Mar-22	Perez,Javier	0.32	0	0
18-Mar-22	Perez,Javier	1.8	0	0

Activity Sublet
No Data Available


Activity Checklist
No Data Available
No Data Available

Activity Sub Total		Activity 20 Sub Total	
Parts:	49.16	Labor:	0.00
Labor Hours:	4.75	Sublet Parts:	0.00
Sublet Labor:	0.00	Sublet Labor:	0.00
Activity Sub Total		49.16	

Work Order Footer		Work Order 55430097 Total	
Parts:	49.16	Labor:	0.00
Labor Hours:	4.75	Sublet Parts:	0.00
Sublet Labor:	0.00	Sublet Labor:	0.00
Activity Sub Total		49.16	



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 1



Work Order No. 55428143
Invoice No. 55345 - 55428143

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
FOLLOWUP-FT Light Duty			Ford E450 Champion Challenger
Requested By:	DARTHURS	Status:	40 - Closed (40)
Created By:	DARTHURS	Priority:	3 - High
Assigned To:		Driver:	
Class:	-	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	288,239 - DH

Chronology

Reported	Mar 13, 2022 3:57:21 PM	Mar 13, 2022 3:57:21 PM
Started	Mar 13, 2022 5:05:00 PM	
Completed	Mar 13, 2022 6:09:00 PM	Mar 13, 2022 6:09:00 PM
Down Time		

Work Order Notes

Line 10 Front Brakes / Front Brakes Low & Slide pins frozen. remove Slide pin Clean Lube & Replace. Remove & Replace front brakes.
parts #8C2Z-2V001-D Qty (1)

Activity Header

Activity: 10 013/002/012 SHOE & LINING, BRAKE, REAR

Activity Note: Xfront Brake

Reason for Repair: FW Follow Up

Work Accomplished:

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
13-Mar-22	8C2Z-2V001-D	PADS, BRAKE, DISC, FRONT	1	56.82	56.82

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
13-Mar-22	Arthurs,Durvin	1.05	0	0

Activity Sublet

No Data Available

Activity Checklist

No Data Available

No Data Available

Activity Sub Total

Activity 10 Sub Total

Parts:	56.82
Labor:	0.00
Labor Hours:	1.05
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	56.82

Work Order Footer

Work Order 55428143 Total

Parts:	56.82
Labor:	0.00
Labor Hours:	1.05
Sublet Parts:	0.00

	Sublet Labor:	0.00
	Activity Sub Total	56.82



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 55321843
Invoice No. 55345 - 55321843

Client Department:

Department: 55345M

Work Order Description

55345-LIGHT DUTY PMA

Requested By: NPIERRE-LOUIS

Created By: NPIERRE-LOUIS

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FD4E4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 3 - High

Driver:

Phone:

ETA:

Meter: 288,239 - DH

Chronology

Reported	Mar 9, 2022 12:00:00 AM	Mar 9, 2022 12:00:00 AM
Started	Mar 13, 2022 1:42:00 PM	
Completed	Mar 13, 2022 4:22:00 PM	Mar 13, 2022 4:22:00 PM
Down Time		

Work Order Notes

Line 10 COMPLAINT: Perform PMA Service.

CAUSE: Service due by mileage..

CORRECTION: Change Oil & Filter. Lube all Pivoting Points .remove Wheels to Check brakes,hydro booster teaking need to replace.

parts # B329 Qty (1)

Oil 5W30 Qty (7.0)Qt,

Activity Header

Activity:5 999/999/999 TOTAL VEHICLE

Activity Note: PERSONAL RISK ASSESSMENT

Reason for Repair: SW Shop Work Order

Work Accomplished: 06 Inspect

Part Failure: 00 No Failure

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
13-Mar-22	B329	FILTER, OIL, SPIN-ON SEE P550965	1	1.99	1.99

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: PERSONAL RISK ASSESSMENT

Task: PRA and Meter Readings Performed by: DARTHURS Performed on: 13-MAR-22

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		DARTHURS	Mar 13, 2022 3:51:29 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		DARTHURS	Mar 13, 2022 3:51:29 PM	No	
4 - Are you wearing the appropriate PPE?	Done		DARTHURS	Mar 13, 2022 3:51:29 PM	No	
7 - Have you performed the proper LOTO?	Done		DARTHURS	Mar 13, 2022	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
				3:51:29 PM		
10 - Are you aware of the potential risks of performing this repair?	Done		DARTHURS	Mar 13, 2022 3:51:29 PM	No	
11 - Have you successfully completed the Personal Risk Assessment?	Done		DARTHURS	Mar 13, 2022 3:51:29 PM	No	

Activity Sub Total

Activity 5 Sub Total	
Parts:	1.99
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	1.99



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 55321843
Invoice No. 55345 - 55321843

Client Department:

Department: 55345M

Work Order Description

55345-LIGHT DUTY PMA

Requested By: NPIERRE-LOUIS

Created By: NPIERRE-LOUIS

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 3 - High

Driver:

Phone:

ETA:

Meter: 288,239 - DH

Activity Header

Activity: 10 079 DEVICES, SAFETY/STABILITY, TRAILER

Activity Note: Light Duty PMI

Reason for Repair: 05 Inspection, Routine

Work Accomplished:

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
13-Mar-22	Arthurs,Durvin	2.3	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: Light Duty PMI

Task: First Transit North America Light Duty PM Inspection Sheet Performed by: DARTHURS Performed on: 13-MAR-22

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,000 - SECTION 1 - Preparation Inspection	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
10,100 - INSPECT_Auto-Transmission Operation/Controller; Neutral Safety Switch	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
10,200 - !FRA!INSPECT_Starter Operation	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
10,300 - !FRA!INSPECT_Warning Lights and Alarms	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
10,400 - !FRA!INSPECT_Back Up Alarm	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
10,500 - !FRA!INSPECT_Engine Operation, OBSERVE_Exhaust for Excessive Smoke	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
10,600 - Check Driver's Pre-trip or DVIR/EVIR & Authorization Forms	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
10,700 - INSPECT_All Exterior Lights (Turn on until Completion of this section)	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
10,800 - *RPT*INSPECT_Body Damage, Corrosion;DOCUMENT_Issues	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
10,900 - INSPECT_Fuel Tank Cap, and Doors	Done		DARTHURS	Mar 13, 2022	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
				3:48:45 PM		
11,100 - INSPECT_License Plate, Bracket, Bumpers	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
20,000 - SECTION 2 - Test Drive and Operator Area Inspection	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
20,100 - INSPECT_Driver Seat condition/operation/seatbelt	Done	driver seat torn	DARTHURS	Mar 13, 2022 3:48:45 PM	No	
20,200 - TEST DRIVE_INSPECT_Proper Operation; Drive into Shop	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
20,300 - *RPT*INSPECT_Steering Wheel for Play/Bind/Horn Op./Turn Signal Cancelation	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
20,400 - PERFORM_Brake Test (Apply hard enough to check wheel pull and Application)	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
20,500 - *RPT*FRA INSPECT_Lighting/Operation of all Gauges	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
20,600 - *RPT*INSPECT_Windshields, Sun Visors	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
20,700 - INSPECT_Wiper/Washer Operation, Condition	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
20,800 - INSPECT_High Idle Control	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
20,900 - *RPT*!FRA!INSPECT_HVAC Controls, Operation	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
21,000 - *RPT*!FRA!INSPECT_Operation of all Switches and Accessories	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
21,100 - INSPECT_Parking Brake Operation	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
21,200 - !FRA!TEST_Service Brake Backup System (Stationary Brake Tests HYD)	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
21,300 - INSPECT_VIN, Tire Pressure Decal, Data Tags	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
21,400 - *RPT*INSPECT_Drivers Door Hinges, Handles, Controls and Panels	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
21,500 - !FRA!INSPECT_Under Dash Wiring for Proper Routing/Chafing/Securement	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
21,550 - INSPECT_Driver Floor Area for Rust/Water Leaks	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
21,600 - *RPT*INSPECT for WEAR_Pedal Pads, Accelerator, Brake, Parking Brake	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
21,700 - INSPECT_Engine Fault Codes	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
30,000 - SECTION 3 - EXTERIOR INSPECTION - Front	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
31,000 - SSF (Street Side Front)	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
31,010 - *RPT*!FRA!INSPECT_Mirror Mountings, Brackets, Glass	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
31,020 - *RPT*INSPECT_FRONT Springs, Shocks, Spring Shackles	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
31,030 - INSPECT_Mud Flaps, Brackets	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
31,040 - INSPECT_Wiper Blades, Arms	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
32,000 - Engine Inspection	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
32,010 - INSPECT_Hood, Springs and Props	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
32,020 - !FRA!INSPECT_Engine Compartment Condition for Fire Risk Avoidance	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
32,030 - !FRA!INSPECT_for Fluid Leaks, Levels	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
32,040 - !FRA!INSPECT_Hyd_Brake Fluid with Test Strips	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
32,050 - !FRA!INSPECT_RECORD_Coolant Recovery with Refractometer; Test Strips	Degree Fahrenheit	NA	DARTHURS	Mar 13, 2022 3:48:45 PM	No	
32,060 - PRESSURE TEST_Cooling Systems (Radiator, Cap, hoses and clamps)	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
32,070 - *RPT*INSPECT_Radiator and Mountings, Cores	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
32,080 - *RPT*INSPECT_Fan Assembly, Shroud, Tensioner, Belts, All Belt Driven Components	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
32,090 - *RPT*!FRA!INSPECT_Mounting, Installation of Alternator, AC Compressor	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
32,100 - INSPECT_Intake System	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
32,140 - *RPT*!FRA!RECORD_Underhood Battery Voltages (volts)	0 Volt*		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
33,010 - CSF (Curb Side Front)	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
33,020 - *RPT*!FRA!INSPECT_Mirror Mountings, Brackets, Glass	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
33,030 - *RPT*INSPECT_FRONT Springs, Shocks, Spring Shackles	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
33,040 - INSPECT_Mud Flaps, Brackets	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
33,050 - INSPECT_Wiper Blades, Arms	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
33,060 - !FRA!INSPECT_LUBE_Battery Box, Batteries, Tray Slides, Hold Downs	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
33,070 - *RPT*!FRA!RECORD_Side Mounted Battery Voltages (volts)	13.89 Volt*		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
33,080 - INSPECT_Entry door, OPEN_with external lock/switch (if equipped)	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
40,000 - SECTION 4 - Interior Inspection	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
40,100 - *RPT*INSPECT_Step-Well, Step-Tread, Hand Rails, Step-well Light	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
40,200 - INSPECT_Insurance/Registration/Regulatory Forms Dates	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
40,250 - INSPECT_Overhead Compartment for Water Leaks	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
40,300 - INSPECT_Safety Equipment, Fire	Done		DARTHURS	Mar 13, 2022	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
Extinguisher/Suppression				3:48:45 PM		
40,400 - INSPECT_Camera Systems, Filter, Electrical Inputs/Outputs-SOP M038	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
40,600 - !FRA!CHECK for HOTSPOTS_Interior Elec Panel Fuses/Circuit Breakers/Connectors	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
40,700 - *RPT*INSPECT_Seats, Covering, Belts, Loose Cushions, Operation	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
40,800 - *RPT*!FRA!INSPECT_Interior Lights; Mirrors	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
40,900 - !FRA!INSPECT_Interior Cleanliness/Potential Projectiles	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
41,000 - INSPECT_All ADA Equip (Lift Seat Belt, floor hold Downs, Belts, Cover, Alarms)	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
41,100 - INSPECT_CLEAN_AC Filter	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
41,200 - INSPECT_Emergency Windows,Hatches,Doors,Alarms/Lights;CHECK_for Leaks	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
41,300 - *RPT*INSPECT_Interior Body, Floor, Stanchions	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
41,400 - *RPT*INSPECT_Passenger Doors, Glass, Seal	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
50,000 - SECTION 5 - UNDER VEHICLE INSPECTION	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
50,100 - *RPT*INSPECT_Steering components-Drag Link, Tie Rods ends and Steering Damper	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
50,200 - INSPECT_Ball Joint Play	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
50,300 - !FRA!INSPECT_Front Wheel Bearings for Play	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
50,400 - LUBE_All Chassis Components	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
50,500 - !FRA!CHANGE_Engine oil,filters	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
50,700 - INSPECT_Tire Condition	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
50,800 - INSPECT_Tire Valve Stems, Double Check Caps	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
50,900 - !FRA!INSPECT_Wheels for Cracks, Loose Lugs/Indicators, Outer Hub Leaks	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
51,000 - RECORD_LF-Tire Tread Depth (32nds)	8 32nds of an inch		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
51,100 - RECORD_LF-Tire Air Pressure (psi)	70 Pounds per Square Inch		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
51,200 - RECORD_RF-Tire Tread Depth (32nds)	8 32nds of an inch		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
51,300 - RECORD_RF-Air Pressure (psi)	70 Pounds per Square Inch		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
51,400 - !FRA!INSPECT_FRONT ABS Tone Rings, Sensors, Routing of Cables	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
51,500 - !FRA!INSPECT_Wheel Seals for Leaks	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
51,600 - !FRA!INSPECT_Front Brake Assemblies	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
51,700 - MEASURE_RECORD_LF - Brake Lining, Pad Thickness (32nds)	4 32nds of an inch	Xfront Brake	DARTHURS	Mar 13, 2022 3:48:45 PM	Yes	55428143
51,800 - MEASURE_RECORD_RF - Brake Lining, Pad Thickness (32nds)	4 32nds of an inch		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
51,900 - INSPECT VISUALLY_RECORD_LF Rotor Condition (inches)	1.554 Inch		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
52,000 - INSPECT VISUALLY_RECORD_RF Rotor Condition (inches)	1.554 Inch		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
52,100 - INSPECT_Vibration Damper	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
52,200 - !FRA!INSPECT_Battery Cable Routing from Battery Box to Starter	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
52,400 - !FRA!INSPECT_Starter Mounting	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
52,500 - !FRA!INSPECT_Engine Exhaust System	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
52,700 - INSPECT_Engine, Transmission Mounts	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
52,800 - !FRA!INSPECT_Engine, Transmission for Fluid Leaks	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
52,900 - INSPECT_Shift Cable Adjustment - All Transmissions	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
53,000 - !FRA!INSPECT_Transmission Breather and Clean	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
53,100 - *RPT*!FRA!INSPECT_Parking Brake Cables, Shoes for Wear, Contamination	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
53,200 - *RPT*INSPECT_A/C Condensor, Fans, Safety Grills	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
53,300 - *RPT*INSPECT_Driveline, Hanger Bearings, U-Joints, Slip Joints, Safety Loop	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
53,400 - *RPT*INSPECT_All Body Mounts and Chassis Frame for Corrosion, Cracks	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
53,500 - !FRA!INSPECT_Fuel Tank, Mountings, Lines	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
53,600 - INSPECT_Tire Condition	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
53,700 - INSPECT_Tire Valve Stems, Double Check Caps	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
53,800 - INSPECT_Mismatched Tire Tread, Casing Design	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
53,900 - INSPECT_Dual Mating Tires w/Square	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
54,000 - !FRA!INSPECT_Wheels for Cracks, Loose Lugs/Indicators, Outer Hub Leaks	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
54,100 - INSPECT_Mud Flaps, Brackets	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
54,200 - RECORD_RRO-Tire Tread Depth (32nds)	6 32nds of an inch		DARTHURS	Mar 13, 2022 3:48:45 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
54,300 - RECORD_RRI-Tire Tread Depth (32nds)	6 32nds of an inch		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
54,400 - RECORD_RRO-Air Pressure (psi)	65 Pounds per Square Inch		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
54,500 - RECORD_RRI-Air Pressure (psi)	65 Pounds per Square Inch		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
54,600 - RECORD_LRO-Tire Tread Depth (32nds)	7 32nds of an inch		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
54,700 - RECORD_LRI-Tire Tread Depth (32nds)	8 32nds of an inch		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
54,800 - RECORD_LRO-Air Pressure (psi)	65 Pounds per Square Inch		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
54,900 - RECORD_LRI-Air Pressure (psi)	65 Pounds per Square Inch		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
55,000 - !FRA!INSPECT_ REAR Brake Assemblies	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
55,100 - !FRA!INSPECT_ REAR Hubs, Wheel Seals for Oil Leaks	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
55,200 - !FRA!INSPECT_ REAR ABS Tone Rings, Sensors, Routing Of Cables (if equipped)	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
55,300 - MEASURE_RECORD_LR - Brake Lining, Pad Thickness (32nds)	8 32nds of an inch		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
55,400 - MEASURE_RECORD_RR - Brake Lining, Pad Thickness (32nds)	8 32nds of an inch		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
55,500 - INSPECT VISUALLY_MEASURE_RECORD_LR Drum, Rotor Condition (inches)	1.656 Inch		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
55,600 - INSPECT VISUALLY_MEASURE_RECORD_RR Drum, Rotor Condition (inches)	1.656 Inch		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
55,700 - !FRA!INSPECT_ Under Body Exhaust System	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
55,800 - *RPT*INSPECT_ REAR Axle Housing, Breather; CLEAN_Breather	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
55,900 - *RPT*INSPECT_ REAR Springs, Shocks, Suspension, Airbags	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
60,000 - SECTION 6 - Wheelchair Inspection	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
60,100 - RECORD_Wheelchair Cycle Count	13833 Cycles		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
60,200 - CHECK_Lift Access Door for Ease of Opening,Latch Security,Door Hold Back	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
60,300 - CHECK_Platform Emergency Release Mechanism for Ease of Operation	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
60,400 - OPERATE_Lift thru Complete Cycle;CHECK_Noises,Jerky Op,Too Fast-Slow,Drift Down	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
60,500 - INSPECT_Bridgeplate Operation	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
60,600 - INSPECT_All Pivot Points for Wear and Looseness	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
60,700 - INSPECT_Rollers for Wear and Smooth Rotation	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
60,800 - INSPECT_Operation of Platform Barrier Mechanism	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
60,900 - INSPECT_Cam Slots for Wear and Proper Alignment	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
61,000 - INSPECT_Cable Condition (If Applicable)	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
61,100 - INSPECT_Hydraulic Hoses for Leaks, Chafing or Cracks	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
61,200 - INSPECT_Electrical Connections and Routing of Wires and Cables	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
61,300 - INSPECT_Operation and Adjustment of All Safety Switches	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
61,400 - INSPECT_All Lift Mounting Brackets for Loose Bolts Broken Welds, etc.	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
61,500 - INSPECT_Manual Back-up Raise/Lower System (If Applicable)	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
61,600 - INSPECT_HydrPump Reservoir Oil Level. Consult SvcManual for Fluid to Use.	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
61,700 - CHECK_Operator Decals for Proper Positioning;CONSULT_Service Manual	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
61,800 - CHECK_WC Holddowns Inside Vehicle for Secure Mounting,Proper Operation	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
61,900 - CLEAN_Linkages and Mechanisms	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
62,000 - LUBRICATE_Linkages and Mechanisms (DO NOT OVER Lubricate)	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
62,100 - INSPECT_Emergency Platform Release Mechanism	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
62,200 - INSPECT_Platform Barrier Latch Mechanism	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
62,300 - INSPECT_Bridgeplate Hinge	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
62,400 - INSPECT_All Pivot Points	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
62,500 - INSPECT_Cams and Slots	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
62,600 - INSPECT_Rollers	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
62,700 - INSPECT_All Linkages	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
70,000 - SECTION 7 - ALTERNATIVE FUELS INSPECTION	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
70,300 - INSPECT_Condition of Fuel Pressure Gauge	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
70,400 - PROVIDE PROOF_Tank_Dents/Scratches and Re-Certification	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
70,500 - INSPECT_Tank test date, labels-Reference-ST.4 FMMVSS 304 & ANSI-CSA NGV2	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
70,600 - INSPECT_ Tank Lines to Ensure Secure Mounting, Insulation Against Vibration	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
70,700 - INSPECT_ Filling Nozzle for Securely Fitting Cap	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
70,800 - INSPECT_ Pressure Relief Device's Venting System, Valves, Ducting to MNFR Specs	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
80,000 - SECTION 8 - PMI Report Completion	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
80,100 - COMPLETE_PM Report; Follow-ups	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	
80,200 - RETURN_Vehicle to Predetermined Location	Done		DARTHURS	Mar 13, 2022 3:48:45 PM	No	

Activity Sub Total

Activity 10 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	2.30
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00

Activity 20 Sub Total	
Parts:	0.00
Labor:	0.00

	Labor Hours:	0.35
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	0.00
Work Order Footer		
	Work Order 55321843 Total	
	Parts:	1.99
	Labor:	0.00
	Labor Hours:	2.65
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	1.99



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 55418880
Invoice No. 55345 - 55418880

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
55345 HEADLIGHTS		Ford E450 Champion Challenger	
Requested By:	NPIERRE-LOUIS	Status:	40 - Closed (40)
Created By:	NPIERRE-LOUIS	Priority:	-
Assigned To:		Driver:	
Class:	-	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	287,975 - DH

Chronology

Reported	Mar 9, 2022 2:46:29 PM	Mar 9, 2022 2:46:29 PM
Started	Mar 9, 2022 12:00:00 AM	
Completed	Mar 9, 2022 2:55:00 PM	Mar 9, 2022 2:55:00 PM
Down Time		

Work Order Notes

Line 10 COMPLAINT: headlight out

Cause: Defect

Correction: replaced passenger side headlight bulb

Activity Header

Activity: 10 999/999/999 TOTAL VEHICLE

Activity Note: PERSONAL RISK ASSESMENT

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure: 00 No Failure

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: PERSONAL RISK ASSESMENT

Task: PRA and Meter Readings Performed by: NPIERRE-LOUIS Performed on: 09-MAR-22

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		NPIERRE-LOUIS	Mar 9, 2022 2:50:46 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		NPIERRE-LOUIS	Mar 9, 2022 2:50:46 PM	No	
4 - Are you wearing the appropriate PPE?	Done		NPIERRE-LOUIS	Mar 9, 2022 2:50:46 PM	No	
7 - Have you performed the proper LOTO?	Done		NPIERRE-LOUIS	Mar 9, 2022 2:50:46 PM	No	
10 - Are you aware of the potential risks of performing this repair?	Done		NPIERRE-LOUIS	Mar 9, 2022 2:50:46 PM	No	
11 - Have you successfully completed the Personal	Done		NPIERRE-	Mar 9, 2022	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO	
Risk Assessment?			LOUIS	2:50:46 PM			
Activity Sub Total				Activity 10 Sub Total			
				Parts:		0.00	
				Labor:		0.00	
				Labor Hours:		0.00	
				Sublet Parts:		0.00	
				Sublet Labor:		0.00	
				Activity Sub Total		0.00	



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 55418880
Invoice No. 55345 - 55418880

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
55345 HEADLIGHTS		Ford E450 Champion Challenger	
Requested By:	NPIERRE-LOUIS	Status:	40 - Closed (40)
Created By:	NPIERRE-LOUIS	Priority:	-
Assigned To:		Driver:	
Class:	-	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	287,975 - DH

Activity Header
Activity:20 034/001/000 HEADLAMP
Activity Note:
Reason for Repair: 39 Natural Causes
Work Accomplished: 03 Replace New
Part Failure: 02 Burned, Scorched, Melted, Blistered
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
09-Mar-22	H13BP	BULB, HEADLAMP, HALOGEN	1	12.2	12.2

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
09-Mar-22	NELSON PIERRE-LOUIS	1	0	0

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available

Activity Sub Total	
Activity 20 Sub Total	
Parts:	12.20
Labor:	0.00
Labor Hours:	1.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	12.20

Work Order Footer	
Work Order 55418880 Total	
Parts:	12.20
Labor:	0.00
Labor Hours:	1.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	12.20



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 55388327
Invoice No. 55345 - 55388327

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
FIRE ALARM ON		Ford E450 Champion Challenger	
Requested By:	CVERGARA	Status:	40 - Closed (40)
Created By:	CVERGARA	Priority:	-
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	286,663 - DH

Chronology

Reported	Feb 28, 2022 10:47:00 AM	Feb 28, 2022 10:47:00 AM
Started	Feb 28, 2022 12:00:00 AM	
Completed	Mar 2, 2022 10:57:00 AM	Mar 2, 2022 10:57:00 AM
Down Time		

Work Order Notes

Line 10 fire detection bottle low causing alarm on.
New bottle installed by company United Safety, vehicle return to service

Activity Header

Activity: 10 999/999/999 TOTAL VEHICLE

Activity Note:

Reason for Repair: SW Shop Work Order

Work Accomplished: 06 Inspect

Part Failure: 00 No Failure

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
28-Feb-22	Rodriguez,Raul	0.45	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc:

Task: PRA and Meter Readings Performed by: RAUODRIGUEZ Performed on: 28-FEB-22

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		RAUODRIGUEZ	Feb 28, 2022 12:26:31 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		RAUODRIGUEZ	Feb 28, 2022 12:26:31 PM	No	
4 - Are you wearing the appropriate PPE?	Done		RAUODRIGUEZ	Feb 28, 2022 12:26:31 PM	No	
7 - Have you performed the proper LOTO?	Done		RAUODRIGUEZ	Feb 28, 2022 12:26:31 PM	No	
10 - Are you aware of the potential risks of performing this repair?	Done		RAUODRIGUEZ	Feb 28, 2022 12:26:31 PM	No	
11 - Have you successfully completed the Personal Risk Assessment?	Done		RAUODRIGUEZ	Feb 28, 2022 12:26:31 PM	No	

Activity Sub Total															
	<table><tr><td colspan="2">Activity 10 Sub Total</td></tr><tr><td>Parts:</td><td>0.00</td></tr><tr><td>Labor:</td><td>0.00</td></tr><tr><td>Labor Hours:</td><td>0.45</td></tr><tr><td>Sublet Parts:</td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td>0.00</td></tr></table>	Activity 10 Sub Total		Parts:	0.00	Labor:	0.00	Labor Hours:	0.45	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	0.00
Activity 10 Sub Total															
Parts:	0.00														
Labor:	0.00														
Labor Hours:	0.45														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	0.00														



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 55388327
Invoice No. 55345 - 55388327


Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FD4E4FS7EDB17176
FIRE ALARM ON		Ford E450 Champion Challenger	
Requested By:	CVERGARA	Status:	40 - Closed (40)
Created By:	CVERGARA	Priority:	-
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	286,663 - DH

Activity Header				
Activity:20 999 TOTAL VEHICLE				
Activity Note: FIRE ALARM ON				
Reason for Repair: 08 Preventive Maintenance				
Work Accomplished: 06 Inspect				
Part Failure:				
Activity Comments:				
Activity Parts				
No Data Available				
Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
02-Mar-22	Rodriguez,Raul	1	0	0
Activity Sublet				
No Data Available				
Activity Checklist				
No Data Available				
No Data Available				
Activity Sub Total				
			Activity 20 Sub Total	
			Parts:	0.00
			Labor:	0.00
			Labor Hours:	1.00
			Sublet Parts:	0.00
			Sublet Labor:	0.00
			Activity Sub Total	0.00
Work Order Footer				
			Work Order 55388327 Total	
			Parts:	0.00
			Labor:	0.00
			Labor Hours:	1.45
			Sublet Parts:	0.00
			Sublet Labor:	0.00
			Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 55351152
Invoice No. 55345 - 55351152

Client Department:

Department: 55345M

Work Order Description

Ford Body Parts

Requested By: CVERGARA

Created By: CVERGARA

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: -

Driver:

Phone:

ETA:

Meter: 284,500 - DH

Chronology

Reported	Feb 15, 2022 7:54:00 AM	Feb 15, 2022 7:54:00 AM
Started	Feb 15, 2022 8:08:00 AM	
Completed	Feb 15, 2022 11:31:00 AM	Feb 15, 2022 11:31:00 AM
Down Time		

Work Order Notes

Line 10 Complaint. vehicle damage bottom close to the driver door.

Cause. unknow

Correction. Repaired with body filler and touch paint.

Activity Header

Activity: 10 999/999/999 TOTAL VEHICLE

Activity Note: Personal Risk Assessment

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure: 00 No Failure

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: Personal Risk Assessment


Task: PRA and Meter Readings Performed by: RAUODRIGUEZ Performed on: 15-FEB-22

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		RAUODRIGUEZ	Feb 15, 2022 11:25:38 AM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		RAUODRIGUEZ	Feb 15, 2022 11:25:38 AM	No	
4 - Are you wearing the appropriate PPE?	Done		RAUODRIGUEZ	Feb 15, 2022 11:25:38 AM	No	
7 - Have you performed the proper LOTO?	Done		RAUODRIGUEZ	Feb 15, 2022 11:25:38 AM	No	
10 - Are you aware of the potential risks of performing this repair?	Done		RAUODRIGUEZ	Feb 15, 2022 11:25:38 AM	No	
11 - Have you successfully completed the	Done		RAUODRIGUEZ	Feb 15, 2022	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO	
Personal Risk Assessment?				11:25:38 AM			
Activity Sub Total				Activity 10 Sub Total			
				Parts:		0.00	
				Labor:		0.00	
				Labor Hours:		0.00	
				Sublet Parts:		0.00	
				Sublet Labor:		0.00	
				Activity Sub Total		0.00	



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 55351152
Invoice No. 55345 - 55351152

Client Department:

Department: 55345M

Work Order Description

Ford Body Parts

Requested By: CVERGARA

Created By: CVERGARA

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: -

Driver:

Phone:

ETA:

Meter: 284,500 - DH

Activity Header

Activity: 20 002/000/000 CAB & SHEET METAL

Activity Note: FORD BODY REPAIR

Reason for Repair: 41 Abuse of Equipment - 56210

Work Accomplished: 15 Paint Prep, & Repaint

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
15-Feb-22	Rodriguez,Raul	3.1	0	0

Activity Sublet

No Data Available

Activity Checklist

No Data Available

No Data Available

Activity Sub Total

Activity 20 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	3.10
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00

Work Order Footer

Work Order 55351152 Total

Parts:	0.00
Labor:	0.00
Labor Hours:	3.10
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 55013605
Invoice No. 55345 - 55013605

Client Department:

Department: 55345M

Work Order Description

55345-LIGHT DUTY PMC

Requested By: RGASPARD

Created By: RGASPARD

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 3 - High

Driver:

Phone:

ETA:

Meter: 283,555 - DH

Chronology

Reported	Jan 22, 2022 12:00:00 AM	Jan 22, 2022 12:00:00 AM
Started	Feb 3, 2022 5:10:00 PM	
Completed	Feb 4, 2022 12:10:00 PM	Feb 4, 2022 12:10:00 PM
Down Time		

Work Order Notes

Line 10 Complaint: PMC service

Cause: preventive maintenance

Correction: performed pmc service ,transmission and rear end jod was completed

Activity Header

Activity:5 999/999/999 TOTAL VEHICLE

Activity Note: PERSONAL RISK ASSESSMENT

Reason for Repair: SW Shop Work Order

Work Accomplished: 06 Inspect

Part Failure: 00 No Failure

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: PERSONAL RISK ASSESSMENT

Task: PRA and Meter Readings Performed by: NPIERRE-LOUIS Performed on: 04-FEB-22

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		NPIERRE-LOUIS	Feb 4, 2022 11:39:18 AM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		NPIERRE-LOUIS	Feb 4, 2022 11:39:18 AM	No	
4 - Are you wearing the appropriate PPE?	Done		NPIERRE-LOUIS	Feb 4, 2022 11:39:18 AM	No	
7 - Have you performed the proper LOTO?	Done		NPIERRE-LOUIS	Feb 4, 2022 11:39:18 AM	No	
10 - Are you aware of the potential risks of performing this repair?	Done		NPIERRE-LOUIS	Feb 4, 2022 11:39:18 AM	No	
11 - Have you successfully completed the Personal	Done		NPIERRE-	Feb 4, 2022	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
Risk Assessment?			LOUIS	11:39:18 AM		
Activity Sub Total			Activity 5 Sub Total			
			Parts:			0.00
			Labor:			0.00
			Labor Hours:			0.00
			Sublet Parts:			0.00
			Sublet Labor:			0.00
			Activity Sub Total			0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 55013605
Invoice No. 55345 - 55013605

Client Department:

Department: 55345M

Work Order Description

55345-LIGHT DUTY PMC

Requested By: RGASPARD

Created By: RGASPARD

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 3 - High

Driver:

Phone:

ETA:

Meter: 283,555 - DH

Activity Header

Activity: 10 999 TOTAL VEHICLE

Activity Note: Light Duty PMI

Reason for Repair: 08 Preventive Maintenance

Work Accomplished:

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
04-Feb-22	NELSON PIERRE-LOUIS	2.9	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: Light Duty PMI

Task: First Transit North America Light Duty PM Inspection Sheet Performed by: NPIERRE-LOUIS Performed on: 04-FEB-22

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,000 - SECTION 1 - Preparation Inspection	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
10,100 - INSPECT_Auto-Transmission Operation/Controller; Neutral Safety Switch	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
10,200 - !FRA!INSPECT_Starter Operation	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
10,300 - !FRA!INSPECT_Warning Lights and Alarms	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
10,400 - !FRA!INSPECT_Back Up Alarm	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
10,500 - !FRA!INSPECT_Engine Operation, OBSERVE_Exhaust for Excessive Smoke	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
10,600 - Check Driver's Pre-trip or DVIR/EVIR & Authorization Forms	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
10,700 - INSPECT_All Exterior Lights (Turn on until Completion of this section)	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
10,800 - *RPT*INSPECT_Body Damage, Corrosion;DOCUMENT_Issues	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
10,900 - INSPECT_Fuel Tank Cap, and Doors	Done		NPIERRE-	Feb 4, 2022	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
			LOUIS	12:00:09 PM		
11,100 - INSPECT_License Plate, Bracket, Bumpers	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
20,000 - SECTION 2 - Test Drive and Operator Area Inspection	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
20,100 - INSPECT_Driver Seat condition/operation/seatbelt	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
20,200 - TEST DRIVE_INSPECT_Proper Operation; Drive into Shop	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
20,300 - *RPT*INSPECT_Steering Wheel for Play/Bind/Horn Op./Turn Signal Cancelation	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
20,400 - PERFORM_Brake Test (Apply hard enough to check wheel pull and Application)	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
20,500 - *RPT*FRA INSPECT_Lighting/Operation of all Gauges	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
20,600 - *RPT*INSPECT_Windshields, Sun Visors	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
20,700 - INSPECT_Wiper/Washer Operation, Condition	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
20,800 - INSPECT_High Idle Control	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
20,900 - *RPT*!FRA!INSPECT_HVAC Controls, Operation	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
21,000 - *RPT*!FRA!INSPECT_Operation of all Switches and Accessories	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
21,100 - INSPECT_Parking Brake Operation	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
21,200 - !FRA!TEST_Service Brake Backup System (Stationary Brake Tests HYD)	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
21,300 - INSPECT_VIN, Tire Pressure Decal, Data Tags	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
21,400 - *RPT*INSPECT_Drivers Door Hinges, Handles, Controls and Panels	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
21,500 - !FRA!INSPECT_Under Dash Wiring for Proper Routing/Chafing/Securement	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
21,550 - INSPECT_Driver Floor Area for Rust/Water Leaks	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
21,600 - *RPT*INSPECT for WEAR_Pedal Pads, Accelerator, Brake, Parking Brake	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
21,700 - INSPECT_Engine Fault Codes	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
30,000 - SECTION 3 - EXTERIOR INSPECTION - Front	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
31,000 - SSF (Street Side Front)	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
31,010 - *RPT*!FRA!INSPECT_Mirror Mountings, Brackets, Glass	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
31,020 - *RPT*INSPECT_FRONT Springs, Shocks, Spring Shackles	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
31,030 - INSPECT_Mud Flaps, Brackets	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
31,040 - INSPECT_Wiper Blades, Arms	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
32,000 - Engine Inspection	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
32,010 - INSPECT_Hood, Springs and Props	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
32,020 - !FRA!INSPECT_Engine Compartment Condition for Fire Risk Avoidance	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
32,030 - !FRA!INSPECT_for Fluid Leaks, Levels	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
32,040 - !FRA!INSPECT_Hyd_Brake Fluid with Test Strips	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
32,050 - !FRA!INSPECT_RECORD_Coolant Recovery with Refractometer; Test Strips	0 Degree Fahrenheit		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
32,060 - PRESSURE TEST_Cooling Systems (Radiator, Cap, hoses and clamps)	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
32,070 - *RPT*INSPECT_Radiator and Mountings, Cores	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
32,080 - *RPT*INSPECT_Fan Assembly, Shroud, Tensioner, Belts, All Belt Driven Components	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
32,090 - *RPT*!FRA!INSPECT_Mounting, Installation of Alternator, AC Compressor	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
32,100 - INSPECT_Intake System	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
32,140 - *RPT*!FRA!RECORD_Underhood Battery Voltages (volts)	13.2 Volt*		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
33,010 - CSF (Curb Side Front)	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
33,020 - *RPT*!FRA!INSPECT_Mirror Mountings, Brackets, Glass	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
33,030 - *RPT*INSPECT_FRONT Springs, Shocks, Spring Shackles	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
33,040 - INSPECT_Mud Flaps, Brackets	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
33,050 - INSPECT_Wiper Blades, Arms	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
33,060 - !FRA!INSPECT_LUBE_Battery Box, Batteries, Tray Slides, Hold Downs	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
33,070 - *RPT*!FRA!RECORD_Side Mounted Battery Voltages (volts)	13.1 Volt*		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
33,080 - INSPECT_Entry door, OPEN_with external lock/switch (if equipped)	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
40,000 - SECTION 4 - Interior Inspection	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
40,100 - *RPT*INSPECT_Step-Well, Step-Tread, Hand Rails, Step-well Light	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
40,200 - INSPECT_Insurance/Registration/Regulatory Forms Dates	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
40,250 - INSPECT_Overhead Compartment for Water Leaks	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
40,300 - INSPECT_Safety Equipment, Fire	Done		NPIERRE-	Feb 4, 2022	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
Extinguisher/Suppression			LOUIS	12:00:09 PM		
40,400 - INSPECT_Camera Systems, Filter, Electrical Inputs/Outputs-SOP M038	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
40,600 - !FRA!CHECK for HOTSPOTS_Interior Elec Panel Fuses/Circuit Breakers/Connectors	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
40,700 - *RPT*INSPECT_Seats, Covering, Belts, Loose Cushions, Operation	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
40,800 - *RPT*!FRA!INSPECT_Interior Lights; Mirrors	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
40,900 - !FRA!INSPECT_Interior Cleanliness/Potential Projectiles	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
41,000 - INSPECT_All ADA Equip (Lift Seat Belt, floor hold Downs, Belts, Cover, Alarms)	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
41,100 - INSPECT_CLEAN_AC Filter	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
41,200 - INSPECT_Emergency Windows,Hatches,Doors,Alarms/Lights;CHECK_for Leaks	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
41,300 - *RPT*INSPECT_Interior Body, Floor, Stanchions	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
41,400 - *RPT*INSPECT_Passenger Doors, Glass, Seal	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
50,000 - SECTION 5 - UNDER VEHICLE INSPECTION	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
50,100 - *RPT*INSPECT_Steering components-Drag Link, Tie Rods ends and Steering Damper	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
50,200 - INSPECT_Ball Joint Play	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
50,300 - !FRA!INSPECT_Front Wheel Bearings for Play	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
50,400 - LUBE_All Chassis Components	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
50,500 - !FRA!CHANGE_Engine oil,filters	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
50,700 - INSPECT_Tire Condition	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
50,800 - INSPECT_Tire Valve Stems, Double Check Caps	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
50,900 - !FRA!INSPECT_Wheels for Cracks, Loose Lugs/Indicators, Outer Hub Leaks	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
51,000 - RECORD_LF-Tire Tread Depth (32nds)	8 32nds of an inch		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
51,100 - RECORD_LF-Tire Air Pressure (psi)	67 Pounds per Square Inch		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
51,200 - RECORD_RF-Tire Tread Depth (32nds)	7 32nds of an inch		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
51,300 - RECORD_RF-Air Pressure (psi)	66 Pounds per Square Inch		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
51,400 - !FRA!INSPECT_FRONT ABS Tone Rings, Sensors, Routing of Cables	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
51,500 - !FRA!INSPECT_Wheel Seals for Leaks	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
51,600 - !FRA!INSPECT_ Front Brake Assemblies	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
51,700 - MEASURE_RECORD_LF - Brake Lining, Pad Thickness (32nds)	7 32nds of an inch		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
51,800 - MEASURE_RECORD_RF - Brake Lining, Pad Thickness (32nds)	7 32nds of an inch		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
51,900 - INSPECT VISUALLY_RECORD_LF Rotor Condition (inches)	29.5 Inch		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
52,000 - INSPECT VISUALLY_RECORD_RF Rotor Condition (inches)	29.5 Inch		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
52,100 - INSPECT_Vibration Damper	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
52,200 - !FRA!INSPECT_Battery Cable Routing from Battery Box to Starter	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
52,400 - !FRA!INSPECT_Starter Mounting	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
52,500 - !FRA!INSPECT_Engine Exhaust System	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
52,700 - INSPECT_Engine, Transmission Mounts	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
52,800 - !FRA!INSPECT_Engine, Transmission for Fluid Leaks	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
52,900 - INSPECT_Shift Cable Adjustment - All Transmissions	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
53,000 - !FRA!INSPECT_Transmission Breather and Clean	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
53,100 - *RPT*!FRA!INSPECT_Parking Brake Cables, Shoes for Wear, Contamination	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
53,200 - *RPT*INSPECT_A/C Condensor, Fans, Safety Grills	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
53,300 - *RPT*INSPECT_Driveline, Hanger Bearings, U-Joints, Slip Joints, Safety Loop	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
53,400 - *RPT*INSPECT_All Body Mounts and Chassis Frame for Corrosion, Cracks	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
53,500 - !FRA!INSPECT_Fuel Tank, Mountings, Lines	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
53,600 - INSPECT_Tire Condition	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
53,700 - INSPECT_Tire Valve Stems, Double Check Caps	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
53,800 - INSPECT_Mismatched Tire Tread, Casing Design	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
53,900 - INSPECT_Dual Mating Tires w/Square	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
54,000 - !FRA!INSPECT_Wheels for Cracks, Loose Lugs/Indicators, Outer Hub Leaks	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
54,100 - INSPECT_Mud Flaps, Brackets	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
54,200 - RECORD_RRO-Tire Tread Depth (32nds)	7 32nds of an inch		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
54,300 - RECORD_RRI-Tire Tread Depth (32nds)	7 32nds of an inch		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
54,400 - RECORD_RRO-Air Pressure (psi)	68 Pounds per Square Inch		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
54,500 - RECORD_RRI-Air Pressure (psi)	69 Pounds per Square Inch		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
54,600 - RECORD_LRO-Tire Tread Depth (32nds)	7 32nds of an inch		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
54,700 - RECORD_LRI-Tire Tread Depth (32nds)	8 32nds of an inch		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
54,800 - RECORD_LRO-Air Pressure (psi)	68 Pounds per Square Inch		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
54,900 - RECORD_LRI-Air Pressure (psi)	68 Pounds per Square Inch		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
55,000 - !FRA!INSPECT_ REAR Brake Assemblies	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
55,100 - !FRA!INSPECT_ REAR Hubs, Wheel Seals for Oil Leaks	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
55,200 - !FRA!INSPECT_REAR ABS Tone Rings, Sensors, Routing Of Cables (if equipped)	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
55,300 - MEASURE_RECORD_LR - Brake Lining, Pad Thickness (32nds)	6 32nds of an inch		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
55,400 - MEASURE_RECORD_RR - Brake Lining, Pad Thickness (32nds)	6 32nds of an inch		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
55,500 - INSPECT VISUALLY_MEASURE_RECORD_LR Drum, Rotor Condition (inches)	23.5 Inch		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
55,600 - INSPECT VISUALLY_MEASURE_RECORD_RR Drum, Rotor Condition (inches)	23.5 Inch		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
55,700 - !FRA!INSPECT_ Under Body Exhaust System	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
55,800 - *RPT*INSPECT_ REAR Axle Housing, Breather; CLEAN_Breather	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
55,900 - *RPT*INSPECT_ REAR Springs, Shocks, Suspension, Airbags	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
60,000 - SECTION 6 - Wheelchair Inspection	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
60,100 - RECORD_Wheelchair Cycle Count	13633 Cycles		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
60,200 - CHECK_ Lift Access Door for Ease of Opening,Latch Security,Door Hold Back	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
60,300 - CHECK_Platform Emergency Release Mechanism for Ease of Operation	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
60,400 - OPERATE_ Lift thru Complete Cycle;CHECK_Noises,Jerky Op,Too Fast-Slow,Drift Down	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
60,500 - INSPECT_ Bridgeplate Operation	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
60,600 - INSPECT_All Pivot Points for Wear and Looseness	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
60,700 - INSPECT_Rollers for Wear and Smooth Rotation	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
60,800 - INSPECT_Operation of Platform Barrier Mechanism	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
60,900 - INSPECT_Cam Slots for Wear and Proper	Done		NPIERRE-	Feb 4, 2022	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
Alignment			LOUIS	12:00:09 PM		
61,000 - INSPECT_Cable Condition (If Applicable)	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
61,100 - INSPECT_Hydraulic Hoses for Leaks, Chafing or Cracks	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
61,200 - INSPECT_Electrical Connections and Routing of Wires and Cables	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
61,300 - INSPECT_Operation and Adjustment of All Safety Switches	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
61,400 - INSPECT_All Lift Mounting Brackets for Loose Bolts Broken Welds, etc.	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
61,500 - INSPECT_Manual Back-up Raise/Lower System (If Applicable)	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
61,600 - INSPECT_HydrPump Reservoir Oil Level. Consult SrvManual for Fluid to Use.	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
61,700 - CHECK_Operator Decals for Proper Positioning;CONSULT_Service Manual	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
61,800 - CHECK_WC Holddowns Inside Vehicle for Secure Mounting,Proper Operation	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
61,900 - CLEAN_Linkages and Mechanisms	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
62,000 - LUBRICATE_Linkages and Mechanisms (DO NOT OVER Lubricate)	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
62,100 - INSPECT_Emergency Platform Release Mechanism	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
62,200 - INSPECT_Platform Barrier Latch Mechanism	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
62,300 - INSPECT_Bridgeplate Hinge	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
62,400 - INSPECT_All Pivot Points	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
62,500 - INSPECT_Cams and Slots	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
62,600 - INSPECT_Rollers	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
62,700 - INSPECT_All Linkages	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
70,000 - SECTION 7 - ALTERNATIVE FUELS INSPECTION	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
70,300 - INSPECT_Condition of Fuel Pressure Gauge	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
70,400 - PROVIDE PROOF_Tank_Dents/Scratches and Re-Certification	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
70,500 - INSPECT_Tank test date, labels-Reference-ST.4 FMMVSS 304 & ANSI-CSA NGV2	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
70,600 - INSPECT_Tank Lines to Ensure Secure Mounting, Insulation Against Vibration	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
70,700 - INSPECT_Filling Nozzle for Securely Fitting Cap	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
70,800 - INSPECT_Pressure Relief Device's Venting System, Valves, Ducting to MNFR Specs	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
80,000 - SECTION 8 - PMI Report Completion	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
80,100 - COMPLETE_PM Report; Follow-ups	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
80,200 - RETURN_Vehicle to Predetermined Location	Done		NPIERRE-LOUIS	Feb 4, 2022 12:00:09 PM	No	
Activity Sub Total						
			Activity 10 Sub Total			
			Parts:			0.00
			Labor:			0.00
			Labor Hours:			2.90
			Sublet Parts:			0.00
			Sublet Labor:			0.00
			Activity Sub Total			0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 55013605
Invoice No. 55345 - 55013605

Client Department:

Department: 55345M

Work Order Description

55345-LIGHT DUTY PMC

Requested By: RGASPARD

Created By: RGASPARD

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 3 - High

Driver:

Phone:

ETA:

Meter: 283,555 - DH

Activity Header

Activity: 20 999 TOTAL VEHICLE

Activity Note: PM C

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: C PM Level C

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
04-Feb-22	B329	FILTER, OIL, SPIN-ON SEE P550965	1	1.99	1.99
04-Feb-22	40520	BLADE, WIPER, WINDSHIELD, 20"	2	4.4	8.8
04-Feb-22	20021	FILTER, TRANSMISSION 20021	1	17.44	17.44

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
04-Feb-22	NELSON PIERRE-LOUIS	0.75	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List						
20 Desc: PM C						
Task: PM C SERVICE Performed by: NPIERRE-LOUIS Performed on: 04-FEB-22						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
100,000 - "A" PMI SERVICING ITEMS	Done		NPIERRE-LOUIS	Feb 4, 2022 11:38:43 AM	No	
101,000 - FRA Change Oil Filters	Yes		NPIERRE-LOUIS	Feb 4, 2022 11:38:43 AM	No	
102,000 - FRA Drain Engine Oil	Yes		NPIERRE-LOUIS	Feb 4, 2022 11:38:43 AM	No	
103,000 - FRA Check Transmission Fluid	Done		NPIERRE-LOUIS	Feb 4, 2022 11:38:43 AM	No	
104,000 - Lubricate Chassis	Done		NPIERRE-LOUIS	Feb 4, 2022 11:38:43 AM	No	
105,000 - Replace or Clean A/C Filters	Done		NPIERRE-LOUIS	Feb 4, 2022 11:38:43 AM	No	
107,000 - FRA Change Primary Fuel Filter	Done		NPIERRE-LOUIS	Feb 4, 2022 11:38:43 AM	No	
108,000 - Lube all pivoting Mechanisms	Done		NPIERRE-LOUIS	Feb 4, 2022 11:38:43 AM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
200,000 - "B" PMI SERVICING ITEMS (12 MONTH)	Done		NPIERRE-LOUIS	Feb 4, 2022 11:38:43 AM	No	
201,000 - Service Crankcase Breather	Done		NPIERRE-LOUIS	Feb 4, 2022 11:38:43 AM	No	
203,000 - FRA Change Automatic Transmission Fluid	Yes		NPIERRE-LOUIS	Feb 4, 2022 11:38:43 AM	No	
204,000 - FRA Change Power Steering Fluid and Filter	Yes		NPIERRE-LOUIS	Feb 4, 2022 11:38:43 AM	No	
205,000 - Complete Engine Diagnostics and Clear Codes when Completed	Done		NPIERRE-LOUIS	Feb 4, 2022 11:38:43 AM	No	
300,000 - "C" PMI SERVICING ITEMS (24 MONTH)	Done		NPIERRE-LOUIS	Feb 4, 2022 11:38:43 AM	No	
301,000 - Check and Lubricate Door Linkages	Done		NPIERRE-LOUIS	Feb 4, 2022 11:38:43 AM	No	
302,000 - Check Toe-In and Record Reading	Done		NPIERRE-LOUIS	Feb 4, 2022 11:38:43 AM	No	
302,001 - Record Toe-In Reading	0 Inches, fraction-actual		NPIERRE-LOUIS	Feb 4, 2022 11:38:43 AM	No	
304,000 - 1st "C" PMI ONLY: Tune Up Per Engine Mfg's Specifications	Yes		NPIERRE-LOUIS	Feb 4, 2022 11:38:43 AM	No	
305,000 - FRA Change Differential Fluid	Yes		NPIERRE-LOUIS	Feb 4, 2022 11:38:43 AM	No	

Activity Sub Total

Activity 20 Sub Total

Parts:	30.22
Labor:	0.00
Labor Hours:	0.75
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	30.22

Work Order Footer

Work Order 55013605 Total

Parts:	30.22
Labor:	0.00
Labor Hours:	3.65
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	30.22



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 55307988
Invoice No. 55345 - 55307988

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
55345 FIRE SUPPRESSION SYSTEM		Ford E450 Champion Challenger	
Requested By:	RAUODRIGUEZ	Status:	40 - Closed (40)
Created By:	RAUODRIGUEZ	Priority:	-
Assigned To:		Driver:	
Class:	-	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	283,267 - DH

Chronology

Reported	Jan 31, 2022 11:58:18 AM	Jan 31, 2022 11:58:18 AM
Started	Jan 31, 2022 12:00:00 PM	
Completed	Jan 31, 2022 1:40:00 PM	Jan 31, 2022 1:40:00 PM
Down Time		

Work Order Notes

Line 10 C. FIRE SUPPRESSION SYSTEM ALARM ON

C. FOUND DETECTOR BOTLE LITLE LOW

C. NO LEAK, REPLACED DETECTOR BOTLE WITH KNOW USE GOOD ONE (24 Bar)

Activity Header

Activity: 10 999/999/999 TOTAL VEHICLE

Activity Note:

Reason for Repair: SW Shop Work Order

Work Accomplished: 06 Inspect

Part Failure: 00 No Failure

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc:

Task: PRA and Meter Readings Performed by: RAUODRIGUEZ Performed on: 31-JAN-22

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		RAUODRIGUEZ	Jan 31, 2022 1:40:34 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		RAUODRIGUEZ	Jan 31, 2022 1:40:34 PM	No	
4 - Are you wearing the appropriate PPE?	Done		RAUODRIGUEZ	Jan 31, 2022 1:40:34 PM	No	
7 - Have you performed the proper LOTO?	Done		RAUODRIGUEZ	Jan 31, 2022 1:40:34 PM	No	
10 - Are you aware of the potential risks of performing this repair?	Done		RAUODRIGUEZ	Jan 31, 2022 1:40:34 PM	No	
11 - Have you successfully completed the	Done		RAUODRIGUEZ	Jan 31, 2022	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO	
Personal Risk Assessment?				1:40:34 PM			
Activity Sub Total				Activity 10 Sub Total			
				Parts:		0.00	
				Labor:		0.00	
				Labor Hours:		0.00	
				Sublet Parts:		0.00	
				Sublet Labor:		0.00	
				Activity Sub Total		0.00	



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 55307988
Invoice No. 55345 - 55307988

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
55345 FIRE SUPPRESSION SYSTEM		Ford E450 Champion Challenger	
Requested By:	RAURODRIGUEZ	Status:	40 - Closed (40)
Created By:	RAURODRIGUEZ	Priority:	-
Assigned To:		Driver:	
Class:	-	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	283,267 - DH

Activity Header				
Activity:20 999 TOTAL VEHICLE				
Activity Note:				
Reason for Repair:		08 Preventive Maintenance		
Work Accomplished:		06 Inspect		
Part Failure:				
Activity Comments:				
Activity Parts				
No Data Available				
Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
31-Jan-22	Rodriguez,Raul	1.43	0	0
Activity Sublet				
No Data Available				
Activity Checklist				
No Data Available				
No Data Available				
Activity Sub Total				
			Activity 20 Sub Total	
			Parts:	0.00
			Labor:	0.00
			Labor Hours:	1.43
			Sublet Parts:	0.00
			Sublet Labor:	0.00
			Activity Sub Total	0.00
Work Order Footer				
			Work Order 55307988 Total	
			Parts:	0.00
			Labor:	0.00
			Labor Hours:	1.43
			Sublet Parts:	0.00
			Sublet Labor:	0.00
			Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 55272979
Invoice No. 55345 - 55272979

Client Department:

Department: 55345M

Work Order Description

Front Air Conditioning System

Requested By: CVERGARA

Created By: CVERGARA

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: -

Driver:

Phone:

ETA:

Meter: 282,731 - DH

Chronology

Reported	Jan 19, 2022 1:35:00 PM	Jan 19, 2022 1:35:00 PM
Started	Jan 19, 2022 5:40:00 PM	
Completed	Jan 19, 2022 10:03:00 PM	Jan 19, 2022 10:03:00 PM
Down Time		

Work Order Notes

Line 10 COMPLAINT: Front AC malfunction.

CAUSE: Wear and tear.

CORRECTION: Remove and replaced front AC blower motor and blower wheel.

Activity Header

Activity: 10 999/999/999 TOTAL VEHICLE

Activity Note: PERSONAL RISK ASSESMENT

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure: 00 No Failure

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: PERSONAL RISK ASSESMENT


Task: PRA and Meter Readings Performed by: EARJOHNSON Performed on: 19-JAN-22

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		EARJOHNSON	Jan 19, 2022 6:30:32 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		EARJOHNSON	Jan 19, 2022 6:30:32 PM	No	
4 - Are you wearing the appropriate PPE?	Done		EARJOHNSON	Jan 19, 2022 6:30:32 PM	No	
7 - Have you performed the proper LOTO?	Done		EARJOHNSON	Jan 19, 2022 6:30:32 PM	No	
10 - Are you aware of the potential risks of performing this repair?	Done		EARJOHNSON	Jan 19, 2022 6:30:32 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
11 - Have you successfully completed the Personal Risk Assessment?	Done		EARJOHNSON	Jan 19, 2022 6:30:32 PM	No	
Activity Sub Total						
			Activity 10 Sub Total			
			Parts:			0.00
			Labor:			0.00
			Labor Hours:			0.00
			Sublet Parts:			0.00
			Sublet Labor:			0.00
			Activity Sub Total			0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 55272979
Invoice No. 55345 - 55272979

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Front Air Conditioning System		Ford E450 Champion Challenger	
Requested By:	CVERGARA	Status:	40 - Closed (40)
Created By:	CVERGARA	Priority:	-
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	282,731 - DH

Activity Header
Activity:20 001/000/000 AIR CONDITIONING, HEATING AND VENTILATION
Activity Note: FRONT AC DIAG
Reason for Repair: 04 Driver's Report
Work Accomplished: 09 Troubleshooting
Part Failure:
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
19-Jan-22	AC2Z-19834-A	WHEEL, MOTOR, BLOWER	1	29.79	29.79
19-Jan-22	XC2Z-19805-BA	MOTOR, BLOWER SAME AS MM-840	1	38.22	38.22

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
19-Jan-22	Earl Johnson	0.8	0	0

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available

Activity Sub Total	
Activity 20 Sub Total	
Parts:	68.01
Labor:	0.00
Labor Hours:	0.80
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	68.01

Work Order Footer	
Work Order 55272979 Total	
Parts:	68.01
Labor:	0.00
Labor Hours:	0.80
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	68.01



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 55137036
Invoice No. 55345 - 55137036

Client Department:

Department: 55345M

Work Order Description

check engine light on

Requested By: CVERGARA

Created By: CVERGARA

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: -

Driver:

Phone:

ETA:

Meter: 282,056 - DH

Chronology

Reported	Dec 1, 2021 8:33:00 AM	Dec 1, 2021 8:33:00 AM
Started	Dec 13, 2021 12:00:00 AM	
Completed	Dec 14, 2021 8:52:00 AM	Dec 14, 2021 8:52:00 AM
Down Time		

Work Order Notes

Line 10

P0713 Transmission Check engine light is on.

Found P0713 code Transmission Temperature sensor

Drain Transmission. Removed trans oil pan, oil filter, Valve body, valve body harness, temperature sensor, and valve body gasket.

Installed a new valve body gasket, harness, temperature sensor, and transmission oil filter. Washed oil pan, in the parts washer. Dried oil pan and installed back onto transmission. Tightened drain plug.

Filled transmission with 9.8 Qts of transmission fluid. Ran vehicle for about 15 mins. Change transmission through all the gears. Checked transmission oil level, it's on the full line. Test drove and then I checked transmissipon level again. At this time, transmission is shifting properly.

Placed back in service.

Activity Header

Activity: 10 999/999/999 TOTAL VEHICLE

Activity Note: PRA

Reason for Repair: SW Shop Work Order

Work Accomplished: 06 Inspect

Part Failure: 00 No Failure

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: PRA

Task: PRA and Meter Readings Performed by: RAUODRIGUEZ Performed on: 13-DEC-21

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		RAUODRIGUEZ	Dec 13, 2021 2:00:39 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		RAUODRIGUEZ	Dec 13, 2021 2:00:39 PM	No	
4 - Are you wearing the appropriate PPE?	Done		RAUODRIGUEZ	Dec 13, 2021 2:00:39 PM	No	
7 - Have you performed the proper LOTO?	Done		RAUODRIGUEZ	Dec 13, 2021 2:00:39 PM	No	
10 - Are you aware of the potential risks of performing this repair?	Done		RAUODRIGUEZ	Dec 13, 2021 2:00:39 PM	No	
11 - Have you successfully completed the Personal Risk Assessment?	Done		RAUODRIGUEZ	Dec 13, 2021 2:00:39 PM	No	

Activity Sub Total

Activity 10 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 55137036
Invoice No. 55345 - 55137036

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
check engine light on		Ford E450 Champion Challenger	
Requested By:	CVERGARA	Status:	40 - Closed (40)
Created By:	CVERGARA	Priority:	-
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	282,056 - DH

Activity Header
Activity:20 027/000/000 TRANSMISSION, MAIN, AUTOMATIC
Activity Note: VERIFY COMPLAINT
Reason for Repair: 08 Preventive Maintenance
Work Accomplished:
Part Failure:
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
27-Dec-21	4C3Z-7G276-AA	HARNESS, SOLENOID, INTERNAL, TRANSMISSION, 5R110W	1	166.07	166.07
14-Dec-21	8C3Z-7C155-A	GASKET, BODY, VALVE, TRANSMISSION, 5R110	1	7.22	7.22
14-Dec-21	BC3Z-7H141-A	SENSOR, TEMPERATURE, TRANSMISSION	1	11.8	11.8
13-Dec-21	20021	FILTER, TRANSMISSION 20021	1	17.44	17.44

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
13-Dec-21	Rodriguez,Raul	3	0	0

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available

Activity Sub Total	
Activity 20 Sub Total	
Parts:	202.53
Labor:	0.00
Labor Hours:	3.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	202.53

Work Order Footer	
Work Order 55137036 Total	
Parts:	202.53
Labor:	0.00
Labor Hours:	3.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	202.53



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 54884375
Invoice No. 55345 - 54884375

Client Department:

Department: 55345M

Work Order Description

55345-LIGHT DUTY PMA

Requested By: TDELVA

Created By: TDELVA

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 3 - High

Driver:

Phone:

ETA:

Meter: 278,887 - DH

Chronology

Reported	Oct 21, 2021 12:00:00 AM	Oct 21, 2021 12:00:00 AM
Started	Oct 21, 2021 8:27:00 PM	
Completed	Oct 22, 2021 12:11:00 AM	Oct 22, 2021 12:11:00 AM
Down Time		

Work Order Notes

Line 10 COMPLAINT: pmA

CAUSE: Service

CORRECTION:Perform pmA Service

Oil filter B329 qty1

Engine oil 10w30 qty 7 qts

Oil pan sipping oil

Activity Header

Activity:5 999/999/999 TOTAL VEHICLE

Activity Note: PERSONAL RISK ASSESSMENT

Reason for Repair: SW Shop Work Order

Work Accomplished: 06 Inspect

Part Failure: 00 No Failure

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: PERSONAL RISK ASSESSMENT

Task: PRA and Meter Readings Performed by: RGASPARD Performed on: 21-OCT-21

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		RGASPARD	Oct 21, 2021 8:26:57 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		RGASPARD	Oct 21, 2021 8:26:57 PM	No	
4 - Are you wearing the appropriate PPE?	Done		RGASPARD	Oct 21, 2021 8:26:57 PM	No	
7 - Have you performed the proper LOTO?	Done		RGASPARD	Oct 21, 2021 8:26:57 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO	
10 - Are you aware of the potential risks of performing this repair?	Done		RGASPARD	Oct 21, 2021 8:26:57 PM	No		
11 - Have you successfully completed the Personal Risk Assessment?	Done		RGASPARD	Oct 21, 2021 8:26:57 PM	No		
Activity Sub Total			Activity 5 Sub Total				
			Parts: 0.00				
			Labor: 0.00				
			Labor Hours: 0.00				
			Sublet Parts: 0.00				
			Sublet Labor: 0.00				
			Activity Sub Total 0.00				



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 54884375
Invoice No. 55345 - 54884375

Client Department:

Department: 55345M

Work Order Description

55345-LIGHT DUTY PMA

Requested By: TDELVA

Created By: TDELVA

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 3 - High

Driver:

Phone:

ETA:

Meter: 278,887 - DH

Activity Header

Activity: 10 079 DEVICES, SAFETY/STABILITY, TRAILER

Activity Note: Light Duty PMI

Reason for Repair: 05 Inspection, Routine

Work Accomplished:

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
21-Oct-21	Gaspard,Ronald	1.77	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List						
10 Desc: Light Duty PMI Task: First Transit North America Light Duty PM Inspection Sheet Performed by: RGASPARD Performed on: 21-OCT-21						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,000 - SECTION 1 - Preparation Inspection	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
10,100 - INSPECT_Auto-Transmission Operation/Controller; Neutral Safety Switch	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
10,200 - !FRA!INSPECT_Starter Operation	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
10,300 - !FRA!INSPECT_Warning Lights and Alarms	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
10,400 - !FRA!INSPECT_Back Up Alarm	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
10,500 - !FRA!INSPECT_Engine Operation, OBSERVE_Exhaust for Excessive Smoke	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
10,600 - Check Driver's Pre-trip or DVIR/EVIR & Authorization Forms	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
10,700 - INSPECT_All Exterior Lights (Turn on until Completion of this section)	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
10,800 - *RPT*INSPECT_Body Damage, Corrosion;DOCUMENT_Issues	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
10,900 - INSPECT_Fuel Tank Cap, and Doors	Done		RGASPARD	Oct 21, 2021	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
				10:46:11 PM		
11,100 - INSPECT_License Plate, Bracket, Bumpers	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
20,000 - SECTION 2 - Test Drive and Operator Area Inspection	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
20,100 - INSPECT_Driver Seat condition/operation/seatbelt	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
20,200 - TEST DRIVE_INSPECT_Proper Operation; Drive into Shop	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
20,300 - *RPT*INSPECT_Steering Wheel for Play/Bind/Horn Op./Turn Signal Cancelation	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
20,400 - PERFORM_Brake Test (Apply hard enough to check wheel pull and Application)	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
20,500 - *RPT*FRA INSPECT_Lighting/Operation of all Gauges	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
20,600 - *RPT*INSPECT_Windshields, Sun Visors	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
20,700 - INSPECT_Wiper/Washer Operation, Condition	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
20,800 - INSPECT_High Idle Control	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
20,900 - *RPT*!FRA!INSPECT_HVAC Controls, Operation	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
21,000 - *RPT*!FRA!INSPECT_Operation of all Switches and Accessories	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
21,100 - INSPECT_Parking Brake Operation	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
21,200 - !FRA!TEST_Service Brake Backup System (Stationary Brake Tests HYD)	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
21,300 - INSPECT_VIN, Tire Pressure Decal, Data Tags	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
21,400 - *RPT*INSPECT_Drivers Door Hinges, Handles, Controls and Panels	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
21,500 - !FRA!INSPECT_Under Dash Wiring for Proper Routing/Chafing/Securement	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
21,550 - INSPECT_Driver Floor Area for Rust/Water Leaks	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
21,600 - *RPT*INSPECT for WEAR_Pedal Pads, Accelerator, Brake, Parking Brake	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
21,700 - INSPECT_Engine Fault Codes	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
30,000 - SECTION 3 - EXTERIOR INSPECTION - Front	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
31,000 - SSF (Street Side Front)	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
31,010 - *RPT*!FRA!INSPECT_Mirror Mountings, Brackets, Glass	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
31,020 - *RPT*INSPECT_FRONT Springs, Shocks, Spring Shackles	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
31,030 - INSPECT_Mud Flaps, Brackets	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
31,040 - INSPECT_Wiper Blades, Arms	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
32,000 - Engine Inspection	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
32,010 - INSPECT_Hood, Springs and Props	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
32,020 - !FRA!INSPECT_Engine Compartment Condition for Fire Risk Avoidance	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
32,030 - !FRA!INSPECT_for Fluid Leaks, Levels	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
32,040 - !FRA!INSPECT_Hyd_Brake Fluid with Test Strips	Done	na	RGASPARD	Oct 21, 2021 10:46:11 PM	No	
32,050 - !FRA!INSPECT_RECORD_Coolant Recovery with Refractometer; Test Strips	Degree Fahrenheit	na	RGASPARD	Oct 21, 2021 10:46:11 PM	No	
32,060 - PRESSURE TEST_Cooling Systems (Radiator, Cap, hoses and clamps)	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
32,070 - *RPT*INSPECT_Radiator and Mountings, Cores	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
32,080 - *RPT*INSPECT_Fan Assembly, Shroud, Tensioner, Belts, All Belt Driven Components	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
32,090 - *RPT*!FRA!INSPECT_Mounting, Installation of Alternator, AC Compressor	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
32,100 - INSPECT_Intake System	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
32,140 - *RPT*!FRA!RECORD_Underhood Battery Voltages (volts)	14.24 Volt*		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
33,010 - CSF (Curb Side Front)	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
33,020 - *RPT*!FRA!INSPECT_Mirror Mountings, Brackets, Glass	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
33,030 - *RPT*INSPECT_FRONT Springs, Shocks, Spring Shackles	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
33,040 - INSPECT_Mud Flaps, Brackets	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
33,050 - INSPECT_Wiper Blades, Arms	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
33,060 - !FRA!INSPECT_LUBE_Battery Box, Batteries, Tray Slides, Hold Downs	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
33,070 - *RPT*!FRA!RECORD_Side Mounted Battery Voltages (volts)	Volt*	na	RGASPARD	Oct 21, 2021 10:46:11 PM	No	
33,080 - INSPECT_Entry door, OPEN_with external lock/switch (if equipped)	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
40,000 - SECTION 4 - Interior Inspection	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
40,100 - *RPT*INSPECT_Step-Well, Step-Tread, Hand Rails, Step-well Light	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
40,200 - INSPECT_Insurance/Registration/Regulatory Forms Dates	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
40,250 - INSPECT_Overhead Compartment for Water Leaks	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
40,300 - INSPECT_Safety Equipment, Fire	Done		RGASPARD	Oct 21, 2021	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
Extinguisher/Suppression				10:46:11 PM		
40,400 - INSPECT_Camera Systems, Filter, Electrical Inputs/Outputs-SOP M038	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
40,600 - !FRA!CHECK for HOTSPOTS_Interior Elec Panel Fuses/Circuit Breakers/Connectors	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
40,700 - *RPT*INSPECT_Seats, Covering, Belts, Loose Cushions, Operation	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
40,800 - *RPT*!FRA!INSPECT_Interior Lights; Mirrors	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
40,900 - !FRA!INSPECT_Interior Cleanliness/Potential Projectiles	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
41,000 - INSPECT_All ADA Equip (Lift Seat Belt, floor hold Downs, Belts, Cover, Alarms)	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
41,100 - INSPECT_CLEAN_AC Filter	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
41,200 - INSPECT_Emergency Windows,Hatches,Doors,Alarms/Lights;CHECK_for Leaks	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
41,300 - *RPT*INSPECT_Interior Body, Floor, Stanchions	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
41,400 - *RPT*INSPECT_Passenger Doors, Glass, Seal	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
50,000 - SECTION 5 - UNDER VEHICLE INSPECTION	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
50,100 - *RPT*INSPECT_Steering components-Drag Link, Tie Rods ends and Steering Damper	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
50,200 - INSPECT_Ball Joint Play	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
50,300 - !FRA!INSPECT_Front Wheel Bearings for Play	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
50,400 - LUBE_All Chassis Components	Done	na	RGASPARD	Oct 21, 2021 10:46:11 PM	No	
50,500 - !FRA!CHANGE_Engine oil,filters	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
50,700 - INSPECT_Tire Condition	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
50,800 - INSPECT_Tire Valve Stems, Double Check Caps	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
50,900 - !FRA!INSPECT_Wheels for Cracks, Loose Lugs/Indicators, Outer Hub Leaks	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
51,000 - RECORD_LF-Tire Tread Depth (32nds)	8 32nds of an inch		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
51,100 - RECORD_LF-Tire Air Pressure (psi)	70 Pounds per Square Inch		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
51,200 - RECORD_RF-Tire Tread Depth (32nds)	5 32nds of an inch		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
51,300 - RECORD_RF-Air Pressure (psi)	70 Pounds per Square Inch		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
51,400 - !FRA!INSPECT_FRONT ABS Tone Rings, Sensors, Routing of Cables	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
51,500 - !FRA!INSPECT_Wheel Seals for Leaks	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
51,600 - !FRA!INSPECT_ Front Brake Assemblies	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
51,700 - MEASURE_RECORD_LF - Brake Lining, Pad Thickness (32nds)	7 32nds of an inch		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
51,800 - MEASURE_RECORD_RF - Brake Lining, Pad Thickness (32nds)	7 32nds of an inch		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
51,900 - INSPECT VISUALLY_RECORD_LF Rotor Condition (inches)	38 Inch		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
52,000 - INSPECT VISUALLY_RECORD_RF Rotor Condition (inches)	38 Inch		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
52,100 - INSPECT_Vibration Damper	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
52,200 - !FRA!INSPECT_Battery Cable Routing from Battery Box to Starter	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
52,400 - !FRA!INSPECT_Starter Mounting	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
52,500 - !FRA!INSPECT_Engine Exhaust System	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
52,700 - INSPECT_Engine, Transmission Mounts	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
52,800 - !FRA!INSPECT_Engine, Transmission for Fluid Leaks	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
52,900 - INSPECT_Shift Cable Adjustment - All Transmissions	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
53,000 - !FRA!INSPECT_Transmission Breather and Clean	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
53,100 - *RPT*!FRA!INSPECT_Parking Brake Cables, Shoes for Wear, Contamination	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
53,200 - *RPT*INSPECT_A/C Condensor, Fans, Safety Grills	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
53,300 - *RPT*INSPECT_Driveline, Hanger Bearings, U-Joints, Slip Joints, Safety Loop	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
53,400 - *RPT*INSPECT_All Body Mounts and Chassis Frame for Corrosion, Cracks	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
53,500 - !FRA!INSPECT_Fuel Tank, Mountings, Lines	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
53,600 - INSPECT_Tire Condition	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
53,700 - INSPECT_Tire Valve Stems, Double Check Caps	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
53,800 - INSPECT_Mismatched Tire Tread, Casing Design	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
53,900 - INSPECT_Dual Mating Tires w/Square	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
54,000 - !FRA!INSPECT_Wheels for Cracks, Loose Lugs/Indicators, Outer Hub Leaks	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
54,100 - INSPECT_Mud Flaps, Brackets	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
54,200 - RECORD_RRO-Tire Tread Depth (32nds)	4 32nds of an inch		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
54,300 - RECORD_RRI-Tire Tread Depth (32nds)	4 32nds of an inch		RGASPARD	Oct 21, 2021 10:46:11 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
54,400 - RECORD_RRO-Air Pressure (psi)	65 Pounds per Square Inch		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
54,500 - RECORD_RRI-Air Pressure (psi)	65 Pounds per Square Inch		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
54,600 - RECORD_LRO-Tire Tread Depth (32nds)	4 32nds of an inch		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
54,700 - RECORD_LRI-Tire Tread Depth (32nds)	4 32nds of an inch		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
54,800 - RECORD_LRO-Air Pressure (psi)	65 Pounds per Square Inch		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
54,900 - RECORD_LRI-Air Pressure (psi)	65 Pounds per Square Inch		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
55,000 - !FRA!INSPECT_ REAR Brake Assemblies	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
55,100 - !FRA!INSPECT_ REAR Hubs, Wheel Seals for Oil Leaks	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
55,200 - !FRA!INSPECT_REAR ABS Tone Rings, Sensors, Routing Of Cables (if equipped)	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
55,300 - MEASURE_RECORD_LR - Brake Lining, Pad Thickness (32nds)	8 32nds of an inch		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
55,400 - MEASURE_RECORD_RR - Brake Lining, Pad Thickness (32nds)	8 32nds of an inch		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
55,500 - INSPECT VISUALLY_MEASURE_RECORD_LR Drum, Rotor Condition (inches)	40 Inch		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
55,600 - INSPECT VISUALLY_MEASURE_RECORD_RR Drum, Rotor Condition (inches)	40 Inch		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
55,700 - !FRA!INSPECT_ Under Body Exhaust System	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
55,800 - *RPT*INSPECT_ REAR Axle Housing, Breather; CLEAN_Breather	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
55,900 - *RPT*INSPECT_ REAR Springs, Shocks, Suspension, Airbags	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
60,000 - SECTION 6 - Wheelchair Inspection	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
60,100 - RECORD_Wheelchair Cycle Count	12465 Cycles		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
60,200 - CHECK_ Lift Access Door for Ease of Opening,Latch Security,Door Hold Back	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
60,300 - CHECK_Platform Emergency Release Mechanism for Ease of Operation	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
60,400 - OPERATE_ Lift thru Complete Cycle;CHECK_Noises,Jerky Op,Too Fast-Slow,Drift Down	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
60,500 - INSPECT_ Bridgeplate Operation	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
60,600 - INSPECT_All Pivot Points for Wear and Looseness	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
60,700 - INSPECT_Rollers for Wear and Smooth Rotation	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
60,800 - INSPECT_Operation of Platform Barrier Mechanism	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
60,900 - INSPECT_Cam Slots for Wear and Proper	Done		RGASPARD	Oct 21, 2021	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
Alignment				10:46:11 PM		
61,000 - INSPECT_Cable Condition (If Applicable)	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
61,100 - INSPECT_Hydraulic Hoses for Leaks, Chafing or Cracks	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
61,200 - INSPECT_Electrical Connections and Routing of Wires and Cables	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
61,300 - INSPECT_Operation and Adjustment of All Safety Switches	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
61,400 - INSPECT_All Lift Mounting Brackets for Loose Bolts Broken Welds, etc.	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
61,500 - INSPECT_Manual Back-up Raise/Lower System (If Applicable)	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
61,600 - INSPECT_HydrPump Reservoir Oil Level. Consult SvcManual for Fluid to Use.	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
61,700 - CHECK_Operator Decals for Proper Positioning;CONSULT_Service Manual	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
61,800 - CHECK_WC Holddowns Inside Vehicle for Secure Mounting,Proper Operation	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
61,900 - CLEAN_Linkages and Mechanisms	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
62,000 - LUBRICATE_Linkages and Mechanisms (DO NOT OVER Lubricate)	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
62,100 - INSPECT_Emergency Platform Release Mechanism	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
62,200 - INSPECT_Platform Barrier Latch Mechanism	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
62,300 - INSPECT_Bridgeplate Hinge	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
62,400 - INSPECT_All Pivot Points	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
62,500 - INSPECT_Cams and Slots	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
62,600 - INSPECT_Rollers	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
62,700 - INSPECT_All Linkages	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
70,000 - SECTION 7 - ALTERNATIVE FUELS INSPECTION	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
70,300 - INSPECT_Condition of Fuel Pressure Gauge	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
70,400 - PROVIDE PROOF_Tank_Dents/Scratches and Re-Certification	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
70,500 - INSPECT_Tank test date, labels-Reference-ST.4 FMMVSS 304 & ANSI-CSA NGV2	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
70,600 - INSPECT_Tank Lines to Ensure Secure Mounting, Insulation Against Vibration	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
70,700 - INSPECT_Filling Nozzle for Securely Fitting Cap	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
70,800 - INSPECT_Pressure Relief Device's Venting System, Valves, Ducting to MNFR Specs	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
80,000 - SECTION 8 - PMI Report Completion	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
80,100 - COMPLETE_PM Report; Follow-ups	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
80,200 - RETURN_Vehicle to Predetermined Location	Done		RGASPARD	Oct 21, 2021 10:46:11 PM	No	
Activity Sub Total						
				Activity 10 Sub Total		
				Parts:		0.00
				Labor:		0.00
				Labor Hours:		1.77
				Sublet Parts:		0.00
				Sublet Labor:		0.00
				Activity Sub Total		0.00

Parts:	0.00
Labor:	0.00

	Labor Hours:	0.50
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	0.00
Work Order Footer		
	Work Order 54884375 Total	
	Parts:	0.00
	Labor:	0.00
	Labor Hours:	2.27
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 54931344
Invoice No. 55345 - 54931344

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Replace Drain Plug		Ford E450 Champion Challenger	
Requested By:	AOWENS	Status:	40 - Closed (40)
Created By:	AOWENS	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	276,669 - DH

Chronology		
Reported	Sep 24, 2021 5:17:00 PM	Sep 24, 2021 5:17:00 PM
Started		
Completed	Sep 24, 2021 5:29:00 PM	Sep 24, 2021 5:29:00 PM
Down Time		

Work Order Notes

- Line 10 To file warranty be sure to do the following:
- 1) Enter a COMPLAINT statement for each activity.
 - 2) Enter CAUSE statement in the Notes field of each activity.
 - 3) Enter CORRECTION statement in the Comment section of each activity.

Complaint:

Cause:

Correction:

Activity Header
Activity: 5 999 TOTAL VEHICLE
Activity Note: Personal Risk Assessment
Reason for Repair: SW Shop Work Order
Work Accomplished: 06 Inspect
Part Failure:
Activity Comments:
Activity Parts
No Data Available
Activity Labor
No Data Available
Activity Sublet
No Data Available
Activity Checklist
Check List
5 Desc: Personal Risk Assessment Task: PRA and Meter Readings Performed by: AOWENS Performed on: 24-SEP-21

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		AOWENS	Sep 24, 2021 5:27:45 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		AOWENS	Sep 24, 2021 5:27:45 PM	No	
4 - Are you wearing the appropriate PPE?	Done		AOWENS	Sep 24, 2021 5:27:45 PM	No	
7 - Have you performed the proper LOTO?	Done		AOWENS	Sep 24, 2021 5:27:45 PM	No	
10 - Are you aware of the potential risks of performing this repair?	Done		AOWENS	Sep 24, 2021 5:27:45 PM	No	
11 - Have you successfully completed the Personal Risk Assessment?	Done		AOWENS	Sep 24, 2021 5:27:45 PM	No	

Activity Sub Total

Activity 5 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 54931344
Invoice No. 55345 - 54931344

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Replace Drain Plug		Ford E450 Champion Challenger	
Requested By:	AOWENS	Status:	40 - Closed (40)
Created By:	AOWENS	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	276,669 - DH

Activity Header
Activity:15 079 DEVICES, SAFETY/STABILITY, TRAILER
Activity Note: Replace Leaking Drain Plug
Reason for Repair: 05 Inspection, Routine
Work Accomplished:
Part Failure:
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
24-Sep-21	65266	PLUG, DRAIN, OIL, ENGINE	1	4.25	4.25

Activity Labor
No Data Available

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available

Activity Sub Total		Activity 15 Sub Total	
		Parts:	4.25
		Labor:	0.00
		Labor Hours:	0.00
		Sublet Parts:	0.00
		Sublet Labor:	0.00
		Activity Sub Total	4.25

Work Order Footer		Work Order 54931344 Total	
		Parts:	4.25
		Labor:	0.00
		Labor Hours:	0.00
		Sublet Parts:	0.00
		Sublet Labor:	0.00
		Activity Sub Total	4.25



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 54917099
Invoice No. 55345 - 54917099

Client Department:

Department: 55345M

Work Order Description

Road Call

Requested By: JUHURST

Created By: JUHURST

Assigned To:

Class: WORC - WORK ORDER ROAD CALL

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 3 - High

Driver:

Phone:

ETA:

Meter: 275,879 - DH

Chronology

Reported	Sep 20, 2021 5:08:18 PM	Sep 20, 2021 5:08:18 PM
Started	Sep 20, 2021 9:18:00 PM	
Completed	Sep 21, 2021 12:27:00 PM	Sep 21, 2021 12:27:00 PM
Down Time		

Work Order Notes

Line 10 To file warranty be sure to do the following:

- 1) Enter a COMPLAINT statement for each activity.
- 2) Enter CAUSE statement in the Notes field of each activity.
- 3) Enter CORRECTION statement in the Comment section of each activity.

Complaint: Flat left front

Cause: nail

Correction: Arrived to and change the flat after return back to shop 9PM

Activity Header						
Activity: 5 999 TOTAL VEHICLE						
Activity Note: PRAMETER						
Reason for Repair: SW Shop Work Order						
Work Accomplished: 06 Inspect						
Part Failure:						
Activity Comments:						
Activity Parts						
No Data Available						
Activity Labor						
No Data Available						
Activity Sublet						
No Data Available						
Activity Checklist						
Check List						
5 Desc: PRAMETER						
Task: PRA and Meter Readings Performed by: JUHURST Performed on: 21-SEP-21						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		JUHURST	Sep 21, 2021 12:26:41 PM	No	
2 - If task requires lifting, are lifts secured, are jack	Done		JUHURST	Sep 21, 2021	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
stands used correctly?				12:26:41 PM		
4 - Are you wearing the appropriate PPE?	Done		JUHURST	Sep 21, 2021 12:26:41 PM	No	
7 - Have you performed the proper LOTO?	Done		JUHURST	Sep 21, 2021 12:26:41 PM	No	
10 - Are you aware of the potential risks of performing this repair?	Done		JUHURST	Sep 21, 2021 12:26:41 PM	No	
11 - Have you successfully completed the Personal Risk Assessment?	Done		JUHURST	Sep 21, 2021 12:26:41 PM	No	

Activity Sub Total

Activity 5 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 54917099
Invoice No. 55345 - 54917099

Client Department:

Department: 55345M

Work Order Description

Road Call

Requested By: JUHURST

Created By: JUHURST

Assigned To:

Class: WORC - WORK ORDER ROAD CALL

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 3 - High

Driver:

Phone:

ETA:

Meter: 275,879 - DH

Activity Header

Activity: 10 999 TOTAL VEHICLE

Activity Note: ROAD CALL

Reason for Repair: 10 Road Call

Work Accomplished:

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
20-Sep-21	Junior Hurst	1.15	0	0

Activity Sublet

No Data Available

Activity Checklist

No Data Available

No Data Available

Activity Sub Total

Activity 10 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	1.15
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00

Work Order Footer

Work Order 54917099 Total

Parts:	0.00
Labor:	0.00
Labor Hours:	1.15
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 54802382
Invoice No. 55345 - 54802382

Client Department:

Department: 55345M

Work Order Description

55345-LIGHT DUTY PMA

Requested By: HPIERRE

Created By: HPIERRE

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 3 - High

Driver:

Phone:

ETA:

Meter: 274,615 - DH

Chronology

Reported	Sep 7, 2021 12:00:00 AM	Sep 7, 2021 12:00:00 AM
Started	Sep 9, 2021 10:01:00 AM	
Completed	Sep 9, 2021 3:10:00 PM	Sep 9, 2021 3:10:00 PM
Down Time		

Work Order Notes

Line 10 COMPLAINT: PMA

CAUSE: PMA service due

CORRECTION: Performed and completed PMA

Activity Header

Activity: 5 999/999/999 TOTAL VEHICLE

Activity Note: PERSONAL RISK ASSESSMENT

Reason for Repair: SW Shop Work Order

Work Accomplished: 06 Inspect

Part Failure: 00 No Failure

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: PERSONAL RISK ASSESSMENT

Task: PRA and Meter Readings Performed by: TDELVA Performed on: 09-SEP-21

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		TDELVA	Sep 9, 2021 2:57:26 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		TDELVA	Sep 9, 2021 2:57:26 PM	No	
4 - Are you wearing the appropriate PPE?	Done		TDELVA	Sep 9, 2021 2:57:26 PM	No	
7 - Have you performed the proper LOTO?	Done		TDELVA	Sep 9, 2021 2:57:26 PM	No	
10 - Are you aware of the potential risks of performing this repair?	Done		TDELVA	Sep 9, 2021 2:57:26 PM	No	
11 - Have you successfully completed the Personal	Done		TDELVA	Sep 9, 2021	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO	
Risk Assessment?				2:57:26 PM			
20 - Miles			TDELVA	Sep 9, 2021 2:57:26 PM	No		
30 - Kilometers			TDELVA	Sep 9, 2021 2:57:26 PM	No		
40 - Hours			TDELVA	Sep 9, 2021 2:57:26 PM	No		
Activity Sub Total							
				Activity 5 Sub Total			
				Parts:			0.00
				Labor:			0.00
				Labor Hours:			0.00
				Sublet Parts:			0.00
				Sublet Labor:			0.00
				Activity Sub Total			0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 54802382
Invoice No. 55345 - 54802382

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
55345-LIGHT DUTY PMA		Ford E450 Champion Challenger	
Requested By:	HPIERRE	Status:	40 - Closed (40)
Created By:	HPIERRE	Priority:	3 - High
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	274,615 - DH

Activity Header																																																																																																								
Activity: 10																																																																																																								
Activity Note: Light Duty PMI																																																																																																								
Reason for Repair:																																																																																																								
Work Accomplished:																																																																																																								
Part Failure:																																																																																																								
Activity Comments:																																																																																																								
Activity Parts																																																																																																								
No Data Available																																																																																																								
Activity Labor																																																																																																								
<table><tr><th>Booked Date</th><th>Technician</th><th>Hours</th><th>Shop Rate</th><th>Extended</th></tr><tr><td>09-Sep-21</td><td>Delva,Terry</td><td>3.23</td><td>0</td><td>0</td></tr></table>							Booked Date	Technician	Hours	Shop Rate	Extended	09-Sep-21	Delva,Terry	3.23	0	0																																																																																								
Booked Date	Technician	Hours	Shop Rate	Extended																																																																																																				
09-Sep-21	Delva,Terry	3.23	0	0																																																																																																				
Activity Sublet																																																																																																								
No Data Available																																																																																																								
Activity Checklist																																																																																																								
<table><tr><th colspan="7">Check List</th></tr><tr><td colspan="7">10 Desc: Light Duty PMI</td></tr><tr><td colspan="7">Task: First Transit North America Light Duty PM Inspection Sheet Performed by: TDELVA Performed on: 09-SEP-21</td></tr><tr><th>Inspection Item</th><th>RESULTS</th><th>Inspector's Note</th><th>Inspector</th><th>Date Inspected</th><th>Follow Up Needed</th><th>Follow Up WO</th></tr><tr><td>10,000 - SECTION 1 - Preparation Inspection</td><td>Done</td><td></td><td>TDELVA</td><td>Sep 9, 2021 2:56:29 PM</td><td>No</td><td></td></tr><tr><td>10,100 - INSPECT_Auto-Transmission Operation/Controller; Neutral Safety Switch</td><td>Done</td><td></td><td>TDELVA</td><td>Sep 9, 2021 2:56:29 PM</td><td>No</td><td></td></tr><tr><td>10,200 - !FRA!INSPECT_Starter Operation</td><td>Done</td><td></td><td>TDELVA</td><td>Sep 9, 2021 2:56:29 PM</td><td>No</td><td></td></tr><tr><td>10,300 - !FRA!INSPECT_Warning Lights and Alarms</td><td>Done</td><td></td><td>TDELVA</td><td>Sep 9, 2021 2:56:29 PM</td><td>No</td><td></td></tr><tr><td>10,400 - !FRA!INSPECT_Back Up Alarm</td><td>Done</td><td></td><td>TDELVA</td><td>Sep 9, 2021 2:56:29 PM</td><td>No</td><td></td></tr><tr><td>10,500 - !FRA!INSPECT_Engine Operation, OBSERVE_Exhaust for Excessive Smoke</td><td>Done</td><td></td><td>TDELVA</td><td>Sep 9, 2021 2:56:29 PM</td><td>No</td><td></td></tr><tr><td>10,600 - Check Driver's Pre-trip or DVIR/EVIR & Authorization Forms</td><td>Done</td><td></td><td>TDELVA</td><td>Sep 9, 2021 2:56:29 PM</td><td>No</td><td></td></tr><tr><td>10,700 - INSPECT_All Exterior Lights (Turn on until Completion of this section)</td><td>Done</td><td></td><td>TDELVA</td><td>Sep 9, 2021 2:56:29 PM</td><td>No</td><td></td></tr><tr><td>10,800 - *RPT*INSPECT_Body Damage, Corrosion;DOCUMENT_Issues</td><td>Done</td><td></td><td>TDELVA</td><td>Sep 9, 2021 2:56:29 PM</td><td>No</td><td></td></tr><tr><td>10,900 - INSPECT_Fuel Tank Cap, and Doors</td><td>Done</td><td></td><td>TDELVA</td><td>Sep 9, 2021 2:56:29 PM</td><td>No</td><td></td></tr></table>							Check List							10 Desc: Light Duty PMI							Task: First Transit North America Light Duty PM Inspection Sheet Performed by: TDELVA Performed on: 09-SEP-21							Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO	10,000 - SECTION 1 - Preparation Inspection	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No		10,100 - INSPECT_Auto-Transmission Operation/Controller; Neutral Safety Switch	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No		10,200 - !FRA!INSPECT_Starter Operation	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No		10,300 - !FRA!INSPECT_Warning Lights and Alarms	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No		10,400 - !FRA!INSPECT_Back Up Alarm	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No		10,500 - !FRA!INSPECT_Engine Operation, OBSERVE_Exhaust for Excessive Smoke	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No		10,600 - Check Driver's Pre-trip or DVIR/EVIR & Authorization Forms	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No		10,700 - INSPECT_All Exterior Lights (Turn on until Completion of this section)	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No		10,800 - *RPT*INSPECT_Body Damage, Corrosion;DOCUMENT_Issues	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No		10,900 - INSPECT_Fuel Tank Cap, and Doors	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
Check List																																																																																																								
10 Desc: Light Duty PMI																																																																																																								
Task: First Transit North America Light Duty PM Inspection Sheet Performed by: TDELVA Performed on: 09-SEP-21																																																																																																								
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO																																																																																																		
10,000 - SECTION 1 - Preparation Inspection	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No																																																																																																			
10,100 - INSPECT_Auto-Transmission Operation/Controller; Neutral Safety Switch	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No																																																																																																			
10,200 - !FRA!INSPECT_Starter Operation	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No																																																																																																			
10,300 - !FRA!INSPECT_Warning Lights and Alarms	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No																																																																																																			
10,400 - !FRA!INSPECT_Back Up Alarm	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No																																																																																																			
10,500 - !FRA!INSPECT_Engine Operation, OBSERVE_Exhaust for Excessive Smoke	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No																																																																																																			
10,600 - Check Driver's Pre-trip or DVIR/EVIR & Authorization Forms	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No																																																																																																			
10,700 - INSPECT_All Exterior Lights (Turn on until Completion of this section)	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No																																																																																																			
10,800 - *RPT*INSPECT_Body Damage, Corrosion;DOCUMENT_Issues	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No																																																																																																			
10,900 - INSPECT_Fuel Tank Cap, and Doors	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No																																																																																																			

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
11,100 - INSPECT_License Plate, Bracket, Bumpers	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
20,000 - SECTION 2 - Test Drive and Operator Area Inspection	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
20,100 - INSPECT_Driver Seat condition/operation/seatbelt	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
20,200 - TEST DRIVE_INSPECT_Proper Operation; Drive into Shop	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
20,300 - *RPT*INSPECT_Steering Wheel for Play/Bind/Horn Op./Turn Signal Cancelation	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
20,400 - PERFORM_Brake Test (Apply hard enough to check wheel pull and Application)	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
20,500 - *RPT*FRA INSPECT_Lighting/Operation of all Gauges	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
20,600 - *RPT*INSPECT_Windshields, Sun Visors	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
20,700 - INSPECT_Wiper/Washer Operation, Condition	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
20,800 - INSPECT_High Idle Control	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
20,900 - *RPT*!FRA!INSPECT_HVAC Controls, Operation	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
21,000 - *RPT*!FRA!INSPECT_Operation of all Switches and Accessories	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
21,100 - INSPECT_Parking Brake Operation	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
21,200 - !FRA!TEST_Service Brake Backup System (Stationary Brake Tests HYD)	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
21,300 - INSPECT_VIN, Tire Pressure Decal, Data Tags	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
21,400 - *RPT*INSPECT_Drivers Door Hinges, Handles, Controls and Panels	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
21,500 - !FRA!INSPECT_Under Dash Wiring for Proper Routing/Chafing/Securement	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
21,550 - INSPECT_Driver Floor Area for Rust/Water Leaks	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
21,600 - *RPT*INSPECT for WEAR_Pedal Pads, Accelerator, Brake, Parking Brake	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
21,700 - INSPECT_Engine Fault Codes	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
30,000 - SECTION 3 - EXTERIOR INSPECTION - Front	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
31,000 - SSF (Street Side Front)	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
31,010 - *RPT*!FRA!INSPECT_Mirror Mountings, Brackets, Glass	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
31,020 - *RPT*INSPECT_FRONT Springs, Shocks, Spring Shackles	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
31,030 - INSPECT_Mud Flaps, Brackets	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
31,040 - INSPECT_Wiper Blades, Arms	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
32,000 - Engine Inspection	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
32,010 - INSPECT_Hood, Springs and Props	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
32,020 - !FRA!INSPECT_Engine Compartment Condition for Fire Risk Avoidance	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
32,030 - !FRA!INSPECT_for Fluid Leaks, Levels	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
32,040 - !FRA!INSPECT_Hyd_Brake Fluid with Test Strips	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
32,050 - !FRA!INSPECT_RECORD_Coolant Recovery with Refractometer; Test Strips	Degree Fahrenheit	na	TDELVA	Sep 9, 2021 2:56:29 PM	No	
32,060 - PRESSURE TEST_Cooling Systems (Radiator, Cap, hoses and clamps)	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
32,070 - *RPT*INSPECT_Radiator and Mountings, Cores	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
32,080 - *RPT*INSPECT_Fan Assembly, Shroud, Tensioner, Belts, All Belt Driven Components	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
32,090 - *RPT*!FRA!INSPECT_Mounting, Installation of Alternator, AC Compressor	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
32,100 - INSPECT_Intake System	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
32,140 - *RPT*!FRA!RECORD_Underhood Battery Voltages (volts)	Volt*	na	TDELVA	Sep 9, 2021 2:56:29 PM	No	
33,010 - CSF (Curb Side Front)	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
33,020 - *RPT*!FRA!INSPECT_Mirror Mountings, Brackets, Glass	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
33,030 - *RPT*INSPECT_FRONT Springs, Shocks, Spring Shackles	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
33,040 - INSPECT_Mud Flaps, Brackets	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
33,050 - INSPECT_Wiper Blades, Arms	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
33,060 - !FRA!INSPECT_LUBE_Battery Box, Batteries, Tray Slides, Hold Downs	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
33,070 - *RPT*!FRA!RECORD_Side Mounted Battery Voltages (volts)	12.8 Volt*		TDELVA	Sep 9, 2021 2:56:29 PM	No	
33,080 - INSPECT_Entry door, OPEN_with external lock/switch (if equipped)	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
40,000 - SECTION 4 - Interior Inspection	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
40,100 - *RPT*INSPECT_Step-Well, Step-Tread, Hand Rails, Step-well Light	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
40,200 - INSPECT_Insurance/Registration/Regulatory Forms Dates	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
40,250 - INSPECT_Overhead Compartment for Water Leaks	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
40,300 - INSPECT_Safety Equipment, Fire Extinguisher/Suppression	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
40,400 - INSPECT_Camera Systems, Filter, Electrical Inputs/Outputs-SOP M038	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
40,600 - !FRA!CHECK for HOTSPOTS_Interior Elec Panel Fuses/Circuit Breakers/Connectors	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
40,700 - *RPT*INSPECT_Seats, Covering, Belts, Loose Cushions, Operation	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
40,800 - *RPT*!FRA!INSPECT_Interior Lights; Mirrors	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
40,900 - !FRA!INSPECT_Interior Cleanliness/Potential Projectiles	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
41,000 - INSPECT_All ADA Equip (Lift Seat Belt, floor hold Downs, Belts, Cover, Alarms)	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
41,100 - INSPECT_CLEAN_AC Filter	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
41,200 - INSPECT_Emergency Windows,Hatches,Doors,Alarms/Lights;CHECK_for Leaks	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
41,300 - *RPT*INSPECT_Interior Body, Floor, Stanchions	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
41,400 - *RPT*INSPECT_Passenger Doors, Glass, Seal	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
50,000 - SECTION 5 - UNDER VEHICLE INSPECTION	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
50,100 - *RPT*INSPECT_Steering components-Drag Link, Tie Rods ends and Steering Damper	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
50,200 - INSPECT_Ball Joint Play	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
50,300 - !FRA!INSPECT_Front Wheel Bearings for Play	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
50,400 - LUBE_All Chassis Components	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
50,500 - !FRA!CHANGE_Engine oil,filters	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
50,700 - INSPECT_Tire Condition	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
50,800 - INSPECT_Tire Valve Stems, Double Check Caps	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
50,900 - !FRA!INSPECT_Wheels for Cracks, Loose Lugs/Indicators, Outer Hub Leaks	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
51,000 - RECORD_LF-Tire Tread Depth (32nds)	10 32nds of an inch		TDELVA	Sep 9, 2021 2:56:29 PM	No	
51,100 - RECORD_LF-Tire Air Pressure (psi)	65 Pounds per Square Inch		TDELVA	Sep 9, 2021 2:56:29 PM	No	
51,200 - RECORD_RF-Tire Tread Depth (32nds)	10 32nds of an inch		TDELVA	Sep 9, 2021 2:56:29 PM	No	
51,300 - RECORD_RF-Air Pressure (psi)	65 Pounds per Square Inch		TDELVA	Sep 9, 2021 2:56:29 PM	No	
51,400 - !FRA!INSPECT_FRONT ABS Tone Rings, Sensors, Routing of Cables	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
51,500 - !FRA!INSPECT_Wheel Seals for Leaks	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
51,600 - !FRA!INSPECT_Front Brake Assemblies	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
51,700 - MEASURE_RECORD_LF - Brake Lining, Pad Thickness (32nds)	8 32nds of an inch		TDELVA	Sep 9, 2021 2:56:29 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
51,800 - MEASURE_RECORD_RF - Brake Lining, Pad Thickness (32nds)	8 32nds of an inch		TDELVA	Sep 9, 2021 2:56:29 PM	No	
51,900 - INSPECT VISUALLY_RECORD_LF Rotor Condition (inches)	38.7 Inch		TDELVA	Sep 9, 2021 2:56:29 PM	No	
52,000 - INSPECT VISUALLY_RECORD_RF Rotor Condition (inches)	38.7 Inch		TDELVA	Sep 9, 2021 2:56:29 PM	No	
52,100 - INSPECT_Vibration Damper	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
52,200 - !FRA!INSPECT_Battery Cable Routing from Battery Box to Starter	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
52,400 - !FRA!INSPECT_Starter Mounting	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
52,500 - !FRA!INSPECT_Engine Exhaust System	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
52,700 - INSPECT_Engine, Transmission Mounts	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
52,800 - !FRA!INSPECT_Engine, Transmission for Fluid Leaks	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
52,900 - INSPECT_Shift Cable Adjustment - All Transmissions	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
53,000 - !FRA!INSPECT_Transmission Breather and Clean	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
53,100 - *RPT*!FRA!INSPECT_Parking Brake Cables, Shoes for Wear, Contamination	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
53,200 - *RPT*INSPECT_A/C Condensor, Fans, Safety Grills	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
53,300 - *RPT*INSPECT_Driveline, Hanger Bearings, U-Joints, Slip Joints, Safety Loop	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
53,400 - *RPT*INSPECT_All Body Mounts and Chassis Frame for Corrosion, Cracks	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
53,500 - !FRA!INSPECT_Fuel Tank, Mountings, Lines	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
53,600 - INSPECT_Tire Condition	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
53,700 - INSPECT_Tire Valve Stems, Double Check Caps	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
53,800 - INSPECT_Mismatched Tire Tread, Casing Design	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
53,900 - INSPECT_Dual Mating Tires w/Square	-	na	TDELVA	Sep 9, 2021 2:56:29 PM	No	
54,000 - !FRA!INSPECT_Wheels for Cracks, Loose Lugs/Indicators, Outer Hub Leaks	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
54,100 - INSPECT_Mud Flaps, Brackets	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
54,200 - RECORD_RRO-Tire Tread Depth (32nds)	10 32nds of an inch		TDELVA	Sep 9, 2021 2:56:29 PM	No	
54,300 - RECORD_RRI-Tire Tread Depth (32nds)	10 32nds of an inch		TDELVA	Sep 9, 2021 2:56:29 PM	No	
54,400 - RECORD_RRO-Air Pressure (psi)	65 Pounds per Square Inch		TDELVA	Sep 9, 2021 2:56:29 PM	No	
54,500 - RECORD_RRI-Air Pressure (psi)	65 Pounds per Square Inch		TDELVA	Sep 9, 2021 2:56:29 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
54,600 - RECORD_LRO-Tire Tread Depth (32nds)	10 32nds of an inch		TDELVA	Sep 9, 2021 2:56:29 PM	No	
54,700 - RECORD_LRI-Tire Tread Depth (32nds)	10 32nds of an inch		TDELVA	Sep 9, 2021 2:56:29 PM	No	
54,800 - RECORD_LRO-Air Pressure (psi)	65 Pounds per Square Inch		TDELVA	Sep 9, 2021 2:56:29 PM	No	
54,900 - RECORD_LRI-Air Pressure (psi)	65 Pounds per Square Inch		TDELVA	Sep 9, 2021 2:56:29 PM	No	
55,000 - !FRA!INSPECT_ REAR Brake Assemblies	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
55,100 - !FRA!INSPECT_ REAR Hubs, Wheel Seals for Oil Leaks	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
55,200 - !FRA!INSPECT_ REAR ABS Tone Rings, Sensors, Routing Of Cables (if equipped)	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
55,300 - MEASURE_RECORD_LR - Brake Lining, Pad Thickness (32nds)	8 32nds of an inch		TDELVA	Sep 9, 2021 2:56:29 PM	No	
55,400 - MEASURE_RECORD_RR - Brake Lining, Pad Thickness (32nds)	8 32nds of an inch		TDELVA	Sep 9, 2021 2:56:29 PM	No	
55,500 - INSPECT VISUALLY_MEASURE_RECORD_LR Drum, Rotor Condition (inches)	36.5 Inch		TDELVA	Sep 9, 2021 2:56:29 PM	No	
55,600 - INSPECT VISUALLY_MEASURE_RECORD_RR Drum, Rotor Condition (inches)	36.5 Inch		TDELVA	Sep 9, 2021 2:56:29 PM	No	
55,700 - !FRA!INSPECT_ Under Body Exhaust System	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
55,800 - *RPT*INSPECT_ REAR Axle Housing, Breather; CLEAN_Breather	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
55,900 - *RPT*INSPECT_ REAR Springs, Shocks, Suspension, Airbags	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
60,000 - SECTION 6 - Wheelchair Inspection	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
60,100 - RECORD_Wheelchair Cycle Count	0 Cycles		TDELVA	Sep 9, 2021 2:56:29 PM	No	
60,200 - CHECK_ Lift Access Door for Ease of Opening,Latch Security,Door Hold Back	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
60,300 - CHECK_Platform Emergency Release Mechanism for Ease of Operation	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
60,400 - OPERATE_ Lift thru Complete Cycle;CHECK_Noises,Jerky Op,Too Fast-Slow,Drift Down	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
60,500 - INSPECT_ Bridgeplate Operation	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
60,600 - INSPECT_All Pivot Points for Wear and Looseness	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
60,700 - INSPECT_Rollers for Wear and Smooth Rotation	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
60,800 - INSPECT_Operation of Platform Barrier Mechanism	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
60,900 - INSPECT_Cam Slots for Wear and Proper Alignment	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
61,000 - INSPECT_Cable Condition (If Applicable)	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
61,100 - INSPECT_Hydraulic Hoses for Leaks, Chafing or Cracks	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
61,200 - INSPECT_Electrical Connections and Routing of Wires and Cables	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
61,300 - INSPECT_Operation and Adjustment of All Safety Switches	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
61,400 - INSPECT_All Lift Mounting Brackets for Loose Bolts Broken Welds, etc.	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
61,500 - INSPECT_Manual Back-up Raise/Lower System (If Applicable)	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
61,600 - INSPECT_HydrPump Reservoir Oil Level. Consult SvcManual for Fluid to Use.	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
61,700 - CHECK_Operator Decals for Proper Positioning;CONSULT_Service Manual	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
61,800 - CHECK_WC Holddowns Inside Vehicle for Secure Mounting,Proper Operation	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
61,900 - CLEAN_Linkages and Mechanisms	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
62,000 - LUBRICATE_Linkages and Mechanisms (DO NOT OVER Lubricate)	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
62,100 - INSPECT_Emergency Platform Release Mechanism	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
62,200 - INSPECT_Platform Barrier Latch Mechanism	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
62,300 - INSPECT_Bridgeplate Hinge	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
62,400 - INSPECT_All Pivot Points	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
62,500 - INSPECT_Cams and Slots	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
62,600 - INSPECT_Rollers	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
62,700 - INSPECT_All Linkages	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
70,000 - SECTION 7 - ALTERNATIVE FUELS INSPECTION	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
70,300 - INSPECT_Condition of Fuel Pressure Gauge	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
70,400 - PROVIDE PROOF_Tank_Dents/Scratches and Re-Certification	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
70,500 - INSPECT_Tank test date, labels-Reference-ST. 4 FMMVSS 304 & ANSI-CSA NGV2	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
70,600 - INSPECT_Tank Lines to Ensure Secure Mounting, Insulation Against Vibration	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
70,700 - INSPECT_Filling Nozzle for Securely Fitting Cap	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
70,800 - INSPECT_Pressure Relief Device's Venting System, Valves, Ducting to MNFR Specs	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
80,000 - SECTION 8 - PMI Report Completion	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
80,100 - COMPLETE_PM Report; Follow-ups	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	
80,200 - RETURN_Vehicle to Predetermined Location	Done		TDELVA	Sep 9, 2021 2:56:29 PM	No	

Activity Sub Total															
	<table><tr><td colspan="2">Activity 10 Sub Total</td></tr><tr><td>Parts:</td><td>0.00</td></tr><tr><td>Labor:</td><td>0.00</td></tr><tr><td>Labor Hours:</td><td>3.23</td></tr><tr><td>Sublet Parts:</td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td>0.00</td></tr></table>	Activity 10 Sub Total		Parts:	0.00	Labor:	0.00	Labor Hours:	3.23	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	0.00
Activity 10 Sub Total															
Parts:	0.00														
Labor:	0.00														
Labor Hours:	3.23														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	0.00														



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 54802382
Invoice No. 55345 - 54802382

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
55345-LIGHT DUTY PMA		Ford E450 Champion Challenger	
Requested By:	HPIERRE	Status:	40 - Closed (40)
Created By:	HPIERRE	Priority:	3 - High
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	274,615 - DH

Activity Header
Activity:20 999 TOTAL VEHICLE
Activity Note: PM A
Reason for Repair: 08 Preventive Maintenance
Work Accomplished: A PM Level A
Part Failure:
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
09-Sep-21	PA4075	FILTER, AIR SEE P546597	1	5.32	5.32
09-Sep-21	B329(F)	GOING OUT OF SERVICE SEE BALDWIN B329 IN THE FLEET ORG. FILTER, OIL, SPIN-ON	1	1.98	1.98

Activity Labor
No Data Available

Activity Sublet
No Data Available


Activity Checklist						
Check List						
20 Desc: PM A						
Task: PM A SERVICE Performed by: TDELVA Performed on: 09-SEP-21						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
100,000 - "A" PMI SERVICING ITEMS	Done		TDELVA	Sep 9, 2021 2:58:03 PM	No	
101,000 - FRA Change Oil Filters	Yes		TDELVA	Sep 9, 2021 2:58:03 PM	No	
102,000 - FRA Drain Engine Oil	Yes		TDELVA	Sep 9, 2021 2:58:03 PM	No	
103,000 - FRA Check Transmission Fluid	Done		TDELVA	Sep 9, 2021 2:58:03 PM	No	
104,000 - Lubricate Chassis	Done		TDELVA	Sep 9, 2021 2:58:03 PM	No	
105,000 - Replace or Clean A/C Filters	-	na	TDELVA	Sep 9, 2021 2:58:03 PM	No	
107,000 - FRA Change Primary Fuel Filter	Yes		TDELVA	Sep 9, 2021 2:58:03 PM	No	
108,000 - Lube all pivoting Mechanisms	Done		TDELVA	Sep 9, 2021 2:58:03 PM	No	

Activity Sub Total

	Activity 20 Sub Total	
	Parts:	7.30
	Labor:	0.00
	Labor Hours:	0.00
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	7.30
Work Order Footer		
	Work Order 54802382 Total	
	Parts:	7.30
	Labor:	0.00
	Labor Hours:	3.23
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	7.30



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 53544611
Invoice No. 55345 - 53544611

Client Department:

Department: 55345M

Work Order Description

QCC FLEET INSPECTION

Requested By: RBOOTH

Created By: RBOOTH

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 3 - High

Driver:

Phone:

ETA:

Meter: 270,932 -

Chronology

Reported	Jun 25, 2021 11:52:28 AM	Jun 25, 2021 11:52:28 AM
Started		
Completed	Aug 19, 2021 9:25:59 AM	Aug 19, 2021 9:25:59 AM
Down Time		

Work Order Notes

Activity Header

Activity: 10 999/999/999 TOTAL VEHICLE

Activity Note: PERSONAL RISK ASSESSMENT

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure: 00 No Failure

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: PERSONAL RISK ASSESSMENT

Task: PRA and Meter Readings Performed by: AOWENS Performed on: 25-JUN-21

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		AOWENS	Jun 25, 2021 4:22:36 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		AOWENS	Jun 25, 2021 4:22:36 PM	No	
3 - Are you wearing the appropriate PPE?	Done		AOWENS	Jun 25, 2021 4:22:36 PM	No	
4 - Have you performed the proper LOTO?	Done		AOWENS	Jun 25, 2021 4:22:36 PM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		AOWENS	Jun 25, 2021 4:22:36 PM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		AOWENS	Jun 25, 2021 4:22:36 PM	No	
20 - Miles			AOWENS	Jun 25, 2021 4:22:36 PM	No	
30 - Kilometers			AOWENS	Jun 25, 2021	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO	
				4:22:36 PM			
40 - Hours			AOWENS	Jun 25, 2021 4:22:36 PM	No		
Activity Sub Total							
				Activity 10 Sub Total			
				Parts:			0.00
				Labor:			0.00
				Labor Hours:			0.00
				Sublet Parts:			0.00
				Sublet Labor:			0.00
				Activity Sub Total			0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 53544611
Invoice No. 55345 - 53544611

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
QCC FLEET INSPECTION		Ford E450 Champion Challenger	
Requested By:	RBOOTH	Status:	40 - Closed (40)
Created By:	RBOOTH	Priority:	3 - High
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	270,932 -

Activity Header															
Activity:20 999 TOTAL VEHICLE															
Activity Note: QCC FLEET INSPECTION															
Reason for Repair: 05 Inspection, Routine															
Work Accomplished:															
Part Failure:															
Activity Comments:															
Activity Parts															
No Data Available															
Activity Labor															
No Data Available															
Activity Sublet															
No Data Available															
Activity Checklist															
No Data Available															
No Data Available															
Activity Sub Total															
<table><tr><td colspan="2">Activity 20 Sub Total</td></tr><tr><td>Parts:</td><td>0.00</td></tr><tr><td>Labor:</td><td>0.00</td></tr><tr><td>Labor Hours:</td><td>0.00</td></tr><tr><td>Sublet Parts:</td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td>0.00</td></tr></table>		Activity 20 Sub Total		Parts:	0.00	Labor:	0.00	Labor Hours:	0.00	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	0.00
Activity 20 Sub Total															
Parts:	0.00														
Labor:	0.00														
Labor Hours:	0.00														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	0.00														
Work Order Footer															
<table><tr><td colspan="2">Work Order 53544611 Total</td></tr><tr><td>Parts:</td><td>0.00</td></tr><tr><td>Labor:</td><td>0.00</td></tr><tr><td>Labor Hours:</td><td>0.00</td></tr><tr><td>Sublet Parts:</td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td>0.00</td></tr></table>		Work Order 53544611 Total		Parts:	0.00	Labor:	0.00	Labor Hours:	0.00	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	0.00
Work Order 53544611 Total															
Parts:	0.00														
Labor:	0.00														
Labor Hours:	0.00														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	0.00														



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 54802371
Invoice No. 55345 - 54802371

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
FOLLOWUP-FT Light Duty		Ford E450 Champion Challenger	
Requested By:	HPIERRE	Status:	40 - Closed (40)
Created By:	HPIERRE	Priority:	3 - High
Assigned To:		Driver:	
Class:	-	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	270,020 - DH

Chronology		
Reported	Aug 11, 2021 9:29:05 AM	Aug 11, 2021 9:29:05 AM
Started	Aug 11, 2021 9:33:00 AM	
Completed	Aug 11, 2021 1:12:00 PM	Aug 11, 2021 1:12:00 PM
Down Time		

Work Order Notes

Line 10 PMB follows up bus need rear tire

Preventive maintenance

Replace two tire in the by two good use one completed

Activity Header															
Activity: 10 017/003/001 TIRE, CUSHION W/TREAD															
Activity Note: need rear tires															
Reason for Repair: FW Follow Up															
Work Accomplished:															
Part Failure:															
Activity Comments:															
Activity Parts															
No Data Available															
Activity Labor															
No Data Available															
Activity Sublet															
No Data Available															
Activity Checklist															
No Data Available															
No Data Available															
Activity Sub Total															
<table><tr><td colspan="2">Activity 10 Sub Total</td></tr><tr><td>Parts:</td><td>0.00</td></tr><tr><td>Labor:</td><td>0.00</td></tr><tr><td>Labor Hours:</td><td>0.00</td></tr><tr><td>Sublet Parts:</td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td>0.00</td></tr></table>		Activity 10 Sub Total		Parts:	0.00	Labor:	0.00	Labor Hours:	0.00	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	0.00
Activity 10 Sub Total															
Parts:	0.00														
Labor:	0.00														
Labor Hours:	0.00														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	0.00														



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 54802371
Invoice No. 55345 - 54802371

Client Department:
Department: 55345M
Work Order Description
FOLLOWUP-FT Light Duty
Requested By: HPIERRE
Created By: HPIERRE
Assigned To:
Class: -
Arrangement: Unassigned
Potential Warranty: No
Equipment No.: 4514-P
VIN: 1FDFE4FS7EDB17176
Ford E450 Champion Challenger
Status: 40 - Closed (40)
Priority: 3 - High
Driver:
Phone:
ETA:
Meter: 270,020 - DH

Activity Header				
Activity:20 018/000/000 WHEELS, RIMS, HUBS AND BEARINGS				
Activity Note:				
Reason for Repair:		08 Preventive Maintenance		
Work Accomplished:		03 Replace New		
Part Failure:		99 Replaced Before Failure		
Activity Comments:				
Activity Parts				
No Data Available				
Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
11-Aug-21	Pierre,Hubert J	3.63	0	0
Activity Sublet				
No Data Available				
Activity Checklist				
No Data Available				
No Data Available				
Activity Sub Total				
			Activity 20 Sub Total	
			Parts:	0.00
			Labor:	0.00
			Labor Hours:	3.63
			Sublet Parts:	0.00
			Sublet Labor:	0.00
			Activity Sub Total	0.00
Work Order Footer				
			Work Order 54802371 Total	
			Parts:	0.00
			Labor:	0.00
			Labor Hours:	3.63
			Sublet Parts:	0.00
			Sublet Labor:	0.00
			Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 54682232
Invoice No. 55345 - 54682232

Client Department:

Department: 55345M

Work Order Description

55345-LIGHT DUTY PMB

Requested By: JUHURST

Created By: JUHURST

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 3 - High

Driver:

Phone:

ETA:

Meter: 270,020 - DH

Chronology

Reported	Aug 9, 2021 12:00:00 AM	Aug 9, 2021 12:00:00 AM
Started	Aug 11, 2021 7:36:00 AM	
Completed	Aug 11, 2021 9:32:00 AM	Aug 11, 2021 9:32:00 AM
Down Time		

Work Order Notes

Line 10 COMPLAINT:PMB

CAUSE: preventive maintenance

CORRECTION: Performed service PMB service lube all pivoting point cross rotate tires completed

Activity Header

Activity:5 999/999/999 TOTAL VEHICLE

Activity Note: PERSONAL RISK ASSESSMENT

Reason for Repair: SW Shop Work Order

Work Accomplished: 06 Inspect

Part Failure: 00 No Failure

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: PERSONAL RISK ASSESSMENT

Task: PRA and Meter Readings Performed by: HPIERRE Performed on: 11-AUG-21

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		HPIERRE	Aug 11, 2021 9:17:39 AM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		HPIERRE	Aug 11, 2021 9:17:39 AM	No	
3 - Are you wearing the appropriate PPE?	Done		HPIERRE	Aug 11, 2021 9:17:39 AM	No	
4 - Have you performed the proper LOTO?	Done		HPIERRE	Aug 11, 2021 9:17:39 AM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		HPIERRE	Aug 11, 2021 9:17:39 AM	No	
10 - Have you successfully completed the Personal	Done		HPIERRE	Aug 11, 2021	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO	
Risk Assessment?				9:17:39 AM			
20 - Miles			HPIERRE	Aug 11, 2021 9:17:39 AM	No		
30 - Kilometers	4		HPIERRE	Aug 11, 2021 9:17:39 AM	No		
40 - Hours	4		HPIERRE	Aug 11, 2021 9:17:39 AM	No		
Activity Sub Total							
				Activity 5 Sub Total			
				Parts:			0.00
				Labor:			0.00
				Labor Hours:			0.00
				Sublet Parts:			0.00
				Sublet Labor:			0.00
				Activity Sub Total			0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 54682232
Invoice No. 55345 - 54682232

Client Department:

Department: 55345M

Work Order Description

55345-LIGHT DUTY PMB

Requested By: JUHURST

Created By: JUHURST

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 3 - High

Driver:

Phone:

ETA:

Meter: 270,020 - DH

Activity Header

Activity: 10

Activity Note: Light Duty PMI

Reason for Repair:

Work Accomplished:

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: Light Duty PMI

Task: First Transit North America Light Duty PM Inspection Sheet Performed by: HPIERRE Performed on: 11-AUG-21

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,000 - SECTION 1 - Preparation Inspection	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
10,100 - INSPECT_Auto-Transmission Operation/Controller; Neutral Safety Switch	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
10,200 - !FRA!INSPECT_Starter Operation	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
10,300 - !FRA!INSPECT_Warning Lights and Alarms	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
10,400 - !FRA!INSPECT_Back Up Alarm	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
10,500 - !FRA!INSPECT_Engine Operation, OBSERVE_Exhaust for Excessive Smoke	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
10,600 - Check Driver's Pre-trip or DVIR/EVIR & Authorization Forms	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
10,700 - INSPECT_All Exterior Lights (Turn on until Completion of this section)	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
10,800 - *RPT*INSPECT_Body Damage, Corrosion;DOCUMENT_Issues	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
10,900 - INSPECT_Fuel Tank Cap, and Doors	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
11,100 - INSPECT_License Plate, Bracket, Bumpers	Done		HPIERRE	Aug 11, 2021	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
				9:29:25 AM		
20,000 - SECTION 2 - Test Drive and Operator Area Inspection	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
20,100 - INSPECT_Driver Seat condition/operation/seatbelt	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
20,200 - TEST DRIVE_INSPECT_Proper Operation; Drive into Shop	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
20,300 - *RPT*INSPECT_Steering Wheel for Play/Bind/Horn Op./Turn Signal Cancelation	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
20,400 - PERFORM_Brake Test (Apply hard enough to check wheel pull and Application)	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
20,500 - *RPT*FRA INSPECT_Lighting/Operation of all Gauges	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
20,600 - *RPT*INSPECT_Windshields, Sun Visors	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
20,700 - INSPECT_Wiper/Washer Operation, Condition	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
20,800 - INSPECT_High Idle Control	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
20,900 - *RPT*!FRA!INSPECT_HVAC Controls, Operation	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
21,000 - *RPT*!FRA!INSPECT_Operation of all Switches and Accessories	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
21,100 - INSPECT_Parking Brake Operation	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
21,200 - !FRA!TEST_Service Brake Backup System (Stationary Brake Tests HYD)	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
21,300 - INSPECT_VIN, Tire Pressure Decal, Data Tags	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
21,400 - *RPT*INSPECT_Drivers Door Hinges, Handles, Controls and Panels	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
21,500 - !FRA!INSPECT_Under Dash Wiring for Proper Routing/Chafing/Securement	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
21,550 - INSPECT_Driver Floor Area for Rust/Water Leaks	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
21,600 - *RPT*INSPECT for WEAR_Pedal Pads, Accelerator, Brake, Parking Brake	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
21,700 - INSPECT_Engine Fault Codes	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
30,000 - SECTION 3 - EXTERIOR INSPECTION - Front	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
31,000 - SSF (Street Side Front)	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
31,010 - *RPT*!FRA!INSPECT_Mirror Mountings, Brackets, Glass	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
31,020 - *RPT*INSPECT_FRONT Springs, Shocks, Spring Shackles	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
31,030 - INSPECT_Mud Flaps, Brackets	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
31,040 - INSPECT_Wiper Blades, Arms	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
32,000 - Engine Inspection	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
32,010 - INSPECT_Hood, Springs and Props	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
32,020 - !FRA!INSPECT_Engine Compartment Condition for Fire Risk Avoidance	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
32,030 - !FRA!INSPECT_for Fluid Leaks, Levels	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
32,040 - !FRA!INSPECT_Hyd_Brake Fluid with Test Strips	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
32,050 - !FRA!INSPECT_RECORD_Coolant Recovery with Refractometer; Test Strips	190 Degree Fahrenheit	N/A	HPIERRE	Aug 11, 2021 9:29:25 AM	No	
32,060 - PRESSURE TEST_Cooling Systems (Radiator, Cap, hoses and clamps)	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
32,070 - *RPT*INSPECT_Radiator and Mountings, Cores	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
32,080 - *RPT*INSPECT_Fan Assembly, Shroud, Tensioner, Belts, All Belt Driven Components	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
32,090 - *RPT*!FRA!INSPECT_Mounting, Installation of Alternator, AC Compressor	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
32,100 - INSPECT_Intake System	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
32,140 - *RPT*!FRA!RECORD_Underhood Battery Voltages (volts)	12 Volt*		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
33,010 - CSF (Curb Side Front)	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
33,020 - *RPT*!FRA!INSPECT_Mirror Mountings, Brackets, Glass	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
33,030 - *RPT*INSPECT_FRONT Springs, Shocks, Spring Shackles	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
33,040 - INSPECT_Mud Flaps, Brackets	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
33,050 - INSPECT_Wiper Blades, Arms	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
33,060 - !FRA!INSPECT_LUBE_Battery Box, Batteries, Tray Slides, Hold Downs	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
33,070 - *RPT*!FRA!RECORD_Side Mounted Battery Voltages (volts)	12 Volt*		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
33,080 - INSPECT_Entry door, OPEN_with external lock/switch (if equipped)	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
40,000 - SECTION 4 - Interior Inspection	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
40,100 - *RPT*INSPECT_Step-Well, Step-Tread, Hand Rails, Step-well Light	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
40,200 - INSPECT_Insurance/Registration/Regulatory Forms Dates	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
40,250 - INSPECT_Overhead Compartment for Water Leaks	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
40,300 - INSPECT_Safety Equipment, Fire Extinguisher/Suppression	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
40,400 - INSPECT_Camera Systems, Filter, Electrical	Done		HPIERRE	Aug 11, 2021	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
Inputs/Outputs-SOP M038				9:29:25 AM		
40,600 - !FRA!CHECK for HOTSPOTS_Interior Elec Panel Fuses/Circuit Breakers/Connectors	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
40,700 - *RPT*INSPECT_Seats, Covering, Belts, Loose Cushions, Operation	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
40,800 - *RPT*!FRA!INSPECT_Interior Lights; Mirrors	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
40,900 - !FRA!INSPECT_Interior Cleanliness/Potential Projectiles	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
41,000 - INSPECT_All ADA Equip (Lift Seat Belt, floor hold Downs, Belts, Cover, Alarms)	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
41,100 - INSPECT_CLEAN_AC Filter	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
41,200 - INSPECT_Emergency Windows,Hatches,Doors,Alarms/Lights;CHECK_for Leaks	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
41,300 - *RPT*INSPECT_Interior Body, Floor, Stanchions	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
41,400 - *RPT*INSPECT_Passenger Doors, Glass, Seal	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
50,000 - SECTION 5 - UNDER VEHICLE INSPECTION	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
50,100 - *RPT*INSPECT_Steering components-Drag Link, Tie Rods ends and Steering Damper	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
50,200 - INSPECT_Ball Joint Play	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
50,300 - !FRA!INSPECT_Front Wheel Bearings for Play	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
50,400 - LUBE_All Chassis Components	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
50,500 - !FRA!CHANGE_Engine oil,filters	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
50,700 - INSPECT_Tire Condition	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
50,800 - INSPECT_Tire Valve Stems, Double Check Caps	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
50,900 - !FRA!INSPECT_Wheels for Cracks, Loose Lugs/Indicators, Outer Hub Leaks	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
51,000 - RECORD_LF-Tire Tread Depth (32nds)	8 32nds of an inch		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
51,100 - RECORD_LF-Tire Air Pressure (psi)	65 Pounds per Square Inch		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
51,200 - RECORD_RF-Tire Tread Depth (32nds)	8 32nds of an inch		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
51,300 - RECORD_RF-Air Pressure (psi)	65 Pounds per Square Inch		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
51,400 - !FRA!INSPECT_FRONT ABS Tone Rings, Sensors, Routing of Cables	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
51,500 - !FRA!INSPECT_Wheel Seals for Leaks	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
51,600 - !FRA!INSPECT_Front Brake Assemblies	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
51,700 - MEASURE_RECORD_LF - Brake Lining, Pad Thickness (32nds)	10 32nds of an inch		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
51,800 - MEASURE_RECORD_RF - Brake Lining, Pad Thickness (32nds)	10 32nds of an inch		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
51,900 - INSPECT VISUALLY_RECORD_LF Rotor Condition (inches)	1.2 Inch		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
52,000 - INSPECT VISUALLY_RECORD_RF Rotor Condition (inches)	1.2 Inch		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
52,100 - INSPECT_Vibration Damper	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
52,200 - !FRA!INSPECT_Battery Cable Routing from Battery Box to Starter	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
52,400 - !FRA!INSPECT_Starter Mounting	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
52,500 - !FRA!INSPECT_Engine Exhaust System	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
52,700 - INSPECT_Engine, Transmission Mounts	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
52,800 - !FRA!INSPECT_Engine, Transmission for Fluid Leaks	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
52,900 - INSPECT_Shift Cable Adjustment - All Transmissions	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
53,000 - !FRA!INSPECT_Transmission Breather and Clean	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
53,100 - *RPT*!FRA!INSPECT_Parking Brake Cables, Shoes for Wear, Contamination	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
53,200 - *RPT*INSPECT_A/C Condensor, Fans, Safety Grills	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
53,300 - *RPT*INSPECT_Driveline, Hanger Bearings, U-Joints, Slip Joints, Safety Loop	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
53,400 - *RPT*INSPECT_All Body Mounts and Chassis Frame for Corrosion, Cracks	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
53,500 - !FRA!INSPECT_Fuel Tank, Mountings, Lines	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
53,600 - INSPECT_Tire Condition	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
53,700 - INSPECT_Tire Valve Stems, Double Check Caps	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
53,800 - INSPECT_Mismatched Tire Tread, Casing Design	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
53,900 - INSPECT_Dual Mating Tires w/Square	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
54,000 - !FRA!INSPECT_Wheels for Cracks, Loose Lugs/Indicators, Outer Hub Leaks	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
54,100 - INSPECT_Mud Flaps, Brackets	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
54,200 - RECORD_RRO-Tire Tread Depth (32nds)	3 32nds of an inch	need rear tires	HPIERRE	Aug 11, 2021 9:29:25 AM	Yes	54802371
54,300 - RECORD_RRI-Tire Tread Depth (32nds)	6 32nds of an inch		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
54,400 - RECORD_RRO-Air Pressure (psi)	70 Pounds per Square Inch		HPIERRE	Aug 11, 2021 9:29:25 AM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
54,500 - RECORD_RRI-Air Pressure (psi)	70 Pounds per Square Inch		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
54,600 - RECORD_LRO-Tire Tread Depth (32nds)	5 32nds of an inch		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
54,700 - RECORD_LRI-Tire Tread Depth (32nds)	3 32nds of an inch		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
54,800 - RECORD_LRO-Air Pressure (psi)	70 Pounds per Square Inch		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
54,900 - RECORD_LRI-Air Pressure (psi)	70 Pounds per Square Inch		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
55,000 - !FRA!INSPECT_ REAR Brake Assemblies	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
55,100 - !FRA!INSPECT_ REAR Hubs, Wheel Seals for Oil Leaks	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
55,200 - !FRA!INSPECT_ REAR ABS Tone Rings, Sensors, Routing Of Cables (if equipped)	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
55,300 - MEASURE_RECORD_LR - Brake Lining, Pad Thickness (32nds)	10 32nds of an inch		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
55,400 - MEASURE_RECORD_RR - Brake Lining, Pad Thickness (32nds)	10 32nds of an inch		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
55,500 - INSPECT VISUALLY_MEASURE_RECORD_LR Drum, Rotor Condition (inches)	1.2 Inch		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
55,600 - INSPECT VISUALLY_MEASURE_RECORD_RR Drum, Rotor Condition (inches)	1.2 Inch		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
55,700 - !FRA!INSPECT_ Under Body Exhaust System	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
55,800 - *RPT*INSPECT_ REAR Axle Housing, Breather; CLEAN_Breather	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
55,900 - *RPT*INSPECT_ REAR Springs, Shocks, Suspension, Airbags	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
60,000 - SECTION 6 - Wheelchair Inspection	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
60,100 - RECORD_Wheelchair Cycle Count	1234 Cycles		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
60,200 - CHECK_ Lift Access Door for Ease of Opening,Latch Security,Door Hold Back	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
60,300 - CHECK_Platform Emergency Release Mechanism for Ease of Operation	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
60,400 - OPERATE_Lift thru Complete Cycle;CHECK_Noises,Jerky Op,Too Fast-Slow,Drift Down	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
60,500 - INSPECT_ Bridgeplate Operation	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
60,600 - INSPECT_All Pivot Points for Wear and Looseness	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
60,700 - INSPECT_Rollers for Wear and Smooth Rotation	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
60,800 - INSPECT_Operation of Platform Barrier Mechanism	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
60,900 - INSPECT_Cam Slots for Wear and Proper Alignment	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
61,000 - INSPECT_Cable Condition (If Applicable)	Done		HPIERRE	Aug 11, 2021	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
				9:29:25 AM		
61,100 - INSPECT_Hydraulic Hoses for Leaks, Chafing or Cracks	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
61,200 - INSPECT_Electrical Connections and Routing of Wires and Cables	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
61,300 - INSPECT_Operation and Adjustment of All Safety Switches	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
61,400 - INSPECT_All Lift Mounting Brackets for Loose Bolts Broken Welds, etc.	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
61,500 - INSPECT_Manual Back-up Raise/Lower System (If Applicable)	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
61,600 - INSPECT_HydrPump Reservoir Oil Level. Consult SvcManual for Fluid to Use.	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
61,700 - CHECK_Operator Decals for Proper Positioning;CONSULT_Service Manual	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
61,800 - CHECK_WC Holddowns Inside Vehicle for Secure Mounting,Proper Operation	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
61,900 - CLEAN_Linkages and Mechanisms	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
62,000 - LUBRICATE_Linkages and Mechanisms (DO NOT OVER Lubricate)	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
62,100 - INSPECT_Emergency Platform Release Mechanism	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
62,200 - INSPECT_Platform Barrier Latch Mechanism	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
62,300 - INSPECT_Bridgeplate Hinge	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
62,400 - INSPECT_All Pivot Points	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
62,500 - INSPECT_Cams and Slots	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
62,600 - INSPECT_Rollers	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
62,700 - INSPECT_All Linkages	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
70,000 - SECTION 7 - ALTERNATIVE FUELS INSPECTION	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
70,300 - INSPECT_Condition of Fuel Pressure Gauge	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
70,400 - PROVIDE PROOF_Tank_Dents/Scratches and Re-Certification	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
70,500 - INSPECT_Tank test date, labels-Reference-ST.4 FMMVSS 304 & ANSI-CSA NGV2	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
70,600 - INSPECT_Tank Lines to Ensure Secure Mounting, Insulation Against Vibration	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
70,700 - INSPECT_Filling Nozzle for Securely Fitting Cap	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
70,800 - INSPECT_Pressure Relief Device's Venting System, Valves, Ducting to MNFR Specs	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
80,000 - SECTION 8 - PMI Report Completion	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
80,100 - COMPLETE_PM Report; Follow-ups	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	
80,200 - RETURN_Vehicle to Predetermined Location	Done		HPIERRE	Aug 11, 2021 9:29:25 AM	No	

Activity Sub Total

Activity 10 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 54682232
Invoice No. 55345 - 54682232

Client Department:

Department: 55345M

Work Order Description

55345-LIGHT DUTY PMB

Requested By: JUHURST

Created By: JUHURST

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 3 - High

Driver:

Phone:

ETA:

Meter: 270,020 - DH

Activity Header

Activity: 20 999 TOTAL VEHICLE

Activity Note: PM B

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: B PM Level B

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
13-Aug-21	P7398	FILTER, OIL	-1	1.41	-1.41
11-Aug-21	P7398	FILTER, OIL	1	1.41	1.41

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
11-Aug-21	Pierre, Hubert J	1.93	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List						
20 Desc: PM B Task: PM B SERVICE Performed by: HPIERRE Performed on: 11-AUG-21						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
100,000 - "A" PMI SERVICING ITEMS	Done		HPIERRE	Aug 11, 2021 9:30:48 AM	No	
101,000 - FRA Change Oil Filters	Yes		HPIERRE	Aug 11, 2021 9:30:48 AM	No	
102,000 - FRA Drain Engine Oil	Yes		HPIERRE	Aug 11, 2021 9:30:48 AM	No	
103,000 - FRA Check Transmission Fluid	Done		HPIERRE	Aug 11, 2021 9:30:48 AM	No	
104,000 - Lubricate Chassis	Done		HPIERRE	Aug 11, 2021 9:30:48 AM	No	
105,000 - Replace or Clean A/C Filters	Done		HPIERRE	Aug 11, 2021 9:30:48 AM	No	
107,000 - FRA Change Primary Fuel Filter	No	N/A	HPIERRE	Aug 11, 2021 9:30:48 AM	No	
108,000 - Lube all pivoting Mechanisms	Done		HPIERRE	Aug 11, 2021 9:30:48 AM	No	
200,000 - "B" PMI SERVICING ITEMS (12 MONTH)	Done		HPIERRE	Aug 11, 2021	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
				9:30:48 AM		
201,000 - Service Crankcase Breather	Done		HPIERRE	Aug 11, 2021 9:30:48 AM	No	
203,000 - FRA Change Automatic Transmission Fluid	No		HPIERRE	Aug 11, 2021 9:30:48 AM	No	
204,000 - FRA Change Power Steering Fluid and Filter	No		HPIERRE	Aug 11, 2021 9:30:48 AM	No	
205,000 - Complete Engine Diagnostics and Clear Codes when Completed	Done		HPIERRE	Aug 11, 2021 9:30:48 AM	No	

Activity Sub Total

Activity 20 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	1.93
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00

Work Order Footer

Work Order 54682232 Total

Parts:	0.00
Labor:	0.00
Labor Hours:	1.93
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 54564051
Invoice No. 55345 - 54564051

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
WINDSHIELD WASHER SYSTEM NOT WORKING		Ford E450 Champion Challenger	
Requested By:	CVERGARA	Status:	40 - Closed (40)
Created By:	CVERGARA	Priority:	-
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	260,847 - DH

Chronology		
Reported	May 14, 2021 7:34:00 AM	May 14, 2021 7:34:00 AM
Started	Aug 11, 2021 5:52:00 AM	
Completed	Aug 11, 2021 9:15:00 AM	Aug 11, 2021 9:15:00 AM
Down Time		

Work Order Notes

Line 10 Road call wiper blade fall off

Preventive maintenance

Install new wiper blade completed

Activity Header						
Activity:10 999/999/999 TOTAL VEHICLE						
Activity Note: PERSONAL RISK ASSESMENT						
Reason for Repair: 05 Inspection, Routine						
Work Accomplished: 06 Inspect						
Part Failure: 00 No Failure						
Activity Comments:						
Activity Parts						
No Data Available						
Activity Labor						
No Data Available						
Activity Sublet						
No Data Available						
Activity Checklist						
Check List						
10 Desc: PERSONAL RISK ASSESMENT						
Task: PRA and Meter Readings Performed by: HPIERRE Performed on: 11-AUG-21						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		HPIERRE	Aug 11, 2021 7:38:59 AM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		HPIERRE	Aug 11, 2021 7:38:59 AM	No	
3 - Are you wearing the appropriate PPE?	Done		HPIERRE	Aug 11, 2021 7:38:59 AM	No	
4 - Have you performed the proper LOTO?	Done		HPIERRE	Aug 11, 2021 7:38:59 AM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		HPIERRE	Aug 11, 2021 7:38:59 AM	No	
10 - Have you successfully completed the Personal	Done		HPIERRE	Aug 11, 2021	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO	
Risk Assessment?				7:38:59 AM			
20 - Miles			HPIERRE	Aug 11, 2021 7:38:59 AM	No		
30 - Kilometers	3		HPIERRE	Aug 11, 2021 7:38:59 AM	No		
40 - Hours	1		HPIERRE	Aug 11, 2021 7:38:59 AM	No		
Activity Sub Total							
				Activity 10 Sub Total			
				Parts:			0.00
				Labor:			0.00
				Labor Hours:			0.00
				Sublet Parts:			0.00
				Sublet Labor:			0.00
				Activity Sub Total			0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 54564051
Invoice No. 55345 - 54564051

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
WINDSHIELD WASHER SYSTEM NOT WORKING		Ford E450 Champion Challenger	
Requested By:	CVERGARA	Status:	40 - Closed (40)
Created By:	CVERGARA	Priority:	-
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	260,847 - DH

Activity Header
Activity:20 050/000/000 GROUP, ACCESSORIES
Activity Note:
Reason for Repair: 05 Inspection, Routine
Work Accomplished: 03 Replace New
Part Failure:
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
13-Aug-21	40520	BLADE, WIPER, WINDSHIELD, 20"	1	4.4	4.4

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
11-Aug-21	Pierre,Hubert J	1.72	0	0

Activity Sublet
No Data Available


Activity Checklist
No Data Available
No Data Available

Activity Sub Total	
Activity 20 Sub Total	
Parts:	4.40
Labor:	0.00
Labor Hours:	1.72
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	4.40

Work Order Footer	
Work Order 54564051 Total	
Parts:	4.40
Labor:	0.00
Labor Hours:	1.72
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	4.40



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 53558159
Invoice No. 55345 - 53558159

Client Department:

Department: 55345M

Work Order Description

55345-A/C INSPECTION

Requested By: NSTOLFO

Created By: NSTOLFO

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 2 - Medium

Driver:

Phone:

ETA:

Meter: 265,209 -

Chronology

Reported	Jun 25, 2021 11:52:28 AM	Jun 25, 2021 11:52:28 AM
Started	Jun 25, 2021 3:51:00 PM	
Completed	Jun 25, 2021 4:10:00 PM	Jun 25, 2021 4:10:00 PM
Down Time		

Work Order Notes

Line 10 Front and rear air condition inspected working as designed

Activity Header

Activity: 5 999/999/999 TOTAL VEHICLE

Activity Note: PERSONAL RISK ASSESSMENT

Reason for Repair: SW Shop Work Order

Work Accomplished: 06 Inspect

Part Failure: 00 No Failure

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
25-Jun-21	Junior Hurst	0.07	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: PERSONAL RISK ASSESSMENT

Task: PRA and Meter Readings Performed by: JUHURST Performed on: 25-JUN-21

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		JUHURST	Jun 25, 2021 3:53:03 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		JUHURST	Jun 25, 2021 3:53:03 PM	No	
3 - Are you wearing the appropriate PPE?	Done		JUHURST	Jun 25, 2021 3:53:03 PM	No	
4 - Have you performed the proper LOTO?	Done		JUHURST	Jun 25, 2021 3:53:03 PM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		JUHURST	Jun 25, 2021 3:53:03 PM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		JUHURST	Jun 25, 2021 3:53:03 PM	No	
20 - Miles			JUHURST	Jun 25, 2021	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
				3:53:03 PM		
30 - Kilometers			JUHURST	Jun 25, 2021 3:53:03 PM	No	
40 - Hours			JUHURST	Jun 25, 2021 3:53:03 PM	No	
Activity Sub Total						
			Activity 5 Sub Total			
			Parts:			0.00
			Labor:			0.00
			Labor Hours:			0.07
			Sublet Parts:			0.00
			Sublet Labor:			0.00
			Activity Sub Total			0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 53558159
Invoice No. 55345 - 53558159

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
55345-A/C INSPECTION		Ford E450 Champion Challenger	
Requested By:	NSTOLFO	Status:	40 - Closed (40)
Created By:	NSTOLFO	Priority:	2 - Medium
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	265,209 -

Activity Header				
Activity: 15 001 AIR CONDITIONING, HEATING AND VENTILATION				
Activity Note: ANNUAL A/C INSPECTION				
Reason for Repair: 08 Preventive Maintenance				
Work Accomplished: 06 Inspect				
Part Failure:				
Activity Comments:				
Activity Parts				
No Data Available				
Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
25-Jun-21	Junior Hurst	0.22	0	0
Activity Sublet				
No Data Available				
Activity Checklist				
No Data Available				
No Data Available				
Activity Sub Total				
			Activity 15 Sub Total	
			Parts:	0.00
			Labor:	0.00
			Labor Hours:	0.22
			Sublet Parts:	0.00
			Sublet Labor:	0.00
			Activity Sub Total	0.00
Work Order Footer				
			Work Order 53558159 Total	
			Parts:	0.00
			Labor:	0.00
			Labor Hours:	0.29
			Sublet Parts:	0.00
			Sublet Labor:	0.00
			Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 53557975
Invoice No. 55345 - 53557975

Client Department:

Department: 55345M

Work Order Description

55345-FIRE SAFETY INSPECTION

Requested By: NSTOLFO

Created By: NSTOLFO

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 2 - Medium

Driver:

Phone:

ETA:

Meter: 265,209 -

Chronology

Reported	Jun 25, 2021 11:52:28 AM	Jun 25, 2021 11:52:28 AM
Started	Jun 25, 2021 3:40:00 PM	
Completed	Jun 25, 2021 3:48:00 PM	Jun 25, 2021 3:48:00 PM
Down Time		

Work Order Notes

Line 10 All fire equipment was inspected working perfect

Activity Header

Activity: 5 999/999/999 TOTAL VEHICLE

Activity Note: PERSONAL RISK ASSESSMENT

Reason for Repair: SW Shop Work Order

Work Accomplished: 06 Inspect

Part Failure: 00 No Failure

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: PERSONAL RISK ASSESSMENT

Task: PRA and Meter Readings Performed by: JUHURST Performed on: 25-JUN-21

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		JUHURST	Jun 25, 2021 3:43:05 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		JUHURST	Jun 25, 2021 3:43:05 PM	No	
3 - Are you wearing the appropriate PPE?	Done		JUHURST	Jun 25, 2021 3:43:05 PM	No	
4 - Have you performed the proper LOTO?	Done		JUHURST	Jun 25, 2021 3:43:05 PM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		JUHURST	Jun 25, 2021 3:43:05 PM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		JUHURST	Jun 25, 2021 3:43:05 PM	No	
20 - Miles			JUHURST	Jun 25, 2021 3:43:05 PM	No	
30 - Kilometers			JUHURST	Jun 25, 2021	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO	
				3:43:05 PM			
40 - Hours			JUHURST	Jun 25, 2021 3:43:05 PM	No		
Activity Sub Total							
				Activity 5 Sub Total			
				Parts:			0.00
				Labor:			0.00
				Labor Hours:			0.00
				Sublet Parts:			0.00
				Sublet Labor:			0.00
				Activity Sub Total			0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 53557975
Invoice No. 55345 - 53557975

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
55345-FIRE SAFETY INSPECTION		Ford E450 Champion Challenger	
Requested By:	NSTOLFO	Status:	40 - Closed (40)
Created By:	NSTOLFO	Priority:	2 - Medium
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	265,209 -

Activity Header
Activity:15 999 TOTAL VEHICLE
Activity Note: ANNUAL FIRE SAFETY INSPECTION
Reason for Repair: 08 Preventive Maintenance
Work Accomplished: 06 Inspect
Part Failure:
Activity Comments:

Activity Parts
No Data Available

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
25-Jun-21	Junior Hurst	0.05	0	0

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available

Activity Sub Total		Activity 15 Sub Total	
Parts:			0.00
Labor:			0.00
Labor Hours:			0.05
Sublet Parts:			0.00
Sublet Labor:			0.00
Activity Sub Total			0.00

Work Order Footer		Work Order 53557975 Total	
Parts:			0.00
Labor:			0.00
Labor Hours:			0.05
Sublet Parts:			0.00
Sublet Labor:			0.00
Activity Sub Total			0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 53557799
Invoice No. 55345 - 53557799

Client Department:

Department: 55345M

Work Order Description

55345-PTC INSPECTION

Requested By: NSTOLFO

Created By: NSTOLFO

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 2 - Medium

Driver:

Phone:

ETA:

Meter: 265,209 -

Chronology

Reported	Jun 25, 2021 11:52:28 AM	Jun 25, 2021 11:52:28 AM
Started	Jun 25, 2021 3:30:00 PM	
Completed	Jun 25, 2021 3:38:00 PM	Jun 25, 2021 3:38:00 PM
Down Time		

Work Order Notes

Line 10 Inspection was performed all working perfect

Activity Header

Activity: 5 999/999/999 TOTAL VEHICLE

Activity Note: PERSONAL RISK ASSESSMENT

Reason for Repair: SW Shop Work Order

Work Accomplished: 06 Inspect

Part Failure: 00 No Failure

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
25-Jun-21	Junior Hurst	0.07	0	0

Activity Sublet

No Data Available

Activity Checklist


Check List

5 Desc: PERSONAL RISK ASSESSMENT

Task: PRA and Meter Readings Performed by: JUHURST Performed on: 25-JUN-21

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		JUHURST	Jun 25, 2021 3:31:01 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		JUHURST	Jun 25, 2021 3:31:01 PM	No	
3 - Are you wearing the appropriate PPE?	Done		JUHURST	Jun 25, 2021 3:31:01 PM	No	
4 - Have you performed the proper LOTO?	Done		JUHURST	Jun 25, 2021 3:31:01 PM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		JUHURST	Jun 25, 2021 3:31:01 PM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		JUHURST	Jun 25, 2021 3:31:01 PM	No	
20 - Miles			JUHURST	Jun 25, 2021	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
				3:31:01 PM		
30 - Kilometers			JUHURST	Jun 25, 2021 3:31:01 PM	No	
40 - Hours			JUHURST	Jun 25, 2021 3:31:01 PM	No	
Activity Sub Total						
			Activity 5 Sub Total			
			Parts:			0.00
			Labor:			0.00
			Labor Hours:			0.07
			Sublet Parts:			0.00
			Sublet Labor:			0.00
			Activity Sub Total			0.00

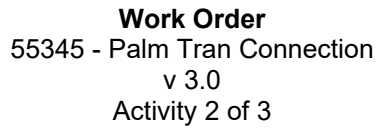



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 53557799
Invoice No. 55345 - 53557799


Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
55345-PTC INSPECTION		Ford E450 Champion Challenger	
Requested By:	NSTOLFO	Status:	40 - Closed (40)
Created By:	NSTOLFO	Priority:	2 - Medium
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	265,209 -

Activity Header															
Activity:25 002RTD BODY INTERIOR															
Activity Note: PTC inspectoon															
Reason for Repair: 11 Routine															
Work Accomplished:															
Part Failure:															
Activity Comments:															
Activity Parts															
No Data Available															
Activity Labor															
No Data Available															
Activity Sublet															
No Data Available															
Activity Checklist															
No Data Available															
No Data Available															
Activity Sub Total															
<table><tr><td colspan="2">Activity 25 Sub Total</td></tr><tr><td>Parts:</td><td>0.00</td></tr><tr><td>Labor:</td><td>0.00</td></tr><tr><td>Labor Hours:</td><td>0.00</td></tr><tr><td>Sublet Parts:</td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td>0.00</td></tr></table>		Activity 25 Sub Total		Parts:	0.00	Labor:	0.00	Labor Hours:	0.00	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	0.00
Activity 25 Sub Total															
Parts:	0.00														
Labor:	0.00														
Labor Hours:	0.00														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	0.00														
Work Order Footer															
<table><tr><td colspan="2">Work Order 53557799 Total</td></tr><tr><td>Parts:</td><td>0.00</td></tr><tr><td>Labor:</td><td>0.00</td></tr><tr><td>Labor Hours:</td><td>0.07</td></tr><tr><td>Sublet Parts:</td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td>0.00</td></tr></table>		Work Order 53557799 Total		Parts:	0.00	Labor:	0.00	Labor Hours:	0.07	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	0.00
Work Order 53557799 Total															
Parts:	0.00														
Labor:	0.00														
Labor Hours:	0.07														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	0.00														



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 54572283
Invoice No. 55345 - 54572283

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
55345-LIGHT DUTY PMA		Ford E450 Champion Challenger	
Requested By:	JUHURST	Status:	40 - Closed (40)
Created By:	JUHURST	Priority:	3 - High
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	265,209 - DH

Chronology

Reported	Jun 25, 2021 12:00:00 AM	Jun 25, 2021 12:00:00 AM
Started	Jun 25, 2021 1:00:00 PM	
Completed	Jun 25, 2021 3:14:00 PM	Jun 25, 2021 3:14:00 PM
Down Time		

Work Order Notes

Line 10 COMPLAINT:

CAUSE:

CORRECTION:

Activity Header

Activity:5 999/999/999 TOTAL VEHICLE
Activity Note: PERSONAL RISK ASSESSMENT
Reason for Repair: SW Shop Work Order
Work Accomplished: 06 Inspect
Part Failure: 00 No Failure
Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
25-Jun-21	Junior Hurst	0.03	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: PERSONAL RISK ASSESSMENT

Task: PRA and Meter Readings Performed by: JUHURST Performed on: 25-JUN-21

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		JUHURST	Jun 25, 2021 1:01:28 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		JUHURST	Jun 25, 2021 1:01:28 PM	No	
3 - Are you wearing the appropriate PPE?	Done		JUHURST	Jun 25, 2021 1:01:28 PM	No	
4 - Have you performed the proper LOTO?	Done		JUHURST	Jun 25, 2021 1:01:28 PM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		JUHURST	Jun 25, 2021 1:01:28 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		JUHURST	Jun 25, 2021 1:01:28 PM	No	
20 - Miles			JUHURST	Jun 25, 2021 1:01:28 PM	No	
30 - Kilometers			JUHURST	Jun 25, 2021 1:01:28 PM	No	
40 - Hours			JUHURST	Jun 25, 2021 1:01:28 PM	No	


Activity Sub Total

Activity 5 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	0.03
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 54572283
Invoice No. 55345 - 54572283

Client Department:

Department: 55345M

Work Order Description

55345-LIGHT DUTY PMA

Requested By: JUHURST

Created By: JUHURST

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 3 - High

Driver:

Phone:

ETA:

Meter: 265,209 - DH

Activity Header

Activity: 10 020 GROUP, DRIVETRAIN

Activity Note: Light Duty PMI

Reason for Repair: 11 Routine

Work Accomplished:

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
25-Jun-21	B329(F)	GOING OUT OF SERVICE SEE BALDWIN B329 IN THE FLEET ORG. FILTER, OIL, SPIN-ON	1	1.98	1.98

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
25-Jun-21	Junior Hurst	2.1	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List						
10 Desc: Light Duty PMI						
Task: First Transit North America Light Duty PM Inspection Sheet Performed by: JUHURST Performed on: 25-JUN-21						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,000 - SECTION 1 - Preparation Inspection	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
10,100 - INSPECT_Auto-Transmission Operation/Controller; Neutral Safety Switch	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
10,200 - !FRA!INSPECT_Starter Operation	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
10,300 - !FRA!INSPECT_Warning Lights and Alarms	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
10,400 - !FRA!INSPECT_Back Up Alarm	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
10,500 - !FRA!INSPECT_Engine Operation, OBSERVE_Exhaust for Excessive Smoke	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
10,600 - Check Driver's Pre-trip or DVIR/EVIR & Authorization Forms	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
10,700 - INSPECT_All Exterior Lights (Turn on until Completion of this section)	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
10,800 - *RPT*INSPECT_Body Damage,	Done		JUHURST	Jun 25, 2021	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
Corrosion;DOCUMENT_Issues				3:08:09 PM		
10,900 - INSPECT_Fuel Tank Cap, and Doors	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
11,100 - INSPECT_License Plate, Bracket, Bumpers	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
20,000 - SECTION 2 - Test Drive and Operator Area Inspection	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
20,100 - INSPECT_Driver Seat condition/operation/seatbelt	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
20,200 - TEST DRIVE_INSPECT_Proper Operation; Drive into Shop	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
20,300 - *RPT*INSPECT_Steering Wheel for Play/Bind/Horn Op./Turn Signal Cancelation	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
20,400 - PERFORM_Brake Test (Apply hard enough to check wheel pull and Application)	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
20,500 - *RPT*FRA INSPECT_Lighting/Operation of all Gauges	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
20,600 - *RPT*INSPECT_Windshields, Sun Visors	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
20,700 - INSPECT_Wiper/Washer Operation, Condition	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
20,800 - INSPECT_High Idle Control	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
20,900 - *RPT*!FRA!INSPECT_HVAC Controls, Operation	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
21,000 - *RPT*!FRA!INSPECT_Operation of all Switches and Accessories	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
21,100 - INSPECT_Parking Brake Operation	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
21,200 - !FRA!TEST_Service Brake Backup System (Stationary Brake Tests HYD)	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
21,300 - INSPECT_VIN, Tire Pressure Decal, Data Tags	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
21,400 - *RPT*INSPECT_Drivers Door Hinges, Handles, Controls and Panels	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
21,500 - !FRA!INSPECT_Under Dash Wiring for Proper Routing/Chafing/Securement	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
21,550 - INSPECT_Driver Floor Area for Rust/Water Leaks	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
21,600 - *RPT*INSPECT for WEAR_Pedal Pads, Accelerator, Brake, Parking Brake	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
21,700 - INSPECT_Engine Fault Codes	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
30,000 - SECTION 3 - EXTERIOR INSPECTION - Front	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
31,000 - SSF (Street Side Front)	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
31,010 - *RPT*!FRA!INSPECT_Mirror Mountings, Brackets, Glass	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
31,020 - *RPT*INSPECT_FRONT Springs, Shocks, Spring Shackles	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
31,030 - INSPECT_Mud Flaps, Brackets	Done		JUHURST	Jun 25, 2021	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
				3:08:09 PM		
31,040 - INSPECT_Wiper Blades, Arms	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
32,000 - Engine Inspection	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
32,010 - INSPECT_Hood, Springs and Props	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
32,020 - !FRA!INSPECT_Engine Compartment Condition for Fire Risk Avoidance	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
32,030 - !FRA!INSPECT_for Fluid Leaks, Levels	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
32,040 - !FRA!INSPECT_Hyd_Brake Fluid with Test Strips	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
32,050 - !FRA!INSPECT_RECORD_Coolant Recovery with Refractometer; Test Strips	26 Degree Fahrenheit		JUHURST	Jun 25, 2021 3:08:09 PM	No	
32,060 - PRESSURE TEST_Cooling Systems (Radiator, Cap, hoses and clamps)	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
32,070 - *RPT*INSPECT_Radiator and Mountings, Cores	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
32,080 - *RPT*INSPECT_Fan Assembly, Shroud, Tensioner, Belts, All Belt Driven Components	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
32,090 - *RPT*!FRA!INSPECT_Mounting, Installation of Alternator, AC Compressor	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
32,100 - INSPECT_Intake System	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
32,140 - *RPT*!FRA!RECORD_Underhood Battery Voltages (volts)	14 Volt*		JUHURST	Jun 25, 2021 3:08:09 PM	No	
33,010 - CSF (Curb Side Front)	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
33,020 - *RPT*!FRA!INSPECT_Mirror Mountings, Brackets, Glass	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
33,030 - *RPT*INSPECT_FRONT Springs, Shocks, Spring Shackles	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
33,040 - INSPECT_Mud Flaps, Brackets	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
33,050 - INSPECT_Wiper Blades, Arms	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
33,060 - !FRA!INSPECT_LUBE_Battery Box, Batteries, Tray Slides, Hold Downs	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
33,070 - *RPT*!FRA!RECORD_Side Mounted Battery Voltages (volts)	14 Volt*		JUHURST	Jun 25, 2021 3:08:09 PM	No	
33,080 - INSPECT_Entry door, OPEN_with external lock/switch (if equipped)	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
40,000 - SECTION 4 - Interior Inspection	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
40,100 - *RPT*INSPECT_Step-Well, Step-Tread, Hand Rails, Step-well Light	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
40,200 - INSPECT_Insurance/Registration/Regulatory Forms Dates	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
40,250 - INSPECT_Overhead Compartment for Water Leaks	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
40,300 - INSPECT_Safety Equipment, Fire Extinguisher/Suppression	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
40,400 - INSPECT_Camera Systems, Filter, Electrical Inputs/Outputs-SOP M038	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
40,600 - !FRA!CHECK for HOTSPOTS_Interior Elec Panel Fuses/Circuit Breakers/Connectors	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
40,700 - *RPT*INSPECT_Seats, Covering, Belts, Loose Cushions, Operation	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
40,800 - *RPT*!FRA!INSPECT_Interior Lights; Mirrors	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
40,900 - !FRA!INSPECT_Interior Cleanliness/Potential Projectiles	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
41,000 - INSPECT_All ADA Equip (Lift Seat Belt, floor hold Downs, Belts, Cover, Alarms)	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
41,100 - INSPECT_CLEAN_AC Filter	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
41,200 - INSPECT_Emergency Windows,Hatches,Doors,Alarms/Lights;CHECK_for Leaks	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
41,300 - *RPT*INSPECT_Interior Body, Floor, Stanchions	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
41,400 - *RPT*INSPECT_Passenger Doors, Glass, Seal	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
50,000 - SECTION 5 - UNDER VEHICLE INSPECTION	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
50,100 - *RPT*INSPECT_Steering components-Drag Link, Tie Rods ends and Steering Damper	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
50,200 - INSPECT_Ball Joint Play	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
50,300 - !FRA!INSPECT_Front Wheel Bearings for Play	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
50,400 - LUBE_All Chassis Components	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
50,500 - !FRA!CHANGE_Engine oil,filters	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
50,700 - INSPECT_Tire Condition	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
50,800 - INSPECT_Tire Valve Stems, Double Check Caps	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
50,900 - !FRA!INSPECT_Wheels for Cracks, Loose Lugs/Indicators, Outer Hub Leaks	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
51,000 - RECORD_LF-Tire Tread Depth (32nds)	5 32nds of an inch		JUHURST	Jun 25, 2021 3:08:09 PM	No	
51,100 - RECORD_LF-Tire Air Pressure (psi)	65 Pounds per Square Inch		JUHURST	Jun 25, 2021 3:08:09 PM	No	
51,200 - RECORD_RF-Tire Tread Depth (32nds)	6 32nds of an inch		JUHURST	Jun 25, 2021 3:08:09 PM	No	
51,300 - RECORD_RF-Air Pressure (psi)	65 Pounds per Square Inch		JUHURST	Jun 25, 2021 3:08:09 PM	No	
51,400 - !FRA!INSPECT_FRONT ABS Tone Rings, Sensors, Routing of Cables	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
51,500 - !FRA!INSPECT_Wheel Seals for Leaks	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
51,600 - !FRA!INSPECT_ Front Brake Assemblies	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
51,700 - MEASURE_RECORD_LF - Brake Lining, Pad Thickness (32nds)	10 32nds of an inch		JUHURST	Jun 25, 2021 3:08:09 PM	No	
51,800 - MEASURE_RECORD_RF - Brake Lining, Pad Thickness (32nds)	10 32nds of an inch		JUHURST	Jun 25, 2021 3:08:09 PM	No	
51,900 - INSPECT VISUALLY_RECORD_LF Rotor Condition (inches)	.12299 Inch		JUHURST	Jun 25, 2021 3:08:09 PM	No	
52,000 - INSPECT VISUALLY_RECORD_RF Rotor Condition (inches)	.12299 Inch		JUHURST	Jun 25, 2021 3:08:09 PM	No	
52,100 - INSPECT_Vibration Damper	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
52,200 - !FRA!INSPECT_Battery Cable Routing from Battery Box to Starter	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
52,400 - !FRA!INSPECT_Starter Mounting	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
52,500 - !FRA!INSPECT_Engine Exhaust System	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
52,700 - INSPECT_Engine, Transmission Mounts	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
52,800 - !FRA!INSPECT_Engine, Transmission for Fluid Leaks	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
52,900 - INSPECT_Shift Cable Adjustment - All Transmissions	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
53,000 - !FRA!INSPECT_Transmission Breather and Clean	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
53,100 - *RPT*!FRA!INSPECT_Parking Brake Cables, Shoes for Wear, Contamination	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
53,200 - *RPT*INSPECT_A/C Condensor, Fans, Safety Grills	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
53,300 - *RPT*INSPECT_Driveline, Hanger Bearings, U-Joints, Slip Joints, Safety Loop	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
53,400 - *RPT*INSPECT_All Body Mounts and Chassis Frame for Corrosion, Cracks	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
53,500 - !FRA!INSPECT_Fuel Tank, Mountings, Lines	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
53,600 - INSPECT_Tire Condition	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
53,700 - INSPECT_Tire Valve Stems, Double Check Caps	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
53,800 - INSPECT_Mismatched Tire Tread, Casing Design	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
53,900 - INSPECT_Dual Mating Tires w/Square	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
54,000 - !FRA!INSPECT_Wheels for Cracks, Loose Lugs/Indicators, Outer Hub Leaks	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
54,100 - INSPECT_Mud Flaps, Brackets	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
54,200 - RECORD_RRO-Tire Tread Depth (32nds)	5 32nds of an inch		JUHURST	Jun 25, 2021 3:08:09 PM	No	
54,300 - RECORD_RRI-Tire Tread Depth (32nds)	5 32nds of an inch		JUHURST	Jun 25, 2021 3:08:09 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
54,400 - RECORD_RRO-Air Pressure (psi)	65 Pounds per Square Inch		JUHURST	Jun 25, 2021 3:08:09 PM	No	
54,500 - RECORD_RRI-Air Pressure (psi)	65 Pounds per Square Inch		JUHURST	Jun 25, 2021 3:08:09 PM	No	
54,600 - RECORD_LRO-Tire Tread Depth (32nds)	5 32nds of an inch		JUHURST	Jun 25, 2021 3:08:09 PM	No	
54,700 - RECORD_LRI-Tire Tread Depth (32nds)	5 32nds of an inch		JUHURST	Jun 25, 2021 3:08:09 PM	No	
54,800 - RECORD_LRO-Air Pressure (psi)	65 Pounds per Square Inch		JUHURST	Jun 25, 2021 3:08:09 PM	No	
54,900 - RECORD_LRI-Air Pressure (psi)	65 Pounds per Square Inch		JUHURST	Jun 25, 2021 3:08:09 PM	No	
55,000 - !FRA!INSPECT_ REAR Brake Assemblies	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
55,100 - !FRA!INSPECT_ REAR Hubs, Wheel Seals for Oil Leaks	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
55,200 - !FRA!INSPECT_ REAR ABS Tone Rings, Sensors, Routing Of Cables (if equipped)	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
55,300 - MEASURE_RECORD_LR - Brake Lining, Pad Thickness (32nds)	10 32nds of an inch		JUHURST	Jun 25, 2021 3:08:09 PM	No	
55,400 - MEASURE_RECORD_RR - Brake Lining, Pad Thickness (32nds)	10 32nds of an inch		JUHURST	Jun 25, 2021 3:08:09 PM	No	
55,500 - INSPECT VISUALLY_MEASURE_RECORD_LR Drum, Rotor Condition (inches)	.722 Inch		JUHURST	Jun 25, 2021 3:08:09 PM	No	
55,600 - INSPECT VISUALLY_MEASURE_RECORD_RR Drum, Rotor Condition (inches)	.722 Inch		JUHURST	Jun 25, 2021 3:08:09 PM	No	
55,700 - !FRA!INSPECT_ Under Body Exhaust System	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
55,800 - *RPT*INSPECT_ REAR Axle Housing, Breather; CLEAN_Breather	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
55,900 - *RPT*INSPECT_ REAR Springs, Shocks, Suspension, Airbags	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
60,000 - SECTION 6 - Wheelchair Inspection	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
60,100 - RECORD_Wheelchair Cycle Count	12805 Cycles		JUHURST	Jun 25, 2021 3:08:09 PM	No	
60,200 - CHECK_Lift Access Door for Ease of Opening,Latch Security,Door Hold Back	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
60,300 - CHECK_Platform Emergency Release Mechanism for Ease of Operation	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
60,400 - OPERATE_Lift thru Complete Cycle;CHECK_Noises,Jerky Op,Too Fast-Slow,Drift Down	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
60,500 - INSPECT_Bridgeplate Operation	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
60,600 - INSPECT_All Pivot Points for Wear and Looseness	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
60,700 - INSPECT_Rollers for Wear and Smooth Rotation	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
60,800 - INSPECT_Operation of Platform Barrier Mechanism	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
60,900 - INSPECT_Cam Slots for Wear and Proper Alignment	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
61,000 - INSPECT_Cable Condition (If Applicable)	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
61,100 - INSPECT_Hydraulic Hoses for Leaks, Chafing or Cracks	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
61,200 - INSPECT_Electrical Connections and Routing of Wires and Cables	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
61,300 - INSPECT_Operation and Adjustment of All Safety Switches	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
61,400 - INSPECT_All Lift Mounting Brackets for Loose Bolts Broken Welds, etc.	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
61,500 - INSPECT_Manual Back-up Raise/Lower System (If Applicable)	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
61,600 - INSPECT_HydrPump Reservoir Oil Level. Consult SvcManual for Fluid to Use.	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
61,700 - CHECK_Operator Decals for Proper Positioning;CONSULT_Service Manual	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
61,800 - CHECK_WC Holddowns Inside Vehicle for Secure Mounting,Proper Operation	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
61,900 - CLEAN_Linkages and Mechanisms	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
62,000 - LUBRICATE_Linkages and Mechanisms (DO NOT OVER Lubricate)	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
62,100 - INSPECT_Emergency Platform Release Mechanism	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
62,200 - INSPECT_Platform Barrier Latch Mechanism	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
62,300 - INSPECT_Bridgeplate Hinge	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
62,400 - INSPECT_All Pivot Points	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
62,500 - INSPECT_Cams and Slots	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
62,600 - INSPECT_Rollers	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
62,700 - INSPECT_All Linkages	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
70,000 - SECTION 7 - ALTERNATIVE FUELS INSPECTION	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
70,300 - INSPECT_Condition of Fuel Pressure Gauge	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
70,400 - PROVIDE PROOF_Tank_Dents/Scratches and Re-Certification	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
70,500 - INSPECT_Tank test date, labels-Reference-ST.4 FMMVSS 304 & ANSI-CSA NGV2	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
70,600 - INSPECT_Tank Lines to Ensure Secure Mounting, Insulation Against Vibration	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
70,700 - INSPECT_Filling Nozzle for Securely Fitting Cap	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
70,800 - INSPECT_Pressure Relief Device's Venting System, Valves, Ducting to MNFR Specs	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
80,000 - SECTION 8 - PMI Report Completion	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
80,100 - COMPLETE_PM Report; Follow-ups	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	
80,200 - RETURN_Vehicle to Predetermined Location	Done		JUHURST	Jun 25, 2021 3:08:09 PM	No	


Activity Sub Total

Activity 10 Sub Total

Parts:	1.98
Labor:	0.00
Labor Hours:	2.10
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	1.98



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 54572283
Invoice No. 55345 - 54572283

Client Department:

Department: 55345M

Work Order Description

55345-LIGHT DUTY PMA

Requested By: JUHURST

Created By: JUHURST

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 3 - High

Driver:

Phone:

ETA:

Meter: 265,209 - DH

Activity Header

Activity: 20 999 TOTAL VEHICLE

Activity Note: PM A

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: A PM Level A

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
25-Jun-21	Junior Hurst	0.05	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List						
20 Desc: PM A						
Task: PM A SERVICE Performed by: JUHURST Performed on: 25-JUN-21						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
100,000 - "A" PMI SERVICING ITEMS	Done		JUHURST	Jun 25, 2021 3:09:47 PM	No	
101,000 - FRA Change Oil Filters	Yes		JUHURST	Jun 25, 2021 3:09:47 PM	No	
102,000 - FRA Drain Engine Oil	Yes		JUHURST	Jun 25, 2021 3:09:47 PM	No	
103,000 - FRA Check Transmission Fluid	Done		JUHURST	Jun 25, 2021 3:09:47 PM	No	
104,000 - Lubricate Chassis	Done		JUHURST	Jun 25, 2021 3:09:47 PM	No	
105,000 - Replace or Clean A/C Filters	Done		JUHURST	Jun 25, 2021 3:09:47 PM	No	
107,000 - FRA Change Primary Fuel Filter	Yes		JUHURST	Jun 25, 2021 3:09:47 PM	No	
108,000 - Lube all pivoting Mechanisms	Done		JUHURST	Jun 25, 2021 3:09:47 PM	No	

Activity Sub Total


Activity 20 Sub Total

Parts:	0.00
Labor:	0.00

	Labor Hours:	0.05
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	0.00
Work Order Footer		
	Work Order 54572283 Total	
	Parts:	1.98
	Labor:	0.00
	Labor Hours:	2.18
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	1.98



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 54546639
Invoice No. 55345 - 54546639

Client Department:

Department: 55345M

Work Order Description

FIRST TRANSIT - NORTH AMERICA - CONSPICUITY

Requested By: DGALLAGHER

Created By: DGALLAGHER

Assigned To:

Class: -

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 3 - High

Driver:

Phone:

ETA:

Meter: 260,374 - DH

Chronology

Reported	May 11, 2021 2:27:16 PM	May 11, 2021 2:27:16 PM
Started		
Completed	Jun 22, 2021 9:32:00 AM	Jun 22, 2021 9:32:00 AM
Down Time		

Work Order Notes

Line 10 Tape Added

Activity Header

Activity: 10 999/999 TOTAL VEHICLE

Activity Note: Personal Risk Assessment

Reason for Repair: SW Shop Work Order

Work Accomplished:

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: Personal Risk Assessment

Task: PRA and Meter Readings Performed by: TDELVA Performed on: 22-JUN-21

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		TDELVA	Jun 22, 2021 9:29:49 AM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		TDELVA	Jun 22, 2021 9:29:49 AM	No	
3 - Are you wearing the appropriate PPE?	Done		TDELVA	Jun 22, 2021 9:29:49 AM	No	
4 - Have you performed the proper LOTO?	Done		TDELVA	Jun 22, 2021 9:29:49 AM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		TDELVA	Jun 22, 2021 9:29:49 AM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		TDELVA	Jun 22, 2021 9:29:49 AM	No	
20 - Miles			TDELVA	Jun 22, 2021 9:29:49 AM	No	
30 - Kilometers			TDELVA	Jun 22, 2021	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO	
				9:29:49 AM			
40 - Hours			TDELVA	Jun 22, 2021 9:29:49 AM	No		
Activity Sub Total							
				Activity 10 Sub Total			
				Parts:			0.00
				Labor:			0.00
				Labor Hours:			0.00
				Sublet Parts:			0.00
				Sublet Labor:			0.00
				Activity Sub Total			0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 54546639
Invoice No. 55345 - 54546639

Client Department:

Department: 55345M

Work Order Description

FIRST TRANSIT - NORTH AMERICA - CONSPICUITY

Requested By: DGALLAGHER

Created By: DGALLAGHER

Assigned To:

Class: -

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 3 - High

Driver:

Phone:

ETA:

Meter: 260,374 - DH

Activity Header

Activity: 20 053/005/018 TAPE, REFLECTIVE

Activity Note: FIRST TRANSIT - NORTH AMERICA - CONSPICUITY

Reason for Repair: IC Internal Campaign

Work Accomplished:

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

20 Desc: FIRST TRANSIT - NORTH AMERICA - CONSPICUITY

Task: FIRST TRANSIT - NORTH AMERICA - CONSPICUITY Performed by: TDELVA Performed on: 22-JUN-21

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
100 - Inspect Conspicuity tape:		Tape Added	TDELVA	Jun 22, 2021 9:30:15 AM	No	

Activity Sub Total

Activity 20 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00

Work Order Footer

Work Order 54546639 Total

Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 54602662
Invoice No. 55345 - 54602662

Client Department:

Department: 55345M

Work Order Description

Muffler Pipe Hanging

Requested By: AOWENS

Created By: AOWENS

Assigned To:

Class: WORC - WORK ORDER ROAD CALL

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 3 - High

Driver:

Phone:

ETA:

Meter: 262,227 - DH

Chronology

Reported	May 27, 2021 5:35:00 PM	May 27, 2021 5:35:00 PM
Started	May 27, 2021 7:04:00 PM	
Completed	May 28, 2021 12:29:00 AM	May 28, 2021 12:29:00 AM
Down Time		

Work Order Notes

Line 10 To file warranty be sure to do the following:

- 1) Enter a COMPLAINT statement for each activity.
- 2) Enter CAUSE statement in the Notes field of each activity.
- 3) Enter CORRECTION statement in the Comment section of each activity.

Complaint:broken muffler

Cause: damage

Correction: replaced exhaust clamp

Part number 95300 qty1 Line 20 UNIT SENT TO COSMOS MUFFLER SHOP FOR TAIL PIPE REPAIR

Activity Header

Activity:5 999 TOTAL VEHICLE

Activity Note: PRAMETER

Reason for Repair: SW Shop Work Order

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: PRAMETER

Task: PRA and Meter Readings Performed by: RGASPARD Performed on: 27-MAY-21

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		RGASPARD	May 27, 2021 7:04:44 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		RGASPARD	May 27, 2021 7:04:44 PM	No	
3 - Are you wearing the appropriate PPE?	Done		RGASPARD	May 27, 2021 7:04:44 PM	No	
4 - Have you performed the proper LOTO?	Done		RGASPARD	May 27, 2021 7:04:44 PM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		RGASPARD	May 27, 2021 7:04:44 PM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		RGASPARD	May 27, 2021 7:04:44 PM	No	
20 - Miles			RGASPARD	May 27, 2021 7:04:44 PM	No	
30 - Kilometers			RGASPARD	May 27, 2021 7:04:44 PM	No	
40 - Hours			RGASPARD	May 27, 2021 7:04:44 PM	No	

Activity Sub Total

Activity 5 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 54602662
Invoice No. 55345 - 54602662

Client Department:

Department: 55345M

Work Order Description

Muffler Pipe Hanging

Requested By: AOWENS

Created By: AOWENS

Assigned To:

Class: WORC - WORK ORDER ROAD CALL

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 3 - High

Driver:

Phone:

ETA:

Meter: 262,227 - DH

Activity Header

Activity: 10 999 TOTAL VEHICLE

Activity Note: ROAD CALL (Muffler Pipe Hangin)

Reason for Repair: 10 Road Call

Work Accomplished:

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
27-May-21	Gaspard,Ronald	1.15	0	0

Activity Sublet

No Data Available

Activity Checklist

No Data Available

No Data Available

Activity Sub Total

Activity 10 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	1.15
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00

Work Order Footer

Work Order 54602662 Total

Parts:	0.00
Labor:	0.00
Labor Hours:	1.15
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 54572291
Invoice No. 55345 - 54572291

Client Department:

Department: 55345M

Work Order Description

Water pump leaking

Requested By: JUHURST

Created By: JUHURST

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 2 - Medium

Driver:

Phone:

ETA:

Meter: 260,956 - DH

Chronology

Reported	May 17, 2021 3:01:05 PM	May 17, 2021 3:01:05 PM
Started	May 17, 2021 3:05:00 PM	
Completed	May 17, 2021 5:51:00 PM	May 17, 2021 5:51:00 PM
Down Time		

Work Order Notes

Line 10 To file warranty be sure to do the following:

- 1) Enter a COMPLAINT statement for each activity.
- 2) Enter CAUSE statement in the Notes field of each activity.
- 3) Enter CORRECTION statement in the Comment section of each activity.

Complaint: water pump

Cause: leaking coolant

Correction: drain coolant from engine after removed drive belt and water pump. Replaced new part # 1360K6 also # 4C3Z-8501-B Replace coolants Unit working as design return unit back to work

Activity Header

Activity: 5 999 TOTAL VEHICLE

Activity Note: Personal Risk Assessment

Reason for Repair: SW Shop Work Order

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: Personal Risk Assessment

Task: PRA and Meter Readings Performed by: JUHURST Performed on: 17-MAY-21

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		JUHURST	May 17, 2021 5:50:24 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		JUHURST	May 17, 2021 5:50:24 PM	No	
3 - Are you wearing the appropriate PPE?	Done		JUHURST	May 17, 2021 5:50:24 PM	No	
4 - Have you performed the proper LOTO?	Done		JUHURST	May 17, 2021 5:50:24 PM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		JUHURST	May 17, 2021 5:50:24 PM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		JUHURST	May 17, 2021 5:50:24 PM	No	
20 - Miles			JUHURST	May 17, 2021 5:50:24 PM	No	
30 - Kilometers			JUHURST	May 17, 2021 5:50:24 PM	No	
40 - Hours			JUHURST	May 17, 2021 5:50:24 PM	No	

Activity Sub Total

Activity 5 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 54572291
Invoice No. 55345 - 54572291

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Water pump leaking		Ford E450 Champion Challenger	
Requested By:	JUHURST	Status:	40 - Closed (40)
Created By:	JUHURST	Priority:	2 - Medium
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	260,956 - DH

Activity Header
Activity: 15 020 GROUP, DRIVETRAIN
Activity Note: Water pump
Reason for Repair: 11 Routine
Work Accomplished:
Part Failure:
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
17-May-21	1360K6	BELT, SERPENTINE, 6-RIB, 136.00" SAME AS 5061360	1	21	21
17-May-21	4C3Z-8501-B	PUMP, WATER, 6.8L	1	90.92	90.92

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
17-May-21	Junior Hurst	2.75	0	0

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available

Activity Sub Total	
Activity 15 Sub Total	
Parts:	111.92
Labor:	0.00
Labor Hours:	2.75
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	111.92

Work Order Footer	
Work Order 54572291 Total	
Parts:	111.92
Labor:	0.00
Labor Hours:	2.75
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	111.92



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 54465331
Invoice No. 55345 - 54465331

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
55345-LIGHT DUTY PMA		Ford E450 Champion Challenger	
Requested By:	JUHURST	Status:	40 - Closed (40)
Created By:	JUHURST	Priority:	3 - High
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	260,956 - DH

Chronology

Reported	May 17, 2021 12:37:19 PM	May 17, 2021 12:37:19 PM
Started	May 17, 2021 12:43:00 PM	
Completed	May 17, 2021 3:00:00 PM	May 17, 2021 3:00:00 PM
Down Time		

Work Order Notes

Line 10 COMPLAINT: Vehicle came in for service

CAUSE:Time for service

CORRECTION: service Job complete. For next operation

Activity Header

Activity:5 999/999/999 TOTAL VEHICLE
Activity Note: PERSONAL RISK ASSESSMENT
Reason for Repair: SW Shop Work Order
Work Accomplished: 06 Inspect
Part Failure: 00 No Failure
Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
17-May-21	Junior Hurst	0.02	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: PERSONAL RISK ASSESSMENT

Task: PRA and Meter Readings Performed by: JUHURST Performed on: 17-MAY-21

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		JUHURST	May 17, 2021 12:44:01 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		JUHURST	May 17, 2021 12:44:01 PM	No	
3 - Are you wearing the appropriate PPE?	Done		JUHURST	May 17, 2021 12:44:01 PM	No	
4 - Have you performed the proper LOTO?	Done		JUHURST	May 17, 2021 12:44:01 PM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		JUHURST	May 17, 2021 12:44:01 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		JUHURST	May 17, 2021 12:44:01 PM	No	
20 - Miles			JUHURST	May 17, 2021 12:44:01 PM	No	
30 - Kilometers			JUHURST	May 17, 2021 12:44:01 PM	No	
40 - Hours			JUHURST	May 17, 2021 12:44:01 PM	No	


Activity Sub Total

Activity 5 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	0.02
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 54465331
Invoice No. 55345 - 54465331

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
55345-LIGHT DUTY PMA		Ford E450 Champion Challenger	
Requested By:	JUHURST	Status:	40 - Closed (40)
Created By:	JUHURST	Priority:	3 - High
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	260,956 - DH

Activity Header

Activity: 10 010 CHASSIS GROUP

Activity Note: Light Duty PMI

Reason for Repair: 11 Routine

Work Accomplished:

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
17-May-21	B329(F)	GOING OUT OF SERVICE SEE BALDWIN B329 IN THE FLEET ORG. FILTER, OIL, SPIN-ON	1	1.98	1.98

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
17-May-21	Junior Hurst	2.13	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List						
10 Desc: Light Duty PMI						
Task: First Transit North America Light Duty PM Inspection Sheet Performed by: JUHURST Performed on: 17-MAY-21						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,000 - SECTION 1 - Preparation Inspection	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
10,100 - INSPECT_Auto-Transmission Operation/Controller; Neutral Safety Switch	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
10,200 - !FRA!INSPECT_Starter Operation	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
10,300 - !FRA!INSPECT_Warning Lights and Alarms	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
10,400 - !FRA!INSPECT_Back Up Alarm	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
10,500 - !FRA!INSPECT_Engine Operation, OBSERVE_Exhaust for Excessive Smoke	Done		JUHURST	May 17, 2021 2:51:37 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,600 - Check Driver's Pre-trip or DVIR/EVIR & Authorization Forms	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
10,700 - INSPECT_All Exterior Lights (Turn on until Completion of this section)	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
10,800 - *RPT*INSPECT_Body Damage, Corrosion;DOCUMENT_Issues	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
10,900 - INSPECT_Fuel Tank Cap, and Doors	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
11,100 - INSPECT_License Plate, Bracket, Bumpers	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
20,000 - SECTION 2 - Test Drive and Operator Area Inspection	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
20,100 - INSPECT_Driver Seat condition/operation/seatbelt	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
20,200 - TEST DRIVE_INSPECT_Proper Operation; Drive into Shop	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
20,300 - *RPT*INSPECT_Steering Wheel for Play/Bind/Horn Op./Turn Signal Cancelation	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
20,400 - PERFORM_Brake Test (Apply hard enough to check wheel pull and Application)	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
20,500 - *RPT*FRA INSPECT_Lighting/Operation of all Gauges	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
20,600 - *RPT*INSPECT_Windshields, Sun Visors	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
20,700 - INSPECT_Wiper/Washer Operation, Condition	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
20,800 - INSPECT_High Idle Control	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
20,900 - *RPT*!FRA!INSPECT_HVAC Controls, Operation	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
21,000 - *RPT*!FRA!INSPECT_Operation of all Switches and Accessories	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
21,100 - INSPECT_Parking Brake Operation	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
21,200 - !FRA!TEST_Service Brake Backup System (Stationary Brake Tests HYD)	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
21,300 - INSPECT_VIN, Tire Pressure Decal, Data Tags	Done		JUHURST	May 17, 2021 2:51:37 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
21,400 - *RPT*INSPECT_Drivers Door Hinges, Handles, Controls and Panels	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
21,500 - !FRA!INSPECT_Under Dash Wiring for Proper Routing/Chafing/Securement	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
21,550 - INSPECT_Driver Floor Area for Water Leaks	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
21,600 - *RPT*INSPECT for WEAR_Pedal Pads, Accelerator, Brake, Parking Brake	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
21,700 - INSPECT_Engine Fault Codes	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
30,000 - SECTION 3 - EXTERIOR INSPECTION - Front	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
31,000 - SSF (Street Side Front)	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
31,010 - *RPT*!FRA!INSPECT_Mirror Mountings, Brackets, Glass	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
31,020 - *RPT*INSPECT_FRONT Springs, Shocks, Spring Shackles	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
31,030 - INSPECT_Mud Flaps, Brackets	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
31,040 - INSPECT_Wiper Blades, Arms	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
32,000 - Engine Inspection	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
32,010 - INSPECT_Hood, Springs and Props	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
32,020 - !FRA!INSPECT_Engine Compartment Condition for Fire Risk Avoidance	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
32,030 - !FRA!INSPECT_for Fluid Leaks, Levels	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
32,040 - !FRA!INSPECT_Hyd_Brake Fluid with Test Strips	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
32,050 - !FRA!INSPECT_RECORD_Coolant Recovery with Refractometer; Test Strips	26 Degree Fahrenheit		JUHURST	May 17, 2021 2:51:37 PM	No	
32,060 - PRESSURE TEST_Cooling Systems (Radiator, Cap, hoses and clamps)	Done	water pump need change	JUHURST	May 17, 2021 2:51:37 PM	No	
32,070 - *RPT*INSPECT_Radiator and Mountings, Cores	Done		JUHURST	May 17, 2021 2:51:37 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
32,080 - *RPT*!INSPECT_Fan Assembly, Shroud, Tensioner, Belts, All Belt Driven Components	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
32,090 - *RPT*!FRA!INSPECT_Mounting, Installation of Alternator, AC Compressor	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
32,100 - INSPECT_Intake System	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
32,140 - *RPT*!FRA!RECORD_Underhood Battery Voltages (volts)	14 Volt*		JUHURST	May 17, 2021 2:51:37 PM	No	
33,010 - CSF (Curb Side Front)	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
33,020 - *RPT*!FRA!INSPECT_Mirror Mountings, Brackets, Glass	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
33,030 - *RPT*!INSPECT_FRONT Springs, Shocks, Spring Shackles	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
33,040 - INSPECT_Mud Flaps, Brackets	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
33,050 - INSPECT_Wiper Blades, Arms	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
33,060 - !FRA!INSPECT_LUBE_Battery Box, Batteries, Tray Slides, Hold Downs	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
33,070 - *RPT*!FRA!RECORD_Side Mounted Battery Voltages (volts)	14 Volt*		JUHURST	May 17, 2021 2:51:37 PM	No	
33,080 - INSPECT_Entry door, OPEN_with external lock/switch (if equipped)	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
40,000 - SECTION 4 - Interior Inspection	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
40,100 - *RPT*!INSPECT_Step-Well, Step-Tread, Hand Rails, Step-well Light	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
40,200 - INSPECT_Insurance/Registration/Regulatory Forms Dates	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
40,250 - INSPECT_Overhead Compartment for Water Leaks	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
40,300 - INSPECT_Safety Equipment, Fire Extinguisher/Suppression	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
40,400 - INSPECT_Camera Systems, Filter, Electrical Inputs/Outputs-SOP M038	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
40,600 - !FRA!CHECK for HOTSPOTS_Interior Elec Panel Fuses/Circuit Breakers/Connectors	Done		JUHURST	May 17, 2021 2:51:37 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
40,700 - *RPT*INSPECT_Seats, Covering, Belts, Loose Cushions, Operation	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
40,800 - *RPT*!FRA!INSPECT_Interior Lights; Mirrors	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
40,900 - !FRA!INSPECT_Interior Cleanliness/Potential Projectiles	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
41,000 - INSPECT_All ADA Equip (Lift Seat Belt, floor hold Downs, Belts, Cover, Alarms)	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
41,100 - INSPECT_CLEAN_AC Filter	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
41,200 - INSPECT_Emergency Windows, Hatches, Doors, Associated Alarms and Lights	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
41,300 - *RPT*INSPECT_Interior Body, Floor, Stanchions	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
41,400 - *RPT*INSPECT_Passenger Doors, Glass, Seal	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
50,000 - SECTION 5 - UNDER VEHICLE INSPECTION	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
50,100 - *RPT*INSPECT_Steering components-Drag Link, Tie Rods ends and Steering Damper	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
50,200 - INSPECT_Ball Joint Play	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
50,300 - !FRA!INSPECT_Front Wheel Bearings for Play	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
50,400 - LUBE_All Chassis Components	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
50,500 - !FRA!CHANGE_Engine oil, filters	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
50,700 - INSPECT_Tire Condition	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
50,800 - INSPECT_Tire Valve Stems, Double Check Caps	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
50,900 - !FRA!INSPECT_Wheels for Cracks, Loose Lugs/Indicators, Outer Hub Leaks	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
51,000 - RECORD_LF-Tire Tread Depth (32nds)	6 32nds of an inch		JUHURST	May 17, 2021 2:51:37 PM	No	
51,100 - RECORD_LF-Tire Air Pressure (psi)	65 Pounds per Square Inch		JUHURST	May 17, 2021 2:51:37 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
51,200 - RECORD_RF-Tire Tread Depth (32nds)	7 32nds of an inch		JUHURST	May 17, 2021 2:51:37 PM	No	
51,300 - RECORD_RF-Air Pressure (psi)	65 Pounds per Square Inch		JUHURST	May 17, 2021 2:51:37 PM	No	
51,400 - !FRA!INSPECT_FRONT ABS Tone Rings, Sensors, Routing of Cables	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
51,500 - !FRA!INSPECT_Wheel Seals for Leaks	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
51,600 - !FRA!INSPECT_Front Brake Assemblies	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
51,700 - MEASURE_RECORD_LF - Brake Lining, Pad Thickness (32nds)	10 32nds of an inch		JUHURST	May 17, 2021 2:51:37 PM	No	
51,800 - MEASURE_RECORD_RF - Brake Lining, Pad Thickness (32nds)	10 32nds of an inch		JUHURST	May 17, 2021 2:51:37 PM	No	
51,900 - INSPECT VISUALLY_RECORD_LF Rotor Condition (inches)	1.2299 Inch		JUHURST	May 17, 2021 2:51:37 PM	No	
52,000 - INSPECT VISUALLY_RECORD_RF Rotor Condition (inches)	1.2299 Inch		JUHURST	May 17, 2021 2:51:37 PM	No	
52,100 - INSPECT_Vibration Damper	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
52,200 - !FRA!INSPECT_Battery Cable Routing from Battery Box to Starter	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
52,400 - !FRA!INSPECT_Starter Mounting	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
52,500 - !FRA!INSPECT_Engine Exhaust System	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
52,700 - INSPECT_Engine, Transmission Mounts	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
52,800 - !FRA!INSPECT_Engine, Transmission for Fluid Leaks	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
52,900 - INSPECT_Shift Cable Adjustment - All Transmissions	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
53,000 - !FRA!INSPECT_Transmission Breather and Clean	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
53,100 - *RPT*!FRA!INSPECT_Parking Brake Cables, Shoes for Wear, Contamination	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
53,200 - *RPT*INSPECT_A/C Condensor, Fans, Safety Grills	Done		JUHURST	May 17, 2021 2:51:37 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
53,300 - *RPT*INSPECT_Driveline, Hanger Bearings, U-Joints, Slip Joints, Safety Loop	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
53,400 - *RPT*INSPECT_All Body Mounts and Chassis Frame for Corrosion, Cracks	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
53,500 - !FRA!INSPECT_Fuel Tank, Mountings, Lines	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
53,600 - INSPECT_Tire Condition	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
53,700 - INSPECT_Tire Valve Stems, Double Check Caps	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
53,800 - INSPECT_Mismatched Tire Tread, Casing Design	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
53,900 - INSPECT_Dual Mating Tires w/Square	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
54,000 - !FRA!INSPECT_Wheels for Cracks, Loose Lugs/Indicators, Outer Hub Leaks	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
54,100 - INSPECT_Mud Flaps, Brackets	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
54,200 - RECORD_RRO-Tire Tread Depth (32nds)	7 32nds of an inch		JUHURST	May 17, 2021 2:51:37 PM	No	
54,300 - RECORD_RRI-Tire Tread Depth (32nds)	5 32nds of an inch		JUHURST	May 17, 2021 2:51:37 PM	No	
54,400 - RECORD_RRO-Air Pressure (psi)	65 Pounds per Square Inch		JUHURST	May 17, 2021 2:51:37 PM	No	
54,500 - RECORD_RRI-Air Pressure (psi)	65 Pounds per Square Inch		JUHURST	May 17, 2021 2:51:37 PM	No	
54,600 - RECORD_LRO-Tire Tread Depth (32nds)	5 32nds of an inch		JUHURST	May 17, 2021 2:51:37 PM	No	
54,700 - RECORD_LRI-Tire Tread Depth (32nds)	5 32nds of an inch		JUHURST	May 17, 2021 2:51:37 PM	No	
54,800 - RECORD_LRO-Air Pressure (psi)	65 Pounds per Square Inch		JUHURST	May 17, 2021 2:51:37 PM	No	
54,900 - RECORD_LRI-Air Pressure (psi)	65 Pounds per Square Inch		JUHURST	May 17, 2021 2:51:37 PM	No	
55,000 - !FRA!INSPECT_REAR Brake Assemblies	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
55,100 - !FRA!INSPECT_REAR Hubs, Wheel Seals for Oil Leaks	Done		JUHURST	May 17, 2021 2:51:37 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
55,200 - !FRA!INSPECT_REAR ABS Tone Rings, Sensors, Routing Of Cables (if equipped)	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
55,300 - MEASURE_RECORD_LR - Brake Lining, Pad Thickness (32nds)	10 32nds of an inch		JUHURST	May 17, 2021 2:51:37 PM	No	
55,400 - MEASURE_RECORD_RR - Brake Lining, Pad Thickness (32nds)	10 32nds of an inch		JUHURST	May 17, 2021 2:51:37 PM	No	
55,500 - INSPECT VISUALLY_MEASURE_RECORD_LR Drum, Rotor Condition (inches)	.799 Inch		JUHURST	May 17, 2021 2:51:37 PM	No	
55,600 - INSPECT VISUALLY_MEASURE_RECORD_RR Drum, Rotor Condition (inches)	.799 Inch		JUHURST	May 17, 2021 2:51:37 PM	No	
55,700 - !FRA!INSPECT_ Under Body Exhaust System	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
55,800 - *RPT*INSPECT_REAR Axle Housing, Breather; CLEAN_Breather	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
55,900 - *RPT*INSPECT_REAR Springs, Shocks, Suspension, Airbags	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
60,000 - SECTION 6 - Wheelchair Inspection	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
60,100 - RECORD_Wheelchair Cycle Count	12618 Cycles		JUHURST	May 17, 2021 2:51:37 PM	No	
60,200 - CHECK_Lift Access Door for Ease of Opening,Latch Security,Door Hold Back	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
60,300 - CHECK_Platform Emergency Release Mechanism for Ease of Operation	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
60,400 - OPERATE_Lift thru Complete Cycle;CHECK_Noises,Jerky Op,Too Fast-Slow,Drift Down	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
60,500 - INSPECT_Bridgeplate Operation	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
60,600 - INSPECT_All Pivot Points for Wear and Looseness	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
60,700 - INSPECT_Rollers for Wear and Smooth Rotation	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
60,800 - INSPECT_Operation of Platform Barrier Mechanism	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
60,900 - INSPECT_Cam Slots for Wear and Proper Alignment	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
61,000 - INSPECT_Cable Condition (If Applicable)	Done		JUHURST	May 17, 2021 2:51:37 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
61,100 - INSPECT_Hydraulic Hoses for Leaks, Chafing or Cracks	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
61,200 - INSPECT_Electrical Connections and Routing of Wires and Cables	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
61,300 - INSPECT_Operation and Adjustment of All Safety Switches	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
61,400 - INSPECT_All Lift Mounting Brackets for Loose Bolts Broken Welds, etc.	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
61,500 - INSPECT_Manual Back-up Raise/Lower System (If Applicable)	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
61,600 - INSPECT_HydrPump Reservoir Oil Level. Consult SrvManual for Fluid to Use.	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
61,700 - CHECK_Operator Decals for Proper Positioning;CONSULT_Service Manual	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
61,800 - CHECK_WC Holddowns Inside Vehicle for Secure Mounting,Proper Operation	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
61,900 - CLEAN_Linkages and Mechanisms	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
62,000 - LUBRICATE_Linkages and Mechanisms (DO NOT OVER Lubricate)	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
62,100 - INSPECT_Emergency Platform Release Mechanism	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
62,200 - INSPECT_Platform Barrier Latch Mechanism	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
62,300 - INSPECT_Bridgeplate Hinge	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
62,400 - INSPECT_All Pivot Points	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
62,500 - INSPECT_Cams and Slots	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
62,600 - INSPECT_Rollers	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
62,700 - INSPECT_All Linkages	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
70,000 - SECTION 7 - ALTERNATIVE FUELS INSPECTION	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
70,300 - INSPECT_Condition of Fuel Pressure Gauge	Done		JUHURST	May 17, 2021 2:51:37 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
70,400 - PROVIDE PROOF_Tank_Dents/Scratches and Re-Certification	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
70,500 - INSPECT_Tank test date, labels-Reference-ST.4 FMMVSS 304 & ANSI-CSA NGV2	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
70,600 - INSPECT_Tank Lines to Ensure Secure Mounting, Insulation Against Vibration	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
70,700 - INSPECT_Filling Nozzle for Securely Fitting Cap	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
70,800 - INSPECT_Pressure Relief Device's Venting System, Valves, Ducting to MNFR Specs	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
80,000 - SECTION 8 - PMI Report Completion	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
80,100 - COMPLETE_PM Report; Follow-ups	Done		JUHURST	May 17, 2021 2:51:37 PM	No	
80,200 - RETURN_Vehicle to Predetermined Location	Done		JUHURST	May 17, 2021 2:51:37 PM	No	

Activity Sub Total

Activity 10 Sub Total	
Parts:	1.98
Labor:	0.00
Labor Hours:	2.13
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	1.98

Activity 20 Sub Total	
Parts:	0.00
Labor:	0.00

	Labor Hours:	0.03
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	0.00
Work Order Footer		
	Work Order 54465331 Total	
	Parts:	1.98
	Labor:	0.00
	Labor Hours:	2.18
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	1.98



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 54565822
Invoice No. 55345 - 54565822

Client Department:

Department: 55345M

Work Order Description

Washing fluid hose

Requested By: JUHURST

Created By: JUHURST

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 2 - Medium

Driver:

Phone:

ETA:

Meter: 260,956 - DH

Chronology

Reported	May 14, 2021 12:38:41 PM	May 14, 2021 12:38:41 PM
Started	May 14, 2021 12:44:00 PM	
Completed	May 14, 2021 5:11:00 PM	May 14, 2021 5:11:00 PM
Down Time		

Work Order Notes

Line 10 To file warranty be sure to do the following:

- 1) Enter a COMPLAINT statement for each activity.
- 2) Enter CAUSE statement in the Notes field of each activity.
- 3) Enter CORRECTION statement in the Comment section of each activity.

Complaint: Washer not working

Cause: Broken hose.

Correction: Job complete also replace coolant to unit return vehicle back to work

Activity Header

Activity: 5 999 TOTAL VEHICLE

Activity Note: Personal Risk Assessment

Reason for Repair: SW Shop Work Order

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: Personal Risk Assessment

Task: PRA and Meter Readings Performed by: JUHURST Performed on: 14-MAY-21

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		JUHURST	May 14, 2021 5:10:32 PM	No	
2 - If task requires lifting, are lifts secured, are jack	Done		JUHURST	May 14, 2021	No	


Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
stands used correctly?				5:10:32 PM		
3 - Are you wearing the appropriate PPE?	Done		JUHURST	May 14, 2021 5:10:32 PM	No	
4 - Have you performed the proper LOTO?	Done		JUHURST	May 14, 2021 5:10:32 PM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		JUHURST	May 14, 2021 5:10:32 PM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		JUHURST	May 14, 2021 5:10:32 PM	No	
20 - Miles			JUHURST	May 14, 2021 5:10:32 PM	No	
30 - Kilometers			JUHURST	May 14, 2021 5:10:32 PM	No	
40 - Hours			JUHURST	May 14, 2021 5:10:32 PM	No	

Activity Sub Total

Activity 5 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 54565822
Invoice No. 55345 - 54565822

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Washing fluid hose		Ford E450 Champion Challenger	
Requested By:	JUHURST	Status:	40 - Closed (40)
Created By:	JUHURST	Priority:	2 - Medium
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	260,956 - DH

Activity Header
Activity:15 024 DRIVESHAFTS
Activity Note: Washing fluid hose
Reason for Repair: 11 Routine
Work Accomplished:
Part Failure:
Activity Comments:

Activity Parts
No Data Available

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
14-May-21	Junior Hurst	4.42	0	0

Activity Sublet
No Data Available


Activity Checklist
No Data Available
No Data Available

Activity Sub Total		Activity 15 Sub Total	
Parts:	0.00	Labor:	0.00
Labor Hours:	4.42	Sublet Parts:	0.00
Sublet Labor:	0.00	Sublet Labor:	0.00
Activity Sub Total		0.00	

Work Order Footer		Work Order 54565822 Total	
Parts:	0.00	Labor:	0.00
Labor Hours:	4.42	Sublet Parts:	0.00
Sublet Labor:	0.00	Sublet Labor:	0.00
Activity Sub Total		0.00	



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 54513621
Invoice No. 55345 - 54513621

Client Department:

Department: 55345M

Work Order Description

WC lift door malfunction.

Requested By: EARJOHNSON

Created By: EARJOHNSON

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 2 - Medium

Driver:

Phone:

ETA:

Meter: 258,712 - DH

Chronology

Reported	Apr 29, 2021 9:29:17 PM	Apr 29, 2021 9:29:17 PM
Started	Apr 29, 2021 9:31:00 PM	
Completed	Apr 29, 2021 11:55:00 PM	Apr 29, 2021 11:55:00 PM
Down Time		

Work Order Notes

Line 10 To file warranty be sure to do the following:

- 1) Enter a COMPLAINT statement for each activity.
- 2) Enter CAUSE statement in the Notes field of each activity.
- 3) Enter CORRECTION statement in the Comment section of each activity.

Complaint: WC door issue.

Cause: Door hinges binding.

Correction: Lubricated WC lift door hinges. Line 20 Resecured WC lift handrails.

Remove and replaced (2) outboard roll stop gas springs.

Activity Header

Activity: 5 999 TOTAL VEHICLE

Activity Note: Personal Risk Assessment

Reason for Repair: SW Shop Work Order

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
29-Apr-21	Earl Johnson	0.05	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: Personal Risk Assessment

Task: PRA and Meter Readings Performed by: EARJOHNSON Performed on: 29-APR-21

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		EARJOHNSON	Apr 29, 2021 9:54:28 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		EARJOHNSON	Apr 29, 2021 9:54:28 PM	No	
3 - Are you wearing the appropriate PPE?	Done		EARJOHNSON	Apr 29, 2021 9:54:28 PM	No	
4 - Have you performed the proper LOTO?	Done		EARJOHNSON	Apr 29, 2021 9:54:28 PM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		EARJOHNSON	Apr 29, 2021 9:54:28 PM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		EARJOHNSON	Apr 29, 2021 9:54:28 PM	No	
20 - Miles			EARJOHNSON	Apr 29, 2021 9:54:28 PM	No	
30 - Kilometers			EARJOHNSON	Apr 29, 2021 9:54:28 PM	No	
40 - Hours			EARJOHNSON	Apr 29, 2021 9:54:28 PM	No	

Activity Sub Total

Activity 5 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	0.05
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 54513621
Invoice No. 55345 - 54513621

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
WC lift door malfunction.		Ford E450 Champion Challenger	
Requested By:	EARJOHNSON	Status:	40 - Closed (40)
Created By:	EARJOHNSON	Priority:	2 - Medium
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	258,712 - DH

Activity Header

Activity: 15 068/003/000 SYSTEM, HYDRAULIC, LIFTING/UNLOADING

Activity Note: WC lift door malfunction.

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 03 Replace New

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
29-Apr-21	32831	SPRING, SHOCK, GAS, W/C	1	26.61	26.61
05-May-21	32831	SPRING, SHOCK, GAS, W/C	2	26.61	53.22

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
29-Apr-21	Earl Johnson	0.37	0	0

Activity Sublet

No Data Available

Activity Checklist

No Data Available

No Data Available

Activity Sub Total

Activity 15 Sub Total

Parts:	79.83
Labor:	0.00
Labor Hours:	0.37
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	79.83

Work Order Footer

Work Order 54513621 Total

Parts:	79.83
Labor:	0.00
Labor Hours:	0.42
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	79.83



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 54481374
Invoice No. 55345 - 54481374

Client Department:

Department: 55345M

Work Order Description

Rear bumper

Requested By: JUHURST

Created By: JUHURST

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 2 - Medium

Driver:

Phone:

ETA:

Meter: 257,245 - DH

Chronology

Reported	Apr 19, 2021 12:18:18 PM	Apr 19, 2021 12:18:18 PM
Started	Apr 19, 2021 12:27:00 PM	
Completed	Apr 19, 2021 1:58:00 PM	Apr 19, 2021 1:58:00 PM
Down Time		

Work Order Notes

Line 10 To file warranty be sure to do the following:

- 1) Enter a COMPLAINT statement for each activity.
- 2) Enter CAUSE statement in the Notes field of each activity.
- 3) Enter CORRECTION statement in the Comment section of each activity.

Complaint: Rear bumper issue

Cause: Broken

Correction: I replace bumper back properly now Vehicle ok to work job complete

Activity Header

Activity: 5 999 TOTAL VEHICLE

Activity Note: Personal Risk Assessment

Reason for Repair: SW Shop Work Order

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: Personal Risk Assessment

Task: PRA and Meter Readings Performed by: JUHURST Performed on: 19-APR-21

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		JUHURST	Apr 19, 2021 1:56:49 PM	No	
2 - If task requires lifting, are lifts secured, are jack	Done		JUHURST	Apr 19, 2021	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
stands used correctly?				1:56:49 PM		
3 - Are you wearing the appropriate PPE?	Done		JUHURST	Apr 19, 2021 1:56:49 PM	No	
4 - Have you performed the proper LOTO?	Done		JUHURST	Apr 19, 2021 1:56:49 PM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		JUHURST	Apr 19, 2021 1:56:49 PM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		JUHURST	Apr 19, 2021 1:56:49 PM	No	
20 - Miles			JUHURST	Apr 19, 2021 1:56:49 PM	No	
30 - Kilometers			JUHURST	Apr 19, 2021 1:56:49 PM	No	
40 - Hours			JUHURST	Apr 19, 2021 1:56:49 PM	No	

Activity Sub Total

Activity 5 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 54481374
Invoice No. 55345 - 54481374

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FD4E4FS7EDB17176
Rear bumper		Ford E450 Champion Challenger	
Requested By:	JUHURST	Status:	40 - Closed (40)
Created By:	JUHURST	Priority:	2 - Medium
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	257,245 - DH

Activity Header
Activity: 15 010 CHASSIS GROUP
Activity Note: Rear bumper
Reason for Repair: 11 Routine
Work Accomplished:
Part Failure:
Activity Comments:

Activity Parts
No Data Available

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
19-Apr-21	Junior Hurst	1.47	0	0

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available

Activity Sub Total		Activity 15 Sub Total	
		Parts:	0.00
		Labor:	0.00
		Labor Hours:	1.47
		Sublet Parts:	0.00
		Sublet Labor:	0.00
		Activity Sub Total	0.00

Work Order Footer		Work Order 54481374 Total	
		Parts:	0.00
		Labor:	0.00
		Labor Hours:	1.47
		Sublet Parts:	0.00
		Sublet Labor:	0.00
		Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 54467525
Invoice No. 55345 - 54467525

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Ball joint		Ford E450 Champion Challenger	
Requested By:	JUHURST	Status:	40 - Closed (40)
Created By:	JUHURST	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	256,867 - DH

Chronology		
Reported	Apr 14, 2021 12:28:33 PM	Apr 14, 2021 12:28:33 PM
Started	Apr 14, 2021 12:33:00 PM	
Completed	Apr 14, 2021 7:20:00 PM	Apr 14, 2021 7:20:00 PM
Down Time		

Work Order Notes

- Line 10 To file warranty be sure to do the following:
- 1) Enter a COMPLAINT statement for each activity.
 - 2) Enter CAUSE statement in the Notes field of each activity.
 - 3) Enter CORRECTION statement in the Comment section of each activity.

=====

Complaint: Vehicle came in for front end repair

Cause:

Correction:

Line 20 Vehicle came in for ball joint replacement. Removed and replaced two lower Ball joint part # 8C2Z-3050. Also two upper joint part # 8C3Z-3049 Line 30 Vehicle came in for ball joint replacement. Removed and replaced two lower Ball joint part # 8C2Z-3050. Also two upper joint part # 8C3Z-3049. Please charge out this part for me. Thank you. Road test vehicle working as design return vehicle back to work

Activity Header
Activity: 5 999 TOTAL VEHICLE
Activity Note: Personal Risk Assessment
Reason for Repair: SW Shop Work Order
Work Accomplished: 06 Inspect
Part Failure:
Activity Comments:
Activity Parts
No Data Available
Activity Labor
No Data Available
Activity Sublet
No Data Available
Activity Checklist
Check List
5 Desc: Personal Risk Assessment Task: PRA and Meter Readings Performed by: JUHURST Performed on: 14-APR-21

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		JUHURST	Apr 14, 2021 6:11:48 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		JUHURST	Apr 14, 2021 6:11:48 PM	No	
3 - Are you wearing the appropriate PPE?	Done		JUHURST	Apr 14, 2021 6:11:48 PM	No	
4 - Have you performed the proper LOTO?	Done		JUHURST	Apr 14, 2021 6:11:48 PM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		JUHURST	Apr 14, 2021 6:11:48 PM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		JUHURST	Apr 14, 2021 6:11:48 PM	No	
20 - Miles			JUHURST	Apr 14, 2021 6:11:48 PM	No	
30 - Kilometers			JUHURST	Apr 14, 2021 6:11:48 PM	No	
40 - Hours			JUHURST	Apr 14, 2021 6:11:48 PM	No	

Activity Sub Total

Activity 5 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 54467525
Invoice No. 55345 - 54467525

Client Department:

Department: 55345M

Work Order Description

Ball joint

Requested By: JUHURST

Created By: JUHURST

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 256,867 - DH

Activity Header

Activity: 15 013RTD FRONT AXLE

Activity Note: Ball joint

Reason for Repair: 11 Routine

Work Accomplished:

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
15-Apr-21	8C2Z-3050-A	JOINT, BALL, LOWER	2	51.83	103.66
15-Apr-21	8C3Z-3049-B	JOINT, BALL, UPPER	2	36.2	72.4

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
14-Apr-21	Junior Hurst	6.1	0	0

Activity Sublet

No Data Available

Activity Checklist

No Data Available

No Data Available

Activity Sub Total

Activity 15 Sub Total

Parts:	176.06
Labor:	0.00
Labor Hours:	6.10
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	176.06

Work Order Footer

Work Order 54467525 Total

Parts:	176.06
Labor:	0.00
Labor Hours:	6.10
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	176.06



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 4



Work Order No. 54376284
Invoice No. 55345 - 54376284

Client Department:

Department: 55345M

Work Order Description

55345-LIGHT DUTY PMC

Requested By: DARTHURS

Created By: DARTHURS

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 3 - High

Driver:

Phone:

ETA:

Meter: 256,867 - DH

Chronology

Reported	Apr 13, 2021 12:00:00 AM	Apr 13, 2021 12:00:00 AM
Started	Apr 13, 2021 12:33:00 PM	
Completed	Apr 13, 2021 7:39:00 PM	Apr 13, 2021 7:39:00 PM
Down Time		

Work Order Notes

Line 10 Vehicle came in for service. Job complete Line 20 Front and rear brakes below specifications. Removed and replaced one set front brakes part #8C2Z-2V001-D also one set rear part # 8C2Z-2V200-C and Two set caliper pin part # BC2Z-2C150. This vehicle Ball joint for tomorrow on my shift Please charge out the brakes for me. Can't fine in system

Activity Header

Activity: 5 999/999/999 TOTAL VEHICLE

Activity Note: PERSONAL RISK ASSESSMENT

Reason for Repair: SW Shop Work Order

Work Accomplished: 06 Inspect

Part Failure: 00 No Failure

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
13-Apr-21	B329(F)	GOING OUT OF SERVICE SEE BALDWIN B329 IN THE FLEET ORG. FILTER, OIL, SPIN-ON	1	1.98	1.98

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: PERSONAL RISK ASSESSMENT

Task: PRA and Meter Readings Performed by: JUHURST Performed on: 13-APR-21

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		JUHURST	Apr 13, 2021 2:14:12 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		JUHURST	Apr 13, 2021 2:14:12 PM	No	
3 - Are you wearing the appropriate PPE?	Done		JUHURST	Apr 13, 2021 2:14:12 PM	No	
4 - Have you performed the proper LOTO?	Done		JUHURST	Apr 13, 2021 2:14:12 PM	No	
5 - Are you aware of the potential risks of performing	Done		JUHURST	Apr 13, 2021	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
this repair?				2:14:12 PM		
10 - Have you successfully completed the Personal Risk Assessment?	Done		JUHURST	Apr 13, 2021 2:14:12 PM	No	
20 - Miles			JUHURST	Apr 13, 2021 2:14:12 PM	No	
30 - Kilometers			JUHURST	Apr 13, 2021 2:14:12 PM	No	
40 - Hours			JUHURST	Apr 13, 2021 2:14:12 PM	No	

Activity Sub Total

Activity 5 Sub Total	
Parts:	1.98
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	1.98



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 4



Work Order No. 54376284
Invoice No. 55345 - 54376284

Client Department:

Department: 55345M

Work Order Description

55345-LIGHT DUTY PMC

Requested By: DARTHURS

Created By: DARTHURS

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 3 - High

Driver:

Phone:

ETA:

Meter: 256,867 - DH

Activity Header

Activity: 10 010 CHASSIS GROUP

Activity Note: Light Duty PMI

Reason for Repair: 11 Routine

Work Accomplished:

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
13-Apr-21	Junior Hurst	1.58	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: Light Duty PMI

Task: First Transit North America Light Duty PM Inspection Sheet Performed by: JUHURST Performed on: 13-APR-21

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,000 - SECTION 1 - Preparation Inspection	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
10,100 - INSPECT_Auto-Transmission Operation/Controller; Neutral Safety Switch	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
10,200 - !FRA!INSPECT_Starter Operation	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
10,300 - !FRA!INSPECT_Warning Lights and Alarms	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
10,400 - !FRA!INSPECT_Back Up Alarm	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
10,500 - !FRA!INSPECT_Engine Operation, OBSERVE_ Exhaust for Excessive Smoke	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
10,600 - Check Driver's Pre-trip or DVIR/EVIR & Authorization Forms	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
10,700 - INSPECT_All Exterior Lights (Turn on until Completion of this section)	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
10,800 - *RPT*INSPECT_Body Damage, Corrosion;DOCUMENT_Issues	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
10,900 - INSPECT_Fuel Tank Cap, and Doors	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
11,100 - INSPECT_License Plate, Bracket, Bumpers	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
20,000 - SECTION 2 - Test Drive and Operator Area Inspection	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
20,100 - INSPECT_Driver Seat condition/operation/seatbelt	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
20,200 - TEST DRIVE_INSPECT_Proper Operation; Drive into Shop	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
20,300 - *RPT*INSPECT_Steering Wheel for Play/Bind/Horn Op./Turn Signal Cancelation	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
20,400 - PERFORM_Brake Test (Apply hard enough to check wheel pull and Application)	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
20,500 - *RPT*FRA INSPECT_Lighting/Operation of all Gauges	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
20,600 - *RPT*INSPECT_Windshields, Sun Visors	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
20,700 - INSPECT_Wiper/Washer Operation, Condition	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
20,800 - INSPECT_High Idle Control	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
20,900 - *RPT*!FRA!INSPECT_HVAC Controls, Operation	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
21,000 - *RPT*!FRA!INSPECT_Operation of all Switches and Accessories	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
21,100 - INSPECT_Parking Brake Operation	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
21,200 - !FRA!TEST_Service Brake Backup System (Stationary Brake Tests HYD)	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
21,300 - INSPECT_VIN, Tire Pressure Decal, Data Tags	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
21,400 - *RPT*INSPECT_Drivers Door Hinges, Handles, Controls and Panels	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
21,500 - !FRA!INSPECT_Under Dash Wiring for Proper Routing/Chafing/Securement	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
21,550 - INSPECT_Driver Floor Area for Water Leaks	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
21,600 - *RPT*INSPECT for WEAR_Pedal Pads, Accelerator, Brake, Parking Brake	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
21,700 - INSPECT_Engine Fault Codes	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
30,000 - SECTION 3 - EXTERIOR INSPECTION - Front	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
31,000 - SSF (Street Side Front)	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
31,010 - *RPT*!FRA!INSPECT_Mirror Mountings, Brackets, Glass	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
31,020 - *RPT*INSPECT_FRONT Springs, Shocks, Spring Shackles	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
31,030 - INSPECT_Mud Flaps, Brackets	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
31,040 - INSPECT_Wiper Blades, Arms	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
32,000 - Engine Inspection	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
32,010 - INSPECT_Hood, Springs and Props	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
32,020 - !FRA!INSPECT_Engine Compartment Condition for Fire Risk Avoidance	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
32,030 - !FRA!INSPECT_for Fluid Leaks, Levels	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
32,040 - !FRA!INSPECT_Hyd_Brake Fluid with Test Strips	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
32,050 - !FRA!INSPECT_RECORD_Coolant Recovery with Refractometer; Test Strips	26 Degree Fahrenheit		JUHURST	Apr 13, 2021 7:36:22 PM	No	
32,060 - PRESSURE TEST_Cooling Systems (Radiator, Cap, hoses and clamps)	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
32,070 - *RPT*INSPECT_Radiator and Mountings, Cores	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
32,080 - *RPT*INSPECT_Fan Assembly, Shroud, Tensioner, Belts, All Belt Driven Components	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
32,090 - *RPT*!FRA!INSPECT_Mounting, Installation of Alternator, AC Compressor	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
32,100 - INSPECT_Intake System	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
32,140 - *RPT*!FRA!RECORD_Underhood Battery Voltages (volts)	14 Volt*		JUHURST	Apr 13, 2021 7:36:22 PM	No	
33,010 - CSF (Curb Side Front)	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
33,020 - *RPT*!FRA!INSPECT_Mirror Mountings, Brackets, Glass	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
33,030 - *RPT*INSPECT_FRONT Springs, Shocks, Spring Shackles	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
33,040 - INSPECT_Mud Flaps, Brackets	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
33,050 - INSPECT_Wiper Blades, Arms	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
33,060 - !FRA!INSPECT_LUBE_Battery Box, Batteries, Tray Slides, Hold Downs	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
33,070 - *RPT*!FRA!RECORD_Side Mounted Battery Voltages (volts)	14 Volt*		JUHURST	Apr 13, 2021 7:36:22 PM	No	
33,080 - INSPECT_Entry door, OPEN_with external lock/switch (if equipped)	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
40,000 - SECTION 4 - Interior Inspection	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
40,100 - *RPT*INSPECT_Step-Well, Step-Tread, Hand Rails, Step-well Light	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
40,200 - INSPECT_Insurance/Registration/Regulatory Forms Dates	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
40,250 - INSPECT_Overhead Compartment for Water Leaks	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
40,300 - INSPECT_Safety Equipment, Fire Extinguisher/Suppression	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
40,400 - INSPECT_Camera Systems, Filter, Electrical Inputs/Outputs-SOP M038	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
40,600 - !FRA!CHECK for HOTSPOTS_Interior Elec Panel Fuses/Circuit Breakers/Connectors	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
40,700 - *RPT*INSPECT_Seats, Covering, Belts, Loose Cushions, Operation	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
40,800 - *RPT*!FRA!INSPECT_Interior Lights; Mirrors	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
40,900 - !FRA!INSPECT_Interior Cleanliness/Potential Projectiles	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
41,000 - INSPECT_All ADA Equip (Lift Seat Belt, floor hold Downs, Belts, Cover, Alarms)	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
41,100 - INSPECT_CLEAN_AC Filter	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
41,200 - INSPECT_Emergency Windows, Hatches, Doors, Associated Alarms and Lights	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
41,300 - *RPT*INSPECT_Interior Body, Floor, Stanchions	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
41,400 - *RPT*INSPECT_Passenger Doors, Glass, Seal	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
50,000 - SECTION 5 - UNDER VEHICLE INSPECTION	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
50,100 - *RPT*INSPECT_Steering components-Drag Link, Tie Rods ends and Steering Damper	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
50,200 - INSPECT_Ball Joint Play	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
50,300 - !FRA!INSPECT_Front Wheel Bearings for Play	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
50,400 - LUBE_All Chassis Components	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
50,500 - !FRA!CHANGE_Engine oil, filters	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
50,700 - INSPECT_Tire Condition	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
50,800 - INSPECT_Tire Valve Stems, Double Check Caps	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
50,900 - !FRA!INSPECT_Wheels for Cracks, Loose Lugs/Indicators, Outer Hub Leaks	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
51,000 - RECORD_LF-Tire Tread Depth (32nds)	5 32nds of an inch		JUHURST	Apr 13, 2021 7:36:22 PM	No	
51,100 - RECORD_LF-Tire Air Pressure (psi)	65 Pounds per Square Inch		JUHURST	Apr 13, 2021 7:36:22 PM	No	
51,200 - RECORD_RF-Tire Tread Depth (32nds)	5 32nds of an inch		JUHURST	Apr 13, 2021 7:36:22 PM	No	
51,300 - RECORD_RF-Air Pressure (psi)	65 Pounds per Square Inch		JUHURST	Apr 13, 2021 7:36:22 PM	No	
51,400 - !FRA!INSPECT_FRONT ABS Tone Rings, Sensors, Routing of Cables	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
51,500 - !FRA!INSPECT_Wheel Seals for Leaks	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
51,600 - !FRA!INSPECT_Front Brake Assemblies	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
51,700 - MEASURE_RECORD_LF - Brake Lining, Pad Thickness (32nds)	5 32nds of an inch		JUHURST	Apr 13, 2021 7:36:22 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
51,800 - MEASURE_RECORD_RF - Brake Lining, Pad Thickness (32nds)	8 32nds of an inch		JUHURST	Apr 13, 2021 7:36:22 PM	No	
51,900 - INSPECT VISUALLY_RECORD_LF Rotor Condition (inches)	1.2299 Inch		JUHURST	Apr 13, 2021 7:36:22 PM	No	
52,000 - INSPECT VISUALLY_RECORD_RF Rotor Condition (inches)	1.2299 Inch		JUHURST	Apr 13, 2021 7:36:22 PM	No	
52,100 - INSPECT_Vibration Damper	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
52,200 - !FRA!INSPECT_Battery Cable Routing from Battery Box to Starter	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
52,400 - !FRA!INSPECT_Starter Mounting	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
52,500 - !FRA!INSPECT_Engine Exhaust System	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
52,700 - INSPECT_Engine, Transmission Mounts	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
52,800 - !FRA!INSPECT_Engine, Transmission for Fluid Leaks	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
52,900 - INSPECT_Shift Cable Adjustment - All Transmissions	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
53,000 - !FRA!INSPECT_Transmission Breather and Clean	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
53,100 - *RPT*!FRA!INSPECT_Parking Brake Cables, Shoes for Wear, Contamination	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
53,200 - *RPT*INSPECT_A/C Condensor, Fans, Safety Grills	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
53,300 - *RPT*INSPECT_Driveline, Hanger Bearings, U-Joints, Slip Joints, Safety Loop	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
53,400 - *RPT*INSPECT_All Body Mounts and Chassis Frame for Corrosion, Cracks	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
53,500 - !FRA!INSPECT_Fuel Tank, Mountings, Lines	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
53,600 - INSPECT_Tire Condition	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
53,700 - INSPECT_Tire Valve Stems, Double Check Caps	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
53,800 - INSPECT_Mismatched Tire Tread, Casing Design	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
53,900 - INSPECT_Dual Mating Tires w/Square	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
54,000 - !FRA!INSPECT_Wheels for Cracks, Loose Lugs/Indicators, Outer Hub Leaks	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
54,100 - INSPECT_Mud Flaps, Brackets	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
54,200 - RECORD_RRO-Tire Tread Depth (32nds)	5 32nds of an inch		JUHURST	Apr 13, 2021 7:36:22 PM	No	
54,300 - RECORD_RRI-Tire Tread Depth (32nds)	5 32nds of an inch		JUHURST	Apr 13, 2021 7:36:22 PM	No	
54,400 - RECORD_RRO-Air Pressure (psi)	65 Pounds per Square Inch		JUHURST	Apr 13, 2021 7:36:22 PM	No	
54,500 - RECORD_RRI-Air Pressure (psi)	65 Pounds per Square Inch		JUHURST	Apr 13, 2021 7:36:22 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
54,600 - RECORD_LRO-Tire Tread Depth (32nds)	5 32nds of an inch		JUHURST	Apr 13, 2021 7:36:22 PM	No	
54,700 - RECORD_LRI-Tire Tread Depth (32nds)	5 32nds of an inch		JUHURST	Apr 13, 2021 7:36:22 PM	No	
54,800 - RECORD_LRO-Air Pressure (psi)	65 Pounds per Square Inch		JUHURST	Apr 13, 2021 7:36:22 PM	No	
54,900 - RECORD_LRI-Air Pressure (psi)	65 Pounds per Square Inch		JUHURST	Apr 13, 2021 7:36:22 PM	No	
55,000 - !FRA!INSPECT_ REAR Brake Assemblies	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
55,100 - !FRA!INSPECT_ REAR Hubs, Wheel Seals for Oil Leaks	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
55,200 - !FRA!INSPECT_REAR ABS Tone Rings, Sensors, Routing Of Cables (if equipped)	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
55,300 - MEASURE_RECORD_LR - Brake Lining, Pad Thickness (32nds)	6 32nds of an inch		JUHURST	Apr 13, 2021 7:36:22 PM	No	
55,400 - MEASURE_RECORD_RR - Brake Lining, Pad Thickness (32nds)	5 32nds of an inch		JUHURST	Apr 13, 2021 7:36:22 PM	No	
55,500 - INSPECT VISUALLY_MEASURE_RECORD_LR Drum, Rotor Condition (inches)	7.299 Inch		JUHURST	Apr 13, 2021 7:36:22 PM	No	
55,600 - INSPECT VISUALLY_MEASURE_RECORD_RR Drum, Rotor Condition (inches)	7.299 Inch		JUHURST	Apr 13, 2021 7:36:22 PM	No	
55,700 - !FRA!INSPECT_ Under Body Exhaust System	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
55,800 - *RPT*INSPECT_ REAR Axle Housing, Breather; CLEAN_Breather	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
55,900 - *RPT*INSPECT_ REAR Springs, Shocks, Suspension, Airbags	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
60,000 - SECTION 6 - Wheelchair Inspection	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
60,100 - RECORD_Wheelchair Cycle Count	12480 Cycles		JUHURST	Apr 13, 2021 7:36:22 PM	No	
60,200 - CHECK_ Lift Access Door for Ease of Opening,Latch Security,Door Hold Back	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
60,300 - CHECK_Platform Emergency Release Mechanism for Ease of Operation	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
60,400 - OPERATE_ Lift thru Complete Cycle;CHECK_Noises,Jerky Op,Too Fast-Slow,Drift Down	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
60,500 - INSPECT_ Bridgeplate Operation	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
60,600 - INSPECT_All Pivot Points for Wear and Looseness	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
60,700 - INSPECT_Rollers for Wear and Smooth Rotation	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
60,800 - INSPECT_Operation of Platform Barrier Mechanism	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
60,900 - INSPECT_Cam Slots for Wear and Proper Alignment	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
61,000 - INSPECT_Cable Condition (If Applicable)	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
61,100 - INSPECT_Hydraulic Hoses for Leaks, Chafing or Cracks	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
61,200 - INSPECT_Electrical Connections and Routing of Wires and Cables	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
61,300 - INSPECT_Operation and Adjustment of All Safety Switches	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
61,400 - INSPECT_All Lift Mounting Brackets for Loose Bolts Broken Welds, etc.	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
61,500 - INSPECT_Manual Back-up Raise/Lower System (If Applicable)	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
61,600 - INSPECT_HydrPump Reservoir Oil Level. Consult SvcManual for Fluid to Use.	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
61,700 - CHECK_Operator Decals for Proper Positioning;CONSULT_Service Manual	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
61,800 - CHECK_WC Holddowns Inside Vehicle for Secure Mounting,Proper Operation	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
61,900 - CLEAN_Linkages and Mechanisms	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
62,000 - LUBRICATE_Linkages and Mechanisms (DO NOT OVER Lubricate)	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
62,100 - INSPECT_Emergency Platform Release Mechanism	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
62,200 - INSPECT_Platform Barrier Latch Mechanism	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
62,300 - INSPECT_Bridgeplate Hinge	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
62,400 - INSPECT_All Pivot Points	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
62,500 - INSPECT_Cams and Slots	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
62,600 - INSPECT_Rollers	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
62,700 - INSPECT_All Linkages	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
70,000 - SECTION 7 - ALTERNATIVE FUELS INSPECTION	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
70,300 - INSPECT_Condition of Fuel Pressure Gauge	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
70,400 - PROVIDE PROOF_Tank_Dents/Scratches and Re-Certification	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
70,500 - INSPECT_Tank test date, labels-Reference-ST.4 FMMVSS 304 & ANSI-CSA NGV2	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
70,600 - INSPECT_Tank Lines to Ensure Secure Mounting, Insulation Against Vibration	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
70,700 - INSPECT_Filling Nozzle for Securely Fitting Cap	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
70,800 - INSPECT_Pressure Relief Device's Venting System, Valves, Ducting to MNFR Specs	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
80,000 - SECTION 8 - PMI Report Completion	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
80,100 - COMPLETE_PM Report; Follow-ups	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	
80,200 - RETURN_Vehicle to Predetermined Location	Done		JUHURST	Apr 13, 2021 7:36:22 PM	No	

Activity Sub Total															
	<table><tr><td colspan="2">Activity 10 Sub Total</td></tr><tr><td>Parts:</td><td>0.00</td></tr><tr><td>Labor:</td><td>0.00</td></tr><tr><td>Labor Hours:</td><td>1.58</td></tr><tr><td>Sublet Parts:</td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td>0.00</td></tr></table>	Activity 10 Sub Total		Parts:	0.00	Labor:	0.00	Labor Hours:	1.58	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	0.00
Activity 10 Sub Total															
Parts:	0.00														
Labor:	0.00														
Labor Hours:	1.58														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	0.00														



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 4



Work Order No. 54376284
Invoice No. 55345 - 54376284

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
55345-LIGHT DUTY PMC		Ford E450 Champion Challenger	
Requested By:	DARTHURS	Status:	40 - Closed (40)
Created By:	DARTHURS	Priority:	3 - High
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	256,867 - DH

Activity Header

Activity:20 999 TOTAL VEHICLE

Activity Note: PM C

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: C PM Level C

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

20 Desc: PM C

Task: PM C SERVICE Performed by: JUHURST Performed on: 13-APR-21

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
100,000 - "A" PMI SERVICING ITEMS	Done		JUHURST	Apr 13, 2021 2:11:55 PM	No	
101,000 - FRA Change Oil Filters	Yes		JUHURST	Apr 13, 2021 2:11:55 PM	No	
102,000 - FRA Drain Engine Oil	Yes		JUHURST	Apr 13, 2021 2:11:55 PM	No	
103,000 - FRA Check Transmission Fluid	Done		JUHURST	Apr 13, 2021 2:11:55 PM	No	
104,000 - Lubricate Chassis	Done		JUHURST	Apr 13, 2021 2:11:55 PM	No	
105,000 - Replace or Clean A/C Filters	Done		JUHURST	Apr 13, 2021 2:11:55 PM	No	
107,000 - FRA Change Primary Fuel Filter	Done		JUHURST	Apr 13, 2021 2:11:55 PM	No	
108,000 - Lube all pivoting Mechanisms	Done		JUHURST	Apr 13, 2021 2:11:55 PM	No	
200,000 - "B" PMI SERVICING ITEMS (12 MONTH)	Done		JUHURST	Apr 13, 2021 2:11:55 PM	No	
201,000 - Service Crankcase Breather	Done		JUHURST	Apr 13, 2021 2:11:55 PM	No	
203,000 - FRA Change Automatic Transmission Fluid	Yes		JUHURST	Apr 13, 2021 2:11:55 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
204,000 - FRA Change Power Steering Fluid and Filter	Yes		JUHURST	Apr 13, 2021 2:11:55 PM	No	
205,000 - Complete Engine Diagnostics and Clear Codes when Completed	Done		JUHURST	Apr 13, 2021 2:11:55 PM	No	
300,000 - "C" PMI SERVICING ITEMS (24 MONTH)	Done		JUHURST	Apr 13, 2021 2:11:55 PM	No	
301,000 - Check and Lubricate Door Linkages	Done		JUHURST	Apr 13, 2021 2:11:55 PM	No	
302,000 - Check Toe-In and Record Reading	Done		JUHURST	Apr 13, 2021 2:11:55 PM	No	
302,001 - Record Toe-In Reading	38 Inches, fraction-actual		JUHURST	Apr 13, 2021 2:11:55 PM	No	
304,000 - 1st "C" PMI ONLY: Tune Up Per Engine Mfg's Specifications	Yes		JUHURST	Apr 13, 2021 2:11:55 PM	No	
305,000 - FRA Change Differential Fluid	Yes		JUHURST	Apr 13, 2021 2:11:55 PM	No	

Activity Sub Total

Activity 20 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 4 of 4



Work Order No. 54376284
Invoice No. 55345 - 54376284

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
55345-LIGHT DUTY PMC		Ford E450 Champion Challenger	
Requested By:	DARTHURS	Status:	40 - Closed (40)
Created By:	DARTHURS	Priority:	3 - High
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	256,867 - DH

Activity Header
Activity:30 013 BRAKES
Activity Note: Front and rear brakes
Reason for Repair: 11 Routine
Work Accomplished:
Part Failure:
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
13-Apr-21	BC2Z-2C150-B	PIN, CALIPER, BRAKE, DISC, UPDATED, E450, '08	2	13.42	26.84

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
13-Apr-21	Junior Hurst	4.62	0	0

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available

Activity Sub Total		Activity 30 Sub Total	
Parts:	26.84	Labor:	0.00
Labor Hours:	4.62	Labor Parts:	0.00
Sublet Parts:	0.00	Sublet Labor:	0.00
Sublet Labor:	0.00	Activity Sub Total	26.84

Work Order Footer		Work Order 54376284 Total	
Parts:	28.82	Labor:	0.00
Labor Hours:	6.20	Labor Parts:	0.00
Sublet Parts:	0.00	Sublet Labor:	0.00
Sublet Labor:	0.00	Activity Sub Total	28.82



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 54383379
Invoice No. 55345 - 54383379

Client Department:

Department: 55345M

Work Order Description

Lift Repair

Requested By: DKNOTT

Created By: DKNOTT

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 252,754 - DH

Chronology

Reported	Mar 16, 2021 8:19:00 AM	Mar 16, 2021 8:19:00 AM
Started	Mar 16, 2021 8:42:00 AM	
Completed	Mar 16, 2021 10:54:00 AM	Mar 16, 2021 10:54:00 AM
Down Time		

Work Order Notes

Line 10 To file warranty be sure to do the following:

- 1) Enter a COMPLAINT statement for each activity.
- 2) Enter CAUSE statement in the Notes field of each activity.
- 3) Enter CORRECTION statement in the Comment section of each activity.

Complaint:wheel chair lift not working

Cause: Check system found right side front barrier safety switch is short it out

Correction:Replace switch retest system ok at this time

Part:

1 switch 400374aks

Activity Header

Activity:5 999 TOTAL VEHICLE

Activity Note: Personal Risk Assessment

Reason for Repair: SW Shop Work Order

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List																				
5 Desc: Personal Risk Assessment																				
Task: PRA and Meter Readings Performed by: JAPEREZ Performed on: 16-MAR-21																				
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO														
1 - Are you properly trained to perform the task?	Done		JAPEREZ	Mar 16, 2021 10:54:20 AM	No															
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		JAPEREZ	Mar 16, 2021 10:54:20 AM	No															
3 - Are you wearing the appropriate PPE?	Done		JAPEREZ	Mar 16, 2021 10:54:20 AM	No															
4 - Have you performed the proper LOTO?	Done		JAPEREZ	Mar 16, 2021 10:54:20 AM	No															
5 - Are you aware of the potential risks of performing this repair?	Done		JAPEREZ	Mar 16, 2021 10:54:20 AM	No															
10 - Have you successfully completed the Personal Risk Assessment?	Done		JAPEREZ	Mar 16, 2021 10:54:20 AM	No															
20 - Miles			JAPEREZ	Mar 16, 2021 10:54:20 AM	No															
30 - Kilometers			JAPEREZ	Mar 16, 2021 10:54:20 AM	No															
40 - Hours			JAPEREZ	Mar 16, 2021 10:54:20 AM	No															
Activity Sub Total																				
				<table border="1"> <thead> <tr> <th colspan="2">Activity 5 Sub Total</th> </tr> </thead> <tbody> <tr> <td>Parts:</td> <td>0.00</td> </tr> <tr> <td>Labor:</td> <td>0.00</td> </tr> <tr> <td>Labor Hours:</td> <td>0.00</td> </tr> <tr> <td>Sublet Parts:</td> <td>0.00</td> </tr> <tr> <td>Sublet Labor:</td> <td>0.00</td> </tr> <tr> <td>Activity Sub Total</td> <td>0.00</td> </tr> </tbody> </table>			Activity 5 Sub Total		Parts:	0.00	Labor:	0.00	Labor Hours:	0.00	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	0.00
Activity 5 Sub Total																				
Parts:	0.00																			
Labor:	0.00																			
Labor Hours:	0.00																			
Sublet Parts:	0.00																			
Sublet Labor:	0.00																			
Activity Sub Total	0.00																			



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 54383379
Invoice No. 55345 - 54383379

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Lift Repair		Ford E450 Champion Challenger	
Requested By:	DKNOTT	Status:	40 - Closed (40)
Created By:	DKNOTT	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	252,754 - DH

Activity Header
Activity: 15 068 Lifting / Unloading
Activity Note: Wheel chair lift not working
Reason for Repair: 04 Driver's Report
Work Accomplished:
Part Failure:
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
16-Mar-21	400374AKS	SWITCH, BARRIER, OUTER, W/C, BRAUN	1	33.69	33.69

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
16-Mar-21	Perez,Javier	2.13	0	0

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available

Activity Sub Total		Activity 15 Sub Total	
Parts:			33.69
Labor:			0.00
Labor Hours:			2.13
Sublet Parts:			0.00
Sublet Labor:			0.00
Activity Sub Total			33.69

Work Order Footer		Work Order 54383379 Total	
Parts:			33.69
Labor:			0.00
Labor Hours:			2.13
Sublet Parts:			0.00
Sublet Labor:			0.00
Activity Sub Total			33.69



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 54292626
Invoice No. 55345 - 54292626

Client Department:

Department: 55345M

Work Order Description

55345-LIGHT DUTY PMA

Requested By: JUHURST

Created By: JUHURST

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 3 - High

Driver:

Phone:

ETA:

Meter: 252,540 - DH

Chronology

Reported	Mar 12, 2021 12:00:17 PM	Mar 12, 2021 12:00:17 PM
Started	Mar 12, 2021 9:15:00 PM	
Completed	Mar 12, 2021 11:42:00 PM	Mar 12, 2021 11:42:00 PM
Down Time		

Work Order Notes

Line 10 COMPLAINT: Perform PMA Service..

CAUSE: Service Due by Mileage.

CORRECTION: Change Oil & Filter Lube all Pivoting Points. Check Brakes Clean batteries. Both rear Caliper dust boots Missing.

Parts # B329 Qty (1)

Oil 5W20QTY Qty (7.0) Qt.

Activity Header

Activity: 5 999/999/999 TOTAL VEHICLE

Activity Note: PERSONAL RISK ASSESSMENT

Reason for Repair: SW Shop Work Order

Work Accomplished: 06 Inspect

Part Failure: 00 No Failure

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: PERSONAL RISK ASSESSMENT

Task: PRA and Meter Readings Performed by: DARTHURS Performed on: 12-MAR-21

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		DARTHURS	Mar 12, 2021 11:02:59 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		DARTHURS	Mar 12, 2021 11:02:59 PM	No	
3 - Are you wearing the appropriate PPE?	Done		DARTHURS	Mar 12, 2021 11:02:59 PM	No	
4 - Have you performed the proper LOTO?	Done		DARTHURS	Mar 12, 2021 11:02:59 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
5 - Are you aware of the potential risks of performing this repair?	Done		DARTHURS	Mar 12, 2021 11:02:59 PM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		DARTHURS	Mar 12, 2021 11:02:59 PM	No	
20 - Miles			DARTHURS	Mar 12, 2021 11:02:59 PM	No	
30 - Kilometers			DARTHURS	Mar 12, 2021 11:02:59 PM	No	
40 - Hours			DARTHURS	Mar 12, 2021 11:02:59 PM	No	

Activity Sub Total

Activity 5 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 54292626
Invoice No. 55345 - 54292626

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
55345-LIGHT DUTY PMA		Ford E450 Champion Challenger	
Requested By:	JUHURST	Status:	40 - Closed (40)
Created By:	JUHURST	Priority:	3 - High
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	252,540 - DH

Activity Header

Activity: 10 079 DEVICES, SAFETY/STABILITY, TRAILER

Activity Note: Light Duty PMI

Reason for Repair: 05 Inspection, Routine

Work Accomplished:

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
12-Mar-21	Arthurs,Durvin	2.08	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: Light Duty PMI

Task: First Transit North America Light Duty PM Inspection Sheet Performed by: DARTHURS Performed on: 12-MAR-21

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,000 - SECTION 1 - Preparation Inspection	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
10,100 - INSPECT_Auto-Transmission Operation/Controller; Neutral Safety Switch	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
10,200 - !FRA!INSPECT_Starter Operation	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
10,300 - !FRA!INSPECT_Warning Lights and Alarms	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
10,400 - !FRA!INSPECT_Back Up Alarm	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
10,500 - !FRA!INSPECT_Engine Operation, OBSERVE_ Exhaust for Excessive Smoke	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
10,600 - Check Driver's Pre-trip or DVIR/EVIR & Authorization Forms	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
10,700 - INSPECT_All Exterior Lights (Turn on until Completion of this section)	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
10,800 - *RPT*INSPECT_Body Damage, Corrosion;DOCUMENT_Issues	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
10,900 - INSPECT_Fuel Tank Cap, and Doors	Done		DARTHURS	Mar 12, 2021	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
				11:01:09 PM		
11,100 - INSPECT_License Plate, Bracket, Bumpers	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
20,000 - SECTION 2 - Test Drive and Operator Area Inspection	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
20,100 - INSPECT_Driver Seat condition/operation/seatbelt	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
20,200 - TEST DRIVE_INSPECT_Proper Operation; Drive into Shop	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
20,300 - *RPT*INSPECT_Steering Wheel for Play/Bind/Horn Op./Turn Signal Cancelation	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
20,400 - PERFORM_Brake Test (Apply hard enough to check wheel pull and Application)	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
20,500 - *RPT*FRA INSPECT_Lighting/Operation of all Gauges	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
20,600 - *RPT*INSPECT_Windshields, Sun Visors	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
20,700 - INSPECT_Wiper/Washer Operation, Condition	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
20,800 - INSPECT_High Idle Control	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
20,900 - *RPT*!FRA!INSPECT_HVAC Controls, Operation	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
21,000 - *RPT*!FRA!INSPECT_Operation of all Switches and Accessories	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
21,100 - INSPECT_Parking Brake Operation	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
21,200 - !FRA!TEST_Service Brake Backup System (Stationary Brake Tests HYD)	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
21,300 - INSPECT_VIN, Tire Pressure Decal, Data Tags	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
21,400 - *RPT*INSPECT_Drivers Door Hinges, Handles, Controls and Panels	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
21,500 - !FRA!INSPECT_Under Dash Wiring for Proper Routing/Chafing/Securement	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
21,550 - INSPECT_Driver Floor Area for Water Leaks	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
21,600 - *RPT*INSPECT for WEAR_Pedal Pads, Accelerator, Brake, Parking Brake	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
21,700 - INSPECT_Engine Fault Codes	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
30,000 - SECTION 3 - EXTERIOR INSPECTION - Front	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
31,000 - SSF (Street Side Front)	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
31,010 - *RPT*!FRA!INSPECT_Mirror Mountings, Brackets, Glass	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
31,020 - *RPT*INSPECT_FRONT Springs, Shocks, Spring Shackles	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
31,030 - INSPECT_Mud Flaps, Brackets	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
31,040 - INSPECT_Wiper Blades, Arms	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
32,000 - Engine Inspection	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
32,010 - INSPECT_Hood, Springs and Props	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
32,020 - !FRA!INSPECT_Engine Compartment Condition for Fire Risk Avoidance	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
32,030 - !FRA!INSPECT_for Fluid Leaks, Levels	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
32,040 - !FRA!INSPECT_Hyd_Brake Fluid with Test Strips	-	NA	DARTHURS	Mar 12, 2021 11:01:09 PM	No	
32,050 - !FRA!INSPECT_RECORD_Coolant Recovery with Refractometer; Test Strips	Degree Fahrenheit	NA	DARTHURS	Mar 12, 2021 11:01:09 PM	No	
32,060 - PRESSURE TEST_Cooling Systems (Radiator, Cap, hoses and clamps)	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
32,070 - *RPT*INSPECT_Radiator and Mountings, Cores	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
32,080 - *RPT*INSPECT_Fan Assembly, Shroud, Tensioner, Belts, All Belt Driven Components	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
32,090 - *RPT*!FRA!INSPECT_Mounting, Installation of Alternator, AC Compressor	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
32,100 - INSPECT_Intake System	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
32,140 - *RPT*!FRA!RECORD_Underhood Battery Voltages (volts)	0 Volt*		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
33,010 - CSF (Curb Side Front)	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
33,020 - *RPT*!FRA!INSPECT_Mirror Mountings, Brackets, Glass	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
33,030 - *RPT*INSPECT_FRONT Springs, Shocks, Spring Shackles	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
33,040 - INSPECT_Mud Flaps, Brackets	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
33,050 - INSPECT_Wiper Blades, Arms	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
33,060 - !FRA!INSPECT_LUBE_Battery Box, Batteries, Tray Slides, Hold Downs	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
33,070 - *RPT*!FRA!RECORD_Side Mounted Battery Voltages (volts)	14.08 Volt*		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
33,080 - INSPECT_Entry door, OPEN_with external lock/switch (if equipped)	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
40,000 - SECTION 4 - Interior Inspection	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
40,100 - *RPT*INSPECT_Step-Well, Step-Tread, Hand Rails, Step-well Light	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
40,200 - INSPECT_Insurance/Registration/Regulatory Forms Dates	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
40,250 - INSPECT_Overhead Compartment for Water Leaks	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
40,300 - INSPECT_Safety Equipment, Fire	Done		DARTHURS	Mar 12, 2021	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
Extinguisher/Suppression				11:01:09 PM		
40,400 - INSPECT_Camera Systems, Filter, Electrical Inputs/Outputs-SOP M038	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
40,600 - !FRA!CHECK for HOTSPOTS_Interior Elec Panel Fuses/Circuit Breakers/Connectors	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
40,700 - *RPT*INSPECT_Seats, Covering, Belts, Loose Cushions, Operation	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
40,800 - *RPT*!FRA!INSPECT_Interior Lights; Mirrors	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
40,900 - !FRA!INSPECT_Interior Cleanliness/Potential Projectiles	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
41,000 - INSPECT_All ADA Equip (Lift Seat Belt, floor hold Downs, Belts, Cover, Alarms)	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
41,100 - INSPECT_CLEAN_AC Filter	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
41,200 - INSPECT_Emergency Windows, Hatches, Doors, Associated Alarms and Lights	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
41,300 - *RPT*INSPECT_Interior Body, Floor, Stanchions	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
41,400 - *RPT*INSPECT_Passenger Doors, Glass, Seal	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
50,000 - SECTION 5 - UNDER VEHICLE INSPECTION	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
50,100 - *RPT*INSPECT_Steering components-Drag Link, Tie Rods ends and Steering Damper	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
50,200 - INSPECT_Ball Joint Play	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
50,300 - !FRA!INSPECT_Front Wheel Bearings for Play	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
50,400 - LUBE_All Chassis Components	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
50,500 - !FRA!CHANGE_Engine oil, filters	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
50,700 - INSPECT_Tire Condition	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
50,800 - INSPECT_Tire Valve Stems, Double Check Caps	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
50,900 - !FRA!INSPECT_Wheels for Cracks, Loose Lugs/Indicators, Outer Hub Leaks	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
51,000 - RECORD_LF-Tire Tread Depth (32nds)	8 32nds of an inch		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
51,100 - RECORD_LF-Tire Air Pressure (psi)	70 Pounds per Square Inch		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
51,200 - RECORD_RF-Tire Tread Depth (32nds)	7 32nds of an inch		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
51,300 - RECORD_RF-Air Pressure (psi)	70 Pounds per Square Inch		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
51,400 - !FRA!INSPECT_FRONT ABS Tone Rings, Sensors, Routing of Cables	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
51,500 - !FRA!INSPECT_Wheel Seals for Leaks	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
51,600 - !FRA!INSPECT_ Front Brake Assemblies	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
51,700 - MEASURE_RECORD_LF - Brake Lining, Pad Thickness (32nds)	8 32nds of an inch		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
51,800 - MEASURE_RECORD_RF - Brake Lining, Pad Thickness (32nds)	8 32nds of an inch		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
51,900 - INSPECT VISUALLY_RECORD_LF Rotor Condition (inches)	1.554 Inch		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
52,000 - INSPECT VISUALLY_RECORD_RF Rotor Condition (inches)	1.554 Inch		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
52,100 - INSPECT_Vibration Damper	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
52,200 - !FRA!INSPECT_Battery Cable Routing from Battery Box to Starter	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
52,400 - !FRA!INSPECT_Starter Mounting	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
52,500 - !FRA!INSPECT_Engine Exhaust System	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
52,700 - INSPECT_Engine, Transmission Mounts	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
52,800 - !FRA!INSPECT_Engine, Transmission for Fluid Leaks	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
52,900 - INSPECT_Shift Cable Adjustment - All Transmissions	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
53,000 - !FRA!INSPECT_Transmission Breather and Clean	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
53,100 - *RPT*!FRA!INSPECT_Parking Brake Cables, Shoes for Wear, Contamination	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
53,200 - *RPT*INSPECT_A/C Condensor, Fans, Safety Grills	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
53,300 - *RPT*INSPECT_Driveline, Hanger Bearings, U-Joints, Slip Joints, Safety Loop	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
53,400 - *RPT*INSPECT_All Body Mounts and Chassis Frame for Corrosion, Cracks	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
53,500 - !FRA!INSPECT_Fuel Tank, Mountings, Lines	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
53,600 - INSPECT_Tire Condition	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
53,700 - INSPECT_Tire Valve Stems, Double Check Caps	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
53,800 - INSPECT_Mismatched Tire Tread, Casing Design	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
53,900 - INSPECT_Dual Mating Tires w/Square	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
54,000 - !FRA!INSPECT_Wheels for Cracks, Loose Lugs/Indicators, Outer Hub Leaks	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
54,100 - INSPECT_Mud Flaps, Brackets	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
54,200 - RECORD_RRO-Tire Tread Depth (32nds)	7 32nds of an inch		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
54,300 - RECORD_RRI-Tire Tread Depth (32nds)	11 32nds of an inch		DARTHURS	Mar 12, 2021 11:01:09 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
54,400 - RECORD_RRO-Air Pressure (psi)	65 Pounds per Square Inch		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
54,500 - RECORD_RRI-Air Pressure (psi)	65 Pounds per Square Inch		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
54,600 - RECORD_LRO-Tire Tread Depth (32nds)	8 32nds of an inch		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
54,700 - RECORD_LRI-Tire Tread Depth (32nds)	8 32nds of an inch		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
54,800 - RECORD_LRO-Air Pressure (psi)	65 Pounds per Square Inch		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
54,900 - RECORD_LRI-Air Pressure (psi)	65 Pounds per Square Inch		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
55,000 - !FRA!INSPECT_ REAR Brake Assemblies	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
55,100 - !FRA!INSPECT_ REAR Hubs, Wheel Seals for Oil Leaks	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
55,200 - !FRA!INSPECT_ REAR ABS Tone Rings, Sensors, Routing Of Cables (if equipped)	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
55,300 - MEASURE_RECORD_LR - Brake Lining, Pad Thickness (32nds)	8 32nds of an inch		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
55,400 - MEASURE_RECORD_RR - Brake Lining, Pad Thickness (32nds)	8 32nds of an inch		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
55,500 - INSPECT VISUALLY_MEASURE_RECORD_LR Drum, Rotor Condition (inches)	1.654 Inch		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
55,600 - INSPECT VISUALLY_MEASURE_RECORD_RR Drum, Rotor Condition (inches)	1.656 Inch		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
55,700 - !FRA!INSPECT_ Under Body Exhaust System	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
55,800 - *RPT*INSPECT_ REAR Axle Housing, Breather; CLEAN_Breather	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
55,900 - *RPT*INSPECT_ REAR Springs, Shocks, Suspension, Airbags	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
60,000 - SECTION 6 - Wheelchair Inspection	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
60,100 - RECORD_Wheelchair Cycle Count	12266 Cycles		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
60,200 - CHECK_ Lift Access Door for Ease of Opening,Latch Security,Door Hold Back	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
60,300 - CHECK_Platform Emergency Release Mechanism for Ease of Operation	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
60,400 - OPERATE_ Lift thru Complete Cycle;CHECK_Noises,Jerky Op,Too Fast-Slow,Drift Down	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
60,500 - INSPECT_ Bridgeplate Operation	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
60,600 - INSPECT_All Pivot Points for Wear and Looseness	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
60,700 - INSPECT_Rollers for Wear and Smooth Rotation	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
60,800 - INSPECT_Operation of Platform Barrier Mechanism	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
60,900 - INSPECT_Cam Slots for Wear and Proper	Done		DARTHURS	Mar 12, 2021	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
Alignment				11:01:09 PM		
61,000 - INSPECT_Cable Condition (If Applicable)	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
61,100 - INSPECT_Hydraulic Hoses for Leaks, Chafing or Cracks	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
61,200 - INSPECT_Electrical Connections and Routing of Wires and Cables	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
61,300 - INSPECT_Operation and Adjustment of All Safety Switches	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
61,400 - INSPECT_All Lift Mounting Brackets for Loose Bolts Broken Welds, etc.	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
61,500 - INSPECT_Manual Back-up Raise/Lower System (If Applicable)	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
61,600 - INSPECT_HydrPump Reservoir Oil Level. Consult SvcManual for Fluid to Use.	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
61,700 - CHECK_Operator Decals for Proper Positioning;CONSULT_Service Manual	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
61,800 - CHECK_WC Holddowns Inside Vehicle for Secure Mounting,Proper Operation	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
61,900 - CLEAN_Linkages and Mechanisms	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
62,000 - LUBRICATE_Linkages and Mechanisms (DO NOT OVER Lubricate)	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
62,100 - INSPECT_Emergency Platform Release Mechanism	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
62,200 - INSPECT_Platform Barrier Latch Mechanism	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
62,300 - INSPECT_Bridgeplate Hinge	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
62,400 - INSPECT_All Pivot Points	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
62,500 - INSPECT_Cams and Slots	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
62,600 - INSPECT_Rollers	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
62,700 - INSPECT_All Linkages	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
70,000 - SECTION 7 - ALTERNATIVE FUELS INSPECTION	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
70,300 - INSPECT_Condition of Fuel Pressure Gauge	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
70,400 - PROVIDE PROOF_Tank_Dents/Scratches and Re-Certification	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
70,500 - INSPECT_Tank test date, labels-Reference-ST.4 FMMVSS 304 & ANSI-CSA NGV2	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
70,600 - INSPECT_Tank Lines to Ensure Secure Mounting, Insulation Against Vibration	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
70,700 - INSPECT_Filling Nozzle for Securely Fitting Cap	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
70,800 - INSPECT_Pressure Relief Device's Venting System, Valves, Ducting to MNFR Specs	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
80,000 - SECTION 8 - PMI Report Completion	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
80,100 - COMPLETE_PM Report; Follow-ups	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
80,200 - RETURN_Vehicle to Predetermined Location	Done		DARTHURS	Mar 12, 2021 11:01:09 PM	No	
Activity Sub Total						
				Activity 10 Sub Total		
				Parts:		0.00
				Labor:		0.00
				Labor Hours:		2.08
				Sublet Parts:		0.00
				Sublet Labor:		0.00
				Activity Sub Total		0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 54292626
Invoice No. 55345 - 54292626

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
55345-LIGHT DUTY PMA		Ford E450 Champion Challenger	
Requested By:	JUHURST	Status:	40 - Closed (40)
Created By:	JUHURST	Priority:	3 - High
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	252,540 - DH

Activity Header

Activity: 20 999 TOTAL VEHICLE
Activity Note: PM A
Reason for Repair: 08 Preventive Maintenance
Work Accomplished: A PM Level A
Part Failure:
Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
12-Mar-21	B329(F)	GOING OUT OF SERVICE SEE BALDWIN B329 IN THE FLEET ORG. FILTER, OIL, SPIN-ON	1	1.96	1.96

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
12-Mar-21	Arthurs,Durvin	0.37	0	0

Activity Sublet

No Data Available

Activity Checklist


Check List						
20 Desc: PM A Task: PM A SERVICE Performed by: DARTHURS Performed on: 12-MAR-21						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
100,000 - "A" PMI SERVICING ITEMS	Done		DARTHURS	Mar 12, 2021 11:02:16 PM	No	
101,000 - FRA Change Oil Filters	Yes		DARTHURS	Mar 12, 2021 11:02:16 PM	No	
102,000 - FRA Drain Engine Oil	Yes		DARTHURS	Mar 12, 2021 11:02:16 PM	No	
103,000 - FRA Check Transmission Fluid	Done		DARTHURS	Mar 12, 2021 11:02:16 PM	No	
104,000 - Lubricate Chassis	Done		DARTHURS	Mar 12, 2021 11:02:16 PM	No	
105,000 - Replace or Clean A/C Filters	Done		DARTHURS	Mar 12, 2021 11:02:16 PM	No	
107,000 - FRA Change Primary Fuel Filter	No	NA	DARTHURS	Mar 12, 2021 11:02:16 PM	No	
108,000 - Lube all pivoting Mechanisms	Done		DARTHURS	Mar 12, 2021 11:02:16 PM	No	

Activity Sub Total

	Activity 20 Sub Total	
	Parts:	1.96
	Labor:	0.00
	Labor Hours:	0.37
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	1.96
Work Order Footer		
	Work Order 54292626 Total	
	Parts:	1.96
	Labor:	0.00
	Labor Hours:	2.45
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	1.96



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 54362585
Invoice No. 55345 - 54362585

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Wheelchair Lift		Ford E450 Champion Challenger	
Requested By:	RAURODRIGUEZ	Status:	40 - Closed (40)
Created By:	RAURODRIGUEZ	Priority:	-
Assigned To:		Driver:	
Class:	-	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	251,747 - DH

Chronology

Reported	Mar 9, 2021 7:29:42 AM	Mar 9, 2021 7:29:42 AM
Started	Mar 9, 2021 7:30:00 AM	
Completed	Mar 11, 2021 12:22:00 PM	Mar 11, 2021 12:22:00 PM
Down Time		

Work Order Notes

Line 10 Complaint. Lift is not working

Cause. Found bad hydraulic pump

Correction. Removed and replaced hydraulic pump with used good one.

Activity Header

Activity: 10 999/999/999 TOTAL VEHICLE

Activity Note: PERSONAL RISK ASSESMENT

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure: 00 No Failure

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: PERSONAL RISK ASSESMENT

Task: PRA and Meter Readings Performed by: RAURODRIGUEZ Performed on: 11-MAR-21

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		RAURODRIGUEZ	Mar 11, 2021 12:20:35 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		RAURODRIGUEZ	Mar 11, 2021 12:20:35 PM	No	
3 - Are you wearing the appropriate PPE?	Done		RAURODRIGUEZ	Mar 11, 2021 12:20:35 PM	No	
4 - Have you performed the proper LOTO?	Done		RAURODRIGUEZ	Mar 11, 2021 12:20:35 PM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		RAURODRIGUEZ	Mar 11, 2021 12:20:35 PM	No	
10 - Have you successfully completed the	Done		RAURODRIGUEZ	Mar 11, 2021	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO	
Personal Risk Assessment?				12:20:35 PM			
20 - Miles			RAURODRIGUEZ	Mar 11, 2021 12:20:35 PM	No		
30 - Kilometers			RAURODRIGUEZ	Mar 11, 2021 12:20:35 PM	No		
40 - Hours			RAURODRIGUEZ	Mar 11, 2021 12:20:35 PM	No		
Activity Sub Total							
				Activity 10 Sub Total			
				Parts:			0.00
				Labor:			0.00
				Labor Hours:			0.00
				Sublet Parts:			0.00
				Sublet Labor:			0.00
				Activity Sub Total			0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 54362585
Invoice No. 55345 - 54362585

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Wheelchair Lift		Ford E450 Champion Challenger	
Requested By:	RAURODRIGUEZ	Status:	40 - Closed (40)
Created By:	RAURODRIGUEZ	Priority:	-
Assigned To:		Driver:	
Class:	-	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	251,747 - DH

Activity Header
Activity:20 068/003/000 SYSTEM, HYDRAULIC, LIFTING/UNLOADING
Activity Note: WheelChair Lift
Reason for Repair: 05 Inspection, Routine
Work Accomplished: 03 Replace New
Part Failure:
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
12-Mar-21	954-0640RNA	ARM, FOLD, REAR, 54", W/C, BRAUN	1	180.77	180.77
12-Mar-21	46590	BELT, RESTRAINT, W/C, RICON	1	31.06	31.06
09-Mar-21	33775AKS	HARNESS, ROLL, STOP, W/C, BRAUN	1	52.09	52.09
10-Mar-21	4C2Z-9439-AA	GASKET, MANIFOLD, INTAKE	1	19.86	19.86
12-Mar-21	32831	SPRING, SHOCK, GAS, W/C	4	26.13	104.52

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
09-Mar-21	Rodriguez,Raul	4.58	0	0

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available

Activity Sub Total	
Activity 20 Sub Total	
Parts:	388.30
Labor:	0.00
Labor Hours:	4.58
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	388.30

Work Order Footer	
Work Order 54362585 Total	
Parts:	388.30
Labor:	0.00
Labor Hours:	4.58
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	388.30



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 54199060
Invoice No. 55345 - 54199060

Client Department:

Department: 55345M

Work Order Description

55345-LIGHT DUTY PMA

Requested By: RGASPARD

Created By: RGASPARD

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 3 - High

Driver:

Phone:

ETA:

Meter: 248,309 - DH

Chronology

Reported	Feb 11, 2021 12:00:00 AM	Feb 11, 2021 12:00:00 AM
Started	Feb 11, 2021 2:05:00 PM	
Completed	Feb 11, 2021 4:20:00 PM	Feb 11, 2021 4:20:00 PM
Down Time		

Work Order Notes

Line 10 COMPLAINT: Unit came in for service

CAUSE: time for service

CORRECTION: job complete replace one good used tire to right rear of unit after return vehicle back to work

Activity Header

Activity: 5 999/999/999 TOTAL VEHICLE

Activity Note: PERSONAL RISK ASSESSMENT

Reason for Repair: SW Shop Work Order

Work Accomplished: 06 Inspect

Part Failure: 00 No Failure

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
11-Feb-21	Junior Hurst	0.02	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: PERSONAL RISK ASSESSMENT

Task: PRA and Meter Readings Performed by: JUHURST Performed on: 11-FEB-21

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		JUHURST	Feb 11, 2021 2:05:50 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		JUHURST	Feb 11, 2021 2:05:50 PM	No	
3 - Are you wearing the appropriate PPE?	Done		JUHURST	Feb 11, 2021 2:05:50 PM	No	
4 - Have you performed the proper LOTO?	Done		JUHURST	Feb 11, 2021 2:05:50 PM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		JUHURST	Feb 11, 2021 2:05:50 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		JUHURST	Feb 11, 2021 2:05:50 PM	No	
20 - Miles			JUHURST	Feb 11, 2021 2:05:50 PM	No	
30 - Kilometers			JUHURST	Feb 11, 2021 2:05:50 PM	No	
40 - Hours			JUHURST	Feb 11, 2021 2:05:50 PM	No	
Activity Sub Total						
			Activity 5 Sub Total			
			Parts:			0.00
			Labor:			0.00
			Labor Hours:			0.02
			Sublet Parts:			0.00
			Sublet Labor:			0.00
			Activity Sub Total			0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 54199060
Invoice No. 55345 - 54199060

Client Department:

Department: 55345M

Work Order Description

55345-LIGHT DUTY PMA

Requested By: RGASPARD

Created By: RGASPARD

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 3 - High

Driver:

Phone:

ETA:

Meter: 248,309 - DH

Activity Header

Activity: 10

Activity Note: Light Duty PMI

Reason for Repair:

Work Accomplished:

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
11-Feb-21	Junior Hurst	1.93	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: Light Duty PMI

Task: First Transit North America Light Duty PM Inspection Sheet Performed by: JUHURST Performed on: 11-FEB-21

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,000 - SECTION 1 - Preparation Inspection	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
10,100 - INSPECT_Auto-Transmission Operation/Controller; Neutral Safety Switch	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
10,200 - !FRA!INSPECT_Starter Operation	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
10,300 - !FRA!INSPECT_Warning Lights and Alarms	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
10,400 - !FRA!INSPECT_Back Up Alarm	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
10,500 - !FRA!INSPECT_Engine Operation, OBSERVE_ Exhaust for Excessive Smoke	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
10,600 - Check Driver's Pre-trip or DVIR/EVIR & Authorization Forms	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
10,700 - INSPECT_All Exterior Lights (Turn on until Completion of this section)	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
10,800 - *RPT*INSPECT_Body Damage, Corrosion;DOCUMENT_Issues	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
10,900 - INSPECT_Fuel Tank Cap, and Doors	Done		JUHURST	Feb 11, 2021	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
				4:01:48 PM		
11,100 - INSPECT_License Plate, Bracket, Bumpers	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
20,000 - SECTION 2 - Test Drive and Operator Area Inspection	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
20,100 - INSPECT_Driver Seat condition/operation/seatbelt	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
20,200 - TEST DRIVE_INSPECT_Proper Operation; Drive into Shop	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
20,300 - *RPT*INSPECT_Steering Wheel for Play/Bind/Horn Op./Turn Signal Cancelation	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
20,400 - PERFORM_Brake Test (Apply hard enough to check wheel pull and Application)	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
20,500 - *RPT*FRA INSPECT_Lighting/Operation of all Gauges	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
20,600 - *RPT*INSPECT_Windshields, Sun Visors	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
20,700 - INSPECT_Wiper/Washer Operation, Condition	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
20,800 - INSPECT_High Idle Control	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
20,900 - *RPT*!FRA!INSPECT_HVAC Controls, Operation	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
21,000 - *RPT*!FRA!INSPECT_Operation of all Switches and Accessories	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
21,100 - INSPECT_Parking Brake Operation	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
21,200 - !FRA!TEST_Service Brake Backup System (Stationary Brake Tests HYD)	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
21,300 - INSPECT_VIN, Tire Pressure Decal, Data Tags	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
21,400 - *RPT*INSPECT_Drivers Door Hinges, Handles, Controls and Panels	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
21,500 - !FRA!INSPECT_Under Dash Wiring for Proper Routing/Chafing/Securement	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
21,550 - INSPECT_Driver Floor Area for Water Leaks	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
21,600 - *RPT*INSPECT for WEAR_Pedal Pads, Accelerator, Brake, Parking Brake	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
21,700 - INSPECT_Engine Fault Codes	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
30,000 - SECTION 3 - EXTERIOR INSPECTION - Front	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
31,000 - SSF (Street Side Front)	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
31,010 - *RPT*!FRA!INSPECT_Mirror Mountings, Brackets, Glass	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
31,020 - *RPT*INSPECT_FRONT Springs, Shocks, Spring Shackles	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
31,030 - INSPECT_Mud Flaps, Brackets	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
31,040 - INSPECT_Wiper Blades, Arms	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
32,000 - Engine Inspection	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
32,010 - INSPECT_Hood, Springs and Props	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
32,020 - !FRA!INSPECT_Engine Compartment Condition for Fire Risk Avoidance	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
32,030 - !FRA!INSPECT_for Fluid Leaks, Levels	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
32,040 - !FRA!INSPECT_Hyd_Brake Fluid with Test Strips	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
32,050 - !FRA!INSPECT_RECORD_Coolant Recovery with Refractometer; Test Strips	26 Degree Fahrenheit		JUHURST	Feb 11, 2021 4:01:48 PM	No	
32,060 - PRESSURE TEST_Cooling Systems (Radiator, Cap, hoses and clamps)	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
32,070 - *RPT*INSPECT_Radiator and Mountings, Cores	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
32,080 - *RPT*INSPECT_Fan Assembly, Shroud, Tensioner, Belts, All Belt Driven Components	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
32,090 - *RPT*!FRA!INSPECT_Mounting, Installation of Alternator, AC Compressor	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
32,100 - INSPECT_Intake System	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
32,140 - *RPT*!FRA!RECORD_Underhood Battery Voltages (volts)	14 Volt*		JUHURST	Feb 11, 2021 4:01:48 PM	No	
33,010 - CSF (Curb Side Front)	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
33,020 - *RPT*!FRA!INSPECT_Mirror Mountings, Brackets, Glass	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
33,030 - *RPT*INSPECT_FRONT Springs, Shocks, Spring Shackles	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
33,040 - INSPECT_Mud Flaps, Brackets	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
33,050 - INSPECT_Wiper Blades, Arms	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
33,060 - !FRA!INSPECT_LUBE_Battery Box, Batteries, Tray Slides, Hold Downs	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
33,070 - *RPT*!FRA!RECORD_Side Mounted Battery Voltages (volts)	14 Volt*		JUHURST	Feb 11, 2021 4:01:48 PM	No	
33,080 - INSPECT_Entry door, OPEN_with external lock/switch (if equipped)	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
40,000 - SECTION 4 - Interior Inspection	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
40,100 - *RPT*INSPECT_Step-Well, Step-Tread, Hand Rails, Step-well Light	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
40,200 - INSPECT_Insurance/Registration/Regulatory Forms Dates	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
40,250 - INSPECT_Overhead Compartment for Water Leaks	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
40,300 - INSPECT_Safety Equipment, Fire	Done		JUHURST	Feb 11, 2021	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
Extinguisher/Suppression				4:01:48 PM		
40,400 - INSPECT_Camera Systems, Filter, Electrical Inputs/Outputs-SOP M038	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
40,600 - !FRA!CHECK for HOTSPOTS_Interior Elec Panel Fuses/Circuit Breakers/Connectors	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
40,700 - *RPT*INSPECT_Seats, Covering, Belts, Loose Cushions, Operation	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
40,800 - *RPT*!FRA!INSPECT_Interior Lights; Mirrors	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
40,900 - !FRA!INSPECT_Interior Cleanliness/Potential Projectiles	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
41,000 - INSPECT_All ADA Equip (Lift Seat Belt, floor hold Downs, Belts, Cover, Alarms)	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
41,100 - INSPECT_CLEAN_AC Filter	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
41,200 - INSPECT_Emergency Windows, Hatches, Doors, Associated Alarms and Lights	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
41,300 - *RPT*INSPECT_Interior Body, Floor, Stanchions	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
41,400 - *RPT*INSPECT_Passenger Doors, Glass, Seal	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
50,000 - SECTION 5 - UNDER VEHICLE INSPECTION	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
50,100 - *RPT*INSPECT_Steering components-Drag Link, Tie Rods ends and Steering Damper	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
50,200 - INSPECT_Ball Joint Play	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
50,300 - !FRA!INSPECT_Front Wheel Bearings for Play	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
50,400 - LUBE_All Chassis Components	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
50,500 - !FRA!CHANGE_Engine oil, filters	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
50,700 - INSPECT_Tire Condition	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
50,800 - INSPECT_Tire Valve Stems, Double Check Caps	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
50,900 - !FRA!INSPECT_Wheels for Cracks, Loose Lugs/Indicators, Outer Hub Leaks	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
51,000 - RECORD_LF-Tire Tread Depth (32nds)	8 32nds of an inch		JUHURST	Feb 11, 2021 4:01:48 PM	No	
51,100 - RECORD_LF-Tire Air Pressure (psi)	65 Pounds per Square Inch		JUHURST	Feb 11, 2021 4:01:48 PM	No	
51,200 - RECORD_RF-Tire Tread Depth (32nds)	8 32nds of an inch		JUHURST	Feb 11, 2021 4:01:48 PM	No	
51,300 - RECORD_RF-Air Pressure (psi)	65 Pounds per Square Inch		JUHURST	Feb 11, 2021 4:01:48 PM	No	
51,400 - !FRA!INSPECT_FRONT ABS Tone Rings, Sensors, Routing of Cables	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
51,500 - !FRA!INSPECT_Wheel Seals for Leaks	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
51,600 - !FRA!INSPECT_ Front Brake Assemblies	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
51,700 - MEASURE_RECORD_LF - Brake Lining, Pad Thickness (32nds)	6 32nds of an inch		JUHURST	Feb 11, 2021 4:01:48 PM	No	
51,800 - MEASURE_RECORD_RF - Brake Lining, Pad Thickness (32nds)	6 32nds of an inch		JUHURST	Feb 11, 2021 4:01:48 PM	No	
51,900 - INSPECT VISUALLY_RECORD_LF Rotor Condition (inches)	2 Inch		JUHURST	Feb 11, 2021 4:01:48 PM	No	
52,000 - INSPECT VISUALLY_RECORD_RF Rotor Condition (inches)	2 Inch		JUHURST	Feb 11, 2021 4:01:48 PM	No	
52,100 - INSPECT_Vibration Damper	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
52,200 - !FRA!INSPECT_Battery Cable Routing from Battery Box to Starter	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
52,400 - !FRA!INSPECT_Starter Mounting	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
52,500 - !FRA!INSPECT_Engine Exhaust System	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
52,700 - INSPECT_Engine, Transmission Mounts	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
52,800 - !FRA!INSPECT_Engine, Transmission for Fluid Leaks	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
52,900 - INSPECT_Shift Cable Adjustment - All Transmissions	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
53,000 - !FRA!INSPECT_Transmission Breather and Clean	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
53,100 - *RPT*!FRA!INSPECT_Parking Brake Cables, Shoes for Wear, Contamination	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
53,200 - *RPT*INSPECT_A/C Condensor, Fans, Safety Grills	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
53,300 - *RPT*INSPECT_Driveline, Hanger Bearings, U-Joints, Slip Joints, Safety Loop	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
53,400 - *RPT*INSPECT_All Body Mounts and Chassis Frame for Corrosion, Cracks	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
53,500 - !FRA!INSPECT_Fuel Tank, Mountings, Lines	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
53,600 - INSPECT_Tire Condition	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
53,700 - INSPECT_Tire Valve Stems, Double Check Caps	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
53,800 - INSPECT_Mismatched Tire Tread, Casing Design	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
53,900 - INSPECT_Dual Mating Tires w/Square	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
54,000 - !FRA!INSPECT_Wheels for Cracks, Loose Lugs/Indicators, Outer Hub Leaks	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
54,100 - INSPECT_Mud Flaps, Brackets	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
54,200 - RECORD_RRO-Tire Tread Depth (32nds)	8 32nds of an inch		JUHURST	Feb 11, 2021 4:01:48 PM	No	
54,300 - RECORD_RRI-Tire Tread Depth (32nds)	8 32nds of an inch		JUHURST	Feb 11, 2021 4:01:48 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
54,400 - RECORD_RRO-Air Pressure (psi)	65 Pounds per Square Inch		JUHURST	Feb 11, 2021 4:01:48 PM	No	
54,500 - RECORD_RRI-Air Pressure (psi)	65 Pounds per Square Inch		JUHURST	Feb 11, 2021 4:01:48 PM	No	
54,600 - RECORD_LRO-Tire Tread Depth (32nds)	9 32nds of an inch		JUHURST	Feb 11, 2021 4:01:48 PM	No	
54,700 - RECORD_LRI-Tire Tread Depth (32nds)	9 32nds of an inch		JUHURST	Feb 11, 2021 4:01:48 PM	No	
54,800 - RECORD_LRO-Air Pressure (psi)	65 Pounds per Square Inch		JUHURST	Feb 11, 2021 4:01:48 PM	No	
54,900 - RECORD_LRI-Air Pressure (psi)	65 Pounds per Square Inch		JUHURST	Feb 11, 2021 4:01:48 PM	No	
55,000 - !FRA!INSPECT_ REAR Brake Assemblies	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
55,100 - !FRA!INSPECT_ REAR Hubs, Wheel Seals for Oil Leaks	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
55,200 - !FRA!INSPECT_REAR ABS Tone Rings, Sensors, Routing Of Cables (if equipped)	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
55,300 - MEASURE_RECORD_LR - Brake Lining, Pad Thickness (32nds)	6 32nds of an inch		JUHURST	Feb 11, 2021 4:01:48 PM	No	
55,400 - MEASURE_RECORD_RR - Brake Lining, Pad Thickness (32nds)	6 32nds of an inch		JUHURST	Feb 11, 2021 4:01:48 PM	No	
55,500 - INSPECT VISUALLY_MEASURE_RECORD_LR Drum, Rotor Condition (inches)	2 Inch		JUHURST	Feb 11, 2021 4:01:48 PM	No	
55,600 - INSPECT VISUALLY_MEASURE_RECORD_RR Drum, Rotor Condition (inches)	2 Inch		JUHURST	Feb 11, 2021 4:01:48 PM	No	
55,700 - !FRA!INSPECT_ Under Body Exhaust System	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
55,800 - *RPT*INSPECT_ REAR Axle Housing, Breather; CLEAN_Breather	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
55,900 - *RPT*INSPECT_ REAR Springs, Shocks, Suspension, Airbags	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
60,000 - SECTION 6 - Wheelchair Inspection	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
60,100 - RECORD_Wheelchair Cycle Count	12108 Cycles		JUHURST	Feb 11, 2021 4:01:48 PM	No	
60,200 - CHECK_ Lift Access Door for Ease of Opening,Latch Security,Door Hold Back	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
60,300 - CHECK_Platform Emergency Release Mechanism for Ease of Operation	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
60,400 - OPERATE_ Lift thru Complete Cycle;CHECK_Noises,Jerky Op,Too Fast-Slow,Drift Down	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
60,500 - INSPECT_ Bridgeplate Operation	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
60,600 - INSPECT_All Pivot Points for Wear and Looseness	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
60,700 - INSPECT_Rollers for Wear and Smooth Rotation	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
60,800 - INSPECT_Operation of Platform Barrier Mechanism	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
60,900 - INSPECT_Cam Slots for Wear and Proper	Done		JUHURST	Feb 11, 2021	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
Alignment				4:01:48 PM		
61,000 - INSPECT_Cable Condition (If Applicable)	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
61,100 - INSPECT_Hydraulic Hoses for Leaks, Chafing or Cracks	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
61,200 - INSPECT_Electrical Connections and Routing of Wires and Cables	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
61,300 - INSPECT_Operation and Adjustment of All Safety Switches	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
61,400 - INSPECT_All Lift Mounting Brackets for Loose Bolts Broken Welds, etc.	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
61,500 - INSPECT_Manual Back-up Raise/Lower System (If Applicable)	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
61,600 - INSPECT_HydrPump Reservoir Oil Level. Consult SvcManual for Fluid to Use.	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
61,700 - CHECK_Operator Decals for Proper Positioning;CONSULT_Service Manual	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
61,800 - CHECK_WC Holddowns Inside Vehicle for Secure Mounting,Proper Operation	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
61,900 - CLEAN_Linkages and Mechanisms	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
62,000 - LUBRICATE_Linkages and Mechanisms (DO NOT OVER Lubricate)	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
62,100 - INSPECT_Emergency Platform Release Mechanism	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
62,200 - INSPECT_Platform Barrier Latch Mechanism	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
62,300 - INSPECT_Bridgeplate Hinge	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
62,400 - INSPECT_All Pivot Points	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
62,500 - INSPECT_Cams and Slots	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
62,600 - INSPECT_Rollers	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
62,700 - INSPECT_All Linkages	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
70,000 - SECTION 7 - ALTERNATIVE FUELS INSPECTION	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
70,300 - INSPECT_Condition of Fuel Pressure Gauge	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
70,400 - PROVIDE PROOF_Tank_Dents/Scratches and Re-Certification	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
70,500 - INSPECT_Tank test date, labels-Reference-ST.4 FMMVSS 304 & ANSI-CSA NGV2	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
70,600 - INSPECT_Tank Lines to Ensure Secure Mounting, Insulation Against Vibration	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
70,700 - INSPECT_Filling Nozzle for Securely Fitting Cap	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
70,800 - INSPECT_Pressure Relief Device's Venting System, Valves, Ducting to MNFR Specs	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
80,000 - SECTION 8 - PMI Report Completion	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
80,100 - COMPLETE_PM Report; Follow-ups	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
80,200 - RETURN_Vehicle to Predetermined Location	Done		JUHURST	Feb 11, 2021 4:01:48 PM	No	
Activity Sub Total						
				Activity 10 Sub Total		
				Parts:		0.00
				Labor:		0.00
				Labor Hours:		1.93
				Sublet Parts:		0.00
				Sublet Labor:		0.00
				Activity Sub Total		0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 54199060
Invoice No. 55345 - 54199060

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
55345-LIGHT DUTY PMA		Ford E450 Champion Challenger	
Requested By:	RGASPARD	Status:	40 - Closed (40)
Created By:	RGASPARD	Priority:	3 - High
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	248,309 - DH

Activity Header

Activity: 20 999 TOTAL VEHICLE
Activity Note: PM A
Reason for Repair: 08 Preventive Maintenance
Work Accomplished: A PM Level A
Part Failure:
Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
11-Feb-21	B329(F)	GOING OUT OF SERVICE SEE BALDWIN B329 IN THE FLEET ORG. FILTER, OIL, SPIN-ON	1	1.96	1.96

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
11-Feb-21	Junior Hurst	0.03	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List						
20 Desc: PM A Task: PM A SERVICE Performed by: JUHURST Performed on: 11-FEB-21						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
100,000 - "A" PMI SERVICING ITEMS	Done		JUHURST	Feb 11, 2021 4:03:31 PM	No	
101,000 - FRA Change Oil Filters	Yes		JUHURST	Feb 11, 2021 4:03:31 PM	No	
102,000 - FRA Drain Engine Oil	Yes		JUHURST	Feb 11, 2021 4:03:31 PM	No	
103,000 - FRA Check Transmission Fluid	Done		JUHURST	Feb 11, 2021 4:03:31 PM	No	
104,000 - Lubricate Chassis	Done		JUHURST	Feb 11, 2021 4:03:31 PM	No	
105,000 - Replace or Clean A/C Filters	Done		JUHURST	Feb 11, 2021 4:03:31 PM	No	
107,000 - FRA Change Primary Fuel Filter	Yes		JUHURST	Feb 11, 2021 4:03:31 PM	No	
108,000 - Lube all pivoting Mechanisms	Done		JUHURST	Feb 11, 2021 4:03:31 PM	No	

Activity Sub Total

	Activity 20 Sub Total	
	Parts:	1.96
	Labor:	0.00
	Labor Hours:	0.03
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	1.96
Work Order Footer		
	Work Order 54199060 Total	
	Parts:	1.96
	Labor:	0.00
	Labor Hours:	1.98
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	1.96



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 54262773
Invoice No. 55345 - 54262773

Client Department:

Department: 55345M

Work Order Description

55345 PER DVIR BUS OVERHEATED

Requested By: CVERGARA

Created By: CVERGARA

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: -

Driver:

Phone:

ETA:

Meter: 247,143 - DH

Chronology

Reported	Feb 2, 2021 12:11:00 PM	Feb 2, 2021 12:11:00 PM
Started	Feb 2, 2021 1:29:00 PM	
Completed	Feb 2, 2021 5:09:00 PM	Feb 2, 2021 5:09:00 PM
Down Time		

Work Order Notes

Line 10 Vehicle came in for coolant leaking check and found it coming from the water pump removed and replaced new pump part # N215051T4207 replace four gallons coolant to unit part# FXAB51 Vehicle now working as design return vehicle back to work

Activity Header

Activity: 10 999/999/999 TOTAL VEHICLE

Activity Note: PRA

Reason for Repair: SW Shop Work Order

Work Accomplished: 06 Inspect

Part Failure: 00 No Failure

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: PRA

Task: PRA and Meter Readings Performed by: JUHURST Performed on: 02-FEB-21

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		JUHURST	Feb 2, 2021 4:36:33 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		JUHURST	Feb 2, 2021 4:36:33 PM	No	
3 - Are you wearing the appropriate PPE?	Done		JUHURST	Feb 2, 2021 4:36:33 PM	No	
4 - Have you performed the proper LOTO?	Done		JUHURST	Feb 2, 2021 4:36:33 PM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		JUHURST	Feb 2, 2021 4:36:33 PM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		JUHURST	Feb 2, 2021 4:36:33 PM	No	
20 - Miles			JUHURST	Feb 2, 2021	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
				4:36:33 PM		
30 - Kilometers			JUHURST	Feb 2, 2021 4:36:33 PM	No	
40 - Hours			JUHURST	Feb 2, 2021 4:36:33 PM	No	
Activity Sub Total						
				Activity 10 Sub Total		
				Parts:		0.00
				Labor:		0.00
				Labor Hours:		0.00
				Sublet Parts:		0.00
				Sublet Labor:		0.00
				Activity Sub Total		0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 54262773
Invoice No. 55345 - 54262773

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
55345 PER DVIR BUS OVERHEATED		Ford E450 Champion Challenger	
Requested By:	CVERGARA	Status:	40 - Closed (40)
Created By:	CVERGARA	Priority:	-
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	247,143 - DH

Activity Header
Activity:20 041RTD COOLING SYSTEM
Activity Note: VERIFY COMPLAINT
Reason for Repair: 11 Routine
Work Accomplished:
Part Failure:
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
02-Feb-21	T4207	PUMP, WATER	1	91.62	91.62
02-Feb-21	FXAB51	ANTIFREEZE, PREMIXED, TYPE-3, RED, EXTENDED-LIFE, OAT	4	0.65	2.6

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
02-Feb-21	Junior Hurst	3.1	0	0
02-Feb-21	Junior Hurst	0.47	0	0

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available

Activity Sub Total		Activity 20 Sub Total	
Parts:	94.22	Labor:	0.00
Labor Hours:	3.57	Labor Hours:	3.57
Sublet Parts:	0.00	Sublet Parts:	0.00
Sublet Labor:	0.00	Sublet Labor:	0.00
Activity Sub Total		94.22	

Work Order Footer		Work Order 54262773 Total	
Parts:	94.22	Labor:	0.00
Labor Hours:	3.57	Labor Hours:	3.57
Sublet Parts:	0.00	Sublet Parts:	0.00
Sublet Labor:	0.00	Sublet Labor:	0.00
Activity Sub Total		94.22	



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 5



Work Order No. 54231231
Invoice No. 55345 - 54231231

Client Department:

Department: 55345M

Work Order Description

55345 PER DVIRcoolant leak

Requested By: CVERGARA

Created By: CVERGARA

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: -

Driver:

Phone:

ETA:

Meter: 245,800 - DH

Chronology

Reported	Jan 22, 2021 6:33:00 AM	Jan 22, 2021 6:33:00 AM
Started	Jan 22, 2021 7:24:00 AM	
Completed	Jan 22, 2021 1:59:00 PM	Jan 22, 2021 1:59:00 PM
Down Time		

Work Order Notes

Line 10 Bus leaking coolant

Bad water pump radiator leak bad driver belt and rear tires flat

Replace water radiator belt and repair tire completed

Activity Header

Activity: 10 999/999/999 TOTAL VEHICLE

Activity Note: PRA

Reason for Repair: SW Shop Work Order

Work Accomplished: 06 Inspect

Part Failure: 00 No Failure

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: PRA


Task: PRA and Meter Readings Performed by: HPIERRE Performed on: 22-JAN-21

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		HPIERRE	Jan 22, 2021 1:59:40 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		HPIERRE	Jan 22, 2021 1:59:40 PM	No	
3 - Are you wearing the appropriate PPE?	Done		HPIERRE	Jan 22, 2021 1:59:40 PM	No	
4 - Have you performed the proper LOTO?	Done		HPIERRE	Jan 22, 2021 1:59:40 PM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		HPIERRE	Jan 22, 2021 1:59:40 PM	No	
10 - Have you successfully completed the Personal	Done		HPIERRE	Jan 22, 2021	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO	
Risk Assessment?				1:59:40 PM			
20 - Miles			HPIERRE	Jan 22, 2021 1:59:40 PM	No		
30 - Kilometers	12		HPIERRE	Jan 22, 2021 1:59:40 PM	No		
40 - Hours	4		HPIERRE	Jan 22, 2021 1:59:40 PM	No		
Activity Sub Total							
				Activity 10 Sub Total			
				Parts:			0.00
				Labor:			0.00
				Labor Hours:			0.00
				Sublet Parts:			0.00
				Sublet Labor:			0.00
				Activity Sub Total			0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 5



Work Order No. 54231231
Invoice No. 55345 - 54231231


Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
55345 PER DVIRcoolant leak		Ford E450 Champion Challenger	
Requested By:	CVERGARA	Status:	40 - Closed (40)
Created By:	CVERGARA	Priority:	-
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	245,800 - DH

Activity Header				
Activity:20 042 COOLING SYSTEM				
Activity Note: VERIFY COMPLAINT				
Reason for Repair: 08 Preventive Maintenance				
Work Accomplished:				
Part Failure:				
Activity Comments:				
Activity Parts				
No Data Available				
Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
22-Jan-21	Pierre,Hubert J	0.57	0	0
Activity Sublet				
No Data Available				
Activity Checklist				
No Data Available				
No Data Available				
Activity Sub Total				
			Activity 20 Sub Total	
			Parts:	0.00
			Labor:	0.00
			Labor Hours:	0.57
			Sublet Parts:	0.00
			Sublet Labor:	0.00
			Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 5



Work Order No. 54231231
Invoice No. 55345 - 54231231

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
55345 PER DVIRcoolant leak		Ford E450 Champion Challenger	
Requested By:	CVERGARA	Status:	40 - Closed (40)
Created By:	CVERGARA	Priority:	-
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	245,800 - DH

Activity Header

Activity:30 042/004/000 PUMP, WATER

Activity Note:

Reason for Repair:04 Driver's Report

Work Accomplished:03 Replace New

Part Failure:18 Leaking

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
22-Jan-21	T4207	PUMP, WATER	1	91.62	91.62

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
22-Jan-21	Pierre,Hubert J	2.97	0	0

Activity Sublet

No Data Available

Activity Checklist

No Data Available

No Data Available

Activity Sub Total

Activity 30 Sub Total

Parts:91.62

Labor:0.00

Labor Hours:2.97


Sublet Parts:0.00

Sublet Labor:0.00

Activity Sub Total91.62



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 4 of 5



Work Order No. 54231231
Invoice No. 55345 - 54231231

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
55345 PER DVIRcoolant leak		Ford E450 Champion Challenger	
Requested By:	CVERGARA	Status:	40 - Closed (40)
Created By:	CVERGARA	Priority:	-
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	245,800 - DH

Activity Header				
Activity:40 001/003 HEATER, AUXILLARY				
Activity Note:				
Reason for Repair:		33 Manufacturer's Recall		
Work Accomplished:		06 Inspect		
Part Failure:				
Activity Comments:				
Activity Parts				
No Data Available				
Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
22-Jan-21	Pierre,Hubert J	1.03	0	0
Activity Sublet				
No Data Available				
Activity Checklist				
No Data Available				
No Data Available				
Activity Sub Total				
			Activity 40 Sub Total	
			Parts:	0.00
			Labor:	0.00
			Labor Hours:	1.03
			Sublet Parts:	0.00
			Sublet Labor:	0.00
			Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 5 of 5



Work Order No. 54231231
Invoice No. 55345 - 54231231

Client Department:

Department: 55345M

Work Order Description

55345 PER DVIRcoolant leak

Requested By: CVERGARA

Created By: CVERGARA

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: -

Driver:

Phone:

ETA:

Meter: 245,800 - DH

Activity Header

Activity:50 040/000/000 ENGINE/MOTOR SYSTEMS GROUP

Activity Note:

Reason for Repair: 39 Natural Causes

Work Accomplished: 03 Replace New

Part Failure: 99 Replaced Before Failure

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
22-Jan-21	1360K6	BELT, SERPENTINE, 6-RIB, 136.00" SAME AS 5061360	1	21	21

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
22-Jan-21	Pierre,Hubert J	1.98	0	0

Activity Sublet

No Data Available

Activity Checklist

No Data Available

No Data Available

Activity Sub Total


Activity 50 Sub Total	
Parts:	21.00
Labor:	0.00
Labor Hours:	1.98
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	21.00

Work Order Footer

Work Order 54231231 Total	
Parts:	112.62
Labor:	0.00
Labor Hours:	6.55
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	112.62



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 54088359
Invoice No. 55345 - 54088359

Client Department:

Department: 55345M

Work Order Description

55345-LIGHT DUTY PMB

Requested By: RAURODRIGUEZ

Created By: RAURODRIGUEZ

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 3 - High

Driver:

Phone:

ETA:

Meter: 244,000 - DH

Chronology

Reported	Jan 11, 2021 12:00:00 AM	Jan 11, 2021 12:00:00 AM
Started	Jan 11, 2021 8:31:00 PM	
Completed	Jan 12, 2021 12:28:00 AM	Jan 12, 2021 12:28:00 AM
Down Time		

Work Order Notes

Line 10 COMPLAINT: PMB

CAUSE: Service

CORRECTION: perform PMB Service

Oil filter B329 Qty1

Engine oil 10w30 qty 7 qts

Air filter PA4075 Qty1

Activity Header

Activity: 5 999/999/999 TOTAL VEHICLE

Activity Note: PERSONAL RISK ASSESSMENT

Reason for Repair: SW Shop Work Order

Work Accomplished: 06 Inspect

Part Failure: 00 No Failure

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: PERSONAL RISK ASSESSMENT

Task: PRA and Meter Readings Performed by: RGASPARD Performed on: 11-JAN-21

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		RGASPARD	Jan 11, 2021 8:31:13 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		RGASPARD	Jan 11, 2021 8:31:13 PM	No	
3 - Are you wearing the appropriate PPE?	Done		RGASPARD	Jan 11, 2021 8:31:13 PM	No	
4 - Have you performed the proper LOTO?	Done		RGASPARD	Jan 11, 2021 8:31:13 PM	No	


Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
5 - Are you aware of the potential risks of performing this repair?	Done		RGASPARD	Jan 11, 2021 8:31:13 PM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		RGASPARD	Jan 11, 2021 8:31:13 PM	No	
20 - Miles			RGASPARD	Jan 11, 2021 8:31:13 PM	No	
30 - Kilometers			RGASPARD	Jan 11, 2021 8:31:13 PM	No	
40 - Hours			RGASPARD	Jan 11, 2021 8:31:13 PM	No	

Activity Sub Total

Activity 5 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 54088359
Invoice No. 55345 - 54088359

Client Department:

Department: 55345M

Work Order Description

55345-LIGHT DUTY PMB

Requested By: RAURODRIGUEZ

Created By: RAURODRIGUEZ

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 3 - High

Driver:

Phone:

ETA:

Meter: 244,000 - DH

Activity Header

Activity: 10 079 DEVICES, SAFETY/STABILITY, TRAILER

Activity Note: Light Duty PMI

Reason for Repair: 05 Inspection, Routine

Work Accomplished:

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
11-Jan-21	PA4075	FILTER, AIR SEE P546597	1	5.28	5.28

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
11-Jan-21	Gaspard,Ronald	1.4	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: Light Duty PMI

Task: First Transit North America Light Duty PM Inspection Sheet Performed by: RGASPARD Performed on: 11-JAN-21

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,000 - SECTION 1 - Preparation Inspection	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
10,100 - INSPECT_Auto-Transmission Operation/Controller; Neutral Safety Switch	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
10,200 - !FRA!INSPECT_Starter Operation	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
10,300 - !FRA!INSPECT_Warning Lights and Alarms	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
10,400 - !FRA!INSPECT_Back Up Alarm	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
10,500 - !FRA!INSPECT_Engine Operation, OBSERVE_ Exhaust for Excessive Smoke	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
10,600 - Check Driver's Pre-trip or DVIR/EVIR & Authorization Forms	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
10,700 - INSPECT_All Exterior Lights (Turn on until Completion of this section)	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
10,800 - *RPT*INSPECT_Body Damage, Corrosion;DOCUMENT_Issues	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,900 - INSPECT_Fuel Tank Cap, and Doors	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
11,100 - INSPECT_License Plate, Bracket, Bumpers	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
20,000 - SECTION 2 - Test Drive and Operator Area Inspection	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
20,100 - INSPECT_Driver Seat condition/operation/seatbelt	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
20,200 - TEST DRIVE_INSPECT_Proper Operation; Drive into Shop	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
20,300 - *RPT*INSPECT_Steering Wheel for Play/Bind/Horn Op./Turn Signal Cancelation	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
20,400 - PERFORM_Brake Test (Apply hard enough to check wheel pull and Application)	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
20,500 - *RPT*FRA INSPECT_Lighting/Operation of all Gauges	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
20,600 - *RPT*INSPECT_Windshields, Sun Visors	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
20,700 - INSPECT_Wiper/Washer Operation, Condition	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
20,800 - INSPECT_High Idle Control	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
20,900 - *RPT*!FRA!INSPECT_HVAC Controls, Operation	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
21,000 - *RPT*!FRA!INSPECT_Operation of all Switches and Accessories	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
21,100 - INSPECT_Parking Brake Operation	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
21,200 - !FRA!TEST_Service Brake Backup System (Stationary Brake Tests HYD)	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
21,300 - INSPECT_VIN, Tire Pressure Decal, Data Tags	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
21,400 - *RPT*INSPECT_Drivers Door Hinges, Handles, Controls and Panels	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
21,500 - !FRA!INSPECT_Under Dash Wiring for Proper Routing/Chafing/Securement	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
21,550 - INSPECT_Driver Floor Area for Water Leaks	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
21,600 - *RPT*INSPECT for WEAR_Pedal Pads, Accelerator, Brake, Parking Brake	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
21,700 - INSPECT_Engine Fault Codes	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
30,000 - SECTION 3 - EXTERIOR INSPECTION - Front	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
31,000 - SSF (Street Side Front)	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
31,010 - *RPT*!FRA!INSPECT_Mirror Mountings, Brackets, Glass	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
31,020 - *RPT*INSPECT_FRONT Springs, Shocks, Spring Shackles	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
31,030 - INSPECT_Mud Flaps, Brackets	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
31,040 - INSPECT_Wiper Blades, Arms	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
32,000 - Engine Inspection	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
32,010 - INSPECT_Hood, Springs and Props	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
32,020 - !FRA!INSPECT_Engine Compartment Condition for Fire Risk Avoidance	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
32,030 - !FRA!INSPECT_for Fluid Leaks, Levels	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
32,040 - !FRA!INSPECT_Hyd_Brake Fluid with Test Strips	Done	na	RGASPARD	Jan 11, 2021 9:45:18 PM	No	
32,050 - !FRA!INSPECT_RECORD_Coolant Recovery with Refractometer; Test Strips	Degree Fahrenheit	na	RGASPARD	Jan 11, 2021 9:45:18 PM	No	
32,060 - PRESSURE TEST_Cooling Systems (Radiator, Cap, hoses and clamps)	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
32,070 - *RPT*INSPECT_Radiator and Mountings, Cores	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
32,080 - *RPT*INSPECT_Fan Assembly, Shroud, Tensioner, Belts, All Belt Driven Components	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
32,090 - *RPT*!FRA!INSPECT_Mounting, Installation of Alternator, AC Compressor	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
32,100 - INSPECT_Intake System	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
32,140 - *RPT*!FRA!RECORD_Underhood Battery Voltages (volts)	13.9 Volt*		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
33,010 - CSF (Curb Side Front)	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
33,020 - *RPT*!FRA!INSPECT_Mirror Mountings, Brackets, Glass	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
33,030 - *RPT*INSPECT_FRONT Springs, Shocks, Spring Shackles	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
33,040 - INSPECT_Mud Flaps, Brackets	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
33,050 - INSPECT_Wiper Blades, Arms	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
33,060 - !FRA!INSPECT_LUBE_Battery Box, Batteries, Tray Slides, Hold Downs	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
33,070 - *RPT*!FRA!RECORD_Side Mounted Battery Voltages (volts)	Volt*	na	RGASPARD	Jan 11, 2021 9:45:18 PM	No	
33,080 - INSPECT_Entry door, OPEN_with external lock/switch (if equipped)	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
40,000 - SECTION 4 - Interior Inspection	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
40,100 - *RPT*INSPECT_Step-Well, Step-Tread, Hand Rails, Step-well Light	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
40,200 - INSPECT_Insurance/Registration/Regulatory Forms Dates	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
40,250 - INSPECT_Overhead Compartment for Water Leaks	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
40,300 - INSPECT_Safety Equipment, Fire	Done		RGASPARD	Jan 11, 2021	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
Extinguisher/Suppression				9:45:18 PM		
40,400 - INSPECT_Camera Systems, Filter, Electrical Inputs/Outputs-SOP M038	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
40,600 - !FRA!CHECK for HOTSPOTS_Interior Elec Panel Fuses/Circuit Breakers/Connectors	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
40,700 - *RPT*INSPECT_Seats, Covering, Belts, Loose Cushions, Operation	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
40,800 - *RPT*!FRA!INSPECT_Interior Lights; Mirrors	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
40,900 - !FRA!INSPECT_Interior Cleanliness/Potential Projectiles	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
41,000 - INSPECT_All ADA Equip (Lift Seat Belt, floor hold Downs, Belts, Cover, Alarms)	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
41,100 - INSPECT_CLEAN_AC Filter	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
41,200 - INSPECT_Emergency Windows, Hatches, Doors, Associated Alarms and Lights	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
41,300 - *RPT*INSPECT_Interior Body, Floor, Stanchions	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
41,400 - *RPT*INSPECT_Passenger Doors, Glass, Seal	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
50,000 - SECTION 5 - UNDER VEHICLE INSPECTION	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
50,100 - *RPT*INSPECT_Steering components-Drag Link, Tie Rods ends and Steering Damper	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
50,200 - INSPECT_Ball Joint Play	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
50,300 - !FRA!INSPECT_Front Wheel Bearings for Play	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
50,400 - LUBE_All Chassis Components	Done	na	RGASPARD	Jan 11, 2021 9:45:18 PM	No	
50,500 - !FRA!CHANGE_Engine oil, filters	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
50,700 - INSPECT_Tire Condition	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
50,800 - INSPECT_Tire Valve Stems, Double Check Caps	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
50,900 - !FRA!INSPECT_Wheels for Cracks, Loose Lugs/Indicators, Outer Hub Leaks	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
51,000 - RECORD_LF-Tire Tread Depth (32nds)	7 32nds of an inch		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
51,100 - RECORD_LF-Tire Air Pressure (psi)	70 Pounds per Square Inch		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
51,200 - RECORD_RF-Tire Tread Depth (32nds)	6 32nds of an inch		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
51,300 - RECORD_RF-Air Pressure (psi)	70 Pounds per Square Inch		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
51,400 - !FRA!INSPECT_FRONT ABS Tone Rings, Sensors, Routing of Cables	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
51,500 - !FRA!INSPECT_Wheel Seals for Leaks	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
51,600 - !FRA!INSPECT_ Front Brake Assemblies	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
51,700 - MEASURE_RECORD_LF - Brake Lining, Pad Thickness (32nds)	9 32nds of an inch		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
51,800 - MEASURE_RECORD_RF - Brake Lining, Pad Thickness (32nds)	9 32nds of an inch		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
51,900 - INSPECT VISUALLY_RECORD_LF Rotor Condition (inches)	37 Inch		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
52,000 - INSPECT VISUALLY_RECORD_RF Rotor Condition (inches)	37 Inch		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
52,100 - INSPECT_Vibration Damper	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
52,200 - !FRA!INSPECT_Battery Cable Routing from Battery Box to Starter	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
52,400 - !FRA!INSPECT_Starter Mounting	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
52,500 - !FRA!INSPECT_Engine Exhaust System	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
52,700 - INSPECT_Engine, Transmission Mounts	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
52,800 - !FRA!INSPECT_Engine, Transmission for Fluid Leaks	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
52,900 - INSPECT_Shift Cable Adjustment - All Transmissions	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
53,000 - !FRA!INSPECT_Transmission Breather and Clean	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
53,100 - *RPT*!FRA!INSPECT_Parking Brake Cables, Shoes for Wear, Contamination	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
53,200 - *RPT*INSPECT_A/C Condensor, Fans, Safety Grills	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
53,300 - *RPT*INSPECT_Driveline, Hanger Bearings, U-Joints, Slip Joints, Safety Loop	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
53,400 - *RPT*INSPECT_All Body Mounts and Chassis Frame for Corrosion, Cracks	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
53,500 - !FRA!INSPECT_Fuel Tank, Mountings, Lines	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
53,600 - INSPECT_Tire Condition	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
53,700 - INSPECT_Tire Valve Stems, Double Check Caps	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
53,800 - INSPECT_Mismatched Tire Tread, Casing Design	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
53,900 - INSPECT_Dual Mating Tires w/Square	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
54,000 - !FRA!INSPECT_Wheels for Cracks, Loose Lugs/Indicators, Outer Hub Leaks	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
54,100 - INSPECT_Mud Flaps, Brackets	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
54,200 - RECORD_RRO-Tire Tread Depth (32nds)	6 32nds of an inch		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
54,300 - RECORD_RRI-Tire Tread Depth (32nds)	7 32nds of an inch		RGASPARD	Jan 11, 2021 9:45:18 PM	No	


Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
54,400 - RECORD_RRO-Air Pressure (psi)	65 Pounds per Square Inch		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
54,500 - RECORD_RRI-Air Pressure (psi)	65 Pounds per Square Inch		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
54,600 - RECORD_LRO-Tire Tread Depth (32nds)	7 32nds of an inch		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
54,700 - RECORD_LRI-Tire Tread Depth (32nds)	7 32nds of an inch		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
54,800 - RECORD_LRO-Air Pressure (psi)	65 Pounds per Square Inch		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
54,900 - RECORD_LRI-Air Pressure (psi)	65 Pounds per Square Inch		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
55,000 - !FRA!INSPECT_ REAR Brake Assemblies	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
55,100 - !FRA!INSPECT_ REAR Hubs, Wheel Seals for Oil Leaks	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
55,200 - !FRA!INSPECT_REAR ABS Tone Rings, Sensors, Routing Of Cables (if equipped)	Done	na	RGASPARD	Jan 11, 2021 9:45:18 PM	No	
55,300 - MEASURE_RECORD_LR - Brake Lining, Pad Thickness (32nds)	7 32nds of an inch		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
55,400 - MEASURE_RECORD_RR - Brake Lining, Pad Thickness (32nds)	7 32nds of an inch		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
55,500 - INSPECT VISUALLY_MEASURE_RECORD_LR Drum, Rotor Condition (inches)	40 Inch		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
55,600 - INSPECT VISUALLY_MEASURE_RECORD_RR Drum, Rotor Condition (inches)	40 Inch		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
55,700 - !FRA!INSPECT_ Under Body Exhaust System	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
55,800 - *RPT*INSPECT_ REAR Axle Housing, Breather; CLEAN_Breather	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
55,900 - *RPT*INSPECT_ REAR Springs, Shocks, Suspension, Airbags	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
60,000 - SECTION 6 - Wheelchair Inspection	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
60,100 - RECORD_Wheelchair Cycle Count	12173 Cycles		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
60,200 - CHECK_ Lift Access Door for Ease of Opening,Latch Security,Door Hold Back	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
60,300 - CHECK_Platform Emergency Release Mechanism for Ease of Operation	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
60,400 - OPERATE_ Lift thru Complete Cycle;CHECK_Noises,Jerky Op,Too Fast-Slow,Drift Down	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
60,500 - INSPECT_ Bridgeplate Operation	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
60,600 - INSPECT_All Pivot Points for Wear and Looseness	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
60,700 - INSPECT_Rollers for Wear and Smooth Rotation	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
60,800 - INSPECT_Operation of Platform Barrier Mechanism	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
60,900 - INSPECT_Cam Slots for Wear and Proper	Done		RGASPARD	Jan 11, 2021	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
Alignment				9:45:18 PM		
61,000 - INSPECT_Cable Condition (If Applicable)	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
61,100 - INSPECT_Hydraulic Hoses for Leaks, Chafing or Cracks	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
61,200 - INSPECT_Electrical Connections and Routing of Wires and Cables	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
61,300 - INSPECT_Operation and Adjustment of All Safety Switches	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
61,400 - INSPECT_All Lift Mounting Brackets for Loose Bolts Broken Welds, etc.	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
61,500 - INSPECT_Manual Back-up Raise/Lower System (If Applicable)	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
61,600 - INSPECT_HydrPump Reservoir Oil Level. Consult SvcManual for Fluid to Use.	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
61,700 - CHECK_Operator Decals for Proper Positioning;CONSULT_Service Manual	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
61,800 - CHECK_WC Holddowns Inside Vehicle for Secure Mounting,Proper Operation	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
61,900 - CLEAN_Linkages and Mechanisms	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
62,000 - LUBRICATE_Linkages and Mechanisms (DO NOT OVER Lubricate)	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
62,100 - INSPECT_Emergency Platform Release Mechanism	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
62,200 - INSPECT_Platform Barrier Latch Mechanism	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
62,300 - INSPECT_Bridgeplate Hinge	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
62,400 - INSPECT_All Pivot Points	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
62,500 - INSPECT_Cams and Slots	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
62,600 - INSPECT_Rollers	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
62,700 - INSPECT_All Linkages	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
70,000 - SECTION 7 - ALTERNATIVE FUELS INSPECTION	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
70,300 - INSPECT_Condition of Fuel Pressure Gauge	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
70,400 - PROVIDE PROOF_Tank_Dents/Scratches and Re-Certification	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
70,500 - INSPECT_Tank test date, labels-Reference-ST.4 FMMVSS 304 & ANSI-CSA NGV2	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
70,600 - INSPECT_Tank Lines to Ensure Secure Mounting, Insulation Against Vibration	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
70,700 - INSPECT_Filling Nozzle for Securely Fitting Cap	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
70,800 - INSPECT_Pressure Relief Device's Venting System, Valves, Ducting to MNFR Specs	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
80,000 - SECTION 8 - PMI Report Completion	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
80,100 - COMPLETE_PM Report; Follow-ups	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
80,200 - RETURN_Vehicle to Predetermined Location	Done		RGASPARD	Jan 11, 2021 9:45:18 PM	No	
Activity Sub Total						
				Activity 10 Sub Total		
				Parts:		5.28
				Labor:		0.00
				Labor Hours:		1.40
				Sublet Parts:		0.00
				Sublet Labor:		0.00
				Activity Sub Total		5.28



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 54088359
Invoice No. 55345 - 54088359

Client Department:

Department: 55345M

Work Order Description

55345-LIGHT DUTY PMB

Requested By: RAURODRIGUEZ

Created By: RAURODRIGUEZ

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 3 - High

Driver:

Phone:

ETA:

Meter: 244,000 - DH

Activity Header

Activity: 20 999 TOTAL VEHICLE

Activity Note: PM B

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: B PM Level B

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
11-Jan-21	B329(F)	GOING OUT OF SERVICE SEE BALDWIN B329 IN THE FLEET ORG. FILTER, OIL, SPIN-ON	1	1.96	1.96

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
11-Jan-21	Gaspard,Ronald	0.55	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List						
20 Desc: PM B						
Task: PM B SERVICE Performed by: RGASPARD Performed on: 11-JAN-21						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
100,000 - "A" PMI SERVICING ITEMS	Done		RGASPARD	Jan 11, 2021 9:56:58 PM	No	
101,000 - FRA Change Oil Filters	Yes		RGASPARD	Jan 11, 2021 9:56:58 PM	No	
102,000 - FRA Drain Engine Oil	Yes		RGASPARD	Jan 11, 2021 9:56:58 PM	No	
103,000 - FRA Check Transmission Fluid	Done		RGASPARD	Jan 11, 2021 9:56:58 PM	No	
104,000 - Lubricate Chassis	-	na	RGASPARD	Jan 11, 2021 9:56:58 PM	No	
105,000 - Replace or Clean A/C Filters	Done		RGASPARD	Jan 11, 2021 9:56:58 PM	No	
107,000 - FRA Change Primary Fuel Filter	No	na	RGASPARD	Jan 11, 2021 9:56:58 PM	No	
108,000 - Lube all pivoting Mechanisms	Done		RGASPARD	Jan 11, 2021 9:56:58 PM	No	
200,000 - "B" PMI SERVICING ITEMS (12	Done		RGASPARD	Jan 11, 2021	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
MONTH)				9:56:58 PM		
201,000 - Service Crankcase Breather	Done		RGASPARD	Jan 11, 2021 9:56:58 PM	No	
203,000 - FRA Change Automatic Transmission Fluid	No		RGASPARD	Jan 11, 2021 9:56:58 PM	No	
204,000 - FRA Change Power Steering Fluid and Filter	No		RGASPARD	Jan 11, 2021 9:56:58 PM	No	
205,000 - Complete Engine Diagnostics and Clear Codes when Completed	Done		RGASPARD	Jan 11, 2021 9:56:58 PM	No	

Activity Sub Total

Activity 20 Sub Total

Parts:	1.96
Labor:	0.00
Labor Hours:	0.55
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	1.96

Work Order Footer

Work Order 54088359 Total

Parts:	7.24
Labor:	0.00
Labor Hours:	1.95
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	7.24



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 54191308
Invoice No. 55345 - 54191308

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
55345 BATTERY		Ford E450 Champion Challenger	
Requested By:	RAURODRIGUEZ	Status:	40 - Closed (40)
Created By:	RAURODRIGUEZ	Priority:	-
Assigned To:		Driver:	
Class:	-	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	243,544 - DH

Chronology

Reported	Jan 8, 2021 11:41:52 AM	Jan 8, 2021 11:41:52 AM
Started		
Completed	Jan 8, 2021 11:46:00 AM	Jan 8, 2021 11:46:00 AM
Down Time		

Work Order Notes

Line 10 Starter

Complaint. Vehicle won't start

Cause. Bad starter

Correction. Removed and replaced starter

Activity Header

Activity: 10 999/999/999 TOTAL VEHICLE

Activity Note: PERSONAL RISK ASSESMENT

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure: 00 No Failure

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: PERSONAL RISK ASSESMENT

Task: PRA and Meter Readings Performed by: RAURODRIGUEZ Performed on: 08-JAN-21

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		RAURODRIGUEZ	Jan 8, 2021 11:44:03 AM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		RAURODRIGUEZ	Jan 8, 2021 11:44:03 AM	No	
3 - Are you wearing the appropriate PPE?	Done		RAURODRIGUEZ	Jan 8, 2021 11:44:03 AM	No	
4 - Have you performed the proper LOTO?	Done		RAURODRIGUEZ	Jan 8, 2021 11:44:03 AM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		RAURODRIGUEZ	Jan 8, 2021 11:44:03 AM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		RAURODRIGUEZ	Jan 8, 2021 11:44:03 AM	No	
20 - Miles			RAURODRIGUEZ	Jan 8, 2021 11:44:03 AM	No	
30 - Kilometers			RAURODRIGUEZ	Jan 8, 2021 11:44:03 AM	No	
40 - Hours			RAURODRIGUEZ	Jan 8, 2021 11:44:03 AM	No	

Activity Sub Total

Activity 10 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 54191308
Invoice No. 55345 - 54191308

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
55345 BATTERY		Ford E450 Champion Challenger	
Requested By:	RAURODRIGUEZ	Status:	40 - Closed (40)
Created By:	RAURODRIGUEZ	Priority:	-
Assigned To:		Driver:	
Class:	-	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	243,544 - DH

Activity Header
Activity:20 031/005/000 CHARGER, BATTERY, ON-BOARD, VEHICLES, PROPELLED, ELECTRICALLY
Activity Note:
Reason for Repair: 05 Inspection, Routine
Work Accomplished: 03 Replace New
Part Failure: 43 Weak
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
08-Jan-21	DL3Z-11002-A	STARTER, E350, '14	1	137.26	137.26

Activity Labor
No Data Available

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available

Activity Sub Total		Activity 20 Sub Total	
		Parts:	137.26
		Labor:	0.00
		Labor Hours:	0.00
		Sublet Parts:	0.00
		Sublet Labor:	0.00
		Activity Sub Total	137.26

Work Order Footer		Work Order 54191308 Total	
		Parts:	137.26
		Labor:	0.00
		Labor Hours:	0.00
		Sublet Parts:	0.00
		Sublet Labor:	0.00
		Activity Sub Total	137.26



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 54184947
Invoice No. 55345 - 54184947

Client Department:

Department: 55345M

Work Order Description

Parking Brake

Requested By: JUHURST

Created By: JUHURST

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 2 - Medium

Driver:

Phone:

ETA:

Meter: 243,542 - DH

Chronology

Reported	Jan 6, 2021 1:48:50 PM	Jan 6, 2021 1:48:50 PM
Started	Jan 6, 2021 1:52:00 PM	
Completed	Jan 6, 2021 3:09:00 PM	Jan 6, 2021 3:09:00 PM
Down Time		

Work Order Notes

Line 10 To file warranty be sure to do the following:

- 1) Enter a COMPLAINT statement for each activity.
- 2) Enter CAUSE statement in the Notes field of each activity.
- 3) Enter CORRECTION statement in the Comment section of each activity.

Complaint: parking Brake

Cause: Driver complaint

Correction: check parking brake and it is working add four quarters transmission fluid to unit after return vehicle back to work

Activity Header

Activity: 5 999 TOTAL VEHICLE

Activity Note: Personal Risk Assessment

Reason for Repair: SW Shop Work Order

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
06-Jan-21	Junior Hurst	0.02	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: Personal Risk Assessment

Task: PRA and Meter Readings Performed by: JUHURST Performed on: 06-JAN-21

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		JUHURST	Jan 6, 2021 1:53:21 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		JUHURST	Jan 6, 2021 1:53:21 PM	No	
3 - Are you wearing the appropriate PPE?	Done		JUHURST	Jan 6, 2021 1:53:21 PM	No	
4 - Have you performed the proper LOTO?	Done		JUHURST	Jan 6, 2021 1:53:21 PM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		JUHURST	Jan 6, 2021 1:53:21 PM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		JUHURST	Jan 6, 2021 1:53:21 PM	No	
20 - Miles			JUHURST	Jan 6, 2021 1:53:21 PM	No	
30 - Kilometers			JUHURST	Jan 6, 2021 1:53:21 PM	No	
40 - Hours			JUHURST	Jan 6, 2021 1:53:21 PM	No	

Activity Sub Total

Activity 5 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	0.02
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 54184947
Invoice No. 55345 - 54184947

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Parking Brake		Ford E450 Champion Challenger	
Requested By:	JUHURST	Status:	40 - Closed (40)
Created By:	JUHURST	Priority:	2 - Medium
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	243,542 - DH

Activity Header
Activity:15 013 BRAKES
Activity Note: Parking Bake
Reason for Repair: 11 Routine
Work Accomplished:
Part Failure:
Activity Comments:

Activity Parts
No Data Available

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
06-Jan-21	Junior Hurst	1.27	0	0

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available

Activity Sub Total		Activity 15 Sub Total	
		Parts:	0.00
		Labor:	0.00
		Labor Hours:	1.27
		Sublet Parts:	0.00
		Sublet Labor:	0.00
		Activity Sub Total	0.00

Work Order Footer		Work Order 54184947 Total	
		Parts:	0.00
		Labor:	0.00
		Labor Hours:	1.29
		Sublet Parts:	0.00
		Sublet Labor:	0.00
		Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 54117915
Invoice No. 55345 - 54117915

Client Department:

Department: 55345M

Work Order Description

Road Call

Requested By: NPIERRE-LOUIS

Created By: NPIERRE-LOUIS

Assigned To:

Class: WORC - WORK ORDER ROAD CALL

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 3 - High

Driver:

Phone:

ETA:

Meter: 240,537 - DH

Chronology

Reported	Dec 9, 2020 6:37:43 AM	Dec 9, 2020 6:37:43 AM
Started	Dec 9, 2020 6:39:00 AM	
Completed	Dec 9, 2020 12:55:00 PM	Dec 9, 2020 12:55:00 PM
Down Time		

Work Order Notes

Line 10 To file warranty be sure to do the following:

- 1) Enter a COMPLAINT statement for each activity.
- 2) Enter CAUSE statement in the Notes field of each activity.
- 3) Enter CORRECTION statement in the Comment section of each activity.

Complaint:batteries light on

Cause: tech found,belt broken,one pulley

Correction:replaced the serpentine belt and pulley Bearing

Activity Header

Activity:5 999 TOTAL VEHICLE

Activity Note: PRAMETER

Reason for Repair: SW Shop Work Order

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: PRAMETER

Task: PRA and Meter Readings Performed by: NPIERRE-LOUIS Performed on: 09-DEC-20

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		NPIERRE-LOUIS	Dec 9, 2020 12:51:47 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		NPIERRE-LOUIS	Dec 9, 2020 12:51:47 PM	No	
3 - Are you wearing the appropriate PPE?	Done		NPIERRE-LOUIS	Dec 9, 2020 12:51:47 PM	No	
4 - Have you performed the proper LOTO?	Done		NPIERRE-LOUIS	Dec 9, 2020 12:51:47 PM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		NPIERRE-LOUIS	Dec 9, 2020 12:51:47 PM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		NPIERRE-LOUIS	Dec 9, 2020 12:51:47 PM	No	
20 - Miles			NPIERRE-LOUIS	Dec 9, 2020 12:51:47 PM	No	
30 - Kilometers			NPIERRE-LOUIS	Dec 9, 2020 12:51:47 PM	No	
40 - Hours			NPIERRE-LOUIS	Dec 9, 2020 12:51:47 PM	No	
Activity Sub Total						
			Activity 5 Sub Total			
			Parts:			0.00
			Labor:			0.00
			Labor Hours:			0.00
			Sublet Parts:			0.00
			Sublet Labor:			0.00
			Activity Sub Total			0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 54117915
Invoice No. 55345 - 54117915

Client Department:

Department: 55345M

Work Order Description

Road Call

Requested By: NPIERRE-LOUIS

Created By: NPIERRE-LOUIS

Assigned To:

Class: WORC - WORK ORDER ROAD CALL

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 3 - High

Driver:

Phone:

ETA:

Meter: 240,537 - DH

Activity Header

Activity: 10 999 TOTAL VEHICLE

Activity Note: ROAD CALL

Reason for Repair: 10 Road Call

Work Accomplished:

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
09-Dec-20	NELSON PIERRE-LOUIS	4.7	0	0

Activity Sublet

No Data Available

Activity Checklist

No Data Available

No Data Available

Activity Sub Total

Activity 10 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	4.70
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 54117915
Invoice No. 55345 - 54117915

Client Department:

Department: 55345M

Work Order Description

Road Call

Requested By: NPIERRE-LOUIS

Created By: NPIERRE-LOUIS

Assigned To:

Class: WORC - WORK ORDER ROAD CALL

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 3 - High

Driver:

Phone:

ETA:

Meter: 240,537 - DH

Activity Header

Activity:20 040/000/000 ENGINE/MOTOR SYSTEMS GROUP

Activity Note:

Reason for Repair: 39 Natural Causes

Work Accomplished: 03 Replace New

Part Failure: 99 Replaced Before Failure

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
09-Dec-20	1360K6	BELT, SERPENTINE, 6-RIB, 136.00" SAME AS 5061360	1	21	21

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

No Data Available

No Data Available

Activity Sub Total

Activity 20 Sub Total

Parts:	21.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	21.00


Work Order Footer

Work Order 54117915 Total

Parts:	21.00
Labor:	0.00
Labor Hours:	4.70
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	21.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 54099848
Invoice No. 55345 - 54099848

Client Department:

Department: 55345M

Work Order Description

Ramp

Requested By: JUHURST

Created By: JUHURST

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 2 - Medium

Driver:

Phone:

ETA:

Meter: 239,934 - DH

Chronology

Reported	Dec 2, 2020 12:26:58 PM	Dec 2, 2020 12:26:58 PM
Started	Dec 2, 2020 12:36:00 PM	
Completed	Dec 2, 2020 3:46:00 PM	Dec 2, 2020 3:46:00 PM
Down Time		

Work Order Notes

Line 10 To file warranty be sure to do the following:

- 1) Enter a COMPLAINT statement for each activity.
- 2) Enter CAUSE statement in the Notes field of each activity.
- 3) Enter CORRECTION statement in the Comment section of each activity.

Complaint:

Cause:

Correction: Line 20 Unit came for lift issue. Check on found power connector loose ramp now working replace one HAND BELT RETRACTOR BUCKLE KIT # 31579KS. Return unit back to work

Activity Header

Activity: 5 999 TOTAL VEHICLE

Activity Note: Personal Risk Assessment

Reason for Repair: SW Shop Work Order

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: Personal Risk Assessment

Task: PRA and Meter Readings Performed by: JUHURST Performed on: 02-DEC-20

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		JUHURST	Dec 2, 2020 12:31:40 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		JUHURST	Dec 2, 2020 12:31:40 PM	No	
3 - Are you wearing the appropriate PPE?	Done		JUHURST	Dec 2, 2020 12:31:40 PM	No	
4 - Have you performed the proper LOTO?	Done		JUHURST	Dec 2, 2020 12:31:40 PM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		JUHURST	Dec 2, 2020 12:31:40 PM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		JUHURST	Dec 2, 2020 12:31:40 PM	No	
20 - Miles			JUHURST	Dec 2, 2020 12:31:40 PM	No	
30 - Kilometers			JUHURST	Dec 2, 2020 12:31:40 PM	No	
40 - Hours			JUHURST	Dec 2, 2020 12:31:40 PM	No	
Activity Sub Total						
			Activity 5 Sub Total			
			Parts:			0.00
			Labor:			0.00
			Labor Hours:			0.00
			Sublet Parts:			0.00
			Sublet Labor:			0.00
			Activity Sub Total			0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 54099848
Invoice No. 55345 - 54099848

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Ramp		Ford E450 Champion Challenger	
Requested By:	JUHURST	Status:	40 - Closed (40)
Created By:	JUHURST	Priority:	2 - Medium
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	239,934 - DH

Activity Header
Activity:15 030 ELECTRICAL GROUP
Activity Note: Ramp
Reason for Repair: 11 Routine
Work Accomplished:
Part Failure:
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
02-Dec-20	31579KS	BELT, W/C	1	72.5	72.5

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
02-Dec-20	Junior Hurst	3.15	0	0

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available

Activity Sub Total		Activity 15 Sub Total	
Parts:			72.50
Labor:			0.00
Labor Hours:			3.15
Sublet Parts:			0.00
Sublet Labor:			0.00
Activity Sub Total			72.50

Work Order Footer		Work Order 54099848 Total	
Parts:			72.50
Labor:			0.00
Labor Hours:			3.15
Sublet Parts:			0.00
Sublet Labor:			0.00
Activity Sub Total			72.50



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 54088362
Invoice No. 55345 - 54088362

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Heater Hoses		Ford E450 Champion Challenger	
Requested By:	RAURODRIGUEZ	Status:	40 - Closed (40)
Created By:	RAURODRIGUEZ	Priority:	-
Assigned To:		Driver:	
Class:	-	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	239,547 - DH

Chronology

Reported	Nov 27, 2020 9:57:13 AM	Nov 27, 2020 9:57:13 AM
Started	Nov 27, 2020 9:59:00 AM	
Completed	Nov 27, 2020 11:24:00 AM	Nov 27, 2020 11:24:00 AM
Down Time		

Work Order Notes

Line 10 Complaint. Coolant low

Cause. Found coolant leak by rear heater valve

Correction. Removed and replaced heater valve.

Activity Header

Activity: 10 999/999/999 TOTAL VEHICLE

Activity Note: PERSONAL RISK ASSESMENT

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure: 00 No Failure

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: PERSONAL RISK ASSESMENT

Task: PRA and Meter Readings Performed by: RAURODRIGUEZ Performed on: 27-NOV-20

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		RAURODRIGUEZ	Nov 27, 2020 9:59:05 AM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		RAURODRIGUEZ	Nov 27, 2020 9:59:05 AM	No	
3 - Are you wearing the appropriate PPE?	Done		RAURODRIGUEZ	Nov 27, 2020 9:59:05 AM	No	
4 - Have you performed the proper LOTO?	Done		RAURODRIGUEZ	Nov 27, 2020 9:59:05 AM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		RAURODRIGUEZ	Nov 27, 2020 9:59:05 AM	No	
10 - Have you successfully completed the	Done		RAURODRIGUEZ	Nov 27, 2020	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
Personal Risk Assessment?				9:59:05 AM		
20 - Miles			RAURODRIGUEZ	Nov 27, 2020 9:59:05 AM	No	
30 - Kilometers			RAURODRIGUEZ	Nov 27, 2020 9:59:05 AM	No	
40 - Hours			RAURODRIGUEZ	Nov 27, 2020 9:59:05 AM	No	
Activity Sub Total						
				Activity 10 Sub Total		
				Parts:		0.00
				Labor:		0.00
				Labor Hours:		0.00
				Sublet Parts:		0.00
				Sublet Labor:		0.00
				Activity Sub Total		0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 54088362
Invoice No. 55345 - 54088362

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Heater Hoses		Ford E450 Champion Challenger	
Requested By:	RAURODRIGUEZ	Status:	40 - Closed (40)
Created By:	RAURODRIGUEZ	Priority:	-
Assigned To:		Driver:	
Class:	-	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	239,547 - DH

Activity Header
Activity:20 042/000/000 COOLING SYSTEM
Activity Note:
Reason for Repair: 05 Inspection, Routine
Work Accomplished: 03 Replace New
Part Failure:
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
27-Nov-20	74612	VALVE, CONTROL, HEATER	1	9.91	9.91

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
27-Nov-20	Rodriguez,Raul	1.4	0	0

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available

Activity Sub Total	
Activity 20 Sub Total	
Parts:	9.91
Labor:	0.00
Labor Hours:	1.40
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	9.91

Work Order Footer	
Work Order 54088362 Total	
Parts:	9.91
Labor:	0.00
Labor Hours:	1.40
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	9.91



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 53984261
Invoice No. 55345 - 53984261

Client Department:

Department: 55345M

Work Order Description

55345-LIGHT DUTY PMA

Requested By: RGASPARD

Created By: RGASPARD

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 3 - High

Driver:

Phone:

ETA:

Meter: 239,547 - DH

Chronology

Reported	Nov 26, 2020 12:00:00 AM	Nov 26, 2020 12:00:00 AM
Started	Nov 27, 2020 12:00:00 AM	
Completed	Nov 27, 2020 9:57:00 AM	Nov 27, 2020 9:57:00 AM
Down Time		

Work Order Notes

Line 10 PM.

Perform pmA service, lube front end, tire rotation, torque and re torque tires (140 f/p), R&R engine oil and filter, road test, all okay at this time.

Parts. Engine oil filter part # B329 qty 1
engine oil. 5W20 Qty 6 qts

Activity Header

Activity: 5 999/999/999 TOTAL VEHICLE

Activity Note: PERSONAL RISK ASSESSMENT

Reason for Repair: SW Shop Work Order

Work Accomplished: 06 Inspect

Part Failure: 00 No Failure

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: PERSONAL RISK ASSESSMENT

Task: PRA and Meter Readings Performed by: RAUODRIGUEZ Performed on: 27-NOV-20

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		RAUODRIGUEZ	Nov 27, 2020 9:40:18 AM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		RAUODRIGUEZ	Nov 27, 2020 9:40:18 AM	No	
3 - Are you wearing the appropriate PPE?	Done		RAUODRIGUEZ	Nov 27, 2020 9:40:18 AM	No	
4 - Have you performed the proper LOTO?	Done		RAUODRIGUEZ	Nov 27, 2020 9:40:18 AM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
5 - Are you aware of the potential risks of performing this repair?	Done		RAUODRIGUEZ	Nov 27, 2020 9:40:18 AM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		RAUODRIGUEZ	Nov 27, 2020 9:40:18 AM	No	
20 - Miles			RAUODRIGUEZ	Nov 27, 2020 9:40:18 AM	No	
30 - Kilometers			RAUODRIGUEZ	Nov 27, 2020 9:40:18 AM	No	
40 - Hours			RAUODRIGUEZ	Nov 27, 2020 9:40:18 AM	No	

Activity Sub Total

Activity 5 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 53984261
Invoice No. 55345 - 53984261

Client Department:

Department: 55345M

Work Order Description

55345-LIGHT DUTY PMA

Requested By: RGASPARD

Created By: RGASPARD

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 3 - High

Driver:

Phone:

ETA:

Meter: 239,547 - DH

Activity Header

Activity: 10 999/999/999 TOTAL VEHICLE

Activity Note: Light Duty PMI

Reason for Repair: 08 Preventive Maintenance

Work Accomplished:

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
27-Nov-20	Rodriguez,Raul	2.0333333	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List						
10 Desc: Light Duty PMI Task: First Transit North America Light Duty PM Inspection Sheet Performed by: RAURODRIGUEZ Performed on: 27-NOV-20						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,000 - SECTION 1 - Preparation Inspection	Done		RAURODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
10,100 - INSPECT_Auto-Transmission Operation/Controller; Neutral Safety Switch	Done		RAURODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
10,200 - !FRA!INSPECT_Starter Operation	Done		RAURODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
10,300 - !FRA!INSPECT_Warning Lights and Alarms	Done		RAURODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
10,400 - !FRA!INSPECT_Back Up Alarm	Done		RAURODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
10,500 - !FRA!INSPECT_Engine Operation, OBSERVE_ Exhaust for Excessive Smoke	Done		RAURODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
10,600 - Check Driver's Pre-trip or DVIR/EVIR & Authorization Forms	Done		RAURODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,700 - INSPECT_All Exterior Lights (Turn on until Completion of this section)	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
10,800 - *RPT*INSPECT_Body Damage, Corrosion;DOCUMENT_Issues	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
10,900 - INSPECT_Fuel Tank Cap, and Doors	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
11,100 - INSPECT_License Plate, Bracket, Bumpers	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
20,000 - SECTION 2 - Test Drive and Operator Area Inspection	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
20,100 - INSPECT_Driver Seat condition/operation/seatbelt	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
20,200 - TEST DRIVE_INSPECT_Proper Operation; Drive into Shop	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
20,300 - *RPT*INSPECT_Steering Wheel for Play/Bind/Horn Op./Turn Signal Cancelation	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
20,400 - PERFORM_Brake Test (Apply hard enough to check wheel pull and Application)	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
20,500 - *RPT*FRA INSPECT_Lighting/Operation of all Gauges	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
20,600 - *RPT*INSPECT_Windshields, Sun Visors	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
20,700 - INSPECT_Wiper/Washer Operation, Condition	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
20,800 - INSPECT_High Idle Control	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
20,900 - *RPT*!FRA!INSPECT_HVAC Controls, Operation	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
21,000 - *RPT*!FRA!INSPECT_Operation of all Switches and Accessories	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
21,100 - INSPECT_Parking Brake Operation	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
21,200 - !FRA!TEST_Service Brake Backup System (Stationary Brake Tests HYD)	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
21,300 - INSPECT_VIN, Tire Pressure Decal, Data Tags	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
21,400 - *RPT*INSPECT_Drivers Door Hinges, Handles, Controls and Panels	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
21,500 - !FRA!INSPECT_Under Dash Wiring for Proper Routing/Chafing/Securement	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
21,550 - INSPECT_Driver Floor Area for Water Leaks	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
21,600 - *RPT*INSPECT for WEAR_Pedal Pads, Accelerator, Brake, Parking Brake	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
21,700 - INSPECT_Engine Fault Codes	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
30,000 - SECTION 3 - EXTERIOR INSPECTION - Front	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
31,000 - SSF (Street Side Front)	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
31,010 - *RPT*!FRA!INSPECT_Mirror Mountings, Brackets, Glass	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
31,020 - *RPT*INSPECT_FRONT Springs, Shocks, Spring Shackles	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
31,030 - INSPECT_Mud Flaps, Brackets	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
31,040 - INSPECT_Wiper Blades, Arms	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
32,000 - Engine Inspection	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
32,010 - INSPECT_Hood, Springs and Props	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
32,020 - !FRA!INSPECT_Engine Compartment Condition for Fire Risk Avoidance	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
32,030 - !FRA!INSPECT_for Fluid Leaks, Levels	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
32,040 - !FRA!INSPECT_Hyd_Brake Fluid with Test Strips	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
32,050 - !FRA!INSPECT_RECORD_Coolant Recovery with Refractometer; Test Strips	Degree Fahrenheit	na	RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
32,060 - PRESSURE TEST_Cooling Systems (Radiator, Cap, hoses and clamps)	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
32,070 - *RPT*INSPECT_Radiator and Mountings, Cores	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
32,080 - *RPT*INSPECT_Fan Assembly, Shroud, Tensioner, Belts, All Belt Driven Components	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
32,090 - *RPT*!FRA!INSPECT_Mounting, Installation of Alternator, AC Compressor	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
32,100 - INSPECT_Intake System	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
32,140 - *RPT*!FRA!RECORD_Underhood Battery Voltages (volts)	12.7 Volt*		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
33,010 - CSF (Curb Side Front)	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
33,020 - *RPT*!FRA!INSPECT_Mirror Mountings, Brackets, Glass	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
33,030 - *RPT*INSPECT_FRONT Springs, Shocks, Spring Shackles	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
33,040 - INSPECT_Mud Flaps, Brackets	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
33,050 - INSPECT_Wiper Blades, Arms	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
33,060 - !FRA!INSPECT_LUBE_Battery Box, Batteries, Tray Slides, Hold Downs	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
33,070 - *RPT*!FRA!RECORD_Side Mounted Battery Voltages (volts)	12.7 Volt*		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
33,080 - INSPECT_Entry door, OPEN_with external lock/switch (if equipped)	-	na	RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
40,000 - SECTION 4 - Interior Inspection	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
40,100 - *RPT*INSPECT_Step-Well, Step-Tread, Hand Rails, Step-well Light	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
40,200 - INSPECT_Insurance/Registration/Regulatory Forms Dates	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
40,250 - INSPECT_Overhead Compartment for Water Leaks	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
40,300 - INSPECT_Safety Equipment, Fire Extinguisher/Suppression	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
40,400 - INSPECT_Camera Systems, Filter, Electrical Inputs/Outputs-SOP M038	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
40,600 - !FRA!CHECK for HOTSPOTS_Interior Elec Panel Fuses/Circuit Breakers/Connectors	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
40,700 - *RPT*INSPECT_Seats, Covering, Belts, Loose Cushions, Operation	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
40,800 - *RPT*!FRA!INSPECT_Interior Lights; Mirrors	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
40,900 - !FRA!INSPECT_Interior Cleanliness/Potential Projectiles	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
41,000 - INSPECT_All ADA Equip (Lift Seat Belt, floor hold Downs, Belts, Cover, Alarms)	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
41,100 - INSPECT_CLEAN_AC Filter	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
41,200 - INSPECT_Emergency Windows, Hatches, Doors, Associated Alarms and Lights	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
41,300 - *RPT*INSPECT_Interior Body, Floor, Stanchions	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
41,400 - *RPT*INSPECT_Passenger Doors, Glass, Seal	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
50,000 - SECTION 5 - UNDER VEHICLE INSPECTION	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
50,100 - *RPT*INSPECT_Steering components-Drag Link, Tie Rods ends and Steering Damper	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
50,200 - INSPECT_Ball Joint Play	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
50,300 - !FRA!INSPECT_Front Wheel Bearings for Play	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
50,400 - LUBE_All Chassis Components	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
50,500 - !FRA!CHANGE_Engine oil, filters	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
50,700 - INSPECT_Tire Condition	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
50,800 - INSPECT_Tire Valve Stems, Double Check Caps	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
50,900 - !FRA!INSPECT_Wheels for Cracks, Loose Lugs/Indicators, Outer Hub Leaks	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
51,000 - RECORD_LF-Tire Tread Depth (32nds)	11 32nds of an inch		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
51,100 - RECORD_LF-Tire Air Pressure (psi)	70 Pounds per Square Inch		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
51,200 - RECORD_RF-Tire Tread Depth (32nds)	11 32nds of an inch		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
51,300 - RECORD_RF-Air Pressure (psi)	70 Pounds per Square Inch		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
51,400 - !FRA!INSPECT_FRONT ABS Tone Rings, Sensors, Routing of Cables	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
51,500 - !FRA!INSPECT_Wheel Seals for Leaks	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
51,600 - !FRA!INSPECT_Front Brake Assemblies	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
51,700 - MEASURE_RECORD_LF - Brake Lining, Pad Thickness (32nds)	32nds of an inch	9mm	RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
51,800 - MEASURE_RECORD_RF - Brake Lining, Pad Thickness (32nds)	32nds of an inch	9mm	RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
51,900 - INSPECT VISUALLY_RECORD_LF Rotor Condition (inches)	Inch	39.5mm	RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
52,000 - INSPECT VISUALLY_RECORD_RF Rotor Condition (inches)	Inch	39.5mm	RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
52,100 - INSPECT_Vibration Damper	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
52,200 - !FRA!INSPECT_Battery Cable Routing from Battery Box to Starter	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
52,400 - !FRA!INSPECT_Starter Mounting	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
52,500 - !FRA!INSPECT_Engine Exhaust System	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
52,700 - INSPECT_Engine, Transmission Mounts	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
52,800 - !FRA!INSPECT_Engine, Transmission for Fluid Leaks	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
52,900 - INSPECT_Shift Cable Adjustment - All Transmissions	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
53,000 - !FRA!INSPECT_Transmission Breather and Clean	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
53,100 - *RPT*!FRA!INSPECT_Parking Brake Cables, Shoes for Wear, Contamination	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
53,200 - *RPT*INSPECT_A/C Condensor, Fans, Safety Grills	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
53,300 - *RPT*INSPECT_Driveline, Hanger Bearings, U-Joints, Slip Joints, Safety Loop	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
53,400 - *RPT*INSPECT_All Body Mounts and Chassis Frame for Corrosion, Cracks	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
53,500 - !FRA!INSPECT_Fuel Tank, Mountings, Lines	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
53,600 - INSPECT_Tire Condition	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
53,700 - INSPECT_Tire Valve Stems, Double Check Caps	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
53,800 - INSPECT_Mismatched Tire Tread, Casing Design	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
53,900 - INSPECT_Dual Mating Tires w/Square	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
54,000 - !FRA!INSPECT_Wheels for Cracks, Loose Lugs/Indicators, Outer Hub Leaks	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
54,100 - INSPECT_Mud Flaps, Brackets	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
54,200 - RECORD_RRO-Tire Tread Depth (32nds)	10 32nds of an inch		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
54,300 - RECORD_RRI-Tire Tread Depth (32nds)	10 32nds of an inch		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
54,400 - RECORD_RRO-Air Pressure (psi)	70 Pounds per Square Inch		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
54,500 - RECORD_RRI-Air Pressure (psi)	70 Pounds per Square Inch		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
54,600 - RECORD_LRO-Tire Tread Depth (32nds)	10 32nds of an inch		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
54,700 - RECORD_LRI-Tire Tread Depth (32nds)	10 32nds of an inch		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
54,800 - RECORD_LRO-Air Pressure (psi)	70 Pounds per Square Inch		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
54,900 - RECORD_LRI-Air Pressure (psi)	70 Pounds per Square Inch		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
55,000 - !FRA!INSPECT_REAR Brake Assemblies	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
55,100 - !FRA!INSPECT_REAR Hubs, Wheel Seals for Oil Leaks	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
55,200 - !FRA!INSPECT_REAR ABS Tone Rings, Sensors, Routing Of Cables (if equipped)	-	na	RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
55,300 - MEASURE_RECORD_LR - Brake Lining, Pad Thickness (32nds)	32nds of an inch	8mm	RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
55,400 - MEASURE_RECORD_RR - Brake Lining, Pad Thickness (32nds)	32nds of an inch	8mm	RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
55,500 - INSPECT VISUALLY_MEASURE_RECORD_LR Drum, Rotor Condition (inches)	Inch	37.9mm	RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
55,600 - INSPECT VISUALLY_MEASURE_RECORD_RR Drum, Rotor Condition (inches)	Inch	37.9mm	RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
55,700 - !FRA!INSPECT_ Under Body Exhaust System	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
55,800 - *RPT*INSPECT_REAR Axle Housing, Breather; CLEAN_Breather	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
55,900 - *RPT*INSPECT_REAR Springs, Shocks, Suspension, Airbags	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
60,000 - SECTION 6 - Wheelchair Inspection	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
60,100 - RECORD_Wheelchair Cycle Count	Cycles	na	RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
60,200 - CHECK_Lift Access Door for Ease of Opening,Latch Security,Door Hold Back	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
60,300 - CHECK_Platform Emergency Release Mechanism for Ease of Operation	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
60,400 - OPERATE_Lift thru Complete Cycle;CHECK_Noises,Jerky Op,Too Fast-Slow,Drift Down	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
60,500 - INSPECT_Bridgeplate Operation	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
60,600 - INSPECT_All Pivot Points for Wear and Looseness	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
60,700 - INSPECT_Rollers for Wear and Smooth Rotation	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
60,800 - INSPECT_Operation of Platform Barrier Mechanism	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
60,900 - INSPECT_Cam Slots for Wear and Proper Alignment	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
61,000 - INSPECT_Cable Condition (If Applicable)	-	na	RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
61,100 - INSPECT_Hydraulic Hoses for Leaks, Chafing or Cracks	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
61,200 - INSPECT_Electrical Connections and Routing of Wires and Cables	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
61,300 - INSPECT_Operation and Adjustment of All Safety Switches	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
61,400 - INSPECT_All Lift Mounting Brackets for Loose Bolts Broken Welds, etc.	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
61,500 - INSPECT_Manual Back-up Raise/Lower System (If Applicable)	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
61,600 - INSPECT_HydrPump Reservoir Oil Level. Consult SvcManual for Fluid to Use.	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
61,700 - CHECK_Operator Decals for Proper Positioning;CONSULT_Service Manual	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
61,800 - CHECK_WC Holddowns Inside Vehicle for Secure Mounting,Proper Operation	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
61,900 - CLEAN_Linkages and Mechanisms	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
62,000 - LUBRICATE_Linkages and Mechanisms (DO NOT OVER Lubricate)	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
62,100 - INSPECT_Emergency Platform Release Mechanism	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
62,200 - INSPECT_Platform Barrier Latch Mechanism	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
62,300 - INSPECT_Bridgeplate Hinge	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
62,400 - INSPECT_All Pivot Points	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
62,500 - INSPECT_Cams and Slots	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
62,600 - INSPECT_Rollers	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
62,700 - INSPECT_All Linkages	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
70,000 - SECTION 7 - ALTERNATIVE FUELS INSPECTION	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
70,300 - INSPECT_Condition of Fuel Pressure Gauge	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
70,400 - PROVIDE PROOF_Tank_Dents/Scratches and Re-Certification	Done		RAUODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
70,500 - INSPECT_Tank test date, labels-Reference-ST.4 FMMVSS 304 & ANSI-CSA NGV2	Done		RAURODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
70,600 - INSPECT_Tank Lines to Ensure Secure Mounting, Insulation Against Vibration	Done		RAURODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
70,700 - INSPECT_Filling Nozzle for Securely Fitting Cap	Done		RAURODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
70,800 - INSPECT_Pressure Relief Device's Venting System, Valves, Ducting to MNFR Specs	Done		RAURODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
80,000 - SECTION 8 - PMI Report Completion	Done		RAURODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
80,100 - COMPLETE_PM Report; Follow-ups	Done		RAURODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	
80,200 - RETURN_Vehicle to Predetermined Location	Done		RAURODRIGUEZ	Nov 27, 2020 9:55:36 AM	No	

Activity Sub Total

Activity 10 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	2.03
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 53984261
Invoice No. 55345 - 53984261

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
55345-LIGHT DUTY PMA		Ford E450 Champion Challenger	
Requested By:	RGASPARD	Status:	40 - Closed (40)
Created By:	RGASPARD	Priority:	3 - High
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	239,547 - DH

Activity Header

Activity:20 999 TOTAL VEHICLE

Activity Note: PM A

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: A PM Level A

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
27-Nov-20	PA4456	FILTER, AIR, PANEL	1	5.02	5.02
27-Nov-20	B329(F)	GOING OUT OF SERVICE SEE BALDWIN B329 IN THE FLEET ORG. FILTER, OIL, SPIN-ON	1	1.96	1.96

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List						
20 Desc: PM A						
Task: PM A SERVICE Performed by: RAURODRIGUEZ Performed on: 27-NOV-20						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
100,000 - "A" PMI SERVICING ITEMS	Done		RAURODRIGUEZ	Nov 27, 2020 9:56:29 AM	No	
101,000 - FRA Change Oil Filters	Yes		RAURODRIGUEZ	Nov 27, 2020 9:56:29 AM	No	
102,000 - FRA Drain Engine Oil	Yes		RAURODRIGUEZ	Nov 27, 2020 9:56:29 AM	No	
103,000 - FRA Check Transmission Fluid	Done		RAURODRIGUEZ	Nov 27, 2020 9:56:29 AM	No	
104,000 - Lubricate Chassis	Done		RAURODRIGUEZ	Nov 27, 2020 9:56:29 AM	No	
105,000 - Replace or Clean A/C Filters	Done		RAURODRIGUEZ	Nov 27, 2020 9:56:29 AM	No	
107,000 - FRA Change Primary Fuel Filter	No	na	RAURODRIGUEZ	Nov 27, 2020 9:56:29 AM	No	
108,000 - Lube all pivoting Mechanisms	Done		RAURODRIGUEZ	Nov 27, 2020 9:56:29 AM	No	

Activity Sub Total

	Activity 20 Sub Total	
	Parts:	6.98
	Labor:	0.00
	Labor Hours:	0.00
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	6.98
Work Order Footer		
	Work Order 53984261 Total	
	Parts:	6.98
	Labor:	0.00
	Labor Hours:	2.03
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	6.98



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 54059851
Invoice No. 55345 - 54059851

Client Department:

Department: 55345M

Work Order Description

No crank.

Requested By: EARJOHNSON

Created By: EARJOHNSON

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 2 - Medium

Driver:

Phone:

ETA:

Meter: 238,242 - DH

Chronology

Reported	Nov 16, 2020 5:42:00 PM	Nov 16, 2020 5:42:00 PM
Started	Nov 16, 2020 5:43:00 PM	
Completed	Nov 20, 2020 12:12:00 AM	Nov 20, 2020 12:12:00 AM
Down Time		

Work Order Notes

Line 10 To file warranty be sure to do the following:

- 1) Enter a COMPLAINT statement for each activity.
- 2) Enter CAUSE statement in the Notes field of each activity.
- 3) Enter CORRECTION statement in the Comment section of each activity.

Complaint: No crank

Cause: TBD.

Correction: noted for repair

Activity Header						
Activity: 5 999 TOTAL VEHICLE						
Activity Note: Personal Risk Assessment						
Reason for Repair: SW Shop Work Order						
Work Accomplished: 06 Inspect						
Part Failure:						
Activity Comments:						
Activity Parts						
No Data Available						
Activity Labor						
No Data Available						
Activity Sublet						
No Data Available						
Activity Checklist						
Check List						
5 Desc: Personal Risk Assessment						
Task: PRA and Meter Readings Performed by: EARJOHNSON Performed on: 20-NOV-20						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		EARJOHNSON	Nov 20, 2020 12:11:16 AM	No	
2 - If task requires lifting, are lifts secured, are	Done		EARJOHNSON	Nov 20, 2020	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
jack stands used correctly?				12:11:16 AM		
3 - Are you wearing the appropriate PPE?	Done		EARJOHNSON	Nov 20, 2020 12:11:16 AM	No	
4 - Have you performed the proper LOTO?	Done		EARJOHNSON	Nov 20, 2020 12:11:16 AM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		EARJOHNSON	Nov 20, 2020 12:11:16 AM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		EARJOHNSON	Nov 20, 2020 12:11:16 AM	No	
20 - Miles			EARJOHNSON	Nov 20, 2020 12:11:16 AM	No	
30 - Kilometers			EARJOHNSON	Nov 20, 2020 12:11:16 AM	No	
40 - Hours			EARJOHNSON	Nov 20, 2020 12:11:16 AM	No	

Activity Sub Total

Activity 5 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 54059851
Invoice No. 55345 - 54059851


Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
No crank.		Ford E450 Champion Challenger	
Requested By:	EARJOHNSON	Status:	40 - Closed (40)
Created By:	EARJOHNSON	Priority:	2 - Medium
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	238,242 - DH

Activity Header				
Activity:15 032 CRANKING				
Activity Note: No crank.				
Reason for Repair:		04 Driver's Report		
Work Accomplished:				
Part Failure:				
Activity Comments:				
Activity Parts				
No Data Available				
Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
16-Nov-20	Earl Johnson	1.5	0	0
Activity Sublet				
No Data Available				
Activity Checklist				
No Data Available				
No Data Available				
Activity Sub Total				
			Activity 15 Sub Total	
			Parts:	0.00
			Labor:	0.00
			Labor Hours:	1.50
			Sublet Parts:	0.00
			Sublet Labor:	0.00
			Activity Sub Total	0.00
Work Order Footer				
			Work Order 54059851 Total	
			Parts:	0.00
			Labor:	0.00
			Labor Hours:	1.50
			Sublet Parts:	0.00
			Sublet Labor:	0.00
			Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 54060471
Invoice No. 55345 - 54060471

Client Department:

Department: 55345M
Work Order Description
VEHICLE HAS A NO CRANK NO START CONDITION
Requested By: HPIERRE
Created By: HPIERRE
Assigned To:
Class: WO - WORK ORDER
Arrangement: Unassigned
Potential Warranty: No

Equipment No.: 4514-P
VIN: 1FDFE4FS7EDB17176
Ford E450 Champion Challenger
Status: 40 - Closed (40)
Priority: 2 - Medium
Driver:
Phone:
ETA:
Meter: 238,242 - DH

Chronology		
Reported	Nov 17, 2020 6:02:45 AM	Nov 17, 2020 6:02:45 AM
Started	Nov 17, 2020 6:06:00 AM	
Completed	Nov 17, 2020 2:21:00 PM	Nov 17, 2020 2:21:00 PM
Down Time		

Work Order Notes

Line 10 To file warranty be sure to do the following:

- 1) Enter a COMPLAINT statement for each activity.
- 2) Enter CAUSE statement in the Notes field of each activity.
- 3) Enter CORRECTION statement in the Comment section of each activity.

Complaint: vehicle won't crank

Cause: Check cranking system and computer system found codes for transmission range sensor circuit low

Correction: Replaced external wire harness for transmission, retest and road test vehicle ok at this time

Part:

1 transmission harness dc2z-7c078-s

Activity Header Activity: 5 999 TOTAL VEHICLE Activity Note: Personal Risk Assessment Reason for Repair: SW Shop Work Order Work Accomplished: 06 Inspect Part Failure: Activity Comments:		
Activity Parts No Data Available		
Activity Labor No Data Available		
Activity Sublet No Data Available		
Activity Checklist <table border="1"><thead><tr><th>Check List</th></tr></thead><tbody><tr><td>5 Desc: Personal Risk Assessment Task: PRA and Meter Readings Performed by: JAPEREZ Performed on: 17-NOV-20</td></tr></tbody></table>	Check List	5 Desc: Personal Risk Assessment Task: PRA and Meter Readings Performed by: JAPEREZ Performed on: 17-NOV-20
Check List		
5 Desc: Personal Risk Assessment Task: PRA and Meter Readings Performed by: JAPEREZ Performed on: 17-NOV-20		

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		JAPEREZ	Nov 17, 2020 2:20:56 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		JAPEREZ	Nov 17, 2020 2:20:56 PM	No	
3 - Are you wearing the appropriate PPE?	Done		JAPEREZ	Nov 17, 2020 2:20:56 PM	No	
4 - Have you performed the proper LOTO?	Done		JAPEREZ	Nov 17, 2020 2:20:56 PM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		JAPEREZ	Nov 17, 2020 2:20:56 PM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		JAPEREZ	Nov 17, 2020 2:20:56 PM	No	
20 - Miles			JAPEREZ	Nov 17, 2020 2:20:56 PM	No	
30 - Kilometers			JAPEREZ	Nov 17, 2020 2:20:56 PM	No	
40 - Hours			JAPEREZ	Nov 17, 2020 2:20:56 PM	No	


Activity Sub Total

Activity 5 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 54060471
Invoice No. 55345 - 54060471

Client Department:

Department: 55345M
Work Order Description
VEHICLE HAS A NO CRANK NO START CONDITION
Requested By: HPIERRE
Created By: HPIERRE
Assigned To:
Class: WO - WORK ORDER
Arrangement: Unassigned
Potential Warranty: No

Equipment No.: 4514-P
VIN: 1FDFE4FS7EDB17176
Ford E450 Champion Challenger
Status: 40 - Closed (40)
Priority: 2 - Medium
Driver:
Phone:
ETA:
Meter: 238,242 - DH

Activity Header
Activity: 15 032/000/000 CRANKING
Activity Note:
Reason for Repair: 05 Inspection, Routine
Work Accomplished: 03 Replace New
Part Failure:
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
17-Nov-20	DC2Z-7C078-S	HARNESS, TRANSMISSION, EXTERNAL, E450	1	73.01	73.01

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
17-Nov-20	Perez,Javier	4.48	0	0
17-Nov-20	Pierre,Hubert J	1.68	0	0

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available

Activity Sub Total	
Activity 15 Sub Total	
Parts:	73.01
Labor:	0.00
Labor Hours:	6.16
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	73.01

Work Order Footer	
Work Order 54060471 Total	
Parts:	73.01
Labor:	0.00
Labor Hours:	6.16
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	73.01



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 54046608
Invoice No. 55345 - 54046608

Client Department:

Department: 55345M

Work Order Description

Malfunction Wheel Chair Lift

Requested By: AOWENS

Created By: AOWENS

Assigned To:

Class: WORC - WORK ORDER ROAD CALL

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 3 - High

Driver:

Phone:

ETA:

Meter: 237,688 - DH

Chronology

Reported	Nov 11, 2020 4:46:00 PM	Nov 11, 2020 4:46:00 PM
Started	Nov 11, 2020 4:48:00 PM	
Completed	Nov 11, 2020 8:17:00 PM	Nov 11, 2020 8:17:00 PM
Down Time		

Work Order Notes

Line 10 To file warranty be sure to do the following:

- 1) Enter a COMPLAINT statement for each activity.
- 2) Enter CAUSE statement in the Notes field of each activity.
- 3) Enter CORRECTION statement in the Comment section of each activity.

Complaint:Driver complained lift not working

Cause: found loose cable remote

Correction:switch bus ; drive the bus to base and tighten the cable

Check lift working fine.

Activity Header

Activity:5 999 TOTAL VEHICLE

Activity Note: PRAMETER

Reason for Repair: SW Shop Work Order

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: PRAMETER

Task: PRA and Meter Readings Performed by: RGASPARD Performed on: 11-NOV-20

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		RGASPARD	Nov 11, 2020 4:48:29 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		RGASPARD	Nov 11, 2020 4:48:29 PM	No	
3 - Are you wearing the appropriate PPE?	Done		RGASPARD	Nov 11, 2020 4:48:29 PM	No	
4 - Have you performed the proper LOTO?	Done		RGASPARD	Nov 11, 2020 4:48:29 PM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		RGASPARD	Nov 11, 2020 4:48:29 PM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		RGASPARD	Nov 11, 2020 4:48:29 PM	No	
20 - Miles			RGASPARD	Nov 11, 2020 4:48:29 PM	No	
30 - Kilometers			RGASPARD	Nov 11, 2020 4:48:29 PM	No	
40 - Hours			RGASPARD	Nov 11, 2020 4:48:29 PM	No	

Activity Sub Total

Activity 5 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 54046608
Invoice No. 55345 - 54046608

Client Department:

Department: 55345M

Work Order Description

Malfunction Wheel Chair Lift

Requested By: AOWENS

Created By: AOWENS

Assigned To:

Class: WORC - WORK ORDER ROAD CALL

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 3 - High

Driver:

Phone:

ETA:

Meter: 237,688 - DH

Activity Header

Activity: 10 999 TOTAL VEHICLE

Activity Note: ROAD CALL (Wheel Chair Lift)

Reason for Repair: 10 Road Call

Work Accomplished:

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
11-Nov-20	Gaspard,Ronald	2.48	0	0

Activity Sublet

No Data Available

Activity Checklist

No Data Available

No Data Available

Activity Sub Total

Activity 10 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	2.48
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00

Work Order Footer

Work Order 54046608 Total

Parts:	0.00
Labor:	0.00
Labor Hours:	2.48
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 53990932
Invoice No. 55345 - 53990932

Client Department:

Department: 55345M

Work Order Description

Check Wheel Chair Lift

Requested By: AOWENS

Created By: AOWENS

Assigned To:

Class: WORC - WORK ORDER ROAD CALL

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 3 - High

Driver:

Phone:

ETA:

Meter: 235,405 - DH

Chronology		
Reported	Oct 23, 2020 5:30:00 PM	Oct 23, 2020 5:30:00 PM
Started		
Completed	Oct 31, 2020 12:09:00 AM	Oct 31, 2020 12:09:00 AM
Down Time		

Work Order Notes

Line 10 To file warranty be sure to do the following:

- 1) Enter a COMPLAINT statement for each activity.
- 2) Enter CAUSE statement in the Notes field of each activity.
- 3) Enter CORRECTION statement in the Comment section of each activity.

Complaint:

Cause:

Correction: no problem found

Activity Header						
Activity:5 999 TOTAL VEHICLE						
Activity Note: PRAMETER						
Reason for Repair: SW Shop Work Order						
Work Accomplished: 06 Inspect						
Part Failure:						
Activity Comments:						
Activity Parts						
No Data Available						
Activity Labor						
No Data Available						
Activity Sublet						
No Data Available						
Activity Checklist						
Check List						
5 Desc: PRAMETER						
Task: PRA and Meter Readings Performed by: SHARRINGTON Performed on: 31-OCT-20						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		SHARRINGTON	Oct 31, 2020 12:09:23 AM	No	
2 - If task requires lifting, are lifts secured, are	Done		SHARRINGTON	Oct 31, 2020	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
jack stands used correctly?				12:09:23 AM		
3 - Are you wearing the appropriate PPE?	Done		SHARRINGTON	Oct 31, 2020 12:09:23 AM	No	
4 - Have you performed the proper LOTO?	Done		SHARRINGTON	Oct 31, 2020 12:09:23 AM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		SHARRINGTON	Oct 31, 2020 12:09:23 AM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		SHARRINGTON	Oct 31, 2020 12:09:23 AM	No	
20 - Miles			SHARRINGTON	Oct 31, 2020 12:09:23 AM	No	
30 - Kilometers			SHARRINGTON	Oct 31, 2020 12:09:23 AM	No	
40 - Hours			SHARRINGTON	Oct 31, 2020 12:09:23 AM	No	

Activity Sub Total

Activity 5 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 53990932
Invoice No. 55345 - 53990932

Client Department:

Department: 55345M

Work Order Description

Check Wheel Chair Lift

Requested By: AOWENS

Created By: AOWENS

Assigned To:

Class: WORC - WORK ORDER ROAD CALL

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 3 - High

Driver:

Phone:

ETA:

Meter: 235,405 - DH

Activity Header

Activity: 10 068/003/000 SYSTEM, HYDRAULIC, LIFTING/UNLOADING

Activity Note: ROAD CALL

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 03 Replace New

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

No Data Available

No Data Available

Activity Sub Total

Activity 10 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 53990932
Invoice No. 55345 - 53990932

Client Department:		Equipment No.: 4514-P
Department:	55345M	VIN: 1FDFE4FS7EDB17176
Work Order Description Check Wheel Chair Lift		Ford E450 Champion Challenger
Requested By:	AOWENS	Status: 40 - Closed (40)
Created By:	AOWENS	Priority: 3 - High
Assigned To:		Driver:
Class:	WORC - WORK ORDER ROAD CALL	Phone:
Arrangement:	Unassigned	ETA:
Potential Warranty:	No	Meter: 235,405 - DH

Activity Header															
Activity: 20 068/003/000 SYSTEM, HYDRAULIC, LIFTING/UNLOADING															
Activity Note: Check Wheel Chair Lift															
Reason for Repair:	05 Inspection, Routine														
Work Accomplished:	03 Replace New														
Part Failure:															
Activity Comments:															
Activity Parts															
No Data Available															
Activity Labor															
No Data Available															
Activity Sublet															
No Data Available															
Activity Checklist															
No Data Available															
No Data Available															
Activity Sub Total															
<table><tr><td colspan="2">Activity 20 Sub Total</td></tr><tr><td>Parts:</td><td>0.00</td></tr><tr><td>Labor:</td><td>0.00</td></tr><tr><td>Labor Hours:</td><td>0.00</td></tr><tr><td>Sublet Parts:</td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td>0.00</td></tr></table>		Activity 20 Sub Total		Parts:	0.00	Labor:	0.00	Labor Hours:	0.00	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	0.00
Activity 20 Sub Total															
Parts:	0.00														
Labor:	0.00														
Labor Hours:	0.00														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	0.00														
Work Order Footer															
<table><tr><td colspan="2">Work Order 53990932 Total</td></tr><tr><td>Parts:</td><td>0.00</td></tr><tr><td>Labor:</td><td>0.00</td></tr><tr><td>Labor Hours:</td><td>0.00</td></tr><tr><td>Sublet Parts:</td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td>0.00</td></tr></table>		Work Order 53990932 Total		Parts:	0.00	Labor:	0.00	Labor Hours:	0.00	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	0.00
Work Order 53990932 Total															
Parts:	0.00														
Labor:	0.00														
Labor Hours:	0.00														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	0.00														



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 53992327
Invoice No. 55345 - 53992327

Client Department:

Department: 55345M

Work Order Description

WC lift malfunction.

Requested By: EARJOHNSON

Created By: EARJOHNSON

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 2 - Medium

Driver:

Phone:

ETA:

Meter: 235,405 - DH

Chronology

Reported	Oct 25, 2020 1:00:04 PM	Oct 25, 2020 1:00:04 PM
Started	Oct 25, 2020 1:04:00 PM	
Completed	Oct 25, 2020 1:59:00 PM	Oct 25, 2020 1:59:00 PM
Down Time		

Work Order Notes

Line 10 To file warranty be sure to do the following:

- 1) Enter a COMPLAINT statement for each activity.
- 2) Enter CAUSE statement in the Notes field of each activity.
- 3) Enter CORRECTION statement in the Comment section of each activity.

Complaint: WC lift don't go up.

Cause: TBD.

Correction: Ran WC lift thru 5 consecutive cycles with no problems. Will monitor.

Activity Header

Activity: 5 999 TOTAL VEHICLE

Activity Note: Personal Risk Assessment

Reason for Repair: SW Shop Work Order

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
25-Oct-20	Earl Johnson	0.05	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: Personal Risk Assessment

Task: PRA and Meter Readings Performed by: EARJOHNSON Performed on: 25-OCT-20

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		EARJOHNSON	Oct 25, 2020	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
				1:28:34 PM		
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		EARJOHNSON	Oct 25, 2020 1:28:34 PM	No	
3 - Are you wearing the appropriate PPE?	Done		EARJOHNSON	Oct 25, 2020 1:28:34 PM	No	
4 - Have you performed the proper LOTO?	Done		EARJOHNSON	Oct 25, 2020 1:28:34 PM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		EARJOHNSON	Oct 25, 2020 1:28:34 PM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		EARJOHNSON	Oct 25, 2020 1:28:34 PM	No	
20 - Miles			EARJOHNSON	Oct 25, 2020 1:28:34 PM	No	
30 - Kilometers			EARJOHNSON	Oct 25, 2020 1:28:34 PM	No	
40 - Hours			EARJOHNSON	Oct 25, 2020 1:28:34 PM	No	

Activity Sub Total

Activity 5 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	0.05
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 53992327
Invoice No. 55345 - 53992327

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
WC lift malfunction.		Ford E450 Champion Challenger	
Requested By:	EARJOHNSON	Status:	40 - Closed (40)
Created By:	EARJOHNSON	Priority:	2 - Medium
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	235,405 - DH

Activity Header
Activity: 15 068/003/000 SYSTEM, HYDRAULIC, LIFTING/UNLOADING
Activity Note: WC lift malfunction.
Reason for Repair: 05 Inspection, Routine
Work Accomplished: 03 Replace New
Part Failure:
Activity Comments:

Activity Parts
No Data Available

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
25-Oct-20	Earl Johnson	0.38	0	0

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available

Activity Sub Total															
<table><tr><th colspan="2">Activity 15 Sub Total</th></tr><tr><td>Parts:</td><td>0.00</td></tr><tr><td>Labor:</td><td>0.00</td></tr><tr><td>Labor Hours:</td><td>0.38</td></tr><tr><td>Sublet Parts:</td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td>0.00</td></tr></table>		Activity 15 Sub Total		Parts:	0.00	Labor:	0.00	Labor Hours:	0.38	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	0.00
Activity 15 Sub Total															
Parts:	0.00														
Labor:	0.00														
Labor Hours:	0.38														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	0.00														

Work Order Footer															
<table><tr><th colspan="2">Work Order 53992327 Total</th></tr><tr><td>Parts:</td><td>0.00</td></tr><tr><td>Labor:</td><td>0.00</td></tr><tr><td>Labor Hours:</td><td>0.43</td></tr><tr><td>Sublet Parts:</td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td>0.00</td></tr></table>		Work Order 53992327 Total		Parts:	0.00	Labor:	0.00	Labor Hours:	0.43	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	0.00
Work Order 53992327 Total															
Parts:	0.00														
Labor:	0.00														
Labor Hours:	0.43														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	0.00														



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 53984586
Invoice No. 55345 - 53984586

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Pm follow up need morryde		Ford E450 Champion Challenger	
Requested By:	HPIERRE	Status:	40 - Closed (40)
Created By:	HPIERRE	Priority:	-
Assigned To:		Driver:	
Class:	-	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	235,236 - DH

Chronology

Reported	Oct 22, 2020 5:54:25 AM	Oct 22, 2020 5:54:25 AM
Started	Oct 22, 2020 5:56:00 AM	
Completed	Oct 22, 2020 10:32:00 AM	Oct 22, 2020 10:32:00 AM
Down Time		

Work Order Notes

Line 10 Pm follow up need morryde

Preventive maintenance

Replaced morryde completed

Activity Header

Activity: 10 999/999/999 TOTAL VEHICLE
Activity Note: PERSONAL RISK ASSESMENT
Reason for Repair: 05 Inspection, Routine
Work Accomplished: 06 Inspect
Part Failure: 00 No Failure
Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: PERSONAL RISK ASSESMENT

Task: PRA and Meter Readings Performed by: HPIERRE Performed on: 22-OCT-20

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		HPIERRE	Oct 22, 2020 10:26:53 AM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		HPIERRE	Oct 22, 2020 10:26:53 AM	No	
3 - Are you wearing the appropriate PPE?	Done		HPIERRE	Oct 22, 2020 10:26:53 AM	No	
4 - Have you performed the proper LOTO?	Done		HPIERRE	Oct 22, 2020 10:26:53 AM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
5 - Are you aware of the potential risks of performing this repair?	Done		HPIERRE	Oct 22, 2020 10:26:53 AM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		HPIERRE	Oct 22, 2020 10:26:53 AM	No	
20 - Miles			HPIERRE	Oct 22, 2020 10:26:53 AM	No	
30 - Kilometers	12		HPIERRE	Oct 22, 2020 10:26:53 AM	No	
40 - Hours	4		HPIERRE	Oct 22, 2020 10:26:53 AM	No	

Activity Sub Total

Activity 10 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 53984586
Invoice No. 55345 - 53984586

Client Department:		Equipment No.:	4514-P
Department:	55345M	VIN:	1FDFE4FS7EDB17176
Work Order Description			Ford E450 Champion Challenger
Pm follow up need morryde		Status:	40 - Closed (40)
Requested By:	HPIERRE	Priority:	-
Created By:	HPIERRE	Driver:	
Assigned To:		Phone:	
Class:	-	ETA:	
Arrangement:	Unassigned	Meter:	235,236 - DH
Potential Warranty:	No		

Activity Header
Activity:20 016/000/000 SUSPENSION
Activity Note:
Reason for Repair: 05 Inspection, Routine
Work Accomplished:
Part Failure:
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
22-Oct-20	DSR108-075	RUBBER, SPRING, SHEAR, RUBBER, REAR, MOR/RYPDE	1	152.75	152.75

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
22-Oct-20	Pierre,Hubert J	4.6	0	0

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available

Activity Sub Total		Activity 20 Sub Total	
Parts:			152.75
Labor:			0.00
Labor Hours:			4.60
Sublet Parts:			0.00
Sublet Labor:			0.00
Activity Sub Total			152.75

Work Order Footer		Work Order 53984586 Total	
Parts:			152.75
Labor:			0.00
Labor Hours:			4.60
Sublet Parts:			0.00
Sublet Labor:			0.00
Activity Sub Total			152.75



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 53863713
Invoice No. 55345 - 53863713

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
55345-LIGHT DUTY PMA		Ford E450 Champion Challenger	
Requested By:	NPIERRE-LOUIS	Status:	40 - Closed (40)
Created By:	NPIERRE-LOUIS	Priority:	3 - High
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	235,236 - DH

Chronology		
Reported	Oct 21, 2020 12:00:00 AM	Oct 21, 2020 12:00:00 AM
Started	Oct 21, 2020 9:51:00 PM	
Completed	Oct 21, 2020 10:17:00 PM	Oct 21, 2020 10:17:00 PM
Down Time		

Work Order Notes

Line 10 COMPLAINT: PmA

CAUSE: Service

CORRECTION:perform PmA Service
Oil filter B329 Qty1
Engine oil 10w30 qty 7 qts

Activity Header						
Activity:5 999/999/999 TOTAL VEHICLE						
Activity Note: PERSONAL RISK ASSESSMENT						
Reason for Repair: SW Shop Work Order						
Work Accomplished: 06 Inspect						
Part Failure: 00 No Failure						
Activity Comments:						
Activity Parts						
No Data Available						
Activity Labor						
No Data Available						
Activity Sublet						
No Data Available						
Activity Checklist						
Check List						
5 Desc: PERSONAL RISK ASSESSMENT						
Task: PRA and Meter Readings Performed by: RGASPARD Performed on: 21-OCT-20						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		RGASPARD	Oct 21, 2020 9:29:18 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		RGASPARD	Oct 21, 2020 9:29:18 PM	No	
3 - Are you wearing the appropriate PPE?	Done		RGASPARD	Oct 21, 2020 9:29:18 PM	No	
4 - Have you performed the proper LOTO?	Done		RGASPARD	Oct 21, 2020 9:29:18 PM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		RGASPARD	Oct 21, 2020 9:29:18 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		RGASPARD	Oct 21, 2020 9:29:18 PM	No	
20 - Miles			RGASPARD	Oct 21, 2020 9:29:18 PM	No	
30 - Kilometers			RGASPARD	Oct 21, 2020 9:29:18 PM	No	
40 - Hours			RGASPARD	Oct 21, 2020 9:29:18 PM	No	

Activity Sub Total

Activity 5 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 53863713
Invoice No. 55345 - 53863713

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
55345-LIGHT DUTY PMA		Ford E450 Champion Challenger	
Requested By:	NPIERRE-LOUIS	Status:	40 - Closed (40)
Created By:	NPIERRE-LOUIS	Priority:	3 - High
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	235,236 - DH

Activity Header				
Activity:10 999/999/999 TOTAL VEHICLE				
Activity Note: Light Duty PMI				
Reason for Repair: 08 Preventive Maintenance				
Work Accomplished:				
Part Failure:				
Activity Comments:				
Activity Parts				
No Data Available				
Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
21-Oct-20	Gaspard,Ronald	0.4	0	0
Activity Sublet				
No Data Available				
Activity Checklist				
No Data Available				
No Data Available				
Activity Sub Total				
			Activity 10 Sub Total	
			Parts:	0.00
			Labor:	0.00
			Labor Hours:	0.40
			Sublet Parts:	0.00
			Sublet Labor:	0.00
			Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 53863713
Invoice No. 55345 - 53863713

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
55345-LIGHT DUTY PMA		Ford E450 Champion Challenger	
Requested By:	NPIERRE-LOUIS	Status:	40 - Closed (40)
Created By:	NPIERRE-LOUIS	Priority:	3 - High
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	235,236 - DH

Activity Header

Activity: 20 999 TOTAL VEHICLE
Activity Note: PM A
Reason for Repair: 08 Preventive Maintenance
Work Accomplished: A PM Level A
Part Failure:
Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
21-Oct-20	B329(F)	GOING OUT OF SERVICE SEE BALDWIN B329 IN THE FLEET ORG. FILTER, OIL, SPIN-ON	1	1.96	1.96

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
21-Oct-20	Gaspard,Ronald	0.02	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List						
20 Desc: PM A Task: PM A SERVICE Performed by: RGASPARD Performed on: 21-OCT-20						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
100,000 - "A" PMI SERVICING ITEMS	Done		RGASPARD	Oct 21, 2020 10:15:06 PM	No	
101,000 - FRA Change Oil Filters	Yes		RGASPARD	Oct 21, 2020 10:15:06 PM	No	
102,000 - FRA Drain Engine Oil	Yes		RGASPARD	Oct 21, 2020 10:15:06 PM	No	
103,000 - FRA Check Transmission Fluid	Done		RGASPARD	Oct 21, 2020 10:15:06 PM	No	
104,000 - Lubricate Chassis	-	na	RGASPARD	Oct 21, 2020 10:15:06 PM	No	
105,000 - Replace or Clean A/C Filters	Done		RGASPARD	Oct 21, 2020 10:15:06 PM	No	
107,000 - FRA Change Primary Fuel Filter	No	na	RGASPARD	Oct 21, 2020 10:15:06 PM	No	
108,000 - Lube all pivoting Mechanisms	Done		RGASPARD	Oct 21, 2020 10:15:06 PM	No	

Activity Sub Total

	Activity 20 Sub Total	
	Parts:	1.96
	Labor:	0.00
	Labor Hours:	0.02
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	1.96
Work Order Footer		
	Work Order 53863713 Total	
	Parts:	1.96
	Labor:	0.00
	Labor Hours:	0.42
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	1.96



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 4



Work Order No. 53980709
Invoice No. 55345 - 53980709

Client Department:

Department: 55345M

Work Order Description

55345 PER DVIR(Check Driver Side Wiper, And Parking Brake will Not Hold

Requested By: AOWENS

Created By: AOWENS

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment

No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 2 - Medium

Driver:

Phone:

ETA:

Meter: 235,043 - DH

Chronology		
Reported	Oct 20, 2020 9:36:00 PM	Oct 20, 2020 9:36:00 PM
Started		
Completed	Oct 21, 2020 3:13:00 PM	Oct 21, 2020 3:13:00 PM
Down Time		

Work Order Notes

Line 10 Complaint: driver side wiper blade,arm rest broken,parking brake not working properly

Cause: preventive maintenance

Correction: replaced driver side wiper blade,adjusted the arm rest,adjusted the parking brake,everything is ok at this time.

Activity Header

Activity:10 999/999/999 TOTAL VEHICLE

Activity Note: PRA

Reason for Repair: SW Shop Work Order

Work Accomplished: 06 Inspect

Part Failure: 00 No Failure

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List						
10 Desc: PRA Task: PRA and Meter Readings Performed by: NPIERRE-LOUIS Performed on: 21-OCT-20						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		NPIERRE-LOUIS	Oct 21, 2020 8:12:42 AM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		NPIERRE-LOUIS	Oct 21, 2020 8:12:42 AM	No	
3 - Are you wearing the appropriate PPE?	Done		NPIERRE-LOUIS	Oct 21, 2020 8:12:42 AM	No	
4 - Have you performed the proper LOTO?	Done		NPIERRE-LOUIS	Oct 21, 2020 8:12:42 AM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
5 - Are you aware of the potential risks of performing this repair?	Done		NPIERRE-LOUIS	Oct 21, 2020 8:12:42 AM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		NPIERRE-LOUIS	Oct 21, 2020 8:12:42 AM	No	
20 - Miles			NPIERRE-LOUIS	Oct 21, 2020 8:12:42 AM	No	
30 - Kilometers			NPIERRE-LOUIS	Oct 21, 2020 8:12:42 AM	No	
40 - Hours			NPIERRE-LOUIS	Oct 21, 2020 8:12:42 AM	No	

Activity Sub Total

Activity 10 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 4



Work Order No. 53980709
Invoice No. 55345 - 53980709

Client Department:

Department: 55345M

Work Order Description

55345 PER DVIR(Check Driver Side Wiper, And Parking Brake will Not Hold

Requested By: AOWENS

Created By: AOWENS

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment

No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 2 - Medium

Driver:

Phone:

ETA:

Meter: 235,043 - DH

Activity Header

Activity:20

Activity Note: VERIFY COMPLAINT

Reason for Repair:

Work Accomplished:

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

No Data Available

No Data Available

Activity Sub Total

Activity 20 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 4



Work Order No. 53980709
Invoice No. 55345 - 53980709

Client Department:

Department: 55345M

Work Order Description

55345 PER DVIR(Check Driver Side Wiper, And Parking Brake will Not Hold

Requested By: AOWENS

Created By: AOWENS

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment

No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 2 - Medium

Driver:

Phone:

ETA:

Meter: 235,043 - DH

Activity Header

Activity:30 050 GROUP, ACCESSORIES

Activity Note: Windshield Wiper Blades

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 03 Replace New

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

No Data Available

No Data Available

Activity Sub Total

Activity 30 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 4 of 4



Work Order No. 53980709
Invoice No. 55345 - 53980709


Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
55345 PER DVIR(Check Driver Side Wiper, And Parking Brake will Not Hold		Ford E450 Champion Challenger	
Requested By:	AOWENS	Status:	40 - Closed (40)
Created By:	AOWENS	Priority:	2 - Medium
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	235,043 - DH

Activity Header															
Activity: 40 013/000/000 BRAKES															
Activity Note: Parking Brake Will Not Hold															
Reason for Repair:	39 Natural Causes														
Work Accomplished:	03 Replace New														
Part Failure:	44 Worn														
Activity Comments:															
Activity Parts															
No Data Available															
Activity Labor															
No Data Available															
Activity Sublet															
No Data Available															
Activity Checklist															
No Data Available															
No Data Available															
Activity Sub Total															
<table><tr><td colspan="2">Activity 40 Sub Total</td></tr><tr><td>Parts:</td><td>0.00</td></tr><tr><td>Labor:</td><td>0.00</td></tr><tr><td>Labor Hours:</td><td>0.00</td></tr><tr><td>Sublet Parts:</td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td>0.00</td></tr></table>		Activity 40 Sub Total		Parts:	0.00	Labor:	0.00	Labor Hours:	0.00	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	0.00
Activity 40 Sub Total															
Parts:	0.00														
Labor:	0.00														
Labor Hours:	0.00														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	0.00														
Work Order Footer															
<table><tr><td colspan="2">Work Order 53980709 Total</td></tr><tr><td>Parts:</td><td>0.00</td></tr><tr><td>Labor:</td><td>0.00</td></tr><tr><td>Labor Hours:</td><td>0.00</td></tr><tr><td>Sublet Parts:</td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td>0.00</td></tr></table>		Work Order 53980709 Total		Parts:	0.00	Labor:	0.00	Labor Hours:	0.00	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	0.00
Work Order 53980709 Total															
Parts:	0.00														
Labor:	0.00														
Labor Hours:	0.00														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	0.00														



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 53948128
Invoice No. 55345 - 53948128

Client Department:

Department: 55345M

Work Order Description

55345 PER DVIR

Requested By: CVERGARA

Created By: CVERGARA

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: -

Driver:

Phone:

ETA:

Meter: 234,176 - DH

Chronology

Reported	Oct 9, 2020 3:03:00 PM	Oct 9, 2020 3:03:00 PM
Started	Oct 9, 2020 3:42:00 PM	
Completed	Oct 13, 2020 2:41:00 PM	Oct 13, 2020 2:41:00 PM
Down Time		

Work Order Notes

Line 10 C:as per request intake manifold gaskets

C: intake manifold gasket

C: Replaced gaskets, Replace fuel injectors o-rings, Spark Plugs and one coil

Parts:

1 intake manifold kit 4c2z-9439-aa

2 fuel injectors kit f0pz-9229-a

10 spark plugs ap103

1 ignition coil 26326

10 ignition coil boots 35-7006

1 thermostat 7c3z-8575-b

1 gasket f1vy-8255-a

1 intake hose 5c2z-9b642-Ba

Activity Header

Activity:10 999/999/999 TOTAL VEHICLE

Activity Note: PRA

Reason for Repair: SW Shop Work Order

Work Accomplished: 06 Inspect

Part Failure: 00 No Failure

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: PRA

Task: PRA and Meter Readings Performed by: JAPEREZ Performed on: 13-OCT-20

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		JAPEREZ	Oct 13, 2020 2:41:25 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		JAPEREZ	Oct 13, 2020 2:41:25 PM	No	
3 - Are you wearing the appropriate PPE?	Done		JAPEREZ	Oct 13, 2020 2:41:25 PM	No	
4 - Have you performed the proper LOTO?	Done		JAPEREZ	Oct 13, 2020 2:41:25 PM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		JAPEREZ	Oct 13, 2020 2:41:25 PM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		JAPEREZ	Oct 13, 2020 2:41:25 PM	No	
20 - Miles			JAPEREZ	Oct 13, 2020 2:41:25 PM	No	
30 - Kilometers			JAPEREZ	Oct 13, 2020 2:41:25 PM	No	
40 - Hours			JAPEREZ	Oct 13, 2020 2:41:25 PM	No	

Activity Sub Total

Activity 10 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 53948128
Invoice No. 55345 - 53948128

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
55345 PER DVIR		Ford E450 Champion Challenger	
Requested By:	CVERGARA	Status:	40 - Closed (40)
Created By:	CVERGARA	Priority:	-
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	234,176 - DH

Activity Header
Activity:20 042/000/000 COOLING SYSTEM
Activity Note:
Reason for Repair: 39 Natural Causes
Work Accomplished: 03 Replace New
Part Failure: 18 Leaking
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
13-Oct-20	F1VY-8255-A	SEAL, THERMOSTAT	1	4.11	4.11
13-Oct-20	7C3Z-8575-B	THERMOSTAT	1	10.15	10.15
13-Oct-20	5C2Z-9B642-BA	TUBE, INTAKE, CLEANER, AIR	1	59.03	59.03
13-Oct-20	26326	PLUG, COIL, IGNITION	1	28.12	28.12
13-Oct-20	AP103	PLUG, SPARK	10	3.17	31.7
13-Oct-20	FOPZ-9229-A	O-RING, SEAL, INJECTOR, FUEL SAME AS CM-4717	2	14.9	29.8
13-Oct-20	4C2Z-9439-AA	GASKET, MANIFOLD, INTAKE	1	21.56	21.56

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
12-Oct-20	Perez,Javier	7.97	0	0
13-Oct-20	Perez,Javier	6.68	0	0
09-Oct-20	Stephen Harrington	1.67	0	0

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available


Activity Sub Total	
	Activity 20 Sub Total
Parts:	184.47
Labor:	0.00
Labor Hours:	16.32
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	184.47

Work Order Footer	
	Work Order 53948128 Total
Parts:	184.47
Labor:	0.00

	Labor Hours:	16.32
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	184.47



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 53864617
Invoice No. 55345 - 53864617

Client Department:

Department: 55345M

Work Order Description

Replace Water Pump

Requested By: AOWENS

Created By: AOWENS

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 2 - Medium

Driver:

Phone:

ETA:

Meter: 230,898 - DH

Chronology

Reported	Sep 11, 2020 4:27:00 PM	Sep 11, 2020 4:27:00 PM
Started	Sep 11, 2020 4:31:00 PM	
Completed	Sep 14, 2020 2:05:00 PM	Sep 14, 2020 2:05:00 PM
Down Time		

Work Order Notes

Line 10 To file warranty be sure to do the following:

- 1) Enter a COMPLAINT statement for each activity.
- 2) Enter CAUSE statement in the Notes field of each activity.
- 3) Enter CORRECTION statement in the Comment section of each activity.

Complaint:coolant leak

Cause: Bad Water Pump

Correction:Removed and Replaced Water Pump

Activity Header

Activity:5 999 TOTAL VEHICLE

Activity Note: Personal Risk Assessment

Reason for Repair: SW Shop Work Order

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: Personal Risk Assessment

Task: PRA and Meter Readings Performed by: RAUODRIGUEZ Performed on: 14-SEP-20

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		RAUODRIGUEZ	Sep 14, 2020 1:59:52 PM	No	
2 - If task requires lifting, are lifts secured, are	Done		RAUODRIGUEZ	Sep 14, 2020	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
jack stands used correctly?				1:59:52 PM		
3 - Are you wearing the appropriate PPE?	Done		RAUODRIGUEZ	Sep 14, 2020 1:59:52 PM	No	
4 - Have you performed the proper LOTO?	Done		RAUODRIGUEZ	Sep 14, 2020 1:59:52 PM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		RAUODRIGUEZ	Sep 14, 2020 1:59:52 PM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		RAUODRIGUEZ	Sep 14, 2020 1:59:52 PM	No	
20 - Miles			RAUODRIGUEZ	Sep 14, 2020 1:59:52 PM	No	
30 - Kilometers			RAUODRIGUEZ	Sep 14, 2020 1:59:52 PM	No	
40 - Hours			RAUODRIGUEZ	Sep 14, 2020 1:59:52 PM	No	

Activity Sub Total

Activity 5 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 53864617
Invoice No. 55345 - 53864617

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Replace Water Pump		Ford E450 Champion Challenger	
Requested By:	AOWENS	Status:	40 - Closed (40)
Created By:	AOWENS	Priority:	2 - Medium
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	230,898 - DH

Activity Header
Activity:15 042/004/000 PUMP, WATER
Activity Note: Replace Water Pump
Reason for Repair: 04 Driver's Report
Work Accomplished: 03 Replace New
Part Failure: 18 Leaking
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
16-Sep-20	E71960	HOSE, RADIATOR, 7.3L, '01	2	12.47	24.94
14-Sep-20	4C3Z-8501-B	PUMP, WATER, 6.8L	1	77.97	77.97

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
14-Sep-20	Rodriguez,Raul	2.3	0	0
11-Sep-20	Stephen Harrington	3.78	0	0

Activity Sublet
No Data Available


Activity Checklist
No Data Available
No Data Available

Activity Sub Total															
<table><tr><th colspan="2">Activity 15 Sub Total</th></tr><tr><td>Parts:</td><td>102.91</td></tr><tr><td>Labor:</td><td>0.00</td></tr><tr><td>Labor Hours:</td><td>6.08</td></tr><tr><td>Sublet Parts:</td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td>102.91</td></tr></table>	Activity 15 Sub Total		Parts:	102.91	Labor:	0.00	Labor Hours:	6.08	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	102.91	
Activity 15 Sub Total															
Parts:	102.91														
Labor:	0.00														
Labor Hours:	6.08														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	102.91														

Work Order Footer															
<table><tr><th colspan="2">Work Order 53864617 Total</th></tr><tr><td>Parts:</td><td>102.91</td></tr><tr><td>Labor:</td><td>0.00</td></tr><tr><td>Labor Hours:</td><td>6.08</td></tr><tr><td>Sublet Parts:</td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td>102.91</td></tr></table>	Work Order 53864617 Total		Parts:	102.91	Labor:	0.00	Labor Hours:	6.08	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	102.91	
Work Order 53864617 Total															
Parts:	102.91														
Labor:	0.00														
Labor Hours:	6.08														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	102.91														



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 4



Work Order No. 53759681
Invoice No. 55345 - 53759681

Client Department:

Department: 55345M

Work Order Description

55345-LIGHT DUTY PMC

Requested By: RGASPARD

Created By: RGASPARD

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 3 - High

Driver:

Phone:

ETA:

Meter: 230,898 - DH

Chronology

Reported	Sep 10, 2020 12:00:00 AM	Sep 10, 2020 12:00:00 AM
Started	Sep 11, 2020 9:14:00 AM	
Completed	Sep 11, 2020 1:01:00 PM	Sep 11, 2020 1:01:00 PM
Down Time		

Work Order Notes

Line 10 Complaint: PMC Service

Cause: preventive maintenance

Correction: perform PMC Service and lube all Pivoting Points

Activity Header

Activity: 5 999/999/999 TOTAL VEHICLE

Activity Note: PERSONAL RISK ASSESSMENT

Reason for Repair: SW Shop Work Order

Work Accomplished: 06 Inspect

Part Failure: 00 No Failure

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: PERSONAL RISK ASSESSMENT

Task: PRA and Meter Readings Performed by: NPIERRE-LOUIS Performed on: 11-SEP-20

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		NPIERRE-LOUIS	Sep 11, 2020 12:47:24 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		NPIERRE-LOUIS	Sep 11, 2020 12:47:24 PM	No	
3 - Are you wearing the appropriate PPE?	Done		NPIERRE-LOUIS	Sep 11, 2020 12:47:24 PM	No	
4 - Have you performed the proper LOTO?	Done		NPIERRE-LOUIS	Sep 11, 2020 12:47:24 PM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		NPIERRE-LOUIS	Sep 11, 2020 12:47:24 PM	No	
10 - Have you successfully completed the Personal	Done		NPIERRE-	Sep 11, 2020	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO	
Risk Assessment?			LOUIS	12:47:24 PM			
20 - Miles			NPIERRE-LOUIS	Sep 11, 2020 12:47:24 PM	No		
30 - Kilometers			NPIERRE-LOUIS	Sep 11, 2020 12:47:24 PM	No		
40 - Hours			NPIERRE-LOUIS	Sep 11, 2020 12:47:24 PM	No		
Activity Sub Total							
				Activity 5 Sub Total			
				Parts:			0.00
				Labor:			0.00
				Labor Hours:			0.00
				Sublet Parts:			0.00
				Sublet Labor:			0.00
				Activity Sub Total			0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 4



Work Order No. 53759681
Invoice No. 55345 - 53759681


Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
55345-LIGHT DUTY PMC		Ford E450 Champion Challenger	
Requested By:	RGASPARD	Status:	40 - Closed (40)
Created By:	RGASPARD	Priority:	3 - High
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	230,898 - DH

Activity Header				
Activity:10 999/999/999 TOTAL VEHICLE				
Activity Note: Light Duty PMI				
Reason for Repair: 08 Preventive Maintenance				
Work Accomplished:				
Part Failure:				
Activity Comments:				
Activity Parts				
No Data Available				
Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
11-Sep-20	NELSON PIERRE-LOUIS	2.02	0	0
Activity Sublet				
No Data Available				
Activity Checklist				
No Data Available				
No Data Available				
Activity Sub Total				
			Activity 10 Sub Total	
			Parts:	0.00
			Labor:	0.00
			Labor Hours:	2.02
			Sublet Parts:	0.00
			Sublet Labor:	0.00
			Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 4



Work Order No. 53759681
Invoice No. 55345 - 53759681

Client Department:

Department: 55345M

Work Order Description

55345-LIGHT DUTY PMC

Requested By: RGASPARD

Created By: RGASPARD

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 3 - High

Driver:

Phone:

ETA:

Meter: 230,898 - DH

Activity Header

Activity: 20 999 TOTAL VEHICLE

Activity Note: PM C

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: C PM Level C

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
11-Sep-20	B329(F)	GOING OUT OF SERVICE SEE BALDWIN B329 IN THE FLEET ORG. FILTER, OIL, SPIN-ON	1	1.96	1.96

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List						
20 Desc: PM C Task: PM C SERVICE Performed by: NPIERRE-LOUIS Performed on: 11-SEP-20						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
100,000 - "A" PMI SERVICING ITEMS	Done		NPIERRE-LOUIS	Sep 11, 2020 12:48:23 PM	No	
101,000 - FRA Change Oil Filters	Yes		NPIERRE-LOUIS	Sep 11, 2020 12:48:23 PM	No	
102,000 - FRA Drain Engine Oil	Yes		NPIERRE-LOUIS	Sep 11, 2020 12:48:23 PM	No	
103,000 - FRA Check Transmission Fluid	Done		NPIERRE-LOUIS	Sep 11, 2020 12:48:23 PM	No	
104,000 - Lubricate Chassis	Done		NPIERRE-LOUIS	Sep 11, 2020 12:48:23 PM	No	
105,000 - Replace or Clean A/C Filters	Done		NPIERRE-LOUIS	Sep 11, 2020 12:48:23 PM	No	
107,000 - FRA Change Primary Fuel Filter	Done		NPIERRE-LOUIS	Sep 11, 2020 12:48:23 PM	No	
108,000 - Lube all pivoting Mechanisms	Done		NPIERRE-LOUIS	Sep 11, 2020 12:48:23 PM	No	
200,000 - "B" PMI SERVICING ITEMS (12 MONTH)	Done		NPIERRE-LOUIS	Sep 11, 2020 12:48:23 PM	No	


Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
201,000 - Service Crankcase Breather	Done		NPIERRE-LOUIS	Sep 11, 2020 12:48:23 PM	No	
203,000 - FRA Change Automatic Transmission Fluid	Yes		NPIERRE-LOUIS	Sep 11, 2020 12:48:23 PM	No	
204,000 - FRA Change Power Steering Fluid and Filter	Yes		NPIERRE-LOUIS	Sep 11, 2020 12:48:23 PM	No	
205,000 - Complete Engine Diagnostics and Clear Codes when Completed	Done		NPIERRE-LOUIS	Sep 11, 2020 12:48:23 PM	No	
300,000 - "C" PMI SERVICING ITEMS (24 MONTH)	Done		NPIERRE-LOUIS	Sep 11, 2020 12:48:23 PM	No	
301,000 - Check and Lubricate Door Linkages	Done		NPIERRE-LOUIS	Sep 11, 2020 12:48:23 PM	No	
302,000 - Check Toe-In and Record Reading	Done		NPIERRE-LOUIS	Sep 11, 2020 12:48:23 PM	No	
302,001 - Record Toe-In Reading	0 Inches, fraction-actual		NPIERRE-LOUIS	Sep 11, 2020 12:48:23 PM	No	
304,000 - 1st "C" PMI ONLY: Tune Up Per Engine Mfg's Specifications	Yes		NPIERRE-LOUIS	Sep 11, 2020 12:48:23 PM	No	
305,000 - FRA Change Differential Fluid	Yes		NPIERRE-LOUIS	Sep 11, 2020 12:48:23 PM	No	

Activity Sub Total

Activity 20 Sub Total	
Parts:	1.96
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	1.96



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 4 of 4



Work Order No. 53759681
Invoice No. 55345 - 53759681

Client Department:

Department: 55345M

Work Order Description

55345-LIGHT DUTY PMC

Requested By: RGASPARD

Created By: RGASPARD

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 3 - High

Driver:

Phone:

ETA:

Meter: 230,898 - DH

Activity Header

Activity: 30 055/023 LIFT, WHEELCHAIR, PASSENGER

Activity Note: 55345-W/C LIFT INSPECTION

Reason for Repair: 05 Inspection, Routine

Work Accomplished:

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
11-Sep-20	31579KS	BELT, W/C	1	72.5	72.5

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
11-Sep-20	NELSON PIERRE-LOUIS	0.5	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

30 Desc: 55345-W/C LIFT INSPECTION

Task: First Transit Wheelchair Lift Inspection Performed by: NPIERRE-LOUIS Performed on: 11-SEP-20

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
100 - Wheelchair Cycle Count	11445 Cycles		NPIERRE-LOUIS	Sep 11, 2020 12:49:50 PM	No	
1,000 - A.1 Check Lift Access Door for Ease of Opening,Latch Security,Door Hold Back	Done		NPIERRE-LOUIS	Sep 11, 2020 12:49:50 PM	No	
2,000 - A.2 Check Platform Emergency Release Mechanism for Ease of Operation	Done		NPIERRE-LOUIS	Sep 11, 2020 12:49:50 PM	No	
3,000 - Operate Lift Through Complete Cycle and Check for:	Done		NPIERRE-LOUIS	Sep 11, 2020 12:49:50 PM	No	
3,003 - A.3 Unusual Noises	Done		NPIERRE-LOUIS	Sep 11, 2020 12:49:50 PM	No	
3,004 - A.4 Jerky Operation	Done		NPIERRE-LOUIS	Sep 11, 2020 12:49:50 PM	No	
3,005 - A.5 Operated Too Slowly or Too Fast	Done		NPIERRE-LOUIS	Sep 11, 2020 12:49:50 PM	No	
3,006 - A.6 Drift Down	Done		NPIERRE-LOUIS	Sep 11, 2020 12:49:50 PM	No	
7,000 - A.7 Check Bridgeplate Operation	Done		NPIERRE-LOUIS	Sep 11, 2020 12:49:50 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
8,000 - A.8 Check All Pivot Points for Wear and Looseness	Done		NPIERRE-LOUIS	Sep 11, 2020 12:49:50 PM	No	
9,000 - A.9 Check Rollers for Wear and Smooth Rotation	Done		NPIERRE-LOUIS	Sep 11, 2020 12:49:50 PM	No	
11,000 - A.11 Check Operation of Platform Barrier Mechanism	Done		NPIERRE-LOUIS	Sep 11, 2020 12:49:50 PM	No	
12,000 - A.12 Check Cam Slots for Wear and Proper Alignment	Done		NPIERRE-LOUIS	Sep 11, 2020 12:49:50 PM	No	
13,000 - A.13 Check Cable Condition (If Applicable)	Done		NPIERRE-LOUIS	Sep 11, 2020 12:49:50 PM	No	
14,000 - A.14 Check Hydraulic Hoses for Leaks, Chafing or Cracks	Done		NPIERRE-LOUIS	Sep 11, 2020 12:49:50 PM	No	
15,000 - A.15 Check Electrical Connections and Routing of Wires and Cables	Done		NPIERRE-LOUIS	Sep 11, 2020 12:49:50 PM	No	
16,000 - A.16 Check Operation and Adjustment of All Safety Switches	Done		NPIERRE-LOUIS	Sep 11, 2020 12:49:50 PM	No	
17,000 - A.17 Check All Lift Mounting Brackets for Loose Bolts Broken Welds, etc.	Done		NPIERRE-LOUIS	Sep 11, 2020 12:49:50 PM	No	
18,000 - A.18 Check the Manual Back-up Raise/Lower System (If Applicable)	Done		NPIERRE-LOUIS	Sep 11, 2020 12:49:50 PM	No	
19,000 - A.19 Check HydrPump Reservoir Oil Level. Consult SrvManual for Fluid to Use.	Done		NPIERRE-LOUIS	Sep 11, 2020 12:49:50 PM	No	
20,000 - A.20 Are Operator Decals in Place? Consult Service Manual for Information.	Yes		NPIERRE-LOUIS	Sep 11, 2020 12:49:50 PM	No	
21,000 - A.21 Check WC Holddowns Inside Vehicle for Secure Mounting, Proper Operation	Done		NPIERRE-LOUIS	Sep 11, 2020 12:49:50 PM	No	
90,000 - Clean all Linkages and Mechanisms If Needed before Lubrication	Done		NPIERRE-LOUIS	Sep 11, 2020 12:49:50 PM	No	
91,000 - Lubricate (Don't OVER Lubricate)	Done		NPIERRE-LOUIS	Sep 11, 2020 12:49:50 PM	No	
100,000 - B.1 Emergency Platform Release Mechanism	Done		NPIERRE-LOUIS	Sep 11, 2020 12:49:50 PM	No	
200,000 - B.2 Platform Barrier Latch Mechanism	Done		NPIERRE-LOUIS	Sep 11, 2020 12:49:50 PM	No	
300,000 - B.3 Bridgeplate Hinge	Done		NPIERRE-LOUIS	Sep 11, 2020 12:49:50 PM	No	
400,000 - B.4 All Pivot Points	Done		NPIERRE-LOUIS	Sep 11, 2020 12:49:50 PM	No	
500,000 - B.5 Cams and Slots	Done		NPIERRE-LOUIS	Sep 11, 2020 12:49:50 PM	No	
600,000 - B.6 Rollers	Done		NPIERRE-LOUIS	Sep 11, 2020 12:49:50 PM	No	
700,000 - B.7 All Linkages	Done		NPIERRE-LOUIS	Sep 11, 2020 12:49:50 PM	No	

Activity Sub Total

Activity 30 Sub Total


Parts:	72.50
Labor:	0.00
Labor Hours:	0.50
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	72.50

Work Order Footer

Work Order 53759681 Total	
Parts:	74.46
Labor:	0.00
Labor Hours:	2.52
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	74.46



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 53863329
Invoice No. 55345 - 53863329

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
55345 FRONT BRAKE		Ford E450 Champion Challenger	
Requested By:	NPIERRE-LOUIS	Status:	40 - Closed (40)
Created By:	NPIERRE-LOUIS	Priority:	-
Assigned To:		Driver:	
Class:	-	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	230,898 - DH

Chronology

Reported	Sep 11, 2020 11:46:27 AM	Sep 11, 2020 11:46:27 AM
Started	Sep 11, 2020 11:47:00 AM	
Completed	Sep 11, 2020 12:46:00 PM	Sep 11, 2020 12:46:00 PM
Down Time		

Work Order Notes

Line 10 Complaint: Low Front Brake pads

Cause: preventive maintenance

Correction: replaced front brake pads and right front caliper bracket,pin

Activity Header

Activity:10 999/999/999 TOTAL VEHICLE

Activity Note: PERSONAL RISK ASSESMENT

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure: 00 No Failure

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: PERSONAL RISK ASSESMENT

Task: PRA and Meter Readings Performed by: NPIERRE-LOUIS Performed on: 11-SEP-20

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		NPIERRE-LOUIS	Sep 11, 2020 12:46:01 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		NPIERRE-LOUIS	Sep 11, 2020 12:46:01 PM	No	
3 - Are you wearing the appropriate PPE?	Done		NPIERRE-LOUIS	Sep 11, 2020 12:46:01 PM	No	
4 - Have you performed the proper LOTO?	Done		NPIERRE-LOUIS	Sep 11, 2020 12:46:01 PM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		NPIERRE-LOUIS	Sep 11, 2020 12:46:01 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		NPIERRE-LOUIS	Sep 11, 2020 12:46:01 PM	No	
20 - Miles			NPIERRE-LOUIS	Sep 11, 2020 12:46:01 PM	No	
30 - Kilometers			NPIERRE-LOUIS	Sep 11, 2020 12:46:01 PM	No	
40 - Hours			NPIERRE-LOUIS	Sep 11, 2020 12:46:01 PM	No	

Activity Sub Total

Activity 10 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 53863329
Invoice No. 55345 - 53863329

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
55345 FRONT BRAKE		Ford E450 Champion Challenger	
Requested By:	NPIERRE-LOUIS	Status:	40 - Closed (40)
Created By:	NPIERRE-LOUIS	Priority:	-
Assigned To:		Driver:	
Class:	-	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	230,898 - DH

Activity Header
Activity:20 013/000/000 BRAKES
Activity Note: Front Brakes
Reason for Repair: 39 Natural Causes
Work Accomplished: 03 Replace New
Part Failure: 44 Worn
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
11-Sep-20	8C2Z-2V001-D	PADS, BRAKE, DISC, FRONT	1	43.89	43.89
11-Sep-20	141096	BRACKET, CALIPER, BRAKE, DISC, FRONT, LH, FORD	1	34.44	34.44
11-Sep-20	8C2Z-2C150-C	PIN, CALIPER, BRAKE, DISC, FRONT SAME AS BKCOE10	1	9.54	9.54

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
11-Sep-20	NELSON PIERRE-LOUIS	0.98	0	0

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available

Activity Sub Total		Activity 20 Sub Total	
Parts:			87.87
Labor:			0.00
Labor Hours:			0.98
Sublet Parts:			0.00
Sublet Labor:			0.00
Activity Sub Total			87.87

Work Order Footer		Work Order 53863329 Total	
Parts:			87.87
Labor:			0.00
Labor Hours:			0.98
Sublet Parts:			0.00
Sublet Labor:			0.00
Activity Sub Total			87.87



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 53838523
Invoice No. 55345 - 53838523

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
WHEEL CHAIR CYLINDER		Ford E450 Champion Challenger	
Requested By:	CVERGARA	Status:	40 - Closed (40)
Created By:	CVERGARA	Priority:	-
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	229,934 - DH

Chronology

Reported	Sep 2, 2020 10:02:00 AM	Sep 2, 2020 10:02:00 AM
Started	Sep 2, 2020 10:25:00 AM	
Completed	Sep 2, 2020 12:48:00 PM	Sep 2, 2020 12:48:00 PM
Down Time		

Work Order Notes

Line 10 Wheel chair cylinder leaking

Leaking

Replace cylinder completed

Activity Header

Activity: 10 999/999/999 TOTAL VEHICLE

Activity Note:

Reason for Repair: SW Shop Work Order

Work Accomplished: 06 Inspect

Part Failure: 00 No Failure

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc:


Task: PRA and Meter Readings Performed by: HPIERRE Performed on: 02-SEP-20

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		HPIERRE	Sep 2, 2020 12:45:46 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		HPIERRE	Sep 2, 2020 12:45:46 PM	No	
3 - Are you wearing the appropriate PPE?	Done		HPIERRE	Sep 2, 2020 12:45:46 PM	No	
4 - Have you performed the proper LOTO?	Done		HPIERRE	Sep 2, 2020 12:45:46 PM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		HPIERRE	Sep 2, 2020 12:45:46 PM	No	
10 - Have you successfully completed the Personal	Done		HPIERRE	Sep 2, 2020	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO	
Risk Assessment?				12:45:46 PM			
20 - Miles			HPIERRE	Sep 2, 2020 12:45:46 PM	No		
30 - Kilometers	1		HPIERRE	Sep 2, 2020 12:45:46 PM	No		
40 - Hours	2		HPIERRE	Sep 2, 2020 12:45:46 PM	No		
Activity Sub Total							
				Activity 10 Sub Total			
				Parts:			0.00
				Labor:			0.00
				Labor Hours:			0.00
				Sublet Parts:			0.00
				Sublet Labor:			0.00
				Activity Sub Total			0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 53838523
Invoice No. 55345 - 53838523

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
WHEEL CHAIR CYILNDER		Ford E450 Champion Challenger	
Requested By:	CVERGARA	Status:	40 - Closed (40)
Created By:	CVERGARA	Priority:	-
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	229,934 - DH

Activity Header
Activity:20 068/003/000 SYSTEM, HYDRAULIC, LIFTING/UNLOADING
Activity Note:
Reason for Repair: 05 Inspection, Routine
Work Accomplished: 03 Replace New
Part Failure:
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
07-Sep-20	403654KS	CYLINDER, W/C, PARI, 16.50	1	444.38	444.38

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
02-Sep-20	Pierre,Hubert J	2.3	0	0

Activity Sublet
No Data Available


Activity Checklist
No Data Available
No Data Available

Activity Sub Total		Activity 20 Sub Total	
Parts:	444.38	Labor:	0.00
Labor Hours:	2.30	Labor Parts:	0.00
Sublet Parts:	0.00	Sublet Labor:	0.00
Sublet Labor:	0.00	Activity Sub Total	444.38

Work Order Footer		Work Order 53838523 Total	
Parts:	444.38	Labor:	0.00
Labor Hours:	2.30	Labor Parts:	0.00
Sublet Parts:	0.00	Sublet Labor:	0.00
Sublet Labor:	0.00	Activity Sub Total	444.38



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 53816748
Invoice No. 55345 - 53816748

Client Department:

Department: 55345M

Work Order Description

55345 TRANSMISSION DTC P0751

Requested By: CVERGARA

Created By: CVERGARA

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: -

Driver:

Phone:

ETA:

Meter: 229,207 - DH

Chronology

Reported	Aug 26, 2020 9:00:00 AM	Aug 26, 2020 9:00:00 AM
Started	Aug 26, 2020 10:30:00 AM	
Completed	Aug 27, 2020 8:21:00 AM	Aug 27, 2020 8:21:00 AM
Down Time		

Work Order Notes

Line 10 C: Check engine light on

C: Check computer system found code p0751

C: Replace transmission with a new unit, retest system and road test vehicle ok at this time

Part:

1 new transmission

Activity Header

Activity: 10 999/999/999 TOTAL VEHICLE

Activity Note: PERSONAL RISK ASSESMENT

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure: 00 No Failure

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: PERSONAL RISK ASSESMENT

Task: PRA and Meter Readings Performed by: JAPEREZ Performed on: 27-AUG-20

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		JAPEREZ	Aug 27, 2020 8:20:19 AM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		JAPEREZ	Aug 27, 2020 8:20:19 AM	No	
3 - Are you wearing the appropriate PPE?	Done		JAPEREZ	Aug 27, 2020 8:20:19 AM	No	
4 - Have you performed the proper LOTO?	Done		JAPEREZ	Aug 27, 2020	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
				8:20:19 AM		
5 - Are you aware of the potential risks of performing this repair?	Done		JAPEREZ	Aug 27, 2020 8:20:19 AM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		JAPEREZ	Aug 27, 2020 8:20:19 AM	No	
20 - Miles			JAPEREZ	Aug 27, 2020 8:20:19 AM	No	
30 - Kilometers			JAPEREZ	Aug 27, 2020 8:20:19 AM	No	
40 - Hours			JAPEREZ	Aug 27, 2020 8:20:19 AM	No	

Activity Sub Total

Activity 10 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 53816748
Invoice No. 55345 - 53816748

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
55345 TRANSMISSION DTC P0751		Ford E450 Champion Challenger	
Requested By:	CVERGARA	Status:	40 - Closed (40)
Created By:	CVERGARA	Priority:	-
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	229,207 - DH

Activity Header
Activity:20 027/000/000 TRANSMISSION, MAIN, AUTOMATIC
Activity Note:
Reason for Repair: 08 Preventive Maintenance
Work Accomplished: 03 Replace New
Part Failure: 43 Weak
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
31-Aug-20	5R110D408	TRANSMISSION	1	2,620	2,620

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
27-Aug-20	Perez,Javier	0.53	0	0
26-Aug-20	Perez,Javier	5.2	0	0

Activity Sublet
No Data Available

Activity Checklist						
Check List						
20 Desc: Task: 55345 TRANSMISSION DTC P0751 SHIFT SOLENOID Performed by: JAPEREZ Performed on: 27-AUG-20						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
5 - 55345 TRANSMISSION DTC P0751 SHIFT SOLENOID	Done		JAPEREZ	Aug 27, 2020 8:21:45 AM	No	

Activity Sub Total		Activity 20 Sub Total	
Parts:		2,620.00	
Labor:		0.00	
Labor Hours:		5.73	
Sublet Parts:		0.00	
Sublet Labor:		0.00	
Activity Sub Total		2,620.00	

Work Order Footer		Work Order 53816748 Total	
Parts:		2,620.00	
Labor:		0.00	
Labor Hours:		5.73	
Sublet Parts:		0.00	
Sublet Labor:		0.00	
Activity Sub Total		2,620.00	



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 53815351
Invoice No. 55345 - 53815351

Client Department:

Department: 55345M

Work Order Description

Missing Window Seal

Requested By: AOWENS

Created By: AOWENS

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 229,207 - DH

Chronology

Reported	Aug 25, 2020 5:32:00 PM	Aug 25, 2020 5:32:00 PM
Started	Aug 25, 2020 12:00:00 AM	
Completed	Aug 25, 2020 5:41:00 PM	Aug 25, 2020 5:41:00 PM
Down Time		

Work Order Notes

Line 10 To file warranty be sure to do the following:

- 1) Enter a COMPLAINT statement for each activity.
- 2) Enter CAUSE statement in the Notes field of each activity.
- 3) Enter CORRECTION statement in the Comment section of each activity.

Complaint: Window Seal Missing

Cause: Normal Usage

Correction: Replace window seal

Part# 1014750 qty 1

Activity Header							
Activity: 5 999 TOTAL VEHICLE							
Activity Note: Personal Risk Assessment							
Reason for Repair: SW Shop Work Order							
Work Accomplished: 06 Inspect							
Part Failure:							
Activity Comments:							
Activity Parts							
No Data Available							
Activity Labor							
No Data Available							
Activity Sublet							
No Data Available							
Activity Checklist							
Check List							
5 Desc: Personal Risk Assessment							
Task: PRA and Meter Readings Performed by: AOWENS Performed on: 25-AUG-20							
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO	
1 - Are you properly trained to perform the task?	Done		AOWENS	Aug 25, 2020	No		

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
				5:40:58 PM		
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		AOWENS	Aug 25, 2020 5:40:58 PM	No	
3 - Are you wearing the appropriate PPE?	Done		AOWENS	Aug 25, 2020 5:40:58 PM	No	
4 - Have you performed the proper LOTO?	Done		AOWENS	Aug 25, 2020 5:40:58 PM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		AOWENS	Aug 25, 2020 5:40:58 PM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		AOWENS	Aug 25, 2020 5:40:58 PM	No	
20 - Miles			AOWENS	Aug 25, 2020 5:40:58 PM	No	
30 - Kilometers			AOWENS	Aug 25, 2020 5:40:58 PM	No	
40 - Hours			AOWENS	Aug 25, 2020 5:40:58 PM	No	

Activity Sub Total

Activity 5 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 53815351
Invoice No. 55345 - 53815351

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Missing Window Seal		Ford E450 Champion Challenger	
Requested By:	AOWENS	Status:	40 - Closed (40)
Created By:	AOWENS	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	229,207 - DH

Activity Header
Activity:15 079 DEVICES, SAFETY/STABILITY, TRAILER
Activity Note: Replace Window Seal
Reason for Repair: 05 Inspection, Routine
Work Accomplished:
Part Failure:
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
25-Aug-20	1014750	SEAL, WINDOW	1	0.37	0.37

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
25-Aug-20	Owens,Arthur	0.5	0	0

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available

Activity Sub Total		Activity 15 Sub Total	
Parts:			0.37
Labor:			0.00
Labor Hours:			0.50
Sublet Parts:			0.00
Sublet Labor:			0.00
Activity Sub Total			0.37

Work Order Footer		Work Order 53815351 Total	
Parts:			0.37
Labor:			0.00
Labor Hours:			0.50
Sublet Parts:			0.00
Sublet Labor:			0.00
Activity Sub Total			0.37



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 53804862
Invoice No. 55345 - 53804862

Client Department:

Department: 55345M

Work Order Description

55345 PER DVIR (Check Wheel Chair Lift)

Requested By: AOWENS

Created By: AOWENS

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 2 - Medium

Driver:

Phone:

ETA:

Meter: 228,830 - DH

Chronology

Reported	Aug 21, 2020 10:01:00 PM	Aug 21, 2020 10:01:00 PM
Started	Aug 21, 2020 12:00:00 AM	
Completed	Aug 21, 2020 10:09:00 PM	Aug 21, 2020 10:09:00 PM
Down Time		

Work Order Notes

Line 10

Complaint: Wheel Chair Lift will not deploy

Cause: Wheel chair pendent not getting power to deploy

Correction: Replace wheel chair pendent

part# 33659K5 Qty1

Activity Header						
Activity: 10 999/999/999 TOTAL VEHICLE						
Activity Note: PRA						
Reason for Repair:		SW Shop Work Order				
Work Accomplished:		06 Inspect				
Part Failure:		00 No Failure				
Activity Comments:						
Activity Parts						
No Data Available						
Activity Labor						
No Data Available						
Activity Sublet						
No Data Available						
Activity Checklist						
Check List						
10 Desc: PRA						
Task: PRA and Meter Readings Performed by: AOWENS Performed on: 21-AUG-20						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		AOWENS	Aug 21, 2020	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
				10:09:16 PM		
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		AOWENS	Aug 21, 2020 10:09:16 PM	No	
3 - Are you wearing the appropriate PPE?	Done		AOWENS	Aug 21, 2020 10:09:16 PM	No	
4 - Have you performed the proper LOTO?	Done		AOWENS	Aug 21, 2020 10:09:16 PM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		AOWENS	Aug 21, 2020 10:09:16 PM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		AOWENS	Aug 21, 2020 10:09:16 PM	No	
20 - Miles			AOWENS	Aug 21, 2020 10:09:16 PM	No	
30 - Kilometers			AOWENS	Aug 21, 2020 10:09:16 PM	No	
40 - Hours			AOWENS	Aug 21, 2020 10:09:16 PM	No	

Activity Sub Total

Activity 10 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 53804862
Invoice No. 55345 - 53804862

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
55345 PER DVIR (Check Wheel Chair Lift)		Ford E450 Champion Challenger	
Requested By:	AOWENS	Status:	40 - Closed (40)
Created By:	AOWENS	Priority:	2 - Medium
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	228,830 - DH

Activity Header
Activity:30 079 DEVICES, SAFETY/STABILITY, TRAILER
Activity Note: Replace Wheel Chair Penedent
Reason for Repair: 05 Inspection, Routine
Work Accomplished:
Part Failure:
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
21-Aug-20	33659KS	PENDANT, CONTROL, W/C, BRAUN	1	188.95	188.95

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
21-Aug-20	Owens,Arthur	0.5	0	0

Activity Sublet
No Data Available


Activity Checklist
No Data Available
No Data Available

Activity Sub Total															
<table><tr><th colspan="2">Activity 30 Sub Total</th></tr><tr><td>Parts:</td><td>188.95</td></tr><tr><td>Labor:</td><td>0.00</td></tr><tr><td>Labor Hours:</td><td>0.50</td></tr><tr><td>Sublet Parts:</td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td>188.95</td></tr></table>		Activity 30 Sub Total		Parts:	188.95	Labor:	0.00	Labor Hours:	0.50	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	188.95
Activity 30 Sub Total															
Parts:	188.95														
Labor:	0.00														
Labor Hours:	0.50														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	188.95														

Work Order Footer															
<table><tr><th colspan="2">Work Order 53804862 Total</th></tr><tr><td>Parts:</td><td>188.95</td></tr><tr><td>Labor:</td><td>0.00</td></tr><tr><td>Labor Hours:</td><td>0.50</td></tr><tr><td>Sublet Parts:</td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td>188.95</td></tr></table>		Work Order 53804862 Total		Parts:	188.95	Labor:	0.00	Labor Hours:	0.50	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	188.95
Work Order 53804862 Total															
Parts:	188.95														
Labor:	0.00														
Labor Hours:	0.50														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	188.95														



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 53759627
Invoice No. 55345 - 53759627

Client Department:

Department: 55345M

Work Order Description

FOLLOWUP----> Replace 6 tires

Requested By: AOWENS

Created By: AOWENS

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 226,398 - DH

Chronology

Reported	Aug 5, 2020 10:54:05 PM	Aug 5, 2020 10:54:05 PM
Started	Aug 5, 2020 11:11:00 PM	
Completed	Aug 6, 2020 5:08:00 PM	Aug 6, 2020 5:08:00 PM
Down Time		

Work Order Notes

Line 10 Have you completed a satisfactory Personal Risk Assessment? Yes() No ().

If the answer is NO stop what you are doing, complete an IP Safety Contact Slip and see your supervisor for further instructions.

=====

To file warranty be sure to do the following:

- 1) Enter a COMPLAINT statement for each activity.
- 2) Enter CAUSE statement in the Notes field of each activity.
- 3) Enter CORRECTION statement in the Comment section of each activity.

=====

Complaint: needs 6 tires

Cause: low spec

Correction:6 new tires mount and balance

Torque wheels 140 lbs second torque 140 lbs

Part number 192659 qty 6

Activity Header

Activity:10 017/003/001 TIRE, CUSHION W/TREAD

Activity Note: needs 2 front tires

Reason for Repair: 05 Inspection, Routine

Work Accomplished:

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
06-Aug-20	192659	TIRE, LT225/75R16, R500 HD, BSW, E/10PR, DURAVIS, BRIDGESTONE	2	117.62	235.24

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
05-Aug-20	Gaspard,Ronald	0.8	0	0

Activity Sublet

No Data Available

Activity Checklist

No Data Available	
No Data Available	
Activity Sub Total	
	Activity 10 Sub Total
	Parts: 235.24
	Labor: 0.00
	Labor Hours: 0.80
	Sublet Parts: 0.00
	Sublet Labor: 0.00
	Activity Sub Total 235.24



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 53759627
Invoice No. 55345 - 53759627

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
FOLLOWUP----> Replace 6 tires		Ford E450 Champion Challenger	
Requested By:	AOWENS	Status:	40 - Closed (40)
Created By:	AOWENS	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	226,398 - DH

Activity Header					
Activity:20 017/003/001 TIRE, CUSHION W/TREAD					
Activity Note: needs 2 right rear tires					
Reason for Repair: 05 Inspection, Routine					
Work Accomplished:					
Part Failure:					
Activity Comments:					
Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
06-Aug-20	192659	TIRE, LT225/75R16, R500 HD, BSW, E/10PR, DURAVIS, BRIDGESTONE	2	117.62	235.24
Activity Labor					
Booked Date	Technician	Hours	Shop Rate	Extended	
06-Aug-20	Gaspard,Ronald	0.45	0	0	
05-Aug-20	Gaspard,Ronald	0.02	0	0	
06-Aug-20	Gaspard,Ronald	0.32	0	0	
Activity Sublet					
No Data Available					
Activity Checklist					
No Data Available					
No Data Available					
Activity Sub Total					
			Activity 20 Sub Total		
			Parts:	235.24	
			Labor:	0.00	
			Labor Hours:	0.79	
			Sublet Parts:	0.00	
			Sublet Labor:	0.00	
			Activity Sub Total	235.24	



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 53759627
Invoice No. 55345 - 53759627

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
FOLLOWUP----> Replace 6 tires		Ford E450 Champion Challenger	
Requested By:	AOWENS	Status:	40 - Closed (40)
Created By:	AOWENS	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	226,398 - DH

Activity Header
Activity:30 017/009/016 VALVE, PROTECTION, PRESSURE, TIRE
Activity Note: needs 2 left rear tires
Reason for Repair: 05 Inspection, Routine
Work Accomplished:
Part Failure:
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
06-Aug-20	192659	TIRE, LT225/75R16, R500 HD, BSW, E/10PR, DURAVIS, BRIDGESTONE	2	117.62	235.24

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
06-Aug-20	Gaspard,Ronald	0.7	0	0

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available

Activity Sub Total															
<table><tr><th colspan="2">Activity 30 Sub Total</th></tr><tr><td>Parts:</td><td>235.24</td></tr><tr><td>Labor:</td><td>0.00</td></tr><tr><td>Labor Hours:</td><td>0.70</td></tr><tr><td>Sublet Parts:</td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td>235.24</td></tr></table>	Activity 30 Sub Total		Parts:	235.24	Labor:	0.00	Labor Hours:	0.70	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	235.24	
Activity 30 Sub Total															
Parts:	235.24														
Labor:	0.00														
Labor Hours:	0.70														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	235.24														

Work Order Footer															
<table><tr><th colspan="2">Work Order 53759627 Total</th></tr><tr><td>Parts:</td><td>705.72</td></tr><tr><td>Labor:</td><td>0.00</td></tr><tr><td>Labor Hours:</td><td>2.29</td></tr><tr><td>Sublet Parts:</td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td>705.72</td></tr></table>	Work Order 53759627 Total		Parts:	705.72	Labor:	0.00	Labor Hours:	2.29	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	705.72	
Work Order 53759627 Total															
Parts:	705.72														
Labor:	0.00														
Labor Hours:	2.29														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	705.72														



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 4



Work Order No. 53666694
Invoice No. 55345 - 53666694

Client Department:

Department: 55345M

Work Order Description

55345-LIGHT DUTY PMA

Requested By: RGASPARD

Created By: RGASPARD

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 3 - High

Driver:

Phone:

ETA:

Meter: 226,398 - DH

Chronology

Reported	Aug 5, 2020 12:00:00 AM	Aug 5, 2020 12:00:00 AM
Started	Aug 5, 2020 8:42:00 PM	
Completed	Aug 6, 2020 12:00:00 AM	Aug 6, 2020 12:00:00 AM
Down Time		

Work Order Notes

Line 10 COMPLAINT:

CAUSE:

CORRECTION:

Activity Header

Activity: 5 999/999/999 TOTAL VEHICLE

Activity Note: PERSONAL RISK ASSESSMENT

Reason for Repair: SW Shop Work Order

Work Accomplished: 06 Inspect

Part Failure: 00 No Failure

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: PERSONAL RISK ASSESSMENT


Task: PRA and Meter Readings Performed by: RGASPARD Performed on: 05-AUG-20

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		RGASPARD	Aug 5, 2020 8:42:41 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		RGASPARD	Aug 5, 2020 8:42:41 PM	No	
3 - Are you wearing the appropriate PPE?	Done		RGASPARD	Aug 5, 2020 8:42:41 PM	No	
4 - Have you performed the proper LOTO?	Done		RGASPARD	Aug 5, 2020 8:42:41 PM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		RGASPARD	Aug 5, 2020 8:42:41 PM	No	
10 - Have you successfully completed the Personal	Done		RGASPARD	Aug 5, 2020	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO	
Risk Assessment?				8:42:41 PM			
20 - Miles			RGASPARD	Aug 5, 2020 8:42:41 PM	No		
30 - Kilometers			RGASPARD	Aug 5, 2020 8:42:41 PM	No		
40 - Hours			RGASPARD	Aug 5, 2020 8:42:41 PM	No		
Activity Sub Total							
				Activity 5 Sub Total			
				Parts:			0.00
				Labor:			0.00
				Labor Hours:			0.00
				Sublet Parts:			0.00
				Sublet Labor:			0.00
				Activity Sub Total			0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 4



Work Order No. 53666694
Invoice No. 55345 - 53666694

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
55345-LIGHT DUTY PMA		Ford E450 Champion Challenger	
Requested By:	RGASPARD	Status:	40 - Closed (40)
Created By:	RGASPARD	Priority:	3 - High
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	226,398 - DH


Activity Header				
Activity:10 999/999/999 TOTAL VEHICLE				
Activity Note: Light Duty PMI				
Reason for Repair: 08 Preventive Maintenance				
Work Accomplished:				
Part Failure:				
Activity Comments:				
Activity Parts				
No Data Available				
Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
05-Aug-20	Gaspard,Ronald	1.58	0	0
Activity Sublet				
No Data Available				
Activity Checklist				
No Data Available				
No Data Available				
Activity Sub Total				
			Activity 10 Sub Total	
			Parts:	0.00
			Labor:	0.00
			Labor Hours:	1.58
			Sublet Parts:	0.00
			Sublet Labor:	0.00
			Activity Sub Total	0.00

Parts:	0.00
Labor:	0.00

	Labor Hours:	0.42
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 4 of 4



Work Order No. 53666694
Invoice No. 55345 - 53666694

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
55345-LIGHT DUTY PMA		Ford E450 Champion Challenger	
Requested By:	RGASPARD	Status:	40 - Closed (40)
Created By:	RGASPARD	Priority:	3 - High
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	226,398 - DH

Activity Header
Activity:30 055/023 LIFT, WHEELCHAIR, PASSENGER
Activity Note: 55345-W/C LIFT INSPECTION
Reason for Repair: 05 Inspection, Routine
Work Accomplished:
Part Failure:
Activity Comments:

Activity Parts
No Data Available

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
05-Aug-20	Gaspard,Ronald	0.47	0	0

Activity Sublet
No Data Available

Check List						
30 Desc: 55345-W/C LIFT INSPECTION						
Task: First Transit Wheelchair Lift Inspection Performed by: RGASPARD Performed on: 05-AUG-20						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
100 - Wheelchair Cycle Count	11264 Cycles		RGASPARD	Aug 5, 2020 10:44:43 PM	No	
1,000 - A.1 Check Lift Access Door for Ease of Opening,Latch Security,Door Hold Back	Done		RGASPARD	Aug 5, 2020 10:44:43 PM	No	
2,000 - A.2 Check Platform Emergency Release Mechanism for Ease of Operation	Done		RGASPARD	Aug 5, 2020 10:44:43 PM	No	
3,000 - Operate Lift Through Complete Cycle and Check for:	Done		RGASPARD	Aug 5, 2020 10:44:43 PM	No	
3,003 - A.3 Unusual Noises	Done		RGASPARD	Aug 5, 2020 10:44:43 PM	No	
3,004 - A.4 Jerky Operation	Done		RGASPARD	Aug 5, 2020 10:44:43 PM	No	
3,005 - A.5 Operated Too Slowly or Too Fast	Done		RGASPARD	Aug 5, 2020 10:44:43 PM	No	
3,006 - A.6 Drift Down	Done		RGASPARD	Aug 5, 2020 10:44:43 PM	No	
7,000 - A.7 Check Bridgeplate Operation	Done		RGASPARD	Aug 5, 2020 10:44:43 PM	No	
8,000 - A.8 Check All Pivot Points for Wear and Looseness	Done		RGASPARD	Aug 5, 2020 10:44:43 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
9,000 - A.9 Check Rollers for Wear and Smooth Rotation	Done		RGASPARD	Aug 5, 2020 10:44:43 PM	No	
11,000 - A.11 Check Operation of Platform Barrier Mechanism	Done		RGASPARD	Aug 5, 2020 10:44:43 PM	No	
12,000 - A.12 Check Cam Slots for Wear and Proper Alignment	Done		RGASPARD	Aug 5, 2020 10:44:43 PM	No	
13,000 - A.13 Check Cable Condition (If Applicable)	Done		RGASPARD	Aug 5, 2020 10:44:43 PM	No	
14,000 - A.14 Check Hydraulic Hoses for Leaks, Chafing or Cracks	Done		RGASPARD	Aug 5, 2020 10:44:43 PM	No	
15,000 - A.15 Check Electrical Connections and Routing of Wires and Cables	Done		RGASPARD	Aug 5, 2020 10:44:43 PM	No	
16,000 - A.16 Check Operation and Adjustment of All Safety Switches	Done		RGASPARD	Aug 5, 2020 10:44:43 PM	No	
17,000 - A.17 Check All Lift Mounting Brackets for Loose Bolts Broken Welds, etc.	Done		RGASPARD	Aug 5, 2020 10:44:43 PM	No	
18,000 - A.18 Check the Manual Back-up Raise/Lower System (If Applicable)	Done		RGASPARD	Aug 5, 2020 10:44:43 PM	No	
19,000 - A.19 Check HydrPump Reservoir Oil Level. Consult SvcManual for Fluid to Use.	Done		RGASPARD	Aug 5, 2020 10:44:43 PM	No	
20,000 - A.20 Are Operator Decals in Place? Consult Service Manual for Information.	Yes		RGASPARD	Aug 5, 2020 10:44:43 PM	No	
21,000 - A.21 Check WC Holdowns Inside Vehicle for Secure Mounting, Proper Operation	Done		RGASPARD	Aug 5, 2020 10:44:43 PM	No	
90,000 - Clean all Linkages and Mechanisms If Needed before Lubrication	Done		RGASPARD	Aug 5, 2020 10:44:43 PM	No	
91,000 - Lubricate (Don't OVER Lubricate)	Done		RGASPARD	Aug 5, 2020 10:44:43 PM	No	
100,000 - B.1 Emergency Platform Release Mechanism	Done		RGASPARD	Aug 5, 2020 10:44:43 PM	No	
200,000 - B.2 Platform Barrier Latch Mechanism	Done		RGASPARD	Aug 5, 2020 10:44:43 PM	No	
300,000 - B.3 Bridgeplate Hinge	Done		RGASPARD	Aug 5, 2020 10:44:43 PM	No	
400,000 - B.4 All Pivot Points	Done		RGASPARD	Aug 5, 2020 10:44:43 PM	No	
500,000 - B.5 Cams and Slots	Done		RGASPARD	Aug 5, 2020 10:44:43 PM	No	
600,000 - B.6 Rollers	Done		RGASPARD	Aug 5, 2020 10:44:43 PM	No	
700,000 - B.7 All Linkages	Done		RGASPARD	Aug 5, 2020 10:44:43 PM	No	

Activity Sub Total

Activity 30 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	0.47
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00

Work Order Footer

Work Order 53666694 Total	
Parts:	0.00

	Labor:	0.00
	Labor Hours:	2.47
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 4



Work Order No. 53722643
Invoice No. 55345 - 53722643

Client Department:

Department: 55345M

Work Order Description

55345 PER DVIR (Check Battery and Starter)

Requested By: AOWENS

Created By: AOWENS

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 224,463 - DH

Chronology

Reported	Jul 22, 2020 8:09:00 PM	Jul 22, 2020 8:09:00 PM
Started	Jul 22, 2020 8:34:00 PM	
Completed	Jul 22, 2020 11:06:00 PM	Jul 22, 2020 11:06:00 PM
Down Time		

Work Order Notes

Line 10 Driver complained of the batteries being bad. Remove and replaced 2 batteries.

Activity Header

Activity: 10 999/999/999 TOTAL VEHICLE

Activity Note: PRA

Reason for Repair: SW Shop Work Order

Work Accomplished: 06 Inspect

Part Failure: 00 No Failure

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: PRA

Task: PRA and Meter Readings Performed by: EARJOHNSON Performed on: 22-JUL-20

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		EARJOHNSON	Jul 22, 2020 9:50:17 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		EARJOHNSON	Jul 22, 2020 9:50:17 PM	No	
3 - Are you wearing the appropriate PPE?	Done		EARJOHNSON	Jul 22, 2020 9:50:17 PM	No	
4 - Have you performed the proper LOTO?	Done		EARJOHNSON	Jul 22, 2020 9:50:17 PM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		EARJOHNSON	Jul 22, 2020 9:50:17 PM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		EARJOHNSON	Jul 22, 2020 9:50:17 PM	No	
20 - Miles			EARJOHNSON	Jul 22, 2020 9:50:17 PM	No	
30 - Kilometers			EARJOHNSON	Jul 22, 2020	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
				9:50:17 PM		
40 - Hours			EARJOHNSON	Jul 22, 2020 9:50:17 PM	No	
Activity Sub Total				Activity 10 Sub Total		
				Parts:		0.00
				Labor:		0.00
				Labor Hours:		0.00
				Sublet Parts:		0.00
				Sublet Labor:		0.00
				Activity Sub Total		0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 4



Work Order No. 53722643
Invoice No. 55345 - 53722643

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
55345 PER DVIR (Check Battery and Starter)		Ford E450 Champion Challenger	
Requested By:	AOWENS	Status:	40 - Closed (40)
Created By:	AOWENS	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	224,463 - DH

Activity Header				
Activity:20 032/000/000 CRANKING				
Activity Note: VERIFY COMPLAINT				
Reason for Repair: 05 Inspection, Routine				
Work Accomplished: 03 Replace New				
Part Failure:				
Activity Comments:				
Activity Parts				
No Data Available				
Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
22-Jul-20	Earl Johnson	1.08	0	0
Activity Sublet				
No Data Available				
Activity Checklist				
No Data Available				
No Data Available				
Activity Sub Total				
			Activity 20 Sub Total	
			Parts:	0.00
			Labor:	0.00
			Labor Hours:	1.08
			Sublet Parts:	0.00
			Sublet Labor:	0.00
			Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 4



Work Order No. 53722643
Invoice No. 55345 - 53722643

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FD4E4FS7EDB17176
55345 PER DVIR (Check Battery and Starter)		Ford E450 Champion Challenger	
Requested By:	AOWENS	Status:	40 - Closed (40)
Created By:	AOWENS	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	224,463 - DH

Activity Header				
Activity:30 032/000/000 CRANKING				
Activity Note: Check Battery and Starter				
Reason for Repair: 05 Inspection, Routine				
Work Accomplished: 03 Replace New				
Part Failure:				
Activity Comments:				
Activity Parts				
No Data Available				
Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
22-Jul-20	Earl Johnson	0.35	0	0
Activity Sublet				
No Data Available				
Activity Checklist				
No Data Available				
No Data Available				
Activity Sub Total				
			Activity 30 Sub Total	
			Parts:	0.00
			Labor:	0.00
			Labor Hours:	0.35
			Sublet Parts:	0.00
			Sublet Labor:	0.00
			Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 4 of 4



Work Order No. 53722643
Invoice No. 55345 - 53722643


Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FD4E4FS7EDB17176
55345 PER DVIR (Check Battery and Starter)		Ford E450 Champion Challenger	
Requested By:	AOWENS	Status:	40 - Closed (40)
Created By:	AOWENS	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	224,463 - DH

Activity Header															
Activity:40 031 CHARGING															
Activity Note:															
Reason for Repair: 04 Driver's Report															
Work Accomplished:															
Part Failure:															
Activity Comments:															
Activity Parts															
No Data Available															
Activity Labor															
No Data Available															
Activity Sublet															
No Data Available															
Activity Checklist															
No Data Available															
No Data Available															
Activity Sub Total															
<table><tr><td colspan="2">Activity 40 Sub Total</td></tr><tr><td>Parts:</td><td>0.00</td></tr><tr><td>Labor:</td><td>0.00</td></tr><tr><td>Labor Hours:</td><td>0.00</td></tr><tr><td>Sublet Parts:</td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td>0.00</td></tr></table>		Activity 40 Sub Total		Parts:	0.00	Labor:	0.00	Labor Hours:	0.00	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	0.00
Activity 40 Sub Total															
Parts:	0.00														
Labor:	0.00														
Labor Hours:	0.00														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	0.00														
Work Order Footer															
<table><tr><td colspan="2">Work Order 53722643 Total</td></tr><tr><td>Parts:</td><td>0.00</td></tr><tr><td>Labor:</td><td>0.00</td></tr><tr><td>Labor Hours:</td><td>1.43</td></tr><tr><td>Sublet Parts:</td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td>0.00</td></tr></table>		Work Order 53722643 Total		Parts:	0.00	Labor:	0.00	Labor Hours:	1.43	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	0.00
Work Order 53722643 Total															
Parts:	0.00														
Labor:	0.00														
Labor Hours:	1.43														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	0.00														



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 53716123
Invoice No. 55345 - 53716123

Client Department:

Department: 55345M

Work Order Description

55345 PER DVIR (Hear Noise When Traveling 40-43 MPH)

Requested By: AOWENS

Created By: AOWENS

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 2 - Medium

Driver:

Phone:

ETA:

Meter: 224,165 - DH

Chronology

Reported	Jul 21, 2020 12:09:00 AM	Jul 21, 2020 12:09:00 AM
Started	Jul 21, 2020 7:47:00 AM	
Completed	Jul 21, 2020 2:22:00 PM	Jul 21, 2020 2:22:00 PM
Down Time		

Work Order Notes

Line 10 C: Engine has a noise

C: Check and road test vehicle found engine makes a noise due to bad belt tensioner

C: Replaced belt tensioner retest system ok no noise from tensioner, rear a/c compressor was whining due to too much Freon. Recover and recharge system as manufacturers recommend

Parts:

1 belt tensioner 89263

1 belt 1360k6

Activity Header

Activity:10 999/999/999 TOTAL VEHICLE

Activity Note: PRA

Reason for Repair: SW Shop Work Order

Work Accomplished: 06 Inspect

Part Failure: 00 No Failure

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: PRA

Task: PRA and Meter Readings Performed by: JAPEREZ Performed on: 21-JUL-20

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		JAPEREZ	Jul 21, 2020 2:21:29 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		JAPEREZ	Jul 21, 2020 2:21:29 PM	No	
3 - Are you wearing the appropriate PPE?	Done		JAPEREZ	Jul 21, 2020	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
				2:21:29 PM		
4 - Have you performed the proper LOTO?	Done		JAPEREZ	Jul 21, 2020 2:21:29 PM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		JAPEREZ	Jul 21, 2020 2:21:29 PM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		JAPEREZ	Jul 21, 2020 2:21:29 PM	No	
20 - Miles			JAPEREZ	Jul 21, 2020 2:21:29 PM	No	
30 - Kilometers			JAPEREZ	Jul 21, 2020 2:21:29 PM	No	
40 - Hours			JAPEREZ	Jul 21, 2020 2:21:29 PM	No	

Activity Sub Total

Activity 10 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 53716123
Invoice No. 55345 - 53716123

Client Department:

Department: 55345M

Work Order Description

55345 PER DVIR (Hear Noise When Traveling 40-43 MPH)

Requested By: AOWENS

Created By: AOWENS

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 2 - Medium

Driver:

Phone:

ETA:

Meter: 224,165 - DH

Activity Header

Activity: 20 040 ENGINE/MOTOR SYSTEMS GROUP

Activity Note: VERIFY COMPLAINT

Reason for Repair: 04 Driver's Report

Work Accomplished:

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
21-Jul-20	1360K6	BELT, SERPENTINE, 6-RIB, 136.00" SAME AS 5061360	1	21	21
21-Jul-20	89263	TENSIONER, BELT, SERPENTINE	1	29.41	29.41

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
21-Jul-20	Perez,Javier	6.43	0	0

Activity Sublet

No Data Available

Activity Checklist

No Data Available

No Data Available

Activity Sub Total

Activity 20 Sub Total

Parts:	50.41
Labor:	0.00
Labor Hours:	6.43
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	50.41


Work Order Footer

Work Order 53716123 Total

Parts:	50.41
Labor:	0.00
Labor Hours:	6.43
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	50.41



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 53696458
Invoice No. 55345 - 53696458

Client Department:

Department: 55345M

Work Order Description

(Check Wheel Chair Lift)

Requested By: AOWENS

Created By: AOWENS

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 223,555 - DH

Chronology

Reported	Jul 14, 2020 5:52:00 PM	Jul 14, 2020 5:52:00 PM
Started	Jul 14, 2020 9:57:00 PM	
Completed	Jul 14, 2020 11:29:00 PM	Jul 14, 2020 11:29:00 PM
Down Time		

Work Order Notes

Line 10 Driver complained of the Econ lift not coming back up. Upon inspection found that the out board rollstop was out of adjustment. Adjusted and ran lift thru 5 consecutive cycles with no problems.

Activity Header

Activity: 10 999/999/999 TOTAL VEHICLE

Activity Note: PRA

Reason for Repair: SW Shop Work Order

Work Accomplished: 06 Inspect

Part Failure: 00 No Failure

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
14-Jul-20	Earl Johnson	0.0666666	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: PRA

Task: PRA and Meter Readings Performed by: EARJOHNSON Performed on: 14-JUL-20

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		EARJOHNSON	Jul 14, 2020 11:16:13 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		EARJOHNSON	Jul 14, 2020 11:16:13 PM	No	
3 - Are you wearing the appropriate PPE?	Done		EARJOHNSON	Jul 14, 2020 11:16:13 PM	No	
4 - Have you performed the proper LOTO?	Done		EARJOHNSON	Jul 14, 2020 11:16:13 PM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		EARJOHNSON	Jul 14, 2020 11:16:13 PM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		EARJOHNSON	Jul 14, 2020 11:16:13 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
20 - Miles			EARJOHNSON	Jul 14, 2020 11:16:13 PM	No	
30 - Kilometers			EARJOHNSON	Jul 14, 2020 11:16:13 PM	No	
40 - Hours			EARJOHNSON	Jul 14, 2020 11:16:13 PM	No	
Activity Sub Total						
				Activity 10 Sub Total		
				Parts:		0.00
				Labor:		0.00
				Labor Hours:		0.07
				Sublet Parts:		0.00
				Sublet Labor:		0.00
				Activity Sub Total		0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 53696458
Invoice No. 55345 - 53696458

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description (Check Wheel Chair Lift)		VIN:	1FD4E4FS7EDB17176
Requested By:	AOWENS	Status:	40 - Closed (40)
Created By:	AOWENS	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	223,555 - DH

Activity Header
Activity:20 079 DEVICES, SAFETY/STABILITY, TRAILER
Activity Note: VERIFY COMPLAINT
Reason for Repair: 04 Driver's Report
Work Accomplished:
Part Failure:
Activity Comments:

Activity Parts
No Data Available

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
14-Jul-20	Earl Johnson	1.3	0	0

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available

Activity Sub Total		Activity 20 Sub Total	
		Parts:	0.00
		Labor:	0.00
		Labor Hours:	1.30
		Sublet Parts:	0.00
		Sublet Labor:	0.00
		Activity Sub Total	0.00

Work Order Footer		Work Order 53696458 Total	
		Parts:	0.00
		Labor:	0.00
		Labor Hours:	1.37
		Sublet Parts:	0.00
		Sublet Labor:	0.00
		Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 53670783
Invoice No. 55345 - 53670783

Client Department:

Department: 55345M

Work Order Description

Road Call (Bus Stall Not Starting)

Requested By: AOWENS

Created By: AOWENS

Assigned To:

Class: WORC - WORK ORDER ROAD CALL

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 3 - High

Driver:

Phone:

ETA:

Meter: 222,261 - DH

Chronology		
Reported	Jul 3, 2020 7:55:00 PM	Jul 3, 2020 7:55:00 PM
Started	Jul 3, 2020 7:56:00 PM	
Completed	Jul 3, 2020 8:47:00 PM	Jul 3, 2020 8:47:00 PM
Down Time		

Work Order Notes

Line 10 To file warranty be sure to do the following:

- 1) Enter a COMPLAINT statement for each activity.
- 2) Enter CAUSE statement in the Notes field of each activity.
- 3) Enter CORRECTION statement in the Comment section of each activity.

Complaint:crank no start

Cause: no start

Correction: replaced module still not start

Tow in to the shop

Activity Header						
Activity:5 999 TOTAL VEHICLE						
Activity Note: PRAMETER						
Reason for Repair:		SW Shop Work Order				
Work Accomplished:		06 Inspect				
Part Failure:						
Activity Comments:						
Activity Parts						
No Data Available						
Activity Labor						
No Data Available						
Activity Sublet						
No Data Available						
Activity Checklist						
Check List						
5 Desc: PRAMETER						
Task: PRA and Meter Readings Performed by: RGASPARD Performed on: 03-JUL-20						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		RGASPARD	Jul 3, 2020 8:45:31 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		RGASPARD	Jul 3, 2020 8:45:31 PM	No	
3 - Are you wearing the appropriate PPE?	Done		RGASPARD	Jul 3, 2020 8:45:31 PM	No	
4 - Have you performed the proper LOTO?	Done		RGASPARD	Jul 3, 2020 8:45:31 PM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		RGASPARD	Jul 3, 2020 8:45:31 PM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		RGASPARD	Jul 3, 2020 8:45:31 PM	No	
20 - Miles			RGASPARD	Jul 3, 2020 8:45:31 PM	No	
30 - Kilometers			RGASPARD	Jul 3, 2020 8:45:31 PM	No	
40 - Hours			RGASPARD	Jul 3, 2020 8:45:31 PM	No	

Activity Sub Total

Activity 5 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 53670783
Invoice No. 55345 - 53670783

Client Department:

Department: 55345M

Work Order Description

Road Call (Bus Stall Not Starting)

Requested By: AOWENS

Created By: AOWENS

Assigned To:

Class: WORC - WORK ORDER ROAD CALL

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 3 - High

Driver:

Phone:

ETA:

Meter: 222,261 - DH

Activity Header

Activity: 10 999 TOTAL VEHICLE

Activity Note: ROAD CALL

Reason for Repair: 10 Road Call

Work Accomplished:

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
03-Jul-20	Gaspard,Ronald	0.8	0	0

Activity Sublet

No Data Available

Activity Checklist

No Data Available

No Data Available

Activity Sub Total

Activity 10 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	0.80
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00


Work Order Footer

Work Order 53670783 Total

Parts:	0.00
Labor:	0.00
Labor Hours:	0.80
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 4



Work Order No. 53560789
Invoice No. 55345 - 53560789

Client Department:

Department: 55345M

Work Order Description

55345-LIGHT DUTY PMA

Requested By: RRENE

Created By: RRENE

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 3 - High

Driver:

Phone:

ETA:

Meter: 222,106 - DH

Chronology

Reported	Jun 30, 2020 12:00:00 AM	Jun 30, 2020 12:00:00 AM
Started	Jul 1, 2020 7:30:00 PM	
Completed	Jul 1, 2020 11:49:00 PM	Jul 1, 2020 11:49:00 PM
Down Time		

Work Order Notes

Line 10 COMPLAINT: PmA

CAUSE: Service

CORRECTION: perform PmA Service

Oil filter B329 Qty1

Engine oil 10w30 qty 7 Qts

Air filter PA4075 Qty1

Drain plug oil 65266 Qty1

Activity Header

Activity:5 999/999/999 TOTAL VEHICLE

Activity Note: PERSONAL RISK ASSESSMENT

Reason for Repair: SW Shop Work Order

Work Accomplished: 06 Inspect

Part Failure: 00 No Failure

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: PERSONAL RISK ASSESSMENT

Task: PRA and Meter Readings Performed by: RGASPARD Performed on: 01-JUL-20

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		RGASPARD	Jul 1, 2020 7:30:00 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		RGASPARD	Jul 1, 2020 7:30:00 PM	No	
3 - Are you wearing the appropriate PPE?	Done		RGASPARD	Jul 1, 2020 7:30:00 PM	No	
4 - Have you performed the proper LOTO?	Done		RGASPARD	Jul 1, 2020 7:30:00 PM	No	


Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
5 - Are you aware of the potential risks of performing this repair?	Done		RGASPARD	Jul 1, 2020 7:30:00 PM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		RGASPARD	Jul 1, 2020 7:30:00 PM	No	
20 - Miles			RGASPARD	Jul 1, 2020 7:30:00 PM	No	
30 - Kilometers			RGASPARD	Jul 1, 2020 7:30:00 PM	No	
40 - Hours			RGASPARD	Jul 1, 2020 7:30:00 PM	No	

Activity Sub Total

Activity 5 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 4



Work Order No. 53560789
Invoice No. 55345 - 53560789

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
55345-LIGHT DUTY PMA		Ford E450 Champion Challenger	
Requested By:	RRENE	Status:	40 - Closed (40)
Created By:	RRENE	Priority:	3 - High
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	222,106 - DH

Activity Header				
Activity:10 999/999/999 TOTAL VEHICLE				
Activity Note: Light Duty PMI				
Reason for Repair: 08 Preventive Maintenance				
Work Accomplished:				
Part Failure:				
Activity Comments:				
Activity Parts				
No Data Available				
Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
01-Jul-20	Gaspard,Ronald	1.35	0	0
Activity Sublet				
No Data Available				
Activity Checklist				
No Data Available				
No Data Available				
Activity Sub Total				
			Activity 10 Sub Total	
			Parts:	0.00
			Labor:	0.00
			Labor Hours:	1.35
			Sublet Parts:	0.00
			Sublet Labor:	0.00
			Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 1



Work Order No. 53666481
Invoice No. 55345 - 53666481

Client Department:

Department: 55345M

Work Order Description

FOLLOWUP----> Replace Rear Brakes

Requested By: AOWENS

Created By: AOWENS

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 222,106 - DH

Chronology

Reported	Jul 1, 2020 9:45:02 PM	Jul 1, 2020 9:45:02 PM
Started	Jul 1, 2020 10:03:00 PM	
Completed	Jul 1, 2020 11:49:00 PM	Jul 1, 2020 11:49:00 PM
Down Time		

Work Order Notes

Line 10 Have you completed a satisfactory Personal Risk Assessment? Yes() No ().

If the answer is NO stop what you are doing, complete an IP Safety Contact Slip and see your supervisor for further instructions.

=====

To file warranty be sure to do the following:

- 1) Enter a COMPLAINT statement for each activity.
- 2) Enter CAUSE statement in the Notes field of each activity.
- 3) Enter CORRECTION statement in the Comment section of each activity.

=====

Complaint: needs rear brakes job

Cause: cease caliper and brake pads

Correction:replaced rear brake pads and lubed guide pins

Part number 8C2Z-2V200-C Qty1

Torque wheels 140 lbs second torque 140 lbs

Activity Header

Activity:10 013/002/012 SHOE & LINING, BRAKE, REAR

Activity Note: needs rear brakes job

Reason for Repair:

Work Accomplished:

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
01-Jul-20	8C2Z-2V200-C	PADS, BRAKE, DISC, REAR	1	44.81	44.81

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
01-Jul-20	Gaspard,Ronald	1.37	0	0

Activity Sublet


No Data Available

Activity Checklist

No Data Available	
No Data Available	
Activity Sub Total	
	Activity 10 Sub Total
	Parts: 44.81
	Labor: 0.00
	Labor Hours: 1.37
	Sublet Parts: 0.00
	Sublet Labor: 0.00
	Activity Sub Total 44.81
Work Order Footer	
	Work Order 53666481 Total
	Parts: 44.81
	Labor: 0.00
	Labor Hours: 1.37
	Sublet Parts: 0.00
	Sublet Labor: 0.00
	Activity Sub Total 44.81



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 4



Work Order No. 53560789
Invoice No. 55345 - 53560789

Client Department:

Department: 55345M

Work Order Description

55345-LIGHT DUTY PMA

Requested By: RRENE

Created By: RRENE

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 3 - High

Driver:

Phone:

ETA:

Meter: 222,106 - DH

Activity Header

Activity: 20 999 TOTAL VEHICLE

Activity Note: PM A

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: A PM Level A

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
01-Jul-20	B329(F)	GOING OUT OF SERVICE SEE BALDWIN B329 IN THE FLEET ORG. FILTER, OIL, SPIN-ON	1	1.96	1.96
01-Jul-20	PA4075	FILTER, AIR SEE P546597	1	5.28	5.28
01-Jul-20	65266	PLUG, DRAIN, OIL, ENGINE	1	4.25	4.25

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
01-Jul-20	Gaspard,Ronald	0.37	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List						
20 Desc: PM A						
Task: PM A SERVICE Performed by: RGASPARD Performed on: 01-JUL-20						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
100,000 - "A" PMI SERVICING ITEMS	Done		RGASPARD	Jul 1, 2020 8:52:56 PM	No	
101,000 - FRA Change Oil Filters	Yes		RGASPARD	Jul 1, 2020 8:52:56 PM	No	
102,000 - FRA Drain Engine Oil	Yes		RGASPARD	Jul 1, 2020 8:52:56 PM	No	
103,000 - FRA Check Transmission Fluid	Done		RGASPARD	Jul 1, 2020 8:52:56 PM	No	
104,000 - Lubricate Chassis	-	na	RGASPARD	Jul 1, 2020 8:52:56 PM	No	
105,000 - Replace or Clean A/C Filters	Done		RGASPARD	Jul 1, 2020 8:52:56 PM	No	
107,000 - FRA Change Primary Fuel Filter	No	na	RGASPARD	Jul 1, 2020 8:52:56 PM	No	


Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
108,000 - Lube all pivoting Mechanisms	Done		RGASPARD	Jul 1, 2020 8:52:56 PM	No	

Activity Sub Total

Activity 20 Sub Total	
Parts:	11.49
Labor:	0.00
Labor Hours:	0.37
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	11.49



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 4 of 4



Work Order No. 53560789
Invoice No. 55345 - 53560789

Client Department:

Department: 55345M

Work Order Description

55345-LIGHT DUTY PMA

Requested By: RRENE

Created By: RRENE

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 3 - High

Driver:

Phone:

ETA:

Meter: 222,106 - DH

Activity Header

Activity: 30 055/023 LIFT, WHEELCHAIR, PASSENGER

Activity Note: 55345-W/C LIFT INSPECTION

Reason for Repair: 05 Inspection, Routine

Work Accomplished:

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
01-Jul-20	Gaspard,Ronald	0.58	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

30 Desc: 55345-W/C LIFT INSPECTION

Task: First Transit Wheelchair Lift Inspection Performed by: RGASPARD Performed on: 01-JUL-20

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
100 - Wheelchair Cycle Count	11063 Cycles		RGASPARD	Jul 1, 2020 9:16:27 PM	No	
1,000 - A.1 Check Lift Access Door for Ease of Opening,Latch Security,Door Hold Back	Done		RGASPARD	Jul 1, 2020 9:16:27 PM	No	
2,000 - A.2 Check Platform Emergency Release Mechanism for Ease of Operation	Done		RGASPARD	Jul 1, 2020 9:16:27 PM	No	
3,000 - Operate Lift Through Complete Cycle and Check for:	Done		RGASPARD	Jul 1, 2020 9:16:27 PM	No	
3,003 - A.3 Unusual Noises	Done		RGASPARD	Jul 1, 2020 9:16:27 PM	No	
3,004 - A.4 Jerky Operation	Done		RGASPARD	Jul 1, 2020 9:16:27 PM	No	
3,005 - A.5 Operated Too Slowly or Too Fast	Done		RGASPARD	Jul 1, 2020 9:16:27 PM	No	
3,006 - A.6 Drift Down	Done		RGASPARD	Jul 1, 2020 9:16:27 PM	No	
7,000 - A.7 Check Bridgeplate Operation	Done		RGASPARD	Jul 1, 2020 9:16:27 PM	No	
8,000 - A.8 Check All Pivot Points for Wear and Looseness	Done		RGASPARD	Jul 1, 2020 9:16:27 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
9,000 - A.9 Check Rollers for Wear and Smooth Rotation	Done		RGASPARD	Jul 1, 2020 9:16:27 PM	No	
11,000 - A.11 Check Operation of Platform Barrier Mechanism	Done		RGASPARD	Jul 1, 2020 9:16:27 PM	No	
12,000 - A.12 Check Cam Slots for Wear and Proper Alignment	Done		RGASPARD	Jul 1, 2020 9:16:27 PM	No	
13,000 - A.13 Check Cable Condition (If Applicable)	Done		RGASPARD	Jul 1, 2020 9:16:27 PM	No	
14,000 - A.14 Check Hydraulic Hoses for Leaks, Chafing or Cracks	Done		RGASPARD	Jul 1, 2020 9:16:27 PM	No	
15,000 - A.15 Check Electrical Connections and Routing of Wires and Cables	Done		RGASPARD	Jul 1, 2020 9:16:27 PM	No	
16,000 - A.16 Check Operation and Adjustment of All Safety Switches	Done		RGASPARD	Jul 1, 2020 9:16:27 PM	No	
17,000 - A.17 Check All Lift Mounting Brackets for Loose Bolts Broken Welds, etc.	Done		RGASPARD	Jul 1, 2020 9:16:27 PM	No	
18,000 - A.18 Check the Manual Back-up Raise/Lower System (If Applicable)	Done		RGASPARD	Jul 1, 2020 9:16:27 PM	No	
19,000 - A.19 Check HydrPump Reservoir Oil Level. Consult SvcManual for Fluid to Use.	Done		RGASPARD	Jul 1, 2020 9:16:27 PM	No	
20,000 - A.20 Are Operator Decals in Place? Consult Service Manual for Information.	Yes		RGASPARD	Jul 1, 2020 9:16:27 PM	No	
21,000 - A.21 Check WC Holdowns Inside Vehicle for Secure Mounting, Proper Operation	Done		RGASPARD	Jul 1, 2020 9:16:27 PM	No	
90,000 - Clean all Linkages and Mechanisms If Needed before Lubrication	Done		RGASPARD	Jul 1, 2020 9:16:27 PM	No	
91,000 - Lubricate (Don't OVER Lubricate)	Done		RGASPARD	Jul 1, 2020 9:16:27 PM	No	
100,000 - B.1 Emergency Platform Release Mechanism	Done		RGASPARD	Jul 1, 2020 9:16:27 PM	No	
200,000 - B.2 Platform Barrier Latch Mechanism	Done		RGASPARD	Jul 1, 2020 9:16:27 PM	No	
300,000 - B.3 Bridgeplate Hinge	Done		RGASPARD	Jul 1, 2020 9:16:27 PM	No	
400,000 - B.4 All Pivot Points	Done		RGASPARD	Jul 1, 2020 9:16:27 PM	No	
500,000 - B.5 Cams and Slots	Done		RGASPARD	Jul 1, 2020 9:16:27 PM	No	
600,000 - B.6 Rollers	Done		RGASPARD	Jul 1, 2020 9:16:27 PM	No	
700,000 - B.7 All Linkages	Done		RGASPARD	Jul 1, 2020 9:16:27 PM	No	

Activity Sub Total

Activity 30 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	0.58
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00

Work Order Footer

Work Order 53560789 Total

Parts:	11.49
--------	-------

	Labor:	0.00
	Labor Hours:	2.30
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	11.49



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 53657732
Invoice No. 55345 - 53657732

Client Department:

Department: 55345M

Work Order Description

check engine light on bus shakes

Requested By: CVERGARA

Created By: CVERGARA

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 221,764 - DH

Chronology

Reported	Jun 29, 2020 1:36:00 PM	Jun 29, 2020 1:36:00 PM
Started	Jun 29, 2020 1:52:00 PM	
Completed	Jun 29, 2020 3:02:00 PM	Jun 29, 2020 3:02:00 PM
Down Time		

Work Order Notes

Line 10 To file warranty be sure to do the following:

- 1) Enter a COMPLAINT statement for each activity.
- 2) Enter CAUSE statement in the Notes field of each activity.
- 3) Enter CORRECTION statement in the Comment section of each activity.

Complaint: Check Engine Light On

Cause: Check computer system found codes for engine misfire and fuel shut off valve relief

Correction: Performed running test no codes came back

Activity Header

Activity: 5 999 TOTAL VEHICLE

Activity Note: Personal Risk Assessment

Reason for Repair: SW Shop Work Order

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: Personal Risk Assessment

Task: PRA and Meter Readings Performed by: JAPEREZ Performed on: 29-JUN-20

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		JAPEREZ	Jun 29, 2020 3:01:47 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		JAPEREZ	Jun 29, 2020 3:01:47 PM	No	
3 - Are you wearing the appropriate PPE?	Done		JAPEREZ	Jun 29, 2020 3:01:47 PM	No	
4 - Have you performed the proper LOTO?	Done		JAPEREZ	Jun 29, 2020 3:01:47 PM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		JAPEREZ	Jun 29, 2020 3:01:47 PM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		JAPEREZ	Jun 29, 2020 3:01:47 PM	No	
20 - Miles			JAPEREZ	Jun 29, 2020 3:01:47 PM	No	
30 - Kilometers			JAPEREZ	Jun 29, 2020 3:01:47 PM	No	
40 - Hours			JAPEREZ	Jun 29, 2020 3:01:47 PM	No	

Activity Sub Total

Activity 5 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 53657732
Invoice No. 55345 - 53657732

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FD4E4FS7EDB17176
check engine light on bus shakes		Ford E450 Champion Challenger	
Requested By:	CVERGARA	Status:	40 - Closed (40)
Created By:	CVERGARA	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	221,764 - DH

Activity Header				
Activity:15 003 INSTRUMENTS, GAUGES, WARNING & SHUT-DOWN DEVICES				
Activity Note:				
Reason for Repair: 05 Inspection, Routine				
Work Accomplished:				
Part Failure:				
Activity Comments:				
Activity Parts				
No Data Available				
Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
29-Jun-20	Perez,Javier	1.05	0	0
Activity Sublet				
No Data Available				
Activity Checklist				
No Data Available				
No Data Available				
Activity Sub Total				
			Activity 15 Sub Total	
			Parts:	0.00
			Labor:	0.00
			Labor Hours:	1.05
			Sublet Parts:	0.00
			Sublet Labor:	0.00
			Activity Sub Total	0.00
Work Order Footer				
			Work Order 53657732 Total	
			Parts:	0.00
			Labor:	0.00
			Labor Hours:	1.05
			Sublet Parts:	0.00
			Sublet Labor:	0.00
			Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 53610354
Invoice No. 55345 - 53610354

Client Department:

Department: 55345M

Work Order Description

Crank No Start

Requested By: AOWENS

Created By: AOWENS

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: -

Driver:

Phone:

ETA:

Meter: 219,394 - DH

Chronology

Reported	Jun 9, 2020 7:45:00 PM	Jun 9, 2020 7:45:00 PM
Started	Jun 9, 2020 9:09:00 PM	
Completed	Jun 10, 2020 12:37:00 AM	Jun 10, 2020 12:37:00 AM
Down Time		

Work Order Notes

Line 10 Bus Crank No Start. Check gauges shown full. Tank Was Empty bleed tank refill. Re set gauge. test drive bus found bus misfire Scan Found # (1) cylinder misfire. replace # (1) spark Plugs & Boot.

Parts# 35-7006 Qty (1)

Parts # AP103. Qty (1)

Activity Header

Activity: 10 999/999/999 TOTAL VEHICLE

Activity Note: PRA

Reason for Repair: SW Shop Work Order

Work Accomplished: 06 Inspect

Part Failure: 00 No Failure

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: PRA

Task: PRA and Meter Readings Performed by: DARTHURS Performed on: 10-JUN-20

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		DARTHURS	Jun 10, 2020 12:21:59 AM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		DARTHURS	Jun 10, 2020 12:21:59 AM	No	
3 - Are you wearing the appropriate PPE?	Done		DARTHURS	Jun 10, 2020 12:21:59 AM	No	
4 - Have you performed the proper LOTO?	Done		DARTHURS	Jun 10, 2020 12:21:59 AM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		DARTHURS	Jun 10, 2020 12:21:59 AM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		DARTHURS	Jun 10, 2020 12:21:59 AM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
20 - Miles			DARTHURS	Jun 10, 2020 12:21:59 AM	No	
30 - Kilometers			DARTHURS	Jun 10, 2020 12:21:59 AM	No	
40 - Hours			DARTHURS	Jun 10, 2020 12:21:59 AM	No	

Activity Sub Total

Activity 10 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 53610354
Invoice No. 55345 - 53610354

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Crank No Start		Ford E450 Champion Challenger	
Requested By:	AOWENS	Status:	40 - Closed (40)
Created By:	AOWENS	Priority:	-
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	219,394 - DH

Activity Header				
Activity:20 079 DEVICES, SAFETY/STABILITY, TRAILER				
Activity Note: VERIFY COMPLAINT (Crank No Start)				
Reason for Repair: 05 Inspection, Routine				
Work Accomplished:				
Part Failure:				
Activity Comments:				
Activity Parts				
No Data Available				
Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
09-Jun-20	Arthurs,Durvin	1.3	0	0
Activity Sublet				
No Data Available				
Activity Checklist				
No Data Available				
No Data Available				
Activity Sub Total				
			Activity 20 Sub Total	
			Parts:	0.00
			Labor:	0.00
			Labor Hours:	1.30
			Sublet Parts:	0.00
			Sublet Labor:	0.00
			Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 53610354
Invoice No. 55345 - 53610354

Client Department:

Department: 55345M

Work Order Description

Crank No Start

Requested By: AOWENS

Created By: AOWENS

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: -

Driver:

Phone:

ETA:

Meter: 219,394 - DH

Activity Header

Activity: 30 040/000/000 ENGINE/MOTOR SYSTEMS GROUP

Activity Note: Replace Spark Plug Cylinder# 1 mis fire

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: 03 Replace New

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
10-Jun-20	357006	BOOT, COIL-ON-PLUG, IGNITION	8	4.36	34.88
10-Jun-20	AP103	PLUG, SPARK	8	3.16	25.28

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
10-Jun-20	Arthurs,Durvin	0.2	0	0
09-Jun-20	Arthurs,Durvin	0.57	0	0

Activity Sublet

No Data Available

Activity Checklist

No Data Available

No Data Available

Activity Sub Total

Activity 30 Sub Total

Parts:	60.16
Labor:	0.00
Labor Hours:	0.77
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	60.16

Work Order Footer

Work Order 53610354 Total

Parts:	60.16
Labor:	0.00
Labor Hours:	2.07
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	60.16



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 53606342
Invoice No. 55345 - 53606342

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
55345 TIRES		Ford E450 Champion Challenger	
Requested By:	NPIERRE-LOUIS	Status:	40 - Closed (40)
Created By:	NPIERRE-LOUIS	Priority:	-
Assigned To:		Driver:	
Class:	-	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	219,394 - DH

Chronology

Reported	Jun 8, 2020 12:01:03 PM	Jun 8, 2020 12:01:03 PM
Started	Jun 8, 2020 12:02:00 PM	
Completed	Jun 8, 2020 12:39:00 PM	Jun 8, 2020 12:39:00 PM
Down Time		

Work Order Notes

Line 10 Complaint: Passenger Side front tire flat

Cause: tire valve was bad

Correction: replaced the tire valve add air to 65 p ,everything was ok at this time

Activity Header

Activity: 10 999/999/999 TOTAL VEHICLE

Activity Note: PERSONAL RISK ASSESMENT

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure: 00 No Failure

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: PERSONAL RISK ASSESMENT

Task: PRA and Meter Readings Performed by: NPIERRE-LOUIS Performed on: 08-JUN-20

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		NPIERRE-LOUIS	Jun 8, 2020 12:37:14 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		NPIERRE-LOUIS	Jun 8, 2020 12:37:14 PM	No	
3 - Are you wearing the appropriate PPE?	Done		NPIERRE-LOUIS	Jun 8, 2020 12:37:14 PM	No	
4 - Have you performed the proper LOTO?	Done		NPIERRE-LOUIS	Jun 8, 2020 12:37:14 PM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		NPIERRE-LOUIS	Jun 8, 2020 12:37:14 PM	No	
10 - Have you successfully completed the Personal	Done		NPIERRE-	Jun 8, 2020	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO	
Risk Assessment?			LOUIS	12:37:14 PM			
20 - Miles			NPIERRE-LOUIS	Jun 8, 2020 12:37:14 PM	No		
30 - Kilometers			NPIERRE-LOUIS	Jun 8, 2020 12:37:14 PM	No		
40 - Hours			NPIERRE-LOUIS	Jun 8, 2020 12:37:14 PM	No		
Activity Sub Total							
				Activity 10 Sub Total			
				Parts:			0.00
				Labor:			0.00
				Labor Hours:			0.00
				Sublet Parts:			0.00
				Sublet Labor:			0.00
				Activity Sub Total			0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 53606342
Invoice No. 55345 - 53606342

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
55345 TIRES		Ford E450 Champion Challenger	
Requested By:	NPIERRE-LOUIS	Status:	40 - Closed (40)
Created By:	NPIERRE-LOUIS	Priority:	-
Assigned To:		Driver:	
Class:	-	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	219,394 - DH

Activity Header				
Activity:20 018/000/000 WHEELS, RIMS, HUBS AND BEARINGS				
Activity Note: Flat front tire				
Reason for Repair:		08 Preventive Maintenance		
Work Accomplished:		03 Replace New		
Part Failure:		99 Replaced Before Failure		
Activity Comments:				
Activity Parts				
No Data Available				
Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
08-Jun-20	NELSON PIERRE-LOUIS	0.62	0	0
Activity Sublet				
No Data Available				
Activity Checklist				
No Data Available				
No Data Available				
Activity Sub Total				
			Activity 20 Sub Total	
			Parts:	0.00
			Labor:	0.00
			Labor Hours:	0.62
			Sublet Parts:	0.00
			Sublet Labor:	0.00
			Activity Sub Total	0.00
Work Order Footer				
			Work Order 53606342 Total	
			Parts:	0.00
			Labor:	0.00
			Labor Hours:	0.62
			Sublet Parts:	0.00
			Sublet Labor:	0.00
			Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 53566015
Invoice No. 55345 - 53566015

Client Department:

Department: 55345M
Work Order Description
Front Air Conditioning System
Requested By: RAURODRIGUEZ
Created By: RAURODRIGUEZ
Assigned To:
Class: -
Arrangement: Unassigned
Potential Warranty: No

Equipment No.: 4514-P
VIN: 1FDFE4FS7EDB17176
Ford E450 Champion Challenger
Status: 40 - Closed (40)
Priority: -
Driver:
Phone:
ETA:
Meter: 217,522 - DH

Chronology

Reported	May 21, 2020 7:14:13 AM	May 21, 2020 7:14:13 AM
Started	May 21, 2020 12:00:00 AM	
Completed	May 21, 2020 9:16:00 AM	May 21, 2020 9:16:00 AM
Down Time		

Work Order Notes

Line 10 Complaint. Front ac is blowing hot air

Cause. Low Freon

Correction. Recovery,vacuum, leak test passed, add 2 Oz pag and 1.88 pounds Freon, system tested about 30 min., all okay at this time.

Activity Header

Activity: 10 999/999/999 TOTAL VEHICLE
Activity Note: PERSONAL RISK ASSESMENT
Reason for Repair: 05 Inspection, Routine
Work Accomplished: 06 Inspect
Part Failure: 00 No Failure
Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: PERSONAL RISK ASSESMENT

Task: PRA and Meter Readings Performed by: RAURODRIGUEZ Performed on: 21-MAY-20

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		RAURODRIGUEZ	May 21, 2020 9:09:17 AM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		RAURODRIGUEZ	May 21, 2020 9:09:17 AM	No	
3 - Are you wearing the appropriate PPE?	Done		RAURODRIGUEZ	May 21, 2020 9:09:17 AM	No	
4 - Have you performed the proper LOTO?	Done		RAURODRIGUEZ	May 21, 2020 9:09:17 AM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		RAURODRIGUEZ	May 21, 2020 9:09:17 AM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		RAUODRIGUEZ	May 21, 2020 9:09:17 AM	No	
20 - Miles			RAUODRIGUEZ	May 21, 2020 9:09:17 AM	No	
30 - Kilometers			RAUODRIGUEZ	May 21, 2020 9:09:17 AM	No	
40 - Hours			RAUODRIGUEZ	May 21, 2020 9:09:17 AM	No	

Activity Sub Total

Activity 10 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 53566015
Invoice No. 55345 - 53566015

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Front Air Conditioning System		Ford E450 Champion Challenger	
Requested By:	RAURODRIGUEZ	Status:	40 - Closed (40)
Created By:	RAURODRIGUEZ	Priority:	-
Assigned To:		Driver:	
Class:	-	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	217,522 - DH

Activity Header
Activity:20 001/000/000 AIR CONDITIONING, HEATING AND VENTILATION
Activity Note:
Reason for Repair: 04 Driver's Report
Work Accomplished: 03 Replace New
Part Failure:
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
21-May-20	3411885	TUBE, ORIFICE, A/C, FORD	1	0.75	0.75

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
21-May-20	Rodriguez,Raul	1.9666666	0	0

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available

Activity Sub Total	
Activity 20 Sub Total	
Parts:	0.75
Labor:	0.00
Labor Hours:	1.97
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.75

Work Order Footer	
Work Order 53566015 Total	
Parts:	0.75
Labor:	0.00
Labor Hours:	1.97
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.75



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 53559585
Invoice No. 55345 - 53559585

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Rear A/C service			Ford E450 Champion Challenger
Requested By:	HPIERRE	Status:	40 - Closed (40)
Created By:	HPIERRE	Priority:	2 - Medium
Assigned To:		Driver:	
Class:	-	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	217,303 - DH

Chronology

Reported	May 19, 2020 8:27:50 AM	May 19, 2020 8:27:50 AM
Started	May 19, 2020 8:28:00 AM	
Completed	May 19, 2020 1:31:00 PM	May 19, 2020 1:31:00 PM
Down Time		

Work Order Notes

Line 10 Rear A/C service

Preventive maintenance

Perform rear A/C service completed

Activity Header						
Activity: 10 999/999/999 TOTAL VEHICLE						
Activity Note:						
Reason for Repair:		SW Shop Work Order				
Work Accomplished:		06 Inspect				
Part Failure:		00 No Failure				
Activity Comments:						
Activity Parts						
No Data Available						
Activity Labor						
No Data Available						
Activity Sublet						
No Data Available						
Activity Checklist						
Check List						
10 Desc:						
Task: PRA and Meter Readings Performed by: HPIERRE Performed on: 19-MAY-20						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		HPIERRE	May 19, 2020 12:07:25 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		HPIERRE	May 19, 2020 12:07:25 PM	No	
3 - Are you wearing the appropriate PPE?	Done		HPIERRE	May 19, 2020 12:07:25 PM	No	
4 - Have you performed the proper LOTO?	Done		HPIERRE	May 19, 2020 12:07:25 PM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		HPIERRE	May 19, 2020 12:07:25 PM	No	
10 - Have you successfully completed the Personal	Done		HPIERRE	May 19, 2020	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
Risk Assessment?				12:07:25 PM		
20 - Miles			HPIERRE	May 19, 2020 12:07:25 PM	No	
30 - Kilometers	12		HPIERRE	May 19, 2020 12:07:25 PM	No	
40 - Hours	4		HPIERRE	May 19, 2020 12:07:25 PM	No	
Activity Sub Total						
				Activity 10 Sub Total		
				Parts:		0.00
				Labor:		0.00
				Labor Hours:		0.00
				Sublet Parts:		0.00
				Sublet Labor:		0.00
				Activity Sub Total		0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 53559585
Invoice No. 55345 - 53559585

Client Department:		Equipment No.:	4514-P
Department:	55345M	VIN:	1FDFE4FS7EDB17176
Work Order Description			Ford E450 Champion Challenger
Rear A/C service		Status:	40 - Closed (40)
Requested By:	HPIERRE	Priority:	2 - Medium
Created By:	HPIERRE	Driver:	
Assigned To:		Phone:	
Class:	-	ETA:	
Arrangement:	Unassigned	Meter:	217,303 - DH
Potential Warranty:	No		

Activity Header
Activity:20 050 GROUP, ACCESSORIES
Activity Note:
Reason for Repair: 08 Preventive Maintenance
Work Accomplished:
Part Failure:
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
19-May-20	3411885	TUBE, ORIFICE, A/C, FORD	1	0.75	0.75

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
19-May-20	Pierre,Hubert J	5.05	0	0

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available

Activity Sub Total	
	Activity 20 Sub Total
Parts:	0.75
Labor:	0.00
Labor Hours:	5.05
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.75

Work Order Footer	
	Work Order 53559585 Total
Parts:	0.75
Labor:	0.00
Labor Hours:	5.05
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.75



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 4



Work Order No. 53558498
Invoice No. 55345 - 53558498

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
55345-LIGHT DUTY PMB		Ford E450 Champion Challenger	
Requested By:	NSTOLFO	Status:	99 - Cancelled (99)
Created By:	NSTOLFO	Priority:	3 - High
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	217,522 - DH

Chronology		
Reported	May 19, 2020 12:00:00 AM	May 19, 2020 12:00:00 AM
Started		
Completed	May 19, 2020 1:15:25 PM	May 19, 2020 1:15:25 PM
Down Time		

Work Order Notes

Line 10 COMPLAINT:

CAUSE:

CORRECTION:

Activity Header							
Activity: 5 999/999/999 TOTAL VEHICLE							
Activity Note: PERSONAL RISK ASSESSMENT							
Reason for Repair: SW Shop Work Order							
Work Accomplished: 06 Inspect							
Part Failure: 00 No Failure							
Activity Comments:							
Activity Parts							
No Data Available							
Activity Labor							
No Data Available							
Activity Sublet							
No Data Available							
Activity Checklist							
Check List							
5 Desc: PERSONAL RISK ASSESSMENT							
Task: PRA and Meter Readings Performed by: Performed on:							
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO	
1 - Are you properly trained to perform the task?	-				No		
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	-				No		
3 - Are you wearing the appropriate PPE?	-				No		
4 - Have you performed the proper LOTO?	-				No		
5 - Are you aware of the potential risks of performing this repair?	-				No		
10 - Have you successfully completed the Personal Risk Assessment?	-				No		
20 - Miles					No		

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO	
30 - Kilometers					No		
40 - Hours					No		
Activity Sub Total							
				Activity 5 Sub Total			
				Parts:			0.00
				Labor:			0.00
				Labor Hours:			0.00
				Sublet Parts:			0.00
				Sublet Labor:			0.00
				Activity Sub Total			0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 4



Work Order No. 53558498
Invoice No. 55345 - 53558498

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
55345-LIGHT DUTY PMB		Ford E450 Champion Challenger	
Requested By:	NSTOLFO	Status:	99 - Cancelled (99)
Created By:	NSTOLFO	Priority:	3 - High
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	217,522 - DH

Activity Header

Activity:20 999 TOTAL VEHICLE

Activity Note: PM B

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: B PM Level B

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

20 Desc: PM B

Task: PM B SERVICE Performed by: Performed on:

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
100,000 - "A" PMI SERVICING ITEMS	-				No	
101,000 - FRA Change Oil Filters	No				No	
102,000 - FRA Drain Engine Oil	No				No	
103,000 - FRA Check Transmission Fluid	-				No	
104,000 - Lubricate Chassis	-				No	
105,000 - Replace or Clean A/C Filters	-				No	
107,000 - FRA Change Primary Fuel Filter	No				No	
108,000 - Lube all pivoting Mechanisms	-				No	
200,000 - "B" PMI SERVICING ITEMS (12 MONTH)	-				No	
201,000 - Service Crankcase Breather	-				No	
203,000 - FRA Change Automatic Transmission Fluid	No				No	
204,000 - FRA Change Power Steering Fluid and Filter	No				No	
205,000 - Complete Engine Diagnostics and Clear Codes when Completed	-				No	

Activity Sub Total

Activity 20 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	0.00

	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 4 of 4



Work Order No. 53558498
Invoice No. 55345 - 53558498


Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FD4E4FS7EDB17176
55345-LIGHT DUTY PMB		Ford E450 Champion Challenger	
Requested By:	NSTOLFO	Status:	99 - Cancelled (99)
Created By:	NSTOLFO	Priority:	3 - High
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	217,522 - DH

Activity Header															
Activity:30 068/003/000 SYSTEM, HYDRAULIC, LIFTING/UNLOADING															
Activity Note: 55345-W/C LIFT INSPECTION															
Reason for Repair:	05 Inspection, Routine														
Work Accomplished:	03 Replace New														
Part Failure:															
Activity Comments:															
Activity Parts															
No Data Available															
Activity Labor															
No Data Available															
Activity Sublet															
No Data Available															
Activity Checklist															
No Data Available															
No Data Available															
Activity Sub Total															
<table><tr><td colspan="2">Activity 30 Sub Total</td></tr><tr><td>Parts:</td><td>0.00</td></tr><tr><td>Labor:</td><td>0.00</td></tr><tr><td>Labor Hours:</td><td>0.00</td></tr><tr><td>Sublet Parts:</td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td>0.00</td></tr></table>		Activity 30 Sub Total		Parts:	0.00	Labor:	0.00	Labor Hours:	0.00	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	0.00
Activity 30 Sub Total															
Parts:	0.00														
Labor:	0.00														
Labor Hours:	0.00														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	0.00														
Work Order Footer															
<table><tr><td colspan="2">Work Order 53558498 Total</td></tr><tr><td>Parts:</td><td>0.00</td></tr><tr><td>Labor:</td><td>0.00</td></tr><tr><td>Labor Hours:</td><td>0.00</td></tr><tr><td>Sublet Parts:</td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td>0.00</td></tr></table>		Work Order 53558498 Total		Parts:	0.00	Labor:	0.00	Labor Hours:	0.00	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	0.00
Work Order 53558498 Total															
Parts:	0.00														
Labor:	0.00														
Labor Hours:	0.00														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	0.00														



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 53451043
Invoice No. 55345 - 53451043

Client Department:

Department: 55345M

Work Order Description

PM B

Requested By: NPIERRE-LOUIS

Created By: NPIERRE-LOUIS

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 217,303 - DH

Chronology

Reported	May 18, 2020 11:44:11 AM	May 18, 2020 11:44:11 AM
Started	May 19, 2020 6:06:00 AM	
Completed	May 19, 2020 8:27:00 AM	May 19, 2020 8:27:00 AM
Down Time		

Work Order Notes

Line 10 COMPLAINT: PMB

CAUSE: preventive maintenance

CORRECTION: Performed PMB service lube all pivoting point cross rotate tires completed

Activity Header

Activity: 5 999/999/999 TOTAL VEHICLE

Activity Note: PERSONAL RISK ASSESSMENT

Reason for Repair: SW Shop Work Order

Work Accomplished: 06 Inspect

Part Failure: 00 No Failure

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: PERSONAL RISK ASSESSMENT

Task: PRA and Meter Readings Performed by: HPIERRE Performed on: 19-MAY-20

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		HPIERRE	May 19, 2020 8:12:37 AM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		HPIERRE	May 19, 2020 8:12:37 AM	No	
3 - Are you wearing the appropriate PPE?	Done		HPIERRE	May 19, 2020 8:12:37 AM	No	
4 - Have you performed the proper LOTO?	Done		HPIERRE	May 19, 2020 8:12:37 AM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		HPIERRE	May 19, 2020 8:12:37 AM	No	
10 - Have you successfully completed the Personal	Done		HPIERRE	May 19, 2020	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO	
Risk Assessment?				8:12:37 AM			
20 - Miles			HPIERRE	May 19, 2020 8:12:37 AM	No		
30 - Kilometers	12		HPIERRE	May 19, 2020 8:12:37 AM	No		
40 - Hours	4		HPIERRE	May 19, 2020 8:12:37 AM	No		
Activity Sub Total							
				Activity 5 Sub Total			
				Parts:			0.00
				Labor:			0.00
				Labor Hours:			0.00
				Sublet Parts:			0.00
				Sublet Labor:			0.00
				Activity Sub Total			0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 53451043
Invoice No. 55345 - 53451043


Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
PM B		Ford E450 Champion Challenger	
Requested By:	NPIERRE-LOUIS	Status:	40 - Closed (40)
Created By:	NPIERRE-LOUIS	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	217,303 - DH

Activity Header	
Activity:10 999/999/999 TOTAL VEHICLE	
Activity Note: Light Duty PMI	
Reason for Repair: 08 Preventive Maintenance	
Work Accomplished:	
Part Failure:	
Activity Comments:	
Activity Parts	
No Data Available	
Activity Labor	
No Data Available	
Activity Sublet	
No Data Available	
Activity Checklist	
No Data Available	
No Data Available	
Activity Sub Total	
Activity 10 Sub Total Parts: 0.00 Labor: 0.00 Labor Hours: 0.00 Sublet Parts: 0.00 Sublet Labor: 0.00 Activity Sub Total 0.00	



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 53451043
Invoice No. 55345 - 53451043

Client Department:

Department: 55345M

Work Order Description

PM B

Requested By: NPIERRE-LOUIS

Created By: NPIERRE-LOUIS

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 217,303 - DH

Activity Header

Activity: 20 999 TOTAL VEHICLE

Activity Note: PM B

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: B PM Level B

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
19-May-20	B329(F)	GOING OUT OF SERVICE SEE BALDWIN B329 IN THE FLEET ORG. FILTER, OIL, SPIN-ON	1	1.96	1.96

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
19-May-20	Pierre,Hubert J	2.35	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List						
20 Desc: PM B						
Task: PM B SERVICE Performed by: HPIERRE Performed on: 19-MAY-20						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
100,000 - "A" PMI SERVICING ITEMS	Done		HPIERRE	May 19, 2020 8:11:17 AM	No	
101,000 - FRA Change Oil Filters	Yes		HPIERRE	May 19, 2020 8:11:17 AM	No	
102,000 - FRA Drain Engine Oil	Yes		HPIERRE	May 19, 2020 8:11:17 AM	No	
103,000 - FRA Check Transmission Fluid	Done		HPIERRE	May 19, 2020 8:11:17 AM	No	
104,000 - Lubricate Chassis	Done		HPIERRE	May 19, 2020 8:11:17 AM	No	
105,000 - Replace or Clean A/C Filters	Done		HPIERRE	May 19, 2020 8:11:17 AM	No	
107,000 - FRA Change Primary Fuel Filter	No	N/A	HPIERRE	May 19, 2020 8:11:17 AM	No	
108,000 - Lube all pivoting Mechanisms	Done		HPIERRE	May 19, 2020 8:11:17 AM	No	
200,000 - "B" PMI SERVICING ITEMS (12 MONTH)	Done		HPIERRE	May 19, 2020	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
				8:11:17 AM		
201,000 - Service Crankcase Breather	Done		HPIERRE	May 19, 2020 8:11:17 AM	No	
203,000 - FRA Change Automatic Transmission Fluid	No		HPIERRE	May 19, 2020 8:11:17 AM	No	
204,000 - FRA Change Power Steering Fluid and Filter	No		HPIERRE	May 19, 2020 8:11:17 AM	No	
205,000 - Complete Engine Diagnostics and Clear Codes when Completed	Done		HPIERRE	May 19, 2020 8:11:17 AM	No	

Activity Sub Total

Activity 20 Sub Total

Parts:	1.96
Labor:	0.00
Labor Hours:	2.35
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	1.96


Work Order Footer

Work Order 53451043 Total

Parts:	1.96
Labor:	0.00
Labor Hours:	2.35
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	1.96



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 53545753
Invoice No. 55345 - 53545753

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Wheelchair Lift		Ford E450 Champion Challenger	
Requested By:	RAUODRIGUEZ	Status:	40 - Closed (40)
Created By:	RAUODRIGUEZ	Priority:	-
Assigned To:		Driver:	
Class:	-	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	216,865 - DH

Chronology

Reported	May 13, 2020 9:19:34 AM	May 13, 2020 9:19:34 AM
Started	May 13, 2020 9:28:00 AM	
Completed	May 14, 2020 5:47:00 AM	May 14, 2020 5:47:00 AM
Down Time		

Work Order Notes

Line 10 Complaint. W/Chair lift isn't working properly

Cause. Lost power

Correction. Replaced bad connector, all okay at this time.

Activity Header

Activity: 10 999/999/999 TOTAL VEHICLE
Activity Note: PERSONAL RISK ASSESMENT
Reason for Repair: 05 Inspection, Routine
Work Accomplished: 06 Inspect
Part Failure: 00 No Failure
Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: PERSONAL RISK ASSESMENT

Task: PRA and Meter Readings Performed by: RAUODRIGUEZ Performed on: 13-MAY-20

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		RAUODRIGUEZ	May 13, 2020 9:20:51 AM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		RAUODRIGUEZ	May 13, 2020 9:20:51 AM	No	
3 - Are you wearing the appropriate PPE?	Done		RAUODRIGUEZ	May 13, 2020 9:20:51 AM	No	
4 - Have you performed the proper LOTO?	Done		RAUODRIGUEZ	May 13, 2020 9:20:51 AM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		RAUODRIGUEZ	May 13, 2020 9:20:51 AM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		RAUODRIGUEZ	May 13, 2020 9:20:51 AM	No	
20 - Miles			RAUODRIGUEZ	May 13, 2020 9:20:51 AM	No	
30 - Kilometers			RAUODRIGUEZ	May 13, 2020 9:20:51 AM	No	
40 - Hours			RAUODRIGUEZ	May 13, 2020 9:20:51 AM	No	

Activity Sub Total

Activity 10 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 53545753
Invoice No. 55345 - 53545753

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Wheelchair Lift		Ford E450 Champion Challenger	
Requested By:	RAURODRIGUEZ	Status:	40 - Closed (40)
Created By:	RAURODRIGUEZ	Priority:	-
Assigned To:		Driver:	
Class:	-	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	216,865 - DH

Activity Header
Activity:20 068/003/000 SYSTEM, HYDRAULIC, LIFTING/UNLOADING
Activity Note: WheelChair Lift
Reason for Repair: 05 Inspection, Routine
Work Accomplished: 03 Replace New
Part Failure:
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
13-May-20	33659KS	PENDANT, CONTROL, W/C, BRAUN	1	201.13	201.13

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
13-May-20	Rodriguez,Raul	3.77	0	0

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available

Activity Sub Total		Activity 20 Sub Total	
Parts:	201.13	Labor:	0.00
Labor Hours:	3.77	Labor Parts:	0.00
Sublet Parts:	0.00	Sublet Labor:	0.00
Sublet Labor:	0.00	Activity Sub Total	201.13

Work Order Footer		Work Order 53545753 Total	
Parts:	201.13	Labor:	0.00
Labor Hours:	3.77	Labor Parts:	0.00
Sublet Parts:	0.00	Sublet Labor:	0.00
Sublet Labor:	0.00	Activity Sub Total	201.13



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 53340899
Invoice No. 55345 - 53340899

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
PM A		Ford E450 Champion Challenger	
Requested By:	VAMRITTEEMAL	Status:	40 - Closed (40)
Created By:	VAMRITTEEMAL	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	213,257 - DH

Chronology		
Reported	Apr 3, 2020 10:35:09 AM	Apr 3, 2020 10:35:09 AM
Started	Apr 5, 2020 9:05:00 AM	
Completed	Apr 5, 2020 1:28:00 PM	Apr 5, 2020 1:28:00 PM
Down Time		

Work Order Notes

Line 10 COMPLAINT: pmA service

CAUSE: preventive maintenance

CORRECTION: perform pmA service and lube all Pivoting Points

Activity Header				
Activity:10 999/999/999 TOTAL VEHICLE				
Activity Note: Light Duty PMI				
Reason for Repair: 08 Preventive Maintenance				
Work Accomplished:				
Part Failure:				
Activity Comments:				
Activity Parts				
No Data Available				
Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
05-Apr-20	NELSON PIERRE-LOUIS	2.03	0	0
Activity Sublet				
No Data Available				
Activity Checklist				
No Data Available				
No Data Available				
Activity Sub Total				
			Activity 10 Sub Total	
			Parts:	0.00
			Labor:	0.00
			Labor Hours:	2.03
			Sublet Parts:	0.00
			Sublet Labor:	0.00
			Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 53340899
Invoice No. 55345 - 53340899

Client Department:

Department: 55345M

Work Order Description

PM A

Requested By: VAMRITTEEMAL

Created By: VAMRITTEEMAL

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 213,257 - DH

Activity Header

Activity: 20 999 TOTAL VEHICLE

Activity Note: PM A

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: A PM Level A

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
05-Apr-20	B329(F)	GOING OUT OF SERVICE SEE BALDWIN B329 IN THE FLEET ORG. FILTER, OIL, SPIN-ON	1	1.96	1.96

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List						
20 Desc: PM A						
Task: PM A SERVICE Performed by: NPIERRE-LOUIS Performed on: 05-APR-20						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
100,000 - "A" PMI SERVICING ITEMS	Done		NPIERRE-LOUIS	Apr 5, 2020 11:17:12 AM	No	
101,000 - FRA Change Oil Filters	Yes		NPIERRE-LOUIS	Apr 5, 2020 11:17:12 AM	No	
102,000 - FRA Drain Engine Oil	Yes		NPIERRE-LOUIS	Apr 5, 2020 11:17:12 AM	No	
103,000 - FRA Check Transmission Fluid	Done		NPIERRE-LOUIS	Apr 5, 2020 11:17:12 AM	No	
104,000 - Lubricate Chassis	Done		NPIERRE-LOUIS	Apr 5, 2020 11:17:12 AM	No	
105,000 - Replace or Clean A/C Filters	Done		NPIERRE-LOUIS	Apr 5, 2020 11:17:12 AM	No	
107,000 - FRA Change Primary Fuel Filter	Yes		NPIERRE-LOUIS	Apr 5, 2020 11:17:12 AM	No	
108,000 - Lube all pivoting Mechanisms	Done		NPIERRE-LOUIS	Apr 5, 2020 11:17:12 AM	No	

Activity Sub Total

Activity 20 Sub Total
Parts: 1.96

	Labor:	0.00
	Labor Hours:	0.00
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	1.96



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 53340899
Invoice No. 55345 - 53340899

Client Department:

Department: 55345M

Work Order Description

PM A

Requested By: VAMRITTEEMAL

Created By: VAMRITTEEMAL

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 213,257 - DH

Activity Header

Activity: 30 999 TOTAL VEHICLE

Activity Note: PRAMETER

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

30 Desc: PRAMETER

Task: PRA and Meter Readings Performed by: NPIERRE-LOUIS Performed on: 05-APR-20

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		NPIERRE-LOUIS	Apr 5, 2020 11:10:08 AM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		NPIERRE-LOUIS	Apr 5, 2020 11:10:08 AM	No	
3 - Are you wearing the appropriate PPE?	Done		NPIERRE-LOUIS	Apr 5, 2020 11:10:08 AM	No	
4 - Have you performed the proper LOTO?	Done		NPIERRE-LOUIS	Apr 5, 2020 11:10:08 AM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		NPIERRE-LOUIS	Apr 5, 2020 11:10:08 AM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		NPIERRE-LOUIS	Apr 5, 2020 11:10:08 AM	No	
20 - Miles			NPIERRE-LOUIS	Apr 5, 2020 11:10:08 AM	No	
30 - Kilometers			NPIERRE-LOUIS	Apr 5, 2020 11:10:08 AM	No	
40 - Hours			NPIERRE-LOUIS	Apr 5, 2020 11:10:08 AM	No	

Activity Sub Total

Activity 30 Sub Total

Parts: 0.00

Labor: 0.00

	Labor Hours:	0.00
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	0.00
Work Order Footer		
	Work Order 53340899 Total	
	Parts:	1.96
	Labor:	0.00
	Labor Hours:	2.03
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	1.96



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 53424556
Invoice No. 55345 - 53424556

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Check Engine Light On		Ford E450 Champion Challenger	
Requested By:	DARTHURS	Status:	40 - Closed (40)
Created By:	DARTHURS	Priority:	2 - Medium
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	212,725 - DH

Chronology		
Reported	Mar 27, 2020 4:06:14 PM	Mar 27, 2020 4:06:14 PM
Started	Mar 27, 2020 5:01:00 PM	
Completed	Mar 27, 2020 11:50:00 PM	Mar 27, 2020 11:50:00 PM
Down Time		

Work Order Notes

- Line 10 To file warranty be sure to do the following:
- 1) Enter a COMPLAINT statement for each activity.
 - 2) Enter CAUSE statement in the Notes field of each activity.
 - 3) Enter CORRECTION statement in the Comment section of each activity.

Complaint: Oil Leak / Check Engine Light On

Cause: No Oil leaks found Check Engine Light scan Code PO 713 tranny fluid temp sensor.

Correction: Remove & Replace Transmissions temperature Sensor & harness. & Refill (9) Qt ATF Fluid.
Parts # 4C3Z-7G276-AA Qty (1)
Parts #20021 Qty (1)
Parts# 8C3Z-7C155-A Qty (1)
Parts# BC3Z-7H141-A Qty(1)

Activity Header
Activity: 5 999 TOTAL VEHICLE
Activity Note: Personal Risk Assessment
Reason for Repair: SW Shop Work Order
Work Accomplished: 06 Inspect
Part Failure:
Activity Comments:
Activity Parts
No Data Available
Activity Labor
No Data Available
Activity Sublet
No Data Available
Activity Checklist
Check List
5 Desc: Personal Risk Assessment Task: PRA and Meter Readings Performed by: DARTHURS Performed on: 27-MAR-20

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		DARTHURS	Mar 27, 2020 5:02:45 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		DARTHURS	Mar 27, 2020 5:02:45 PM	No	
3 - Are you wearing the appropriate PPE?	Done		DARTHURS	Mar 27, 2020 5:02:45 PM	No	
4 - Have you performed the proper LOTO?	Done		DARTHURS	Mar 27, 2020 5:02:45 PM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		DARTHURS	Mar 27, 2020 5:02:45 PM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		DARTHURS	Mar 27, 2020 5:02:45 PM	No	
20 - Miles			DARTHURS	Mar 27, 2020 5:02:45 PM	No	
30 - Kilometers			DARTHURS	Mar 27, 2020 5:02:45 PM	No	
40 - Hours			DARTHURS	Mar 27, 2020 5:02:45 PM	No	

Activity Sub Total

Activity 5 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 53424556
Invoice No. 55345 - 53424556

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Check Engine Light On		Ford E450 Champion Challenger	
Requested By:	DARTHURS	Status:	40 - Closed (40)
Created By:	DARTHURS	Priority:	2 - Medium
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	212,725 - DH

Activity Header
Activity:15 079 DEVICES, SAFETY/STABILITY, TRAILER
Activity Note: Replace temperature harness/ Sensor
Reason for Repair: 05 Inspection, Routine
Work Accomplished:
Part Failure:
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
27-Mar-20	4C3Z-7G276-AA	HARNESS, SOLENOID, INTERNAL, TRANSMISSION, 5R110W	1	123.52	123.52
27-Mar-20	8C3Z-7C155-A	GASKET, BODY, VALVE, TRANSMISSION, 5R110	1	6.87	6.87
27-Mar-20	BC3Z-7H141-A	SENSOR, TEMPERATURE, TRANSMISSION	1	9.99	9.99

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
27-Mar-20	Arthurs,Durvin	2	0	0

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available

Activity Sub Total		Activity 15 Sub Total	
Parts:			140.38
Labor:			0.00
Labor Hours:			2.00
Sublet Parts:			0.00
Sublet Labor:			0.00
Activity Sub Total			140.38

Work Order Footer		Work Order 53424556 Total	
Parts:			140.38
Labor:			0.00
Labor Hours:			2.00
Sublet Parts:			0.00
Sublet Labor:			0.00
Activity Sub Total			140.38



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 53411854
Invoice No. 55345 - 53411854

Client Department:

Department: 55345M

Work Order Description

Road Call (bus not start)

Requested By: AOWENS

Created By: AOWENS

Assigned To:

Class: WORC - WORK ORDER ROAD CALL

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 3 - High

Driver:

Phone:

ETA:

Meter: 212,291 - DH

Chronology

Reported	Mar 24, 2020 8:46:00 PM	Mar 24, 2020 8:46:00 PM
Started	Mar 24, 2020 8:48:00 PM	
Completed	Mar 24, 2020 9:40:00 PM	Mar 24, 2020 9:40:00 PM
Down Time		

Work Order Notes

Line 10 To file warranty be sure to do the following:

- 1) Enter a COMPLAINT statement for each activity.
- 2) Enter CAUSE statement in the Notes field of each activity.
- 3) Enter CORRECTION statement in the Comment section of each activity.

Complaint:

Cause:

Correction:

Activity Header						
Activity: 5 999 TOTAL VEHICLE						
Activity Note: PRAMETER						
Reason for Repair: SW Shop Work Order						
Work Accomplished: 06 Inspect						
Part Failure:						
Activity Comments:						
Activity Parts						
No Data Available						
Activity Labor						
No Data Available						
Activity Sublet						
No Data Available						
Activity Checklist						
Check List						
5 Desc: PRAMETER						
Task: PRA and Meter Readings Performed by: RGASPARD Performed on: 24-MAR-20						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		RGASPARD	Mar 24, 2020 9:38:44 PM	No	
2 - If task requires lifting, are lifts secured, are jack	Done		RGASPARD	Mar 24, 2020	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
stands used correctly?				9:38:44 PM		
3 - Are you wearing the appropriate PPE?	Done		RGASPARD	Mar 24, 2020 9:38:44 PM	No	
4 - Have you performed the proper LOTO?	Done		RGASPARD	Mar 24, 2020 9:38:44 PM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		RGASPARD	Mar 24, 2020 9:38:44 PM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		RGASPARD	Mar 24, 2020 9:38:44 PM	No	
20 - Miles			RGASPARD	Mar 24, 2020 9:38:44 PM	No	
30 - Kilometers			RGASPARD	Mar 24, 2020 9:38:44 PM	No	
40 - Hours			RGASPARD	Mar 24, 2020 9:38:44 PM	No	

Activity Sub Total

Activity 5 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 53411854
Invoice No. 55345 - 53411854

Client Department:

Department: 55345M

Work Order Description

Road Call (bus not start)

Requested By: AOWENS

Created By: AOWENS

Assigned To:

Class: WORC - WORK ORDER ROAD CALL

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 3 - High

Driver:

Phone:

ETA:

Meter: 212,291 - DH

Activity Header

Activity: 10 999 TOTAL VEHICLE

Activity Note: ROAD CALL(BUS NOT STARTING)

Reason for Repair: 10 Road Call

Work Accomplished:

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
24-Mar-20	Gaspard,Ronald	0.87	0	0

Activity Sublet

No Data Available

Activity Checklist

No Data Available

No Data Available

Activity Sub Total

Activity 10 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	0.87
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00


Work Order Footer

Work Order 53411854 Total

Parts:	0.00
Labor:	0.00
Labor Hours:	0.87
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 53356565
Invoice No. 55345 - 53356565

Client Department:

Department: 55345M

Work Order Description

Interior stanchion bracket.

Requested By: EARJOHNSON

Created By: EARJOHNSON

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 2 - Medium

Driver:

Phone:

ETA:

Meter: 209,905 - DH

Chronology

Reported	Mar 6, 2020 12:11:14 AM	Mar 6, 2020 12:11:14 AM
Started	Mar 6, 2020 12:16:00 AM	
Completed	Mar 6, 2020 12:20:00 AM	Mar 6, 2020 12:20:00 AM
Down Time		

Work Order Notes

Line 10 To file warranty be sure to do the following:

- 1) Enter a COMPLAINT statement for each activity.
- 2) Enter CAUSE statement in the Notes field of each activity.
- 3) Enter CORRECTION statement in the Comment section of each activity.

Complaint: Interior stanchion bracket.

Cause: Wear and tear.

Correction: Resecured bracket with new screw.

Activity Header

Activity: 5 999 TOTAL VEHICLE

Activity Note: Personal Risk Assessment

Reason for Repair: SW Shop Work Order

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: Personal Risk Assessment

Task: PRA and Meter Readings Performed by: EARJOHNSON Performed on: 06-MAR-20

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		EARJOHNSON	Mar 6, 2020 12:19:34 AM	No	
2 - If task requires lifting, are lifts secured, are	Done		EARJOHNSON	Mar 6, 2020	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
jack stands used correctly?				12:19:34 AM		
3 - Are you wearing the appropriate PPE?	Done		EARJOHNSON	Mar 6, 2020 12:19:34 AM	No	
4 - Have you performed the proper LOTO?	Done		EARJOHNSON	Mar 6, 2020 12:19:34 AM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		EARJOHNSON	Mar 6, 2020 12:19:34 AM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		EARJOHNSON	Mar 6, 2020 12:19:34 AM	No	
20 - Miles			EARJOHNSON	Mar 6, 2020 12:19:34 AM	No	
30 - Kilometers			EARJOHNSON	Mar 6, 2020 12:19:34 AM	No	
40 - Hours			EARJOHNSON	Mar 6, 2020 12:19:34 AM	No	

Activity Sub Total

Activity 5 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 53356565
Invoice No. 55345 - 53356565


Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Interior stanchion bracket.		Ford E450 Champion Challenger	
Requested By:	EARJOHNSON	Status:	40 - Closed (40)
Created By:	EARJOHNSON	Priority:	2 - Medium
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	209,905 - DH

Activity Header				
Activity: 15 079 DEVICES, SAFETY/STABILITY, TRAILER				
Activity Note: Interior bracket.				
Reason for Repair: FW Follow Up				
Work Accomplished:				
Part Failure:				
Activity Comments:				
Activity Parts				
No Data Available				
Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
06-Mar-20	Earl Johnson	0.02	0	0
Activity Sublet				
No Data Available				
Activity Checklist				
No Data Available				
No Data Available				
Activity Sub Total				
			Activity 15 Sub Total	
			Parts:	0.00
			Labor:	0.00
			Labor Hours:	0.02
			Sublet Parts:	0.00
			Sublet Labor:	0.00
			Activity Sub Total	0.00
Work Order Footer				
			Work Order 53356565 Total	
			Parts:	0.00
			Labor:	0.00
			Labor Hours:	0.02
			Sublet Parts:	0.00
			Sublet Labor:	0.00
			Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 53249837
Invoice No. 55345 - 53249837

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
PM A		Ford E450 Champion Challenger	
Requested By:	VAMRITTEEMAL	Status:	40 - Closed (40)
Created By:	VAMRITTEEMAL	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	209,349 - DH

Chronology		
Reported	Mar 2, 2020 10:27:53 AM	Mar 2, 2020 10:27:53 AM
Started	Mar 2, 2020 12:00:00 AM	
Completed	Mar 2, 2020 12:12:00 PM	Mar 2, 2020 12:12:00 PM
Down Time		

Work Order Notes

Line 10 COMPLAINT: PMA SERVICE


CAUSE: PREVENTIVE MAINTENANCE

CORRECTION: PERFORM AND COMPLETED PMA SERVICE

Activity Header				
Activity: 10 999/999/999 TOTAL VEHICLE				
Activity Note: Light Duty PMI				
Reason for Repair: 08 Preventive Maintenance				
Work Accomplished:				
Part Failure:				
Activity Comments:				
Activity Parts				
No Data Available				
Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
02-Mar-20	AMRIT TEEMAL,VISHNU	0.6666666	0	0
Activity Sublet				
No Data Available				
Activity Checklist				
No Data Available				
No Data Available				
Activity Sub Total				
			Activity 10 Sub Total	
			Parts:	0.00
			Labor:	0.00
			Labor Hours:	0.67
			Sublet Parts:	0.00
			Sublet Labor:	0.00
			Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 53249837
Invoice No. 55345 - 53249837

Client Department:

Department: 55345M

Work Order Description

PM A

Requested By: VAMRITTEEMAL

Created By: VAMRITTEEMAL

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 209,349 - DH

Activity Header

Activity: 20 999 TOTAL VEHICLE

Activity Note: PM A

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: A PM Level A

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
02-Mar-20	B329(F)	GOING OUT OF SERVICE SEE BALDWIN B329 IN THE FLEET ORG. FILTER, OIL, SPIN-ON	1	1.96	1.96

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List						
20 Desc: PM A						
Task: PM A SERVICE Performed by: VAMRITTEEMAL Performed on: 02-MAR-20						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
100,000 - "A" PMI SERVICING ITEMS	Done		VAMRITTEEMAL	Mar 2, 2020 12:07:35 PM	No	
101,000 - FRA Change Oil Filters	Yes		VAMRITTEEMAL	Mar 2, 2020 12:07:35 PM	No	
102,000 - FRA Drain Engine Oil	Yes		VAMRITTEEMAL	Mar 2, 2020 12:07:35 PM	No	
103,000 - FRA Check Transmission Fluid	Done		VAMRITTEEMAL	Mar 2, 2020 12:07:35 PM	No	
104,000 - Lubricate Chassis	Done		VAMRITTEEMAL	Mar 2, 2020 12:07:35 PM	No	
105,000 - Replace or Clean A/C Filters	Done		VAMRITTEEMAL	Mar 2, 2020 12:07:35 PM	No	
107,000 - FRA Change Primary Fuel Filter	No	n/a	VAMRITTEEMAL	Mar 2, 2020 12:07:35 PM	No	
108,000 - Lube all pivoting Mechanisms	Done		VAMRITTEEMAL	Mar 2, 2020 12:07:35 PM	No	


Activity Sub Total

Activity 20 Sub Total	
Parts:	1.96

	Labor:	0.00
	Labor Hours:	0.00
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	1.96



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 53249837
Invoice No. 55345 - 53249837

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
PM A		Ford E450 Champion Challenger	
Requested By:	VAMRITTEEMAL	Status:	40 - Closed (40)
Created By:	VAMRITTEEMAL	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	209,349 - DH

Activity Header						
Activity:30 999 TOTAL VEHICLE						
Activity Note: PRAMETER						
Reason for Repair:		05 Inspection, Routine				
Work Accomplished:		06 Inspect				
Part Failure:						
Activity Comments:						
Activity Parts						
No Data Available						
Activity Labor						
No Data Available						
Activity Sublet						
No Data Available						
Activity Checklist						
Check List						
30 Desc: PRAMETER						
Task: PRA and Meter Readings Performed by: VAMRITTEEMAL Performed on: 02-MAR-20						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		VAMRITTEEMAL	Mar 2, 2020 12:07:03 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		VAMRITTEEMAL	Mar 2, 2020 12:07:03 PM	No	
3 - Are you wearing the appropriate PPE?	Done		VAMRITTEEMAL	Mar 2, 2020 12:07:03 PM	No	
4 - Have you performed the proper LOTO?	Done		VAMRITTEEMAL	Mar 2, 2020 12:07:03 PM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		VAMRITTEEMAL	Mar 2, 2020 12:07:03 PM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		VAMRITTEEMAL	Mar 2, 2020 12:07:03 PM	No	
20 - Miles			VAMRITTEEMAL	Mar 2, 2020 12:07:03 PM	No	
30 - Kilometers			VAMRITTEEMAL	Mar 2, 2020 12:07:03 PM	No	
40 - Hours			VAMRITTEEMAL	Mar 2, 2020 12:07:03 PM	No	
Activity Sub Total						
				Activity 30 Sub Total		
Parts:				0.00		
Labor:				0.00		

	Labor Hours:	0.00
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	0.00
Work Order Footer		
	Work Order 53249837 Total	
	Parts:	1.96
	Labor:	0.00
	Labor Hours:	0.67
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	1.96



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 53332061
Invoice No. 55345 - 53332061

Client Department:

Department: 55345M

Work Order Description

Back brakes squeak.

Requested By: EARJOHNSON

Created By: EARJOHNSON

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 2 - Medium

Driver:

Phone:

ETA:

Meter: 208,885 - DH

Chronology

Reported	Feb 27, 2020 11:31:23 PM	Feb 27, 2020 11:31:23 PM
Started	Feb 27, 2020 11:33:00 PM	
Completed	Feb 28, 2020 12:11:00 AM	Feb 28, 2020 12:11:00 AM
Down Time		

Work Order Notes

Line 10 To file warranty be sure to do the following:

- 1) Enter a COMPLAINT statement for each activity.
- 2) Enter CAUSE statement in the Notes field of each activity.
- 3) Enter CORRECTION statement in the Comment section of each activity.

Complaint: Back brakes squeaking.

Cause: TBD.

Correction: Road test vehicle with minor squeaking from the brakes. Brakes work properly and pads are well within spec.

Activity Header

Activity: 5 999 TOTAL VEHICLE

Activity Note: Personal Risk Assessment

Reason for Repair: SW Shop Work Order

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
28-Feb-20	Earl Johnson	0.0666666	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: Personal Risk Assessment

Task: PRA and Meter Readings Performed by: EARJOHNSON Performed on: 28-FEB-20


Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		EARJOHNSON	Feb 28, 2020 12:07:13 AM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		EARJOHNSON	Feb 28, 2020 12:07:13 AM	No	
3 - Are you wearing the appropriate PPE?	Done		EARJOHNSON	Feb 28, 2020 12:07:13 AM	No	
4 - Have you performed the proper LOTO?	Done		EARJOHNSON	Feb 28, 2020 12:07:13 AM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		EARJOHNSON	Feb 28, 2020 12:07:13 AM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		EARJOHNSON	Feb 28, 2020 12:07:13 AM	No	
20 - Miles			EARJOHNSON	Feb 28, 2020 12:07:13 AM	No	
30 - Kilometers			EARJOHNSON	Feb 28, 2020 12:07:13 AM	No	
40 - Hours			EARJOHNSON	Feb 28, 2020 12:07:13 AM	No	

Activity Sub Total

Activity 5 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	0.07
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 53332061
Invoice No. 55345 - 53332061

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Back brakes squeak.		Ford E450 Champion Challenger	
Requested By:	EARJOHNSON	Status:	40 - Closed (40)
Created By:	EARJOHNSON	Priority:	2 - Medium
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	208,885 - DH

Activity Header
Activity:15 013/000/000 BRAKES
Activity Note: Back brakes squeak.
Reason for Repair: 39 Natural Causes
Work Accomplished: 03 Replace New
Part Failure: 44 Worn
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
10-Mar-20	8C2Z-2V200-C	PADS, BRAKE, DISC, REAR	1	47.81	47.81

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
28-Feb-20	Earl Johnson	0.07	0	0
27-Feb-20	Earl Johnson	0.45	0	0

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available

Activity Sub Total		Activity 15 Sub Total	
Parts:	47.81	Labor:	0.00
Labor Hours:	0.52	Labor Hours:	0.52
Sublet Parts:	0.00	Sublet Parts:	0.00
Sublet Labor:	0.00	Sublet Labor:	0.00
Activity Sub Total		47.81	

Work Order Footer		Work Order 53332061 Total	
Parts:	47.81	Labor:	0.00
Labor:	0.00	Labor Hours:	0.59
Labor Hours:	0.59	Sublet Parts:	0.00
Sublet Parts:	0.00	Sublet Labor:	0.00
Sublet Labor:	0.00	Sublet Labor:	0.00
Activity Sub Total		47.81	



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 53159324
Invoice No. 55345 - 53159324

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
PM C		Ford E450 Champion Challenger	
Requested By:	NPIERRE-LOUIS	Status:	40 - Closed (40)
Created By:	NPIERRE-LOUIS	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	205,054 - DH

Chronology		
Reported	Feb 3, 2020 1:31:43 PM	Feb 3, 2020 1:31:43 PM
Started	Feb 4, 2020 12:27:00 PM	
Completed	Feb 4, 2020 3:34:00 PM	Feb 4, 2020 3:34:00 PM
Down Time		

Work Order Notes

Line 10 PMC SERVICE
PREVENTIVE MAINTENANCE
PERFORM AND COMPLETED PMC SERVICE
REPLACED AIR FILTER

Activity Header				
Activity:10 999/999/999 TOTAL VEHICLE				
Activity Note: Light Duty PMI				
Reason for Repair: 08 Preventive Maintenance				
Work Accomplished:				
Part Failure:				
Activity Comments:				
Activity Parts				
No Data Available				
Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
04-Feb-20	AMRIT TEEMAL,VISHNU	1.13	0	0
Activity Sublet				
No Data Available				
Activity Checklist				
No Data Available				
No Data Available				
Activity Sub Total				
			Activity 10 Sub Total	
			Parts:	0.00
			Labor:	0.00
			Labor Hours:	1.13
			Sublet Parts:	0.00
			Sublet Labor:	0.00
			Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 53159324
Invoice No. 55345 - 53159324

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
PM C		Ford E450 Champion Challenger	
Requested By:	NPIERRE-LOUIS	Status:	40 - Closed (40)
Created By:	NPIERRE-LOUIS	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	205,054 - DH

Activity Header
Activity:20 999 TOTAL VEHICLE
Activity Note: PM C
Reason for Repair: 08 Preventive Maintenance
Work Accomplished: C PM Level C
Part Failure:
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
04-Feb-20	PA4075	FILTER, AIR SEE P546597	1	5.28	5.28
04-Feb-20	B329(F)	GOING OUT OF SERVICE SEE BALDWIN B329 IN THE FLEET ORG. FILTER, OIL, SPIN-ON	1	1.96	1.96

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
04-Feb-20	AMRIT TEEMAL,VISHNU	0.37	0	0

Activity Sublet
No Data Available

Activity Checklist						
Check List						
20 Desc: PM C						
Task: PM C SERVICE Performed by: VAMRITTEEMAL Performed on: 04-FEB-20						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
100,000 - "A" PMI SERVICING ITEMS	Done		VAMRITTEEMAL	Feb 4, 2020 2:01:03 PM	No	
101,000 - FRA Change Oil Filters	Yes		VAMRITTEEMAL	Feb 4, 2020 2:01:03 PM	No	
102,000 - FRA Drain Engine Oil	Yes		VAMRITTEEMAL	Feb 4, 2020 2:01:03 PM	No	
103,000 - FRA Check Transmission Fluid	Done		VAMRITTEEMAL	Feb 4, 2020 2:01:03 PM	No	
104,000 - Lubricate Chassis	Done		VAMRITTEEMAL	Feb 4, 2020 2:01:03 PM	No	
105,000 - Replace or Clean A/C Filters	Done		VAMRITTEEMAL	Feb 4, 2020 2:01:03 PM	No	
107,000 - FRA Change Primary Fuel Filter	-	n/a	VAMRITTEEMAL	Feb 4, 2020 2:01:03 PM	No	
108,000 - Lube all pivoting Mechanisms	Done		VAMRITTEEMAL	Feb 4, 2020 2:01:03 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
200,000 - "B" PMI SERVICING ITEMS (12 MONTH)	Done		VAMRITTEEMAL	Feb 4, 2020 2:01:03 PM	No	
201,000 - Service Crankcase Breather	-	n/a	VAMRITTEEMAL	Feb 4, 2020 2:01:03 PM	No	
203,000 - FRA Change Automatic Transmission Fluid	Yes		VAMRITTEEMAL	Feb 4, 2020 2:01:03 PM	No	
204,000 - FRA Change Power Steering Fluid and Filter	No	n/a	VAMRITTEEMAL	Feb 4, 2020 2:01:03 PM	No	
205,000 - Complete Engine Diagnostics and Clear Codes when Completed	Done		VAMRITTEEMAL	Feb 4, 2020 2:01:03 PM	No	
300,000 - "C" PMI SERVICING ITEMS (24 MONTH)	Done		VAMRITTEEMAL	Feb 4, 2020 2:01:03 PM	No	
301,000 - Check and Lubricate Door Linkages	Done		VAMRITTEEMAL	Feb 4, 2020 2:01:03 PM	No	
302,000 - Check Toe-In and Record Reading	-	n/a	VAMRITTEEMAL	Feb 4, 2020 2:01:03 PM	No	
302,001 - Record Toe-In Reading	Inches, fraction-actual	n/a	VAMRITTEEMAL	Feb 4, 2020 2:01:03 PM	No	
304,000 - 1st "C" PMI ONLY: Tune Up Per Engine Mfg's Specifications	No	n/a	VAMRITTEEMAL	Feb 4, 2020 2:01:03 PM	No	
305,000 - FRA Change Differential Fluid	Yes		VAMRITTEEMAL	Feb 4, 2020 2:01:03 PM	No	

Activity Sub Total

Activity 20 Sub Total	
Parts:	7.24
Labor:	0.00
Labor Hours:	0.37
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	7.24



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 53159324
Invoice No. 55345 - 53159324

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
PM C		Ford E450 Champion Challenger	
Requested By:	NPIERRE-LOUIS	Status:	40 - Closed (40)
Created By:	NPIERRE-LOUIS	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	205,054 - DH

Activity Header						
Activity:30 999 TOTAL VEHICLE						
Activity Note: PRAMETER						
Reason for Repair:		05 Inspection, Routine				
Work Accomplished:		06 Inspect				
Part Failure:						
Activity Comments:						
Activity Parts						
No Data Available						
Activity Labor						
No Data Available						
Activity Sublet						
No Data Available						
Activity Checklist						
Check List						
30 Desc: PRAMETER						
Task: PRA and Meter Readings Performed by: VAMRITTEEMAL Performed on: 04-FEB-20						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		VAMRITTEEMAL	Feb 4, 2020 2:00:09 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		VAMRITTEEMAL	Feb 4, 2020 2:00:09 PM	No	
3 - Are you wearing the appropriate PPE?	Done		VAMRITTEEMAL	Feb 4, 2020 2:00:09 PM	No	
4 - Have you performed the proper LOTO?	Done		VAMRITTEEMAL	Feb 4, 2020 2:00:09 PM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		VAMRITTEEMAL	Feb 4, 2020 2:00:09 PM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		VAMRITTEEMAL	Feb 4, 2020 2:00:09 PM	No	
20 - Miles			VAMRITTEEMAL	Feb 4, 2020 2:00:09 PM	No	
30 - Kilometers			VAMRITTEEMAL	Feb 4, 2020 2:00:09 PM	No	
40 - Hours			VAMRITTEEMAL	Feb 4, 2020 2:00:09 PM	No	
Activity Sub Total						
				Activity 30 Sub Total		
Parts:				0.00		
Labor:				0.00		

	Labor Hours:	0.00
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	0.00
Work Order Footer		
	Work Order 53159324 Total	
	Parts:	7.24
	Labor:	0.00
	Labor Hours:	1.50
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	7.24



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 53235406
Invoice No. 55345 - 53235406

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Wiper blades.		Ford E450 Champion Challenger	
Requested By:	EARJOHNSON	Status:	40 - Closed (40)
Created By:	EARJOHNSON	Priority:	2 - Medium
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	204,168 - DH

Chronology		
Reported	Jan 30, 2020 8:27:19 PM	Jan 30, 2020 8:27:19 PM
Started		
Completed	Jan 30, 2020 11:10:00 PM	Jan 30, 2020 11:10:00 PM
Down Time		

Work Order Notes

- Line 10 To file warranty be sure to do the following:
- 1) Enter a COMPLAINT statement for each activity.
 - 2) Enter CAUSE statement in the Notes field of each activity.
 - 3) Enter CORRECTION statement in the Comment section of each activity.
- =====

Complaint: Wiper blades Worn.

Cause: Wear and tear.

Correction: Remove and replaced wiper blades.
Part# 40520 Qty.(2).

Activity Header						
Activity:5 999 TOTAL VEHICLE						
Activity Note: Personal Risk Assessment						
Reason for Repair: SW Shop Work Order						
Work Accomplished: 06 Inspect						
Part Failure:						
Activity Comments:						
Activity Parts						
No Data Available						
Activity Labor						
No Data Available						
Activity Sublet						
No Data Available						
Activity Checklist						
Check List						
5 Desc: Personal Risk Assessment						
Task: PRA and Meter Readings Performed by: EARJOHNSON Performed on: 30-JAN-20						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		EARJOHNSON	Jan 30, 2020 9:50:56 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		EARJOHNSON	Jan 30, 2020 9:50:56 PM	No	
3 - Are you wearing the appropriate PPE?	Done		EARJOHNSON	Jan 30, 2020 9:50:56 PM	No	
4 - Have you performed the proper LOTO?	Done		EARJOHNSON	Jan 30, 2020 9:50:56 PM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		EARJOHNSON	Jan 30, 2020 9:50:56 PM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		EARJOHNSON	Jan 30, 2020 9:50:56 PM	No	
20 - Miles			EARJOHNSON	Jan 30, 2020 9:50:56 PM	No	
30 - Kilometers			EARJOHNSON	Jan 30, 2020 9:50:56 PM	No	
40 - Hours			EARJOHNSON	Jan 30, 2020 9:50:56 PM	No	
Activity Sub Total						
			Activity 5 Sub Total			
			Parts:		0.00	
			Labor:		0.00	
			Labor Hours:		0.00	
			Sublet Parts:		0.00	
			Sublet Labor:		0.00	
			Activity Sub Total		0.00	



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 53235406
Invoice No. 55345 - 53235406

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Wiper blades.		Ford E450 Champion Challenger	
Requested By:	EARJOHNSON	Status:	40 - Closed (40)
Created By:	EARJOHNSON	Priority:	2 - Medium
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	204,168 - DH

Activity Header
Activity: 15 050 GROUP, ACCESSORIES
Activity Note: Wiper blades.
Reason for Repair: 05 Inspection, Routine
Work Accomplished: 03 Replace New
Part Failure:
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
31-Jan-20	40520	BLADE, WIPER, WINDSHIELD, 20"	5	4.28	21.4
30-Jan-20	40520	BLADE, WIPER, WINDSHIELD, 20"	2	4.28	8.56

Activity Labor
No Data Available

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available

Activity Sub Total		Activity 15 Sub Total	
		Parts:	29.96
		Labor:	0.00
		Labor Hours:	0.00
		Sublet Parts:	0.00
		Sublet Labor:	0.00
		Activity Sub Total	29.96

Work Order Footer		Work Order 53235406 Total	
		Parts:	29.96
		Labor:	0.00
		Labor Hours:	0.00
		Sublet Parts:	0.00
		Sublet Labor:	0.00
		Activity Sub Total	29.96



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 1



Work Order No. 53234968
Invoice No. 55345 - 53234968

Client Department:

Department: 55345M

Work Order Description

Fuel Level

Requested By: TDELVA

Created By: TDELVA

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 204,168 - DH

Chronology

Reported	Jan 30, 2020 5:09:11 PM	Jan 30, 2020 5:09:11 PM
Started	Jan 30, 2020 12:00:00 AM	
Completed	Jan 30, 2020 5:17:00 PM	Jan 30, 2020 5:17:00 PM
Down Time		

Work Order Notes

Line 10 Complaint: Fuel needle stuck in middle/half

Cause: Defective fuel level gauge

Correction: replaced fuel level

Activity Header

Activity: 5 999 TOTAL VEHICLE

Activity Note: Personal Risk Assessment

Reason for Repair: SW Shop Work Order

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
30-Jan-20	11395002	MODULE, INTERFACE, LEVEL, FUEL, GASEOUS	1	135.57	135.57

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
30-Jan-20	Delva, Terry	0.5	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: Personal Risk Assessment


Task: PRA and Meter Readings Performed by: TDELVA Performed on: 30-JAN-20

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		TDELVA	Jan 30, 2020 5:16:03 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		TDELVA	Jan 30, 2020 5:16:03 PM	No	
3 - Are you wearing the appropriate PPE?	Done		TDELVA	Jan 30, 2020 5:16:03 PM	No	
4 - Have you performed the proper LOTO?	Done		TDELVA	Jan 30, 2020	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
				5:16:03 PM		
5 - Are you aware of the potential risks of performing this repair?	Done		TDELVA	Jan 30, 2020 5:16:03 PM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		TDELVA	Jan 30, 2020 5:16:03 PM	No	
20 - Miles			TDELVA	Jan 30, 2020 5:16:03 PM	No	
30 - Kilometers			TDELVA	Jan 30, 2020 5:16:03 PM	No	
40 - Hours			TDELVA	Jan 30, 2020 5:16:03 PM	No	
Activity Sub Total						
				Activity 5 Sub Total Parts: 135.57 Labor: 0.00 Labor Hours: 0.50 Sublet Parts: 0.00 Sublet Labor: 0.00 Activity Sub Total 135.57		
Work Order Footer						
				Work Order 53234968 Total Parts: 135.57 Labor: 0.00 Labor Hours: 0.50 Sublet Parts: 0.00 Sublet Labor: 0.00 Activity Sub Total 135.57		



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 53215048
Invoice No. 55345 - 53215048

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Front Tires			Ford E450 Champion Challenger
Requested By:	TDELVA	Status:	40 - Closed (40)
Created By:	TDELVA	Priority:	-
Assigned To:		Driver:	
Class:	-	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	203,269 - DH

Chronology

Reported	Jan 25, 2020 8:40:43 AM	Jan 25, 2020 8:40:43 AM
Started	Jan 25, 2020 9:00:00 AM	
Completed	Jan 27, 2020 8:38:00 AM	Jan 27, 2020 8:38:00 AM
Down Time		

Work Order Notes

Line 10 COMPLAINT: Low thread tire

CAUSE: normal wear

CORRECTION: Dismounted and mounted two front tires

Activity Header

Activity: 10 999/999/999 TOTAL VEHICLE

Activity Note: PERSONAL RISK ASSESMENT

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure: 00 No Failure

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
25-Jan-20	Delva, Terry	3.28	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: PERSONAL RISK ASSESMENT

Task: PRA and Meter Readings Performed by: TDELVA Performed on: 27-JAN-20

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		TDELVA	Jan 27, 2020 8:38:49 AM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		TDELVA	Jan 27, 2020 8:38:49 AM	No	
3 - Are you wearing the appropriate PPE?	Done		TDELVA	Jan 27, 2020 8:38:49 AM	No	
4 - Have you performed the proper LOTO?	Done		TDELVA	Jan 27, 2020 8:38:49 AM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		TDELVA	Jan 27, 2020 8:38:49 AM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		TDELVA	Jan 27, 2020 8:38:49 AM	No	
20 - Miles			TDELVA	Jan 27, 2020 8:38:49 AM	No	
30 - Kilometers			TDELVA	Jan 27, 2020 8:38:49 AM	No	
40 - Hours			TDELVA	Jan 27, 2020 8:38:49 AM	No	

Activity Sub Total

Activity 10 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	3.28
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 53215048
Invoice No. 55345 - 53215048

Client Department:
Department: 55345M
Work Order Description Front Tires
Requested By: TDELVA
Created By: TDELVA
Assigned To:
Class: -
Arrangement: Unassigned
Potential Warranty: No
Equipment No.: 4514-P
VIN: 1FDFE4FS7EDB17176
Ford E450 Champion Challenger
Status: 40 - Closed (40)
Priority: -
Driver:
Phone:
ETA:
Meter: 203,269 - DH

Activity Header
Activity: 20 018/000/000 WHEELS, RIMS, HUBS AND BEARINGS
Activity Note:
Reason for Repair: 08 Preventive Maintenance
Work Accomplished: 03 Replace New
Part Failure: 99 Replaced Before Failure
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
26-Jan-20	192659	TIRE, LT225/75R16, R500 HD, BSW, E/10PR, DURAVIS, BRIDGESTONE	2	132.06	264.12

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
25-Jan-20	Delva, Terry	0.42	0	0
25-Jan-20	Delva, Terry	1.4	0	0

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available

Activity Sub Total		Activity 20 Sub Total	
Parts:	264.12	Labor:	0.00
Labor Hours:	1.82	Sublet Parts:	0.00
Sublet Labor:	0.00	Sublet Labor:	0.00
Activity Sub Total		264.12	

Work Order Footer		Work Order 53215048 Total	
Parts:	264.12	Labor:	0.00
Labor Hours:	5.10	Sublet Parts:	0.00
Sublet Labor:	0.00	Sublet Labor:	0.00
Activity Sub Total		264.12	



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 53066320
Invoice No. 55345 - 53066320

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
PM A		Ford E450 Champion Challenger	
Requested By:	RGASPARD	Status:	40 - Closed (40)
Created By:	RGASPARD	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	200,542 - DH

Chronology		
Reported	Jan 7, 2020 12:01:54 PM	Jan 7, 2020 12:01:54 PM
Started	Jan 8, 2020 12:00:00 AM	
Completed	Jan 8, 2020 8:47:00 AM	Jan 8, 2020 8:47:00 AM
Down Time		

Work Order Notes

Line 10 COMPLAINT: PmA Service

CAUSE: preventive maintenance

CORRECTION: perform PmA Service lube all Pivoting Points

Activity Header				
Activity:10 999/999/999 TOTAL VEHICLE				
Activity Note: Light Duty PMI				
Reason for Repair: 08 Preventive Maintenance				
Work Accomplished:				
Part Failure:				
Activity Comments:				
Activity Parts				
No Data Available				
Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
08-Jan-20	NELSON PIERRE-LOUIS	2.5	0	0
Activity Sublet				
No Data Available				
Activity Checklist				
No Data Available				
No Data Available				
Activity Sub Total				
			Activity 10 Sub Total	
			Parts:	0.00
			Labor:	0.00
			Labor Hours:	2.50
			Sublet Parts:	0.00
			Sublet Labor:	0.00
			Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 53066320
Invoice No. 55345 - 53066320

Client Department:

Department: 55345M

Work Order Description

PM A

Requested By: RGASPARD

Created By: RGASPARD

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 200,542 - DH

Activity Header

Activity: 20 999 TOTAL VEHICLE

Activity Note: PM A

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: A PM Level A

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
08-Jan-20	B329(F)	GOING OUT OF SERVICE SEE BALDWIN B329 IN THE FLEET ORG. FILTER, OIL, SPIN-ON	1	1.96	1.96

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List						
20 Desc: PM A						
Task: PM A SERVICE Performed by: NPIERRE-LOUIS Performed on: 08-JAN-20						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
100,000 - "A" PMI SERVICING ITEMS	Done		NPIERRE-LOUIS	Jan 8, 2020 8:39:10 AM	No	
101,000 - FRA Change Oil Filters	Yes		NPIERRE-LOUIS	Jan 8, 2020 8:39:10 AM	No	
102,000 - FRA Drain Engine Oil	Yes		NPIERRE-LOUIS	Jan 8, 2020 8:39:10 AM	No	
103,000 - FRA Check Transmission Fluid	Done		NPIERRE-LOUIS	Jan 8, 2020 8:39:10 AM	No	
104,000 - Lubricate Chassis	Done		NPIERRE-LOUIS	Jan 8, 2020 8:39:10 AM	No	
105,000 - Replace or Clean A/C Filters	Done		NPIERRE-LOUIS	Jan 8, 2020 8:39:10 AM	No	
107,000 - FRA Change Primary Fuel Filter	Yes		NPIERRE-LOUIS	Jan 8, 2020 8:39:10 AM	No	
108,000 - Lube all pivoting Mechanisms	Done		NPIERRE-LOUIS	Jan 8, 2020 8:39:10 AM	No	

Activity Sub Total

Activity 20 Sub Total
Parts: 1.96

	Labor:	0.00
	Labor Hours:	0.00
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	1.96



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 53066320
Invoice No. 55345 - 53066320

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
PM A		Ford E450 Champion Challenger	
Requested By:	RGASPARD	Status:	40 - Closed (40)
Created By:	RGASPARD	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	200,542 - DH

Activity Header						
Activity:30 999 TOTAL VEHICLE						
Activity Note: PRAMETER						
Reason for Repair:		05 Inspection, Routine				
Work Accomplished:		06 Inspect				
Part Failure:						
Activity Comments:						
Activity Parts						
No Data Available						
Activity Labor						
No Data Available						
Activity Sublet						
No Data Available						
Activity Checklist						
Check List						
30 Desc: PRAMETER						
Task: PRA and Meter Readings Performed by: NPIERRE-LOUIS Performed on: 08-JAN-20						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		NPIERRE-LOUIS	Jan 8, 2020 8:17:13 AM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		NPIERRE-LOUIS	Jan 8, 2020 8:17:13 AM	No	
3 - Are you wearing the appropriate PPE?	Done		NPIERRE-LOUIS	Jan 8, 2020 8:17:13 AM	No	
4 - Have you performed the proper LOTO?	Done		NPIERRE-LOUIS	Jan 8, 2020 8:17:13 AM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		NPIERRE-LOUIS	Jan 8, 2020 8:17:13 AM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		NPIERRE-LOUIS	Jan 8, 2020 8:17:13 AM	No	
20 - Miles			NPIERRE-LOUIS	Jan 8, 2020 8:17:13 AM	No	
30 - Kilometers			NPIERRE-LOUIS	Jan 8, 2020 8:17:13 AM	No	
40 - Hours			NPIERRE-LOUIS	Jan 8, 2020 8:17:13 AM	No	
Activity Sub Total						
				Activity 30 Sub Total		
Parts:				0.00		
Labor:				0.00		

	Labor Hours:	0.00
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	0.00
Work Order Footer		
	Work Order 53066320 Total	
	Parts:	1.96
	Labor:	0.00
	Labor Hours:	2.50
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	1.96



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 53141877
Invoice No. 55345 - 53141877

Client Department:

Department: 55345M

Work Order Description

Vehicle is stalling

Requested By: JAPEREZ

Created By: JAPEREZ

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 2 - Medium

Driver:

Phone:

ETA:

Meter: 199,975 - DH

Chronology

Reported	Jan 2, 2020 8:18:30 AM	Jan 2, 2020 8:18:30 AM
Started	Jan 2, 2020 8:21:00 AM	
Completed	Jan 3, 2020 1:15:00 PM	Jan 3, 2020 1:15:00 PM
Down Time		

Work Order Notes

Line 10 To file warranty be sure to do the following:

- 1) Enter a COMPLAINT statement for each activity.
- 2) Enter CAUSE statement in the Notes field of each activity.
- 3) Enter CORRECTION statement in the Comment section of each activity.

Complaint:engine is stalling

Cause: Check computer system found codes P0301,P0316, P2195, P2197 follow diagnostic procedures.
Perform pressure test, replaced with a good known air fuel meter found engine is running lean perform leak test for fuel injectors found O-rings are damage causing to leak air into cylinder

Correction: Remove propane system to replace all fuel injectors O-rings, retest and road test vehicle engine works ok at this time

Parts:

20 O-rings fopz-9229-a

Activity Header
Activity: 5 999 TOTAL VEHICLE
Activity Note: Personal Risk Assessment
Reason for Repair: SW Shop Work Order
Work Accomplished: 06 Inspect
Part Failure:
Activity Comments:
Activity Parts
No Data Available
Activity Labor
No Data Available
Activity Sublet
No Data Available
Activity Checklist
Check List
5 Desc: Personal Risk Assessment

Check List	
------------	--

Task: PRA and Meter Readings Performed by: JAPEREZ Performed on: 03-JAN-20

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		JAPEREZ	Jan 3, 2020 1:15:08 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		JAPEREZ	Jan 3, 2020 1:15:08 PM	No	
3 - Are you wearing the appropriate PPE?	Done		JAPEREZ	Jan 3, 2020 1:15:08 PM	No	
4 - Have you performed the proper LOTO?	Done		JAPEREZ	Jan 3, 2020 1:15:08 PM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		JAPEREZ	Jan 3, 2020 1:15:08 PM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		JAPEREZ	Jan 3, 2020 1:15:08 PM	No	
20 - Miles			JAPEREZ	Jan 3, 2020 1:15:08 PM	No	
30 - Kilometers			JAPEREZ	Jan 3, 2020 1:15:08 PM	No	
40 - Hours			JAPEREZ	Jan 3, 2020 1:15:08 PM	No	

Activity Sub Total	
--------------------	--

Activity 5 Sub Total	
Parts:	0.0
Labor:	0.0
Labor Hours:	0.0
Sublet Parts:	0.0
Sublet Labor:	0.0
Activity Sub Total	0.0



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 53141877
Invoice No. 55345 - 53141877

Client Department:

Department: 55345M

Work Order Description

Vehicle is stalling

Requested By: JAPEREZ

Created By: JAPEREZ

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 2 - Medium

Driver:

Phone:

ETA:

Meter: 199,975 - DH

Activity Header

Activity: 15 030 ELECTRICAL GROUP

Activity Note: Vehicle is stalling

Reason for Repair: 04 Driver's Report

Work Accomplished:

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
03-Jan-20	FOPZ-9229-A	O-RING, SEAL, INJECTOR, FUEL SAME AS CM-4717	1	13.48	13.48

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
02-Jan-20	Perez,Javier	4.88	0	0
02-Jan-20	Perez,Javier	1.55	0	0
03-Jan-20	Perez,Javier	5.18	0	0

Activity Sublet

No Data Available

Activity Checklist

No Data Available

No Data Available

Activity Sub Total

Activity 15 Sub Total

Parts:	13.48
Labor:	0.00
Labor Hours:	11.61
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	13.48

Work Order Footer

Work Order 53141877 Total

Parts:	13.48
Labor:	0.00
Labor Hours:	11.61
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	13.48



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 53136318
Invoice No. 55345 - 53136318

Client Department:

Department: 55345M

Work Order Description

Check engine light on

Requested By: JAPEREZ

Created By: JAPEREZ

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 2 - Medium

Driver:

Phone:

ETA:

Meter: 199,856 - DH

Chronology

Reported	Dec 30, 2019 12:40:18 PM	Dec 30, 2019 12:40:18 PM
Started	Dec 30, 2019 12:42:00 PM	
Completed	Dec 31, 2019 11:52:00 AM	Dec 31, 2019 11:52:00 AM
Down Time		

Work Order Notes

Line 10 To file warranty be sure to do the following:

- 1) Enter a COMPLAINT statement for each activity.
- 2) Enter CAUSE statement in the Notes field of each activity.
- 3) Enter CORRECTION statement in the Comment section of each activity.

Complaint:Check Engine Light On

Cause: Check computer system found codes for lean condition and engine stalls when driving

Correction:Replaced fuel pump kit, retest system and road test vehicle ok at this time

Part:

1 fuel pump kit 11396002

Activity Header

Activity:5 999 TOTAL VEHICLE

Activity Note: Personal Risk Assessment

Reason for Repair: SW Shop Work Order

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: Personal Risk Assessment

Task: PRA and Meter Readings Performed by: JAPEREZ Performed on: 31-DEC-19

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		JAPEREZ	Dec 31, 2019 11:51:56 AM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		JAPEREZ	Dec 31, 2019 11:51:56 AM	No	
3 - Are you wearing the appropriate PPE?	Done		JAPEREZ	Dec 31, 2019 11:51:56 AM	No	
4 - Have you performed the proper LOTO?	Done		JAPEREZ	Dec 31, 2019 11:51:56 AM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		JAPEREZ	Dec 31, 2019 11:51:56 AM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		JAPEREZ	Dec 31, 2019 11:51:56 AM	No	
20 - Miles			JAPEREZ	Dec 31, 2019 11:51:56 AM	No	
30 - Kilometers			JAPEREZ	Dec 31, 2019 11:51:56 AM	No	
40 - Hours			JAPEREZ	Dec 31, 2019 11:51:56 AM	No	

Activity Sub Total

Activity 5 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 53136318
Invoice No. 55345 - 53136318

Client Department:

Department: 55345M

Work Order Description

Check engine light on

Requested By: JAPEREZ

Created By: JAPEREZ

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 2 - Medium

Driver:

Phone:

ETA:

Meter: 199,856 - DH

Activity Header

Activity: 15 044 FUEL SYSTEM

Activity Note: Check engine light on

Reason for Repair: 04 Driver's Report

Work Accomplished:

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
31-Dec-19	11396002	PUMP, FUEL, GASEOUS, GEN-3 W/KIT	1	414.31	414.31

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
30-Dec-19	Perez,Javier	1.67	65	108.55
31-Dec-19	Perez,Javier	3.13	65	203.45

Activity Sublet

No Data Available

Activity Checklist

No Data Available

No Data Available

Activity Sub Total

Activity 15 Sub Total

Parts:	414.31
Labor:	312.00
Labor Hours:	4.80
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	726.31

Work Order Footer

Work Order 53136318 Total

Parts:	414.31
Labor:	312.00
Labor Hours:	4.80
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	726.31



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 53130212
Invoice No. 55345 - 53130212

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Battery light on		Ford E450 Champion Challenger	
Requested By:	JAPEREZ	Status:	40 - Closed (40)
Created By:	JAPEREZ	Priority:	2 - Medium
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	199,843 - DH

Chronology		
Reported	Dec 27, 2019 10:07:19 AM	Dec 27, 2019 10:07:19 AM
Started	Dec 27, 2019 10:09:00 AM	
Completed	Dec 27, 2019 2:23:00 PM	Dec 27, 2019 2:23:00 PM
Down Time		

Work Order Notes

- Line 10 To file warranty be sure to do the following:
- 1) Enter a COMPLAINT statement for each activity.
 - 2) Enter CAUSE statement in the Notes field of each activity.
 - 3) Enter CORRECTION statement in the Comment section of each activity.

Complaint:Battery light is on

Cause: Check charging system intermittent charging failure due to bad wire harness

Correction:repair wire harness retest system and road test vehicle ok at this time

Activity Header							
Activity:5 999 TOTAL VEHICLE							
Activity Note: Personal Risk Assessment							
Reason for Repair: SW Shop Work Order							
Work Accomplished: 06 Inspect							
Part Failure:							
Activity Comments:							
Activity Parts							
No Data Available							
Activity Labor							
No Data Available							
Activity Sublet							
No Data Available							
Activity Checklist							
Check List							
5 Desc: Personal Risk Assessment							
Task: PRA and Meter Readings Performed by: JAPEREZ Performed on: 27-DEC-19							
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO	
1 - Are you properly trained to perform the task?	Done		JAPEREZ	Dec 27, 2019	No		

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
				2:22:47 PM		
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		JAPEREZ	Dec 27, 2019 2:22:47 PM	No	
3 - Are you wearing the appropriate PPE?	Done		JAPEREZ	Dec 27, 2019 2:22:47 PM	No	
4 - Have you performed the proper LOTO?	Done		JAPEREZ	Dec 27, 2019 2:22:47 PM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		JAPEREZ	Dec 27, 2019 2:22:47 PM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		JAPEREZ	Dec 27, 2019 2:22:47 PM	No	
20 - Miles			JAPEREZ	Dec 27, 2019 2:22:47 PM	No	
30 - Kilometers			JAPEREZ	Dec 27, 2019 2:22:47 PM	No	
40 - Hours			JAPEREZ	Dec 27, 2019 2:22:47 PM	No	

Activity Sub Total

Activity 5 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 53130212
Invoice No. 55345 - 53130212

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Battery light on		Ford E450 Champion Challenger	
Requested By:	JAPEREZ	Status:	40 - Closed (40)
Created By:	JAPEREZ	Priority:	2 - Medium
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	199,843 - DH

Activity Header				
Activity:15 031 CHARGING				
Activity Note: Battery light on				
Reason for Repair: 04 Driver's Report				
Work Accomplished:				
Part Failure:				
Activity Comments:				
Activity Parts				
No Data Available				
Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
27-Dec-19	Perez,Javier	3.45	65	224.25
Activity Sublet				
No Data Available				
Activity Checklist				
No Data Available				
No Data Available				
Activity Sub Total				
			Activity 15 Sub Total	
			Parts:	0.00
			Labor:	224.25
			Labor Hours:	3.45
			Sublet Parts:	0.00
			Sublet Labor:	0.00
			Activity Sub Total	224.25
Work Order Footer				
			Work Order 53130212 Total	
			Parts:	0.00
			Labor:	224.25
			Labor Hours:	3.45
			Sublet Parts:	0.00
			Sublet Labor:	0.00
			Activity Sub Total	224.25



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 53125659
Invoice No. 55345 - 53125659

Client Department:

Department: 55345M

Work Order Description

Check engine light on

Requested By: JAPEREZ

Created By: JAPEREZ

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 2 - Medium

Driver:

Phone:

ETA:

Meter: 199,457 - DH

Chronology

Reported	Dec 24, 2019 11:26:05 AM	Dec 24, 2019 11:26:05 AM
Started	Dec 24, 2019 11:29:00 AM	
Completed	Dec 24, 2019 1:52:00 PM	Dec 24, 2019 1:52:00 PM
Down Time		

Work Order Notes

Line 10 To file warranty be sure to do the following:

- 1) Enter a COMPLAINT statement for each activity.
- 2) Enter CAUSE statement in the Notes field of each activity.
- 3) Enter CORRECTION statement in the Comment section of each activity.

Complaint:Check Engine Light On

Cause: Check computer system found codes for random misfire, p0460 fuel level sensor circuit error and both banks O2 sensors stuck lean. Perform fuel pressure test and verify all systems works p, can't duplicate concern at this time

Correction:Road test vehicle and retest all systems, ok at this time possible vehicle had vapor lock

Activity Header							
Activity: 5 999 TOTAL VEHICLE							
Activity Note: Personal Risk Assessment							
Reason for Repair: SW Shop Work Order							
Work Accomplished: 06 Inspect							
Part Failure:							
Activity Comments:							
Activity Parts No Data Available							
Activity Labor No Data Available							
Activity Sublet No Data Available							
Activity Checklist							
Check List							
5 Desc: Personal Risk Assessment Task: PRA and Meter Readings Performed by: JAPEREZ Performed on: 24-DEC-19							
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO	
1 - Are you properly trained to perform the task?	Done		JAPEREZ	Dec 24, 2019	No		

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
				1:52:07 PM		
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		JAPEREZ	Dec 24, 2019 1:52:07 PM	No	
3 - Are you wearing the appropriate PPE?	Done		JAPEREZ	Dec 24, 2019 1:52:07 PM	No	
4 - Have you performed the proper LOTO?	Done		JAPEREZ	Dec 24, 2019 1:52:07 PM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		JAPEREZ	Dec 24, 2019 1:52:07 PM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		JAPEREZ	Dec 24, 2019 1:52:07 PM	No	
20 - Miles			JAPEREZ	Dec 24, 2019 1:52:07 PM	No	
30 - Kilometers			JAPEREZ	Dec 24, 2019 1:52:07 PM	No	
40 - Hours			JAPEREZ	Dec 24, 2019 1:52:07 PM	No	

Activity Sub Total

Activity 5 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 53125659
Invoice No. 55345 - 53125659

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Check engine light on		Ford E450 Champion Challenger	
Requested By:	JAPEREZ	Status:	40 - Closed (40)
Created By:	JAPEREZ	Priority:	2 - Medium
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	199,457 - DH

Activity Header
Activity: 15 030 ELECTRICAL GROUP
Activity Note: Check engine light on
Reason for Repair: 04 Driver's Report
Work Accomplished:
Part Failure:
Activity Comments:

Activity Parts
No Data Available

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
24-Dec-19	Perez,Javier	2.27	65	147.55

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available

Activity Sub Total		Activity 15 Sub Total	
		Parts:	0.00
		Labor:	147.55
		Labor Hours:	2.27
		Sublet Parts:	0.00
		Sublet Labor:	0.00
		Activity Sub Total	147.55

Work Order Footer		Work Order 53125659 Total	
		Parts:	0.00
		Labor:	147.55
		Labor Hours:	2.27
		Sublet Parts:	0.00
		Sublet Labor:	0.00
		Activity Sub Total	147.55



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 52973065
Invoice No. 55345 - 52973065

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
PM A		Ford E450 Champion Challenger	
Requested By:	RRENE	Status:	40 - Closed (40)
Created By:	RRENE	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	196,301 - DH

Chronology		
Reported	Dec 4, 2019 4:14:55 PM	Dec 4, 2019 4:14:55 PM
Started	Dec 5, 2019 12:00:00 AM	
Completed	Dec 5, 2019 4:42:00 PM	Dec 5, 2019 4:42:00 PM
Down Time		

Work Order Notes

Line 10 COMPLAINT: pmA

CAUSE: Service

CORRECTION: perform pmA service
Oil filter B329 qty1
Engine oil 5w20 qty 7 Qts

Activity Header						
Activity: 10 999 TOTAL VEHICLE						
Activity Note: Light Medium Duty PMI						
Reason for Repair: 08 Preventive Maintenance						
Work Accomplished: A PM Level A						
Part Failure:						
Activity Comments:						
Activity Parts						
No Data Available						
Activity Labor						
Booked Date	Technician	Hours	Shop Rate	Extended		
05-Dec-19	Gaspard,Ronald	1.6166666	65	105.083329		
Activity Sublet						
No Data Available						
Activity Checklist						
Check List						
10 Desc: Light Medium Duty PMI						
Task: First Transit Light-Medium Duty PMI Performed by: RGASPARD Performed on: 05-DEC-19						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,000 - SECTION 1 Preparation and Drive On (In Lot) Inspection	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
10,100 - Safety Inspection	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
10,110 - FRA Check Drivers Pre-trip or DVIR/EVIR & Authorization Forms	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
10,120 - FRA Check All Warning Lights and Alarms	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,130 - FRA Check Automatic Transmission Neutral Start Operation	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
10,140 - Check Service Brakes	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
10,150 - FRA Start Engine and Listen for Any Unusual Noises	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
10,160 - FRA Check Instruments and Horns	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
10,170 - Check Fast Idle	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
10,180 - Check Starter Protection Circuit	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
10,190 - Check Reverse Warning System	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
11,100 - Check Parking Brake	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
11,110 - Check HVAC Switches and Other Controls	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
11,120 - FRA Inspect Windshields, Mirror and Sun Visor Condition	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
11,130 - FRA Check Wiper and Washer Operation	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
11,140 - Road Test: Check for Proper Operation	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
11,150 - Perform Brake Test	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
11,152 - Decelerometer Results Test 1	FEET	NA	RGASPARD	Dec 5, 2019 4:23:57 PM	No	
11,154 - Decelerometer Results Test 2	FEET	NA	RGASPARD	Dec 5, 2019 4:23:57 PM	No	
11,156 - Decelerometer Results Test 3	FEET	NA	RGASPARD	Dec 5, 2019 4:23:57 PM	No	
11,161 - FRA Check/Record Oil Pressure / @1500 rpm	Pounds per Square Inch	NA	RGASPARD	Dec 5, 2019 4:23:57 PM	No	
11,162 - FRA Check/Record Water Temperature	Degree Fahrenheit	NA	RGASPARD	Dec 5, 2019 4:23:57 PM	No	
11,170 - FRA Check Door Operation	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
11,180 - FRA Check Operation of All Other Accessories	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
20,000 - SECTION 2 Interior Circle Inspection	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
20,210 - Check Condition of Operator's Area	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
20,220 - Check Accelerator and Brake Pedals	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
20,230 - FRA Check Wiring Under Dash	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
20,240 - FRA Check Interior Lights	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
20,250 - FRA Check Interior Electrical Panels	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
20,260 - Check Stop Request System	-	NA	RGASPARD	Dec 5, 2019 4:23:57 PM	No	
20,270 - Check Fare Box Mounting (If Applicable)	-	NA	RGASPARD	Dec 5, 2019 4:23:57 PM	No	
20,280 - Check Seats, Seat Belts, Hand Rails and Floor Covering	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
20,290 - Check for Physical Damage, Water Leaks, and Graffiti	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
22,100 - Check Emergency Windows and Glass Condition	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
22,110 - Check Emergency Hatches	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
22,120 - Check All Safety Equipment	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
30,000 - SECTION 3 Exterior Circle Inspection	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
30,310 - Check Passenger Doors	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
30,320 - Inspect Step-well and Hand Rails	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
30,330 - Check Wheelchair Lift Operation	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
30,340 - FRA Check Destination Sign and Run Box	-	NA	RGASPARD	Dec 5, 2019 4:23:57 PM	No	
30,350 - FRA Inspect Mirror and Mountings	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
30,360 - Check for Physical Damage and Decals	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
30,370 - Check Wiper Blade and Arm Condition	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
30,380 - Check Exterior Compartment Doors	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
30,390 - FRA Check Fuel Tank Cap	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
33,100 - Check Lights and Reflectors	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
33,110 - Check License Plate, Permits and State Inspection Decals	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
40,000 - SECTION 4 Engine Compartment Inspection	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
40,410 - FRA Check Engine Compartment/Condition for Fire Risk	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
40,420 - Check Hood	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
40,430 - Check Fan, Shroud and Radiator	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
40,440 - Test Coolant System Using Test Strips and Record Results	-	NA	RGASPARD	Dec 5, 2019 4:23:57 PM	No	
40,441 - Inhibitor Test Pass or Fail (Indicate with a Yes or No)	No	NA	RGASPARD	Dec 5, 2019 4:23:57 PM	No	
40,442 - Freeze Point	Degree Fahrenheit	NA	RGASPARD	Dec 5, 2019 4:23:57 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
40,450 - FRA Check Coolant Recovery System Condition & for Leaks	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
40,460 - Record Antifreeze Protection Level Using Refractometer	-	NA	RGASPARD	Dec 5, 2019 4:23:57 PM	No	
40,461 - Refractometer Reading	Degree Fahrenheit	NA	RGASPARD	Dec 5, 2019 4:23:57 PM	No	
40,470 - Pressure Test Cooling System and Check for Leaks	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
40,480 - FRA Check Coolant Hose Condition	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
40,490 - FRA Check Alternator Mount and Condition	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
44,100 - FRA Check Fuel Control and Transmission Connections	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
44,110 - FRA Check Master Cylinder Fluid Level	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
44,120 - FRA Check All Belts for Condition, Alignment and Tension	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
44,130 - FRA Check Exhaust System	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
44,140 - FRA Check Intake System	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
44,150 - FRA Inspect Turbocharger	-	NA	RGASPARD	Dec 5, 2019 4:23:57 PM	No	
44,160 - FRA Inspect Power Steering and Hydraulic Fluid	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
44,170 - FRA Check All Engine or Belt Driven Components	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
44,180 - FRA Check for Leaks	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
44,190 - FRA Perform Battery Inspection	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
44,200 - FRA Check Battery Box Corrosion, Cables and Hold-Downs	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
50,000 - SECTION 5 Steering System Inspection	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
50,510 - Check Entire Steering System	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
60,000 - SECTION 6 Tires and Wheel Inspection	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
60,610 - FRA Check and Record Air Pressure	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
60,611 - Air Pressure RF	70 Pounds per Square Inch		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
60,612 - Air Pressure LF	70 Pounds per Square Inch		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
60,613 - Air Pressure RRO	65 Pounds per Square Inch		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
60,614 - Air Pressure RRI	65 Pounds per Square Inch		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
60,615 - Air Pressure LRI	65 Pounds per Square Inch		RGASPARD	Dec 5, 2019 4:23:57 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
60,616 - Air Pressure LRO	65 Pounds per Square Inch		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
60,620 - Check Valve Stems and Caps	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
60,630 - Check and Record Tread Depth	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
60,631 - Tread Depth RF	8 32nds of an inch		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
60,632 - Tread Depth LF	10 32nds of an inch		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
60,633 - Tread Depth RRO	10 32nds of an inch		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
60,634 - Tread Depth RRI	10 32nds of an inch		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
60,635 - Tread Depth LRI	10 32nds of an inch		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
60,636 - Tread Depth LRO	10 32nds of an inch		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
60,640 - Check for Mismatched Tread or Casing Design	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
60,650 - Check Sidewall Wear	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
60,660 - Inspect for Cuts and Tears	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
60,670 - Check Dual Mating With Square	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
60,680 - Check Wheels for Cracks and Loose Lugs	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
60,690 - Check Tires for Irregular or Alignment Wear	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
66,100 - FRA Check Outer Hubs for Leaks	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
70,000 - SECTION 7 Under Vehicle Inspection	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
70,710 - Check Vibration Damper	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
70,720 - Check Engine and Transmission Mounts	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
70,730 - FRA Check Starter	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
70,740 - FRA Check Bottom of Engine for Fluid Leaks	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
70,750 - FRA Check Transmission for Leaks	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
70,760 - FRA Check Differential Breather and Fluid	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
70,770 - FRA Check Exhaust System	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
70,780 - Check Driveline, U-joint and Slip Yokes	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
70,790 - Check All Body Mounts and Chassis Frame	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
77,100 - FRA Check Security, Integrity and Length of Ground Straps	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
77,110 - FRA Check Fuel Tank	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
77,120 - Check Suspension Components	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
77,130 - FRA Check Brake Pad Thickness and Rotor for Wear	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
77,131 - Brake Pad Thickness LF	3 Inch		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
77,132 - Brake Pad Thickness RF	3 Inch		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
77,133 - Brake Pad Thickness LR	4 Inch		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
77,134 - Brake Pad Thickness RR	4 Inch		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
77,135 - Brake Rotor LF	38 Inch		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
77,136 - Brake Rotor RF	38 Inch		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
77,137 - Brake Rotor LR	40 Inch		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
77,138 - Brake Rotor RR	40 Inch		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
77,140 - FRA Check Brake Hoses	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
77,150 - Check King Pins	-	NA	RGASPARD	Dec 5, 2019 4:23:57 PM	No	
77,160 - FRA Check for Loose or Noisy Wheel Bearings	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
80,000 - SECTION 8 PMI Report Completion	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
80,810 - Completion of PMI Report	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
90,000 - SECTION 9 Completion of PMI	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	
90,910 - Vehicle Returned to predetermined location	Done		RGASPARD	Dec 5, 2019 4:23:57 PM	No	


Activity Sub Total

Activity 10 Sub Total

Parts:	0.00
Labor:	105.08
Labor Hours:	1.62
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	105.08



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 52973065
Invoice No. 55345 - 52973065

Client Department:

Department: 55345M

Work Order Description

PM A

Requested By: RRENE

Created By: RRENE

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 196,301 - DH

Activity Header

Activity: 20 999 TOTAL VEHICLE

Activity Note: PM A

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: A PM Level A

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
05-Dec-19	B329(F)	GOING OUT OF SERVICE SEE BALDWIN B329 IN THE FLEET ORG. FILTER, OIL, SPIN-ON	1	1.96	1.96

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
05-Dec-19	Gaspard,Ronald	1.1333333	65	73.6666645

Activity Sublet

No Data Available

Activity Checklist

Check List						
20 Desc: PM A						
Task: PM A SERVICE Performed by: RGASPARD Performed on: 05-DEC-19						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
100,000 - "A" PMI SERVICING ITEMS	Done		RGASPARD	Dec 5, 2019 4:24:38 PM	No	
101,000 - FRA Change Oil Filters	Yes		RGASPARD	Dec 5, 2019 4:24:38 PM	No	
102,000 - FRA Drain Engine Oil	Yes		RGASPARD	Dec 5, 2019 4:24:38 PM	No	
103,000 - FRA Check Transmission Fluid	Done		RGASPARD	Dec 5, 2019 4:24:38 PM	No	
104,000 - Lubricate Chassis	-	NA	RGASPARD	Dec 5, 2019 4:24:38 PM	No	
105,000 - Replace or Clean A/C Filters	Done		RGASPARD	Dec 5, 2019 4:24:38 PM	No	
107,000 - FRA Change Primary Fuel Filter	No	NA	RGASPARD	Dec 5, 2019 4:24:38 PM	No	
108,000 - Lube all pivoting Mechanisms	Done		RGASPARD	Dec 5, 2019 4:24:38 PM	No	

Activity Sub Total

	Activity 20 Sub Total	
	Parts:	1.96
	Labor:	73.67
	Labor Hours:	1.13
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	75.63



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 52973065
Invoice No. 55345 - 52973065

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
PM A		Ford E450 Champion Challenger	
Requested By:	RRENE	Status:	40 - Closed (40)
Created By:	RRENE	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	196,301 - DH

Activity Header
Activity:30 999 TOTAL VEHICLE
Activity Note: PRAMETER
Reason for Repair: 05 Inspection, Routine
Work Accomplished: 06 Inspect
Part Failure:
Activity Comments:

Activity Parts
No Data Available

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
05-Dec-19	Gaspard,Ronald	0.25	65	16.25

Activity Sublet
No Data Available

Check List						
30 Desc: PRAMETER Task: PRA and Meter Readings Performed by: RGASPARD Performed on: 05-DEC-19						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		RGASPARD	Dec 5, 2019 4:25:04 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		RGASPARD	Dec 5, 2019 4:25:04 PM	No	
3 - Are you wearing the appropriate PPE?	Done		RGASPARD	Dec 5, 2019 4:25:04 PM	No	
4 - Have you performed the proper LOTO?	Done		RGASPARD	Dec 5, 2019 4:25:04 PM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		RGASPARD	Dec 5, 2019 4:25:04 PM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		RGASPARD	Dec 5, 2019 4:25:04 PM	No	
20 - Miles			RGASPARD	Dec 5, 2019 4:25:04 PM	No	
30 - Kilometers			RGASPARD	Dec 5, 2019 4:25:04 PM	No	
40 - Hours			RGASPARD	Dec 5, 2019 4:25:04 PM	No	

Activity Sub Total	Activity 30 Sub Total
---------------------------	------------------------------

	Parts:	0.00
	Labor:	16.25
	Labor Hours:	0.25
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	16.25
Work Order Footer		
	Work Order 52973065 Total	
	Parts:	1.96
	Labor:	195.00
	Labor Hours:	3.00
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	196.96



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 53066255
Invoice No. 55345 - 53066255

Client Department:

Department: 55345M

Work Order Description

Needs front and rear brakes job

Requested By: RGASPARD

Created By: RGASPARD

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 196,301 - DH

Chronology

Reported	Dec 5, 2019 4:27:15 PM	Dec 5, 2019 4:27:15 PM
Started	Dec 5, 2019 12:00:00 AM	
Completed	Dec 5, 2019 4:41:00 PM	Dec 5, 2019 4:41:00 PM
Down Time		

Work Order Notes

Line 10 To file warranty be sure to do the following:

- 1) Enter a COMPLAINT statement for each activity.
- 2) Enter CAUSE statement in the Notes field of each activity.
- 3) Enter CORRECTION statement in the Comment section of each activity.

Complaint:needs front and rear brakes job

Cause: wear

Correction:replaced front and rear brake pads lubed guide pins

Torque wheels 140 lbs second torque 140 lbs

Front brakes part number 8C2Z-2V001-D qty1

Rear brakes part number 9C2Z-2V200-B qty1

Activity Header

Activity:5 999 TOTAL VEHICLE

Activity Note: Personal Risk Assessment

Reason for Repair: SW Shop Work Order

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
05-Dec-19	Gaspard,Ronald	0.1	65	6.5

Activity Sublet

No Data Available

Activity Checklist

Check List																				
5 Desc: Personal Risk Assessment																				
Task: PRA and Meter Readings Performed by: RGASPARD Performed on: 05-DEC-19																				
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO														
1 - Are you properly trained to perform the task?	Done		RGASPARD	Dec 5, 2019 4:29:47 PM	No															
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		RGASPARD	Dec 5, 2019 4:29:47 PM	No															
3 - Are you wearing the appropriate PPE?	Done		RGASPARD	Dec 5, 2019 4:29:47 PM	No															
4 - Have you performed the proper LOTO?	Done		RGASPARD	Dec 5, 2019 4:29:47 PM	No															
5 - Are you aware of the potential risks of performing this repair?	Done		RGASPARD	Dec 5, 2019 4:29:47 PM	No															
10 - Have you successfully completed the Personal Risk Assessment?	Done		RGASPARD	Dec 5, 2019 4:29:47 PM	No															
20 - Miles			RGASPARD	Dec 5, 2019 4:29:47 PM	No															
30 - Kilometers			RGASPARD	Dec 5, 2019 4:29:47 PM	No															
40 - Hours			RGASPARD	Dec 5, 2019 4:29:47 PM	No															
Activity Sub Total																				
			<table border="1"> <thead> <tr> <th colspan="2">Activity 5 Sub Total</th> </tr> </thead> <tbody> <tr> <td>Parts:</td> <td>0.00</td> </tr> <tr> <td>Labor:</td> <td>6.50</td> </tr> <tr> <td>Labor Hours:</td> <td>0.10</td> </tr> <tr> <td>Sublet Parts:</td> <td>0.00</td> </tr> <tr> <td>Sublet Labor:</td> <td>0.00</td> </tr> <tr> <td>Activity Sub Total</td> <td>6.50</td> </tr> </tbody> </table>				Activity 5 Sub Total		Parts:	0.00	Labor:	6.50	Labor Hours:	0.10	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	6.50
Activity 5 Sub Total																				
Parts:	0.00																			
Labor:	6.50																			
Labor Hours:	0.10																			
Sublet Parts:	0.00																			
Sublet Labor:	0.00																			
Activity Sub Total	6.50																			



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 53066255
Invoice No. 55345 - 53066255

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Needs front and rear brakes job		Ford E450 Champion Challenger	
Requested By:	RGASPARD	Status:	40 - Closed (40)
Created By:	RGASPARD	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	196,301 - DH

Activity Header					
Activity:15 013/000/000 BRAKES					
Activity Note: Needs front and rear brakes job					
Reason for Repair:		39 Natural Causes			
Work Accomplished:		03 Replace New			
Part Failure:		44 Worn			
Activity Comments:					
Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
05-Dec-19	8C2Z-2V001-D	PADS, BRAKE, DISC, FRONT	1	48.87	48.87
Activity Labor					
Booked Date	Technician	Hours	Shop Rate	Extended	
05-Dec-19	Gaspard,Ronald	1.45	65	94.25	
Activity Sublet					
No Data Available					
Activity Checklist					
No Data Available					
No Data Available					
Activity Sub Total					
			Activity 15 Sub Total		
			Parts:	48.87	
			Labor:	94.25	
			Labor Hours:	1.45	
			Sublet Parts:	0.00	
			Sublet Labor:	0.00	
			Activity Sub Total	143.12	



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 53066255
Invoice No. 55345 - 53066255

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Needs front and rear brakes job		Ford E450 Champion Challenger	
Requested By:	RGASPARD	Status:	40 - Closed (40)
Created By:	RGASPARD	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	196,301 - DH

Activity Header
Activity:25 013/000/000 BRAKES
Activity Note: Rear brakes
Reason for Repair: 39 Natural Causes
Work Accomplished: 03 Replace New
Part Failure: 44 Worn
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
05-Dec-19	9C2Z-2V200-B	PADS, BRAKE, DISC, REAR SAME AS BRSD1329B	1	46.22	46.22

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
05-Dec-19	Gaspard,Ronald	1.5	65	97.5

Activity Sublet
No Data Available


Activity Checklist
No Data Available
No Data Available

Activity Sub Total	
Activity 25 Sub Total	
Parts:	46.22
Labor:	97.50
Labor Hours:	1.50
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	143.72

Work Order Footer	
Work Order 53066255 Total	
Parts:	95.09
Labor:	198.25
Labor Hours:	3.05
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	293.34



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 53060992
Invoice No. 55345 - 53060992

Client Department:

Department: 55345M

Work Order Description

Brake booster leaking oil

Requested By: JAPEREZ

Created By: JAPEREZ

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 196,202 - DH

Chronology

Reported	Dec 4, 2019 1:09:54 PM	Dec 4, 2019 1:09:54 PM
Started	Dec 4, 2019 12:00:00 AM	
Completed	Dec 4, 2019 2:48:40 PM	Dec 4, 2019 2:48:40 PM
Down Time		

Work Order Notes

Line 10 To file warranty be sure to do the following:

- 1) Enter a COMPLAINT statement for each activity.
- 2) Enter CAUSE statement in the Notes field of each activity.
- 3) Enter CORRECTION statement in the Comment section of each activity.

Complaint:brake booster leaking oil

Cause: check booster found internal failure of brake booster

Correction:replaced brake booster retest and road test vehicle ok at this time

Part:

1 new brake booster dc2z-2005-a

Activity Header

Activity:5 999 TOTAL VEHICLE

Activity Note: Personal Risk Assessment

Reason for Repair: SW Shop Work Order

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: Personal Risk Assessment

Check List	
------------	--

Task: PRA and Meter Readings Performed by: JAPEREZ Performed on: 04-DEC-19

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		JAPEREZ	Dec 4, 2019 1:22:44 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		JAPEREZ	Dec 4, 2019 1:22:44 PM	No	
3 - Are you wearing the appropriate PPE?	Done		JAPEREZ	Dec 4, 2019 1:22:44 PM	No	
4 - Have you performed the proper LOTO?	Done		JAPEREZ	Dec 4, 2019 1:22:44 PM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		JAPEREZ	Dec 4, 2019 1:22:44 PM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		JAPEREZ	Dec 4, 2019 1:22:44 PM	No	
20 - Miles			JAPEREZ	Dec 4, 2019 1:22:44 PM	No	
30 - Kilometers			JAPEREZ	Dec 4, 2019 1:22:44 PM	No	
40 - Hours			JAPEREZ	Dec 4, 2019 1:22:44 PM	No	

Activity Sub Total	
--------------------	--

Activity 5 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 53060992
Invoice No. 55345 - 53060992

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Brake booster leaking oil		Ford E450 Champion Challenger	
Requested By:	JAPEREZ	Status:	40 - Closed (40)
Created By:	JAPEREZ	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	196,202 - DH

Activity Header
Activity:15 013 BRAKES
Activity Note: Brake booster leaking oil
Reason for Repair: 05 Inspection, Routine
Work Accomplished:
Part Failure:
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
04-Dec-19	DC2Z-2005-A	BOOSTER, BRAKE, POWER, HYDRAULIC SAME AS BRB-103	1	188.55	188.55

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
04-Dec-19	Perez,Javier	2.5	65	162.5

Activity Sublet
No Data Available


Activity Checklist
No Data Available
No Data Available

Activity Sub Total		Activity 15 Sub Total	
Parts:			188.55
Labor:			162.50
Labor Hours:			2.50
Sublet Parts:			0.00
Sublet Labor:			0.00
Activity Sub Total			351.05

Work Order Footer		Work Order 53060992 Total	
Parts:			188.55
Labor:			162.50
Labor Hours:			2.50
Sublet Parts:			0.00
Sublet Labor:			0.00
Activity Sub Total			351.05



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 52878022
Invoice No. 55345 - 52878022

Client Department:

Department: 55345M

Work Order Description

PM B

Requested By: RRENE

Created By: RRENE

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 192,124 - DH

Chronology

Reported	Nov 5, 2019 12:00:00 AM	Nov 5, 2019 12:00:00 AM
Started		
Completed	Nov 6, 2019 10:19:16 AM	Nov 6, 2019 10:19:16 AM
Down Time		

Work Order Notes

Line 10 COMPLAINT:PMB Service

CAUSE:preventive maintenance

CORRECTION: Performed and completed PMB Service

Activity Header

Activity:10 999 TOTAL VEHICLE

Activity Note: Light Medium Duty PMI

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: Light Medium Duty PMI

Task: First Transit Light-Medium Duty PMI Performed by: NPIERRE-LOUIS Performed on: 06-NOV-19

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,000 - SECTION 1 Preparation and Drive On (In Lot) Inspection	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
10,100 - Safety Inspection	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
10,110 - FRA Check Drivers Pre-trip or DVIR/EVIR & Authorization Forms	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
10,120 - FRA Check All Warning Lights and Alarms	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
10,130 - FRA Check Automatic Transmission Neutral Start Operation	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
10,140 - Check Service Brakes	Done		NPIERRE-	Nov 6, 2019	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
			LOUIS	9:36:14 AM		
10,150 - FRA Start Engine and Listen for Any Unusual Noises	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
10,160 - FRA Check Instruments and Horns	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
10,170 - Check Fast Idle	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
10,180 - Check Starter Protection Circuit	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
10,190 - Check Reverse Warning System	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
11,100 - Check Parking Brake	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
11,110 - Check HVAC Switches and Other Controls	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
11,120 - FRA Inspect Windshields, Mirror and Sun Visor Condition	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
11,130 - FRA Check Wiper and Washer Operation	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
11,140 - Road Test: Check for Proper Operation	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
11,150 - Perform Brake Test	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
11,152 - Decelerometer Results Test 1	0 FEET		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
11,154 - Decelerometer Results Test 2	0 FEET		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
11,156 - Decelerometer Results Test 3	0 FEET		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
11,161 - FRA Check/Record Oil Pressure / @1500 rpm	0 Pounds per Square Inch		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
11,162 - FRA Check/Record Water Temperature	0 Degree Fahrenheit		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
11,170 - FRA Check Door Operation	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
11,180 - FRA Check Operation of All Other Accessories	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
20,000 - SECTION 2 Interior Circle Inspection	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
20,210 - Check Condition of Operator's Area	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
20,220 - Check Accelerator and Brake Pedals	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
20,230 - FRA Check Wiring Under Dash	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
20,240 - FRA Check Interior Lights	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
20,250 - FRA Check Interior Electrical Panels	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
20,260 - Check Stop Request System	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
20,270 - Check Fare Box Mounting (If	Done		NPIERRE-	Nov 6, 2019	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
Applicable)			LOUIS	9:36:14 AM		
20,280 - Check Seats, Seat Belts, Hand Rails and Floor Covering	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
20,290 - Check for Physical Damage, Water Leaks, and Graffiti	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
22,100 - Check Emergency Windows and Glass Condition	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
22,110 - Check Emergency Hatches	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
22,120 - Check All Safety Equipment	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
30,000 - SECTION 3 Exterior Circle Inspection	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
30,310 - Check Passenger Doors	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
30,320 - Inspect Step-well and Hand Rails	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
30,330 - Check Wheelchair Lift Operation	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
30,340 - FRA Check Destination Sign and Run Box	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
30,350 - FRA Inspect Mirror and Mountings	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
30,360 - Check for Physical Damage and Decals	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
30,370 - Check Wiper Blade and Arm Condition	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
30,380 - Check Exterior Compartment Doors	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
30,390 - FRA Check Fuel Tank Cap	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
33,100 - Check Lights and Reflectors	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
33,110 - Check License Plate, Permits and State Inspection Decals	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
40,000 - SECTION 4 Engine Compartment Inspection	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
40,410 - FRA Check Engine Compartment/Condition for Fire Risk	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
40,420 - Check Hood	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
40,430 - Check Fan, Shroud and Radiator	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
40,440 - Test Coolant System Using Test Strips and Record Results	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
40,441 - Inhibitor Test Pass or Fail (Indicate with a Yes or No)	Yes		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
40,442 - Freeze Point	0 Degree Fahrenheit		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
40,450 - FRA Check Coolant Recovery System Condition & for Leaks	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
40,460 - Record Antifreeze Protection Level	Done		NPIERRE-	Nov 6, 2019	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
Using Refractometer			LOUIS	9:36:14 AM		
40,461 - Refractometer Reading	0 Degree Fahrenheit		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
40,470 - Pressure Test Cooling System and Check for Leaks	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
40,480 - FRA Check Coolant Hose Condition	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
40,490 - FRA Check Alternator Mount and Condition	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
44,100 - FRA Check Fuel Control and Transmission Connections	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
44,110 - FRA Check Master Cylinder Fluid Level	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
44,120 - FRA Check All Belts for Condition, Alignment and Tension	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
44,130 - FRA Check Exhaust System	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
44,140 - FRA Check Intake System	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
44,150 - FRA Inspect Turbocharger	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
44,160 - FRA Inspect Power Steering and Hydraulic Fluid	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
44,170 - FRA Check All Engine or Belt Driven Components	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
44,180 - FRA Check for Leaks	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
44,190 - FRA Perform Battery Inspection	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
44,200 - FRA Check Battery Box Corrosion, Cables and Hold-Downs	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
50,000 - SECTION 5 Steering System Inspection	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
50,510 - Check Entire Steering System	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
60,000 - SECTION 6 Tires and Wheel Inspection	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
60,610 - FRA Check and Record Air Pressure	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
60,611 - Air Pressure RF	65 Pounds per Square Inch		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
60,612 - Air Pressure LF	65 Pounds per Square Inch		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
60,613 - Air Pressure RRO	70 Pounds per Square Inch		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
60,614 - Air Pressure RRI	70 Pounds per Square Inch		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
60,615 - Air Pressure LRI	70 Pounds per Square Inch		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
60,616 - Air Pressure LRO	70 Pounds per Square Inch		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
60,620 - Check Valve Stems and Caps	Done		NPIERRE-	Nov 6, 2019	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
			LOUIS	9:36:14 AM		
60,630 - Check and Record Tread Depth	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
60,631 - Tread Depth RF	8 32nds of an inch		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
60,632 - Tread Depth LF	9 32nds of an inch		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
60,633 - Tread Depth RRO	8 32nds of an inch		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
60,634 - Tread Depth RRI	8 32nds of an inch		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
60,635 - Tread Depth LRI	7 32nds of an inch		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
60,636 - Tread Depth LRO	7 32nds of an inch		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
60,640 - Check for Mismatched Tread or Casing Design	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
60,650 - Check Sidewall Wear	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
60,660 - Inspect for Cuts and Tears	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
60,670 - Check Dual Mating With Square	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
60,680 - Check Wheels for Cracks and Loose Lugs	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
60,690 - Check Tires for Irregular or Alignment Wear	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
66,100 - FRA Check Outer Hubs for Leaks	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
70,000 - SECTION 7 Under Vehicle Inspection	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
70,710 - Check Vibration Damper	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
70,720 - Check Engine and Transmission Mounts	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
70,730 - FRA Check Starter	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
70,740 - FRA Check Bottom of Engine for Fluid Leaks	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
70,750 - FRA Check Transmission for Leaks	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
70,760 - FRA Check Differential Breather and Fluid	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
70,770 - FRA Check Exhaust System	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
70,780 - Check Driveline, U-joint and Slip Yokes	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
70,790 - Check All Body Mounts and Chassis Frame	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
77,100 - FRA Check Security, Integrity and Length of Ground Straps	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
77,110 - FRA Check Fuel Tank	Done		NPIERRE-	Nov 6, 2019	No	


Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
			LOUIS	9:36:14 AM		
77,120 - Check Suspension Components	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
77,130 - FRA Check Brake Pad Thickness and Rotor for Wear	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
77,131 - Brake Pad Thickness LF	6 Inch		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
77,132 - Brake Pad Thickness RF	6 Inch		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
77,133 - Brake Pad Thickness LR	5 Inch		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
77,134 - Brake Pad Thickness RR	5 Inch		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
77,135 - Brake Rotor LF	41.9 Inch		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
77,136 - Brake Rotor RF	41.9 Inch		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
77,137 - Brake Rotor LR	35.9 Inch		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
77,138 - Brake Rotor RR	35.9 Inch		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
77,140 - FRA Check Brake Hoses	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
77,150 - Check King Pins	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
77,160 - FRA Check for Loose or Noisy Wheel Bearings	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
80,000 - SECTION 8 PMI Report Completion	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
80,810 - Completion of PMI Report	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
90,000 - SECTION 9 Completion of PMI	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	
90,910 - Vehicle Returned to predetermined location	Done		NPIERRE-LOUIS	Nov 6, 2019 9:36:14 AM	No	

Activity Sub Total

Activity 10 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 52878022
Invoice No. 55345 - 52878022

Client Department:

Department: 55345M

Work Order Description

PM B

Requested By: RRENE

Created By: RRENE

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 192,124 - DH

Activity Header

Activity: 20 999 TOTAL VEHICLE

Activity Note: PM B

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: B PM Level B

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
06-Nov-19	B329(F)	GOING OUT OF SERVICE SEE BALDWIN B329 IN THE FLEET ORG. FILTER, OIL, SPIN-ON	1	1.96	1.96

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List						
20 Desc: PM B Task: PM B SERVICE Performed by: NPIERRE-LOUIS Performed on: 06-NOV-19						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
100,000 - "A" PMI SERVICING ITEMS	Done		NPIERRE-LOUIS	Nov 6, 2019 9:37:42 AM	No	
101,000 - FRA Change Oil Filters	Yes		NPIERRE-LOUIS	Nov 6, 2019 9:37:42 AM	No	
102,000 - FRA Drain Engine Oil	Yes		NPIERRE-LOUIS	Nov 6, 2019 9:37:42 AM	No	
103,000 - FRA Check Transmission Fluid	Done		NPIERRE-LOUIS	Nov 6, 2019 9:37:42 AM	No	
104,000 - Lubricate Chassis	Done		NPIERRE-LOUIS	Nov 6, 2019 9:37:42 AM	No	
105,000 - Replace or Clean A/C Filters	Done		NPIERRE-LOUIS	Nov 6, 2019 9:37:42 AM	No	
107,000 - FRA Change Primary Fuel Filter	Yes		NPIERRE-LOUIS	Nov 6, 2019 9:37:42 AM	No	
108,000 - Lube all pivoting Mechanisms	Done		NPIERRE-LOUIS	Nov 6, 2019 9:37:42 AM	No	
200,000 - "B" PMI SERVICING ITEMS (12 MONTH)	Done		NPIERRE-LOUIS	Nov 6, 2019 9:37:42 AM	No	


Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
201,000 - Service Crankcase Breather	Done		NPIERRE-LOUIS	Nov 6, 2019 9:37:42 AM	No	
203,000 - FRA Change Automatic Transmission Fluid	Yes		NPIERRE-LOUIS	Nov 6, 2019 9:37:42 AM	No	
204,000 - FRA Change Power Steering Fluid and Filter	Yes		NPIERRE-LOUIS	Nov 6, 2019 9:37:42 AM	No	
205,000 - Complete Engine Diagnostics and Clear Codes when Completed	Done		NPIERRE-LOUIS	Nov 6, 2019 9:37:42 AM	No	

Activity Sub Total

Activity 20 Sub Total	
Parts:	1.96
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	1.96



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 52878022
Invoice No. 55345 - 52878022

Client Department:

Department: 55345M

Work Order Description

PM B

Requested By: RRENE

Created By: RRENE

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 192,124 - DH

Activity Header

Activity: 30 999 TOTAL VEHICLE

Activity Note: PRAMETER

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

30 Desc: PRAMETER

Task: PRA and Meter Readings Performed by: NPIERRE-LOUIS Performed on: 06-NOV-19

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		NPIERRE-LOUIS	Nov 6, 2019 9:30:49 AM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		NPIERRE-LOUIS	Nov 6, 2019 9:30:49 AM	No	
3 - Are you wearing the appropriate PPE?	Done		NPIERRE-LOUIS	Nov 6, 2019 9:30:49 AM	No	
4 - Have you performed the proper LOTO?	Done		NPIERRE-LOUIS	Nov 6, 2019 9:30:49 AM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		NPIERRE-LOUIS	Nov 6, 2019 9:30:49 AM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		NPIERRE-LOUIS	Nov 6, 2019 9:30:49 AM	No	
20 - Miles			NPIERRE-LOUIS	Nov 6, 2019 9:30:49 AM	No	
30 - Kilometers			NPIERRE-LOUIS	Nov 6, 2019 9:30:49 AM	No	
40 - Hours			NPIERRE-LOUIS	Nov 6, 2019 9:30:49 AM	No	

Activity Sub Total

Activity 30 Sub Total

Parts: 0.00

Labor: 0.00

	Labor Hours:	0.00
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	0.00
Work Order Footer		
	Work Order 52878022 Total	
	Parts:	1.96
	Labor:	0.00
	Labor Hours:	0.00
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	1.96



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 52876091
Invoice No. 55345 - 52876091

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Engine belt		Ford E450 Champion Challenger	
Requested By:	TDELVA	Status:	40 - Closed (40)
Created By:	TDELVA	Priority:	-
Assigned To:		Driver:	
Class:	-	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	187,405 - DH

Chronology

Reported	Oct 8, 2019 2:34:15 PM	Oct 8, 2019 2:34:15 PM
Started	Oct 8, 2019 12:00:00 AM	
Completed	Oct 9, 2019 9:35:08 AM	Oct 9, 2019 9:35:08 AM
Down Time		

Work Order Notes

Line 10 Replaced engine belt
Replaced bearings/pulley

Activity Header

Activity: 10 999/999/999 TOTAL VEHICLE
Activity Note: PERSONAL RISK ASSESMENT
Reason for Repair: 05 Inspection, Routine
Work Accomplished: 06 Inspect
Part Failure: 00 No Failure
Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
08-Oct-19	Delva, Terry	0.6333333	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: PERSONAL RISK ASSESMENT
Task: PRA and Meter Readings Performed by: TDELVA Performed on: 08-OCT-19

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		TDELVA	Oct 8, 2019 3:33:06 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		TDELVA	Oct 8, 2019 3:33:06 PM	No	
3 - Are you wearing the appropriate PPE?	Done		TDELVA	Oct 8, 2019 3:33:06 PM	No	
4 - Have you performed the proper LOTO?	Done		TDELVA	Oct 8, 2019 3:33:06 PM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		TDELVA	Oct 8, 2019 3:33:06 PM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		TDELVA	Oct 8, 2019 3:33:06 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
20 - Miles			TDELVA	Oct 8, 2019 3:33:06 PM	No	
30 - Kilometers			TDELVA	Oct 8, 2019 3:33:06 PM	No	
40 - Hours			TDELVA	Oct 8, 2019 3:33:06 PM	No	
Activity Sub Total			Activity 10 Sub Total			
			Parts: 0.00			
			Labor: 0.00			
			Labor Hours: 0.63			
			Sublet Parts: 0.00			
			Sublet Labor: 0.00			
			Activity Sub Total 0.00			



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 52876091
Invoice No. 55345 - 52876091

Client Department:		Equipment No.:	4514-P
Department:	55345M	VIN:	1FDFE4FS7EDB17176
Work Order Description			Ford E450 Champion Challenger
Engine belt		Status:	40 - Closed (40)
Requested By:	TDELVA	Priority:	-
Created By:	TDELVA	Driver:	
Assigned To:		Phone:	
Class:	-	ETA:	
Arrangement:	Unassigned	Meter:	187,405 - DH
Potential Warranty:	No		

Activity Header
Activity:20 040/000/000 ENGINE/MOTOR SYSTEMS GROUP
Activity Note:
Reason for Repair: 39 Natural Causes
Work Accomplished: 03 Replace New
Part Failure: 99 Replaced Before Failure
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
08-Oct-19	1360K6	BELT, SERPENTINE, 6-RIB, 136.00" SAME AS 5061360	1	21.01	21.01
08-Oct-19	6203	BEARING, SHAFT, STEERING, POWER	2	2.54	5.08

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
08-Oct-19	Delva,Terry	1.9	0	0

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available

Activity Sub Total		Activity 20 Sub Total	
Parts:	26.09	Labor:	0.00
Labor Hours:	1.90	Sublet Parts:	0.00
Sublet Labor:	0.00	Sublet Labor:	0.00
Activity Sub Total		26.09	

Work Order Footer		Work Order 52876091 Total	
Parts:	26.09	Labor:	0.00
Labor Hours:	2.53	Sublet Parts:	0.00
Sublet Labor:	0.00	Sublet Labor:	0.00
Activity Sub Total		26.09	



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 52778369
Invoice No. 55345 - 52778369

Client Department:

Department: 55345M

Work Order Description

PM A

Requested By: AOWENS

Created By: AOWENS

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 187,405 - DH

Chronology

Reported	Oct 7, 2019 2:17:26 PM	Oct 7, 2019 2:17:26 PM
Started	Oct 8, 2019 12:00:00 AM	
Completed	Oct 9, 2019 8:07:27 AM	Oct 9, 2019 8:07:27 AM
Down Time		

Work Order Notes

Line 10 COMPLAINT: PMA

CAUSE: Service due

CORRECTION: Performed and completed pmA

Lubricate all Pivoting Points

Activity Header

Activity: 10 999 TOTAL VEHICLE

Activity Note: Light Medium Duty PMI

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: A PM Level A

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
08-Oct-19	Delva,Terry	1.3833333	0	0
08-Oct-19	Delva,Terry	1.4333333	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: Light Medium Duty PMI

Task: First Transit Light-Medium Duty PMI Performed by: TDELVA Performed on: 08-OCT-19

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,000 - SECTION 1 Preparation and Drive On (In Lot) Inspection	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
10,100 - Safety Inspection	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
10,110 - FRA Check Drivers Pre-trip or DVIR/EVIR & Authorization Forms	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
10,120 - FRA Check All Warning Lights and	Done		TDELVA	Oct 8, 2019	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
Alarms				3:45:54 PM		
10,130 - FRA Check Automatic Transmission Neutral Start Operation	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
10,140 - Check Service Brakes	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
10,150 - FRA Start Engine and Listen for Any Unusual Noises	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
10,160 - FRA Check Instruments and Horns	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
10,170 - Check Fast Idle	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
10,180 - Check Starter Protection Circuit	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
10,190 - Check Reverse Warning System	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
11,100 - Check Parking Brake	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
11,110 - Check HVAC Switches and Other Controls	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
11,120 - FRA Inspect Windshields, Mirror and Sun Visor Condition	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
11,130 - FRA Check Wiper and Washer Operation	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
11,140 - Road Test: Check for Proper Operation	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
11,150 - Perform Brake Test	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
11,152 - Decelerometer Results Test 1	FEET	na	TDELVA	Oct 8, 2019 3:45:54 PM	No	
11,154 - Decelerometer Results Test 2	FEET	na	TDELVA	Oct 8, 2019 3:45:54 PM	No	
11,156 - Decelerometer Results Test 3	FEET	na	TDELVA	Oct 8, 2019 3:45:54 PM	No	
11,161 - FRA Check/Record Oil Pressure / @1500 rpm	Pounds per Square Inch	na	TDELVA	Oct 8, 2019 3:45:54 PM	No	
11,162 - FRA Check/Record Water Temperature	Degree Fahrenheit	na	TDELVA	Oct 8, 2019 3:45:54 PM	No	
11,170 - FRA Check Door Operation	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
11,180 - FRA Check Operation of All Other Accessories	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
20,000 - SECTION 2 Interior Circle Inspection	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
20,210 - Check Condition of Operator's Area	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
20,220 - Check Accelerator and Brake Pedals	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
20,230 - FRA Check Wiring Under Dash	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
20,240 - FRA Check Interior Lights	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
20,250 - FRA Check Interior Electrical Panels	Done		TDELVA	Oct 8, 2019	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
				3:45:54 PM		
20,260 - Check Stop Request System	-	na	TDELVA	Oct 8, 2019 3:45:54 PM	No	
20,270 - Check Fare Box Mounting (If Applicable)	-	na	TDELVA	Oct 8, 2019 3:45:54 PM	No	
20,280 - Check Seats, Seat Belts, Hand Rails and Floor Covering	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
20,290 - Check for Physical Damage, Water Leaks, and Graffiti	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
22,100 - Check Emergency Windows and Glass Condition	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
22,110 - Check Emergency Hatches	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
22,120 - Check All Safety Equipment	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
30,000 - SECTION 3 Exterior Circle Inspection	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
30,310 - Check Passenger Doors	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
30,320 - Inspect Step-well and Hand Rails	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
30,330 - Check Wheelchair Lift Operation	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
30,340 - FRA Check Destination Sign and Run Box	-	na	TDELVA	Oct 8, 2019 3:45:54 PM	No	
30,350 - FRA Inspect Mirror and Mountings	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
30,360 - Check for Physical Damage and Decals	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
30,370 - Check Wiper Blade and Arm Condition	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
30,380 - Check Exterior Compartment Doors	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
30,390 - FRA Check Fuel Tank Cap	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
33,100 - Check Lights and Reflectors	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
33,110 - Check License Plate, Permits and State Inspection Decals	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
40,000 - SECTION 4 Engine Compartment Inspection	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
40,410 - FRA Check Engine Compartment/Condition for Fire Risk	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
40,420 - Check Hood	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
40,430 - Check Fan, Shroud and Radiator	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
40,440 - Test Coolant System Using Test Strips and Record Results	-	na	TDELVA	Oct 8, 2019 3:45:54 PM	No	
40,441 - Inhibitor Test Pass or Fail (Indicate with a Yes or No)	No	na	TDELVA	Oct 8, 2019 3:45:54 PM	No	
40,442 - Freeze Point	Degree	na	TDELVA	Oct 8, 2019	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
	Fahrenheit			3:45:54 PM		
40,450 - FRA Check Coolant Recovery System Condition & for Leaks	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
40,460 - Record Antifreeze Protection Level Using Refractometer	-	na	TDELVA	Oct 8, 2019 3:45:54 PM	No	
40,461 - Refractometer Reading	Degree Fahrenheit	na	TDELVA	Oct 8, 2019 3:45:54 PM	No	
40,470 - Pressure Test Cooling System and Check for Leaks	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
40,480 - FRA Check Coolant Hose Condition	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
40,490 - FRA Check Alternator Mount and Condition	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
44,100 - FRA Check Fuel Control and Transmission Connections	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
44,110 - FRA Check Master Cylinder Fluid Level	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
44,120 - FRA Check All Belts for Condition, Alignment and Tension	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
44,130 - FRA Check Exhaust System	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
44,140 - FRA Check Intake System	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
44,150 - FRA Inspect Turbocharger	-	na	TDELVA	Oct 8, 2019 3:45:54 PM	No	
44,160 - FRA Inspect Power Steering and Hydraulic Fluid	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
44,170 - FRA Check All Engine or Belt Driven Components	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
44,180 - FRA Check for Leaks	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
44,190 - FRA Perform Battery Inspection	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
44,200 - FRA Check Battery Box Corrosion, Cables and Hold-Downs	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
50,000 - SECTION 5 Steering System Inspection	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
50,510 - Check Entire Steering System	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
60,000 - SECTION 6 Tires and Wheel Inspection	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
60,610 - FRA Check and Record Air Pressure	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
60,611 - Air Pressure RF	65 Pounds per Square Inch		TDELVA	Oct 8, 2019 3:45:54 PM	No	
60,612 - Air Pressure LF	65 Pounds per Square Inch		TDELVA	Oct 8, 2019 3:45:54 PM	No	
60,613 - Air Pressure RRO	65 Pounds per Square Inch		TDELVA	Oct 8, 2019 3:45:54 PM	No	
60,614 - Air Pressure RRI	65 Pounds per Square Inch		TDELVA	Oct 8, 2019 3:45:54 PM	No	
60,615 - Air Pressure LRI	65 Pounds per		TDELVA	Oct 8, 2019	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
	Square Inch			3:45:54 PM		
60,616 - Air Pressure LRO	65 Pounds per Square Inch		TDELVA	Oct 8, 2019 3:45:54 PM	No	
60,620 - Check Valve Stems and Caps	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
60,630 - Check and Record Tread Depth	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
60,631 - Tread Depth RF	12 32nds of an inch		TDELVA	Oct 8, 2019 3:45:54 PM	No	
60,632 - Tread Depth LF	12 32nds of an inch		TDELVA	Oct 8, 2019 3:45:54 PM	No	
60,633 - Tread Depth RRO	11 32nds of an inch		TDELVA	Oct 8, 2019 3:45:54 PM	No	
60,634 - Tread Depth RRI	11 32nds of an inch		TDELVA	Oct 8, 2019 3:45:54 PM	No	
60,635 - Tread Depth LRI	10 32nds of an inch		TDELVA	Oct 8, 2019 3:45:54 PM	No	
60,636 - Tread Depth LRO	10 32nds of an inch		TDELVA	Oct 8, 2019 3:45:54 PM	No	
60,640 - Check for Mismatched Tread or Casing Design	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
60,650 - Check Sidewall Wear	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
60,660 - Inspect for Cuts and Tears	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
60,670 - Check Dual Mating With Square	-	na	TDELVA	Oct 8, 2019 3:45:54 PM	No	
60,680 - Check Wheels for Cracks and Loose Lugs	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
60,690 - Check Tires for Irregular or Alignment Wear	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
66,100 - FRA Check Outer Hubs for Leaks	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
70,000 - SECTION 7 Under Vehicle Inspection	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
70,710 - Check Vibration Damper	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
70,720 - Check Engine and Transmission Mounts	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
70,730 - FRA Check Starter	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
70,740 - FRA Check Bottom of Engine for Fluid Leaks	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
70,750 - FRA Check Transmission for Leaks	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
70,760 - FRA Check Differential Breather and Fluid	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
70,770 - FRA Check Exhaust System	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
70,780 - Check Driveline, U-joint and Slip Yokes	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
70,790 - Check All Body Mounts and Chassis	Done		TDELVA	Oct 8, 2019	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
Frame				3:45:54 PM		
77,100 - FRA Check Security, Integrity and Length of Ground Straps	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
77,110 - FRA Check Fuel Tank	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
77,120 - Check Suspension Components	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
77,130 - FRA Check Brake Pad Thickness and Rotor for Wear	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
77,131 - Brake Pad Thickness LF	8 Inch		TDELVA	Oct 8, 2019 3:45:54 PM	No	
77,132 - Brake Pad Thickness RF	8 Inch		TDELVA	Oct 8, 2019 3:45:54 PM	No	
77,133 - Brake Pad Thickness LR	8 Inch		TDELVA	Oct 8, 2019 3:45:54 PM	No	
77,134 - Brake Pad Thickness RR	8 Inch		TDELVA	Oct 8, 2019 3:45:54 PM	No	
77,135 - Brake Rotor LF	38.7 Inch		TDELVA	Oct 8, 2019 3:45:54 PM	No	
77,136 - Brake Rotor RF	38.7 Inch		TDELVA	Oct 8, 2019 3:45:54 PM	No	
77,137 - Brake Rotor LR	37.5 Inch		TDELVA	Oct 8, 2019 3:45:54 PM	No	
77,138 - Brake Rotor RR	37.6 Inch		TDELVA	Oct 8, 2019 3:45:54 PM	No	
77,140 - FRA Check Brake Hoses	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
77,150 - Check King Pins	-	na	TDELVA	Oct 8, 2019 3:45:54 PM	No	
77,160 - FRA Check for Loose or Noisy Wheel Bearings	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
80,000 - SECTION 8 PMI Report Completion	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
80,810 - Completion of PMI Report	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
90,000 - SECTION 9 Completion of PMI	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	
90,910 - Vehicle Returned to predetermined location	Done		TDELVA	Oct 8, 2019 3:45:54 PM	No	

Activity Sub Total

Activity 10 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	2.82
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 52778369
Invoice No. 55345 - 52778369

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
PM A		Ford E450 Champion Challenger	
Requested By:	AOWENS	Status:	40 - Closed (40)
Created By:	AOWENS	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	187,405 - DH

Activity Header
Activity:20 999 TOTAL VEHICLE
Activity Note: PM A
Reason for Repair: 08 Preventive Maintenance
Work Accomplished: A PM Level A
Part Failure:
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
08-Oct-19	B329(F)	GOING OUT OF SERVICE SEE BALDWIN B329 IN THE FLEET ORG. FILTER, OIL, SPIN-ON	1	1.96	1.96

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
08-Oct-19	Delva,Terry	0.5	0	0

Activity Sublet
No Data Available

Activity Checklist						
Check List						
20 Desc: PM A						
Task: PM A SERVICE Performed by: TDELVA Performed on: 08-OCT-19						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
100,000 - "A" PMI SERVICING ITEMS	Done		TDELVA	Oct 8, 2019 3:49:22 PM	No	
101,000 - FRA Change Oil Filters	Yes		TDELVA	Oct 8, 2019 3:49:22 PM	No	
102,000 - FRA Drain Engine Oil	Yes		TDELVA	Oct 8, 2019 3:49:22 PM	No	
103,000 - FRA Check Transmission Fluid	Done		TDELVA	Oct 8, 2019 3:49:22 PM	No	
104,000 - Lubricate Chassis	Done		TDELVA	Oct 8, 2019 3:49:22 PM	No	
105,000 - Replace or Clean A/C Filters	Done		TDELVA	Oct 8, 2019 3:49:22 PM	No	
107,000 - FRA Change Primary Fuel Filter	No	na	TDELVA	Oct 8, 2019 3:49:22 PM	No	
108,000 - Lube all pivoting Mechanisms	Done		TDELVA	Oct 8, 2019 3:49:22 PM	No	

Activity Sub Total

Activity 20 Sub Total	
Parts:	1.96
Labor:	0.00
Labor Hours:	0.50
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	1.96



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 52778369
Invoice No. 55345 - 52778369

Client Department:

Department: 55345M

Work Order Description

PM A

Requested By: AOWENS

Created By: AOWENS

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 187,405 - DH

Activity Header

Activity: 30 999 TOTAL VEHICLE

Activity Note: PRAMETER

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
08-Oct-19	Delva,Terry	0.5	0	0
08-Oct-19	Delva,Terry	0.5833333	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

30 Desc: PRAMETER

Task: PRA and Meter Readings Performed by: TDELVA Performed on: 08-OCT-19

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		TDELVA	Oct 8, 2019 3:49:53 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		TDELVA	Oct 8, 2019 3:49:53 PM	No	
3 - Are you wearing the appropriate PPE?	Done		TDELVA	Oct 8, 2019 3:49:53 PM	No	
4 - Have you performed the proper LOTO?	Done		TDELVA	Oct 8, 2019 3:49:53 PM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		TDELVA	Oct 8, 2019 3:49:53 PM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		TDELVA	Oct 8, 2019 3:49:53 PM	No	
20 - Miles			TDELVA	Oct 8, 2019 3:49:53 PM	No	
30 - Kilometers			TDELVA	Oct 8, 2019 3:49:53 PM	No	
40 - Hours			TDELVA	Oct 8, 2019 3:49:53 PM	No	

Activity Sub Total

	Activity 30 Sub Total	
	Parts:	0.00
	Labor:	0.00
	Labor Hours:	1.08
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	0.00
Work Order Footer		
	Work Order 52778369 Total	
	Parts:	1.96
	Labor:	0.00
	Labor Hours:	4.40
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	1.96



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 52842579
Invoice No. 55345 - 52842579

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Replaced radiator		Ford E450 Champion Challenger	
Requested By:	VAMRITTEEMAL	Status:	40 - Closed (40)
Created By:	VAMRITTEEMAL	Priority:	-
Assigned To:		Driver:	
Class:	-	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	185,773 - DH

Chronology

Reported	Sep 29, 2019 3:24:14 PM	Sep 29, 2019 3:24:14 PM
Started	Sep 29, 2019 12:00:00 AM	
Completed	Sep 30, 2019 10:52:55 AM	Sep 30, 2019 10:52:55 AM
Down Time		

Work Order Notes

Line 10 Replaced radiator
Pressure tested and test driven no problem at this time

Activity Header

Activity: 10 999/999/999 TOTAL VEHICLE
Activity Note: PERSONAL RISK ASSESMENT
Reason for Repair: 05 Inspection, Routine
Work Accomplished: 06 Inspect
Part Failure: 00 No Failure
Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
29-Sep-19	AMRIT TEEMAL,VISHNU	0.2666666	65	17.333329

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: PERSONAL RISK ASSESMENT
Task: PRA and Meter Readings Performed by: VAMRITTEEMAL Performed on: 29-SEP-19

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		VAMRITTEEMAL	Sep 29, 2019 3:28:14 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		VAMRITTEEMAL	Sep 29, 2019 3:28:14 PM	No	
3 - Are you wearing the appropriate PPE?	Done		VAMRITTEEMAL	Sep 29, 2019 3:28:14 PM	No	
4 - Have you performed the proper LOTO?	Done		VAMRITTEEMAL	Sep 29, 2019 3:28:14 PM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		VAMRITTEEMAL	Sep 29, 2019 3:28:14 PM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		VAMRITTEEMAL	Sep 29, 2019 3:28:14 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
20 - Miles			VAMRITTEEMAL	Sep 29, 2019 3:28:14 PM	No	
30 - Kilometers			VAMRITTEEMAL	Sep 29, 2019 3:28:14 PM	No	
40 - Hours			VAMRITTEEMAL	Sep 29, 2019 3:28:14 PM	No	

Activity Sub Total

Activity 10 Sub Total

Parts:	0.00
Labor:	17.33
Labor Hours:	0.27
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	17.33



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 52842579
Invoice No. 55345 - 52842579

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Replaced radiator		Ford E450 Champion Challenger	
Requested By:	VAMRITTEEMAL	Status:	40 - Closed (40)
Created By:	VAMRITTEEMAL	Priority:	-
Assigned To:		Driver:	
Class:	-	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	185,773 - DH

Activity Header
Activity:20 042/000/000 COOLING SYSTEM
Activity Note:
Reason for Repair: 05 Inspection, Routine
Work Accomplished: 03 Replace New
Part Failure:
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
29-Sep-19	G1000382282CSF	RADIATOR, E450	1	119.89	119.89

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
29-Sep-19	AMRIT TEEMAL,VISHNU	2	65	130

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available

Activity Sub Total		Activity 20 Sub Total	
Parts:	119.89	Labor:	130.00
Labor Hours:	2.00	Labor Parts:	0.00
Sublet Parts:	0.00	Sublet Labor:	0.00
Sublet Labor:	0.00	Activity Sub Total	249.89

Work Order Footer		Work Order 52842579 Total	
Parts:	119.89	Labor:	147.33
Labor Hours:	2.27	Labor Parts:	0.00
Sublet Parts:	0.00	Sublet Labor:	0.00
Sublet Labor:	0.00	Activity Sub Total	267.22



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 52675930
Invoice No. 55345 - 52675930

Client Department:

Department: 55345M

Work Order Description

PM A

Requested By: HPIERRE

Created By: HPIERRE

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 182,719 - DH

Chronology

Reported	Sep 10, 2019 10:32:40 AM	Sep 10, 2019 10:32:40 AM
Started	Sep 10, 2019 12:00:00 AM	
Completed	Sep 10, 2019 10:08:00 PM	Sep 10, 2019 10:08:00 PM
Down Time		

Work Order Notes

Line 10 COMPLAINT: PMA SERVICE

CAUSE: PREVENTIVE MAINTENANCE

CORRECTION: PERFORM AND COMPLETED PMA SERVICE
REPLACED DRAIN PLUG

Activity Header

Activity: 10 999 TOTAL VEHICLE

Activity Note: Light Medium Duty PMI

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: A PM Level A

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
10-Sep-19	AMRIT TEEMAL,VISHNU	1.5	65	97.5

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: Light Medium Duty PMI

Task: First Transit Light-Medium Duty PMI Performed by: VAMRITTEEMAL Performed on: 10-SEP-19

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,000 - SECTION 1 Preparation and Drive On (In Lot) Inspection	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
10,100 - Safety Inspection	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
10,110 - FRA Check Drivers Pre-trip or DVIR/EVIR & Authorization Forms	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
10,120 - FRA Check All Warning Lights and Alarms	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,130 - FRA Check Automatic Transmission Neutral Start Operation	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
10,140 - Check Service Brakes	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
10,150 - FRA Start Engine and Listen for Any Unusual Noises	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
10,160 - FRA Check Instruments and Horns	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
10,170 - Check Fast Idle	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
10,180 - Check Starter Protection Circuit	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
10,190 - Check Reverse Warning System	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
11,100 - Check Parking Brake	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
11,110 - Check HVAC Switches and Other Controls	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
11,120 - FRA Inspect Windshields, Mirror and Sun Visor Condition	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
11,130 - FRA Check Wiper and Washer Operation	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
11,140 - Road Test: Check for Proper Operation	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
11,150 - Perform Brake Test	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
11,152 - Decelerometer Results Test 1	FEET	n/a	VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
11,154 - Decelerometer Results Test 2	FEET	n/a	VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
11,156 - Decelerometer Results Test 3	FEET	n/a	VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
11,161 - FRA Check/Record Oil Pressure / @1500 rpm	Pounds per Square Inch	n/a	VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
11,162 - FRA Check/Record Water Temperature	Degree Fahrenheit	n/a	VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
11,170 - FRA Check Door Operation	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
11,180 - FRA Check Operation of All Other Accessories	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
20,000 - SECTION 2 Interior Circle Inspection	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
20,210 - Check Condition of Operator's Area	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
20,220 - Check Accelerator and Brake Pedals	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
20,230 - FRA Check Wiring Under Dash	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
20,240 - FRA Check Interior Lights	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
20,250 - FRA Check Interior Electrical Panels	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
20,260 - Check Stop Request System	-	n/a	VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
20,270 - Check Fare Box Mounting (If Applicable)	-	n/a	VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
20,280 - Check Seats, Seat Belts, Hand Rails and Floor Covering	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
20,290 - Check for Physical Damage, Water Leaks, and Graffiti	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
22,100 - Check Emergency Windows and Glass Condition	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
22,110 - Check Emergency Hatches	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
22,120 - Check All Safety Equipment	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
30,000 - SECTION 3 Exterior Circle Inspection	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
30,310 - Check Passenger Doors	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
30,320 - Inspect Step-well and Hand Rails	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
30,330 - Check Wheelchair Lift Operation	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
30,340 - FRA Check Destination Sign and Run Box	-	n/a	VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
30,350 - FRA Inspect Mirror and Mountings	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
30,360 - Check for Physical Damage and Decals	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
30,370 - Check Wiper Blade and Arm Condition	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
30,380 - Check Exterior Compartment Doors	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
30,390 - FRA Check Fuel Tank Cap	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
33,100 - Check Lights and Reflectors	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
33,110 - Check License Plate, Permits and State Inspection Decals	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
40,000 - SECTION 4 Engine Compartment Inspection	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
40,410 - FRA Check Engine Compartment/Condition for Fire Risk	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
40,420 - Check Hood	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
40,430 - Check Fan, Shroud and Radiator	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
40,440 - Test Coolant System Using Test Strips and Record Results	-	n/a	VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
40,441 - Inhibitor Test Pass or Fail (Indicate with a Yes or No)	No	n/a	VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
40,442 - Freeze Point	Degree Fahrenheit	n/a	VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
40,450 - FRA Check Coolant Recovery System Condition & for Leaks	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
40,460 - Record Antifreeze Protection Level Using Refractometer	-	n/a	VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
40,461 - Refractometer Reading	Degree Fahrenheit	n/a	VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
40,470 - Pressure Test Cooling System and Check for Leaks	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
40,480 - FRA Check Coolant Hose Condition	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
40,490 - FRA Check Alternator Mount and Condition	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
44,100 - FRA Check Fuel Control and Transmission Connections	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
44,110 - FRA Check Master Cylinder Fluid Level	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
44,120 - FRA Check All Belts for Condition, Alignment and Tension	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
44,130 - FRA Check Exhaust System	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
44,140 - FRA Check Intake System	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
44,150 - FRA Inspect Turbocharger	-	n/a	VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
44,160 - FRA Inspect Power Steering and Hydraulic Fluid	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
44,170 - FRA Check All Engine or Belt Driven Components	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
44,180 - FRA Check for Leaks	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
44,190 - FRA Perform Battery Inspection	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
44,200 - FRA Check Battery Box Corrosion, Cables and Hold-Downs	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
50,000 - SECTION 5 Steering System Inspection	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
50,510 - Check Entire Steering System	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
60,000 - SECTION 6 Tires and Wheel Inspection	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
60,610 - FRA Check and Record Air Pressure	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
60,611 - Air Pressure RF	70 Pounds per Square Inch		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
60,612 - Air Pressure LF	70 Pounds per Square Inch		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
60,613 - Air Pressure RRO	70 Pounds per Square Inch		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
60,614 - Air Pressure RRI	70 Pounds per Square Inch		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
60,615 - Air Pressure LRI	70 Pounds per Square Inch		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
60,616 - Air Pressure LRO	70 Pounds per Square Inch		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
60,620 - Check Valve Stems and Caps	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
60,630 - Check and Record Tread Depth	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
60,631 - Tread Depth RF	10 32nds of an inch		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
60,632 - Tread Depth LF	10 32nds of an inch		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
60,633 - Tread Depth RRO	10 32nds of an inch		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
60,634 - Tread Depth RRI	10 32nds of an inch		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
60,635 - Tread Depth LRI	10 32nds of an inch		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
60,636 - Tread Depth LRO	10 32nds of an inch		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
60,640 - Check for Mismatched Tread or Casing Design	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
60,650 - Check Sidewall Wear	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
60,660 - Inspect for Cuts and Tears	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
60,670 - Check Dual Mating With Square	-	n/a	VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
60,680 - Check Wheels for Cracks and Loose Lugs	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
60,690 - Check Tires for Irregular or Alignment Wear	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
66,100 - FRA Check Outer Hubs for Leaks	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
70,000 - SECTION 7 Under Vehicle Inspection	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
70,710 - Check Vibration Damper	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
70,720 - Check Engine and Transmission Mounts	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
70,730 - FRA Check Starter	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
70,740 - FRA Check Bottom of Engine for Fluid Leaks	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
70,750 - FRA Check Transmission for Leaks	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
70,760 - FRA Check Differential Breather and Fluid	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
70,770 - FRA Check Exhaust System	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
70,780 - Check Driveline, U-joint and Slip Yokes	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
70,790 - Check All Body Mounts and Chassis Frame	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
77,100 - FRA Check Security, Integrity and Length of Ground Straps	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
77,110 - FRA Check Fuel Tank	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
77,120 - Check Suspension Components	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
77,130 - FRA Check Brake Pad Thickness and Rotor for Wear	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
77,131 - Brake Pad Thickness LF	7 Inch		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
77,132 - Brake Pad Thickness RF	7 Inch		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
77,133 - Brake Pad Thickness LR	9 Inch		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
77,134 - Brake Pad Thickness RR	9 Inch		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
77,135 - Brake Rotor LF	39.88 Inch		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
77,136 - Brake Rotor RF	39.87 Inch		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
77,137 - Brake Rotor LR	35.89 Inch		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
77,138 - Brake Rotor RR	35.89 Inch		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
77,140 - FRA Check Brake Hoses	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
77,150 - Check King Pins	-	n/a	VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
77,160 - FRA Check for Loose or Noisy Wheel Bearings	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
80,000 - SECTION 8 PMI Report Completion	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
80,810 - Completion of PMI Report	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
90,000 - SECTION 9 Completion of PMI	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	
90,910 - Vehicle Returned to predetermined location	Done		VAMRITTEEMAL	Sep 10, 2019 3:47:27 PM	No	

Activity Sub Total

Activity 10 Sub Total

Parts:	0.00
Labor:	97.50
Labor Hours:	1.50
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	97.50



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 52675930
Invoice No. 55345 - 52675930

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
PM A		Ford E450 Champion Challenger	
Requested By:	HPIERRE	Status:	40 - Closed (40)
Created By:	HPIERRE	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	182,719 - DH

Activity Header
Activity:20 999 TOTAL VEHICLE
Activity Note: PM A
Reason for Repair: 08 Preventive Maintenance
Work Accomplished: A PM Level A
Part Failure:
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
10-Sep-19	65266	PLUG, DRAIN, OIL, ENGINE	1	4.35	4.35
10-Sep-19	B329(F)	GOING OUT OF SERVICE SEE BALDWIN B329 IN THE FLEET ORG. FILTER, OIL, SPIN-ON	1	1.96	1.96

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
10-Sep-19	AMRIT TEEMAL,VISHNU	1	65	65

Activity Sublet
No Data Available

Activity Checklist						
Check List						
20 Desc: PM A						
Task: PM A SERVICE Performed by: VAMRITTEEMAL Performed on: 10-SEP-19						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
100,000 - "A" PMI SERVICING ITEMS	Done		VAMRITTEEMAL	Sep 10, 2019 3:48:15 PM	No	
101,000 - FRA Change Oil Filters	Yes		VAMRITTEEMAL	Sep 10, 2019 3:48:15 PM	No	
102,000 - FRA Drain Engine Oil	Yes		VAMRITTEEMAL	Sep 10, 2019 3:48:15 PM	No	
103,000 - FRA Check Transmission Fluid	Done		VAMRITTEEMAL	Sep 10, 2019 3:48:15 PM	No	
104,000 - Lubricate Chassis	Done		VAMRITTEEMAL	Sep 10, 2019 3:48:15 PM	No	
105,000 - Replace or Clean A/C Filters	Done		VAMRITTEEMAL	Sep 10, 2019 3:48:15 PM	No	
107,000 - FRA Change Primary Fuel Filter	No	n/a	VAMRITTEEMAL	Sep 10, 2019 3:48:15 PM	No	
108,000 - Lube all pivoting Mechanisms	Done		VAMRITTEEMAL	Sep 10, 2019 3:48:15 PM	No	

Activity Sub Total															
	<table> <tr> <td colspan="2">Activity 20 Sub Total</td></tr> <tr> <td>Parts:</td><td>6.31</td></tr> <tr> <td>Labor:</td><td>65.00</td></tr> <tr> <td>Labor Hours:</td><td>1.00</td></tr> <tr> <td>Sublet Parts:</td><td>0.00</td></tr> <tr> <td>Sublet Labor:</td><td>0.00</td></tr> <tr> <td>Activity Sub Total</td><td>71.31</td></tr> </table>	Activity 20 Sub Total		Parts:	6.31	Labor:	65.00	Labor Hours:	1.00	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	71.31
Activity 20 Sub Total															
Parts:	6.31														
Labor:	65.00														
Labor Hours:	1.00														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	71.31														



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 52675930
Invoice No. 55345 - 52675930

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
PM A		Ford E450 Champion Challenger	
Requested By:	HPIERRE	Status:	40 - Closed (40)
Created By:	HPIERRE	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	182,719 - DH

Activity Header
Activity:30 999 TOTAL VEHICLE
Activity Note: PRAMETER
Reason for Repair: 05 Inspection, Routine
Work Accomplished: 06 Inspect
Part Failure:
Activity Comments:

Activity Parts
No Data Available

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
10-Sep-19	AMRIT TEEMAL,VISHNU	0.2666666	65	17.333329

Activity Sublet
No Data Available


Check List						
30 Desc: PRAMETER Task: PRA and Meter Readings Performed by: VAMRITTEEMAL Performed on: 10-SEP-19						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		VAMRITTEEMAL	Sep 10, 2019 3:52:28 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		VAMRITTEEMAL	Sep 10, 2019 3:52:28 PM	No	
3 - Are you wearing the appropriate PPE?	Done		VAMRITTEEMAL	Sep 10, 2019 3:52:28 PM	No	
4 - Have you performed the proper LOTO?	Done		VAMRITTEEMAL	Sep 10, 2019 3:52:28 PM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		VAMRITTEEMAL	Sep 10, 2019 3:52:28 PM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		VAMRITTEEMAL	Sep 10, 2019 3:52:28 PM	No	
20 - Miles			VAMRITTEEMAL	Sep 10, 2019 3:52:28 PM	No	
30 - Kilometers			VAMRITTEEMAL	Sep 10, 2019 3:52:28 PM	No	
40 - Hours			VAMRITTEEMAL	Sep 10, 2019 3:52:28 PM	No	

Activity Sub Total	Activity 30 Sub Total
---------------------------	------------------------------

	Parts:	0.00
	Labor:	17.33
	Labor Hours:	0.27
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	17.33
Work Order Footer		
	Work Order 52675930 Total	
	Parts:	6.31
	Labor:	179.83
	Labor Hours:	2.77
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	186.14



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 52594526
Invoice No. 55345 - 52594526

Client Department:

Department: 55345M

Work Order Description

PM C

Requested By: DARTHURS

Created By: DARTHURS

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 178,348 - DH

Chronology

Reported	Aug 9, 2019 11:00:15 AM	Aug 9, 2019 11:00:15 AM
Started		
Completed	Aug 9, 2019 11:31:00 AM	Aug 9, 2019 11:31:00 AM
Down Time		

Work Order Notes

Line 10 PMC

Preventive maintenance

Perform PMC Service lube all Pivoting Points Cross Rotate Tires Completed

Activity Header

Activity: 10 999 TOTAL VEHICLE

Activity Note: Light Medium Duty PMI

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: Light Medium Duty PMI

Task: First Transit Light-Medium Duty PMI Performed by: HPIERRE Performed on: 09-AUG-19

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,000 - SECTION 1 Preparation and Drive On (In Lot) Inspection	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
10,100 - Safety Inspection	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
10,110 - FRA Check Drivers Pre-trip or DVIR/EVIR & Authorization Forms	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
10,120 - FRA Check All Warning Lights and Alarms	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
10,130 - FRA Check Automatic Transmission Neutral Start Operation	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
10,140 - Check Service Brakes	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,150 - FRA Start Engine and Listen for Any Unusual Noises	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
10,160 - FRA Check Instruments and Horns	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
10,170 - Check Fast Idle	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
10,180 - Check Starter Protection Circuit	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
10,190 - Check Reverse Warning System	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
11,100 - Check Parking Brake	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
11,110 - Check HVAC Switches and Other Controls	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
11,120 - FRA Inspect Windshields, Mirror and Sun Visor Condition	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
11,130 - FRA Check Wiper and Washer Operation	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
11,140 - Road Test: Check for Proper Operation	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
11,150 - Perform Brake Test	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
11,152 - Decelerometer Results Test 1	FEET	N/A	HPIERRE	Aug 9, 2019 11:21:11 AM	No	
11,154 - Decelerometer Results Test 2	FEET	N/A	HPIERRE	Aug 9, 2019 11:21:11 AM	No	
11,156 - Decelerometer Results Test 3	FEET	N/A	HPIERRE	Aug 9, 2019 11:21:11 AM	No	
11,161 - FRA Check/Record Oil Pressure / @1500 rpm	1500 Pounds per Square Inch	N/A	HPIERRE	Aug 9, 2019 11:21:11 AM	No	
11,162 - FRA Check/Record Water Temperature	190 Degree Fahrenheit	N/A	HPIERRE	Aug 9, 2019 11:21:11 AM	No	
11,170 - FRA Check Door Operation	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
11,180 - FRA Check Operation of All Other Accessories	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
20,000 - SECTION 2 Interior Circle Inspection	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
20,210 - Check Condition of Operator's Area	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
20,220 - Check Accelerator and Brake Pedals	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
20,230 - FRA Check Wiring Under Dash	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
20,240 - FRA Check Interior Lights	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
20,250 - FRA Check Interior Electrical Panels	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
20,260 - Check Stop Request System	-	N/A	HPIERRE	Aug 9, 2019 11:21:11 AM	No	
20,270 - Check Fare Box Mounting (If Applicable)	-	N/A	HPIERRE	Aug 9, 2019 11:21:11 AM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
20,280 - Check Seats, Seat Belts, Hand Rails and Floor Covering	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
20,290 - Check for Physical Damage, Water Leaks, and Graffiti	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
22,100 - Check Emergency Windows and Glass Condition	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
22,110 - Check Emergency Hatches	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
22,120 - Check All Safety Equipment	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
30,000 - SECTION 3 Exterior Circle Inspection	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
30,310 - Check Passenger Doors	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
30,320 - Inspect Step-well and Hand Rails	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
30,330 - Check Wheelchair Lift Operation	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
30,340 - FRA Check Destination Sign and Run Box	-	N/A	HPIERRE	Aug 9, 2019 11:21:11 AM	No	
30,350 - FRA Inspect Mirror and Mountings	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
30,360 - Check for Physical Damage and Decals	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
30,370 - Check Wiper Blade and Arm Condition	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
30,380 - Check Exterior Compartment Doors	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
30,390 - FRA Check Fuel Tank Cap	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
33,100 - Check Lights and Reflectors	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
33,110 - Check License Plate, Permits and State Inspection Decals	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
40,000 - SECTION 4 Engine Compartment Inspection	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
40,410 - FRA Check Engine Compartment/Condition for Fire Risk	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
40,420 - Check Hood	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
40,430 - Check Fan, Shroud and Radiator	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
40,440 - Test Coolant System Using Test Strips and Record Results	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
40,441 - Inhibitor Test Pass or Fail (Indicate with a Yes or No)	No	N/A	HPIERRE	Aug 9, 2019 11:21:11 AM	No	
40,442 - Freeze Point	Degree Fahrenheit	N/A	HPIERRE	Aug 9, 2019 11:21:11 AM	No	
40,450 - FRA Check Coolant Recovery System Condition & for Leaks	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
40,460 - Record Antifreeze Protection Level Using Refractometer	-	N/A	HPIERRE	Aug 9, 2019 11:21:11 AM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
40,461 - Refractometer Reading	Degree Fahrenheit	N/A	HPIERRE	Aug 9, 2019 11:21:11 AM	No	
40,470 - Pressure Test Cooling System and Check for Leaks	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
40,480 - FRA Check Coolant Hose Condition	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
40,490 - FRA Check Alternator Mount and Condition	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
44,100 - FRA Check Fuel Control and Transmission Connections	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
44,110 - FRA Check Master Cylinder Fluid Level	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
44,120 - FRA Check All Belts for Condition, Alignment and Tension	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
44,130 - FRA Check Exhaust System	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
44,140 - FRA Check Intake System	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
44,150 - FRA Inspect Turbocharger	-	N/A	HPIERRE	Aug 9, 2019 11:21:11 AM	No	
44,160 - FRA Inspect Power Steering and Hydraulic Fluid	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
44,170 - FRA Check All Engine or Belt Driven Components	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
44,180 - FRA Check for Leaks	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
44,190 - FRA Perform Battery Inspection	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
44,200 - FRA Check Battery Box Corrosion, Cables and Hold-Downs	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
50,000 - SECTION 5 Steering System Inspection	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
50,510 - Check Entire Steering System	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
60,000 - SECTION 6 Tires and Wheel Inspection	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
60,610 - FRA Check and Record Air Pressure	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
60,611 - Air Pressure RF	65 Pounds per Square Inch		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
60,612 - Air Pressure LF	65 Pounds per Square Inch		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
60,613 - Air Pressure RRO	70 Pounds per Square Inch		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
60,614 - Air Pressure RRI	70 Pounds per Square Inch		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
60,615 - Air Pressure LRI	70 Pounds per Square Inch		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
60,616 - Air Pressure LRO	70 Pounds per Square Inch		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
60,620 - Check Valve Stems and Caps	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
60,630 - Check and Record Tread Depth	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
60,631 - Tread Depth RF	12 32nds of an inch		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
60,632 - Tread Depth LF	12 32nds of an inch		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
60,633 - Tread Depth RRO	10 32nds of an inch		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
60,634 - Tread Depth RRI	10 32nds of an inch		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
60,635 - Tread Depth LRI	10 32nds of an inch		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
60,636 - Tread Depth LRO	10 32nds of an inch		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
60,640 - Check for Mismatched Tread or Casing Design	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
60,650 - Check Sidewall Wear	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
60,660 - Inspect for Cuts and Tears	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
60,670 - Check Dual Mating With Square	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
60,680 - Check Wheels for Cracks and Loose Lugs	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
60,690 - Check Tires for Irregular or Alignment Wear	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
66,100 - FRA Check Outer Hubs for Leaks	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
70,000 - SECTION 7 Under Vehicle Inspection	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
70,710 - Check Vibration Damper	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
70,720 - Check Engine and Transmission Mounts	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
70,730 - FRA Check Starter	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
70,740 - FRA Check Bottom of Engine for Fluid Leaks	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
70,750 - FRA Check Transmission for Leaks	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
70,760 - FRA Check Differential Breather and Fluid	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
70,770 - FRA Check Exhaust System	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
70,780 - Check Driveline, U-joint and Slip Yokes	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
70,790 - Check All Body Mounts and Chassis Frame	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
77,100 - FRA Check Security, Integrity and Length of Ground Straps	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
77,110 - FRA Check Fuel Tank	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	


Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
77,120 - Check Suspension Components	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
77,130 - FRA Check Brake Pad Thickness and Rotor for Wear	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
77,131 - Brake Pad Thickness LF	10 Inch		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
77,132 - Brake Pad Thickness RF	10 Inch		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
77,133 - Brake Pad Thickness LR	12 Inch		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
77,134 - Brake Pad Thickness RR	12 Inch		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
77,135 - Brake Rotor LF	1.6 Inch		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
77,136 - Brake Rotor RF	1.6 Inch		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
77,137 - Brake Rotor LR	1.7 Inch		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
77,138 - Brake Rotor RR	1.7 Inch		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
77,140 - FRA Check Brake Hoses	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
77,150 - Check King Pins	-	N/A	HPIERRE	Aug 9, 2019 11:21:11 AM	No	
77,160 - FRA Check for Loose or Noisy Wheel Bearings	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
80,000 - SECTION 8 PMI Report Completion	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
80,810 - Completion of PMI Report	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
90,000 - SECTION 9 Completion of PMI	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	
90,910 - Vehicle Returned to predetermined location	Done		HPIERRE	Aug 9, 2019 11:21:11 AM	No	

Activity Sub Total

Activity 10 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 52594526
Invoice No. 55345 - 52594526

Client Department:

Department: 55345M

Work Order Description

PM C

Requested By: DARTHURS

Created By: DARTHURS

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 178,348 - DH

Activity Header

Activity: 20 999 TOTAL VEHICLE

Activity Note: PM C

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: C PM Level C

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
09-Aug-19	B329(F)	GOING OUT OF SERVICE SEE BALDWIN B329 IN THE FLEET ORG. FILTER, OIL, SPIN-ON	1	1.96	1.96

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List						
20 Desc: PM C Task: PM C SERVICE Performed by: HPIERRE Performed on: 09-AUG-19						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
100,000 - "A" PMI SERVICING ITEMS	Done		HPIERRE	Aug 9, 2019 11:23:17 AM	No	
101,000 - FRA Change Oil Filters	Yes		HPIERRE	Aug 9, 2019 11:23:17 AM	No	
102,000 - FRA Drain Engine Oil	Yes		HPIERRE	Aug 9, 2019 11:23:17 AM	No	
103,000 - FRA Check Transmission Fluid	Done		HPIERRE	Aug 9, 2019 11:23:17 AM	No	
104,000 - Lubricate Chassis	Done		HPIERRE	Aug 9, 2019 11:23:17 AM	No	
105,000 - Replace or Clean A/C Filters	Done		HPIERRE	Aug 9, 2019 11:23:17 AM	No	
107,000 - FRA Change Primary Fuel Filter	Done		HPIERRE	Aug 9, 2019 11:23:17 AM	No	
108,000 - Lube all pivoting Mechanisms	Done		HPIERRE	Aug 9, 2019 11:23:17 AM	No	
200,000 - "B" PMI SERVICING ITEMS (12 MONTH)	Done		HPIERRE	Aug 9, 2019 11:23:17 AM	No	


Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
201,000 - Service Crankcase Breather	Done		HPIERRE	Aug 9, 2019 11:23:17 AM	No	
203,000 - FRA Change Automatic Transmission Fluid	Yes		HPIERRE	Aug 9, 2019 11:23:17 AM	No	
204,000 - FRA Change Power Steering Fluid and Filter	No		HPIERRE	Aug 9, 2019 11:23:17 AM	No	
205,000 - Complete Engine Diagnostics and Clear Codes when Completed	Done		HPIERRE	Aug 9, 2019 11:23:17 AM	No	
300,000 - "C" PMI SERVICING ITEMS (24 MONTH)	Done		HPIERRE	Aug 9, 2019 11:23:17 AM	No	
301,000 - Check and Lubricate Door Linkages	Done		HPIERRE	Aug 9, 2019 11:23:17 AM	No	
302,000 - Check Toe-In and Record Reading	-	NA	HPIERRE	Aug 9, 2019 11:23:17 AM	No	
302,001 - Record Toe-In Reading	Inches, fraction-actual	N/A	HPIERRE	Aug 9, 2019 11:23:17 AM	No	
304,000 - 1st "C" PMI ONLY: Tune Up Per Engine Mfg's Specifications	No		HPIERRE	Aug 9, 2019 11:23:17 AM	No	
305,000 - FRA Change Differential Fluid	Yes		HPIERRE	Aug 9, 2019 11:23:17 AM	No	

Activity Sub Total

Activity 20 Sub Total	
Parts:	1.96
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	1.96



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 52594526
Invoice No. 55345 - 52594526

Client Department:

Department: 55345M

Work Order Description

PM C

Requested By: DARTHURS

Created By: DARTHURS

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 178,348 - DH

Activity Header

Activity: 30 999 TOTAL VEHICLE

Activity Note: PRAMETER

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

30 Desc: PRAMETER

Task: PRA and Meter Readings Performed by: HPIERRE Performed on: 09-AUG-19

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		HPIERRE	Aug 9, 2019 11:27:19 AM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		HPIERRE	Aug 9, 2019 11:27:19 AM	No	
3 - Are you wearing the appropriate PPE?	Done		HPIERRE	Aug 9, 2019 11:27:19 AM	No	
4 - Have you performed the proper LOTO?	Done		HPIERRE	Aug 9, 2019 11:27:19 AM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		HPIERRE	Aug 9, 2019 11:27:19 AM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		HPIERRE	Aug 9, 2019 11:27:19 AM	No	
20 - Miles			HPIERRE	Aug 9, 2019 11:27:19 AM	No	
30 - Kilometers	7		HPIERRE	Aug 9, 2019 11:27:19 AM	No	
40 - Hours	6		HPIERRE	Aug 9, 2019 11:27:19 AM	No	

Activity Sub Total

Activity 30 Sub Total


Parts: 0.00

Labor: 0.00

	Labor Hours:	0.00
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	0.00
Work Order Footer		
	Work Order 52594526 Total	
	Parts:	1.96
	Labor:	0.00
	Labor Hours:	0.00
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	1.96



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 52655682
Invoice No. 55345 - 52655682

Client Department:

Department: 55345M

Work Order Description

Replace spring on lift flap

Requested By: AOWENS

Created By: AOWENS

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 177,170 - DH

Chronology

Reported	Aug 1, 2019 9:33:00 PM	Aug 1, 2019 9:33:00 PM
Started	Aug 1, 2019 12:00:00 AM	
Completed	Aug 1, 2019 9:47:00 PM	Aug 1, 2019 9:47:00 PM
Down Time		

Work Order Notes

Line 10 To file warranty be sure to do the following:

- 1) Enter a COMPLAINT statement for each activity.
- 2) Enter CAUSE statement in the Notes field of each activity.
- 3) Enter CORRECTION statement in the Comment section of each activity.

Complaint: Flap will not go up

Cause: Shocks no good

Correction: replace shocks

Activity Header

Activity: 5 999 TOTAL VEHICLE

Activity Note: Personal Risk Assessment

Reason for Repair: SW Shop Work Order

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
01-Aug-19	Owens, Arthur	0.2	65	13

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: Personal Risk Assessment

Task: PRA and Meter Readings Performed by: AOWENS Performed on: 01-AUG-19

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		AOWENS	Aug 1, 2019	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
				9:45:31 PM		
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		AOWENS	Aug 1, 2019 9:45:31 PM	No	
3 - Are you wearing the appropriate PPE?	Done		AOWENS	Aug 1, 2019 9:45:31 PM	No	
4 - Have you performed the proper LOTO?	Done		AOWENS	Aug 1, 2019 9:45:31 PM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		AOWENS	Aug 1, 2019 9:45:31 PM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		AOWENS	Aug 1, 2019 9:45:31 PM	No	
20 - Miles			AOWENS	Aug 1, 2019 9:45:31 PM	No	
30 - Kilometers			AOWENS	Aug 1, 2019 9:45:31 PM	No	
40 - Hours			AOWENS	Aug 1, 2019 9:45:31 PM	No	

Activity Sub Total

Activity 5 Sub Total

Parts:	0.00
Labor:	13.00
Labor Hours:	0.20
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	13.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 52655682
Invoice No. 55345 - 52655682

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Replace spring on lift flap		Ford E450 Champion Challenger	
Requested By:	AOWENS	Status:	40 - Closed (40)
Created By:	AOWENS	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	177,170 - DH

Activity Header
Activity: 15 068/003/000 SYSTEM, HYDRAULIC, LIFTING/UNLOADING
Activity Note: Wheel chair flap shocks
Reason for Repair: 05 Inspection, Routine
Work Accomplished: 03 Replace New
Part Failure:
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
01-Aug-19	32831	SPRING, SHOCK, GAS, W/C	2	26.63	53.26

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
01-Aug-19	Owens,Arthur	1.5	65	97.5

Activity Sublet
No Data Available


Activity Checklist
No Data Available
No Data Available

Activity Sub Total															
<table><tr><th colspan="2">Activity 15 Sub Total</th></tr><tr><td>Parts:</td><td>53.26</td></tr><tr><td>Labor:</td><td>97.50</td></tr><tr><td>Labor Hours:</td><td>1.50</td></tr><tr><td>Sublet Parts:</td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td>150.76</td></tr></table>	Activity 15 Sub Total		Parts:	53.26	Labor:	97.50	Labor Hours:	1.50	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	150.76	
Activity 15 Sub Total															
Parts:	53.26														
Labor:	97.50														
Labor Hours:	1.50														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	150.76														

Work Order Footer															
<table><tr><th colspan="2">Work Order 52655682 Total</th></tr><tr><td>Parts:</td><td>53.26</td></tr><tr><td>Labor:</td><td>110.50</td></tr><tr><td>Labor Hours:</td><td>1.70</td></tr><tr><td>Sublet Parts:</td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td>163.76</td></tr></table>	Work Order 52655682 Total		Parts:	53.26	Labor:	110.50	Labor Hours:	1.70	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	163.76	
Work Order 52655682 Total															
Parts:	53.26														
Labor:	110.50														
Labor Hours:	1.70														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	163.76														



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 52634058
Invoice No. 55345 - 52634058

Client Department:

Department: 55345M

Work Order Description

Front A/C not working and rear A/C work only on high

Requested By: NPIERRE-LOUIS

Created By: NPIERRE-LOUIS

Assigned To:

Class: -

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: -

Driver:

Phone:

ETA:

Meter: 176,110 - DH

Chronology

Reported	Jul 25, 2019 11:34:40 AM	Jul 25, 2019 11:34:40 AM
Started	Jul 25, 2019 12:00:00 AM	
Completed	Jul 25, 2019 2:04:27 PM	Jul 25, 2019 2:04:27 PM
Down Time		

Work Order Notes

Line 10 Driver complaint: front A/C is not working and rear a/c blow only on high

Tech found: Front a/c blower not working and bad rear blower Resistor

Replaced: front blower motor and rear blower motor Resistor

Parts : blower, xc2z-19805-na. Resistor - 04210303a

Activity Header

Activity: 10 999/999/999 TOTAL VEHICLE

Activity Note: PERSONAL RISK ASSESMENT

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure: 00 No Failure

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: PERSONAL RISK ASSESMENT

Task: PRA and Meter Readings Performed by: NPIERRE-LOUIS Performed on: 25-JUL-19

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		NPIERRE-LOUIS	Jul 25, 2019 11:51:35 AM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		NPIERRE-LOUIS	Jul 25, 2019 11:51:35 AM	No	
3 - Are you wearing the appropriate PPE?	Done		NPIERRE-LOUIS	Jul 25, 2019 11:51:35 AM	No	
4 - Have you performed the proper LOTO?	Done		NPIERRE-LOUIS	Jul 25, 2019 11:51:35 AM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		NPIERRE-LOUIS	Jul 25, 2019 11:51:35 AM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		NPIERRE-LOUIS	Jul 25, 2019 11:51:35 AM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
20 - Miles			NPIERRE-LOUIS	Jul 25, 2019 11:51:35 AM	No	
30 - Kilometers			NPIERRE-LOUIS	Jul 25, 2019 11:51:35 AM	No	
40 - Hours			NPIERRE-LOUIS	Jul 25, 2019 11:51:35 AM	No	
Activity Sub Total			Activity 10 Sub Total			
			Parts: 0.00			
			Labor: 0.00			
			Labor Hours: 0.00			
			Sublet Parts: 0.00			
			Sublet Labor: 0.00			
			Activity Sub Total 0.00			



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 52634058
Invoice No. 55345 - 52634058

Client Department:

Department: 55345M

Work Order Description

Front A/C not working and rear A/C work only on high

Requested By: NPIERRE-LOUIS

Created By: NPIERRE-LOUIS

Assigned To:

Class: -

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: -

Driver:

Phone:

ETA:

Meter: 176,110 - DH

Activity Header

Activity: 20 001/000/000 AIR CONDITIONING, HEATING AND VENTILATION

Activity Note:

Reason for Repair: 04 Driver's Report

Work Accomplished: 03 Replace New

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
25-Jul-19	04210303A	TERMINAL, RESISTOR	1	17.82	17.82
25-Jul-19	XC2Z-19805-BA	MOTOR, BLOWER SAME AS MM-840	1	36.37	36.37

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
25-Jul-19	NELSON PIERRE-LOUIS	2.5	65	162.5

Activity Sublet

No Data Available

Activity Checklist

No Data Available

No Data Available

Activity Sub Total

Activity 20 Sub Total

Parts:	54.19
Labor:	162.50
Labor Hours:	2.50
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	216.69

Work Order Footer

Work Order 52634058 Total

Parts:	54.19
Labor:	162.50
Labor Hours:	2.50
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	216.69



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 52633105
Invoice No. 55345 - 52633105

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Coolant resevoir leaking		Ford E450 Champion Challenger	
Requested By:	HPIERRE	Status:	40 - Closed (40)
Created By:	HPIERRE	Priority:	2 - Medium
Assigned To:		Driver:	
Class:	-	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	176,110 - DH

Chronology

Reported	Jul 25, 2019 8:03:52 AM	Jul 25, 2019 8:03:52 AM
Started		
Completed	Jul 25, 2019 8:16:00 AM	Jul 25, 2019 8:16:00 AM
Down Time		

Work Order Notes

Line 10 Coolant reservoir leaking

Preventive maintenance

Replace coolant reservoir add coolant completed

Activity Header

Activity: 10 999/999/999 TOTAL VEHICLE

Activity Note:

Reason for Repair: SW Shop Work Order

Work Accomplished: 06 Inspect

Part Failure: 00 No Failure

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
25-Jul-19	8C2Z-8A080-C	TANK, SURGE, COOLANT	1	80.17	80.17

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc:

Task: PRA and Meter Readings Performed by: HPIERRE Performed on: 25-JUL-19

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		HPIERRE	Jul 25, 2019 8:11:38 AM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		HPIERRE	Jul 25, 2019 8:11:38 AM	No	
3 - Are you wearing the appropriate PPE?	Done		HPIERRE	Jul 25, 2019 8:11:38 AM	No	
4 - Have you performed the proper LOTO?	Done		HPIERRE	Jul 25, 2019 8:11:38 AM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		HPIERRE	Jul 25, 2019 8:11:38 AM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		HPIERRE	Jul 25, 2019 8:11:38 AM	No	
20 - Miles			HPIERRE	Jul 25, 2019 8:11:38 AM	No	
30 - Kilometers	4		HPIERRE	Jul 25, 2019 8:11:38 AM	No	
40 - Hours	1		HPIERRE	Jul 25, 2019 8:11:38 AM	No	

Activity Sub Total

Activity 10 Sub Total

Parts:	80.17
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	80.17



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 52633105
Invoice No. 55345 - 52633105

Client Department:		Equipment No.:	4514-P
Department:	55345M	VIN:	1FDFE4FS7EDB17176
Work Order Description			Ford E450 Champion Challenger
Coolant resevoir leaking		Status:	40 - Closed (40)
Requested By:	HPIERRE	Priority:	2 - Medium
Created By:	HPIERRE	Driver:	
Assigned To:		Phone:	
Class:	-	ETA:	
Arrangement:	Unassigned	Meter:	176,110 - DH
Potential Warranty:	No		

Activity Header															
Activity:20															
Activity Note:															
Reason for Repair:															
Work Accomplished:															
Part Failure:															
Activity Comments:															
Activity Parts															
No Data Available															
Activity Labor															
No Data Available															
Activity Sublet															
No Data Available															
Activity Checklist															
No Data Available															
No Data Available															
Activity Sub Total															
<table><tr><td colspan="2">Activity 20 Sub Total</td></tr><tr><td>Parts:</td><td>0.00</td></tr><tr><td>Labor:</td><td>0.00</td></tr><tr><td>Labor Hours:</td><td>0.00</td></tr><tr><td>Sublet Parts:</td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td>0.00</td></tr></table>		Activity 20 Sub Total		Parts:	0.00	Labor:	0.00	Labor Hours:	0.00	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	0.00
Activity 20 Sub Total															
Parts:	0.00														
Labor:	0.00														
Labor Hours:	0.00														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	0.00														
Work Order Footer															
<table><tr><td colspan="2">Work Order 52633105 Total</td></tr><tr><td>Parts:</td><td>80.17</td></tr><tr><td>Labor:</td><td>0.00</td></tr><tr><td>Labor Hours:</td><td>0.00</td></tr><tr><td>Sublet Parts:</td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td>80.17</td></tr></table>		Work Order 52633105 Total		Parts:	80.17	Labor:	0.00	Labor Hours:	0.00	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	80.17
Work Order 52633105 Total															
Parts:	80.17														
Labor:	0.00														
Labor Hours:	0.00														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	80.17														



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 52594513
Invoice No. 55345 - 52594513

Client Department:

Department: 55345M

Work Order Description

Rear Brakes / Tires

Requested By: DARTHURS

Created By: DARTHURS

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 173,864 - DH

Chronology

Reported	Jul 12, 2019 12:03:17 AM	Jul 12, 2019 12:03:17 AM
Started	Jul 12, 2019 12:00:00 AM	
Completed	Jul 12, 2019 12:17:00 AM	Jul 12, 2019 12:17:00 AM
Down Time		

Work Order Notes

Line 10 To file warranty be sure to do the following:

- 1) Enter a COMPLAINT statement for each activity.
- 2) Enter CAUSE statement in the Notes field of each activity.
- 3) Enter CORRECTION statement in the Comment section of each activity.

Complaint: Rear Brakes / Tires

Cause: Rear Brakes Low all Tires Worn

Correction: Remove & Replace Rear Brakes / Mount & Balance all six Tire & Replace & Wash Wheel

Parts #192659 Qty (6)

Parts# 8C2Z-2V200-C Qty (1)

Activity Header

Activity: 5 999 TOTAL VEHICLE

Activity Note: Personal Risk Assessment

Reason for Repair: SW Shop Work Order

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
12-Jul-19	Arthurs,Durvin	0.0833333	65	5.4166645

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: Personal Risk Assessment

Check List						
Task: PRA and Meter Readings Performed by: DARTHURS Performed on: 12-JUL-19						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		DARTHURS	Jul 12, 2019 12:04:54 AM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		DARTHURS	Jul 12, 2019 12:04:54 AM	No	
3 - Are you wearing the appropriate PPE?	Done		DARTHURS	Jul 12, 2019 12:04:54 AM	No	
4 - Have you performed the proper LOTO?	Done		DARTHURS	Jul 12, 2019 12:04:54 AM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		DARTHURS	Jul 12, 2019 12:04:54 AM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		DARTHURS	Jul 12, 2019 12:04:54 AM	No	
20 - Miles			DARTHURS	Jul 12, 2019 12:04:54 AM	No	
30 - Kilometers			DARTHURS	Jul 12, 2019 12:04:54 AM	No	
40 - Hours			DARTHURS	Jul 12, 2019 12:04:54 AM	No	

Activity Sub Total

Activity 5 Sub Total

Parts:

Labor:

Labor Hours:

Sublet Parts:

Sublet Labor:

Activity Sub Total

0.00

5.42

0.08


0.00

0.00

5.42



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 52516871
Invoice No. 55345 - 52516871

Client Department:

Department: 55345M

Work Order Description

PM A

Requested By: RGASPARD

Created By: RGASPARD

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 173,864 - DH

Chronology

Reported	Jul 11, 2019 10:21:32 AM	Jul 11, 2019 10:21:32 AM
Started	Jul 12, 2019 12:00:00 AM	
Completed	Jul 12, 2019 12:17:00 AM	Jul 12, 2019 12:17:00 AM
Down Time		

Work Order Notes

Line 10 COMPLAINT: Perform PMA Service

CAUSE: Service due by Mileage.

CORRECTION: Change Oil & Filter Lube all Pivoting Points. Check brakes. Clean batteries. Replace A/C Filter.

Parts # B329 Qty (1)

Oil 5W20 Qty (7.0) Qt

Activity Header

Activity: 10 999 TOTAL VEHICLE

Activity Note: Light Medium Duty PMI

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: A PM Level A

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
12-Jul-19	Arthurs,Durvin	1.5	65	97.5

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: Light Medium Duty PMI

Task: First Transit Light-Medium Duty PMI Performed by: DARTHURS Performed on: 11-JUL-19

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,000 - SECTION 1 Preparation and Drive On (In Lot) Inspection	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
10,100 - Safety Inspection	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
10,110 - FRA Check Drivers Pre-trip or DVIR/EVIR & Authorization Forms	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
10,120 - FRA Check All Warning Lights and Alarms	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,130 - FRA Check Automatic Transmission Neutral Start Operation	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
10,140 - Check Service Brakes	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
10,150 - FRA Start Engine and Listen for Any Unusual Noises	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
10,160 - FRA Check Instruments and Horns	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
10,170 - Check Fast Idle	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
10,180 - Check Starter Protection Circuit	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
10,190 - Check Reverse Warning System	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
11,100 - Check Parking Brake	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
11,110 - Check HVAC Switches and Other Controls	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
11,120 - FRA Inspect Windshields, Mirror and Sun Visor Condition	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
11,130 - FRA Check Wiper and Washer Operation	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
11,140 - Road Test: Check for Proper Operation	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
11,150 - Perform Brake Test	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
11,152 - Decelerometer Results Test 1	FEET	NA	DARTHURS	Jul 11, 2019 11:56:46 PM	No	
11,154 - Decelerometer Results Test 2	FEET	NA	DARTHURS	Jul 11, 2019 11:56:46 PM	No	
11,156 - Decelerometer Results Test 3	FEET	NA	DARTHURS	Jul 11, 2019 11:56:46 PM	No	
11,161 - FRA Check/Record Oil Pressure / @1500 rpm	Pounds per Square Inch	NA	DARTHURS	Jul 11, 2019 11:56:46 PM	No	
11,162 - FRA Check/Record Water Temperature	Degree Fahrenheit	NA	DARTHURS	Jul 11, 2019 11:56:46 PM	No	
11,170 - FRA Check Door Operation	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
11,180 - FRA Check Operation of All Other Accessories	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
20,000 - SECTION 2 Interior Circle Inspection	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
20,210 - Check Condition of Operator's Area	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
20,220 - Check Accelerator and Brake Pedals	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
20,230 - FRA Check Wiring Under Dash	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
20,240 - FRA Check Interior Lights	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
20,250 - FRA Check Interior Electrical Panels	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
20,260 - Check Stop Request System	-	NA	DARTHURS	Jul 11, 2019 11:56:46 PM	No	
20,270 - Check Fare Box Mounting (If Applicable)	-	NA	DARTHURS	Jul 11, 2019 11:56:46 PM	No	
20,280 - Check Seats, Seat Belts, Hand Rails and Floor Covering	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
20,290 - Check for Physical Damage, Water Leaks, and Graffiti	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
22,100 - Check Emergency Windows and Glass Condition	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
22,110 - Check Emergency Hatches	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
22,120 - Check All Safety Equipment	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
30,000 - SECTION 3 Exterior Circle Inspection	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
30,310 - Check Passenger Doors	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
30,320 - Inspect Step-well and Hand Rails	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
30,330 - Check Wheelchair Lift Operation	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
30,340 - FRA Check Destination Sign and Run Box	-	NA	DARTHURS	Jul 11, 2019 11:56:46 PM	No	
30,350 - FRA Inspect Mirror and Mountings	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
30,360 - Check for Physical Damage and Decals	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
30,370 - Check Wiper Blade and Arm Condition	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
30,380 - Check Exterior Compartment Doors	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
30,390 - FRA Check Fuel Tank Cap	-	NA	DARTHURS	Jul 11, 2019 11:56:46 PM	No	
33,100 - Check Lights and Reflectors	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
33,110 - Check License Plate, Permits and State Inspection Decals	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
40,000 - SECTION 4 Engine Compartment Inspection	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
40,410 - FRA Check Engine Compartment/Condition for Fire Risk	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
40,420 - Check Hood	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
40,430 - Check Fan, Shroud and Radiator	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
40,440 - Test Coolant System Using Test Strips and Record Results	-	NA	DARTHURS	Jul 11, 2019 11:56:46 PM	No	
40,441 - Inhibitor Test Pass or Fail (Indicate with a Yes or No)	No	NA	DARTHURS	Jul 11, 2019 11:56:46 PM	No	
40,442 - Freeze Point	Degree Fahrenheit	NA	DARTHURS	Jul 11, 2019 11:56:46 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
40,450 - FRA Check Coolant Recovery System Condition & for Leaks	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
40,460 - Record Antifreeze Protection Level Using Refractometer	-	NA	DARTHURS	Jul 11, 2019 11:56:46 PM	No	
40,461 - Refractometer Reading	Degree Fahrenheit	NA	DARTHURS	Jul 11, 2019 11:56:46 PM	No	
40,470 - Pressure Test Cooling System and Check for Leaks	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
40,480 - FRA Check Coolant Hose Condition	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
40,490 - FRA Check Alternator Mount and Condition	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
44,100 - FRA Check Fuel Control and Transmission Connections	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
44,110 - FRA Check Master Cylinder Fluid Level	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
44,120 - FRA Check All Belts for Condition, Alignment and Tension	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
44,130 - FRA Check Exhaust System	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
44,140 - FRA Check Intake System	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
44,150 - FRA Inspect Turbocharger	-	NA	DARTHURS	Jul 11, 2019 11:56:46 PM	No	
44,160 - FRA Inspect Power Steering and Hydraulic Fluid	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
44,170 - FRA Check All Engine or Belt Driven Components	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
44,180 - FRA Check for Leaks	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
44,190 - FRA Perform Battery Inspection	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
44,200 - FRA Check Battery Box Corrosion, Cables and Hold-Downs	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
50,000 - SECTION 5 Steering System Inspection	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
50,510 - Check Entire Steering System	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
60,000 - SECTION 6 Tires and Wheel Inspection	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
60,610 - FRA Check and Record Air Pressure	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
60,611 - Air Pressure RF	70 Pounds per Square Inch		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
60,612 - Air Pressure LF	70 Pounds per Square Inch		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
60,613 - Air Pressure RRO	65 Pounds per Square Inch		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
60,614 - Air Pressure RRI	65 Pounds per Square Inch		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
60,615 - Air Pressure LRI	65 Pounds per Square Inch		DARTHURS	Jul 11, 2019 11:56:46 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
60,616 - Air Pressure LRO	65 Pounds per Square Inch		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
60,620 - Check Valve Stems and Caps	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
60,630 - Check and Record Tread Depth	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
60,631 - Tread Depth RF	5 32nds of an inch		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
60,632 - Tread Depth LF	5 32nds of an inch		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
60,633 - Tread Depth RRO	4 32nds of an inch		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
60,634 - Tread Depth RRI	3 32nds of an inch		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
60,635 - Tread Depth LRI	3 32nds of an inch		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
60,636 - Tread Depth LRO	3 32nds of an inch		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
60,640 - Check for Mismatched Tread or Casing Design	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
60,650 - Check Sidewall Wear	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
60,660 - Inspect for Cuts and Tears	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
60,670 - Check Dual Mating With Square	-	NA	DARTHURS	Jul 11, 2019 11:56:46 PM	No	
60,680 - Check Wheels for Cracks and Loose Lugs	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
60,690 - Check Tires for Irregular or Alignment Wear	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
66,100 - FRA Check Outer Hubs for Leaks	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
70,000 - SECTION 7 Under Vehicle Inspection	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
70,710 - Check Vibration Damper	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
70,720 - Check Engine and Transmission Mounts	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
70,730 - FRA Check Starter	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
70,740 - FRA Check Bottom of Engine for Fluid Leaks	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
70,750 - FRA Check Transmission for Leaks	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
70,760 - FRA Check Differential Breather and Fluid	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
70,770 - FRA Check Exhaust System	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
70,780 - Check Driveline, U-joint and Slip Yokes	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
70,790 - Check All Body Mounts and Chassis Frame	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
77,100 - FRA Check Security, Integrity and Length of Ground Straps	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
77,110 - FRA Check Fuel Tank	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
77,120 - Check Suspension Components	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
77,130 - FRA Check Brake Pad Thickness and Rotor for Wear	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
77,131 - Brake Pad Thickness LF	8 Inch		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
77,132 - Brake Pad Thickness RF	8 Inch		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
77,133 - Brake Pad Thickness LR	4 Inch		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
77,134 - Brake Pad Thickness RR	4 Inch		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
77,135 - Brake Rotor LF	1.554 Inch		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
77,136 - Brake Rotor RF	1.554 Inch		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
77,137 - Brake Rotor LR	1.656 Inch		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
77,138 - Brake Rotor RR	1.657 Inch		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
77,140 - FRA Check Brake Hoses	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
77,150 - Check King Pins	-	NA	DARTHURS	Jul 11, 2019 11:56:46 PM	No	
77,160 - FRA Check for Loose or Noisy Wheel Bearings	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
80,000 - SECTION 8 PMI Report Completion	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
80,810 - Completion of PMI Report	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
90,000 - SECTION 9 Completion of PMI	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	
90,910 - Vehicle Returned to predetermined location	Done		DARTHURS	Jul 11, 2019 11:56:46 PM	No	

Activity Sub Total

Activity 10 Sub Total

Parts:	0.00
Labor:	97.50
Labor Hours:	1.50
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	97.50



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 52594513
Invoice No. 55345 - 52594513

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Rear Brakes / Tires		Ford E450 Champion Challenger	
Requested By:	DARTHURS	Status:	40 - Closed (40)
Created By:	DARTHURS	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	173,864 - DH

Activity Header

Activity:15 013/000/000 BRAKES

Activity Note:

Reason for Repair:39 Natural Causes

Work Accomplished:03 Replace New

Part Failure:44 Worn

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
12-Jul-19	8C2Z-2V200-C	PADS, BRAKE, DISC, REAR	1	44.89	44.89

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
12-Jul-19	Arthurs,Durvin	1.5	65	97.5

Activity Sublet

No Data Available

Activity Checklist

No Data Available

No Data Available

Activity Sub Total

Activity 15 Sub Total

Parts:44.89

Labor:97.50

Labor Hours:1.50

Sublet Parts:0.00

Sublet Labor:0.00

Activity Sub Total142.39



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 52516871
Invoice No. 55345 - 52516871

Client Department:

Department: 55345M

Work Order Description

PM A

Requested By: RGASPARD

Created By: RGASPARD

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 173,864 - DH

Activity Header

Activity: 20 999 TOTAL VEHICLE

Activity Note: PM A

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: A PM Level A

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
12-Jul-19	B329(F)	GOING OUT OF SERVICE SEE BALDWIN B329 IN THE FLEET ORG. FILTER, OIL, SPIN-ON	1	1.96	1.96

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
12-Jul-19	Arthurs,Durvin	0.4166666	65	27.083329

Activity Sublet

No Data Available

Activity Checklist

Check List						
20 Desc: PM A						
Task: PM A SERVICE Performed by: DARTHURS Performed on: 11-JUL-19						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
100,000 - "A" PMI SERVICING ITEMS	Done		DARTHURS	Jul 11, 2019 11:58:04 PM	No	
101,000 - FRA Change Oil Filters	Yes		DARTHURS	Jul 11, 2019 11:58:04 PM	No	
102,000 - FRA Drain Engine Oil	Yes		DARTHURS	Jul 11, 2019 11:58:04 PM	No	
103,000 - FRA Check Transmission Fluid	Done		DARTHURS	Jul 11, 2019 11:58:04 PM	No	
104,000 - Lubricate Chassis	Done		DARTHURS	Jul 11, 2019 11:58:04 PM	No	
105,000 - Replace or Clean A/C Filters	Done		DARTHURS	Jul 11, 2019 11:58:04 PM	No	
107,000 - FRA Change Primary Fuel Filter	No	NA	DARTHURS	Jul 11, 2019 11:58:04 PM	No	
108,000 - Lube all pivoting Mechanisms	Done		DARTHURS	Jul 11, 2019 11:58:04 PM	No	

Activity Sub Total

	Activity 20 Sub Total	
	Parts:	1.96
	Labor:	27.08
	Labor Hours:	0.42
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	29.04



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 52594513
Invoice No. 55345 - 52594513

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Rear Brakes / Tires		Ford E450 Champion Challenger	
Requested By:	DARTHURS	Status:	40 - Closed (40)
Created By:	DARTHURS	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	173,864 - DH

Activity Header				
Activity:25 018/000/000 WHEELS, RIMS, HUBS AND BEARINGS				
Activity Note:				
Reason for Repair:		08 Preventive Maintenance		
Work Accomplished:		03 Replace New		
Part Failure:		99 Replaced Before Failure		
Activity Comments:				
Activity Parts				
No Data Available				
Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
12-Jul-19	Arthurs,Durvin	3	65	195
Activity Sublet				
No Data Available				
Activity Checklist				
No Data Available				
No Data Available				
Activity Sub Total				
			Activity 25 Sub Total	
			Parts:	0.00
			Labor:	195.00
			Labor Hours:	3.00
			Sublet Parts:	0.00
			Sublet Labor:	0.00
			Activity Sub Total	195.00
Work Order Footer				
			Work Order 52594513 Total	
			Parts:	44.89
			Labor:	297.92
			Labor Hours:	4.58
			Sublet Parts:	0.00
			Sublet Labor:	0.00
			Activity Sub Total	342.81



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 52516871
Invoice No. 55345 - 52516871

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
PM A		Ford E450 Champion Challenger	
Requested By:	RGASPARD	Status:	40 - Closed (40)
Created By:	RGASPARD	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	173,864 - DH

Activity Header

Activity:30 999 TOTAL VEHICLE

Activity Note: PRAMETER

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
12-Jul-19	Arthurs,Durvin	0.0833333	65	5.4166645

Activity Sublet

No Data Available

Activity Checklist

Check List						
30 Desc: PRAMETER						
Task: PRA and Meter Readings Performed by: DARTHURS Performed on: 11-JUL-19						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		DARTHURS	Jul 11, 2019 11:58:35 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		DARTHURS	Jul 11, 2019 11:58:35 PM	No	
3 - Are you wearing the appropriate PPE?	Done		DARTHURS	Jul 11, 2019 11:58:35 PM	No	
4 - Have you performed the proper LOTO?	Done		DARTHURS	Jul 11, 2019 11:58:35 PM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		DARTHURS	Jul 11, 2019 11:58:35 PM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		DARTHURS	Jul 11, 2019 11:58:35 PM	No	
20 - Miles			DARTHURS	Jul 11, 2019 11:58:35 PM	No	
30 - Kilometers			DARTHURS	Jul 11, 2019 11:58:35 PM	No	
40 - Hours			DARTHURS	Jul 11, 2019 11:58:35 PM	No	

Activity Sub Total

Activity 30 Sub Total

	Parts:	0.00
	Labor:	5.42
	Labor Hours:	0.08
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	5.42
Work Order Footer		
	Work Order 52516871 Total	
	Parts:	1.96
	Labor:	130.00
	Labor Hours:	2.00
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	131.96



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 52535030
Invoice No. 55345 - 52535030

Client Department:

Department: 55345M

Work Order Description

Rear a/c display pad not let you put at 75 degrees

Requested By: AOWENS

Created By: AOWENS

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 170,632 - DH

Chronology

Reported	Jun 19, 2019 11:51:00 PM	Jun 19, 2019 11:51:00 PM
Started	Jun 20, 2019 12:00:00 AM	
Completed	Jun 20, 2019 12:18:00 AM	Jun 20, 2019 12:18:00 AM
Down Time		

Work Order Notes

Line 10 To file warranty be sure to do the following:

- 1) Enter a COMPLAINT statement for each activity.
- 2) Enter CAUSE statement in the Notes field of each activity.
- 3) Enter CORRECTION statement in the Comment section of each activity.

Complaint: Rear a/c control pad not let driver put degrees to 75

Cause: rear a/c control pad

Correction: remove old rear a/c display board reinstall new rear a/c board

Parts# 04257712A qty 1

Activity Header				
Activity: 5 999 TOTAL VEHICLE				
Activity Note: Personal Risk Assessment				
Reason for Repair: SW Shop Work Order				
Work Accomplished: 06 Inspect				
Part Failure:				
Activity Comments:				
Activity Parts				
No Data Available				
Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
20-Jun-19	Owens,Arthur	0.2	65	13
Activity Sublet				
No Data Available				
Activity Checklist				
Check List				
5 Desc: Personal Risk Assessment				
Task: PRA and Meter Readings Performed by: AOWENS Performed on: 20-JUN-19				

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		AOWENS	Jun 20, 2019 12:17:32 AM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		AOWENS	Jun 20, 2019 12:17:32 AM	No	
3 - Are you wearing the appropriate PPE?	Done		AOWENS	Jun 20, 2019 12:17:32 AM	No	
4 - Have you performed the proper LOTO?	Done		AOWENS	Jun 20, 2019 12:17:32 AM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		AOWENS	Jun 20, 2019 12:17:32 AM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		AOWENS	Jun 20, 2019 12:17:32 AM	No	
20 - Miles			AOWENS	Jun 20, 2019 12:17:32 AM	No	
30 - Kilometers			AOWENS	Jun 20, 2019 12:17:32 AM	No	
40 - Hours			AOWENS	Jun 20, 2019 12:17:32 AM	No	

Activity Sub Total

Activity 5 Sub Total	
Parts:	0.00
Labor:	13.00
Labor Hours:	0.20
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	13.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 52535030
Invoice No. 55345 - 52535030

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FD4E4FS7EDB17176
Rear a/c display pad not let you put at 75 degrees		Ford E450 Champion Challenger	
Requested By:	AOWENS	Status:	40 - Closed (40)
Created By:	AOWENS	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	170,632 - DH

Activity Header
Activity: 15 079 DEVICES, SAFETY/STABILITY, TRAILER
Activity Note: Rear a/c control pad
Reason for Repair: 05 Inspection, Routine
Work Accomplished:
Part Failure:
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
20-Jun-19	04257712A	DISPLAY, DASH, LED, A/C, G4500	1	275.73	275.73

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
20-Jun-19	Owens,Arthur	0.7	65	45.5

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available

Activity Sub Total															
<table><tr><th colspan="2">Activity 15 Sub Total</th></tr><tr><td>Parts:</td><td>275.73</td></tr><tr><td>Labor:</td><td>45.50</td></tr><tr><td>Labor Hours:</td><td>0.70</td></tr><tr><td>Sublet Parts:</td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td>321.23</td></tr></table>	Activity 15 Sub Total		Parts:	275.73	Labor:	45.50	Labor Hours:	0.70	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	321.23	
Activity 15 Sub Total															
Parts:	275.73														
Labor:	45.50														
Labor Hours:	0.70														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	321.23														

Work Order Footer															
<table><tr><th colspan="2">Work Order 52535030 Total</th></tr><tr><td>Parts:</td><td>275.73</td></tr><tr><td>Labor:</td><td>58.50</td></tr><tr><td>Labor Hours:</td><td>0.90</td></tr><tr><td>Sublet Parts:</td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td>334.23</td></tr></table>	Work Order 52535030 Total		Parts:	275.73	Labor:	58.50	Labor Hours:	0.90	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	334.23	
Work Order 52535030 Total															
Parts:	275.73														
Labor:	58.50														
Labor Hours:	0.90														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	334.23														



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 52436180
Invoice No. 55345 - 52436180

Client Department:

Department: 55345M

Work Order Description

PM A

Requested By: CVERGARA

Created By: CVERGARA

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 169,711 - DH

Chronology

Reported	Jun 13, 2019 4:16:01 PM	Jun 13, 2019 4:16:01 PM
Started	Jun 13, 2019 12:00:00 AM	
Completed	Jun 13, 2019 11:57:00 PM	Jun 13, 2019 11:57:00 PM
Down Time		

Work Order Notes

Line 10 COMPLAINT:pmA

CAUSE: Service

CORRECTION:Perform pmA Service

Oil filter B329 Qty1

Engine oil 5w20 qty 7 Qts

Air filter PA4075

Activity Header

Activity:10 999 TOTAL VEHICLE

Activity Note: Light Medium Duty PMI

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: A PM Level A

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
13-Jun-19	Gaspard,Ronald	1.6	65	104

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: Light Medium Duty PMI

Task: First Transit Light-Medium Duty PMI Performed by: RGASPARD Performed on: 13-JUN-19

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,000 - SECTION 1 Preparation and Drive On (In Lot) Inspection	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
10,100 - Safety Inspection	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
10,110 - FRA Check Drivers Pre-trip or DVIR/EVIR & Authorization Forms	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
10,120 - FRA Check All Warning Lights and	Done		RGASPARD	Jun 13, 2019	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
Alarms				10:45:11 PM		
10,130 - FRA Check Automatic Transmission Neutral Start Operation	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
10,140 - Check Service Brakes	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
10,150 - FRA Start Engine and Listen for Any Unusual Noises	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
10,160 - FRA Check Instruments and Horns	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
10,170 - Check Fast Idle	-	na	RGASPARD	Jun 13, 2019 10:45:11 PM	No	
10,180 - Check Starter Protection Circuit	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
10,190 - Check Reverse Warning System	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
11,100 - Check Parking Brake	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
11,110 - Check HVAC Switches and Other Controls	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
11,120 - FRA Inspect Windshields, Mirror and Sun Visor Condition	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
11,130 - FRA Check Wiper and Washer Operation	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
11,140 - Road Test: Check for Proper Operation	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
11,150 - Perform Brake Test	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
11,152 - Decelerometer Results Test 1	FEET	na	RGASPARD	Jun 13, 2019 10:45:11 PM	No	
11,154 - Decelerometer Results Test 2	FEET	na	RGASPARD	Jun 13, 2019 10:45:11 PM	No	
11,156 - Decelerometer Results Test 3	FEET	na	RGASPARD	Jun 13, 2019 10:45:11 PM	No	
11,161 - FRA Check/Record Oil Pressure / @1500 rpm	Pounds per Square Inch	na	RGASPARD	Jun 13, 2019 10:45:11 PM	No	
11,162 - FRA Check/Record Water Temperature	Degree Fahrenheit	na	RGASPARD	Jun 13, 2019 10:45:11 PM	No	
11,170 - FRA Check Door Operation	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
11,180 - FRA Check Operation of All Other Accessories	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
20,000 - SECTION 2 Interior Circle Inspection	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
20,210 - Check Condition of Operator's Area	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
20,220 - Check Accelerator and Brake Pedals	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
20,230 - FRA Check Wiring Under Dash	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
20,240 - FRA Check Interior Lights	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
20,250 - FRA Check Interior Electrical Panels	Done		RGASPARD	Jun 13, 2019	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
				10:45:11 PM		
20,260 - Check Stop Request System	-	na	RGASPARD	Jun 13, 2019 10:45:11 PM	No	
20,270 - Check Fare Box Mounting (If Applicable)	-	na	RGASPARD	Jun 13, 2019 10:45:11 PM	No	
20,280 - Check Seats, Seat Belts, Hand Rails and Floor Covering	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
20,290 - Check for Physical Damage, Water Leaks, and Graffiti	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
22,100 - Check Emergency Windows and Glass Condition	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
22,110 - Check Emergency Hatches	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
22,120 - Check All Safety Equipment	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
30,000 - SECTION 3 Exterior Circle Inspection	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
30,310 - Check Passenger Doors	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
30,320 - Inspect Step-well and Hand Rails	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
30,330 - Check Wheelchair Lift Operation	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
30,340 - FRA Check Destination Sign and Run Box	-	na	RGASPARD	Jun 13, 2019 10:45:11 PM	No	
30,350 - FRA Inspect Mirror and Mountings	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
30,360 - Check for Physical Damage and Decals	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
30,370 - Check Wiper Blade and Arm Condition	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
30,380 - Check Exterior Compartment Doors	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
30,390 - FRA Check Fuel Tank Cap	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
33,100 - Check Lights and Reflectors	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
33,110 - Check License Plate, Permits and State Inspection Decals	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
40,000 - SECTION 4 Engine Compartment Inspection	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
40,410 - FRA Check Engine Compartment/Condition for Fire Risk	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
40,420 - Check Hood	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
40,430 - Check Fan, Shroud and Radiator	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
40,440 - Test Coolant System Using Test Strips and Record Results	-	na	RGASPARD	Jun 13, 2019 10:45:11 PM	No	
40,441 - Inhibitor Test Pass or Fail (Indicate with a Yes or No)	No	na	RGASPARD	Jun 13, 2019 10:45:11 PM	No	
40,442 - Freeze Point	Degree	na	RGASPARD	Jun 13, 2019	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
	Fahrenheit			10:45:11 PM		
40,450 - FRA Check Coolant Recovery System Condition & for Leaks	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
40,460 - Record Antifreeze Protection Level Using Refractometer	-	na	RGASPARD	Jun 13, 2019 10:45:11 PM	No	
40,461 - Refractometer Reading	Degree Fahrenheit	na	RGASPARD	Jun 13, 2019 10:45:11 PM	No	
40,470 - Pressure Test Cooling System and Check for Leaks	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
40,480 - FRA Check Coolant Hose Condition	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
40,490 - FRA Check Alternator Mount and Condition	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
44,100 - FRA Check Fuel Control and Transmission Connections	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
44,110 - FRA Check Master Cylinder Fluid Level	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
44,120 - FRA Check All Belts for Condition, Alignment and Tension	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
44,130 - FRA Check Exhaust System	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
44,140 - FRA Check Intake System	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
44,150 - FRA Inspect Turbocharger	-	na	RGASPARD	Jun 13, 2019 10:45:11 PM	No	
44,160 - FRA Inspect Power Steering and Hydraulic Fluid	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
44,170 - FRA Check All Engine or Belt Driven Components	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
44,180 - FRA Check for Leaks	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
44,190 - FRA Perform Battery Inspection	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
44,200 - FRA Check Battery Box Corrosion, Cables and Hold-Downs	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
50,000 - SECTION 5 Steering System Inspection	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
50,510 - Check Entire Steering System	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
60,000 - SECTION 6 Tires and Wheel Inspection	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
60,610 - FRA Check and Record Air Pressure	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
60,611 - Air Pressure RF	70 Pounds per Square Inch		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
60,612 - Air Pressure LF	70 Pounds per Square Inch		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
60,613 - Air Pressure RRO	65 Pounds per Square Inch		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
60,614 - Air Pressure RRI	65 Pounds per Square Inch		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
60,615 - Air Pressure LRI	65 Pounds per		RGASPARD	Jun 13, 2019	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
	Square Inch			10:45:11 PM		
60,616 - Air Pressure LRO	65 Pounds per Square Inch		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
60,620 - Check Valve Stems and Caps	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
60,630 - Check and Record Tread Depth	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
60,631 - Tread Depth RF	7 32nds of an inch		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
60,632 - Tread Depth LF	7 32nds of an inch		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
60,633 - Tread Depth RRO	5 32nds of an inch		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
60,634 - Tread Depth RRI	5 32nds of an inch		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
60,635 - Tread Depth LRI	5 32nds of an inch		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
60,636 - Tread Depth LRO	5 32nds of an inch		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
60,640 - Check for Mismatched Tread or Casing Design	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
60,650 - Check Sidewall Wear	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
60,660 - Inspect for Cuts and Tears	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
60,670 - Check Dual Mating With Square	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
60,680 - Check Wheels for Cracks and Loose Lugs	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
60,690 - Check Tires for Irregular or Alignment Wear	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
66,100 - FRA Check Outer Hubs for Leaks	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
70,000 - SECTION 7 Under Vehicle Inspection	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
70,710 - Check Vibration Damper	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
70,720 - Check Engine and Transmission Mounts	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
70,730 - FRA Check Starter	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
70,740 - FRA Check Bottom of Engine for Fluid Leaks	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
70,750 - FRA Check Transmission for Leaks	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
70,760 - FRA Check Differential Breather and Fluid	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
70,770 - FRA Check Exhaust System	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
70,780 - Check Driveline, U-joint and Slip Yokes	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
70,790 - Check All Body Mounts and Chassis	Done		RGASPARD	Jun 13, 2019	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
Frame				10:45:11 PM		
77,100 - FRA Check Security, Integrity and Length of Ground Straps	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
77,110 - FRA Check Fuel Tank	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
77,120 - Check Suspension Components	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
77,130 - FRA Check Brake Pad Thickness and Rotor for Wear	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
77,131 - Brake Pad Thickness LF	7 Inch		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
77,132 - Brake Pad Thickness RF	7 Inch		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
77,133 - Brake Pad Thickness LR	7 Inch		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
77,134 - Brake Pad Thickness RR	7 Inch		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
77,135 - Brake Rotor LF	38 Inch		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
77,136 - Brake Rotor RF	38 Inch		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
77,137 - Brake Rotor LR	40 Inch		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
77,138 - Brake Rotor RR	40 Inch		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
77,140 - FRA Check Brake Hoses	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
77,150 - Check King Pins	-	na	RGASPARD	Jun 13, 2019 10:45:11 PM	No	
77,160 - FRA Check for Loose or Noisy Wheel Bearings	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
80,000 - SECTION 8 PMI Report Completion	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
80,810 - Completion of PMI Report	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
90,000 - SECTION 9 Completion of PMI	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	
90,910 - Vehicle Returned to predetermined location	Done		RGASPARD	Jun 13, 2019 10:45:11 PM	No	

Activity Sub Total

Activity 10 Sub Total	
Parts:	0.00
Labor:	104.00
Labor Hours:	1.60
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	104.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 52436180
Invoice No. 55345 - 52436180

Client Department:

Department: 55345M

Work Order Description

PM A

Requested By: CVERGARA

Created By: CVERGARA

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 169,711 - DH

Activity Header

Activity: 20 999 TOTAL VEHICLE

Activity Note: PM A

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: A PM Level A

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
13-Jun-19	PA4075	FILTER, AIR SEE P546597	1	5.28	5.28
13-Jun-19	B329(F)	GOING OUT OF SERVICE SEE BALDWIN B329 IN THE FLEET ORG. FILTER, OIL, SPIN-ON	1	1.96	1.96

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
13-Jun-19	Gaspard,Ronald	1.1	65	71.5

Activity Sublet

No Data Available

Activity Checklist

Check List						
20 Desc: PM A						
Task: PM A SERVICE Performed by: RGASPARD Performed on: 13-JUN-19						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
100,000 - "A" PMI SERVICING ITEMS	Done		RGASPARD	Jun 13, 2019 10:45:56 PM	No	
101,000 - FRA Change Oil Filters	Yes		RGASPARD	Jun 13, 2019 10:45:56 PM	No	
102,000 - FRA Drain Engine Oil	Yes		RGASPARD	Jun 13, 2019 10:45:56 PM	No	
103,000 - FRA Check Transmission Fluid	Done		RGASPARD	Jun 13, 2019 10:45:56 PM	No	
104,000 - Lubricate Chassis	-	na	RGASPARD	Jun 13, 2019 10:45:56 PM	No	
105,000 - Replace or Clean A/C Filters	Done		RGASPARD	Jun 13, 2019 10:45:56 PM	No	
107,000 - FRA Change Primary Fuel Filter	No	na	RGASPARD	Jun 13, 2019 10:45:56 PM	No	
108,000 - Lube all pivoting Mechanisms	Done		RGASPARD	Jun 13, 2019 10:45:56 PM	No	

Activity Sub Total															
	<table> <tr> <td colspan="2">Activity 20 Sub Total</td></tr> <tr> <td>Parts:</td><td>7.24</td></tr> <tr> <td>Labor:</td><td>71.50</td></tr> <tr> <td>Labor Hours:</td><td>1.10</td></tr> <tr> <td>Sublet Parts:</td><td>0.00</td></tr> <tr> <td>Sublet Labor:</td><td>0.00</td></tr> <tr> <td>Activity Sub Total</td><td>78.74</td></tr> </table>	Activity 20 Sub Total		Parts:	7.24	Labor:	71.50	Labor Hours:	1.10	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	78.74
Activity 20 Sub Total															
Parts:	7.24														
Labor:	71.50														
Labor Hours:	1.10														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	78.74														



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 52436180
Invoice No. 55345 - 52436180

Client Department:

Department: 55345M

Work Order Description

PM A

Requested By: CVERGARA

Created By: CVERGARA

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 169,711 - DH

Activity Header

Activity: 30 999 TOTAL VEHICLE

Activity Note: PRAMETER

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
13-Jun-19	Gaspard,Ronald	0.25	65	16.25

Activity Sublet

No Data Available

Activity Checklist

Check List

30 Desc: PRAMETER

Task: PRA and Meter Readings Performed by: RGASPARD Performed on: 13-JUN-19

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		RGASPARD	Jun 13, 2019 10:48:45 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		RGASPARD	Jun 13, 2019 10:48:45 PM	No	
3 - Are you wearing the appropriate PPE?	Done		RGASPARD	Jun 13, 2019 10:48:45 PM	No	
4 - Have you performed the proper LOTO?	Done		RGASPARD	Jun 13, 2019 10:48:45 PM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		RGASPARD	Jun 13, 2019 10:48:45 PM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		RGASPARD	Jun 13, 2019 10:48:45 PM	No	
20 - Miles			RGASPARD	Jun 13, 2019 10:48:45 PM	No	
30 - Kilometers			RGASPARD	Jun 13, 2019 10:48:45 PM	No	
40 - Hours			RGASPARD	Jun 13, 2019 10:48:45 PM	No	

Activity Sub Total

Activity 30 Sub Total

	Parts:	0.00
	Labor:	16.25
	Labor Hours:	0.25
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	16.25
Work Order Footer		
	Work Order 52436180 Total	
	Parts:	7.24
	Labor:	191.75
	Labor Hours:	2.95
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	198.99



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 52485653
Invoice No. 55345 - 52485653

Client Department:

Department: 55345M

Work Order Description

Front and rear ac issues.

Requested By: EJACKSON

Created By: EJACKSON

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 167,934 - DH

Chronology

Reported	Jun 3, 2019 10:09:35 PM	Jun 3, 2019 10:09:35 PM
Started	Jun 3, 2019 12:00:00 AM	
Completed	Jun 3, 2019 10:57:00 PM	Jun 3, 2019 10:57:00 PM
Down Time		

Work Order Notes

Line 10 To file warranty be sure to do the following:

- 1) Enter a COMPLAINT statement for each activity.
- 2) Enter CAUSE statement in the Notes field of each activity.
- 3) Enter CORRECTION statement in the Comment section of each activity.

Complaint: Front and rear ac wasn't cooling properly.

Cause: Front ac Orifice tube was restricted. Rear ac blower resistors faulty.

Correction: Remove and Replaced Front ac Orifice. Replaced 1 rear condenser fan.
Part# 3411885 quantity 1, part# 8050002 quantity 1.

Activity Header

Activity: 5 999 TOTAL VEHICLE

Activity Note: Personal Risk Assessment

Reason for Repair: SW Shop Work Order

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
03-Jun-19	EARL JACKSON	0.0333333	65	2.1666645

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: Personal Risk Assessment

Task: PRA and Meter Readings Performed by: EJACKSON Performed on: 03-JUN-19

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		EJACKSON	Jun 3, 2019 10:54:40 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		EJACKSON	Jun 3, 2019 10:54:40 PM	No	
3 - Are you wearing the appropriate PPE?	Done		EJACKSON	Jun 3, 2019 10:54:40 PM	No	
4 - Have you performed the proper LOTO?	Done		EJACKSON	Jun 3, 2019 10:54:40 PM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		EJACKSON	Jun 3, 2019 10:54:40 PM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		EJACKSON	Jun 3, 2019 10:54:40 PM	No	
20 - Miles			EJACKSON	Jun 3, 2019 10:54:40 PM	No	
30 - Kilometers			EJACKSON	Jun 3, 2019 10:54:40 PM	No	
40 - Hours			EJACKSON	Jun 3, 2019 10:54:40 PM	No	


Activity Sub Total

Activity 5 Sub Total

Parts:	0.00
Labor:	2.17
Labor Hours:	0.03
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	2.17



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 52485653
Invoice No. 55345 - 52485653

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Front and rear ac issues.		Ford E450 Champion Challenger	
Requested By:	EJACKSON	Status:	40 - Closed (40)
Created By:	EJACKSON	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	167,934 - DH

Activity Header
Activity:15 001/000/000 AIR CONDITIONING, HEATING AND VENTILATION
Activity Note: Front and rear ac issues.
Reason for Repair: 04 Driver's Report
Work Accomplished: 03 Replace New
Part Failure:
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
03-Jun-19	3411885	TUBE, ORIFICE, A/C, FORD	1	0.75	0.75
05-Jun-19	8050002	FAN, CONDENSER, A/C, MOUNT, FLUSH, 14"	1	66.04	66.04

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
03-Jun-19	EARL JACKSON	2	65	130

Activity Sublet
No Data Available


Activity Checklist
No Data Available
No Data Available

Activity Sub Total		Activity 15 Sub Total	
Parts:	66.79	Labor:	130.00
Labor Hours:	2.00	Labor Hours:	2.00
Sublet Parts:	0.00	Sublet Parts:	0.00
Sublet Labor:	0.00	Sublet Labor:	0.00
Activity Sub Total		196.79	

Work Order Footer		Work Order 52485653 Total	
Parts:	66.79	Labor:	132.17
Labor Hours:	2.03	Labor Hours:	2.03
Sublet Parts:	0.00	Sublet Parts:	0.00
Sublet Labor:	0.00	Sublet Labor:	0.00
Activity Sub Total		198.96	



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 52340366
Invoice No. 55345 - 52340366

Client Department:

Department: 55345M

Work Order Description

PM B

Requested By: TDELVA

Created By: TDELVA

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 165,502 - DH

Chronology

Reported	May 14, 2019 12:00:00 AM	May 14, 2019 12:00:00 AM
Started		
Completed	May 16, 2019 11:04:50 AM	May 16, 2019 11:04:50 AM
Down Time		

Work Order Notes

Line 10 COMPLAINT:pmB Service

CAUSE: preventive maintenance

CORRECTION:perform pmB

Activity Header

Activity:10 999 TOTAL VEHICLE

Activity Note: Light Medium Duty PMI

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: Light Medium Duty PMI

Task: First Transit Light-Medium Duty PMI Performed by: NPIERRE-LOUIS Performed on: 16-MAY-19

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,000 - SECTION 1 Preparation and Drive On (In Lot) Inspection	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
10,100 - Safety Inspection	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
10,110 - FRA Check Drivers Pre-trip or DVIR/EVIR & Authorization Forms	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
10,120 - FRA Check All Warning Lights and Alarms	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
10,130 - FRA Check Automatic Transmission Neutral Start Operation	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
10,140 - Check Service Brakes	Done		NPIERRE-	May 16, 2019	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
			LOUIS	8:32:42 AM		
10,150 - FRA Start Engine and Listen for Any Unusual Noises	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
10,160 - FRA Check Instruments and Horns	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
10,170 - Check Fast Idle	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
10,180 - Check Starter Protection Circuit	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
10,190 - Check Reverse Warning System	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
11,100 - Check Parking Brake	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
11,110 - Check HVAC Switches and Other Controls	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
11,120 - FRA Inspect Windshields, Mirror and Sun Visor Condition	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
11,130 - FRA Check Wiper and Washer Operation	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
11,140 - Road Test: Check for Proper Operation	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
11,150 - Perform Brake Test	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
11,152 - Decelerometer Results Test 1	FEET	na	NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
11,154 - Decelerometer Results Test 2	FEET	na	NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
11,156 - Decelerometer Results Test 3	FEET	na	NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
11,161 - FRA Check/Record Oil Pressure / @1500 rpm	Pounds per Square Inch	na	NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
11,162 - FRA Check/Record Water Temperature	Degree Fahrenheit	na	NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
11,170 - FRA Check Door Operation	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
11,180 - FRA Check Operation of All Other Accessories	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
20,000 - SECTION 2 Interior Circle Inspection	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
20,210 - Check Condition of Operator's Area	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
20,220 - Check Accelerator and Brake Pedals	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
20,230 - FRA Check Wiring Under Dash	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
20,240 - FRA Check Interior Lights	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
20,250 - FRA Check Interior Electrical Panels	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
20,260 - Check Stop Request System	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
20,270 - Check Fare Box Mounting (If	Done		NPIERRE-	May 16, 2019	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
Applicable)			LOUIS	8:32:42 AM		
20,280 - Check Seats, Seat Belts, Hand Rails and Floor Covering	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
20,290 - Check for Physical Damage, Water Leaks, and Graffiti	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
22,100 - Check Emergency Windows and Glass Condition	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
22,110 - Check Emergency Hatches	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
22,120 - Check All Safety Equipment	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
30,000 - SECTION 3 Exterior Circle Inspection	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
30,310 - Check Passenger Doors	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
30,320 - Inspect Step-well and Hand Rails	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
30,330 - Check Wheelchair Lift Operation	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
30,340 - FRA Check Destination Sign and Run Box	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
30,350 - FRA Inspect Mirror and Mountings	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
30,360 - Check for Physical Damage and Decals	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
30,370 - Check Wiper Blade and Arm Condition	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
30,380 - Check Exterior Compartment Doors	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
30,390 - FRA Check Fuel Tank Cap	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
33,100 - Check Lights and Reflectors	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
33,110 - Check License Plate, Permits and State Inspection Decals	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
40,000 - SECTION 4 Engine Compartment Inspection	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
40,410 - FRA Check Engine Compartment/Condition for Fire Risk	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
40,420 - Check Hood	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
40,430 - Check Fan, Shroud and Radiator	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
40,440 - Test Coolant System Using Test Strips and Record Results	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
40,441 - Inhibitor Test Pass or Fail (Indicate with a Yes or No)	Yes		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
40,442 - Freeze Point	Degree Fahrenheit	na	NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
40,450 - FRA Check Coolant Recovery System Condition & for Leaks	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
40,460 - Record Antifreeze Protection Level	Done		NPIERRE-	May 16, 2019	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
Using Refractometer			LOUIS	8:32:42 AM		
40,461 - Refractometer Reading	Degree Fahrenheit	na	NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
40,470 - Pressure Test Cooling System and Check for Leaks	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
40,480 - FRA Check Coolant Hose Condition	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
40,490 - FRA Check Alternator Mount and Condition	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
44,100 - FRA Check Fuel Control and Transmission Connections	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
44,110 - FRA Check Master Cylinder Fluid Level	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
44,120 - FRA Check All Belts for Condition, Alignment and Tension	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
44,130 - FRA Check Exhaust System	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
44,140 - FRA Check Intake System	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
44,150 - FRA Inspect Turbocharger	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
44,160 - FRA Inspect Power Steering and Hydraulic Fluid	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
44,170 - FRA Check All Engine or Belt Driven Components	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
44,180 - FRA Check for Leaks	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
44,190 - FRA Perform Battery Inspection	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
44,200 - FRA Check Battery Box Corrosion, Cables and Hold-Downs	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
50,000 - SECTION 5 Steering System Inspection	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
50,510 - Check Entire Steering System	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
60,000 - SECTION 6 Tires and Wheel Inspection	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
60,610 - FRA Check and Record Air Pressure	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
60,611 - Air Pressure RF	65 Pounds per Square Inch		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
60,612 - Air Pressure LF	65 Pounds per Square Inch		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
60,613 - Air Pressure RRO	70 Pounds per Square Inch		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
60,614 - Air Pressure RRI	70 Pounds per Square Inch		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
60,615 - Air Pressure LRI	70 Pounds per Square Inch		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
60,616 - Air Pressure LRO	70 Pounds per Square Inch		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
60,620 - Check Valve Stems and Caps	Done		NPIERRE-	May 16, 2019	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
			LOUIS	8:32:42 AM		
60,630 - Check and Record Tread Depth	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
60,631 - Tread Depth RF	8 32nds of an inch		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
60,632 - Tread Depth LF	8 32nds of an inch		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
60,633 - Tread Depth RRO	6 32nds of an inch		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
60,634 - Tread Depth RRI	32nds of an inch	6	NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
60,635 - Tread Depth LRI	6 32nds of an inch		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
60,636 - Tread Depth LRO	5 32nds of an inch		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
60,640 - Check for Mismatched Tread or Casing Design	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
60,650 - Check Sidewall Wear	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
60,660 - Inspect for Cuts and Tears	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
60,670 - Check Dual Mating With Square	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
60,680 - Check Wheels for Cracks and Loose Lugs	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
60,690 - Check Tires for Irregular or Alignment Wear	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
66,100 - FRA Check Outer Hubs for Leaks	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
70,000 - SECTION 7 Under Vehicle Inspection	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
70,710 - Check Vibration Damper	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
70,720 - Check Engine and Transmission Mounts	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
70,730 - FRA Check Starter	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
70,740 - FRA Check Bottom of Engine for Fluid Leaks	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
70,750 - FRA Check Transmission for Leaks	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
70,760 - FRA Check Differential Breather and Fluid	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
70,770 - FRA Check Exhaust System	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
70,780 - Check Driveline, U-joint and Slip Yokes	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
70,790 - Check All Body Mounts and Chassis Frame	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
77,100 - FRA Check Security, Integrity and Length of Ground Straps	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
77,110 - FRA Check Fuel Tank	Done		NPIERRE-	May 16, 2019	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
			LOUIS	8:32:42 AM		
77,120 - Check Suspension Components	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
77,130 - FRA Check Brake Pad Thickness and Rotor for Wear	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
77,131 - Brake Pad Thickness LF	9 Inch		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
77,132 - Brake Pad Thickness RF	9 Inch		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
77,133 - Brake Pad Thickness LR	5 Inch		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
77,134 - Brake Pad Thickness RR	5 Inch		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
77,135 - Brake Rotor LF	44.9 Inch		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
77,136 - Brake Rotor RF	44.9 Inch		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
77,137 - Brake Rotor LR	34.9 Inch		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
77,138 - Brake Rotor RR	34.9 Inch		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
77,140 - FRA Check Brake Hoses	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
77,150 - Check King Pins	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
77,160 - FRA Check for Loose or Noisy Wheel Bearings	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
80,000 - SECTION 8 PMI Report Completion	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
80,810 - Completion of PMI Report	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
90,000 - SECTION 9 Completion of PMI	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	
90,910 - Vehicle Returned to predetermined location	Done		NPIERRE-LOUIS	May 16, 2019 8:32:42 AM	No	


Activity Sub Total

Activity 10 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 52340366
Invoice No. 55345 - 52340366

Client Department:

Department: 55345M

Work Order Description

PM B

Requested By: TDELVA

Created By: TDELVA

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 165,502 - DH

Activity Header

Activity: 20 999 TOTAL VEHICLE

Activity Note: PM B

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: B PM Level B

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
16-May-19	B329(F)	GOING OUT OF SERVICE SEE BALDWIN B329 IN THE FLEET ORG. FILTER, OIL, SPIN-ON	1	1.96	1.96

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List						
20 Desc: PM B Task: PM B SERVICE Performed by: NPIERRE-LOUIS Performed on: 16-MAY-19						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
100,000 - "A" PMI SERVICING ITEMS	Done		NPIERRE-LOUIS	May 16, 2019 11:01:32 AM	No	
101,000 - FRA Change Oil Filters	Yes		NPIERRE-LOUIS	May 16, 2019 11:01:32 AM	No	
102,000 - FRA Drain Engine Oil	Yes		NPIERRE-LOUIS	May 16, 2019 11:01:32 AM	No	
103,000 - FRA Check Transmission Fluid	Done		NPIERRE-LOUIS	May 16, 2019 11:01:32 AM	No	
104,000 - Lubricate Chassis	Done		NPIERRE-LOUIS	May 16, 2019 11:01:32 AM	No	
105,000 - Replace or Clean A/C Filters	Done		NPIERRE-LOUIS	May 16, 2019 11:01:32 AM	No	
107,000 - FRA Change Primary Fuel Filter	No		NPIERRE-LOUIS	May 16, 2019 11:01:32 AM	No	
108,000 - Lube all pivoting Mechanisms	Done		NPIERRE-LOUIS	May 16, 2019 11:01:32 AM	No	
200,000 - "B" PMI SERVICING ITEMS (12 MONTH)	Done		NPIERRE-LOUIS	May 16, 2019 11:01:32 AM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
201,000 - Service Crankcase Breather	Done		NPIERRE-LOUIS	May 16, 2019 11:01:32 AM	No	
203,000 - FRA Change Automatic Transmission Fluid	No		NPIERRE-LOUIS	May 16, 2019 11:01:32 AM	No	
204,000 - FRA Change Power Steering Fluid and Filter	No		NPIERRE-LOUIS	May 16, 2019 11:01:32 AM	No	
205,000 - Complete Engine Diagnostics and Clear Codes when Completed	Done		NPIERRE-LOUIS	May 16, 2019 11:01:32 AM	No	


Activity Sub Total

Activity 20 Sub Total

Parts:	1.96
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	1.96



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 52340366
Invoice No. 55345 - 52340366

Client Department:


Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
PM B		Ford E450 Champion Challenger	
Requested By:	TDELVA	Status:	40 - Closed (40)
Created By:	TDELVA	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	165,502 - DH

Activity Header						
Activity:30 999 TOTAL VEHICLE						
Activity Note: PRAMETER						
Reason for Repair: 05 Inspection, Routine						
Work Accomplished: 06 Inspect						
Part Failure:						
Activity Comments:						
Activity Parts						
No Data Available						
Activity Labor						
No Data Available						
Activity Sublet						
No Data Available						
Activity Checklist						
Check List						
30 Desc: PRAMETER						
Task: PRA and Meter Readings Performed by: NPIERRE-LOUIS Performed on: 16-MAY-19						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		NPIERRE-LOUIS	May 16, 2019 8:18:27 AM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		NPIERRE-LOUIS	May 16, 2019 8:18:27 AM	No	
3 - Are you wearing the appropriate PPE?	Done		NPIERRE-LOUIS	May 16, 2019 8:18:27 AM	No	
4 - Have you performed the proper LOTO?	Done		NPIERRE-LOUIS	May 16, 2019 8:18:27 AM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		NPIERRE-LOUIS	May 16, 2019 8:18:27 AM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		NPIERRE-LOUIS	May 16, 2019 8:18:27 AM	No	
20 - Miles		na	NPIERRE-LOUIS	May 16, 2019 8:18:27 AM	No	
30 - Kilometers		na	NPIERRE-LOUIS	May 16, 2019 8:18:27 AM	No	
40 - Hours		na	NPIERRE-LOUIS	May 16, 2019 8:18:27 AM	No	
Activity Sub Total						
				Activity 30 Sub Total		
				Parts: 0.00		
				Labor: 0.00		

	Labor Hours:	0.00
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	0.00
Work Order Footer		
	Work Order 52340366 Total	
	Parts:	1.96
	Labor:	0.00
	Labor Hours:	0.00
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	1.96



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 52341814
Invoice No. 55345 - 52341814

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FD4E4FS7EDB17176
Front Air Conditioning System		Ford E450 Champion Challenger	
Requested By:	CKARLENS	Status:	40 - Closed (40)
Created By:	CKARLENS	Priority:	-
Assigned To:		Driver:	
Class:	-	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	160,720 - DH

Chronology

Reported	Apr 14, 2019 11:58:08 AM	Apr 14, 2019 11:58:08 AM
Started	Apr 14, 2019 12:00:00 AM	
Completed	Apr 14, 2019 12:03:00 PM	Apr 14, 2019 12:03:00 PM
Down Time		

Work Order Notes

Line 10 Driver Stated no heat coming out of vehicle vents.
Upon inspection, tech found that blend door was inoperable.
Tech replaced blend door.

Activity Header

Activity: 10 999/999/999 TOTAL VEHICLE
Activity Note: PERSONAL RISK ASSESMENT
Reason for Repair: 05 Inspection, Routine
Work Accomplished: 06 Inspect
Part Failure: 00 No Failure

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
14-Apr-19	KARLENS,Cyrius	0.3333333	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: PERSONAL RISK ASSESMENT

Task: PRA and Meter Readings Performed by: CKARLENS Performed on: 14-APR-19

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		CKARLENS	Apr 14, 2019 12:03:44 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		CKARLENS	Apr 14, 2019 12:03:44 PM	No	
3 - Are you wearing the appropriate PPE?	Done		CKARLENS	Apr 14, 2019 12:03:44 PM	No	
4 - Have you performed the proper LOTO?	Done		CKARLENS	Apr 14, 2019 12:03:44 PM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		CKARLENS	Apr 14, 2019 12:03:44 PM	No	
10 - Have you successfully completed the Personal	Done		CKARLENS	Apr 14, 2019	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO	
Risk Assessment?				12:03:44 PM			
20 - Miles		na	CKARLENS	Apr 14, 2019 12:03:44 PM	No		
30 - Kilometers		na	CKARLENS	Apr 14, 2019 12:03:44 PM	No		
40 - Hours		na	CKARLENS	Apr 14, 2019 12:03:44 PM	No		
Activity Sub Total							
				Activity 10 Sub Total			
				Parts:			0.00
				Labor:			0.00
				Labor Hours:			0.33
				Sublet Parts:			0.00
				Sublet Labor:			0.00
				Activity Sub Total			0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 52341814
Invoice No. 55345 - 52341814

Client Department:			
Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Front Air Conditioning System		Ford E450 Champion Challenger	
Requested By:	CKARLENS	Status:	40 - Closed (40)
Created By:	CKARLENS	Priority:	-
Assigned To:		Driver:	
Class:	-	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	160,720 - DH

Activity Header
Activity:20 001/000/000 AIR CONDITIONING, HEATING AND VENTILATION
Activity Note:
Reason for Repair: 04 Driver's Report
Work Accomplished: 03 Replace New
Part Failure:
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
14-Apr-19	604-200	ACTUATOR, DOOR, BLEND	4	26.69	106.76
14-Apr-19	604-200	ACTUATOR, DOOR, BLEND	-3	26.69	-80.07

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
14-Apr-19	KARLENS,Cyrius	2	0	0

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available

Activity Sub Total															
<table><tr><th colspan="2">Activity 20 Sub Total</th></tr><tr><td>Parts:</td><td>26.69</td></tr><tr><td>Labor:</td><td>0.00</td></tr><tr><td>Labor Hours:</td><td>2.00</td></tr><tr><td>Sublet Parts:</td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td>26.69</td></tr></table>		Activity 20 Sub Total		Parts:	26.69	Labor:	0.00	Labor Hours:	2.00	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	26.69
Activity 20 Sub Total															
Parts:	26.69														
Labor:	0.00														
Labor Hours:	2.00														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	26.69														

Work Order Footer															
<table><tr><th colspan="2">Work Order 52341814 Total</th></tr><tr><td>Parts:</td><td>26.69</td></tr><tr><td>Labor:</td><td>0.00</td></tr><tr><td>Labor Hours:</td><td>2.33</td></tr><tr><td>Sublet Parts:</td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td>26.69</td></tr></table>		Work Order 52341814 Total		Parts:	26.69	Labor:	0.00	Labor Hours:	2.33	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	26.69
Work Order 52341814 Total															
Parts:	26.69														
Labor:	0.00														
Labor Hours:	2.33														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	26.69														



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 52255861
Invoice No. 55345 - 52255861

Client Department:

Department: 55345M

Work Order Description

PM A

Requested By: CVERGARA

Created By: CVERGARA

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 160,720 - DH

Chronology

Reported	Apr 12, 2019 12:00:00 AM	Apr 12, 2019 12:00:00 AM
Started	Apr 12, 2019 12:00:00 AM	
Completed	Apr 12, 2019 5:39:00 PM	Apr 12, 2019 5:39:00 PM
Down Time		

Work Order Notes

Line 10 COMPLAINT: PmA

CAUSE: Service due

CORRECTION: Performed and completed PmA
Changed engine oil and replaced engine oil filter

Activity Header

Activity: 10 999 TOTAL VEHICLE

Activity Note: Light Medium Duty PMI

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: A PM Level A

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
12-Apr-19	Delva,Terry	1.5	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: Light Medium Duty PMI

Task: First Transit Light-Medium Duty PMI Performed by: TDELVA Performed on: 12-APR-19

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,000 - SECTION 1 Preparation and Drive On (In Lot) Inspection	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
10,100 - Safety Inspection	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
10,110 - FRA Check Drivers Pre-trip or DVIR/EVIR & Authorization Forms	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
10,120 - FRA Check All Warning Lights and Alarms	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,130 - FRA Check Automatic Transmission Neutral Start Operation	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
10,140 - Check Service Brakes	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
10,150 - FRA Start Engine and Listen for Any Unusual Noises	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
10,160 - FRA Check Instruments and Horns	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
10,170 - Check Fast Idle	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
10,180 - Check Starter Protection Circuit	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
10,190 - Check Reverse Warning System	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
11,100 - Check Parking Brake	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
11,110 - Check HVAC Switches and Other Controls	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
11,120 - FRA Inspect Windshields, Mirror and Sun Visor Condition	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
11,130 - FRA Check Wiper and Washer Operation	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
11,140 - Road Test: Check for Proper Operation	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
11,150 - Perform Brake Test	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
11,152 - Decelerometer Results Test 1	FEET	na	TDELVA	Apr 12, 2019 5:37:54 PM	No	
11,154 - Decelerometer Results Test 2	FEET	na	TDELVA	Apr 12, 2019 5:37:54 PM	No	
11,156 - Decelerometer Results Test 3	FEET	na	TDELVA	Apr 12, 2019 5:37:54 PM	No	
11,161 - FRA Check/Record Oil Pressure / @1500 rpm	Pounds per Square Inch	na	TDELVA	Apr 12, 2019 5:37:54 PM	No	
11,162 - FRA Check/Record Water Temperature	Degree Fahrenheit	na	TDELVA	Apr 12, 2019 5:37:54 PM	No	
11,170 - FRA Check Door Operation	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
11,180 - FRA Check Operation of All Other Accessories	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
20,000 - SECTION 2 Interior Circle Inspection	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
20,210 - Check Condition of Operator's Area	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
20,220 - Check Accelerator and Brake Pedals	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
20,230 - FRA Check Wiring Under Dash	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
20,240 - FRA Check Interior Lights	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
20,250 - FRA Check Interior Electrical Panels	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
20,260 - Check Stop Request System	-	na	TDELVA	Apr 12, 2019 5:37:54 PM	No	
20,270 - Check Fare Box Mounting (If Applicable)	-	na	TDELVA	Apr 12, 2019 5:37:54 PM	No	
20,280 - Check Seats, Seat Belts, Hand Rails and Floor Covering	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
20,290 - Check for Physical Damage, Water Leaks, and Graffiti	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
22,100 - Check Emergency Windows and Glass Condition	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
22,110 - Check Emergency Hatches	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
22,120 - Check All Safety Equipment	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
30,000 - SECTION 3 Exterior Circle Inspection	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
30,310 - Check Passenger Doors	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
30,320 - Inspect Step-well and Hand Rails	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
30,330 - Check Wheelchair Lift Operation	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
30,340 - FRA Check Destination Sign and Run Box	-	na	TDELVA	Apr 12, 2019 5:37:54 PM	No	
30,350 - FRA Inspect Mirror and Mountings	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
30,360 - Check for Physical Damage and Decals	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
30,370 - Check Wiper Blade and Arm Condition	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
30,380 - Check Exterior Compartment Doors	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
30,390 - FRA Check Fuel Tank Cap	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
33,100 - Check Lights and Reflectors	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
33,110 - Check License Plate, Permits and State Inspection Decals	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
40,000 - SECTION 4 Engine Compartment Inspection	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
40,410 - FRA Check Engine Compartment/Condition for Fire Risk	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
40,420 - Check Hood	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
40,430 - Check Fan, Shroud and Radiator	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
40,440 - Test Coolant System Using Test Strips and Record Results	-	na	TDELVA	Apr 12, 2019 5:37:54 PM	No	
40,441 - Inhibitor Test Pass or Fail (Indicate with a Yes or No)	No	na	TDELVA	Apr 12, 2019 5:37:54 PM	No	
40,442 - Freeze Point	Degree Fahrenheit	na	TDELVA	Apr 12, 2019 5:37:54 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
40,450 - FRA Check Coolant Recovery System Condition & for Leaks	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
40,460 - Record Antifreeze Protection Level Using Refractometer	-	na	TDELVA	Apr 12, 2019 5:37:54 PM	No	
40,461 - Refractometer Reading	Degree Fahrenheit	na	TDELVA	Apr 12, 2019 5:37:54 PM	No	
40,470 - Pressure Test Cooling System and Check for Leaks	-	na	TDELVA	Apr 12, 2019 5:37:54 PM	No	
40,480 - FRA Check Coolant Hose Condition	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
40,490 - FRA Check Alternator Mount and Condition	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
44,100 - FRA Check Fuel Control and Transmission Connections	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
44,110 - FRA Check Master Cylinder Fluid Level	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
44,120 - FRA Check All Belts for Condition, Alignment and Tension	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
44,130 - FRA Check Exhaust System	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
44,140 - FRA Check Intake System	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
44,150 - FRA Inspect Turbocharger	-	na	TDELVA	Apr 12, 2019 5:37:54 PM	No	
44,160 - FRA Inspect Power Steering and Hydraulic Fluid	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
44,170 - FRA Check All Engine or Belt Driven Components	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
44,180 - FRA Check for Leaks	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
44,190 - FRA Perform Battery Inspection	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
44,200 - FRA Check Battery Box Corrosion, Cables and Hold-Downs	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
50,000 - SECTION 5 Steering System Inspection	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
50,510 - Check Entire Steering System	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
60,000 - SECTION 6 Tires and Wheel Inspection	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
60,610 - FRA Check and Record Air Pressure	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
60,611 - Air Pressure RF	65 Pounds per Square Inch		TDELVA	Apr 12, 2019 5:37:54 PM	No	
60,612 - Air Pressure LF	65 Pounds per Square Inch		TDELVA	Apr 12, 2019 5:37:54 PM	No	
60,613 - Air Pressure RRO	65 Pounds per Square Inch		TDELVA	Apr 12, 2019 5:37:54 PM	No	
60,614 - Air Pressure RRI	65 Pounds per Square Inch		TDELVA	Apr 12, 2019 5:37:54 PM	No	
60,615 - Air Pressure LRI	65 Pounds per Square Inch		TDELVA	Apr 12, 2019 5:37:54 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
60,616 - Air Pressure LRO	65 Pounds per Square Inch		TDELVA	Apr 12, 2019 5:37:54 PM	No	
60,620 - Check Valve Stems and Caps	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
60,630 - Check and Record Tread Depth	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
60,631 - Tread Depth RF	11 32nds of an inch		TDELVA	Apr 12, 2019 5:37:54 PM	No	
60,632 - Tread Depth LF	11 32nds of an inch		TDELVA	Apr 12, 2019 5:37:54 PM	No	
60,633 - Tread Depth RRO	8 32nds of an inch		TDELVA	Apr 12, 2019 5:37:54 PM	No	
60,634 - Tread Depth RRI	9 32nds of an inch		TDELVA	Apr 12, 2019 5:37:54 PM	No	
60,635 - Tread Depth LRI	8 32nds of an inch		TDELVA	Apr 12, 2019 5:37:54 PM	No	
60,636 - Tread Depth LRO	7 32nds of an inch		TDELVA	Apr 12, 2019 5:37:54 PM	No	
60,640 - Check for Mismatched Tread or Casing Design	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
60,650 - Check Sidewall Wear	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
60,660 - Inspect for Cuts and Tears	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
60,670 - Check Dual Mating With Square	-	na	TDELVA	Apr 12, 2019 5:37:54 PM	No	
60,680 - Check Wheels for Cracks and Loose Lugs	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
60,690 - Check Tires for Irregular or Alignment Wear	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
66,100 - FRA Check Outer Hubs for Leaks	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
70,000 - SECTION 7 Under Vehicle Inspection	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
70,710 - Check Vibration Damper	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
70,720 - Check Engine and Transmission Mounts	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
70,730 - FRA Check Starter	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
70,740 - FRA Check Bottom of Engine for Fluid Leaks	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
70,750 - FRA Check Transmission for Leaks	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
70,760 - FRA Check Differential Breather and Fluid	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
70,770 - FRA Check Exhaust System	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
70,780 - Check Driveline, U-joint and Slip Yokes	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
70,790 - Check All Body Mounts and Chassis Frame	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
77,100 - FRA Check Security, Integrity and Length of Ground Straps	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
77,110 - FRA Check Fuel Tank	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
77,120 - Check Suspension Components	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
77,130 - FRA Check Brake Pad Thickness and Rotor for Wear	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
77,131 - Brake Pad Thickness LF	4 Inch		TDELVA	Apr 12, 2019 5:37:54 PM	No	
77,132 - Brake Pad Thickness RF	5 Inch		TDELVA	Apr 12, 2019 5:37:54 PM	No	
77,133 - Brake Pad Thickness LR	8 Inch		TDELVA	Apr 12, 2019 5:37:54 PM	No	
77,134 - Brake Pad Thickness RR	8 Inch		TDELVA	Apr 12, 2019 5:37:54 PM	No	
77,135 - Brake Rotor LF	39.7 Inch		TDELVA	Apr 12, 2019 5:37:54 PM	No	
77,136 - Brake Rotor RF	39.7 Inch		TDELVA	Apr 12, 2019 5:37:54 PM	No	
77,137 - Brake Rotor LR	37.5 Inch		TDELVA	Apr 12, 2019 5:37:54 PM	No	
77,138 - Brake Rotor RR	37.6 Inch		TDELVA	Apr 12, 2019 5:37:54 PM	No	
77,140 - FRA Check Brake Hoses	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
77,150 - Check King Pins	-	na	TDELVA	Apr 12, 2019 5:37:54 PM	No	
77,160 - FRA Check for Loose or Noisy Wheel Bearings	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
80,000 - SECTION 8 PMI Report Completion	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
80,810 - Completion of PMI Report	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
90,000 - SECTION 9 Completion of PMI	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	
90,910 - Vehicle Returned to predetermined location	Done		TDELVA	Apr 12, 2019 5:37:54 PM	No	

Activity Sub Total

Activity 10 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	1.50
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 52255861
Invoice No. 55345 - 52255861

Client Department:

Department: 55345M

Work Order Description

PM A

Requested By: CVERGARA

Created By: CVERGARA

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 160,720 - DH

Activity Header

Activity: 20 999 TOTAL VEHICLE

Activity Note: PM A

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: A PM Level A

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
12-Apr-19	B329(F)	GOING OUT OF SERVICE SEE BALDWIN B329 IN THE FLEET ORG. FILTER, OIL, SPIN-ON	1	1.96	1.96

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
12-Apr-19	Delva, Terry	1.9333333	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List						
20 Desc: PM A						
Task: PM A SERVICE Performed by: TDELVA Performed on: 12-APR-19						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
100,000 - "A" PMI SERVICING ITEMS	Done		TDELVA	Apr 12, 2019 5:38:56 PM	No	
101,000 - FRA Change Oil Filters	Yes		TDELVA	Apr 12, 2019 5:38:56 PM	No	
102,000 - FRA Drain Engine Oil	Yes		TDELVA	Apr 12, 2019 5:38:56 PM	No	
103,000 - FRA Check Transmission Fluid	Done		TDELVA	Apr 12, 2019 5:38:56 PM	No	
104,000 - Lubricate Chassis	Done		TDELVA	Apr 12, 2019 5:38:56 PM	No	
105,000 - Replace or Clean A/C Filters	Done		TDELVA	Apr 12, 2019 5:38:56 PM	No	
107,000 - FRA Change Primary Fuel Filter	No	na	TDELVA	Apr 12, 2019 5:38:56 PM	No	
108,000 - Lube all pivoting Mechanisms	Done		TDELVA	Apr 12, 2019 5:38:56 PM	No	

Activity Sub Total

Activity 20 Sub Total	
Parts:	1.96
Labor:	0.00
Labor Hours:	1.93
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	1.96



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 52255861
Invoice No. 55345 - 52255861

Client Department:

Department: 55345M

Work Order Description

PM A

Requested By: CVERGARA

Created By: CVERGARA

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 160,720 - DH

Activity Header

Activity: 30 999 TOTAL VEHICLE

Activity Note: PRAMETER

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
12-Apr-19	Delva, Terry	0.8	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List						
30 Desc: PRAMETER						
Task: PRA and Meter Readings Performed by: TDELVA Performed on: 12-APR-19						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		TDELVA	Apr 12, 2019 5:39:18 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		TDELVA	Apr 12, 2019 5:39:18 PM	No	
3 - Are you wearing the appropriate PPE?	Done		TDELVA	Apr 12, 2019 5:39:18 PM	No	
4 - Have you performed the proper LOTO?	Done		TDELVA	Apr 12, 2019 5:39:18 PM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		TDELVA	Apr 12, 2019 5:39:18 PM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		TDELVA	Apr 12, 2019 5:39:18 PM	No	
20 - Miles			TDELVA	Apr 12, 2019 5:39:18 PM	No	
30 - Kilometers			TDELVA	Apr 12, 2019 5:39:18 PM	No	
40 - Hours			TDELVA	Apr 12, 2019 5:39:18 PM	No	

Activity Sub Total

Activity 30 Sub Total

	Parts:	0.00
	Labor:	0.00
	Labor Hours:	0.80
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	0.00
Work Order Footer		
	Work Order 52255861 Total	
	Parts:	1.96
	Labor:	0.00
	Labor Hours:	4.23
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	1.96



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 52307124
Invoice No. 55345 - 52307124

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Engine coolant has oil mixed		Ford E450 Champion Challenger	
Requested By:	JAPEREZ	Status:	40 - Closed (40)
Created By:	JAPEREZ	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	158,638 - DH

Chronology		
Reported	Apr 2, 2019 2:04:35 PM	Apr 2, 2019 2:04:35 PM
Started	Apr 2, 2019 12:00:00 AM	
Completed	Apr 3, 2019 10:30:51 AM	Apr 3, 2019 10:30:51 AM
Down Time		

Work Order Notes

- Line 10 To file warranty be sure to do the following:
- 1) Enter a COMPLAINT statement for each activity.
 - 2) Enter CAUSE statement in the Notes field of each activity.
 - 3) Enter CORRECTION statement in the Comment section of each activity.

=====

Complaint:engine coolant has oil mixed

Cause: check coolant system found engine oil coolant is damaged internal failure

Correction:replaced engine oil cooler, Clean all hoses and coolants system for oil contamination

Parts:
1 new oil cooler 9c2z-6a642-a
1 o ring f1vy-8255-a

Activity Header
Activity: 5 999 TOTAL VEHICLE
Activity Note: Personal Risk Assessment
Reason for Repair: SW Shop Work Order
Work Accomplished: 06 Inspect
Part Failure:
Activity Comments:
Activity Parts
No Data Available
Activity Labor
No Data Available
Activity Sublet
No Data Available
Activity Checklist

Check List																				
5 Desc: Personal Risk Assessment																				
Task: PRA and Meter Readings Performed by: JAPEREZ Performed on: 02-APR-19																				
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO														
1 - Are you properly trained to perform the task?	Done		JAPEREZ	Apr 2, 2019 2:14:18 PM	No															
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		JAPEREZ	Apr 2, 2019 2:14:18 PM	No															
3 - Are you wearing the appropriate PPE?	Done		JAPEREZ	Apr 2, 2019 2:14:18 PM	No															
4 - Have you performed the proper LOTO?	Done		JAPEREZ	Apr 2, 2019 2:14:18 PM	No															
5 - Are you aware of the potential risks of performing this repair?	Done		JAPEREZ	Apr 2, 2019 2:14:18 PM	No															
10 - Have you successfully completed the Personal Risk Assessment?	Done		JAPEREZ	Apr 2, 2019 2:14:18 PM	No															
20 - Miles			JAPEREZ	Apr 2, 2019 2:14:18 PM	No															
30 - Kilometers			JAPEREZ	Apr 2, 2019 2:14:18 PM	No															
40 - Hours			JAPEREZ	Apr 2, 2019 2:14:18 PM	No															
Activity Sub Total																				
			<table border="1"> <thead> <tr> <th colspan="2">Activity 5 Sub Total</th> </tr> </thead> <tbody> <tr> <td>Parts:</td> <td>0.00</td> </tr> <tr> <td>Labor:</td> <td>0.00</td> </tr> <tr> <td>Labor Hours:</td> <td>0.00</td> </tr> <tr> <td>Sublet Parts:</td> <td>0.00</td> </tr> <tr> <td>Sublet Labor:</td> <td>0.00</td> </tr> <tr> <td>Activity Sub Total</td> <td>0.00</td> </tr> </tbody> </table>				Activity 5 Sub Total		Parts:	0.00	Labor:	0.00	Labor Hours:	0.00	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	0.00
Activity 5 Sub Total																				
Parts:	0.00																			
Labor:	0.00																			
Labor Hours:	0.00																			
Sublet Parts:	0.00																			
Sublet Labor:	0.00																			
Activity Sub Total	0.00																			



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 52307124
Invoice No. 55345 - 52307124

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Engine coolant has oil mixed		Ford E450 Champion Challenger	
Requested By:	JAPEREZ	Status:	40 - Closed (40)
Created By:	JAPEREZ	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	158,638 - DH

Activity Header
Activity: 15 042 COOLING SYSTEM
Activity Note: Engine coolant has oil mixed
Reason for Repair: 05 Inspection, Routine
Work Accomplished:
Part Failure:
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
02-Apr-19	F1VY-8255-A	SEAL, THERMOSTAT	1	4.88	4.88
02-Apr-19	9C2Z-6A642-A	COOLER, OIL, ENGINE	1	59.86	59.86

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
02-Apr-19	Perez,Javier	3.4166666	0	0

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available

Activity Sub Total															
<table><tr><th colspan="2">Activity 15 Sub Total</th></tr><tr><td>Parts:</td><td>64.74</td></tr><tr><td>Labor:</td><td>0.00</td></tr><tr><td>Labor Hours:</td><td>3.42</td></tr><tr><td>Sublet Parts:</td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td>64.74</td></tr></table>	Activity 15 Sub Total		Parts:	64.74	Labor:	0.00	Labor Hours:	3.42	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	64.74	
Activity 15 Sub Total															
Parts:	64.74														
Labor:	0.00														
Labor Hours:	3.42														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	64.74														

Work Order Footer															
<table><tr><th colspan="2">Work Order 52307124 Total</th></tr><tr><td>Parts:</td><td>64.74</td></tr><tr><td>Labor:</td><td>0.00</td></tr><tr><td>Labor Hours:</td><td>3.42</td></tr><tr><td>Sublet Parts:</td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td>64.74</td></tr></table>	Work Order 52307124 Total		Parts:	64.74	Labor:	0.00	Labor Hours:	3.42	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	64.74	
Work Order 52307124 Total															
Parts:	64.74														
Labor:	0.00														
Labor Hours:	3.42														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	64.74														



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 52255557
Invoice No. 55345 - 52255557

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Pma follow up need front tire		Ford E450 Champion Challenger	
Requested By:	HPIERRE	Status:	40 - Closed (40)
Created By:	HPIERRE	Priority:	-
Assigned To:		Driver:	
Class:	-	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	155,772 - DH

Chronology		
Reported	Mar 15, 2019 7:49:59 AM	Mar 15, 2019 7:49:59 AM
Started		
Completed	Mar 15, 2019 1:22:00 PM	Mar 15, 2019 1:22:00 PM
Down Time		

Work Order Notes

Line 10 PMA follow up need front tire

Normal wear

Replace tire mount and balanced completed

Activity Header						
Activity:10 999/999/999 TOTAL VEHICLE						
Activity Note: PERSONAL RISK ASSESMENT						
Reason for Repair:		05 Inspection, Routine				
Work Accomplished:		06 Inspect				
Part Failure:		00 No Failure				
Activity Comments:						
Activity Parts						
No Data Available						
Activity Labor						
No Data Available						
Activity Sublet						
No Data Available						
Activity Checklist						
Check List						
10 Desc: PERSONAL RISK ASSESMENT						
Task: PRA and Meter Readings Performed by: HPIERRE Performed on: 15-MAR-19						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		HPIERRE	Mar 15, 2019 7:52:20 AM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		HPIERRE	Mar 15, 2019 7:52:20 AM	No	
3 - Are you wearing the appropriate PPE?	Done		HPIERRE	Mar 15, 2019 7:52:20 AM	No	
4 - Have you performed the proper LOTO?	Done		HPIERRE	Mar 15, 2019 7:52:20 AM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		HPIERRE	Mar 15, 2019 7:52:20 AM	No	
10 - Have you successfully completed the Personal	Done		HPIERRE	Mar 15, 2019	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO	
Risk Assessment?				7:52:20 AM			
20 - Miles			HPIERRE	Mar 15, 2019 7:52:20 AM	No		
30 - Kilometers	6		HPIERRE	Mar 15, 2019 7:52:20 AM	No		
40 - Hours	1		HPIERRE	Mar 15, 2019 7:52:20 AM	No		
Activity Sub Total							
				Activity 10 Sub Total			
				Parts:			0.00
				Labor:			0.00
				Labor Hours:			0.00
				Sublet Parts:			0.00
				Sublet Labor:			0.00
				Activity Sub Total			0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 52255557
Invoice No. 55345 - 52255557

Client Department:
Department: 55345M
Work Order Description
Pma follow up need front tire
Requested By: HPIERRE
Created By: HPIERRE
Assigned To:
Class: -
Arrangement: Unassigned
Potential Warranty: No
Equipment No.: 4514-P
VIN: 1FDFE4FS7EDB17176
Ford E450 Champion Challenger
Status: 40 - Closed (40)
Priority: -
Driver:
Phone:
ETA:
Meter: 155,772 - DH

Activity Header					
Activity:20 018/000/000 WHEELS, RIMS, HUBS AND BEARINGS					
Activity Note:					
Reason for Repair:		08 Preventive Maintenance			
Work Accomplished:		03 Replace New			
Part Failure:		99 Replaced Before Failure			
Activity Comments:					
Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
15-Mar-19	002760	TIRE, 225/75R16, 10-PLY, BSW, HT2, TRANSFORCE, FIRESTONE	2	108.36	216.72
Activity Labor					
No Data Available					
Activity Sublet					
No Data Available					
Activity Checklist					
No Data Available					
No Data Available					
Activity Sub Total					
			Activity 20 Sub Total		
			Parts: 216.72		
			Labor: 0.00		
			Labor Hours: 0.00		
			Sublet Parts: 0.00		
			Sublet Labor: 0.00		
			Activity Sub Total 216.72		
Work Order Footer					
			Work Order 52255557 Total		
			Parts: 216.72		
			Labor: 0.00		
			Labor Hours: 0.00		
			Sublet Parts: 0.00		
			Sublet Labor: 0.00		
			Activity Sub Total 216.72		



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 52189555
Invoice No. 55345 - 52189555

Client Department:

Department: 55345M

Work Order Description

PM A

Requested By: CVERGARA

Created By: CVERGARA

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 156,090 - DH

Chronology

Reported	Mar 14, 2019 11:57:41 AM	Mar 14, 2019 11:57:41 AM
Started		
Completed	Mar 15, 2019 9:07:00 AM	Mar 15, 2019 9:07:00 AM
Down Time		

Work Order Notes

Line 10 COMPLAINT:

CAUSE:

CORRECTION: Line 20 PmA

Preventive maintenance

Perform Service lube all Pivoting Points Cross Rotate Tires Completed

Activity Header

Activity: 10 999 TOTAL VEHICLE

Activity Note: Light Medium Duty PMI

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: A PM Level A

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: Light Medium Duty PMI

Task: First Transit Light-Medium Duty PMI Performed by: HPIERRE Performed on: 15-MAR-19

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,000 - SECTION 1 Preparation and Drive On (In Lot) Inspection	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
10,100 - Safety Inspection	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
10,110 - FRA Check Drivers Pre-trip or DVIR/EVIR & Authorization Forms	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
10,120 - FRA Check All Warning Lights and Alarms	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,130 - FRA Check Automatic Transmission Neutral Start Operation	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
10,140 - Check Service Brakes	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
10,150 - FRA Start Engine and Listen for Any Unusual Noises	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
10,160 - FRA Check Instruments and Horns	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
10,170 - Check Fast Idle	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
10,180 - Check Starter Protection Circuit	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
10,190 - Check Reverse Warning System	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
11,100 - Check Parking Brake	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
11,110 - Check HVAC Switches and Other Controls	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
11,120 - FRA Inspect Windshields, Mirror and Sun Visor Condition	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
11,130 - FRA Check Wiper and Washer Operation	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
11,140 - Road Test: Check for Proper Operation	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
11,150 - Perform Brake Test	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
11,152 - Decelerometer Results Test 1	FEET	N/A	HPIERRE	Mar 15, 2019 7:30:54 AM	No	
11,154 - Decelerometer Results Test 2	FEET	N/A	HPIERRE	Mar 15, 2019 7:30:54 AM	No	
11,156 - Decelerometer Results Test 3	FEET	N/A	HPIERRE	Mar 15, 2019 7:30:54 AM	No	
11,161 - FRA Check/Record Oil Pressure / @1500 rpm	1500 Pounds per Square Inch	N/A	HPIERRE	Mar 15, 2019 7:30:54 AM	No	
11,162 - FRA Check/Record Water Temperature	190 Degree Fahrenheit	N/A	HPIERRE	Mar 15, 2019 7:30:54 AM	No	
11,170 - FRA Check Door Operation	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
11,180 - FRA Check Operation of All Other Accessories	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
20,000 - SECTION 2 Interior Circle Inspection	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
20,210 - Check Condition of Operator's Area	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
20,220 - Check Accelerator and Brake Pedals	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
20,230 - FRA Check Wiring Under Dash	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
20,240 - FRA Check Interior Lights	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
20,250 - FRA Check Interior Electrical Panels	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
20,260 - Check Stop Request System	-	N/A	HPIERRE	Mar 15, 2019 7:30:54 AM	No	
20,270 - Check Fare Box Mounting (If Applicable)	-	N/A	HPIERRE	Mar 15, 2019 7:30:54 AM	No	
20,280 - Check Seats, Seat Belts, Hand Rails and Floor Covering	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
20,290 - Check for Physical Damage, Water Leaks, and Graffiti	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
22,100 - Check Emergency Windows and Glass Condition	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
22,110 - Check Emergency Hatches	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
22,120 - Check All Safety Equipment	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
30,000 - SECTION 3 Exterior Circle Inspection	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
30,310 - Check Passenger Doors	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
30,320 - Inspect Step-well and Hand Rails	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
30,330 - Check Wheelchair Lift Operation	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
30,340 - FRA Check Destination Sign and Run Box	-	N/A	HPIERRE	Mar 15, 2019 7:30:54 AM	No	
30,350 - FRA Inspect Mirror and Mountings	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
30,360 - Check for Physical Damage and Decals	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
30,370 - Check Wiper Blade and Arm Condition	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
30,380 - Check Exterior Compartment Doors	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
30,390 - FRA Check Fuel Tank Cap	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
33,100 - Check Lights and Reflectors	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
33,110 - Check License Plate, Permits and State Inspection Decals	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
40,000 - SECTION 4 Engine Compartment Inspection	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
40,410 - FRA Check Engine Compartment/Condition for Fire Risk	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
40,420 - Check Hood	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
40,430 - Check Fan, Shroud and Radiator	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
40,440 - Test Coolant System Using Test Strips and Record Results	-	N/A	HPIERRE	Mar 15, 2019 7:30:54 AM	No	
40,441 - Inhibitor Test Pass or Fail (Indicate with a Yes or No)	No	N/A	HPIERRE	Mar 15, 2019 7:30:54 AM	No	
40,442 - Freeze Point	Degree Fahrenheit	N/A	HPIERRE	Mar 15, 2019 7:30:54 AM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
40,450 - FRA Check Coolant Recovery System Condition & for Leaks	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
40,460 - Record Antifreeze Protection Level Using Refractometer	-	N/A	HPIERRE	Mar 15, 2019 7:30:54 AM	No	
40,461 - Refractometer Reading	Degree Fahrenheit	N/A	HPIERRE	Mar 15, 2019 7:30:54 AM	No	
40,470 - Pressure Test Cooling System and Check for Leaks	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
40,480 - FRA Check Coolant Hose Condition	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
40,490 - FRA Check Alternator Mount and Condition	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
44,100 - FRA Check Fuel Control and Transmission Connections	-	N/A	HPIERRE	Mar 15, 2019 7:30:54 AM	No	
44,110 - FRA Check Master Cylinder Fluid Level	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
44,120 - FRA Check All Belts for Condition, Alignment and Tension	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
44,130 - FRA Check Exhaust System	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
44,140 - FRA Check Intake System	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
44,150 - FRA Inspect Turbocharger	-	N/A	HPIERRE	Mar 15, 2019 7:30:54 AM	No	
44,160 - FRA Inspect Power Steering and Hydraulic Fluid	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
44,170 - FRA Check All Engine or Belt Driven Components	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
44,180 - FRA Check for Leaks	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
44,190 - FRA Perform Battery Inspection	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
44,200 - FRA Check Battery Box Corrosion, Cables and Hold-Downs	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
50,000 - SECTION 5 Steering System Inspection	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
50,510 - Check Entire Steering System	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
60,000 - SECTION 6 Tires and Wheel Inspection	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
60,610 - FRA Check and Record Air Pressure	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
60,611 - Air Pressure RF	65 Pounds per Square Inch		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
60,612 - Air Pressure LF	65 Pounds per Square Inch		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
60,613 - Air Pressure RRO	70 Pounds per Square Inch		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
60,614 - Air Pressure RRI	70 Pounds per Square Inch		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
60,615 - Air Pressure LRI	70 Pounds per Square Inch		HPIERRE	Mar 15, 2019 7:30:54 AM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
60,616 - Air Pressure LRO	70 Pounds per Square Inch		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
60,620 - Check Valve Stems and Caps	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
60,630 - Check and Record Tread Depth	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
60,631 - Tread Depth RF	3 32nds of an inch	need front tire and alignment	HPIERRE	Mar 15, 2019 7:30:54 AM	No	
60,632 - Tread Depth LF	4 32nds of an inch		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
60,633 - Tread Depth RRO	10 32nds of an inch		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
60,634 - Tread Depth RRI	10 32nds of an inch		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
60,635 - Tread Depth LRI	10 32nds of an inch		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
60,636 - Tread Depth LRO	10 32nds of an inch		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
60,640 - Check for Mismatched Tread or Casing Design	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
60,650 - Check Sidewall Wear	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
60,660 - Inspect for Cuts and Tears	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
60,670 - Check Dual Mating With Square	-	N/A	HPIERRE	Mar 15, 2019 7:30:54 AM	No	
60,680 - Check Wheels for Cracks and Loose Lugs	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
60,690 - Check Tires for Irregular or Alignment Wear	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
66,100 - FRA Check Outer Hubs for Leaks	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
70,000 - SECTION 7 Under Vehicle Inspection	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
70,710 - Check Vibration Damper	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
70,720 - Check Engine and Transmission Mounts	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
70,730 - FRA Check Starter	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
70,740 - FRA Check Bottom of Engine for Fluid Leaks	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
70,750 - FRA Check Transmission for Leaks	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
70,760 - FRA Check Differential Breather and Fluid	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
70,770 - FRA Check Exhaust System	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
70,780 - Check Driveline, U-joint and Slip Yokes	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
70,790 - Check All Body Mounts and Chassis Frame	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
77,100 - FRA Check Security, Integrity and Length of Ground Straps	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
77,110 - FRA Check Fuel Tank	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
77,120 - Check Suspension Components	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
77,130 - FRA Check Brake Pad Thickness and Rotor for Wear	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
77,131 - Brake Pad Thickness LF	10 Inch		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
77,132 - Brake Pad Thickness RF	10 Inch		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
77,133 - Brake Pad Thickness LR	8 Inch		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
77,134 - Brake Pad Thickness RR	8 Inch		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
77,135 - Brake Rotor LF	1.6 Inch		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
77,136 - Brake Rotor RF	1.6 Inch		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
77,137 - Brake Rotor LR	1.7 Inch		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
77,138 - Brake Rotor RR	1.7 Inch		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
77,140 - FRA Check Brake Hoses	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
77,150 - Check King Pins	-	N/A	HPIERRE	Mar 15, 2019 7:30:54 AM	No	
77,160 - FRA Check for Loose or Noisy Wheel Bearings	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
80,000 - SECTION 8 PMI Report Completion	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
80,810 - Completion of PMI Report	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
90,000 - SECTION 9 Completion of PMI	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	
90,910 - Vehicle Returned to predetermined location	Done		HPIERRE	Mar 15, 2019 7:30:54 AM	No	

Activity Sub Total

Activity 10 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 52189555
Invoice No. 55345 - 52189555

Client Department:

Department: 55345M

Work Order Description

PM A

Requested By: CVERGARA

Created By: CVERGARA

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 156,090 - DH

Activity Header

Activity: 20 999 TOTAL VEHICLE

Activity Note: PM A

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: A PM Level A

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

20 Desc: PM A

Task: PM A SERVICE Performed by: HPIERRE Performed on: 15-MAR-19

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
100,000 - "A" PMI SERVICING ITEMS	Done		HPIERRE	Mar 15, 2019 7:34:21 AM	No	
101,000 - FRA Change Oil Filters	Yes		HPIERRE	Mar 15, 2019 7:34:21 AM	No	
102,000 - FRA Drain Engine Oil	Yes		HPIERRE	Mar 15, 2019 7:34:21 AM	No	
103,000 - FRA Check Transmission Fluid	Done		HPIERRE	Mar 15, 2019 7:34:21 AM	No	
104,000 - Lubricate Chassis	Done		HPIERRE	Mar 15, 2019 7:34:21 AM	No	
105,000 - Replace or Clean A/C Filters	Done		HPIERRE	Mar 15, 2019 7:34:21 AM	No	
107,000 - FRA Change Primary Fuel Filter	No	N/A	HPIERRE	Mar 15, 2019 7:34:21 AM	No	
108,000 - Lube all pivoting Mechanisms	Done		HPIERRE	Mar 15, 2019 7:34:21 AM	No	

Activity Sub Total

Activity 20 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00

	Sublet Labor:	0.00
	Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 52189555
Invoice No. 55345 - 52189555

Client Department:


Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
PM A		Ford E450 Champion Challenger	
Requested By:	CVERGARA	Status:	40 - Closed (40)
Created By:	CVERGARA	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	156,090 - DH

Activity Header						
Activity:30 999 TOTAL VEHICLE						
Activity Note: PRAMETER						
Reason for Repair: 05 Inspection, Routine						
Work Accomplished: 06 Inspect						
Part Failure:						
Activity Comments:						
Activity Parts						
No Data Available						
Activity Labor						
No Data Available						
Activity Sublet						
No Data Available						
Activity Checklist						
Check List						
30 Desc: PRAMETER						
Task: PRA and Meter Readings Performed by: HPIERRE Performed on: 15-MAR-19						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		HPIERRE	Mar 15, 2019 7:35:54 AM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		HPIERRE	Mar 15, 2019 7:35:54 AM	No	
3 - Are you wearing the appropriate PPE?	Done		HPIERRE	Mar 15, 2019 7:35:54 AM	No	
4 - Have you performed the proper LOTO?	Done		HPIERRE	Mar 15, 2019 7:35:54 AM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		HPIERRE	Mar 15, 2019 7:35:54 AM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		HPIERRE	Mar 15, 2019 7:35:54 AM	No	
20 - Miles			HPIERRE	Mar 15, 2019 7:35:54 AM	No	
30 - Kilometers	10		HPIERRE	Mar 15, 2019 7:35:54 AM	No	
40 - Hours	6		HPIERRE	Mar 15, 2019 7:35:54 AM	No	
Activity Sub Total						
				Activity 30 Sub Total		
				Parts: 0.00		
				Labor: 0.00		

	Labor Hours:	0.00
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	0.00
Work Order Footer		
	Work Order 52189555 Total	
	Parts:	0.00
	Labor:	0.00
	Labor Hours:	0.00
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 52187425
Invoice No. 55345 - 52187425

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Pmc follow up need rear brake pads		Ford E450 Champion Challenger	
Requested By:	HPIERRE	Status:	40 - Closed (40)
Created By:	HPIERRE	Priority:	-
Assigned To:		Driver:	
Class:	-	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	151,791 - DH

Chronology

Reported	Feb 20, 2019 1:50:59 PM	Feb 20, 2019 1:50:59 PM
Started	Feb 20, 2019 12:00:00 AM	
Completed	Feb 21, 2019 11:42:48 AM	Feb 21, 2019 11:42:48 AM
Down Time		

Work Order Notes

Line 10 PMC follow up need rear brakes pads

Normal wear

Replaced rear brake pads lube caliper pins completed

Activity Header

Activity: 10 999/999/999 TOTAL VEHICLE

Activity Note: PERSONAL RISK ASSESMENT

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure: 00 No Failure

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
20-Feb-19	Pierre, Hubert J	2	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: PERSONAL RISK ASSESMENT

Task: PRA and Meter Readings Performed by: HPIERRE Performed on: 20-FEB-19

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		HPIERRE	Feb 20, 2019 1:53:05 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		HPIERRE	Feb 20, 2019 1:53:05 PM	No	
3 - Are you wearing the appropriate PPE?	Done		HPIERRE	Feb 20, 2019 1:53:05 PM	No	
4 - Have you performed the proper LOTO?	Done		HPIERRE	Feb 20, 2019 1:53:05 PM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		HPIERRE	Feb 20, 2019 1:53:05 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		HPIERRE	Feb 20, 2019 1:53:05 PM	No	
20 - Miles			HPIERRE	Feb 20, 2019 1:53:05 PM	No	
30 - Kilometers	10		HPIERRE	Feb 20, 2019 1:53:05 PM	No	
40 - Hours	2		HPIERRE	Feb 20, 2019 1:53:05 PM	No	

Activity Sub Total

Activity 10 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	2.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 52187425
Invoice No. 55345 - 52187425

Client Department:
Department: 55345M
Work Order Description
Pmc follow up need rear brake pads
Requested By: HPIERRE
Created By: HPIERRE
Assigned To:
Class: -
Arrangement: Unassigned
Potential Warranty: No
Equipment No.: 4514-P
VIN: 1FDFE4FS7EDB17176
Ford E450 Champion Challenger
Status: 40 - Closed (40)
Priority: -
Driver:
Phone:
ETA:
Meter: 151,791 - DH

Activity Header
Activity:20 013/000/000 BRAKES
Activity Note:
Reason for Repair: 39 Natural Causes
Work Accomplished: 03 Replace New
Part Failure: 44 Worn
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
20-Feb-19	9C2Z-2V200-B	PADS, BRAKE, DISC, REAR SAME AS BRSD1329B	1	46.22	46.22

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
20-Feb-19	Pierre,Hubert J	0.1166666	0	0

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available

Activity Sub Total		Activity 20 Sub Total	
		Parts:	46.22
		Labor:	0.00
		Labor Hours:	0.12
		Sublet Parts:	0.00
		Sublet Labor:	0.00
		Activity Sub Total	46.22

Work Order Footer		Work Order 52187425 Total	
		Parts:	46.22
		Labor:	0.00
		Labor Hours:	2.12
		Sublet Parts:	0.00
		Sublet Labor:	0.00
		Activity Sub Total	46.22



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 52111086
Invoice No. 55345 - 52111086

Client Department:

Department: 55345M

Work Order Description

PM C

Requested By: DARTHURS

Created By: DARTHURS

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 151,791 - DH

Chronology

Reported	Feb 20, 2019 7:04:03 AM	Feb 20, 2019 7:04:03 AM
Started		
Completed	Feb 21, 2019 8:09:00 AM	Feb 21, 2019 8:09:00 AM
Down Time		

Work Order Notes

Line 10 PMC

Preventive maintenance

Perform PMC Service lube all Pivoting Points Cross Rotate Tires Completed

Activity Header

Activity: 10 999 TOTAL VEHICLE

Activity Note: Light Medium Duty PMI

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: Light Medium Duty PMI

Task: First Transit Light-Medium Duty PMI Performed by: HPIERRE Performed on: 20-FEB-19

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,000 - SECTION 1 Preparation and Drive On (In Lot) Inspection	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
10,100 - Safety Inspection	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
10,110 - FRA Check Drivers Pre-trip or DVIR/EVIR & Authorization Forms	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
10,120 - FRA Check All Warning Lights and Alarms	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
10,130 - FRA Check Automatic Transmission Neutral Start Operation	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,140 - Check Service Brakes	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
10,150 - FRA Start Engine and Listen for Any Unusual Noises	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
10,160 - FRA Check Instruments and Horns	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
10,170 - Check Fast Idle	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
10,180 - Check Starter Protection Circuit	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
10,190 - Check Reverse Warning System	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
11,100 - Check Parking Brake	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
11,110 - Check HVAC Switches and Other Controls	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
11,120 - FRA Inspect Windshields, Mirror and Sun Visor Condition	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
11,130 - FRA Check Wiper and Washer Operation	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
11,140 - Road Test: Check for Proper Operation	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
11,150 - Perform Brake Test	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
11,152 - Decelerometer Results Test 1	FEET	N/A	HPIERRE	Feb 20, 2019 1:45:49 PM	No	
11,154 - Decelerometer Results Test 2	FEET	N/A	HPIERRE	Feb 20, 2019 1:45:49 PM	No	
11,156 - Decelerometer Results Test 3	FEET	N/A	HPIERRE	Feb 20, 2019 1:45:49 PM	No	
11,161 - FRA Check/Record Oil Pressure / @1500 rpm	1500 Pounds per Square Inch	N/A	HPIERRE	Feb 20, 2019 1:45:49 PM	No	
11,162 - FRA Check/Record Water Temperature	190 Degree Fahrenheit	N/A	HPIERRE	Feb 20, 2019 1:45:49 PM	No	
11,170 - FRA Check Door Operation	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
11,180 - FRA Check Operation of All Other Accessories	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
20,000 - SECTION 2 Interior Circle Inspection	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
20,210 - Check Condition of Operator's Area	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
20,220 - Check Accelerator and Brake Pedals	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
20,230 - FRA Check Wiring Under Dash	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
20,240 - FRA Check Interior Lights	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
20,250 - FRA Check Interior Electrical Panels	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
20,260 - Check Stop Request System	-	N/A	HPIERRE	Feb 20, 2019 1:45:49 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
20,270 - Check Fare Box Mounting (If Applicable)	-	N/A	HPIERRE	Feb 20, 2019 1:45:49 PM	No	
20,280 - Check Seats, Seat Belts, Hand Rails and Floor Covering	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
20,290 - Check for Physical Damage, Water Leaks, and Graffiti	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
22,100 - Check Emergency Windows and Glass Condition	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
22,110 - Check Emergency Hatches	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
22,120 - Check All Safety Equipment	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
30,000 - SECTION 3 Exterior Circle Inspection	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
30,310 - Check Passenger Doors	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
30,320 - Inspect Step-well and Hand Rails	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
30,330 - Check Wheelchair Lift Operation	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
30,340 - FRA Check Destination Sign and Run Box	-	N/A	HPIERRE	Feb 20, 2019 1:45:49 PM	No	
30,350 - FRA Inspect Mirror and Mountings	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
30,360 - Check for Physical Damage and Decals	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
30,370 - Check Wiper Blade and Arm Condition	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
30,380 - Check Exterior Compartment Doors	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
30,390 - FRA Check Fuel Tank Cap	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
33,100 - Check Lights and Reflectors	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
33,110 - Check License Plate, Permits and State Inspection Decals	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
40,000 - SECTION 4 Engine Compartment Inspection	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
40,410 - FRA Check Engine Compartment/Condition for Fire Risk	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
40,420 - Check Hood	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
40,430 - Check Fan, Shroud and Radiator	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
40,440 - Test Coolant System Using Test Strips and Record Results	-	N/A	HPIERRE	Feb 20, 2019 1:45:49 PM	No	
40,441 - Inhibitor Test Pass or Fail (Indicate with a Yes or No)	No	N/A	HPIERRE	Feb 20, 2019 1:45:49 PM	No	
40,442 - Freeze Point	Degree Fahrenheit	N/A	HPIERRE	Feb 20, 2019 1:45:49 PM	No	
40,450 - FRA Check Coolant Recovery System Condition & for Leaks	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
40,460 - Record Antifreeze Protection Level Using Refractometer	-	N/A	HPIERRE	Feb 20, 2019 1:45:49 PM	No	
40,461 - Refractometer Reading	Degree Fahrenheit	N/A	HPIERRE	Feb 20, 2019 1:45:49 PM	No	
40,470 - Pressure Test Cooling System and Check for Leaks	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
40,480 - FRA Check Coolant Hose Condition	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
40,490 - FRA Check Alternator Mount and Condition	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
44,100 - FRA Check Fuel Control and Transmission Connections	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
44,110 - FRA Check Master Cylinder Fluid Level	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
44,120 - FRA Check All Belts for Condition, Alignment and Tension	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
44,130 - FRA Check Exhaust System	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
44,140 - FRA Check Intake System	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
44,150 - FRA Inspect Turbocharger	-	N/A	HPIERRE	Feb 20, 2019 1:45:49 PM	No	
44,160 - FRA Inspect Power Steering and Hydraulic Fluid	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
44,170 - FRA Check All Engine or Belt Driven Components	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
44,180 - FRA Check for Leaks	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
44,190 - FRA Perform Battery Inspection	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
44,200 - FRA Check Battery Box Corrosion, Cables and Hold-Downs	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
50,000 - SECTION 5 Steering System Inspection	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
50,510 - Check Entire Steering System	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
60,000 - SECTION 6 Tires and Wheel Inspection	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
60,610 - FRA Check and Record Air Pressure	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
60,611 - Air Pressure RF	65 Pounds per Square Inch		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
60,612 - Air Pressure LF	65 Pounds per Square Inch		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
60,613 - Air Pressure RRO	70 Pounds per Square Inch		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
60,614 - Air Pressure RRI	70 Pounds per Square Inch		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
60,615 - Air Pressure LRI	70 Pounds per Square Inch		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
60,616 - Air Pressure LRO	70 Pounds per Square Inch		HPIERRE	Feb 20, 2019 1:45:49 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
60,620 - Check Valve Stems and Caps	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
60,630 - Check and Record Tread Depth	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
60,631 - Tread Depth RF	8 32nds of an inch		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
60,632 - Tread Depth LF	8 32nds of an inch		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
60,633 - Tread Depth RRO	8 32nds of an inch		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
60,634 - Tread Depth RRI	10 32nds of an inch		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
60,635 - Tread Depth LRI	10 32nds of an inch		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
60,636 - Tread Depth LRO	10 32nds of an inch		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
60,640 - Check for Mismatched Tread or Casing Design	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
60,650 - Check Sidewall Wear	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
60,660 - Inspect for Cuts and Tears	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
60,670 - Check Dual Mating With Square	-	N/A	HPIERRE	Feb 20, 2019 1:45:49 PM	No	
60,680 - Check Wheels for Cracks and Loose Lugs	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
60,690 - Check Tires for Irregular or Alignment Wear	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
66,100 - FRA Check Outer Hubs for Leaks	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
70,000 - SECTION 7 Under Vehicle Inspection	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
70,710 - Check Vibration Damper	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
70,720 - Check Engine and Transmission Mounts	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
70,730 - FRA Check Starter	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
70,740 - FRA Check Bottom of Engine for Fluid Leaks	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
70,750 - FRA Check Transmission for Leaks	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
70,760 - FRA Check Differential Breather and Fluid	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
70,770 - FRA Check Exhaust System	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
70,780 - Check Driveline, U-joint and Slip Yokes	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
70,790 - Check All Body Mounts and Chassis Frame	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
77,100 - FRA Check Security, Integrity and Length of Ground Straps	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
77,110 - FRA Check Fuel Tank	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
77,120 - Check Suspension Components	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
77,130 - FRA Check Brake Pad Thickness and Rotor for Wear	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
77,131 - Brake Pad Thickness LF	10 Inch		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
77,132 - Brake Pad Thickness RF	10 Inch		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
77,133 - Brake Pad Thickness LR	4 Inch		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
77,134 - Brake Pad Thickness RR	4 Inch		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
77,135 - Brake Rotor LF	1.6 Inch		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
77,136 - Brake Rotor RF	1.6 Inch		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
77,137 - Brake Rotor LR	1.7 Inch		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
77,138 - Brake Rotor RR	1.7 Inch		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
77,140 - FRA Check Brake Hoses	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
77,150 - Check King Pins	-	N/A	HPIERRE	Feb 20, 2019 1:45:49 PM	No	
77,160 - FRA Check for Loose or Noisy Wheel Bearings	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
80,000 - SECTION 8 PMI Report Completion	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
80,810 - Completion of PMI Report	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
90,000 - SECTION 9 Completion of PMI	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	
90,910 - Vehicle Returned to predetermined location	Done		HPIERRE	Feb 20, 2019 1:45:49 PM	No	

Activity Sub Total

Activity 10 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 52111086
Invoice No. 55345 - 52111086

Client Department:

Department: 55345M

Work Order Description

PM C

Requested By: DARTHURS

Created By: DARTHURS

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 151,791 - DH

Activity Header

Activity: 20 999 TOTAL VEHICLE

Activity Note: PM C

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: C PM Level C

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
20-Feb-19	B329(F)	GOING OUT OF SERVICE SEE BALDWIN B329 IN THE FLEET ORG. FILTER, OIL, SPIN-ON	1	1.96	1.96

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List						
20 Desc: PM C Task: PM C SERVICE Performed by: HPIERRE Performed on: 20-FEB-19						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
100,000 - "A" PMI SERVICING ITEMS	Done		HPIERRE	Feb 20, 2019 1:48:32 PM	No	
101,000 - FRA Change Oil Filters	Yes		HPIERRE	Feb 20, 2019 1:48:32 PM	No	
102,000 - FRA Drain Engine Oil	Yes		HPIERRE	Feb 20, 2019 1:48:32 PM	No	
103,000 - FRA Check Transmission Fluid	Done		HPIERRE	Feb 20, 2019 1:48:32 PM	No	
104,000 - Lubricate Chassis	Done		HPIERRE	Feb 20, 2019 1:48:32 PM	No	
105,000 - Replace or Clean A/C Filters	Done		HPIERRE	Feb 20, 2019 1:48:32 PM	No	
107,000 - FRA Change Primary Fuel Filter	Done		HPIERRE	Feb 20, 2019 1:48:32 PM	No	
108,000 - Lube all pivoting Mechanisms	Done		HPIERRE	Feb 20, 2019 1:48:32 PM	No	
200,000 - "B" PMI SERVICING ITEMS (12 MONTH)	Done		HPIERRE	Feb 20, 2019 1:48:32 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
201,000 - Service Crankcase Breather	Done		HPIERRE	Feb 20, 2019 1:48:32 PM	No	
203,000 - FRA Change Automatic Transmission Fluid	No	transmission done three months ago	HPIERRE	Feb 20, 2019 1:48:32 PM	No	
204,000 - FRA Change Power Steering Fluid and Filter	No		HPIERRE	Feb 20, 2019 1:48:32 PM	No	
205,000 - Complete Engine Diagnostics and Clear Codes when Completed	Done		HPIERRE	Feb 20, 2019 1:48:32 PM	No	
300,000 - "C" PMI SERVICING ITEMS (24 MONTH)	Done		HPIERRE	Feb 20, 2019 1:48:32 PM	No	
301,000 - Check and Lubricate Door Linkages	Done		HPIERRE	Feb 20, 2019 1:48:32 PM	No	
302,000 - Check Toe-In and Record Reading	-	N/A	HPIERRE	Feb 20, 2019 1:48:32 PM	No	
302,001 - Record Toe-In Reading	Inches, fraction-actual	N/A	HPIERRE	Feb 20, 2019 1:48:32 PM	No	
304,000 - 1st "C" PMI ONLY: Tune Up Per Engine Mfg's Specifications	No		HPIERRE	Feb 20, 2019 1:48:32 PM	No	
305,000 - FRA Change Differential Fluid	Yes		HPIERRE	Feb 20, 2019 1:48:32 PM	No	

Activity Sub Total

Activity 20 Sub Total	
Parts:	1.96
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	1.96



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 52111086
Invoice No. 55345 - 52111086

Client Department:

Department: 55345M

Work Order Description

PM C

Requested By: DARTHURS

Created By: DARTHURS

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 151,791 - DH

Activity Header

Activity: 30 999 TOTAL VEHICLE

Activity Note: PRAMETER

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

30 Desc: PRAMETER

Task: PRA and Meter Readings Performed by: HPIERRE Performed on: 20-FEB-19

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		HPIERRE	Feb 20, 2019 1:49:35 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		HPIERRE	Feb 20, 2019 1:49:35 PM	No	
3 - Are you wearing the appropriate PPE?	Done		HPIERRE	Feb 20, 2019 1:49:35 PM	No	
4 - Have you performed the proper LOTO?	Done		HPIERRE	Feb 20, 2019 1:49:35 PM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		HPIERRE	Feb 20, 2019 1:49:35 PM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		HPIERRE	Feb 20, 2019 1:49:35 PM	No	
20 - Miles			HPIERRE	Feb 20, 2019 1:49:35 PM	No	
30 - Kilometers	8		HPIERRE	Feb 20, 2019 1:49:35 PM	No	
40 - Hours	8		HPIERRE	Feb 20, 2019 1:49:35 PM	No	

Activity Sub Total

Activity 30 Sub Total

Parts: 0.00

Labor: 0.00

	Labor Hours:	0.00
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	0.00
Work Order Footer		
	Work Order 52111086 Total	
	Parts:	1.96
	Labor:	0.00
	Labor Hours:	0.00
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	1.96



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 52021846
Invoice No. 55345 - 52021846

Client Department:

Department: 55345M

Work Order Description

PM A

Requested By: TDELVA

Created By: TDELVA

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 147,440 - DH

Chronology

Reported	Jan 24, 2019 12:28:51 PM	Jan 24, 2019 12:28:51 PM
Started	Jan 24, 2019 12:00:00 AM	
Completed	Jan 24, 2019 10:57:00 PM	Jan 24, 2019 10:57:00 PM
Down Time		

Work Order Notes

Line 10 COMPLAINT: PMA Service

CAUSE: Service Due by Mileage.

CORRECTION: Change Oil & Filter .lube all Pivoting Points. Check brakes . Clean batteries. Replace drain plugs.
Replace A/C Filter.

Parts # B329 Qty (1)

Parts# 65266 Qty (1)

Oil 5W20QTY (7.0) Qt

Activity Header

Activity:10 999 TOTAL VEHICLE

Activity Note: Light Medium Duty PMI

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: A PM Level A

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
24-Jan-19	Arthurs,Durvin	1.5	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: Light Medium Duty PMI

Task: First Transit Light-Medium Duty PMI Performed by: DARTHURS Performed on: 24-JAN-19

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,000 - SECTION 1 Preparation and Drive On (In Lot) Inspection	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
10,100 - Safety Inspection	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
10,110 - FRA Check Drivers Pre-trip or DVIR/EVIR & Authorization Forms	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,120 - FRA Check All Warning Lights and Alarms	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
10,130 - FRA Check Automatic Transmission Neutral Start Operation	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
10,140 - Check Service Brakes	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
10,150 - FRA Start Engine and Listen for Any Unusual Noises	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
10,160 - FRA Check Instruments and Horns	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
10,170 - Check Fast Idle	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
10,180 - Check Starter Protection Circuit	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
10,190 - Check Reverse Warning System	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
11,100 - Check Parking Brake	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
11,110 - Check HVAC Switches and Other Controls	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
11,120 - FRA Inspect Windshields, Mirror and Sun Visor Condition	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
11,130 - FRA Check Wiper and Washer Operation	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
11,140 - Road Test: Check for Proper Operation	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
11,150 - Perform Brake Test	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
11,152 - Decelerometer Results Test 1	FEET	NA	DARTHURS	Jan 24, 2019 10:45:53 PM	No	
11,154 - Decelerometer Results Test 2	FEET	NA	DARTHURS	Jan 24, 2019 10:45:53 PM	No	
11,156 - Decelerometer Results Test 3	FEET	NA	DARTHURS	Jan 24, 2019 10:45:53 PM	No	
11,161 - FRA Check/Record Oil Pressure / @1500 rpm	Pounds per Square Inch	NA	DARTHURS	Jan 24, 2019 10:45:53 PM	No	
11,162 - FRA Check/Record Water Temperature	Degree Fahrenheit	NA	DARTHURS	Jan 24, 2019 10:45:53 PM	No	
11,170 - FRA Check Door Operation	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
11,180 - FRA Check Operation of All Other Accessories	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
20,000 - SECTION 2 Interior Circle Inspection	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
20,210 - Check Condition of Operator's Area	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
20,220 - Check Accelerator and Brake Pedals	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
20,230 - FRA Check Wiring Under Dash	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
20,240 - FRA Check Interior Lights	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
20,250 - FRA Check Interior Electrical Panels	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
20,260 - Check Stop Request System	-	NA	DARTHURS	Jan 24, 2019 10:45:53 PM	No	
20,270 - Check Fare Box Mounting (If Applicable)	-	NA	DARTHURS	Jan 24, 2019 10:45:53 PM	No	
20,280 - Check Seats, Seat Belts, Hand Rails and Floor Covering	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
20,290 - Check for Physical Damage, Water Leaks, and Graffiti	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
22,100 - Check Emergency Windows and Glass Condition	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
22,110 - Check Emergency Hatches	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
22,120 - Check All Safety Equipment	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
30,000 - SECTION 3 Exterior Circle Inspection	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
30,310 - Check Passenger Doors	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
30,320 - Inspect Step-well and Hand Rails	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
30,330 - Check Wheelchair Lift Operation	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
30,340 - FRA Check Destination Sign and Run Box	-	NA	DARTHURS	Jan 24, 2019 10:45:53 PM	No	
30,350 - FRA Inspect Mirror and Mountings	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
30,360 - Check for Physical Damage and Decals	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
30,370 - Check Wiper Blade and Arm Condition	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
30,380 - Check Exterior Compartment Doors	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
30,390 - FRA Check Fuel Tank Cap	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
33,100 - Check Lights and Reflectors	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
33,110 - Check License Plate, Permits and State Inspection Decals	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
40,000 - SECTION 4 Engine Compartment Inspection	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
40,410 - FRA Check Engine Compartment/Condition for Fire Risk	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
40,420 - Check Hood	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
40,430 - Check Fan, Shroud and Radiator	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
40,440 - Test Coolant System Using Test Strips and Record Results	-	NA	DARTHURS	Jan 24, 2019 10:45:53 PM	No	
40,441 - Inhibitor Test Pass or Fail (Indicate with a Yes or No)	No	NA	DARTHURS	Jan 24, 2019 10:45:53 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
40,442 - Freeze Point	Degree Fahrenheit	NA	DARTHURS	Jan 24, 2019 10:45:53 PM	No	
40,450 - FRA Check Coolant Recovery System Condition & for Leaks	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
40,460 - Record Antifreeze Protection Level Using Refractometer	-	NA	DARTHURS	Jan 24, 2019 10:45:53 PM	No	
40,461 - Refractometer Reading	Degree Fahrenheit	NA	DARTHURS	Jan 24, 2019 10:45:53 PM	No	
40,470 - Pressure Test Cooling System and Check for Leaks	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
40,480 - FRA Check Coolant Hose Condition	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
40,490 - FRA Check Alternator Mount and Condition	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
44,100 - FRA Check Fuel Control and Transmission Connections	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
44,110 - FRA Check Master Cylinder Fluid Level	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
44,120 - FRA Check All Belts for Condition, Alignment and Tension	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
44,130 - FRA Check Exhaust System	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
44,140 - FRA Check Intake System	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
44,150 - FRA Inspect Turbocharger	-	NA	DARTHURS	Jan 24, 2019 10:45:53 PM	No	
44,160 - FRA Inspect Power Steering and Hydraulic Fluid	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
44,170 - FRA Check All Engine or Belt Driven Components	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
44,180 - FRA Check for Leaks	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
44,190 - FRA Perform Battery Inspection	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
44,200 - FRA Check Battery Box Corrosion, Cables and Hold-Downs	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
50,000 - SECTION 5 Steering System Inspection	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
50,510 - Check Entire Steering System	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
60,000 - SECTION 6 Tires and Wheel Inspection	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
60,610 - FRA Check and Record Air Pressure	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
60,611 - Air Pressure RF	70 Pounds per Square Inch		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
60,612 - Air Pressure LF	70 Pounds per Square Inch		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
60,613 - Air Pressure RRO	65 Pounds per Square Inch		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
60,614 - Air Pressure RRI	65 Pounds per Square Inch		DARTHURS	Jan 24, 2019 10:45:53 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
60,615 - Air Pressure LRI	65 Pounds per Square Inch		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
60,616 - Air Pressure LRO	65 Pounds per Square Inch		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
60,620 - Check Valve Stems and Caps	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
60,630 - Check and Record Tread Depth	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
60,631 - Tread Depth RF	7 32nds of an inch		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
60,632 - Tread Depth LF	7 32nds of an inch		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
60,633 - Tread Depth RRO	10 32nds of an inch		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
60,634 - Tread Depth RRI	10 32nds of an inch		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
60,635 - Tread Depth LRI	9 32nds of an inch		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
60,636 - Tread Depth LRO	8 32nds of an inch		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
60,640 - Check for Mismatched Tread or Casing Design	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
60,650 - Check Sidewall Wear	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
60,660 - Inspect for Cuts and Tears	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
60,670 - Check Dual Mating With Square	-	NA	DARTHURS	Jan 24, 2019 10:45:53 PM	No	
60,680 - Check Wheels for Cracks and Loose Lugs	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
60,690 - Check Tires for Irregular or Alignment Wear	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
66,100 - FRA Check Outer Hubs for Leaks	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
70,000 - SECTION 7 Under Vehicle Inspection	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
70,710 - Check Vibration Damper	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
70,720 - Check Engine and Transmission Mounts	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
70,730 - FRA Check Starter	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
70,740 - FRA Check Bottom of Engine for Fluid Leaks	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
70,750 - FRA Check Transmission for Leaks	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
70,760 - FRA Check Differential Breather and Fluid	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
70,770 - FRA Check Exhaust System	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
70,780 - Check Driveline, U-joint and Slip Yokes	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
70,790 - Check All Body Mounts and Chassis Frame	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
77,100 - FRA Check Security, Integrity and Length of Ground Straps	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
77,110 - FRA Check Fuel Tank	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
77,120 - Check Suspension Components	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
77,130 - FRA Check Brake Pad Thickness and Rotor for Wear	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
77,131 - Brake Pad Thickness LF	9 Inch		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
77,132 - Brake Pad Thickness RF	9 Inch		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
77,133 - Brake Pad Thickness LR	8 Inch		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
77,134 - Brake Pad Thickness RR	8 Inch		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
77,135 - Brake Rotor LF	1.555 Inch		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
77,136 - Brake Rotor RF	1.556 Inch		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
77,137 - Brake Rotor LR	1.655 Inch		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
77,138 - Brake Rotor RR	1.654 Inch		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
77,140 - FRA Check Brake Hoses	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
77,150 - Check King Pins	-	NA	DARTHURS	Jan 24, 2019 10:45:53 PM	No	
77,160 - FRA Check for Loose or Noisy Wheel Bearings	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
80,000 - SECTION 8 PMI Report Completion	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
80,810 - Completion of PMI Report	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
90,000 - SECTION 9 Completion of PMI	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	
90,910 - Vehicle Returned to predetermined location	Done		DARTHURS	Jan 24, 2019 10:45:53 PM	No	

Activity Sub Total

Activity 10 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	1.50
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 52021846
Invoice No. 55345 - 52021846

Client Department:

Department: 55345M

Work Order Description

PM A

Requested By: TDELVA

Created By: TDELVA

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 147,440 - DH

Activity Header

Activity: 20 999 TOTAL VEHICLE

Activity Note: PM A

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: A PM Level A

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
24-Jan-19	65266	PLUG, DRAIN, OIL, ENGINE	1	5.79	5.79
24-Jan-19	B329(F)	GOING OUT OF SERVICE SEE BALDWIN B329 IN THE FLEET ORG. FILTER, OIL, SPIN-ON	1	1.96	1.96

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
24-Jan-19	Arthurs,Durvin	0.4166666	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List						
20 Desc: PM A						
Task: PM A SERVICE Performed by: DARTHURS Performed on: 24-JAN-19						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
100,000 - "A" PMI SERVICING ITEMS	Done		DARTHURS	Jan 24, 2019 10:46:51 PM	No	
101,000 - FRA Change Oil Filters	Yes		DARTHURS	Jan 24, 2019 10:46:51 PM	No	
102,000 - FRA Drain Engine Oil	Yes		DARTHURS	Jan 24, 2019 10:46:51 PM	No	
103,000 - FRA Check Transmission Fluid	Done		DARTHURS	Jan 24, 2019 10:46:51 PM	No	
104,000 - Lubricate Chassis	Done		DARTHURS	Jan 24, 2019 10:46:51 PM	No	
105,000 - Replace or Clean A/C Filters	Done		DARTHURS	Jan 24, 2019 10:46:51 PM	No	
107,000 - FRA Change Primary Fuel Filter	No	NA	DARTHURS	Jan 24, 2019 10:46:51 PM	No	
108,000 - Lube all pivoting Mechanisms	Done		DARTHURS	Jan 24, 2019 10:46:51 PM	No	

Activity Sub Total															
	<table> <tr> <td colspan="2">Activity 20 Sub Total</td></tr> <tr> <td>Parts:</td><td>7.75</td></tr> <tr> <td>Labor:</td><td>0.00</td></tr> <tr> <td>Labor Hours:</td><td>0.42</td></tr> <tr> <td>Sublet Parts:</td><td>0.00</td></tr> <tr> <td>Sublet Labor:</td><td>0.00</td></tr> <tr> <td>Activity Sub Total</td><td>7.75</td></tr> </table>	Activity 20 Sub Total		Parts:	7.75	Labor:	0.00	Labor Hours:	0.42	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	7.75
Activity 20 Sub Total															
Parts:	7.75														
Labor:	0.00														
Labor Hours:	0.42														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	7.75														



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 52021846
Invoice No. 55345 - 52021846

Client Department:

Department: 55345M

Work Order Description

PM A

Requested By: TDELVA

Created By: TDELVA

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 147,440 - DH

Activity Header

Activity: 30 999 TOTAL VEHICLE

Activity Note: PRAMETER

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
24-Jan-19	Arthurs,Durvin	0.0833333	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List						
30 Desc: PRAMETER						
Task: PRA and Meter Readings Performed by: DARTHURS Performed on: 24-JAN-19						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		DARTHURS	Jan 24, 2019 10:47:37 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		DARTHURS	Jan 24, 2019 10:47:37 PM	No	
3 - Are you wearing the appropriate PPE?	Done		DARTHURS	Jan 24, 2019 10:47:37 PM	No	
4 - Have you performed the proper LOTO?	Done		DARTHURS	Jan 24, 2019 10:47:37 PM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		DARTHURS	Jan 24, 2019 10:47:37 PM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		DARTHURS	Jan 24, 2019 10:47:37 PM	No	
20 - Miles			DARTHURS	Jan 24, 2019 10:47:37 PM	No	
30 - Kilometers			DARTHURS	Jan 24, 2019 10:47:37 PM	No	
40 - Hours			DARTHURS	Jan 24, 2019 10:47:37 PM	No	


Activity Sub Total

Activity 30 Sub Total

	Parts:	0.00
	Labor:	0.00
	Labor Hours:	0.08
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	0.00
Work Order Footer		
	Work Order 52021846 Total	
	Parts:	7.75
	Labor:	0.00
	Labor Hours:	2.00
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	7.75



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 52023802
Invoice No. 55345 - 52023802

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Replace			Ford E450 Champion Challenger
Requested By:	CKARLENS	Status:	40 - Closed (40)
Created By:	CKARLENS	Priority:	2 - Medium
Assigned To:		Driver:	
Class:	-	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	143,247 - DH

Chronology		
Reported	Dec 26, 2018 12:23:41 PM	Dec 26, 2018 12:23:41 PM
Started	Dec 26, 2018 12:00:00 AM	
Completed	Dec 27, 2018 2:47:56 PM	Dec 27, 2018 2:47:56 PM
Down Time		

Work Order Notes

Line 10 Tech Replaced both heather hoses

Activity Header						
Activity: 10 999/999/999 TOTAL VEHICLE						
Activity Note: PERSONAL RISK ASSESMENT						
Reason for Repair:	05	Inspection, Routine				
Work Accomplished:	06	Inspect				
Part Failure:	00	No Failure				
Activity Comments:						
Activity Parts						
No Data Available						
Activity Labor						
Booked Date	Technician	Hours	Shop Rate	Extended		
26-Dec-18	KARLENS,Cyrus	0.3333333	0	0		
Activity Sublet						
No Data Available						
Activity Checklist						
Check List						
10 Desc: PERSONAL RISK ASSESMENT						
Task: PRA and Meter Readings Performed by: CKARLENS Performed on: 26-DEC-18						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		CKARLENS	Dec 26, 2018 12:38:38 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		CKARLENS	Dec 26, 2018 12:38:38 PM	No	
3 - Are you wearing the appropriate PPE?	Done		CKARLENS	Dec 26, 2018 12:38:38 PM	No	
4 - Have you performed the proper LOTO?	Done		CKARLENS	Dec 26, 2018 12:38:38 PM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		CKARLENS	Dec 26, 2018 12:38:38 PM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		CKARLENS	Dec 26, 2018 12:38:38 PM	No	
20 - Miles			CKARLENS	Dec 26, 2018	No	


Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
				12:38:38 PM		
30 - Kilometers			CKARLENS	Dec 26, 2018 12:38:38 PM	No	
40 - Hours			CKARLENS	Dec 26, 2018 12:38:38 PM	No	

Activity Sub Total

Activity 10 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	0.33
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 52023802
Invoice No. 55345 - 52023802

Client Department:		Equipment No.:	4514-P
Department:	55345M	VIN:	1FDFE4FS7EDB17176
Work Order Description			Ford E450 Champion Challenger
Replace		Status:	40 - Closed (40)
Requested By:	CKARLENS	Priority:	2 - Medium
Created By:	CKARLENS	Driver:	
Assigned To:		Phone:	
Class:	-	ETA:	
Arrangement:	Unassigned	Meter:	143,247 - DH
Potential Warranty:	No		

Activity Header
Activity:20 042/000/000 COOLING SYSTEM
Activity Note:
Reason for Repair: 05 Inspection, Routine
Work Accomplished: 03 Replace New
Part Failure:
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
26-Dec-18	BC2Z-18472-DA	TUBE, HEATER, WATER	1	50.32	50.32
26-Dec-18	BC2Z-18472-CA	TUBE, HEATER, WATER	1	49.68	49.68

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
26-Dec-18	KARLENS,Cyrius	4	0	0

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available

Activity Sub Total	
Activity 20 Sub Total	
Parts:	100.00
Labor:	0.00
Labor Hours:	4.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	100.00

Work Order Footer	
Work Order 52023802 Total	
Parts:	100.00
Labor:	0.00
Labor Hours:	4.33
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	100.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 51946226
Invoice No. 55345 - 51946226

Client Department:

Department: 55345M

Work Order Description

PM A

Requested By: DARTHURS

Created By: DARTHURS

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 143,068 - DH

Chronology

Reported	Dec 24, 2018 10:29:24 AM	Dec 24, 2018 10:29:24 AM
Started	Dec 24, 2018 12:00:00 AM	
Completed	Dec 24, 2018 10:34:00 PM	Dec 24, 2018 10:34:00 PM
Down Time		

Work Order Notes

Line 10 COMPLAINT: PMA

CAUSE: Service due

CORRECTION: Performed and completed pmA
Changed engine oil and replaced engine oil filter

Activity Header

Activity: 10 999 TOTAL VEHICLE

Activity Note: Light Medium Duty PMI

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: A PM Level A

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
24-Dec-18	Delva,Terry	0.5	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: Light Medium Duty PMI

Task: First Transit Light-Medium Duty PMI Performed by: TDELVA Performed on: 24-DEC-18

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,000 - SECTION 1 Preparation and Drive On (In Lot) Inspection	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
10,100 - Safety Inspection	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
10,110 - FRA Check Drivers Pre-trip or DVIR/EVIR & Authorization Forms	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
10,120 - FRA Check All Warning Lights and Alarms	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,130 - FRA Check Automatic Transmission Neutral Start Operation	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
10,140 - Check Service Brakes	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
10,150 - FRA Start Engine and Listen for Any Unusual Noises	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
10,160 - FRA Check Instruments and Horns	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
10,170 - Check Fast Idle	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
10,180 - Check Starter Protection Circuit	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
10,190 - Check Reverse Warning System	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
11,100 - Check Parking Brake	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
11,110 - Check HVAC Switches and Other Controls	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
11,120 - FRA Inspect Windshields, Mirror and Sun Visor Condition	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
11,130 - FRA Check Wiper and Washer Operation	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
11,140 - Road Test: Check for Proper Operation	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
11,150 - Perform Brake Test	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
11,152 - Decelerometer Results Test 1	FEET	na	TDELVA	Dec 24, 2018 10:23:01 PM	No	
11,154 - Decelerometer Results Test 2	FEET	na	TDELVA	Dec 24, 2018 10:23:01 PM	No	
11,156 - Decelerometer Results Test 3	FEET	na	TDELVA	Dec 24, 2018 10:23:01 PM	No	
11,161 - FRA Check/Record Oil Pressure / @1500 rpm	Pounds per Square Inch	na	TDELVA	Dec 24, 2018 10:23:01 PM	No	
11,162 - FRA Check/Record Water Temperature	Degree Fahrenheit	na	TDELVA	Dec 24, 2018 10:23:01 PM	No	
11,170 - FRA Check Door Operation	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
11,180 - FRA Check Operation of All Other Accessories	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
20,000 - SECTION 2 Interior Circle Inspection	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
20,210 - Check Condition of Operator's Area	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
20,220 - Check Accelerator and Brake Pedals	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
20,230 - FRA Check Wiring Under Dash	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
20,240 - FRA Check Interior Lights	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
20,250 - FRA Check Interior Electrical Panels	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
20,260 - Check Stop Request System	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
20,270 - Check Fare Box Mounting (If Applicable)	-	na	TDELVA	Dec 24, 2018 10:23:01 PM	No	
20,280 - Check Seats, Seat Belts, Hand Rails and Floor Covering	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
20,290 - Check for Physical Damage, Water Leaks, and Graffiti	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
22,100 - Check Emergency Windows and Glass Condition	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
22,110 - Check Emergency Hatches	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
22,120 - Check All Safety Equipment	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
30,000 - SECTION 3 Exterior Circle Inspection	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
30,310 - Check Passenger Doors	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
30,320 - Inspect Step-well and Hand Rails	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
30,330 - Check Wheelchair Lift Operation	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
30,340 - FRA Check Destination Sign and Run Box	-	na	TDELVA	Dec 24, 2018 10:23:01 PM	No	
30,350 - FRA Inspect Mirror and Mountings	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
30,360 - Check for Physical Damage and Decals	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
30,370 - Check Wiper Blade and Arm Condition	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
30,380 - Check Exterior Compartment Doors	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
30,390 - FRA Check Fuel Tank Cap	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
33,100 - Check Lights and Reflectors	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
33,110 - Check License Plate, Permits and State Inspection Decals	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
40,000 - SECTION 4 Engine Compartment Inspection	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
40,410 - FRA Check Engine Compartment/Condition for Fire Risk	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
40,420 - Check Hood	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
40,430 - Check Fan, Shroud and Radiator	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
40,440 - Test Coolant System Using Test Strips and Record Results	-	na	TDELVA	Dec 24, 2018 10:23:01 PM	No	
40,441 - Inhibitor Test Pass or Fail (Indicate with a Yes or No)	No	na	TDELVA	Dec 24, 2018 10:23:01 PM	No	
40,442 - Freeze Point	Degree Fahrenheit	na	TDELVA	Dec 24, 2018 10:23:01 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
40,450 - FRA Check Coolant Recovery System Condition & for Leaks	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
40,460 - Record Antifreeze Protection Level Using Refractometer	-	na	TDELVA	Dec 24, 2018 10:23:01 PM	No	
40,461 - Refractometer Reading	Degree Fahrenheit	na	TDELVA	Dec 24, 2018 10:23:01 PM	No	
40,470 - Pressure Test Cooling System and Check for Leaks	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
40,480 - FRA Check Coolant Hose Condition	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
40,490 - FRA Check Alternator Mount and Condition	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
44,100 - FRA Check Fuel Control and Transmission Connections	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
44,110 - FRA Check Master Cylinder Fluid Level	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
44,120 - FRA Check All Belts for Condition, Alignment and Tension	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
44,130 - FRA Check Exhaust System	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
44,140 - FRA Check Intake System	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
44,150 - FRA Inspect Turbocharger	-	na	TDELVA	Dec 24, 2018 10:23:01 PM	No	
44,160 - FRA Inspect Power Steering and Hydraulic Fluid	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
44,170 - FRA Check All Engine or Belt Driven Components	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
44,180 - FRA Check for Leaks	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
44,190 - FRA Perform Battery Inspection	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
44,200 - FRA Check Battery Box Corrosion, Cables and Hold-Downs	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
50,000 - SECTION 5 Steering System Inspection	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
50,510 - Check Entire Steering System	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
60,000 - SECTION 6 Tires and Wheel Inspection	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
60,610 - FRA Check and Record Air Pressure	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
60,611 - Air Pressure RF	65 Pounds per Square Inch		TDELVA	Dec 24, 2018 10:23:01 PM	No	
60,612 - Air Pressure LF	65 Pounds per Square Inch		TDELVA	Dec 24, 2018 10:23:01 PM	No	
60,613 - Air Pressure RRO	65 Pounds per Square Inch		TDELVA	Dec 24, 2018 10:23:01 PM	No	
60,614 - Air Pressure RRI	65 Pounds per Square Inch		TDELVA	Dec 24, 2018 10:23:01 PM	No	
60,615 - Air Pressure LRI	65 Pounds per Square Inch		TDELVA	Dec 24, 2018 10:23:01 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
60,616 - Air Pressure LRO	65 Pounds per Square Inch		TDELVA	Dec 24, 2018 10:23:01 PM	No	
60,620 - Check Valve Stems and Caps	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
60,630 - Check and Record Tread Depth	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
60,631 - Tread Depth RF	12 32nds of an inch		TDELVA	Dec 24, 2018 10:23:01 PM	No	
60,632 - Tread Depth LF	12 32nds of an inch		TDELVA	Dec 24, 2018 10:23:01 PM	No	
60,633 - Tread Depth RRO	11 32nds of an inch		TDELVA	Dec 24, 2018 10:23:01 PM	No	
60,634 - Tread Depth RRI	11 32nds of an inch		TDELVA	Dec 24, 2018 10:23:01 PM	No	
60,635 - Tread Depth LRI	12 32nds of an inch		TDELVA	Dec 24, 2018 10:23:01 PM	No	
60,636 - Tread Depth LRO	11 32nds of an inch		TDELVA	Dec 24, 2018 10:23:01 PM	No	
60,640 - Check for Mismatched Tread or Casing Design	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
60,650 - Check Sidewall Wear	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
60,660 - Inspect for Cuts and Tears	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
60,670 - Check Dual Mating With Square	-	na	TDELVA	Dec 24, 2018 10:23:01 PM	No	
60,680 - Check Wheels for Cracks and Loose Lugs	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
60,690 - Check Tires for Irregular or Alignment Wear	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
66,100 - FRA Check Outer Hubs for Leaks	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
70,000 - SECTION 7 Under Vehicle Inspection	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
70,710 - Check Vibration Damper	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
70,720 - Check Engine and Transmission Mounts	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
70,730 - FRA Check Starter	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
70,740 - FRA Check Bottom of Engine for Fluid Leaks	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
70,750 - FRA Check Transmission for Leaks	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
70,760 - FRA Check Differential Breather and Fluid	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
70,770 - FRA Check Exhaust System	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
70,780 - Check Driveline, U-joint and Slip Yokes	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
70,790 - Check All Body Mounts and Chassis Frame	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
77,100 - FRA Check Security, Integrity and Length of Ground Straps	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
77,110 - FRA Check Fuel Tank	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
77,120 - Check Suspension Components	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
77,130 - FRA Check Brake Pad Thickness and Rotor for Wear	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
77,131 - Brake Pad Thickness LF	8 Inch		TDELVA	Dec 24, 2018 10:23:01 PM	No	
77,132 - Brake Pad Thickness RF	8 Inch		TDELVA	Dec 24, 2018 10:23:01 PM	No	
77,133 - Brake Pad Thickness LR	8 Inch		TDELVA	Dec 24, 2018 10:23:01 PM	No	
77,134 - Brake Pad Thickness RR	8 Inch		TDELVA	Dec 24, 2018 10:23:01 PM	No	
77,135 - Brake Rotor LF	39.5 Inch		TDELVA	Dec 24, 2018 10:23:01 PM	No	
77,136 - Brake Rotor RF	39.6 Inch		TDELVA	Dec 24, 2018 10:23:01 PM	No	
77,137 - Brake Rotor LR	37.8 Inch		TDELVA	Dec 24, 2018 10:23:01 PM	No	
77,138 - Brake Rotor RR	38.6 Inch		TDELVA	Dec 24, 2018 10:23:01 PM	No	
77,140 - FRA Check Brake Hoses	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
77,150 - Check King Pins	-	na	TDELVA	Dec 24, 2018 10:23:01 PM	No	
77,160 - FRA Check for Loose or Noisy Wheel Bearings	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
80,000 - SECTION 8 PMI Report Completion	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
80,810 - Completion of PMI Report	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
90,000 - SECTION 9 Completion of PMI	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
90,910 - Vehicle Returned to predetermined location	Done		TDELVA	Dec 24, 2018 10:23:01 PM	No	
Activity Sub Total						
				Activity 10 Sub Total		
				Parts:	0.00	
				Labor:	0.00	
				Labor Hours:	0.50	
				Sublet Parts:	0.00	
				Sublet Labor:	0.00	
				Activity Sub Total	0.00	



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 51946226
Invoice No. 55345 - 51946226

Client Department:

Department: 55345M

Work Order Description

PM A

Requested By: DARTHURS

Created By: DARTHURS

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 143,068 - DH

Activity Header

Activity: 20 999 TOTAL VEHICLE

Activity Note: PM A

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: A PM Level A

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
24-Dec-18	B329(F)	GOING OUT OF SERVICE SEE BALDWIN B329 IN THE FLEET ORG. FILTER, OIL, SPIN-ON	1	1.96	1.96

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
24-Dec-18	Delva, Terry	1.2166666	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List						
20 Desc: PM A						
Task: PM A SERVICE Performed by: TDELVA Performed on: 24-DEC-18						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
100,000 - "A" PMI SERVICING ITEMS	Done		TDELVA	Dec 24, 2018 10:23:35 PM	No	
101,000 - FRA Change Oil Filters	Yes		TDELVA	Dec 24, 2018 10:23:35 PM	No	
102,000 - FRA Drain Engine Oil	Yes		TDELVA	Dec 24, 2018 10:23:35 PM	No	
103,000 - FRA Check Transmission Fluid	Done		TDELVA	Dec 24, 2018 10:23:35 PM	No	
104,000 - Lubricate Chassis	Done		TDELVA	Dec 24, 2018 10:23:35 PM	No	
105,000 - Replace or Clean A/C Filters	Done		TDELVA	Dec 24, 2018 10:23:35 PM	No	
107,000 - FRA Change Primary Fuel Filter	No	na	TDELVA	Dec 24, 2018 10:23:35 PM	No	
108,000 - Lube all pivoting Mechanisms	Done		TDELVA	Dec 24, 2018 10:23:35 PM	No	

Activity Sub Total

	Activity 20 Sub Total	
	Parts:	1.96
	Labor:	0.00
	Labor Hours:	1.22
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	1.96



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 51946226
Invoice No. 55345 - 51946226

Client Department:

Department: 55345M

Work Order Description

PM A

Requested By: DARTHURS

Created By: DARTHURS

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 143,068 - DH

Activity Header

Activity: 30 999 TOTAL VEHICLE

Activity Note: PRAMETER

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
24-Dec-18	Delva, Terry	1	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

30 Desc: PRAMETER

Task: PRA and Meter Readings Performed by: TDELVA Performed on: 24-DEC-18

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		TDELVA	Dec 24, 2018 10:16:44 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		TDELVA	Dec 24, 2018 10:16:44 PM	No	
3 - Are you wearing the appropriate PPE?	Done		TDELVA	Dec 24, 2018 10:16:44 PM	No	
4 - Have you performed the proper LOTO?	Done		TDELVA	Dec 24, 2018 10:16:44 PM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		TDELVA	Dec 24, 2018 10:16:44 PM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		TDELVA	Dec 24, 2018 10:16:44 PM	No	
20 - Miles			TDELVA	Dec 24, 2018 10:16:44 PM	No	
30 - Kilometers			TDELVA	Dec 24, 2018 10:16:44 PM	No	
40 - Hours			TDELVA	Dec 24, 2018 10:16:44 PM	No	


Activity Sub Total

Activity 30 Sub Total

	Parts:	0.00
	Labor:	0.00
	Labor Hours:	1.00
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	0.00
Work Order Footer		
	Work Order 51946226 Total	
	Parts:	1.96
	Labor:	0.00
	Labor Hours:	2.72
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	1.96



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 51977889
Invoice No. 55345 - 51977889

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
1 rear tire		Ford E450 Champion Challenger	
Requested By:	VAMRITTEEMAL	Status:	40 - Closed (40)
Created By:	VAMRITTEEMAL	Priority:	-
Assigned To:		Driver:	
Class:	-	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	140,473 - DH

Chronology

Reported	Dec 9, 2018 1:50:01 PM	Dec 9, 2018 1:50:01 PM
Started	Dec 9, 2018 12:00:00 AM	
Completed	Dec 10, 2018 1:58:53 PM	Dec 10, 2018 1:58:53 PM
Down Time		

Work Order Notes

Line 10 Right rear outer tire flat
Mount and balanced right rear outer tire torque to 140ftlb test driven and retorqued to 140ftlb

Activity Header

Activity: 10 999/999/999 TOTAL VEHICLE
Activity Note: PERSONAL RISK ASSESMENT
Reason for Repair: 05 Inspection, Routine
Work Accomplished: 06 Inspect
Part Failure: 00 No Failure
Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
09-Dec-18	AMRIT TEEMAL,VISHNU	0.2666666	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: PERSONAL RISK ASSESMENT
Task: PRA and Meter Readings Performed by: VAMRITTEEMAL Performed on: 09-DEC-18

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		VAMRITTEEMAL	Dec 9, 2018 1:54:47 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		VAMRITTEEMAL	Dec 9, 2018 1:54:47 PM	No	
3 - Are you wearing the appropriate PPE?	Done		VAMRITTEEMAL	Dec 9, 2018 1:54:47 PM	No	
4 - Have you performed the proper LOTO?	Done		VAMRITTEEMAL	Dec 9, 2018 1:54:47 PM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		VAMRITTEEMAL	Dec 9, 2018 1:54:47 PM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		VAMRITTEEMAL	Dec 9, 2018 1:54:47 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
20 - Miles			VAMRITTEEMAL	Dec 9, 2018 1:54:47 PM	No	
30 - Kilometers			VAMRITTEEMAL	Dec 9, 2018 1:54:47 PM	No	
40 - Hours			VAMRITTEEMAL	Dec 9, 2018 1:54:47 PM	No	
Activity Sub Total						
			Activity 10 Sub Total			
			Parts:			0.00
			Labor:			0.00
			Labor Hours:			0.27
			Sublet Parts:			0.00
			Sublet Labor:			0.00
			Activity Sub Total			0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 51977889
Invoice No. 55345 - 51977889

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
1 rear tire		Ford E450 Champion Challenger	
Requested By:	VAMRITTEEMAL	Status:	40 - Closed (40)
Created By:	VAMRITTEEMAL	Priority:	-
Assigned To:		Driver:	
Class:	-	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	140,473 - DH

Activity Header
Activity:20 018/000/000 WHEELS, RIMS, HUBS AND BEARINGS
Activity Note:
Reason for Repair: 08 Preventive Maintenance
Work Accomplished: 03 Replace New
Part Failure: 99 Replaced Before Failure
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
09-Dec-18	189752	TIRE, LT225/75R16, TLBLPS115RE, TRANSFORCE HT 10PLY 1622575E, NEW	1	106.13	106.13

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
09-Dec-18	AMRIT TEEMAL,VISHNU	0.5	0	0

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available

Activity Sub Total	
Activity 20 Sub Total	
Parts:	106.13
Labor:	0.00
Labor Hours:	0.50
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	106.13

Work Order Footer	
Work Order 51977889 Total	
Parts:	106.13
Labor:	0.00
Labor Hours:	0.77
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	106.13



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 51966775
Invoice No. 55345 - 51966775

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Front A/C don't blowing hot air		Ford E450 Champion Challenger	
Requested By:	HPIERRE	Status:	40 - Closed (40)
Created By:	HPIERRE	Priority:	-
Assigned To:		Driver:	
Class:	-	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	139,776 - DH

Chronology

Reported	Dec 5, 2018 12:56:55 PM	Dec 5, 2018 12:56:55 PM
Started	Dec 5, 2018 12:00:00 AM	
Completed	Dec 7, 2018 9:31:59 AM	Dec 7, 2018 9:31:59 AM
Down Time		

Work Order Notes

Line 10 Front A/C don't blow air

Normal wear

Replace blower motor completed

Activity Header

Activity: 10 999/999/999 TOTAL VEHICLE

Activity Note: PERSONAL RISK ASSESMENT

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure: 00 No Failure

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
05-Dec-18	Pierre, Hubert J	1	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: PERSONAL RISK ASSESMENT

Task: PRA and Meter Readings Performed by: HPIERRE Performed on: 06-DEC-18

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		HPIERRE	Dec 6, 2018 9:16:43 AM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		HPIERRE	Dec 6, 2018 9:16:43 AM	No	
3 - Are you wearing the appropriate PPE?	Done		HPIERRE	Dec 6, 2018 9:16:43 AM	No	
4 - Have you performed the proper LOTO?	Done		HPIERRE	Dec 6, 2018 9:16:43 AM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		HPIERRE	Dec 6, 2018 9:16:43 AM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		HPIERRE	Dec 6, 2018 9:16:43 AM	No	
20 - Miles			HPIERRE	Dec 6, 2018 9:16:43 AM	No	
30 - Kilometers	4		HPIERRE	Dec 6, 2018 9:16:43 AM	No	
40 - Hours	2		HPIERRE	Dec 6, 2018 9:16:43 AM	No	

Activity Sub Total

Activity 10 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	1.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2




Work Order No. 51966775
Invoice No. 55345 - 51966775

Client Department:
Department: 55345M
Work Order Description
Front A/C don't blowing hot air
Requested By: HPIERRE
Created By: HPIERRE
Assigned To:
Class: -
Arrangement: Unassigned
Potential Warranty: No
Equipment No.: 4514-P
VIN: 1FDFE4FS7EDB17176
Ford E450 Champion Challenger
Status: 40 - Closed (40)
Priority: -
Driver:
Phone:
ETA:
Meter: 139,776 - DH

Activity Header					
Activity:20 001/000/000 AIR CONDITIONING, HEATING AND VENTILATION					
Activity Note:					
Reason for Repair: 04 Driver's Report					
Work Accomplished: 03 Replace New					
Part Failure:					
Activity Comments:					
Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
05-Dec-18	XC2Z-19805-BA	MOTOR, BLOWER SAME AS MM-840	1	60.66	60.66
Activity Labor					
Booked Date	Technician	Hours	Shop Rate	Extended	
06-Dec-18	Pierre,Hubert J	0.1	0	0	
Activity Sublet					
No Data Available					
Activity Checklist					
No Data Available					
No Data Available					
Activity Sub Total					
			Activity 20 Sub Total		
			Parts:	60.66	
			Labor:	0.00	
			Labor Hours:	0.10	
			Sublet Parts:	0.00	
			Sublet Labor:	0.00	
			Activity Sub Total	60.66	
Work Order Footer					
			Work Order 51966775 Total		
			Parts:	60.66	
			Labor:	0.00	
			Labor Hours:	1.10	
			Sublet Parts:	0.00	
			Sublet Labor:	0.00	
			Activity Sub Total	60.66	



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 51870025
Invoice No. 55345 - 51870025

Client Department:

Department: 55345M

Work Order Description

PM B

Requested By: RGASPARD

Created By: RGASPARD

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 138,592 - DH

Chronology

Reported	Nov 28, 2018 10:49:44 AM	Nov 28, 2018 10:49:44 AM
Started	Nov 28, 2018 12:00:00 AM	
Completed	Nov 28, 2018 11:51:00 PM	Nov 28, 2018 11:51:00 PM
Down Time		

Work Order Notes

Line 10 COMPLAINT: PMB Service

CAUSE: Service due by Mileage..

CORRECTION: Change Oil & Filter. Lube All Pivoting Points. Check Brakes ,Clean batteries . Replace Air Filter.

Parts# B329 Qty (1)

Parts#PA4075 Qty (1)

Oil 5W20 Qty (7,0) Qt

Activity Header

Activity:10 999 TOTAL VEHICLE

Activity Note: Light Medium Duty PMI

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
28-Nov-18	Arthurs,Durvin	2	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: Light Medium Duty PMI

Task: First Transit Light-Medium Duty PMI Performed by: DARTHURS Performed on: 28-NOV-18

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,000 - SECTION 1 Preparation and Drive On (In Lot) Inspection	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
10,100 - Safety Inspection	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
10,110 - FRA Check Drivers Pre-trip or DVIR/EVIR & Authorization Forms	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
10,120 - FRA Check All Warning Lights and	Done		DARTHURS	Nov 28, 2018	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
Alarms				10:11:28 PM		
10,130 - FRA Check Automatic Transmission Neutral Start Operation	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
10,140 - Check Service Brakes	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
10,150 - FRA Start Engine and Listen for Any Unusual Noises	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
10,160 - FRA Check Instruments and Horns	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
10,170 - Check Fast Idle	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
10,180 - Check Starter Protection Circuit	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
10,190 - Check Reverse Warning System	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
11,100 - Check Parking Brake	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
11,110 - Check HVAC Switches and Other Controls	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
11,120 - FRA Inspect Windshields, Mirror and Sun Visor Condition	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
11,130 - FRA Check Wiper and Washer Operation	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
11,140 - Road Test: Check for Proper Operation	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
11,150 - Perform Brake Test	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
11,152 - Decelerometer Results Test 1	FEET	NA	DARTHURS	Nov 28, 2018 10:11:28 PM	No	
11,154 - Decelerometer Results Test 2	FEET	NA	DARTHURS	Nov 28, 2018 10:11:28 PM	No	
11,156 - Decelerometer Results Test 3	FEET	NA	DARTHURS	Nov 28, 2018 10:11:28 PM	No	
11,161 - FRA Check/Record Oil Pressure / @1500 rpm	Pounds per Square Inch	NA	DARTHURS	Nov 28, 2018 10:11:28 PM	No	
11,162 - FRA Check/Record Water Temperature	Degree Fahrenheit	NA	DARTHURS	Nov 28, 2018 10:11:28 PM	No	
11,170 - FRA Check Door Operation	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
11,180 - FRA Check Operation of All Other Accessories	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
20,000 - SECTION 2 Interior Circle Inspection	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
20,210 - Check Condition of Operator's Area	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
20,220 - Check Accelerator and Brake Pedals	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
20,230 - FRA Check Wiring Under Dash	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
20,240 - FRA Check Interior Lights	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
20,250 - FRA Check Interior Electrical Panels	Done		DARTHURS	Nov 28, 2018	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
				10:11:28 PM		
20,260 - Check Stop Request System	-	NA	DARTHURS	Nov 28, 2018 10:11:28 PM	No	
20,270 - Check Fare Box Mounting (If Applicable)	-	NA	DARTHURS	Nov 28, 2018 10:11:28 PM	No	
20,280 - Check Seats, Seat Belts, Hand Rails and Floor Covering	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
20,290 - Check for Physical Damage, Water Leaks, and Graffiti	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
22,100 - Check Emergency Windows and Glass Condition	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
22,110 - Check Emergency Hatches	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
22,120 - Check All Safety Equipment	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
30,000 - SECTION 3 Exterior Circle Inspection	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
30,310 - Check Passenger Doors	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
30,320 - Inspect Step-well and Hand Rails	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
30,330 - Check Wheelchair Lift Operation	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
30,340 - FRA Check Destination Sign and Run Box	-	NA	DARTHURS	Nov 28, 2018 10:11:28 PM	No	
30,350 - FRA Inspect Mirror and Mountings	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
30,360 - Check for Physical Damage and Decals	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
30,370 - Check Wiper Blade and Arm Condition	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
30,380 - Check Exterior Compartment Doors	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
30,390 - FRA Check Fuel Tank Cap	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
33,100 - Check Lights and Reflectors	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
33,110 - Check License Plate, Permits and State Inspection Decals	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
40,000 - SECTION 4 Engine Compartment Inspection	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
40,410 - FRA Check Engine Compartment/Condition for Fire Risk	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
40,420 - Check Hood	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
40,430 - Check Fan, Shroud and Radiator	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
40,440 - Test Coolant System Using Test Strips and Record Results	-	NA	DARTHURS	Nov 28, 2018 10:11:28 PM	No	
40,441 - Inhibitor Test Pass or Fail (Indicate with a Yes or No)	No	NA	DARTHURS	Nov 28, 2018 10:11:28 PM	No	
40,442 - Freeze Point	Degree	NA	DARTHURS	Nov 28, 2018	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
	Fahrenheit			10:11:28 PM		
40,450 - FRA Check Coolant Recovery System Condition & for Leaks	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
40,460 - Record Antifreeze Protection Level Using Refractometer	-	NA	DARTHURS	Nov 28, 2018 10:11:28 PM	No	
40,461 - Refractometer Reading	Degree Fahrenheit	NA	DARTHURS	Nov 28, 2018 10:11:28 PM	No	
40,470 - Pressure Test Cooling System and Check for Leaks	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
40,480 - FRA Check Coolant Hose Condition	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
40,490 - FRA Check Alternator Mount and Condition	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
44,100 - FRA Check Fuel Control and Transmission Connections	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
44,110 - FRA Check Master Cylinder Fluid Level	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
44,120 - FRA Check All Belts for Condition, Alignment and Tension	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
44,130 - FRA Check Exhaust System	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
44,140 - FRA Check Intake System	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
44,150 - FRA Inspect Turbocharger	-	NA	DARTHURS	Nov 28, 2018 10:11:28 PM	No	
44,160 - FRA Inspect Power Steering and Hydraulic Fluid	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
44,170 - FRA Check All Engine or Belt Driven Components	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
44,180 - FRA Check for Leaks	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
44,190 - FRA Perform Battery Inspection	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
44,200 - FRA Check Battery Box Corrosion, Cables and Hold-Downs	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
50,000 - SECTION 5 Steering System Inspection	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
50,510 - Check Entire Steering System	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
60,000 - SECTION 6 Tires and Wheel Inspection	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
60,610 - FRA Check and Record Air Pressure	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
60,611 - Air Pressure RF	70 Pounds per Square Inch		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
60,612 - Air Pressure LF	70 Pounds per Square Inch		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
60,613 - Air Pressure RRO	65 Pounds per Square Inch		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
60,614 - Air Pressure RRI	65 Pounds per Square Inch		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
60,615 - Air Pressure LRI	65 Pounds per		DARTHURS	Nov 28, 2018	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
	Square Inch			10:11:28 PM		
60,616 - Air Pressure LRO	65 Pounds per Square Inch		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
60,620 - Check Valve Stems and Caps	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
60,630 - Check and Record Tread Depth	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
60,631 - Tread Depth RF	11 32nds of an inch		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
60,632 - Tread Depth LF	11 32nds of an inch		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
60,633 - Tread Depth RRO	12 32nds of an inch		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
60,634 - Tread Depth RRI	12 32nds of an inch		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
60,635 - Tread Depth LRI	11 32nds of an inch		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
60,636 - Tread Depth LRO	10 32nds of an inch		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
60,640 - Check for Mismatched Tread or Casing Design	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
60,650 - Check Sidewall Wear	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
60,660 - Inspect for Cuts and Tears	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
60,670 - Check Dual Mating With Square	-	NA	DARTHURS	Nov 28, 2018 10:11:28 PM	No	
60,680 - Check Wheels for Cracks and Loose Lugs	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
60,690 - Check Tires for Irregular or Alignment Wear	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
66,100 - FRA Check Outer Hubs for Leaks	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
70,000 - SECTION 7 Under Vehicle Inspection	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
70,710 - Check Vibration Damper	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
70,720 - Check Engine and Transmission Mounts	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
70,730 - FRA Check Starter	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
70,740 - FRA Check Bottom of Engine for Fluid Leaks	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
70,750 - FRA Check Transmission for Leaks	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
70,760 - FRA Check Differential Breather and Fluid	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
70,770 - FRA Check Exhaust System	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
70,780 - Check Driveline, U-joint and Slip Yokes	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
70,790 - Check All Body Mounts and Chassis	Done		DARTHURS	Nov 28, 2018	No	


Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
Frame				10:11:28 PM		
77,100 - FRA Check Security, Integrity and Length of Ground Straps	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
77,110 - FRA Check Fuel Tank	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
77,120 - Check Suspension Components	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
77,130 - FRA Check Brake Pad Thickness and Rotor for Wear	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
77,131 - Brake Pad Thickness LF	12 Inch		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
77,132 - Brake Pad Thickness RF	12 Inch		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
77,133 - Brake Pad Thickness LR	12 Inch		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
77,134 - Brake Pad Thickness RR	12 Inch		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
77,135 - Brake Rotor LF	1559 Inch		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
77,136 - Brake Rotor RF	1.559 Inch		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
77,137 - Brake Rotor LR	1.654 Inch		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
77,138 - Brake Rotor RR	1.655 Inch		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
77,140 - FRA Check Brake Hoses	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
77,150 - Check King Pins	-	NA	DARTHURS	Nov 28, 2018 10:11:28 PM	No	
77,160 - FRA Check for Loose or Noisy Wheel Bearings	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
80,000 - SECTION 8 PMI Report Completion	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
80,810 - Completion of PMI Report	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
90,000 - SECTION 9 Completion of PMI	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	
90,910 - Vehicle Returned to predetermined location	Done		DARTHURS	Nov 28, 2018 10:11:28 PM	No	

Activity Sub Total

Activity 10 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	2.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 51870025
Invoice No. 55345 - 51870025

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
PM B		Ford E450 Champion Challenger	
Requested By:	RGASPARD	Status:	40 - Closed (40)
Created By:	RGASPARD	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	138,592 - DH

Activity Header

Activity:20 999 TOTAL VEHICLE

Activity Note: PM B

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: B PM Level B

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
28-Nov-18	B329(F)	GOING OUT OF SERVICE SEE BALDWIN B329 IN THE FLEET ORG. FILTER, OIL, SPIN-ON	1	1.96	1.96
28-Nov-18	PA4075	FILTER, AIR SEE P546597	1	5.27	5.27

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
28-Nov-18	Arthurs,Durvin	0.4166666	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List						
20 Desc: PM B Task: PM B SERVICE Performed by: DARTHURS Performed on: 28-NOV-18						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
100,000 - "A" PMI SERVICING ITEMS	Done		DARTHURS	Nov 28, 2018 10:12:44 PM	No	
101,000 - FRA Change Oil Filters	Yes		DARTHURS	Nov 28, 2018 10:12:44 PM	No	
102,000 - FRA Drain Engine Oil	Yes		DARTHURS	Nov 28, 2018 10:12:44 PM	No	
103,000 - FRA Check Transmission Fluid	Done		DARTHURS	Nov 28, 2018 10:12:44 PM	No	
104,000 - Lubricate Chassis	Done		DARTHURS	Nov 28, 2018 10:12:44 PM	No	
105,000 - Replace or Clean A/C Filters	Done		DARTHURS	Nov 28, 2018 10:12:44 PM	No	
107,000 - FRA Change Primary Fuel Filter	No	NA	DARTHURS	Nov 28, 2018 10:12:44 PM	No	
108,000 - Lube all pivoting Mechanisms	Done		DARTHURS	Nov 28, 2018 10:12:44 PM	No	


Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
200,000 - "B" PMI SERVICING ITEMS (12 MONTH)	Done		DARTHURS	Nov 28, 2018 10:12:44 PM	No	
201,000 - Service Crankcase Breather	-	NA	DARTHURS	Nov 28, 2018 10:12:44 PM	No	
203,000 - FRA Change Automatic Transmission Fluid	No		DARTHURS	Nov 28, 2018 10:12:44 PM	No	
204,000 - FRA Change Power Steering Fluid and Filter	No		DARTHURS	Nov 28, 2018 10:12:44 PM	No	
205,000 - Complete Engine Diagnostics and Clear Codes when Completed	Done		DARTHURS	Nov 28, 2018 10:12:44 PM	No	

Activity Sub Total

Activity 20 Sub Total	
Parts:	7.23
Labor:	0.00
Labor Hours:	0.42
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	7.23



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 51870025
Invoice No. 55345 - 51870025

Client Department:

Department: 55345M

Work Order Description

PM B

Requested By: RGASPARD

Created By: RGASPARD

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 138,592 - DH

Activity Header

Activity: 30 999 TOTAL VEHICLE

Activity Note: PRAMETER

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
28-Nov-18	Arthurs,Durvin	0.0833333	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

30 Desc: PRAMETER

Task: PRA and Meter Readings Performed by: DARTHURS Performed on: 28-NOV-18

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		DARTHURS	Nov 28, 2018 10:13:29 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		DARTHURS	Nov 28, 2018 10:13:29 PM	No	
3 - Are you wearing the appropriate PPE?	Done		DARTHURS	Nov 28, 2018 10:13:29 PM	No	
4 - Have you performed the proper LOTO?	Done		DARTHURS	Nov 28, 2018 10:13:29 PM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		DARTHURS	Nov 28, 2018 10:13:29 PM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		DARTHURS	Nov 28, 2018 10:13:29 PM	No	
20 - Miles			DARTHURS	Nov 28, 2018 10:13:29 PM	No	
30 - Kilometers			DARTHURS	Nov 28, 2018 10:13:29 PM	No	
40 - Hours			DARTHURS	Nov 28, 2018 10:13:29 PM	No	


Activity Sub Total

Activity 30 Sub Total

	Parts:	0.00
	Labor:	0.00
	Labor Hours:	0.08
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	0.00
Work Order Footer		
	Work Order 51870025 Total	
	Parts:	7.23
	Labor:	0.00
	Labor Hours:	2.50
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	7.23



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 51797823
Invoice No. 55345 - 51797823

Client Department:

Department: 55345M

Work Order Description

PM A

Requested By: RGASPARD

Created By: RGASPARD

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 134,285 - DH

Chronology

Reported	Nov 1, 2018 1:04:40 PM	Nov 1, 2018 1:04:40 PM
Started	Nov 1, 2018 12:00:00 AM	
Completed	Nov 1, 2018 11:51:00 PM	Nov 1, 2018 11:51:00 PM
Down Time		

Work Order Notes

Line 10 COMPLAINT:pmA

CAUSE:Service

CORRECTION:Perform pmA Service

Oil filter B329 Qty1

Engine oil 5w20 qty 7 Qts

Activity Header

Activity:10 999 TOTAL VEHICLE

Activity Note: Light Medium Duty PMI

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: A PM Level A

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
01-Nov-18	Gaspard,Ronald	1.5333333	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: Light Medium Duty PMI

Task: First Transit Light-Medium Duty PMI Performed by: RGASPARD Performed on: 01-NOV-18

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,000 - SECTION 1 Preparation and Drive On (In Lot) Inspection	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
10,100 - Safety Inspection	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
10,110 - FRA Check Drivers Pre-trip or DVIR/EVIR & Authorization Forms	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
10,120 - FRA Check All Warning Lights and Alarms	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,130 - FRA Check Automatic Transmission Neutral Start Operation	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
10,140 - Check Service Brakes	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
10,150 - FRA Start Engine and Listen for Any Unusual Noises	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
10,160 - FRA Check Instruments and Horns	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
10,170 - Check Fast Idle	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
10,180 - Check Starter Protection Circuit	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
10,190 - Check Reverse Warning System	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
11,100 - Check Parking Brake	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
11,110 - Check HVAC Switches and Other Controls	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
11,120 - FRA Inspect Windshields, Mirror and Sun Visor Condition	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
11,130 - FRA Check Wiper and Washer Operation	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
11,140 - Road Test: Check for Proper Operation	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
11,150 - Perform Brake Test	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
11,152 - Decelerometer Results Test 1	FEET	na	RGASPARD	Nov 1, 2018 11:46:31 PM	No	
11,154 - Decelerometer Results Test 2	FEET	na	RGASPARD	Nov 1, 2018 11:46:31 PM	No	
11,156 - Decelerometer Results Test 3	FEET	na	RGASPARD	Nov 1, 2018 11:46:31 PM	No	
11,161 - FRA Check/Record Oil Pressure / @1500 rpm	Pounds per Square Inch	na	RGASPARD	Nov 1, 2018 11:46:31 PM	No	
11,162 - FRA Check/Record Water Temperature	Degree Fahrenheit	na	RGASPARD	Nov 1, 2018 11:46:31 PM	No	
11,170 - FRA Check Door Operation	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
11,180 - FRA Check Operation of All Other Accessories	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
20,000 - SECTION 2 Interior Circle Inspection	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
20,210 - Check Condition of Operator's Area	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
20,220 - Check Accelerator and Brake Pedals	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
20,230 - FRA Check Wiring Under Dash	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
20,240 - FRA Check Interior Lights	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
20,250 - FRA Check Interior Electrical Panels	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
20,260 - Check Stop Request System	-	na	RGASPARD	Nov 1, 2018 11:46:31 PM	No	
20,270 - Check Fare Box Mounting (If Applicable)	-	na	RGASPARD	Nov 1, 2018 11:46:31 PM	No	
20,280 - Check Seats, Seat Belts, Hand Rails and Floor Covering	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
20,290 - Check for Physical Damage, Water Leaks, and Graffiti	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
22,100 - Check Emergency Windows and Glass Condition	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
22,110 - Check Emergency Hatches	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
22,120 - Check All Safety Equipment	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
30,000 - SECTION 3 Exterior Circle Inspection	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
30,310 - Check Passenger Doors	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
30,320 - Inspect Step-well and Hand Rails	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
30,330 - Check Wheelchair Lift Operation	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
30,340 - FRA Check Destination Sign and Run Box	-	na	RGASPARD	Nov 1, 2018 11:46:31 PM	No	
30,350 - FRA Inspect Mirror and Mountings	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
30,360 - Check for Physical Damage and Decals	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
30,370 - Check Wiper Blade and Arm Condition	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
30,380 - Check Exterior Compartment Doors	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
30,390 - FRA Check Fuel Tank Cap	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
33,100 - Check Lights and Reflectors	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
33,110 - Check License Plate, Permits and State Inspection Decals	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
40,000 - SECTION 4 Engine Compartment Inspection	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
40,410 - FRA Check Engine Compartment/Condition for Fire Risk	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
40,420 - Check Hood	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
40,430 - Check Fan, Shroud and Radiator	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
40,440 - Test Coolant System Using Test Strips and Record Results	-	na	RGASPARD	Nov 1, 2018 11:46:31 PM	No	
40,441 - Inhibitor Test Pass or Fail (Indicate with a Yes or No)	No	na	RGASPARD	Nov 1, 2018 11:46:31 PM	No	
40,442 - Freeze Point	Degree Fahrenheit	na	RGASPARD	Nov 1, 2018 11:46:31 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
40,450 - FRA Check Coolant Recovery System Condition & for Leaks	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
40,460 - Record Antifreeze Protection Level Using Refractometer	-	na	RGASPARD	Nov 1, 2018 11:46:31 PM	No	
40,461 - Refractometer Reading	Degree Fahrenheit	na	RGASPARD	Nov 1, 2018 11:46:31 PM	No	
40,470 - Pressure Test Cooling System and Check for Leaks	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
40,480 - FRA Check Coolant Hose Condition	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
40,490 - FRA Check Alternator Mount and Condition	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
44,100 - FRA Check Fuel Control and Transmission Connections	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
44,110 - FRA Check Master Cylinder Fluid Level	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
44,120 - FRA Check All Belts for Condition, Alignment and Tension	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
44,130 - FRA Check Exhaust System	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
44,140 - FRA Check Intake System	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
44,150 - FRA Inspect Turbocharger	-	na	RGASPARD	Nov 1, 2018 11:46:31 PM	No	
44,160 - FRA Inspect Power Steering and Hydraulic Fluid	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
44,170 - FRA Check All Engine or Belt Driven Components	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
44,180 - FRA Check for Leaks	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
44,190 - FRA Perform Battery Inspection	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
44,200 - FRA Check Battery Box Corrosion, Cables and Hold-Downs	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
50,000 - SECTION 5 Steering System Inspection	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
50,510 - Check Entire Steering System	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
60,000 - SECTION 6 Tires and Wheel Inspection	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
60,610 - FRA Check and Record Air Pressure	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
60,611 - Air Pressure RF	70 Pounds per Square Inch		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
60,612 - Air Pressure LF	70 Pounds per Square Inch		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
60,613 - Air Pressure RRO	65 Pounds per Square Inch		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
60,614 - Air Pressure RRI	65 Pounds per Square Inch		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
60,615 - Air Pressure LRI	65 Pounds per Square Inch		RGASPARD	Nov 1, 2018 11:46:31 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
60,616 - Air Pressure LRO	65 Pounds per Square Inch		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
60,620 - Check Valve Stems and Caps	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
60,630 - Check and Record Tread Depth	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
60,631 - Tread Depth RF	11 32nds of an inch		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
60,632 - Tread Depth LF	12 32nds of an inch		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
60,633 - Tread Depth RRO	11 32nds of an inch		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
60,634 - Tread Depth RRI	12 32nds of an inch		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
60,635 - Tread Depth LRI	12 32nds of an inch		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
60,636 - Tread Depth LRO	12 32nds of an inch		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
60,640 - Check for Mismatched Tread or Casing Design	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
60,650 - Check Sidewall Wear	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
60,660 - Inspect for Cuts and Tears	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
60,670 - Check Dual Mating With Square	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
60,680 - Check Wheels for Cracks and Loose Lugs	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
60,690 - Check Tires for Irregular or Alignment Wear	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
66,100 - FRA Check Outer Hubs for Leaks	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
70,000 - SECTION 7 Under Vehicle Inspection	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
70,710 - Check Vibration Damper	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
70,720 - Check Engine and Transmission Mounts	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
70,730 - FRA Check Starter	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
70,740 - FRA Check Bottom of Engine for Fluid Leaks	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
70,750 - FRA Check Transmission for Leaks	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
70,760 - FRA Check Differential Breather and Fluid	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
70,770 - FRA Check Exhaust System	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
70,780 - Check Driveline, U-joint and Slip Yokes	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
70,790 - Check All Body Mounts and Chassis Frame	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
77,100 - FRA Check Security, Integrity and Length of Ground Straps	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
77,110 - FRA Check Fuel Tank	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
77,120 - Check Suspension Components	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
77,130 - FRA Check Brake Pad Thickness and Rotor for Wear	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
77,131 - Brake Pad Thickness LF	11 Inch		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
77,132 - Brake Pad Thickness RF	11 Inch		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
77,133 - Brake Pad Thickness LR	11 Inch		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
77,134 - Brake Pad Thickness RR	11 Inch		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
77,135 - Brake Rotor LF	38 Inch		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
77,136 - Brake Rotor RF	38 Inch		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
77,137 - Brake Rotor LR	40 Inch		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
77,138 - Brake Rotor RR	40 Inch		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
77,140 - FRA Check Brake Hoses	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
77,150 - Check King Pins	-	na	RGASPARD	Nov 1, 2018 11:46:31 PM	No	
77,160 - FRA Check for Loose or Noisy Wheel Bearings	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
80,000 - SECTION 8 PMI Report Completion	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
80,810 - Completion of PMI Report	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
90,000 - SECTION 9 Completion of PMI	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
90,910 - Vehicle Returned to predetermined location	Done		RGASPARD	Nov 1, 2018 11:46:31 PM	No	
Activity Sub Total						
				Activity 10 Sub Total		
				Parts:	0.00	
				Labor:	0.00	
				Labor Hours:	1.53	
				Sublet Parts:	0.00	
				Sublet Labor:	0.00	
				Activity Sub Total	0.00	



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 51797823
Invoice No. 55345 - 51797823

Client Department:

Department: 55345M

Work Order Description

PM A

Requested By: RGASPARD

Created By: RGASPARD

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 134,285 - DH

Activity Header

Activity: 20 999 TOTAL VEHICLE

Activity Note: PM A

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: A PM Level A

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
01-Nov-18	B329(F)	GOING OUT OF SERVICE SEE BALDWIN B329 IN THE FLEET ORG. FILTER, OIL, SPIN-ON	1	1.96	1.96

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
01-Nov-18	Gaspard,Ronald	1.05	0	0

Activity Sublet

No Data Available

Activity Checklist


Check List						
20 Desc: PM A						
Task: PM A SERVICE Performed by: RGASPARD Performed on: 01-NOV-18						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
100,000 - "A" PMI SERVICING ITEMS	Done		RGASPARD	Nov 1, 2018 11:47:34 PM	No	
101,000 - FRA Change Oil Filters	Yes		RGASPARD	Nov 1, 2018 11:47:34 PM	No	
102,000 - FRA Drain Engine Oil	Yes		RGASPARD	Nov 1, 2018 11:47:34 PM	No	
103,000 - FRA Check Transmission Fluid	Done		RGASPARD	Nov 1, 2018 11:47:34 PM	No	
104,000 - Lubricate Chassis	-	na	RGASPARD	Nov 1, 2018 11:47:34 PM	No	
105,000 - Replace or Clean A/C Filters	Done		RGASPARD	Nov 1, 2018 11:47:34 PM	No	
107,000 - FRA Change Primary Fuel Filter	No	na	RGASPARD	Nov 1, 2018 11:47:34 PM	No	
108,000 - Lube all pivoting Mechanisms	Done		RGASPARD	Nov 1, 2018 11:47:34 PM	No	

Activity Sub Total

	Activity 20 Sub Total	
	Parts:	1.96
	Labor:	0.00
	Labor Hours:	1.05
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	1.96



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 51797823
Invoice No. 55345 - 51797823

Client Department:

Department: 55345M

Work Order Description

PM A

Requested By: RGASPARD

Created By: RGASPARD

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 134,285 - DH

Activity Header

Activity: 30 999 TOTAL VEHICLE

Activity Note: PRAMETER

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
01-Nov-18	Gaspard, Ronald	0.2833333	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List						
30 Desc: PRAMETER						
Task: PRA and Meter Readings Performed by: RGASPARD Performed on: 01-NOV-18						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		RGASPARD	Nov 1, 2018 11:48:32 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		RGASPARD	Nov 1, 2018 11:48:32 PM	No	
3 - Are you wearing the appropriate PPE?	Done		RGASPARD	Nov 1, 2018 11:48:32 PM	No	
4 - Have you performed the proper LOTO?	Done		RGASPARD	Nov 1, 2018 11:48:32 PM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		RGASPARD	Nov 1, 2018 11:48:32 PM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		RGASPARD	Nov 1, 2018 11:48:32 PM	No	
20 - Miles			RGASPARD	Nov 1, 2018 11:48:32 PM	No	
30 - Kilometers			RGASPARD	Nov 1, 2018 11:48:32 PM	No	
40 - Hours			RGASPARD	Nov 1, 2018 11:48:32 PM	No	

Activity Sub Total

Activity 30 Sub Total

	Parts:	0.00
	Labor:	0.00
	Labor Hours:	0.28
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	0.00
Work Order Footer		
	Work Order 51797823 Total	
	Parts:	1.96
	Labor:	0.00
	Labor Hours:	2.87
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	1.96



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 4



Work Order No. 51848099
Invoice No. 55345 - 51848099

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FD4E4FS7EDB17176
Brakes & Tires			Ford E450 Champion Challenger
Requested By:	TDELVA	Status:	40 - Closed (40)
Created By:	TDELVA	Priority:	-
Assigned To:		Driver:	
Class:	-	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	132,725 - DH

Chronology

Reported	Oct 25, 2018 4:24:19 PM	Oct 25, 2018 4:24:19 PM
Started	Oct 25, 2018 12:00:00 AM	
Completed	Oct 25, 2018 4:39:00 PM	Oct 25, 2018 4:39:00 PM
Down Time		

Work Order Notes

Line 10 Replaced front and a rear Brakes
Replaced front and Rear Tires

Activity Header

Activity: 10 999/999/999 TOTAL VEHICLE
Activity Note: PERSONAL RISK ASSESMENT
Reason for Repair: 05 Inspection, Routine
Work Accomplished: 06 Inspect
Part Failure: 00 No Failure
Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
25-Oct-18	Delva, Terry	0.5833333	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: PERSONAL RISK ASSESMENT
Task: PRA and Meter Readings Performed by: TDELVA Performed on: 25-OCT-18

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		TDELVA	Oct 25, 2018 4:36:55 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		TDELVA	Oct 25, 2018 4:36:55 PM	No	
3 - Are you wearing the appropriate PPE?	Done		TDELVA	Oct 25, 2018 4:36:55 PM	No	
4 - Have you performed the proper LOTO?	Done		TDELVA	Oct 25, 2018 4:36:55 PM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		TDELVA	Oct 25, 2018 4:36:55 PM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		TDELVA	Oct 25, 2018 4:36:55 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
20 - Miles			TDELVA	Oct 25, 2018 4:36:55 PM	No	
30 - Kilometers			TDELVA	Oct 25, 2018 4:36:55 PM	No	
40 - Hours			TDELVA	Oct 25, 2018 4:36:55 PM	No	

Activity Sub Total

Activity 10 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	0.58
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 4



Work Order No. 51848099
Invoice No. 55345 - 51848099

Client Department:
Department: 55345M
Work Order Description
Brakes & Tires
Requested By: TDELVA
Created By: TDELVA
Assigned To:
Class: -
Arrangement: Unassigned
Potential Warranty: No
Equipment No.: 4514-P
VIN: 1FDFE4FS7EDB17176
Ford E450 Champion Challenger
Status: 40 - Closed (40)
Priority: -
Driver:
Phone:
ETA:
Meter: 132,725 - DH

Activity Header					
Activity:20 013/000/000 BRAKES					
Activity Note: Front Brakes					
Reason for Repair:		39 Natural Causes			
Work Accomplished:		03 Replace New			
Part Failure:		44 Worn			
Activity Comments:					
Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
25-Oct-18	8C2Z-2V001-D	PADS, BRAKE, DISC, FRONT	1	48.87	48.87
Activity Labor					
Booked Date	Technician	Hours	Shop Rate	Extended	
25-Oct-18	Delva,Terry	1.05	0	0	
Activity Sublet					
No Data Available					
Activity Checklist					
No Data Available					
No Data Available					
Activity Sub Total					
			Activity 20 Sub Total		
			Parts: 48.87		
			Labor: 0.00		
			Labor Hours: 1.05		
			Sublet Parts: 0.00		
			Sublet Labor: 0.00		
			Activity Sub Total 48.87		



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 4



Work Order No. 51848099
Invoice No. 55345 - 51848099

Client Department:
Department: 55345M
Work Order Description
Brakes & Tires
Requested By: TDELVA
Created By: TDELVA
Assigned To:
Class: -
Arrangement: Unassigned
Potential Warranty: No
Equipment No.: 4514-P
VIN: 1FDFE4FS7EDB17176
Ford E450 Champion Challenger
Status: 40 - Closed (40)
Priority: -
Driver:
Phone:
ETA:
Meter: 132,725 - DH

Activity Header					
Activity: 30 018/000/000 WHEELS, RIMS, HUBS AND BEARINGS					
Activity Note: Front & Rear Tires					
Reason for Repair: 08 Preventive Maintenance					
Work Accomplished: 03 Replace New					
Part Failure: 99 Replaced Before Failure					
Activity Comments:					
Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
25-Oct-18	189752	TIRE, LT225/75R16, TLBLPS115RE, TRANSFORCE HT 10PLY 1622575E, NEW	6	103.44	620.64
Activity Labor					
Booked Date	Technician	Hours	Shop Rate	Extended	
25-Oct-18	Delva, Terry	1.2833333	0	0	
Activity Sublet					
No Data Available					
Activity Checklist					
No Data Available					
No Data Available					
Activity Sub Total					
			Activity 30 Sub Total		
			Parts:	620.64	
			Labor:	0.00	
			Labor Hours:	1.28	
			Sublet Parts:	0.00	
			Sublet Labor:	0.00	
			Activity Sub Total	620.64	



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 4 of 4



Work Order No. 51848099
Invoice No. 55345 - 51848099

Client Department:
Department: 55345M
Work Order Description
Brakes & Tires
Requested By: TDELVA
Created By: TDELVA
Assigned To:
Class: -
Arrangement: Unassigned
Potential Warranty: No
Equipment No.: 4514-P
VIN: 1FDFE4FS7EDB17176
Ford E450 Champion Challenger
Status: 40 - Closed (40)
Priority: -
Driver:
Phone:
ETA:
Meter: 132,725 - DH

Activity Header
Activity:40 013/000/000 BRAKES
Activity Note: Rear Brakes
Reason for Repair: 39 Natural Causes
Work Accomplished: 03 Replace New
Part Failure: 44 Worn
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
25-Oct-18	8C2Z-2V200-C	PADS, BRAKE, DISC, REAR	1	48.53	48.53

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
25-Oct-18	Delva, Terry	1.6833333	0	0

Activity Sublet
No Data Available


Activity Checklist
No Data Available
No Data Available

Activity Sub Total	
Activity 40 Sub Total	
Parts:	48.53
Labor:	0.00
Labor Hours:	1.68
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	48.53

Work Order Footer	
Work Order 51848099 Total	
Parts:	718.04
Labor:	0.00
Labor Hours:	4.60
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	718.04



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 51840603
Invoice No. 55345 - 51840603

Client Department:

Department: 55345M

Work Order Description

Transmission Code PO713

Requested By: DARTHURS

Created By: DARTHURS

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 132,566 - DH

Chronology

Reported	Oct 23, 2018 10:21:31 PM	Oct 23, 2018 10:21:31 PM
Started	Oct 23, 2018 12:00:00 AM	
Completed	Oct 23, 2018 11:35:00 PM	Oct 23, 2018 11:35:00 PM
Down Time		

Work Order Notes

Line 10 To file warranty be sure to do the following:

- 1) Enter a COMPLAINT statement for each activity.
- 2) Enter CAUSE statement in the Notes field of each activity.
- 3) Enter CORRECTION statement in the Comment section of each activity.

Complaint: Check Engine light on. Transmissions code PO713

Cause: Transmission temperature sensor Wire harness bad.

Correction: Remove & Replace temperature harness & temperature sensor. Replace transmission Oil Pan.

Parts# 4C3Z-7G276-AA Qty (1)

Parts# BC3Z-7H141-A Qty (1)

Parts# BC3Z-7C155-A Qty (1)

Parts# BC3Z-7A194-B Qty (1)

Activity Header

Activity: 5 999 TOTAL VEHICLE

Activity Note: Personal Risk Assessment

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
23-Oct-18	Arthurs, Durvin	0.0833333	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List																				
5 Desc: Personal Risk Assessment																				
Task: PRA and Meter Readings Performed by: DARTHURS Performed on: 23-OCT-18																				
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO														
1 - Are you properly trained to perform the task?	Done		DARTHURS	Oct 23, 2018 11:33:19 PM	No															
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		DARTHURS	Oct 23, 2018 11:33:19 PM	No															
3 - Are you wearing the appropriate PPE?	Done		DARTHURS	Oct 23, 2018 11:33:19 PM	No															
4 - Have you performed the proper LOTO?	Done		DARTHURS	Oct 23, 2018 11:33:19 PM	No															
5 - Are you aware of the potential risks of performing this repair?	Done		DARTHURS	Oct 23, 2018 11:33:19 PM	No															
10 - Have you successfully completed the Personal Risk Assessment?	Done		DARTHURS	Oct 23, 2018 11:33:19 PM	No															
20 - Miles			DARTHURS	Oct 23, 2018 11:33:19 PM	No															
30 - Kilometers			DARTHURS	Oct 23, 2018 11:33:19 PM	No															
40 - Hours			DARTHURS	Oct 23, 2018 11:33:19 PM	No															
Activity Sub Total																				
			<table border="1"> <thead> <tr> <th colspan="2">Activity 5 Sub Total</th> </tr> </thead> <tbody> <tr> <td>Parts:</td> <td>0.00</td> </tr> <tr> <td>Labor:</td> <td>0.00</td> </tr> <tr> <td>Labor Hours:</td> <td>0.08</td> </tr> <tr> <td>Sublet Parts:</td> <td>0.00</td> </tr> <tr> <td>Sublet Labor:</td> <td>0.00</td> </tr> <tr> <td>Activity Sub Total</td> <td>0.00</td> </tr> </tbody> </table>				Activity 5 Sub Total		Parts:	0.00	Labor:	0.00	Labor Hours:	0.08	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	0.00
Activity 5 Sub Total																				
Parts:	0.00																			
Labor:	0.00																			
Labor Hours:	0.08																			
Sublet Parts:	0.00																			
Sublet Labor:	0.00																			
Activity Sub Total	0.00																			



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 51840603
Invoice No. 55345 - 51840603

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Transmission Code PO713		Ford E450 Champion Challenger	
Requested By:	DARTHURS	Status:	40 - Closed (40)
Created By:	DARTHURS	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	132,566 - DH

Activity Header
Activity: 15 027/000/000 TRANSMISSION, MAIN, AUTOMATIC
Activity Note:
Reason for Repair: 08 Preventive Maintenance
Work Accomplished:
Part Failure:
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
23-Oct-18	BC3Z-7H141-A	SENSOR, TEMPERATURE, TRANSMISSION	1	9.99	9.99
23-Oct-18	4C3Z-7G276-AA	HARNESS, SOLENOID, INTERNAL, TRANSMISSION, 5R110W	1	109.68	109.68
23-Oct-18	8C3Z-7A194-B	PAN, OIL, TRANSMISSION	1	56.44	56.44
23-Oct-18	8C3Z-7C155-A	GASKET, BODY, VALVE, TRANSMISSION, 5R110	1	10.14	10.14
23-Oct-18	4C3Z-7G276-AA	HARNESS, SOLENOID, INTERNAL, TRANSMISSION, 5R110W	-1	109.68	-109.68
26-Oct-18	20021	FILTER, TRANSMISSION 20021	1	17.27	17.27

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
23-Oct-18	Arthurs,Durvin	1.5	0	0

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available

Activity Sub Total		Activity 15 Sub Total	
Parts:			203.52
Labor:			0.00
Labor Hours:			1.50
Sublet Parts:			0.00
Sublet Labor:			0.00
Activity Sub Total			203.52

Work Order Footer		Work Order 51840603 Total	
Parts:			203.52
Labor:			0.00
Labor Hours:			1.58
Sublet Parts:			0.00
Sublet Labor:			0.00
Activity Sub Total			203.52



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 51722137
Invoice No. 55345 - 51722137

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
PM A		Ford E450 Champion Challenger	
Requested By:	RGASPARD	Status:	40 - Closed (40)
Created By:	RGASPARD	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	130,030 - DH

Chronology		
Reported	Oct 9, 2018 12:49:18 PM	Oct 9, 2018 12:49:18 PM
Started	Oct 9, 2018 12:00:00 AM	
Completed	Oct 9, 2018 11:55:00 PM	Oct 9, 2018 11:55:00 PM
Down Time		

Work Order Notes

Line 10 COMPLAINT:pmA

CAUSE:Service

CORRECTION:Perform pmA Service
Oil filter B329 Qty1
Engine oil 5w20 qty 7 Qts

Activity Header						
Activity: 10 999 TOTAL VEHICLE						
Activity Note: Light Medium Duty PMI						
Reason for Repair: 08 Preventive Maintenance						
Work Accomplished: A PM Level A						
Part Failure:						
Activity Comments:						
Activity Parts						
No Data Available						
Activity Labor						
Booked Date	Technician	Hours	Shop Rate	Extended		
09-Oct-18	Gaspard,Ronald	1.5666666	0	0		
Activity Sublet						
No Data Available						
Activity Checklist						
Check List						
10 Desc: Light Medium Duty PMI						
Task: First Transit Light-Medium Duty PMI Performed by: RGASPARD Performed on: 09-OCT-18						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,000 - SECTION 1 Preparation and Drive On (In Lot) Inspection	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
10,100 - Safety Inspection	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
10,110 - FRA Check Drivers Pre-trip or DVIR/EVIR & Authorization Forms	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
10,120 - FRA Check All Warning Lights and Alarms	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,130 - FRA Check Automatic Transmission Neutral Start Operation	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
10,140 - Check Service Brakes	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
10,150 - FRA Start Engine and Listen for Any Unusual Noises	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
10,160 - FRA Check Instruments and Horns	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
10,170 - Check Fast Idle	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
10,180 - Check Starter Protection Circuit	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
10,190 - Check Reverse Warning System	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
11,100 - Check Parking Brake	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
11,110 - Check HVAC Switches and Other Controls	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
11,120 - FRA Inspect Windshields, Mirror and Sun Visor Condition	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
11,130 - FRA Check Wiper and Washer Operation	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
11,140 - Road Test: Check for Proper Operation	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
11,150 - Perform Brake Test	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
11,152 - Decelerometer Results Test 1	FEET	NA	RGASPARD	Oct 9, 2018 10:43:47 PM	No	
11,154 - Decelerometer Results Test 2	FEET	NA	RGASPARD	Oct 9, 2018 10:43:47 PM	No	
11,156 - Decelerometer Results Test 3	FEET	NA	RGASPARD	Oct 9, 2018 10:43:47 PM	No	
11,161 - FRA Check/Record Oil Pressure / @1500 rpm	Pounds per Square Inch	NA	RGASPARD	Oct 9, 2018 10:43:47 PM	No	
11,162 - FRA Check/Record Water Temperature	Degree Fahrenheit	NA	RGASPARD	Oct 9, 2018 10:43:47 PM	No	
11,170 - FRA Check Door Operation	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
11,180 - FRA Check Operation of All Other Accessories	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
20,000 - SECTION 2 Interior Circle Inspection	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
20,210 - Check Condition of Operator's Area	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
20,220 - Check Accelerator and Brake Pedals	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
20,230 - FRA Check Wiring Under Dash	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
20,240 - FRA Check Interior Lights	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
20,250 - FRA Check Interior Electrical Panels	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
20,260 - Check Stop Request System	-	NA	RGASPARD	Oct 9, 2018 10:43:47 PM	No	
20,270 - Check Fare Box Mounting (If Applicable)	-	NA	RGASPARD	Oct 9, 2018 10:43:47 PM	No	
20,280 - Check Seats, Seat Belts, Hand Rails and Floor Covering	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
20,290 - Check for Physical Damage, Water Leaks, and Graffiti	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
22,100 - Check Emergency Windows and Glass Condition	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
22,110 - Check Emergency Hatches	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
22,120 - Check All Safety Equipment	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
30,000 - SECTION 3 Exterior Circle Inspection	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
30,310 - Check Passenger Doors	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
30,320 - Inspect Step-well and Hand Rails	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
30,330 - Check Wheelchair Lift Operation	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
30,340 - FRA Check Destination Sign and Run Box	-	NA	RGASPARD	Oct 9, 2018 10:43:47 PM	No	
30,350 - FRA Inspect Mirror and Mountings	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
30,360 - Check for Physical Damage and Decals	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
30,370 - Check Wiper Blade and Arm Condition	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
30,380 - Check Exterior Compartment Doors	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
30,390 - FRA Check Fuel Tank Cap	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
33,100 - Check Lights and Reflectors	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
33,110 - Check License Plate, Permits and State Inspection Decals	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
40,000 - SECTION 4 Engine Compartment Inspection	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
40,410 - FRA Check Engine Compartment/Condition for Fire Risk	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
40,420 - Check Hood	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
40,430 - Check Fan, Shroud and Radiator	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
40,440 - Test Coolant System Using Test Strips and Record Results	-	NA	RGASPARD	Oct 9, 2018 10:43:47 PM	No	
40,441 - Inhibitor Test Pass or Fail (Indicate with a Yes or No)	No	NA	RGASPARD	Oct 9, 2018 10:43:47 PM	No	
40,442 - Freeze Point	Degree Fahrenheit	NA	RGASPARD	Oct 9, 2018 10:43:47 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
40,450 - FRA Check Coolant Recovery System Condition & for Leaks	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
40,460 - Record Antifreeze Protection Level Using Refractometer	-	NA	RGASPARD	Oct 9, 2018 10:43:47 PM	No	
40,461 - Refractometer Reading	Degree Fahrenheit	NA	RGASPARD	Oct 9, 2018 10:43:47 PM	No	
40,470 - Pressure Test Cooling System and Check for Leaks	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
40,480 - FRA Check Coolant Hose Condition	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
40,490 - FRA Check Alternator Mount and Condition	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
44,100 - FRA Check Fuel Control and Transmission Connections	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
44,110 - FRA Check Master Cylinder Fluid Level	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
44,120 - FRA Check All Belts for Condition, Alignment and Tension	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
44,130 - FRA Check Exhaust System	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
44,140 - FRA Check Intake System	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
44,150 - FRA Inspect Turbocharger	-	NA	RGASPARD	Oct 9, 2018 10:43:47 PM	No	
44,160 - FRA Inspect Power Steering and Hydraulic Fluid	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
44,170 - FRA Check All Engine or Belt Driven Components	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
44,180 - FRA Check for Leaks	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
44,190 - FRA Perform Battery Inspection	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
44,200 - FRA Check Battery Box Corrosion, Cables and Hold-Downs	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
50,000 - SECTION 5 Steering System Inspection	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
50,510 - Check Entire Steering System	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
60,000 - SECTION 6 Tires and Wheel Inspection	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
60,610 - FRA Check and Record Air Pressure	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
60,611 - Air Pressure RF	70 Pounds per Square Inch		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
60,612 - Air Pressure LF	70 Pounds per Square Inch		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
60,613 - Air Pressure RRO	65 Pounds per Square Inch		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
60,614 - Air Pressure RRI	65 Pounds per Square Inch		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
60,615 - Air Pressure LRI	65 Pounds per Square Inch		RGASPARD	Oct 9, 2018 10:43:47 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
60,616 - Air Pressure LRO	65 Pounds per Square Inch		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
60,620 - Check Valve Stems and Caps	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
60,630 - Check and Record Tread Depth	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
60,631 - Tread Depth RF	6 32nds of an inch		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
60,632 - Tread Depth LF	7 32nds of an inch		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
60,633 - Tread Depth RRO	4 32nds of an inch		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
60,634 - Tread Depth RRI	4 32nds of an inch		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
60,635 - Tread Depth LRI	5 32nds of an inch		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
60,636 - Tread Depth LRO	5 32nds of an inch		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
60,640 - Check for Mismatched Tread or Casing Design	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
60,650 - Check Sidewall Wear	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
60,660 - Inspect for Cuts and Tears	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
60,670 - Check Dual Mating With Square	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
60,680 - Check Wheels for Cracks and Loose Lugs	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
60,690 - Check Tires for Irregular or Alignment Wear	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
66,100 - FRA Check Outer Hubs for Leaks	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
70,000 - SECTION 7 Under Vehicle Inspection	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
70,710 - Check Vibration Damper	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
70,720 - Check Engine and Transmission Mounts	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
70,730 - FRA Check Starter	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
70,740 - FRA Check Bottom of Engine for Fluid Leaks	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
70,750 - FRA Check Transmission for Leaks	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
70,760 - FRA Check Differential Breather and Fluid	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
70,770 - FRA Check Exhaust System	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
70,780 - Check Driveline, U-joint and Slip Yokes	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
70,790 - Check All Body Mounts and Chassis Frame	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
77,100 - FRA Check Security, Integrity and Length of Ground Straps	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
77,110 - FRA Check Fuel Tank	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
77,120 - Check Suspension Components	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
77,130 - FRA Check Brake Pad Thickness and Rotor for Wear	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
77,131 - Brake Pad Thickness LF	6 Inch		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
77,132 - Brake Pad Thickness RF	6 Inch		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
77,133 - Brake Pad Thickness LR	8 Inch		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
77,134 - Brake Pad Thickness RR	8 Inch		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
77,135 - Brake Rotor LF	38 Inch		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
77,136 - Brake Rotor RF	38 Inch		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
77,137 - Brake Rotor LR	40 Inch		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
77,138 - Brake Rotor RR	40 Inch		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
77,140 - FRA Check Brake Hoses	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
77,150 - Check King Pins	-	NA	RGASPARD	Oct 9, 2018 10:43:47 PM	No	
77,160 - FRA Check for Loose or Noisy Wheel Bearings	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
80,000 - SECTION 8 PMI Report Completion	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
80,810 - Completion of PMI Report	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
90,000 - SECTION 9 Completion of PMI	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	
90,910 - Vehicle Returned to predetermined location	Done		RGASPARD	Oct 9, 2018 10:43:47 PM	No	

Activity Sub Total

Activity 10 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	1.57
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 51722137
Invoice No. 55345 - 51722137

Client Department:

Department: 55345M

Work Order Description

PM A

Requested By: RGASPARD

Created By: RGASPARD

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 130,030 - DH

Activity Header

Activity: 20 999 TOTAL VEHICLE

Activity Note: PM A

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: A PM Level A

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
09-Oct-18	B329(F)	GOING OUT OF SERVICE SEE BALDWIN B329 IN THE FLEET ORG. FILTER, OIL, SPIN-ON	1	1.96	1.96

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
09-Oct-18	Gaspard,Ronald	1.05	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List						
20 Desc: PM A						
Task: PM A SERVICE Performed by: RGASPARD Performed on: 09-OCT-18						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
100,000 - "A" PMI SERVICING ITEMS	Done		RGASPARD	Oct 9, 2018 10:44:27 PM	No	
101,000 - FRA Change Oil Filters	Yes		RGASPARD	Oct 9, 2018 10:44:27 PM	No	
102,000 - FRA Drain Engine Oil	Yes		RGASPARD	Oct 9, 2018 10:44:27 PM	No	
103,000 - FRA Check Transmission Fluid	Done		RGASPARD	Oct 9, 2018 10:44:27 PM	No	
104,000 - Lubricate Chassis	-	NA	RGASPARD	Oct 9, 2018 10:44:27 PM	No	
105,000 - Replace or Clean A/C Filters	Done		RGASPARD	Oct 9, 2018 10:44:27 PM	No	
107,000 - FRA Change Primary Fuel Filter	No	NA	RGASPARD	Oct 9, 2018 10:44:27 PM	No	
108,000 - Lube all pivoting Mechanisms	Done		RGASPARD	Oct 9, 2018 10:44:27 PM	No	

Activity Sub Total

	Activity 20 Sub Total	
	Parts:	1.96
	Labor:	0.00
	Labor Hours:	1.05
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	1.96



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 51722137
Invoice No. 55345 - 51722137

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
PM A		Ford E450 Champion Challenger	
Requested By:	RGASPARD	Status:	40 - Closed (40)
Created By:	RGASPARD	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	130,030 - DH

Activity Header
Activity:30 999 TOTAL VEHICLE
Activity Note: PRAMETER
Reason for Repair: 05 Inspection, Routine
Work Accomplished: 06 Inspect
Part Failure:
Activity Comments:

Activity Parts
No Data Available

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
09-Oct-18	Gaspard,Ronald	0.3	0	0

Activity Sublet
No Data Available


Check List						
30 Desc: PRAMETER Task: PRA and Meter Readings Performed by: RGASPARD Performed on: 09-OCT-18						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
1 - Are you properly trained to perform the task?	Done		RGASPARD	Oct 9, 2018 10:44:58 PM	No	
2 - If task requires lifting, are lifts secured, are jack stands used correctly?	Done		RGASPARD	Oct 9, 2018 10:44:58 PM	No	
3 - Are you wearing the appropriate PPE?	Done		RGASPARD	Oct 9, 2018 10:44:58 PM	No	
4 - Have you performed the proper LOTO?	Done		RGASPARD	Oct 9, 2018 10:44:58 PM	No	
5 - Are you aware of the potential risks of performing this repair?	Done		RGASPARD	Oct 9, 2018 10:44:58 PM	No	
10 - Have you successfully completed the Personal Risk Assessment?	Done		RGASPARD	Oct 9, 2018 10:44:58 PM	No	
20 - Miles			RGASPARD	Oct 9, 2018 10:44:58 PM	No	
30 - Kilometers			RGASPARD	Oct 9, 2018 10:44:58 PM	No	
40 - Hours			RGASPARD	Oct 9, 2018 10:44:58 PM	No	

Activity Sub Total	Activity 30 Sub Total
---------------------------	------------------------------

	Parts:	0.00
	Labor:	0.00
	Labor Hours:	0.30
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	0.00
Work Order Footer		
	Work Order 51722137 Total	
	Parts:	1.96
	Labor:	0.00
	Labor Hours:	2.92
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	1.96



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 51760148
Invoice No. 55345 - 51760148

Client Department:

Department: 55345M

Work Order Description

Left side rear bumper loose

Requested By: RAURODRIGUEZ

Created By: RAURODRIGUEZ

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 128,144 - DH

Chronology

Reported	Sep 27, 2018 11:40:23 AM	Sep 27, 2018 11:40:23 AM
Started	Sep 27, 2018 12:00:00 AM	
Completed	Sep 27, 2018 12:28:00 PM	Sep 27, 2018 12:28:00 PM
Down Time		

Work Order Notes

Line 10 To file warranty be sure to do the following:

- 1) Enter a COMPLAINT statement for each activity.
- 2) Enter CAUSE statement in the Notes field of each activity.
- 3) Enter CORRECTION statement in the Comment section of each activity.

Complaint: Left side rear bumper loose

Cause: left side of bumper is hanging from the aluminum. Vehicle involved in an accident.

Correction:

Reattached left side of black bumper back on To aluminum.

No parts used.

Activity Header

Activity: 5 999 TOTAL VEHICLE

Activity Note: Personal Risk Assessment

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: Personal Risk Assessment

Task: PRA and Meter Readings Performed by: RAURODRIGUEZ Performed on: 27-SEP-18

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		RAURODRIGUEZ	Sep 27, 2018 12:26:20 PM	No	
20 - Miles			RAURODRIGUEZ	Sep 27, 2018 12:26:20 PM	No	
30 - Kilometers			RAURODRIGUEZ	Sep 27, 2018 12:26:20 PM	No	
40 - Hours			RAURODRIGUEZ	Sep 27, 2018 12:26:20 PM	No	

Activity Sub Total

Activity 5 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 51760148
Invoice No. 55345 - 51760148

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Left side rear bumper loose		Ford E450 Champion Challenger	
Requested By:	RAURODRIGUEZ	Status:	40 - Closed (40)
Created By:	RAURODRIGUEZ	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	128,144 - DH

Activity Header
Activity: 15 999 TOTAL VEHICLE
Activity Note: Left side rear bumper loose
Reason for Repair: 41 Abuse of Equipment - 56210
Work Accomplished:
Part Failure:
Activity Comments:

Activity Parts
No Data Available

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
27-Sep-18	Rodriguez,Raul	1.0833333	0	0

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available

Activity Sub Total															
<table><tr><th colspan="2">Activity 15 Sub Total</th></tr><tr><td>Parts:</td><td>0.00</td></tr><tr><td>Labor:</td><td>0.00</td></tr><tr><td>Labor Hours:</td><td>1.08</td></tr><tr><td>Sublet Parts:</td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td>0.00</td></tr></table>	Activity 15 Sub Total		Parts:	0.00	Labor:	0.00	Labor Hours:	1.08	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	0.00	
Activity 15 Sub Total															
Parts:	0.00														
Labor:	0.00														
Labor Hours:	1.08														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	0.00														

Work Order Footer															
<table><tr><th colspan="2">Work Order 51760148 Total</th></tr><tr><td>Parts:</td><td>0.00</td></tr><tr><td>Labor:</td><td>0.00</td></tr><tr><td>Labor Hours:</td><td>1.08</td></tr><tr><td>Sublet Parts:</td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td>0.00</td></tr></table>	Work Order 51760148 Total		Parts:	0.00	Labor:	0.00	Labor Hours:	1.08	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	0.00	
Work Order 51760148 Total															
Parts:	0.00														
Labor:	0.00														
Labor Hours:	1.08														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	0.00														



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 51740001
Invoice No. 55345 - 51740001

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Replaced tag light assembly		Ford E450 Champion Challenger	
Requested By:	VAMRITTEEMAL	Status:	40 - Closed (40)
Created By:	VAMRITTEEMAL	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	126,900 - DH

Chronology		
Reported	Sep 20, 2018 10:43:09 PM	Sep 20, 2018 10:43:09 PM
Started	Sep 20, 2018 12:00:00 AM	
Completed	Sep 20, 2018 11:04:00 PM	Sep 20, 2018 11:04:00 PM
Down Time		

Work Order Notes

Line 10 To file warranty be sure to do the following:
1) Enter a COMPLAINT statement for each activity.
2) Enter CAUSE statement in the Notes field of each activity.
3) Enter CORRECTION statement in the Comment section of each activity.

Complaint: tag light out

Cause: bad bulbs

Correction: Replaced tag light assembly
Warranty

Activity Header				
Activity: 5 999 TOTAL VEHICLE				
Activity Note: Personal Risk Assessment				
Reason for Repair:		05 Inspection, Routine		
Work Accomplished:		06 Inspect		
Part Failure:				
Activity Comments:				
Activity Parts				
No Data Available				
Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
20-Sep-18	AMRIT TEEMAL,VISHNU	0.5	0	0
Activity Sublet				
No Data Available				
Activity Checklist				
Check List				
5 Desc: Personal Risk Assessment				
Task: PRA and Meter Readings Performed by: VAMRITTEEMAL Performed on: 20-SEP-18				

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		VAMRITTEEMAL	Sep 20, 2018 11:00:10 PM	No	
20 - Miles			VAMRITTEEMAL	Sep 20, 2018 11:00:10 PM	No	
30 - Kilometers			VAMRITTEEMAL	Sep 20, 2018 11:00:10 PM	No	
40 - Hours			VAMRITTEEMAL	Sep 20, 2018 11:00:10 PM	No	

Activity Sub Total

Activity 5 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	0.50
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 51740001
Invoice No. 55345 - 51740001

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FD4E4FS7EDB17176
Replaced tag light assembly		Ford E450 Champion Challenger	
Requested By:	VAMRITTEEMAL	Status:	40 - Closed (40)
Created By:	VAMRITTEEMAL	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	126,900 - DH

Activity Header				
Activity:15 034 LIGHTING SYSTEM				
Activity Note: Need tag light assembly				
Reason for Repair: 05 Inspection, Routine				
Work Accomplished:				
Part Failure:				
Activity Comments:				
Activity Parts				
No Data Available				
Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
20-Sep-18	AMRIT TEEMAL,VISHNU	0.1666666	0	0
Activity Sublet				
No Data Available				
Activity Checklist				
No Data Available				
No Data Available				
Activity Sub Total				
			Activity 15 Sub Total	
			Parts:	0.00
			Labor:	0.00
			Labor Hours:	0.17
			Sublet Parts:	0.00
			Sublet Labor:	0.00
			Activity Sub Total	0.00
Work Order Footer				
			Work Order 51740001 Total	
			Parts:	0.00
			Labor:	0.00
			Labor Hours:	0.67
			Sublet Parts:	0.00
			Sublet Labor:	0.00
			Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 51634337
Invoice No. 55345 - 51634337

Client Department:

Department: 55345M

Work Order Description

PM C

Requested By: AOWENS

Created By: AOWENS

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 125,751 - DH

Chronology

Reported	Sep 14, 2018 12:01:30 PM	Sep 14, 2018 12:01:30 PM
Started	Sep 14, 2018 12:00:00 AM	
Completed	Sep 15, 2018 12:00:00 AM	Sep 15, 2018 12:00:00 AM
Down Time		

Work Order Notes

Line 10 PMC
Service
Perform PMC Service
Oil filter B329 Qty1
Engine oil 5w20 qty 7 Qts
Gear Oil 80w 90 qty 5 Qts
Rotate tires and washed rims
Torque 140 lbs second torque 140 lbs

Activity Header

Activity: 10 999 TOTAL VEHICLE

Activity Note: Light Medium Duty PMI

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
14-Sep-18	Gaspard, Ronald	2.0666666	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: Light Medium Duty PMI

Task: First Transit Light-Medium Duty PMI Performed by: RGASPARD Performed on: 14-SEP-18

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,000 - SECTION 1 Preparation and Drive On (In Lot) Inspection	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
10,100 - Safety Inspection	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
10,110 - FRA Check Drivers Pre-trip or DVIR/EVIR & Authorization Forms	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
10,120 - FRA Check All Warning Lights and	Done		RGASPARD	Sep 14, 2018	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
Alarms				11:22:36 PM		
10,130 - FRA Check Automatic Transmission Neutral Start Operation	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
10,140 - Check Service Brakes	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
10,150 - FRA Start Engine and Listen for Any Unusual Noises	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
10,160 - FRA Check Instruments and Horns	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
10,170 - Check Fast Idle	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
10,180 - Check Starter Protection Circuit	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
10,190 - Check Reverse Warning System	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
11,100 - Check Parking Brake	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
11,110 - Check HVAC Switches and Other Controls	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
11,120 - FRA Inspect Windshields, Mirror and Sun Visor Condition	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
11,130 - FRA Check Wiper and Washer Operation	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
11,140 - Road Test: Check for Proper Operation	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
11,150 - Perform Brake Test	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
11,152 - Decelerometer Results Test 1	FEET	NA	RGASPARD	Sep 14, 2018 11:22:36 PM	No	
11,154 - Decelerometer Results Test 2	FEET	NA	RGASPARD	Sep 14, 2018 11:22:36 PM	No	
11,156 - Decelerometer Results Test 3	FEET	NA	RGASPARD	Sep 14, 2018 11:22:36 PM	No	
11,161 - FRA Check/Record Oil Pressure / @1500 rpm	Pounds per Square Inch	NA	RGASPARD	Sep 14, 2018 11:22:36 PM	No	
11,162 - FRA Check/Record Water Temperature	Degree Fahrenheit	NA	RGASPARD	Sep 14, 2018 11:22:36 PM	No	
11,170 - FRA Check Door Operation	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
11,180 - FRA Check Operation of All Other Accessories	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
20,000 - SECTION 2 Interior Circle Inspection	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
20,210 - Check Condition of Operator's Area	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
20,220 - Check Accelerator and Brake Pedals	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
20,230 - FRA Check Wiring Under Dash	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
20,240 - FRA Check Interior Lights	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
20,250 - FRA Check Interior Electrical Panels	Done		RGASPARD	Sep 14, 2018	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
				11:22:36 PM		
20,260 - Check Stop Request System	-	NA	RGASPARD	Sep 14, 2018 11:22:36 PM	No	
20,270 - Check Fare Box Mounting (If Applicable)	-	NA	RGASPARD	Sep 14, 2018 11:22:36 PM	No	
20,280 - Check Seats, Seat Belts, Hand Rails and Floor Covering	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
20,290 - Check for Physical Damage, Water Leaks, and Graffiti	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
22,100 - Check Emergency Windows and Glass Condition	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
22,110 - Check Emergency Hatches	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
22,120 - Check All Safety Equipment	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
30,000 - SECTION 3 Exterior Circle Inspection	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
30,310 - Check Passenger Doors	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
30,320 - Inspect Step-well and Hand Rails	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
30,330 - Check Wheelchair Lift Operation	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
30,340 - FRA Check Destination Sign and Run Box	-	NA	RGASPARD	Sep 14, 2018 11:22:36 PM	No	
30,350 - FRA Inspect Mirror and Mountings	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
30,360 - Check for Physical Damage and Decals	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
30,370 - Check Wiper Blade and Arm Condition	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
30,380 - Check Exterior Compartment Doors	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
30,390 - FRA Check Fuel Tank Cap	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
33,100 - Check Lights and Reflectors	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
33,110 - Check License Plate, Permits and State Inspection Decals	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
40,000 - SECTION 4 Engine Compartment Inspection	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
40,410 - FRA Check Engine Compartment/Condition for Fire Risk	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
40,420 - Check Hood	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
40,430 - Check Fan, Shroud and Radiator	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
40,440 - Test Coolant System Using Test Strips and Record Results	-	NA	RGASPARD	Sep 14, 2018 11:22:36 PM	No	
40,441 - Inhibitor Test Pass or Fail (Indicate with a Yes or No)	No	NA	RGASPARD	Sep 14, 2018 11:22:36 PM	No	
40,442 - Freeze Point	Degree	NA	RGASPARD	Sep 14, 2018	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
	Fahrenheit			11:22:36 PM		
40,450 - FRA Check Coolant Recovery System Condition & for Leaks	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
40,460 - Record Antifreeze Protection Level Using Refractometer	-	NA	RGASPARD	Sep 14, 2018 11:22:36 PM	No	
40,461 - Refractometer Reading	Degree Fahrenheit	NA	RGASPARD	Sep 14, 2018 11:22:36 PM	No	
40,470 - Pressure Test Cooling System and Check for Leaks	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
40,480 - FRA Check Coolant Hose Condition	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
40,490 - FRA Check Alternator Mount and Condition	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
44,100 - FRA Check Fuel Control and Transmission Connections	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
44,110 - FRA Check Master Cylinder Fluid Level	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
44,120 - FRA Check All Belts for Condition, Alignment and Tension	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
44,130 - FRA Check Exhaust System	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
44,140 - FRA Check Intake System	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
44,150 - FRA Inspect Turbocharger	-	NA	RGASPARD	Sep 14, 2018 11:22:36 PM	No	
44,160 - FRA Inspect Power Steering and Hydraulic Fluid	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
44,170 - FRA Check All Engine or Belt Driven Components	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
44,180 - FRA Check for Leaks	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
44,190 - FRA Perform Battery Inspection	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
44,200 - FRA Check Battery Box Corrosion, Cables and Hold-Downs	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
50,000 - SECTION 5 Steering System Inspection	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
50,510 - Check Entire Steering System	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
60,000 - SECTION 6 Tires and Wheel Inspection	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
60,610 - FRA Check and Record Air Pressure	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
60,611 - Air Pressure RF	70 Pounds per Square Inch		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
60,612 - Air Pressure LF	70 Pounds per Square Inch		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
60,613 - Air Pressure RRO	65 Pounds per Square Inch		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
60,614 - Air Pressure RRI	65 Pounds per Square Inch		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
60,615 - Air Pressure LRI	65 Pounds per		RGASPARD	Sep 14, 2018	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
	Square Inch			11:22:36 PM		
60,616 - Air Pressure LRO	65 Pounds per Square Inch		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
60,620 - Check Valve Stems and Caps	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
60,630 - Check and Record Tread Depth	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
60,631 - Tread Depth RF	6 32nds of an inch		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
60,632 - Tread Depth LF	8 32nds of an inch		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
60,633 - Tread Depth RRO	5 32nds of an inch		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
60,634 - Tread Depth RRI	6 32nds of an inch		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
60,635 - Tread Depth LRI	6 32nds of an inch		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
60,636 - Tread Depth LRO	6 32nds of an inch		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
60,640 - Check for Mismatched Tread or Casing Design	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
60,650 - Check Sidewall Wear	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
60,660 - Inspect for Cuts and Tears	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
60,670 - Check Dual Mating With Square	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
60,680 - Check Wheels for Cracks and Loose Lugs	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
60,690 - Check Tires for Irregular or Alignment Wear	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
66,100 - FRA Check Outer Hubs for Leaks	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
70,000 - SECTION 7 Under Vehicle Inspection	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
70,710 - Check Vibration Damper	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
70,720 - Check Engine and Transmission Mounts	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
70,730 - FRA Check Starter	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
70,740 - FRA Check Bottom of Engine for Fluid Leaks	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
70,750 - FRA Check Transmission for Leaks	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
70,760 - FRA Check Differential Breather and Fluid	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
70,770 - FRA Check Exhaust System	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
70,780 - Check Driveline, U-joint and Slip Yokes	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
70,790 - Check All Body Mounts and Chassis	Done		RGASPARD	Sep 14, 2018	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
Frame				11:22:36 PM		
77,100 - FRA Check Security, Integrity and Length of Ground Straps	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
77,110 - FRA Check Fuel Tank	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
77,120 - Check Suspension Components	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
77,130 - FRA Check Brake Pad Thickness and Rotor for Wear	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
77,131 - Brake Pad Thickness LF	7 Inch		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
77,132 - Brake Pad Thickness RF	7 Inch		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
77,133 - Brake Pad Thickness LR	8 Inch		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
77,134 - Brake Pad Thickness RR	8 Inch		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
77,135 - Brake Rotor LF	38 Inch		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
77,136 - Brake Rotor RF	38 Inch		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
77,137 - Brake Rotor LR	40 Inch		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
77,138 - Brake Rotor RR	40 Inch		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
77,140 - FRA Check Brake Hoses	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
77,150 - Check King Pins	-	NA	RGASPARD	Sep 14, 2018 11:22:36 PM	No	
77,160 - FRA Check for Loose or Noisy Wheel Bearings	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
80,000 - SECTION 8 PMI Report Completion	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
80,810 - Completion of PMI Report	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
90,000 - SECTION 9 Completion of PMI	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	
90,910 - Vehicle Returned to predetermined location	Done		RGASPARD	Sep 14, 2018 11:22:36 PM	No	

Activity Sub Total

Activity 10 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	2.07
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 51634337
Invoice No. 55345 - 51634337

Client Department:

Department: 55345M

Work Order Description

PM C

Requested By: AOWENS

Created By: AOWENS

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 125,751 - DH

Activity Header

Activity: 20 999 TOTAL VEHICLE

Activity Note: PM C

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: C PM Level C

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
14-Sep-18	Gaspard, Ronald	1.5333333	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

20 Desc: PM C

Task: PM C SERVICE Performed by: RGASPARD Performed on: 14-SEP-18

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
100,000 - "A" PMI SERVICING ITEMS	Done		RGASPARD	Sep 14, 2018 11:24:02 PM	No	
101,000 - FRA Change Oil Filters	Yes		RGASPARD	Sep 14, 2018 11:24:02 PM	No	
102,000 - FRA Drain Engine Oil	Yes		RGASPARD	Sep 14, 2018 11:24:02 PM	No	
103,000 - FRA Check Transmission Fluid	Done		RGASPARD	Sep 14, 2018 11:24:02 PM	No	
104,000 - Lubricate Chassis	-	NA	RGASPARD	Sep 14, 2018 11:24:02 PM	No	
105,000 - Replace or Clean A/C Filters	Done		RGASPARD	Sep 14, 2018 11:24:02 PM	No	
107,000 - FRA Change Primary Fuel Filter	-	NA	RGASPARD	Sep 14, 2018 11:24:02 PM	No	
108,000 - Lube all pivoting Mechanisms	Done		RGASPARD	Sep 14, 2018 11:24:02 PM	No	
200,000 - "B" PMI SERVICING ITEMS (12 MONTH)	Done		RGASPARD	Sep 14, 2018 11:24:02 PM	No	
201,000 - Service Crankcase Breather	Done		RGASPARD	Sep 14, 2018 11:24:02 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
203,000 - FRA Change Automatic Transmission Fluid	No		RGASPARD	Sep 14, 2018 11:24:02 PM	No	
204,000 - FRA Change Power Steering Fluid and Filter	No		RGASPARD	Sep 14, 2018 11:24:02 PM	No	
205,000 - Complete Engine Diagnostics and Clear Codes when Completed	Done		RGASPARD	Sep 14, 2018 11:24:02 PM	No	
300,000 - "C" PMI SERVICING ITEMS (24 MONTH)	Done		RGASPARD	Sep 14, 2018 11:24:02 PM	No	
301,000 - Check and Lubricate Door Linkages	Done		RGASPARD	Sep 14, 2018 11:24:02 PM	No	
302,000 - Check Toe-In and Record Reading	-	NA	RGASPARD	Sep 14, 2018 11:24:02 PM	No	
302,001 - Record Toe-In Reading	Inches, fraction-actual	NA	RGASPARD	Sep 14, 2018 11:24:02 PM	No	
304,000 - 1st "C" PMI ONLY: Tune Up Per Engine Mfg's Specifications	No		RGASPARD	Sep 14, 2018 11:24:02 PM	No	
305,000 - FRA Change Differential Fluid	Yes		RGASPARD	Sep 14, 2018 11:24:02 PM	No	

Activity Sub Total

Activity 20 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	1.53
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 51634337
Invoice No. 55345 - 51634337

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
PM C		Ford E450 Champion Challenger	
Requested By:	AOWENS	Status:	40 - Closed (40)
Created By:	AOWENS	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	125,751 - DH

Activity Header
Activity:30 999 TOTAL VEHICLE
Activity Note: PRAMETER
Reason for Repair: 05 Inspection, Routine
Work Accomplished: 06 Inspect
Part Failure:
Activity Comments:

Activity Parts
No Data Available

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
14-Sep-18	Gaspard,Ronald	0.2666666	0	0

Activity Sublet
No Data Available

Activity Checklist						
Check List						
30 Desc: PRAMETER						
Task: PRA and Meter Readings Performed by: RGASPARD Performed on: 14-SEP-18						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		RGASPARD	Sep 14, 2018 11:24:26 PM	No	
20 - Miles			RGASPARD	Sep 14, 2018 11:24:26 PM	No	
30 - Kilometers			RGASPARD	Sep 14, 2018 11:24:26 PM	No	
40 - Hours			RGASPARD	Sep 14, 2018 11:24:26 PM	No	


Activity Sub Total	
Activity 30 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	0.27
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00

Work Order Footer	
Work Order 51634337 Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	3.87

	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 51714424
Invoice No. 55345 - 51714424

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FD4E4FS7EDB17176
Replace transmission. P0451		Ford E450 Champion Challenger	
Requested By:	CKARLENS	Status:	40 - Closed (40)
Created By:	CKARLENS	Priority:	-
Assigned To:		Driver:	
Class:	-	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	125,388 - DH

Chronology

Reported	Sep 12, 2018 10:47:36 PM	Sep 12, 2018 10:47:36 PM
Started	Sep 12, 2018 12:00:00 AM	
Completed	Sep 13, 2018 10:59:00 PM	Sep 13, 2018 10:59:00 PM
Down Time		

Work Order Notes

Line 10 Tech performed TSB
CODE P0751

Activity Header

Activity: 10 999/999/999 TOTAL VEHICLE
Activity Note: PERSONAL RISK ASSESMENT
Reason for Repair: 05 Inspection, Routine
Work Accomplished: 06 Inspect
Part Failure: 00 No Failure
Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
12-Sep-18	KARLENS,Cyrus	0.3333333	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: PERSONAL RISK ASSESMENT

Task: PRA and Meter Readings Performed by: CKARLENS Performed on: 12-SEP-18

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		CKARLENS	Sep 12, 2018 10:55:54 PM	No	
20 - Miles			CKARLENS	Sep 12, 2018 10:55:54 PM	No	
30 - Kilometers			CKARLENS	Sep 12, 2018 10:55:54 PM	No	
40 - Hours			CKARLENS	Sep 12, 2018 10:55:54 PM	No	

Activity Sub Total

Activity 10 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	0.33

	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 51714424
Invoice No. 55345 - 51714424

Client Department:
Department: 55345M
Work Order Description
Replace transmission. P0451
Requested By: CKARLENS
Created By: CKARLENS
Assigned To:
Class: -
Arrangement: Unassigned
Potential Warranty: No
Equipment No.: 4514-P
VIN: 1FDFE4FS7EDB17176
Ford E450 Champion Challenger
Status: 40 - Closed (40)
Priority: -
Driver:
Phone:
ETA:
Meter: 125,388 - DH

Activity Header
Activity: 20 027/000/000 TRANSMISSION, MAIN, AUTOMATIC
Activity Note:
Reason for Repair: 08 Preventive Maintenance
Work Accomplished: 03 Replace New
Part Failure: 43 Weak
Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
12-Sep-18	20021	FILTER, TRANSMISSION 20021	1	17.27	17.27
12-Sep-18	4C3Z-7G276-AA	HARNESS, SOLENOID, INTERNAL, TRANSMISSION, 5R110W	1	109.68	109.68
14-Sep-18	XC3Z-7A160-AA	TUBE, DIPSTICK, LEVEL, OIL, TRANSMISSION, AT-CASE	1	9.8	9.8
12-Sep-18	3C3Z-7G299-AA	RETAINER, GEAR, PLANETARY	1	9.14	9.14
12-Sep-18	6C3Z-7A262-AA	CLUTCH, FORWARD, TRANSMISSION	1	22.21	22.21
12-Sep-18	19180251	TRANSMISSION, REMANUFACTURED	1	322.56	322.56
12-Sep-18	7C3Z-7G387-B	CYLINDER, CLUTCH, TRANSMISSION	1	76.54	76.54
12-Sep-18	8C3Z-7C155-A	GASKET, BODY, VALVE, TRANSMISSION, 5R110	1	10.21	10.21
12-Sep-18	BC3Z-7H141-A	SENSOR, TEMPERATURE, TRANSMISSION	1	10.85	10.85
12-Sep-18	F81Z-7A527-AA	RING, SNAP, CLUTCH, TRANSMISSION	1	2.49	2.49

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
12-Sep-18	KARLENS, Cyrius	4	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List						
20 Desc: Task: 55345 TRANSMISSION DTC P0751 SHIFT SOLENOID Performed by: CKARLENS Performed on: 12-SEP-18						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
5 - 55345 TRANSMISSION DTC P0751 SHIFT SOLENOID	Done		CKARLENS	Sep 12, 2018 10:55:23 PM	No	

Activity Sub Total

Activity 20 Sub Total	
Parts:	590.75
Labor:	0.00
Labor Hours:	4.00

	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	590.75
Work Order Footer		
Work Order 51714424 Total		
	Parts:	590.75
	Labor:	0.00
	Labor Hours:	4.33
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	590.75



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 51717242
Invoice No. 55345 - 51717242

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FD4E4FS7EDB17176
REPLACE SHIFTER CABLE		Ford E450 Champion Challenger	
Requested By:	CKARLENS	Status:	40 - Closed (40)
Created By:	CKARLENS	Priority:	-
Assigned To:		Driver:	
Class:	-	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	125,574 - DH

Chronology

Reported	Sep 13, 2018 3:21:03 PM	Sep 13, 2018 3:21:03 PM
Started	Sep 13, 2018 12:00:00 AM	
Completed	Sep 13, 2018 10:55:00 PM	Sep 13, 2018 10:55:00 PM
Down Time		

Work Order Notes

Line 10 Tech replaced shifter cable
Qty1 part#9C2Z-2V200-B

Activity Header

Activity: 10 999/999/999 TOTAL VEHICLE
Activity Note: PERSONAL RISK ASSESMENT
Reason for Repair: 05 Inspection, Routine
Work Accomplished: 06 Inspect
Part Failure: 00 No Failure
Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
13-Sep-18	KARLENS,Cyrius	0.5	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: PERSONAL RISK ASSESMENT

Task: PRA and Meter Readings Performed by: CKARLENS Performed on: 13-SEP-18

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		CKARLENS	Sep 13, 2018 3:29:04 PM	No	
20 - Miles			CKARLENS	Sep 13, 2018 3:29:04 PM	No	
30 - Kilometers			CKARLENS	Sep 13, 2018 3:29:04 PM	No	
40 - Hours			CKARLENS	Sep 13, 2018 3:29:04 PM	No	

Activity Sub Total

Activity 10 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	0.50

	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 51717242
Invoice No. 55345 - 51717242

Client Department:
Department: 55345M **Equipment No.:** 4514-P
Work Order Description **VIN:** 1FDFE4FS7EDB17176
REPLACE SHIFTER CABLE Ford E450 Champion Challenger
Requested By: CKARLENS **Status:** 40 - Closed (40)
Created By: CKARLENS **Priority:** -
Assigned To: **Driver:**
Class: - **Phone:**
Arrangement: Unassigned **ETA:**
Potential Warranty: No **Meter:** 125,574 - DH

Activity Header
Activity:20 027/000/000 TRANSMISSION, MAIN, AUTOMATIC
Activity Note:
Reason for Repair: 05 Inspection, Routine
Work Accomplished: 03 Replace New
Part Failure:
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
13-Sep-18	8C2Z-7E395-A	CABLE, SELECTOR, SHIFT	1	44.69	44.69

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
13-Sep-18	KARLENS,Cyrius	1.4166666	0	0

Activity Sublet
No Data Available


Activity Checklist
No Data Available
No Data Available

Activity Sub Total															
<table><tr><th colspan="2">Activity 20 Sub Total</th></tr><tr><td>Parts:</td><td>44.69</td></tr><tr><td>Labor:</td><td>0.00</td></tr><tr><td>Labor Hours:</td><td>1.42</td></tr><tr><td>Sublet Parts:</td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td>44.69</td></tr></table>		Activity 20 Sub Total		Parts:	44.69	Labor:	0.00	Labor Hours:	1.42	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	44.69
Activity 20 Sub Total															
Parts:	44.69														
Labor:	0.00														
Labor Hours:	1.42														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	44.69														

Work Order Footer															
<table><tr><th colspan="2">Work Order 51717242 Total</th></tr><tr><td>Parts:</td><td>44.69</td></tr><tr><td>Labor:</td><td>0.00</td></tr><tr><td>Labor Hours:</td><td>1.92</td></tr><tr><td>Sublet Parts:</td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td>44.69</td></tr></table>		Work Order 51717242 Total		Parts:	44.69	Labor:	0.00	Labor Hours:	1.92	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	44.69
Work Order 51717242 Total															
Parts:	44.69														
Labor:	0.00														
Labor Hours:	1.92														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	44.69														



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 51534064
Invoice No. 55345 - 51534064

Client Department:

Department: 55345M

Work Order Description

PM A

Requested By: RGASPARD

Created By: RGASPARD

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 121,344 - DH

Chronology

Reported	Aug 17, 2018 11:28:44 AM	Aug 17, 2018 11:28:44 AM
Started	Aug 19, 2018 12:00:00 AM	
Completed	Aug 19, 2018 6:06:00 PM	Aug 19, 2018 6:06:00 PM
Down Time		

Work Order Notes

Line 10 COMPLAINT: Performed PM service

CAUSE: Preventive Maintenance

CORRECTION: performed service, tires, brakes good at this time

Parts B329qty 1

Activity Header

Activity: 10 999 TOTAL VEHICLE

Activity Note: Light Medium Duty PMI

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: A PM Level A

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
19-Aug-18	Owens,Arthur	1	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: Light Medium Duty PMI

Task: First Transit Light-Medium Duty PMI Performed by: AOWENS Performed on: 19-AUG-18

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,000 - SECTION 1 Preparation and Drive On (In Lot) Inspection	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
10,100 - Safety Inspection	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
10,110 - FRA Check Drivers Pre-trip or DVIR/EVIR & Authorization Forms	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
10,120 - FRA Check All Warning Lights and Alarms	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,130 - FRA Check Automatic Transmission Neutral Start Operation	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
10,140 - Check Service Brakes	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
10,150 - FRA Start Engine and Listen for Any Unusual Noises	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
10,160 - FRA Check Instruments and Horns	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
10,170 - Check Fast Idle	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
10,180 - Check Starter Protection Circuit	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
10,190 - Check Reverse Warning System	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
11,100 - Check Parking Brake	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
11,110 - Check HVAC Switches and Other Controls	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
11,120 - FRA Inspect Windshields, Mirror and Sun Visor Condition	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
11,130 - FRA Check Wiper and Washer Operation	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
11,140 - Road Test: Check for Proper Operation	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
11,150 - Perform Brake Test	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
11,152 - Decelerometer Results Test 1	FEET	N/a	AOWENS	Aug 19, 2018 5:56:12 PM	No	
11,154 - Decelerometer Results Test 2	FEET	n/a	AOWENS	Aug 19, 2018 5:56:12 PM	No	
11,156 - Decelerometer Results Test 3	FEET	n/a	AOWENS	Aug 19, 2018 5:56:12 PM	No	
11,161 - FRA Check/Record Oil Pressure / @1500 rpm	Pounds per Square Inch	n/a	AOWENS	Aug 19, 2018 5:56:12 PM	No	
11,162 - FRA Check/Record Water Temperature	Degree Fahrenheit	N/a	AOWENS	Aug 19, 2018 5:56:12 PM	No	
11,170 - FRA Check Door Operation	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
11,180 - FRA Check Operation of All Other Accessories	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
20,000 - SECTION 2 Interior Circle Inspection	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
20,210 - Check Condition of Operator's Area	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
20,220 - Check Accelerator and Brake Pedals	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
20,230 - FRA Check Wiring Under Dash	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
20,240 - FRA Check Interior Lights	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
20,250 - FRA Check Interior Electrical Panels	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
20,260 - Check Stop Request System	-	n/a	AOWENS	Aug 19, 2018 5:56:12 PM	No	
20,270 - Check Fare Box Mounting (If Applicable)	-	n/a	AOWENS	Aug 19, 2018 5:56:12 PM	No	
20,280 - Check Seats, Seat Belts, Hand Rails and Floor Covering	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
20,290 - Check for Physical Damage, Water Leaks, and Graffiti	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
22,100 - Check Emergency Windows and Glass Condition	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
22,110 - Check Emergency Hatches	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
22,120 - Check All Safety Equipment	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
30,000 - SECTION 3 Exterior Circle Inspection	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
30,310 - Check Passenger Doors	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
30,320 - Inspect Step-well and Hand Rails	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
30,330 - Check Wheelchair Lift Operation	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
30,340 - FRA Check Destination Sign and Run Box	-	n/a	AOWENS	Aug 19, 2018 5:56:12 PM	No	
30,350 - FRA Inspect Mirror and Mountings	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
30,360 - Check for Physical Damage and Decals	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
30,370 - Check Wiper Blade and Arm Condition	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
30,380 - Check Exterior Compartment Doors	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
30,390 - FRA Check Fuel Tank Cap	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
33,100 - Check Lights and Reflectors	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
33,110 - Check License Plate, Permits and State Inspection Decals	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
40,000 - SECTION 4 Engine Compartment Inspection	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
40,410 - FRA Check Engine Compartment/Condition for Fire Risk	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
40,420 - Check Hood	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
40,430 - Check Fan, Shroud and Radiator	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
40,440 - Test Coolant System Using Test Strips and Record Results	-	n/a	AOWENS	Aug 19, 2018 5:56:12 PM	No	
40,441 - Inhibitor Test Pass or Fail (Indicate with a Yes or No)	No	n/a	AOWENS	Aug 19, 2018 5:56:12 PM	No	
40,442 - Freeze Point	Degree Fahrenheit	n/a	AOWENS	Aug 19, 2018 5:56:12 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
40,450 - FRA Check Coolant Recovery System Condition & for Leaks	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
40,460 - Record Antifreeze Protection Level Using Refractometer	-	n/a	AOWENS	Aug 19, 2018 5:56:12 PM	No	
40,461 - Refractometer Reading	Degree Fahrenheit	n/a	AOWENS	Aug 19, 2018 5:56:12 PM	No	
40,470 - Pressure Test Cooling System and Check for Leaks	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
40,480 - FRA Check Coolant Hose Condition	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
40,490 - FRA Check Alternator Mount and Condition	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
44,100 - FRA Check Fuel Control and Transmission Connections	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
44,110 - FRA Check Master Cylinder Fluid Level	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
44,120 - FRA Check All Belts for Condition, Alignment and Tension	-	replaced serpentine belt	AOWENS	Aug 19, 2018 5:56:12 PM	Yes	51634333
44,130 - FRA Check Exhaust System	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
44,140 - FRA Check Intake System	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
44,150 - FRA Inspect Turbocharger	-	n/a	AOWENS	Aug 19, 2018 5:56:12 PM	No	
44,160 - FRA Inspect Power Steering and Hydraulic Fluid	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
44,170 - FRA Check All Engine or Belt Driven Components	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
44,180 - FRA Check for Leaks	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
44,190 - FRA Perform Battery Inspection	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
44,200 - FRA Check Battery Box Corrosion, Cables and Hold-Downs	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
50,000 - SECTION 5 Steering System Inspection	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
50,510 - Check Entire Steering System	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
60,000 - SECTION 6 Tires and Wheel Inspection	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
60,610 - FRA Check and Record Air Pressure	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
60,611 - Air Pressure RF	70 Pounds per Square Inch		AOWENS	Aug 19, 2018 5:56:12 PM	No	
60,612 - Air Pressure LF	70 Pounds per Square Inch		AOWENS	Aug 19, 2018 5:56:12 PM	No	
60,613 - Air Pressure RRO	70 Pounds per Square Inch		AOWENS	Aug 19, 2018 5:56:12 PM	No	
60,614 - Air Pressure RRI	70 Pounds per Square Inch		AOWENS	Aug 19, 2018 5:56:12 PM	No	
60,615 - Air Pressure LRI	70 Pounds per Square Inch		AOWENS	Aug 19, 2018 5:56:12 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
60,616 - Air Pressure LRO	70 Pounds per Square Inch		AOWENS	Aug 19, 2018 5:56:12 PM	No	
60,620 - Check Valve Stems and Caps	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
60,630 - Check and Record Tread Depth	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
60,631 - Tread Depth RF	7 32nds of an inch		AOWENS	Aug 19, 2018 5:56:12 PM	No	
60,632 - Tread Depth LF	7 32nds of an inch		AOWENS	Aug 19, 2018 5:56:12 PM	No	
60,633 - Tread Depth RRO	8 32nds of an inch		AOWENS	Aug 19, 2018 5:56:12 PM	No	
60,634 - Tread Depth RRI	8 32nds of an inch		AOWENS	Aug 19, 2018 5:56:12 PM	No	
60,635 - Tread Depth LRI	5 32nds of an inch		AOWENS	Aug 19, 2018 5:56:12 PM	No	
60,636 - Tread Depth LRO	8 32nds of an inch		AOWENS	Aug 19, 2018 5:56:12 PM	No	
60,640 - Check for Mismatched Tread or Casing Design	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
60,650 - Check Sidewall Wear	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
60,660 - Inspect for Cuts and Tears	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
60,670 - Check Dual Mating With Square	-	n/a	AOWENS	Aug 19, 2018 5:56:12 PM	No	
60,680 - Check Wheels for Cracks and Loose Lugs	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
60,690 - Check Tires for Irregular or Alignment Wear	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
66,100 - FRA Check Outer Hubs for Leaks	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
70,000 - SECTION 7 Under Vehicle Inspection	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
70,710 - Check Vibration Damper	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
70,720 - Check Engine and Transmission Mounts	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
70,730 - FRA Check Starter	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
70,740 - FRA Check Bottom of Engine for Fluid Leaks	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
70,750 - FRA Check Transmission for Leaks	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
70,760 - FRA Check Differential Breather and Fluid	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
70,770 - FRA Check Exhaust System	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
70,780 - Check Driveline, U-joint and Slip Yokes	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
70,790 - Check All Body Mounts and Chassis Frame	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
77,100 - FRA Check Security, Integrity and Length of Ground Straps	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
77,110 - FRA Check Fuel Tank	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
77,120 - Check Suspension Components	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
77,130 - FRA Check Brake Pad Thickness and Rotor for Wear	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
77,131 - Brake Pad Thickness LF	7 Inch		AOWENS	Aug 19, 2018 5:56:12 PM	No	
77,132 - Brake Pad Thickness RF	7 Inch		AOWENS	Aug 19, 2018 5:56:12 PM	No	
77,133 - Brake Pad Thickness LR	9 Inch		AOWENS	Aug 19, 2018 5:56:12 PM	No	
77,134 - Brake Pad Thickness RR	9 Inch		AOWENS	Aug 19, 2018 5:56:12 PM	No	
77,135 - Brake Rotor LF	38 Inch		AOWENS	Aug 19, 2018 5:56:12 PM	No	
77,136 - Brake Rotor RF	38 Inch		AOWENS	Aug 19, 2018 5:56:12 PM	No	
77,137 - Brake Rotor LR	40 Inch		AOWENS	Aug 19, 2018 5:56:12 PM	No	
77,138 - Brake Rotor RR	40 Inch		AOWENS	Aug 19, 2018 5:56:12 PM	No	
77,140 - FRA Check Brake Hoses	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
77,150 - Check King Pins	-	n/a	AOWENS	Aug 19, 2018 5:56:12 PM	No	
77,160 - FRA Check for Loose or Noisy Wheel Bearings	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
80,000 - SECTION 8 PMI Report Completion	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
80,810 - Completion of PMI Report	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
90,000 - SECTION 9 Completion of PMI	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	
90,910 - Vehicle Returned to predetermined location	Done		AOWENS	Aug 19, 2018 5:56:12 PM	No	

Activity Sub Total

Activity 10 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	1.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 51634333
Invoice No. 55345 - 51634333

Client Department:

Department: 55345M

Work Order Description

FOLLOW UP ~~~~~-> REPLACE SERPTINE BELT

Requested By: AOWENS

Created By: AOWENS

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 121,344 - DH

Chronology

Reported	Aug 19, 2018 5:56:21 PM	Aug 19, 2018 5:56:21 PM
Started	Aug 19, 2018 12:00:00 AM	
Completed	Aug 19, 2018 6:06:00 PM	Aug 19, 2018 6:06:00 PM
Down Time		

Work Order Notes

Line 10 Replaced serpentine belt

Part# 1360k6

Qty 1

Activity Header

Activity: 10 040/000/000 ENGINE/MOTOR SYSTEMS GROUP

Activity Note: replaced serpentine belt

Reason for Repair: 39 Natural Causes

Work Accomplished: 03 Replace New

Part Failure: 99 Replaced Before Failure

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
19-Aug-18	1360K6	BELT, SERPENTINE, 6-RIB, 136.00" SAME AS 5061360	1	23.51	23.51

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
19-Aug-18	Owens,Arthur	0.75	0	0

Activity Sublet

No Data Available

Activity Checklist

No Data Available

No Data Available

Activity Sub Total

Activity 10 Sub Total

Parts:	23.51
Labor:	0.00
Labor Hours:	0.75
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	23.51



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 51534064
Invoice No. 55345 - 51534064

Client Department:

Department: 55345M

Work Order Description

PM A

Requested By: RGASPARD

Created By: RGASPARD

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 121,344 - DH

Activity Header

Activity: 20 999 TOTAL VEHICLE

Activity Note: PM A

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: A PM Level A

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
19-Aug-18	B329(F)	GOING OUT OF SERVICE SEE BALDWIN B329 IN THE FLEET ORG. FILTER, OIL, SPIN-ON	1	1.96	1.96

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
19-Aug-18	Owens,Arthur	1.5	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List						
20 Desc: PM A						
Task: PM A SERVICE Performed by: AOWENS Performed on: 19-AUG-18						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
100,000 - "A" PMI SERVICING ITEMS	Done		AOWENS	Aug 19, 2018 5:38:59 PM	No	
101,000 - FRA Change Oil Filters	Yes		AOWENS	Aug 19, 2018 5:38:59 PM	No	
102,000 - FRA Drain Engine Oil	Yes		AOWENS	Aug 19, 2018 5:38:59 PM	No	
103,000 - FRA Check Transmission Fluid	Done		AOWENS	Aug 19, 2018 5:38:59 PM	No	
104,000 - Lubricate Chassis	Done		AOWENS	Aug 19, 2018 5:38:59 PM	No	
105,000 - Replace or Clean A/C Filters	Done		AOWENS	Aug 19, 2018 5:38:59 PM	No	
107,000 - FRA Change Primary Fuel Filter	No	N/a	AOWENS	Aug 19, 2018 5:38:59 PM	No	
108,000 - Lube all pivoting Mechanisms	Done		AOWENS	Aug 19, 2018 5:38:59 PM	No	

Activity Sub Total

Activity 20 Sub Total	
Parts:	1.96
Labor:	0.00
Labor Hours:	1.50
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	1.96



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 51634333
Invoice No. 55345 - 51634333

Client Department:		Equipment No.: 4514-P
Department:	55345M	VIN: 1FDFE4FS7EDB17176
Work Order Description		Ford E450 Champion Challenger
FOLLOW UP ~~~~~-> REPLACE SERPTINE BELT		Status: 40 - Closed (40)
Requested By:	AOWENS	Priority: 1 - Low
Created By:	AOWENS	Driver:
Assigned To:		Phone:
Class:	WO - WORK ORDER	ETA:
Arrangement:	Unassigned	Meter: 121,344 - DH
Potential Warranty:	No	

Activity Header
Activity:20 999/999/999 TOTAL VEHICLE
Activity Note:
Reason for Repair: 05 Inspection, Routine
Work Accomplished: 06 Inspect
Part Failure: 00 No Failure
Activity Comments:

Activity Parts
No Data Available

Activity Labor
No Data Available

Activity Sublet
No Data Available

Check List						
20 Desc: Task: PRA and Meter Readings Performed by: AOWENS Performed on: 19-AUG-18						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		AOWENS	Aug 19, 2018 6:05:38 PM	No	
20 - Miles			AOWENS	Aug 19, 2018 6:05:38 PM	No	
30 - Kilometers			AOWENS	Aug 19, 2018 6:05:38 PM	No	
40 - Hours			AOWENS	Aug 19, 2018 6:05:38 PM	No	


Activity Sub Total		Activity 20 Sub Total	
		Parts:	0.00
		Labor:	0.00
		Labor Hours:	0.00
		Sublet Parts:	0.00
		Sublet Labor:	0.00
		Activity Sub Total	0.00

Work Order Footer		Work Order 51634333 Total	
		Parts:	23.51
		Labor:	0.00
		Labor Hours:	0.75
		Sublet Parts:	0.00
		Sublet Labor:	0.00

	Activity Sub Total	23.51
--	---------------------------	--------------



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 51534064
Invoice No. 55345 - 51534064

Client Department:

Department: 55345M

Work Order Description

PM A

Requested By: RGASPARD

Created By: RGASPARD

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 121,344 - DH

Activity Header

Activity: 30 999 TOTAL VEHICLE

Activity Note: PRAMETER

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
19-Aug-18	Owens,Arthur	0.5	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

30 Desc: PRAMETER

Task: PRA and Meter Readings Performed by: AOWENS Performed on: 19-AUG-18

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		AOWENS	Aug 19, 2018 5:36:26 PM	No	
20 - Miles			AOWENS	Aug 19, 2018 5:36:26 PM	No	
30 - Kilometers			AOWENS	Aug 19, 2018 5:36:26 PM	No	
40 - Hours			AOWENS	Aug 19, 2018 5:36:26 PM	No	

Activity Sub Total

Activity 30 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	0.50
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00

Work Order Footer

Work Order 51534064 Total

Parts:	1.96
Labor:	0.00
Labor Hours:	3.00

	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	1.96



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 51577911
Invoice No. 55345 - 51577911

Client Department:

Department: 55345M

Work Order Description

Check engine light on

Requested By: JAPEREZ

Created By: JAPEREZ

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 119,465 - DH

Chronology

Reported	Aug 7, 2018 1:21:16 PM	Aug 7, 2018 1:21:16 PM
Started	Aug 7, 2018 12:00:00 AM	
Completed	Aug 7, 2018 3:07:02 PM	Aug 7, 2018 3:07:02 PM
Down Time		

Work Order Notes

Line 10 To file warranty be sure to do the following:

- 1) Enter a COMPLAINT statement for each activity.
- 2) Enter CAUSE statement in the Notes field of each activity.
- 3) Enter CORRECTION statement in the Comment section of each activity.

Complaint:check engine light on

Cause: check computer system found code p2632 fuel pump B control circuit open, follow diagnostic chart found high resistance on fuel pump system

Correction:replaced fuel pump and fuel pump control module

Parts:

1 fuel pump kit 11396002

1 fuel pump module aa8z-9d370-b

Activity Header

Activity:5 999 TOTAL VEHICLE

Activity Note: Personal Risk Assessment

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List						
5 Desc: Personal Risk Assessment						
Task: PRA and Meter Readings Performed by: JAPEREZ Performed on: 07-AUG-18						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		JAPEREZ	Aug 7, 2018 1:31:08 PM	No	
20 - Miles			JAPEREZ	Aug 7, 2018 1:31:08 PM	No	
30 - Kilometers			JAPEREZ	Aug 7, 2018 1:31:08 PM	No	
40 - Hours			JAPEREZ	Aug 7, 2018 1:31:08 PM	No	
Activity Sub Total						
			Activity 5 Sub Total			
			Parts: 0.00			
			Labor: 0.00			
			Labor Hours: 0.00			
			Sublet Parts: 0.00			
			Sublet Labor: 0.00			
			Activity Sub Total 0.00			



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 51577911
Invoice No. 55345 - 51577911

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Check engine light on		Ford E450 Champion Challenger	
Requested By:	JAPEREZ	Status:	40 - Closed (40)
Created By:	JAPEREZ	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	119,465 - DH

Activity Header
Activity:15 044 FUEL SYSTEM
Activity Note: Check engine light on
Reason for Repair: 04 Driver's Report
Work Accomplished:
Part Failure:
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
07-Aug-18	AA8Z-9D370-B	MODULE, RELAY, PUMP, FUEL	1	40.88	40.88

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
07-Aug-18	Perez,Javier	4.6666666	0	0

Activity Sublet
No Data Available


Activity Checklist
No Data Available
No Data Available

Activity Sub Total		Activity 15 Sub Total	
Parts:			40.88
Labor:			0.00
Labor Hours:			4.67
Sublet Parts:			0.00
Sublet Labor:			0.00
Activity Sub Total			40.88

Work Order Footer		Work Order 51577911 Total	
Parts:			40.88
Labor:			0.00
Labor Hours:			4.67
Sublet Parts:			0.00
Sublet Labor:			0.00
Activity Sub Total			40.88



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 51447121
Invoice No. 55345 - 51447121

Client Department:

Department: 55345M

Work Order Description

PM A

Requested By: RGASPARD

Created By: RGASPARD

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 117,185 - DH

Chronology

Reported	Jul 19, 2018 11:19:20 AM	Jul 19, 2018 11:19:20 AM
Started	Jul 24, 2018 12:00:00 AM	
Completed	Jul 24, 2018 12:14:00 AM	Jul 24, 2018 12:14:00 AM
Down Time		

Work Order Notes

Line 10 COMPLAINT:pmA

CAUSE:Service

CORRECTION:Perform pmA Service

Oil filter B329 qty1

Engine oil 5w20 qty 7 Qts

Fixed right front tire patched and balanced tire

Torque wheel 140 lbs second torque 140 lbs

Activity Header

Activity:10 999 TOTAL VEHICLE

Activity Note: Light Medium Duty PMI

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: A PM Level A

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
24-Jul-18	Gaspard,Ronald	1.5333333	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: Light Medium Duty PMI

Task: First Transit Light-Medium Duty PMI Performed by: RGASPARD Performed on: 24-JUL-18

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,000 - SECTION 1 Preparation and Drive On (In Lot) Inspection	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
10,100 - Safety Inspection	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
10,110 - FRA Check Drivers Pre-trip or DVIR/EVIR & Authorization Forms	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,120 - FRA Check All Warning Lights and Alarms	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
10,130 - FRA Check Automatic Transmission Neutral Start Operation	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
10,140 - Check Service Brakes	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
10,150 - FRA Start Engine and Listen for Any Unusual Noises	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
10,160 - FRA Check Instruments and Horns	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
10,170 - Check Fast Idle	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
10,180 - Check Starter Protection Circuit	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
10,190 - Check Reverse Warning System	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
11,100 - Check Parking Brake	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
11,110 - Check HVAC Switches and Other Controls	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
11,120 - FRA Inspect Windshields, Mirror and Sun Visor Condition	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
11,130 - FRA Check Wiper and Washer Operation	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
11,140 - Road Test: Check for Proper Operation	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
11,150 - Perform Brake Test	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
11,152 - Decelerometer Results Test 1	FEET	na	RGASPARD	Jul 24, 2018 12:02:10 AM	No	
11,154 - Decelerometer Results Test 2	FEET	na	RGASPARD	Jul 24, 2018 12:02:10 AM	No	
11,156 - Decelerometer Results Test 3	FEET	na	RGASPARD	Jul 24, 2018 12:02:10 AM	No	
11,161 - FRA Check/Record Oil Pressure / @1500 rpm	Pounds per Square Inch	na	RGASPARD	Jul 24, 2018 12:02:10 AM	No	
11,162 - FRA Check/Record Water Temperature	Degree Fahrenheit	na	RGASPARD	Jul 24, 2018 12:02:10 AM	No	
11,170 - FRA Check Door Operation	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
11,180 - FRA Check Operation of All Other Accessories	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
20,000 - SECTION 2 Interior Circle Inspection	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
20,210 - Check Condition of Operator's Area	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
20,220 - Check Accelerator and Brake Pedals	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
20,230 - FRA Check Wiring Under Dash	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
20,240 - FRA Check Interior Lights	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
20,250 - FRA Check Interior Electrical Panels	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
20,260 - Check Stop Request System	-	na	RGASPARD	Jul 24, 2018 12:02:10 AM	No	
20,270 - Check Fare Box Mounting (If Applicable)	-	na	RGASPARD	Jul 24, 2018 12:02:10 AM	No	
20,280 - Check Seats, Seat Belts, Hand Rails and Floor Covering	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
20,290 - Check for Physical Damage, Water Leaks, and Graffiti	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
22,100 - Check Emergency Windows and Glass Condition	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
22,110 - Check Emergency Hatches	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
22,120 - Check All Safety Equipment	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
30,000 - SECTION 3 Exterior Circle Inspection	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
30,310 - Check Passenger Doors	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
30,320 - Inspect Step-well and Hand Rails	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
30,330 - Check Wheelchair Lift Operation	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
30,340 - FRA Check Destination Sign and Run Box	-	na	RGASPARD	Jul 24, 2018 12:02:10 AM	No	
30,350 - FRA Inspect Mirror and Mountings	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
30,360 - Check for Physical Damage and Decals	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
30,370 - Check Wiper Blade and Arm Condition	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
30,380 - Check Exterior Compartment Doors	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
30,390 - FRA Check Fuel Tank Cap	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
33,100 - Check Lights and Reflectors	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
33,110 - Check License Plate, Permits and State Inspection Decals	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
40,000 - SECTION 4 Engine Compartment Inspection	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
40,410 - FRA Check Engine Compartment/Condition for Fire Risk	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
40,420 - Check Hood	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
40,430 - Check Fan, Shroud and Radiator	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
40,440 - Test Coolant System Using Test Strips and Record Results	-	na	RGASPARD	Jul 24, 2018 12:02:10 AM	No	
40,441 - Inhibitor Test Pass or Fail (Indicate with a Yes or No)	No	na	RGASPARD	Jul 24, 2018 12:02:10 AM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
40,442 - Freeze Point	Degree Fahrenheit	na	RGASPARD	Jul 24, 2018 12:02:10 AM	No	
40,450 - FRA Check Coolant Recovery System Condition & for Leaks	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
40,460 - Record Antifreeze Protection Level Using Refractometer	-	na	RGASPARD	Jul 24, 2018 12:02:10 AM	No	
40,461 - Refractometer Reading	Degree Fahrenheit	na	RGASPARD	Jul 24, 2018 12:02:10 AM	No	
40,470 - Pressure Test Cooling System and Check for Leaks	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
40,480 - FRA Check Coolant Hose Condition	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
40,490 - FRA Check Alternator Mount and Condition	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
44,100 - FRA Check Fuel Control and Transmission Connections	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
44,110 - FRA Check Master Cylinder Fluid Level	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
44,120 - FRA Check All Belts for Condition, Alignment and Tension	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
44,130 - FRA Check Exhaust System	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
44,140 - FRA Check Intake System	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
44,150 - FRA Inspect Turbocharger	-	na	RGASPARD	Jul 24, 2018 12:02:10 AM	No	
44,160 - FRA Inspect Power Steering and Hydraulic Fluid	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
44,170 - FRA Check All Engine or Belt Driven Components	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
44,180 - FRA Check for Leaks	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
44,190 - FRA Perform Battery Inspection	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
44,200 - FRA Check Battery Box Corrosion, Cables and Hold-Downs	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
50,000 - SECTION 5 Steering System Inspection	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
50,510 - Check Entire Steering System	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
60,000 - SECTION 6 Tires and Wheel Inspection	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
60,610 - FRA Check and Record Air Pressure	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
60,611 - Air Pressure RF	70 Pounds per Square Inch		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
60,612 - Air Pressure LF	70 Pounds per Square Inch		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
60,613 - Air Pressure RRO	65 Pounds per Square Inch		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
60,614 - Air Pressure RRI	65 Pounds per Square Inch		RGASPARD	Jul 24, 2018 12:02:10 AM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
60,615 - Air Pressure LRI	65 Pounds per Square Inch		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
60,616 - Air Pressure LRO	65 Pounds per Square Inch		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
60,620 - Check Valve Stems and Caps	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
60,630 - Check and Record Tread Depth	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
60,631 - Tread Depth RF	7 32nds of an inch		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
60,632 - Tread Depth LF	8 32nds of an inch		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
60,633 - Tread Depth RRO	6 32nds of an inch		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
60,634 - Tread Depth RRI	6 32nds of an inch		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
60,635 - Tread Depth LRI	7 32nds of an inch		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
60,636 - Tread Depth LRO	6 32nds of an inch		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
60,640 - Check for Mismatched Tread or Casing Design	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
60,650 - Check Sidewall Wear	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
60,660 - Inspect for Cuts and Tears	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
60,670 - Check Dual Mating With Square	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
60,680 - Check Wheels for Cracks and Loose Lugs	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
60,690 - Check Tires for Irregular or Alignment Wear	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
66,100 - FRA Check Outer Hubs for Leaks	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
70,000 - SECTION 7 Under Vehicle Inspection	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
70,710 - Check Vibration Damper	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
70,720 - Check Engine and Transmission Mounts	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
70,730 - FRA Check Starter	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
70,740 - FRA Check Bottom of Engine for Fluid Leaks	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
70,750 - FRA Check Transmission for Leaks	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
70,760 - FRA Check Differential Breather and Fluid	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
70,770 - FRA Check Exhaust System	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
70,780 - Check Driveline, U-joint and Slip Yokes	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	


Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
70,790 - Check All Body Mounts and Chassis Frame	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
77,100 - FRA Check Security, Integrity and Length of Ground Straps	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
77,110 - FRA Check Fuel Tank	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
77,120 - Check Suspension Components	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
77,130 - FRA Check Brake Pad Thickness and Rotor for Wear	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
77,131 - Brake Pad Thickness LF	8 Inch		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
77,132 - Brake Pad Thickness RF	8 Inch		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
77,133 - Brake Pad Thickness LR	10 Inch		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
77,134 - Brake Pad Thickness RR	10 Inch		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
77,135 - Brake Rotor LF	38 Inch		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
77,136 - Brake Rotor RF	38 Inch		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
77,137 - Brake Rotor LR	40 Inch		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
77,138 - Brake Rotor RR	40 Inch		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
77,140 - FRA Check Brake Hoses	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
77,150 - Check King Pins	-	na	RGASPARD	Jul 24, 2018 12:02:10 AM	No	
77,160 - FRA Check for Loose or Noisy Wheel Bearings	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
80,000 - SECTION 8 PMI Report Completion	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
80,810 - Completion of PMI Report	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
90,000 - SECTION 9 Completion of PMI	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	
90,910 - Vehicle Returned to predetermined location	Done		RGASPARD	Jul 24, 2018 12:02:10 AM	No	

Activity Sub Total

Activity 10 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	1.53
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 51447121
Invoice No. 55345 - 51447121

Client Department:

Department: 55345M

Work Order Description

PM A

Requested By: RGASPARD

Created By: RGASPARD

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 117,185 - DH

Activity Header

Activity: 20 999 TOTAL VEHICLE

Activity Note: PM A

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: A PM Level A

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
24-Jul-18	B329(F)	GOING OUT OF SERVICE SEE BALDWIN B329 IN THE FLEET ORG. FILTER, OIL, SPIN-ON	1	1.96	1.96

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
24-Jul-18	Gaspard,Ronald	1.5	0	0

Activity Sublet

No Data Available

Activity Checklist


Check List						
20 Desc: PM A						
Task: PM A SERVICE Performed by: RGASPARD Performed on: 24-JUL-18						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
100,000 - "A" PMI SERVICING ITEMS	Done		RGASPARD	Jul 24, 2018 12:02:57 AM	No	
101,000 - FRA Change Oil Filters	Yes		RGASPARD	Jul 24, 2018 12:02:57 AM	No	
102,000 - FRA Drain Engine Oil	Yes		RGASPARD	Jul 24, 2018 12:02:57 AM	No	
103,000 - FRA Check Transmission Fluid	Done		RGASPARD	Jul 24, 2018 12:02:57 AM	No	
104,000 - Lubricate Chassis	-	na	RGASPARD	Jul 24, 2018 12:02:57 AM	No	
105,000 - Replace or Clean A/C Filters	Done		RGASPARD	Jul 24, 2018 12:02:57 AM	No	
107,000 - FRA Change Primary Fuel Filter	No	na	RGASPARD	Jul 24, 2018 12:02:57 AM	No	
108,000 - Lube all pivoting Mechanisms	Done		RGASPARD	Jul 24, 2018 12:02:57 AM	No	

Activity Sub Total

Activity 20 Sub Total	
Parts:	1.96
Labor:	0.00
Labor Hours:	1.50
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	1.96



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 51447121
Invoice No. 55345 - 51447121

Client Department:

Department: 55345M

Work Order Description

PM A

Requested By: RGASPARD

Created By: RGASPARD

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 117,185 - DH

Activity Header

Activity: 30 999 TOTAL VEHICLE

Activity Note: PRAMETER

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
24-Jul-18	Gaspard,Ronald	0.25	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

30 Desc: PRAMETER

Task: PRA and Meter Readings Performed by: RGASPARD Performed on: 24-JUL-18

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		RGASPARD	Jul 24, 2018 12:03:19 AM	No	
20 - Miles			RGASPARD	Jul 24, 2018 12:03:19 AM	No	
30 - Kilometers			RGASPARD	Jul 24, 2018 12:03:19 AM	No	
40 - Hours			RGASPARD	Jul 24, 2018 12:03:19 AM	No	

Activity Sub Total

Activity 30 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	0.25
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00

Work Order Footer

Work Order 51447121 Total

Parts:	1.96
Labor:	0.00
Labor Hours:	3.28

	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	1.96



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 51365408
Invoice No. 55345 - 51365408

Client Department:

Department: 55345M

Work Order Description

PM B

Requested By: RAURODRIGUEZ

Created By: RAURODRIGUEZ

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 112,821 - DH

Chronology

Reported	Jun 20, 2018 11:31:54 AM	Jun 20, 2018 11:31:54 AM
Started	Jun 20, 2018 12:00:00 AM	
Completed	Jun 21, 2018 12:06:00 AM	Jun 21, 2018 12:06:00 AM
Down Time		

Work Order Notes

Line 10 COMPLAINT:pmB

CAUSE:Service

CORRECTION:Perform pmB Service

Oil filter B329 qty1

Engine oil 5w20 qty 7 Qts

Activity Header

Activity:10 999 TOTAL VEHICLE

Activity Note: Light Medium Duty PMI

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
20-Jun-18	Gaspard,Ronald	1.55	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: Light Medium Duty PMI

Task: First Transit Light-Medium Duty PMI Performed by: RGASPARD Performed on: 20-JUN-18

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,000 - SECTION 1 Preparation and Drive On (In Lot) Inspection	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
10,100 - Safety Inspection	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
10,110 - FRA Check Drivers Pre-trip or DVIR/EVIR & Authorization Forms	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
10,120 - FRA Check All Warning Lights and Alarms	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,130 - FRA Check Automatic Transmission Neutral Start Operation	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
10,140 - Check Service Brakes	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
10,150 - FRA Start Engine and Listen for Any Unusual Noises	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
10,160 - FRA Check Instruments and Horns	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
10,170 - Check Fast Idle	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
10,180 - Check Starter Protection Circuit	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
10,190 - Check Reverse Warning System	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
11,100 - Check Parking Brake	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
11,110 - Check HVAC Switches and Other Controls	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
11,120 - FRA Inspect Windshields, Mirror and Sun Visor Condition	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
11,130 - FRA Check Wiper and Washer Operation	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
11,140 - Road Test: Check for Proper Operation	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
11,150 - Perform Brake Test	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
11,152 - Decelerometer Results Test 1	FEET	na	RGASPARD	Jun 20, 2018 11:39:21 PM	No	
11,154 - Decelerometer Results Test 2	FEET	na	RGASPARD	Jun 20, 2018 11:39:21 PM	No	
11,156 - Decelerometer Results Test 3	FEET	na	RGASPARD	Jun 20, 2018 11:39:21 PM	No	
11,161 - FRA Check/Record Oil Pressure / @1500 rpm	Pounds per Square Inch	na	RGASPARD	Jun 20, 2018 11:39:21 PM	No	
11,162 - FRA Check/Record Water Temperature	Degree Fahrenheit	na	RGASPARD	Jun 20, 2018 11:39:21 PM	No	
11,170 - FRA Check Door Operation	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
11,180 - FRA Check Operation of All Other Accessories	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
20,000 - SECTION 2 Interior Circle Inspection	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
20,210 - Check Condition of Operator's Area	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
20,220 - Check Accelerator and Brake Pedals	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
20,230 - FRA Check Wiring Under Dash	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
20,240 - FRA Check Interior Lights	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
20,250 - FRA Check Interior Electrical Panels	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
20,260 - Check Stop Request System	-	na	RGASPARD	Jun 20, 2018 11:39:21 PM	No	
20,270 - Check Fare Box Mounting (If Applicable)	-	na	RGASPARD	Jun 20, 2018 11:39:21 PM	No	
20,280 - Check Seats, Seat Belts, Hand Rails and Floor Covering	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
20,290 - Check for Physical Damage, Water Leaks, and Graffiti	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
22,100 - Check Emergency Windows and Glass Condition	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
22,110 - Check Emergency Hatches	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
22,120 - Check All Safety Equipment	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
30,000 - SECTION 3 Exterior Circle Inspection	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
30,310 - Check Passenger Doors	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
30,320 - Inspect Step-well and Hand Rails	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
30,330 - Check Wheelchair Lift Operation	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
30,340 - FRA Check Destination Sign and Run Box	-	na	RGASPARD	Jun 20, 2018 11:39:21 PM	No	
30,350 - FRA Inspect Mirror and Mountings	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
30,360 - Check for Physical Damage and Decals	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
30,370 - Check Wiper Blade and Arm Condition	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
30,380 - Check Exterior Compartment Doors	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
30,390 - FRA Check Fuel Tank Cap	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
33,100 - Check Lights and Reflectors	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
33,110 - Check License Plate, Permits and State Inspection Decals	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
40,000 - SECTION 4 Engine Compartment Inspection	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
40,410 - FRA Check Engine Compartment/Condition for Fire Risk	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
40,420 - Check Hood	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
40,430 - Check Fan, Shroud and Radiator	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
40,440 - Test Coolant System Using Test Strips and Record Results	-	na	RGASPARD	Jun 20, 2018 11:39:21 PM	No	
40,441 - Inhibitor Test Pass or Fail (Indicate with a Yes or No)	No	na	RGASPARD	Jun 20, 2018 11:39:21 PM	No	
40,442 - Freeze Point	Degree Fahrenheit	na	RGASPARD	Jun 20, 2018 11:39:21 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
40,450 - FRA Check Coolant Recovery System Condition & for Leaks	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
40,460 - Record Antifreeze Protection Level Using Refractometer	-	na	RGASPARD	Jun 20, 2018 11:39:21 PM	No	
40,461 - Refractometer Reading	Degree Fahrenheit	na	RGASPARD	Jun 20, 2018 11:39:21 PM	No	
40,470 - Pressure Test Cooling System and Check for Leaks	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
40,480 - FRA Check Coolant Hose Condition	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
40,490 - FRA Check Alternator Mount and Condition	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
44,100 - FRA Check Fuel Control and Transmission Connections	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
44,110 - FRA Check Master Cylinder Fluid Level	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
44,120 - FRA Check All Belts for Condition, Alignment and Tension	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
44,130 - FRA Check Exhaust System	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
44,140 - FRA Check Intake System	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
44,150 - FRA Inspect Turbocharger	-	na	RGASPARD	Jun 20, 2018 11:39:21 PM	No	
44,160 - FRA Inspect Power Steering and Hydraulic Fluid	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
44,170 - FRA Check All Engine or Belt Driven Components	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
44,180 - FRA Check for Leaks	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
44,190 - FRA Perform Battery Inspection	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
44,200 - FRA Check Battery Box Corrosion, Cables and Hold-Downs	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
50,000 - SECTION 5 Steering System Inspection	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
50,510 - Check Entire Steering System	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
60,000 - SECTION 6 Tires and Wheel Inspection	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
60,610 - FRA Check and Record Air Pressure	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
60,611 - Air Pressure RF	70 Pounds per Square Inch		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
60,612 - Air Pressure LF	70 Pounds per Square Inch		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
60,613 - Air Pressure RRO	65 Pounds per Square Inch		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
60,614 - Air Pressure RRI	65 Pounds per Square Inch		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
60,615 - Air Pressure LRI	65 Pounds per Square Inch		RGASPARD	Jun 20, 2018 11:39:21 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
60,616 - Air Pressure LRO	65 Pounds per Square Inch		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
60,620 - Check Valve Stems and Caps	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
60,630 - Check and Record Tread Depth	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
60,631 - Tread Depth RF	7 32nds of an inch		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
60,632 - Tread Depth LF	8 32nds of an inch		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
60,633 - Tread Depth RRO	7 32nds of an inch		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
60,634 - Tread Depth RRI	8 32nds of an inch		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
60,635 - Tread Depth LRI	10 32nds of an inch		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
60,636 - Tread Depth LRO	10 32nds of an inch		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
60,640 - Check for Mismatched Tread or Casing Design	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
60,650 - Check Sidewall Wear	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
60,660 - Inspect for Cuts and Tears	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
60,670 - Check Dual Mating With Square	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
60,680 - Check Wheels for Cracks and Loose Lugs	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
60,690 - Check Tires for Irregular or Alignment Wear	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
66,100 - FRA Check Outer Hubs for Leaks	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
70,000 - SECTION 7 Under Vehicle Inspection	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
70,710 - Check Vibration Damper	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
70,720 - Check Engine and Transmission Mounts	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
70,730 - FRA Check Starter	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
70,740 - FRA Check Bottom of Engine for Fluid Leaks	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
70,750 - FRA Check Transmission for Leaks	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
70,760 - FRA Check Differential Breather and Fluid	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
70,770 - FRA Check Exhaust System	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
70,780 - Check Driveline, U-joint and Slip Yokes	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
70,790 - Check All Body Mounts and Chassis Frame	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
77,100 - FRA Check Security, Integrity and Length of Ground Straps	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
77,110 - FRA Check Fuel Tank	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
77,120 - Check Suspension Components	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
77,130 - FRA Check Brake Pad Thickness and Rotor for Wear	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
77,131 - Brake Pad Thickness LF	8 Inch		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
77,132 - Brake Pad Thickness RF	8 Inch		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
77,133 - Brake Pad Thickness LR	4 Inch		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
77,134 - Brake Pad Thickness RR	4 Inch		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
77,135 - Brake Rotor LF	38 Inch		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
77,136 - Brake Rotor RF	38 Inch		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
77,137 - Brake Rotor LR	40 Inch		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
77,138 - Brake Rotor RR	40 Inch		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
77,140 - FRA Check Brake Hoses	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
77,150 - Check King Pins	-	na	RGASPARD	Jun 20, 2018 11:39:21 PM	No	
77,160 - FRA Check for Loose or Noisy Wheel Bearings	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
80,000 - SECTION 8 PMI Report Completion	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
80,810 - Completion of PMI Report	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
90,000 - SECTION 9 Completion of PMI	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	
90,910 - Vehicle Returned to predetermined location	Done		RGASPARD	Jun 20, 2018 11:39:21 PM	No	

Activity Sub Total

Activity 10 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	1.55
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 51365408
Invoice No. 55345 - 51365408

Client Department:

Department: 55345M

Work Order Description

PM B

Requested By: RAURODRIGUEZ

Created By: RAURODRIGUEZ

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 112,821 - DH

Activity Header

Activity: 20 999 TOTAL VEHICLE

Activity Note: PM B

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: B PM Level B

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
20-Jun-18	B329(F)	GOING OUT OF SERVICE SEE BALDWIN B329 IN THE FLEET ORG. FILTER, OIL, SPIN-ON	1	1.96	1.96

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
20-Jun-18	Gaspard, Ronald	1.0666666	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List						
20 Desc: PM B						
Task: PM B SERVICE Performed by: RGASPARD Performed on: 20-JUN-18						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
100,000 - "A" PMI SERVICING ITEMS	Done		RGASPARD	Jun 20, 2018 11:40:26 PM	No	
101,000 - FRA Change Oil Filters	Yes		RGASPARD	Jun 20, 2018 11:40:26 PM	No	
102,000 - FRA Drain Engine Oil	Yes		RGASPARD	Jun 20, 2018 11:40:26 PM	No	
103,000 - FRA Check Transmission Fluid	Done		RGASPARD	Jun 20, 2018 11:40:26 PM	No	
104,000 - Lubricate Chassis	-	na	RGASPARD	Jun 20, 2018 11:40:26 PM	No	
105,000 - Replace or Clean A/C Filters	Done		RGASPARD	Jun 20, 2018 11:40:26 PM	No	
107,000 - FRA Change Primary Fuel Filter	No	na	RGASPARD	Jun 20, 2018 11:40:26 PM	No	
108,000 - Lube all pivoting Mechanisms	Done		RGASPARD	Jun 20, 2018 11:40:26 PM	No	
200,000 - "B" PMI SERVICING ITEMS (12	Done		RGASPARD	Jun 20, 2018	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
MONTH)				11:40:26 PM		
201,000 - Service Crankcase Breather	Done		RGASPARD	Jun 20, 2018 11:40:26 PM	No	
203,000 - FRA Change Automatic Transmission Fluid	No		RGASPARD	Jun 20, 2018 11:40:26 PM	No	
204,000 - FRA Change Power Steering Fluid and Filter	No		RGASPARD	Jun 20, 2018 11:40:26 PM	No	
205,000 - Complete Engine Diagnostics and Clear Codes when Completed	Done		RGASPARD	Jun 20, 2018 11:40:26 PM	No	

Activity Sub Total

Activity 20 Sub Total	
Parts:	1.96
Labor:	0.00
Labor Hours:	1.07
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	1.96



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 51365408
Invoice No. 55345 - 51365408

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
PM B		Ford E450 Champion Challenger	
Requested By:	RAURODRIGUEZ	Status:	40 - Closed (40)
Created By:	RAURODRIGUEZ	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	112,821 - DH

Activity Header
Activity:30 999 TOTAL VEHICLE
Activity Note: PRAMETER
Reason for Repair: 05 Inspection, Routine
Work Accomplished: 06 Inspect
Part Failure:
Activity Comments:

Activity Parts
No Data Available

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
20-Jun-18	Gaspard,Ronald	0.25	0	0

Activity Sublet
No Data Available

Activity Checklist						
Check List						
30 Desc: PRAMETER						
Task: PRA and Meter Readings Performed by: RGASPARD Performed on: 20-JUN-18						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		RGASPARD	Jun 20, 2018 11:40:51 PM	No	
20 - Miles			RGASPARD	Jun 20, 2018 11:40:51 PM	No	
30 - Kilometers			RGASPARD	Jun 20, 2018 11:40:51 PM	No	
40 - Hours			RGASPARD	Jun 20, 2018 11:40:51 PM	No	

Activity Sub Total	
Activity 30 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	0.25
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00

Work Order Footer	
Work Order 51365408 Total	
Parts:	1.96
Labor:	0.00
Labor Hours:	2.87

	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	1.96



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 51447076
Invoice No. 55345 - 51447076

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Needs rear brakes job		Ford E450 Champion Challenger	
Requested By:	RGASPARD	Status:	40 - Closed (40)
Created By:	RGASPARD	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	112,821 - DH

Chronology		
Reported	Jun 20, 2018 11:43:52 PM	Jun 20, 2018 11:43:52 PM
Started	Jun 20, 2018 12:00:00 AM	
Completed	Jun 21, 2018 12:05:00 AM	Jun 21, 2018 12:05:00 AM
Down Time		

Work Order Notes

Line 10 To file warranty be sure to do the following:
1) Enter a COMPLAINT statement for each activity.
2) Enter CAUSE statement in the Notes field of each activity.
3) Enter CORRECTION statement in the Comment section of each activity.

=====

Complaint:needs rear brakes job

Cause: wear

Correction:Replaced rear brake pads and lubed guide pins
Torque wheels 140 lbs second torque wheels 140 lbs
Part number BRSD1330 qty1

Activity Header				
Activity:5 999 TOTAL VEHICLE				
Activity Note: Personal Risk Assessment				
Reason for Repair:		05 Inspection, Routine		
Work Accomplished:		06 Inspect		
Part Failure:				
Activity Comments:				
Activity Parts				
No Data Available				
Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
20-Jun-18	Gaspard,Ronald	0.1166666	0	0
Activity Sublet				
No Data Available				
Activity Checklist				
Check List				
5 Desc: Personal Risk Assessment				

Check List						
Task: PRA and Meter Readings Performed by: RGASPARD Performed on: 20-JUN-18						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		RGASPARD	Jun 20, 2018 11:46:37 PM	No	
20 - Miles			RGASPARD	Jun 20, 2018 11:46:37 PM	No	
30 - Kilometers			RGASPARD	Jun 20, 2018 11:46:37 PM	No	
40 - Hours			RGASPARD	Jun 20, 2018 11:46:37 PM	No	
Activity Sub Total						
			Activity 5 Sub Total			
			Parts: 0.00			
			Labor: 0.00			
			Labor Hours: 0.12			
			Sublet Parts: 0.00			
			Sublet Labor: 0.00			
			Activity Sub Total 0.00			



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 51447076
Invoice No. 55345 - 51447076

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Needs rear brakes job		Ford E450 Champion Challenger	
Requested By:	RGASPARD	Status:	40 - Closed (40)
Created By:	RGASPARD	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	112,821 - DH

Activity Header
Activity:15 013/000/000 BRAKES
Activity Note: Needs rear brakes job
Reason for Repair: 39 Natural Causes
Work Accomplished: 03 Replace New
Part Failure: 44 Worn
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
20-Jun-18	BRSD-1330	PADS, BRAKE, DISC, REAR, FORD SAME AS PFH133020	1	43.06	43.06

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
20-Jun-18	Gaspard,Ronald	1.5	0	0

Activity Sublet
No Data Available


Activity Checklist
No Data Available
No Data Available

Activity Sub Total		Activity 15 Sub Total	
Parts:			43.06
Labor:			0.00
Labor Hours:			1.50
Sublet Parts:			0.00
Sublet Labor:			0.00
Activity Sub Total			43.06

Work Order Footer		Work Order 51447076 Total	
Parts:			43.06
Labor:			0.00
Labor Hours:			1.62
Sublet Parts:			0.00
Sublet Labor:			0.00
Activity Sub Total			43.06



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 51372406
Invoice No. 55345 - 51372406

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
55345 HEADLIGHTS			Ford E450 Champion Challenger
Requested By:	EDITORRES	Status:	40 - Closed (40)
Created By:	EDITORRES	Priority:	-
Assigned To:		Driver:	
Class:	-	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	109,159 - DH

Chronology

Reported	May 25, 2018 7:08:53 AM	May 25, 2018 7:08:53 AM
Started	May 25, 2018 12:00:00 AM	
Completed	May 29, 2018 9:09:00 AM	May 29, 2018 9:09:00 AM
Down Time		

Work Order Notes

Line 10 Headlight D

COMPLAINT:

Driver side headlight is out

CAUSE:

Normal wear

CORRECTION:

Replaced driverside headlight bulb.

PARTS:

Under shop supply

Activity Header

Activity:10 999/999/999 TOTAL VEHICLE

Activity Note: PERSONAL RISK ASSESMENT

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure: 00 No Failure

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: PERSONAL RISK ASSESMENT

Task: PRA and Meter Readings Performed by: EDITORRES Performed on: 25-MAY-18

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		EDITORRES	May 25, 2018 7:41:51 AM	No	
20 - Miles			EDITORRES	May 25, 2018	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
				7:41:51 AM		
30 - Kilometers			EDITORRES	May 25, 2018 7:41:51 AM	No	
40 - Hours			EDITORRES	May 25, 2018 7:41:51 AM	No	
Activity Sub Total						
				Activity 10 Sub Total		
				Parts:		0.00
				Labor:		0.00
				Labor Hours:		0.00
				Sublet Parts:		0.00
				Sublet Labor:		0.00
				Activity Sub Total		0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2




Work Order No. 51372406
Invoice No. 55345 - 51372406

Client Department:		Equipment No.:	4514-P
Department:	55345M	VIN:	1FDFE4FS7EDB17176
Work Order Description			Ford E450 Champion Challenger
55345 HEADLIGHTS		Status:	40 - Closed (40)
Requested By:	EDITORRES	Priority:	-
Created By:	EDITORRES	Driver:	
Assigned To:		Phone:	
Class:	-	ETA:	
Arrangement:	Unassigned	Meter:	109,159 - DH
Potential Warranty:	No		

Activity Header				
Activity:20 034/001/000 HEADLAMP				
Activity Note:				
Reason for Repair:		39 Natural Causes		
Work Accomplished:		03 Replace New		
Part Failure:		02 Burned, Scorched, Melted, Blistered		
Activity Comments:				
Activity Parts				
No Data Available				
Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
25-May-18	Torres,Edwin	0.5166666	0	0
Activity Sublet				
No Data Available				
Activity Checklist				
No Data Available				
No Data Available				
Activity Sub Total				
			Activity 20 Sub Total	
			Parts:	0.00
			Labor:	0.00
			Labor Hours:	0.52
			Sublet Parts:	0.00
			Sublet Labor:	0.00
			Activity Sub Total	0.00
Work Order Footer				
			Work Order 51372406 Total	
			Parts:	0.00
			Labor:	0.00
			Labor Hours:	0.52
			Sublet Parts:	0.00
			Sublet Labor:	0.00
			Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 51290765
Invoice No. 55345 - 51290765

Client Department:

Department: 55345M

Work Order Description

PM A

Requested By: RGASPARD

Created By: RGASPARD

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 108,680 - DH

Chronology

Reported	May 22, 2018 10:23:17 AM	May 22, 2018 10:23:17 AM
Started	May 22, 2018 12:00:00 AM	
Completed	May 22, 2018 12:28:00 PM	May 22, 2018 12:28:00 PM
Down Time		

Work Order Notes

Line 10

CAUSE:

PM

CORRECTION:

Perform pmA service, lube front end, tire rotation, torque and re torque tires (140 f/p), R&R engine oil and filter, road test, all okay at this time.

Parts. Engine oil filter part # B329 qty 1

engine oil. 5W20 Qty 6 qts

Drain plug qty 1

Activity Header

Activity: 10 999 TOTAL VEHICLE

Activity Note: Light Medium Duty PMI

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: A PM Level A

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
22-May-18	Rodriguez,Raul	1.45	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: Light Medium Duty PMI

Task: First Transit Light-Medium Duty PMI Performed by: RAURODRIGUEZ Performed on: 22-MAY-18

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,000 - SECTION 1 Preparation and Drive On (In Lot) Inspection	Done		RAURODRIGUEZ	May 22, 2018 12:23:43 PM	No	
10,100 - Safety Inspection	Done		RAURODRIGUEZ	May 22, 2018	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
				12:23:43 PM		
10,110 - FRA Check Drivers Pre-trip or DVIR/EVIR & Authorization Forms	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
10,120 - FRA Check All Warning Lights and Alarms	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
10,130 - FRA Check Automatic Transmission Neutral Start Operation	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
10,140 - Check Service Brakes	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
10,150 - FRA Start Engine and Listen for Any Unusual Noises	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
10,160 - FRA Check Instruments and Horns	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
10,170 - Check Fast Idle	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
10,180 - Check Starter Protection Circuit	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
10,190 - Check Reverse Warning System	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
11,100 - Check Parking Brake	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
11,110 - Check HVAC Switches and Other Controls	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
11,120 - FRA Inspect Windshields, Mirror and Sun Visor Condition	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
11,130 - FRA Check Wiper and Washer Operation	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
11,140 - Road Test: Check for Proper Operation	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
11,150 - Perform Brake Test	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
11,152 - Decelerometer Results Test 1	FEET	na	RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
11,154 - Decelerometer Results Test 2	FEET	na	RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
11,156 - Decelerometer Results Test 3	FEET	na	RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
11,161 - FRA Check/Record Oil Pressure / @1500 rpm	Pounds per Square Inch	na	RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
11,162 - FRA Check/Record Water Temperature	Degree Fahrenheit	na	RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
11,170 - FRA Check Door Operation	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
11,180 - FRA Check Operation of All Other Accessories	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
20,000 - SECTION 2 Interior Circle Inspection	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
20,210 - Check Condition of Operator's Area	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
20,220 - Check Accelerator and Brake Pedals	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
20,230 - FRA Check Wiring Under Dash	Done		RAUODRIGUEZ	May 22, 2018	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
				12:23:43 PM		
20,240 - FRA Check Interior Lights	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
20,250 - FRA Check Interior Electrical Panels	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
20,260 - Check Stop Request System	-	na	RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
20,270 - Check Fare Box Mounting (If Applicable)	-	na	RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
20,280 - Check Seats, Seat Belts, Hand Rails and Floor Covering	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
20,290 - Check for Physical Damage, Water Leaks, and Graffiti	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
22,100 - Check Emergency Windows and Glass Condition	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
22,110 - Check Emergency Hatches	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
22,120 - Check All Safety Equipment	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
30,000 - SECTION 3 Exterior Circle Inspection	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
30,310 - Check Passenger Doors	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
30,320 - Inspect Step-well and Hand Rails	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
30,330 - Check Wheelchair Lift Operation	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
30,340 - FRA Check Destination Sign and Run Box	-	na	RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
30,350 - FRA Inspect Mirror and Mountings	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
30,360 - Check for Physical Damage and Decals	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
30,370 - Check Wiper Blade and Arm Condition	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
30,380 - Check Exterior Compartment Doors	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
30,390 - FRA Check Fuel Tank Cap	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
33,100 - Check Lights and Reflectors	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
33,110 - Check License Plate, Permits and State Inspection Decals	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
40,000 - SECTION 4 Engine Compartment Inspection	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
40,410 - FRA Check Engine Compartment/Condition for Fire Risk	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
40,420 - Check Hood	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
40,430 - Check Fan, Shroud and Radiator	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
40,440 - Test Coolant System Using Test	Done		RAUODRIGUEZ	May 22, 2018	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
Strips and Record Results				12:23:43 PM		
40,441 - Inhibitor Test Pass or Fail (Indicate with a Yes or No)	No	na	RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
40,442 - Freeze Point	Degree Fahrenheit	na	RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
40,450 - FRA Check Coolant Recovery System Condition & for Leaks	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
40,460 - Record Antifreeze Protection Level Using Refractometer	-	na	RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
40,461 - Refractometer Reading	Degree Fahrenheit	na	RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
40,470 - Pressure Test Cooling System and Check for Leaks	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
40,480 - FRA Check Coolant Hose Condition	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
40,490 - FRA Check Alternator Mount and Condition	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
44,100 - FRA Check Fuel Control and Transmission Connections	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
44,110 - FRA Check Master Cylinder Fluid Level	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
44,120 - FRA Check All Belts for Condition, Alignment and Tension	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
44,130 - FRA Check Exhaust System	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
44,140 - FRA Check Intake System	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
44,150 - FRA Inspect Turbocharger	-	na	RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
44,160 - FRA Inspect Power Steering and Hydraulic Fluid	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
44,170 - FRA Check All Engine or Belt Driven Components	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
44,180 - FRA Check for Leaks	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
44,190 - FRA Perform Battery Inspection	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
44,200 - FRA Check Battery Box Corrosion, Cables and Hold-Downs	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
50,000 - SECTION 5 Steering System Inspection	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
50,510 - Check Entire Steering System	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
60,000 - SECTION 6 Tires and Wheel Inspection	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
60,610 - FRA Check and Record Air Pressure	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
60,611 - Air Pressure RF	65 Pounds per Square Inch		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
60,612 - Air Pressure LF	65 Pounds per Square Inch		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
60,613 - Air Pressure RRO	65 Pounds per		RAUODRIGUEZ	May 22, 2018	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
	Square Inch			12:23:43 PM		
60,614 - Air Pressure RRI	65 Pounds per Square Inch		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
60,615 - Air Pressure LRI	65 Pounds per Square Inch		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
60,616 - Air Pressure LRO	65 Pounds per Square Inch		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
60,620 - Check Valve Stems and Caps	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
60,630 - Check and Record Tread Depth	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
60,631 - Tread Depth RF	10 32nds of an inch		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
60,632 - Tread Depth LF	10 32nds of an inch		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
60,633 - Tread Depth RRO	10 32nds of an inch		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
60,634 - Tread Depth RRI	10 32nds of an inch		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
60,635 - Tread Depth LRI	10 32nds of an inch		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
60,636 - Tread Depth LRO	10 32nds of an inch		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
60,640 - Check for Mismatched Tread or Casing Design	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
60,650 - Check Sidewall Wear	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
60,660 - Inspect for Cuts and Tears	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
60,670 - Check Dual Mating With Square	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
60,680 - Check Wheels for Cracks and Loose Lugs	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
60,690 - Check Tires for Irregular or Alignment Wear	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
66,100 - FRA Check Outer Hubs for Leaks	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
70,000 - SECTION 7 Under Vehicle Inspection	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
70,710 - Check Vibration Damper	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
70,720 - Check Engine and Transmission Mounts	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
70,730 - FRA Check Starter	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
70,740 - FRA Check Bottom of Engine for Fluid Leaks	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
70,750 - FRA Check Transmission for Leaks	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
70,760 - FRA Check Differential Breather and Fluid	Done		RAUODRIGUEZ	May 22, 2018 12:23:43 PM	No	
70,770 - FRA Check Exhaust System	Done		RAUODRIGUEZ	May 22, 2018	No	


Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
				12:23:43 PM		
70,780 - Check Driveline, U-joint and Slip Yokes	Done		RAURODRIGUEZ	May 22, 2018 12:23:43 PM	No	
70,790 - Check All Body Mounts and Chassis Frame	Done		RAURODRIGUEZ	May 22, 2018 12:23:43 PM	No	
77,100 - FRA Check Security, Integrity and Length of Ground Straps	Done		RAURODRIGUEZ	May 22, 2018 12:23:43 PM	No	
77,110 - FRA Check Fuel Tank	Done		RAURODRIGUEZ	May 22, 2018 12:23:43 PM	No	
77,120 - Check Suspension Components	Done		RAURODRIGUEZ	May 22, 2018 12:23:43 PM	No	
77,130 - FRA Check Brake Pad Thickness and Rotor for Wear	Done		RAURODRIGUEZ	May 22, 2018 12:23:43 PM	No	
77,131 - Brake Pad Thickness LF	0 Inch	9mm	RAURODRIGUEZ	May 22, 2018 12:23:43 PM	No	
77,132 - Brake Pad Thickness RF	Inch	9mm	RAURODRIGUEZ	May 22, 2018 12:23:43 PM	No	
77,133 - Brake Pad Thickness LR	Inch	6mm	RAURODRIGUEZ	May 22, 2018 12:23:43 PM	No	
77,134 - Brake Pad Thickness RR	Inch	6mm	RAURODRIGUEZ	May 22, 2018 12:23:43 PM	No	
77,135 - Brake Rotor LF	Inch	39.7mm	RAURODRIGUEZ	May 22, 2018 12:23:43 PM	No	
77,136 - Brake Rotor RF	Inch	39.7mm	RAURODRIGUEZ	May 22, 2018 12:23:43 PM	No	
77,137 - Brake Rotor LR	Inch	35.7mm	RAURODRIGUEZ	May 22, 2018 12:23:43 PM	No	
77,138 - Brake Rotor RR	Inch	35.7mm	RAURODRIGUEZ	May 22, 2018 12:23:43 PM	No	
77,140 - FRA Check Brake Hoses	Done		RAURODRIGUEZ	May 22, 2018 12:23:43 PM	No	
77,150 - Check King Pins	-	na	RAURODRIGUEZ	May 22, 2018 12:23:43 PM	No	
77,160 - FRA Check for Loose or Noisy Wheel Bearings	Done		RAURODRIGUEZ	May 22, 2018 12:23:43 PM	No	
80,000 - SECTION 8 PMI Report Completion	Done		RAURODRIGUEZ	May 22, 2018 12:23:43 PM	No	
80,810 - Completion of PMI Report	Done		RAURODRIGUEZ	May 22, 2018 12:23:43 PM	No	
90,000 - SECTION 9 Completion of PMI	Done		RAURODRIGUEZ	May 22, 2018 12:23:43 PM	No	
90,910 - Vehicle Returned to predetermined location	Done		RAURODRIGUEZ	May 22, 2018 12:23:43 PM	No	

Activity Sub Total

Activity 10 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	1.45
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 51290765
Invoice No. 55345 - 51290765

Client Department:

Department: 55345M

Work Order Description

PM A

Requested By: RGASPARD

Created By: RGASPARD

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 108,680 - DH

Activity Header

Activity: 20 999 TOTAL VEHICLE

Activity Note: PM A

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: A PM Level A

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
22-May-18	B329(F)	GOING OUT OF SERVICE SEE BALDWIN B329 IN THE FLEET ORG. FILTER, OIL, SPIN-ON	1	1.96	1.96

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List						
20 Desc: PM A						
Task: PM A SERVICE Performed by: RAURODRIGUEZ Performed on: 22-MAY-18						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
100,000 - "A" PMI SERVICING ITEMS	Done		RAURODRIGUEZ	May 22, 2018 12:27:13 PM	No	
101,000 - FRA Change Oil Filters	Yes		RAURODRIGUEZ	May 22, 2018 12:27:13 PM	No	
102,000 - FRA Drain Engine Oil	Yes		RAURODRIGUEZ	May 22, 2018 12:27:13 PM	No	
103,000 - FRA Check Transmission Fluid	Done		RAURODRIGUEZ	May 22, 2018 12:27:13 PM	No	
104,000 - Lubricate Chassis	Done		RAURODRIGUEZ	May 22, 2018 12:27:13 PM	No	
105,000 - Replace or Clean A/C Filters	Done		RAURODRIGUEZ	May 22, 2018 12:27:13 PM	No	
107,000 - FRA Change Primary Fuel Filter	No	na	RAURODRIGUEZ	May 22, 2018 12:27:13 PM	No	
108,000 - Lube all pivoting Mechanisms	Done		RAURODRIGUEZ	May 22, 2018 12:27:13 PM	No	

Activity Sub Total

Activity 20 Sub Total
Parts: 1.96

	Labor:	0.00
	Labor Hours:	0.00
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	1.96



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 51290765
Invoice No. 55345 - 51290765

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FD4E4FS7EDB17176
PM A		Ford E450 Champion Challenger	
Requested By:	RGASPARD	Status:	40 - Closed (40)
Created By:	RGASPARD	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	108,680 - DH

Activity Header
Activity:30 999 TOTAL VEHICLE
Activity Note: PRAMETER
Reason for Repair: 05 Inspection, Routine
Work Accomplished: 06 Inspect
Part Failure:
Activity Comments:

Activity Parts
No Data Available

Activity Labor
No Data Available

Activity Sublet
No Data Available

Check List						
30 Desc: PRAMETER						
Task: PRA and Meter Readings Performed by: RAURODRIGUEZ Performed on: 22-MAY-18						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		RAURODRIGUEZ	May 22, 2018 12:27:55 PM	No	
20 - Miles			RAURODRIGUEZ	May 22, 2018 12:27:55 PM	No	
30 - Kilometers			RAURODRIGUEZ	May 22, 2018 12:27:55 PM	No	
40 - Hours			RAURODRIGUEZ	May 22, 2018 12:27:55 PM	No	


Activity Sub Total		Activity 30 Sub Total	
		Parts:	0.00
		Labor:	0.00
		Labor Hours:	0.00
		Sublet Parts:	0.00
		Sublet Labor:	0.00
		Activity Sub Total	0.00

Work Order Footer		Work Order 51290765 Total	
		Parts:	1.96
		Labor:	0.00
		Labor Hours:	1.45
		Sublet Parts:	0.00
		Sublet Labor:	0.00

	Activity Sub Total	1.96
--	---------------------------	-------------



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 1



Work Order No. 51120881
Invoice No. 55345 - 51120881

Client Department:

Department: 55345M

Work Order Description

FTLM PMI_FOLLOWUP

Requested By: AOWENS

Created By: AOWENS

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 99 - Cancelled (99)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 99,814 - DH

Chronology

Reported	Mar 23, 2018 8:39:17 PM	Mar 23, 2018 8:39:17 PM
Started		
Completed	May 1, 2018 11:14:15 AM	May 1, 2018 11:14:15 AM
Down Time		

Work Order Notes

Activity Header

Activity: 10 017 TIRES, TUBES, LINERS & VALVES

Activity Note: Rear Tires

Reason for Repair:

Work Accomplished:

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

No Data Available

No Data Available

Activity Sub Total

Activity 10 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00

Work Order Footer

Work Order 51120881 Total

Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 51290700
Invoice No. 55345 - 51290700

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Vehicle pull Right when Braking		Ford E450 Champion Challenger	
Requested By:	DARTHURS	Status:	40 - Closed (40)
Created By:	DARTHURS	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	104,442 - DH

Chronology		
Reported	Apr 25, 2018 11:39:35 PM	Apr 25, 2018 11:39:35 PM
Started	Apr 26, 2018 12:00:00 AM	
Completed	Apr 26, 2018 12:31:00 AM	Apr 26, 2018 12:31:00 AM
Down Time		

Work Order Notes

- Line 10 To file warranty be sure to do the following:
- 1) Enter a COMPLAINT statement for each activity.
 - 2) Enter CAUSE statement in the Notes field of each activity.
 - 3) Enter CORRECTION statement in the Comment section of each activity.
- =====

Complaint: vehicle Pull to Right When braking

Cause: Pads uneven wear& Low .both front Rotor glaze

Correction: Remove& Replace Both Front Rotor. replace both Side inner & Outer wheel Bearing & Seal
Parts#BRRF-115 Qty (2)
Parts#CR240000 Qty(2)
Parts# TMLM102949 Qty (2)
Parts# TM15101 Qty (2)
Parts# 1328 Qty (1)

Activity Header	
Activity: 5 999 TOTAL VEHICLE	
Activity Note: Personal Risk Assessment	
Reason for Repair:	05 Inspection, Routine
Work Accomplished:	06 Inspect
Part Failure:	
Activity Comments:	
Activity Parts	
No Data Available	
Activity Labor	

Booked Date	Technician	Hours	Shop Rate	Extended
26-Apr-18	Arthurs,Durvin	0.0833333	0	0

Activity Sublet
No Data Available

Activity Checklist

Check List						
5 Desc: Personal Risk Assessment Task: PRA and Meter Readings Performed by: DARTHURS Performed on: 26-APR-18						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		DARTHURS	Apr 26, 2018 12:31:09 AM	No	
20 - Miles			DARTHURS	Apr 26, 2018 12:31:09 AM	No	
30 - Kilometers			DARTHURS	Apr 26, 2018 12:31:09 AM	No	
40 - Hours			DARTHURS	Apr 26, 2018 12:31:09 AM	No	

Activity Sub Total

Activity 5 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	0.08
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 51290700
Invoice No. 55345 - 51290700

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Vehicle pull Right when Braking		Ford E450 Champion Challenger	
Requested By:	DARTHURS	Status:	40 - Closed (40)
Created By:	DARTHURS	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	104,442 - DH

Activity Header
Activity: 15 079 DEVICES, SAFETY/STABILITY, TRAILER
Activity Note: Remove Replace both Front Rotor& wheel bearing & Seal/ fraont pads
Reason for Repair: 05 Inspection, Routine
Work Accomplished:
Part Failure:
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
26-Apr-18	CR24000	SEAL, WHEEL, HUB, FRONT	2	7.76	15.52
26-Apr-18	TM15101	BEARING, WHEEL, OUTER, CONE, ROLLER, TAPERED	2	8.16	16.32
26-Apr-18	BRRF115	ROTOR & HUB, BRAKE, DISC, FRONT, E350	2	110	220
26-Apr-18	TMLM102949	BEARING, DIFFERENTIAL, CONE, ROLLER, TAPERED	2	6.95	13.9
26-Apr-18	BRSD-1328	PADS, BRAKE, DISC, FRONT	1	51.81	51.81

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
26-Apr-18	Arthurs,Durvin	2	0	0

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available

Activity Sub Total	
Activity 15 Sub Total	
Parts:	317.55
Labor:	0.00
Labor Hours:	2.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	317.55

Work Order Footer	
Work Order 51290700 Total	
Parts:	317.55
Labor:	0.00
Labor Hours:	2.08
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	317.55



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 51132389
Invoice No. 55345 - 51132389

Client Department:

Department: 55345M

Work Order Description

PM A

Requested By: DKNOTT

Created By: DKNOTT

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 104,442 - DH

Chronology

Reported	Apr 25, 2018 12:55:57 PM	Apr 25, 2018 12:55:57 PM
Started	Apr 25, 2018 12:00:00 AM	
Completed	Apr 26, 2018 12:03:00 AM	Apr 26, 2018 12:03:00 AM
Down Time		

Work Order Notes

Line 10 COMPLAINT:pmA

CAUSE:Service

CORRECTION:Perform pmA Service

Oil filter B329 qty1

Engine oil 5 w20 qty 7 Qts

Activity Header

Activity:10 999 TOTAL VEHICLE

Activity Note: Light Medium Duty PMI

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: A PM Level A

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
25-Apr-18	Gaspard,Ronald	1.5333333	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: Light Medium Duty PMI

Task: First Transit Light-Medium Duty PMI Performed by: RGASPARD Performed on: 25-APR-18

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,000 - SECTION 1 Preparation and Drive On (In Lot) Inspection	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
10,100 - Safety Inspection	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
10,110 - FRA Check Drivers Pre-trip or DVIR/EVIR & Authorization Forms	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
10,120 - FRA Check All Warning Lights and Alarms	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,130 - FRA Check Automatic Transmission Neutral Start Operation	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
10,140 - Check Service Brakes	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
10,150 - FRA Start Engine and Listen for Any Unusual Noises	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
10,160 - FRA Check Instruments and Horns	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
10,170 - Check Fast Idle	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
10,180 - Check Starter Protection Circuit	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
10,190 - Check Reverse Warning System	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
11,100 - Check Parking Brake	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
11,110 - Check HVAC Switches and Other Controls	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
11,120 - FRA Inspect Windshields, Mirror and Sun Visor Condition	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
11,130 - FRA Check Wiper and Washer Operation	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
11,140 - Road Test: Check for Proper Operation	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
11,150 - Perform Brake Test	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
11,152 - Decelerometer Results Test 1	FEET	NA	RGASPARD	Apr 25, 2018 11:44:22 PM	No	
11,154 - Decelerometer Results Test 2	FEET	NA	RGASPARD	Apr 25, 2018 11:44:22 PM	No	
11,156 - Decelerometer Results Test 3	FEET	NA	RGASPARD	Apr 25, 2018 11:44:22 PM	No	
11,161 - FRA Check/Record Oil Pressure / @1500 rpm	Pounds per Square Inch	NA	RGASPARD	Apr 25, 2018 11:44:22 PM	No	
11,162 - FRA Check/Record Water Temperature	Degree Fahrenheit	NA	RGASPARD	Apr 25, 2018 11:44:22 PM	No	
11,170 - FRA Check Door Operation	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
11,180 - FRA Check Operation of All Other Accessories	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
20,000 - SECTION 2 Interior Circle Inspection	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
20,210 - Check Condition of Operator's Area	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
20,220 - Check Accelerator and Brake Pedals	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
20,230 - FRA Check Wiring Under Dash	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
20,240 - FRA Check Interior Lights	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
20,250 - FRA Check Interior Electrical Panels	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
20,260 - Check Stop Request System	-	NA	RGASPARD	Apr 25, 2018 11:44:22 PM	No	
20,270 - Check Fare Box Mounting (If Applicable)	-	NA	RGASPARD	Apr 25, 2018 11:44:22 PM	No	
20,280 - Check Seats, Seat Belts, Hand Rails and Floor Covering	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
20,290 - Check for Physical Damage, Water Leaks, and Graffiti	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
22,100 - Check Emergency Windows and Glass Condition	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
22,110 - Check Emergency Hatches	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
22,120 - Check All Safety Equipment	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
30,000 - SECTION 3 Exterior Circle Inspection	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
30,310 - Check Passenger Doors	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
30,320 - Inspect Step-well and Hand Rails	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
30,330 - Check Wheelchair Lift Operation	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
30,340 - FRA Check Destination Sign and Run Box	-	NA	RGASPARD	Apr 25, 2018 11:44:22 PM	No	
30,350 - FRA Inspect Mirror and Mountings	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
30,360 - Check for Physical Damage and Decals	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
30,370 - Check Wiper Blade and Arm Condition	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
30,380 - Check Exterior Compartment Doors	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
30,390 - FRA Check Fuel Tank Cap	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
33,100 - Check Lights and Reflectors	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
33,110 - Check License Plate, Permits and State Inspection Decals	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
40,000 - SECTION 4 Engine Compartment Inspection	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
40,410 - FRA Check Engine Compartment/Condition for Fire Risk	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
40,420 - Check Hood	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
40,430 - Check Fan, Shroud and Radiator	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
40,440 - Test Coolant System Using Test Strips and Record Results	-	NA	RGASPARD	Apr 25, 2018 11:44:22 PM	No	
40,441 - Inhibitor Test Pass or Fail (Indicate with a Yes or No)	No	NA	RGASPARD	Apr 25, 2018 11:44:22 PM	No	
40,442 - Freeze Point	Degree Fahrenheit	NA	RGASPARD	Apr 25, 2018 11:44:22 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
40,450 - FRA Check Coolant Recovery System Condition & for Leaks	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
40,460 - Record Antifreeze Protection Level Using Refractometer	-	NA	RGASPARD	Apr 25, 2018 11:44:22 PM	No	
40,461 - Refractometer Reading	Degree Fahrenheit	NA	RGASPARD	Apr 25, 2018 11:44:22 PM	No	
40,470 - Pressure Test Cooling System and Check for Leaks	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
40,480 - FRA Check Coolant Hose Condition	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
40,490 - FRA Check Alternator Mount and Condition	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
44,100 - FRA Check Fuel Control and Transmission Connections	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
44,110 - FRA Check Master Cylinder Fluid Level	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
44,120 - FRA Check All Belts for Condition, Alignment and Tension	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
44,130 - FRA Check Exhaust System	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
44,140 - FRA Check Intake System	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
44,150 - FRA Inspect Turbocharger	-	NA	RGASPARD	Apr 25, 2018 11:44:22 PM	No	
44,160 - FRA Inspect Power Steering and Hydraulic Fluid	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
44,170 - FRA Check All Engine or Belt Driven Components	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
44,180 - FRA Check for Leaks	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
44,190 - FRA Perform Battery Inspection	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
44,200 - FRA Check Battery Box Corrosion, Cables and Hold-Downs	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
50,000 - SECTION 5 Steering System Inspection	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
50,510 - Check Entire Steering System	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
60,000 - SECTION 6 Tires and Wheel Inspection	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
60,610 - FRA Check and Record Air Pressure	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
60,611 - Air Pressure RF	70 Pounds per Square Inch		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
60,612 - Air Pressure LF	70 Pounds per Square Inch		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
60,613 - Air Pressure RRO	65 Pounds per Square Inch		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
60,614 - Air Pressure RRI	65 Pounds per Square Inch		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
60,615 - Air Pressure LRI	65 Pounds per Square Inch		RGASPARD	Apr 25, 2018 11:44:22 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
60,616 - Air Pressure LRO	65 Pounds per Square Inch		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
60,620 - Check Valve Stems and Caps	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
60,630 - Check and Record Tread Depth	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
60,631 - Tread Depth RF	10 32nds of an inch		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
60,632 - Tread Depth LF	11 32nds of an inch		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
60,633 - Tread Depth RRO	10 32nds of an inch		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
60,634 - Tread Depth RRI	10 32nds of an inch		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
60,635 - Tread Depth LRI	11 32nds of an inch		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
60,636 - Tread Depth LRO	11 32nds of an inch		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
60,640 - Check for Mismatched Tread or Casing Design	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
60,650 - Check Sidewall Wear	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
60,660 - Inspect for Cuts and Tears	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
60,670 - Check Dual Mating With Square	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
60,680 - Check Wheels for Cracks and Loose Lugs	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
60,690 - Check Tires for Irregular or Alignment Wear	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
66,100 - FRA Check Outer Hubs for Leaks	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
70,000 - SECTION 7 Under Vehicle Inspection	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
70,710 - Check Vibration Damper	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
70,720 - Check Engine and Transmission Mounts	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
70,730 - FRA Check Starter	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
70,740 - FRA Check Bottom of Engine for Fluid Leaks	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
70,750 - FRA Check Transmission for Leaks	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
70,760 - FRA Check Differential Breather and Fluid	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
70,770 - FRA Check Exhaust System	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
70,780 - Check Driveline, U-joint and Slip Yokes	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
70,790 - Check All Body Mounts and Chassis Frame	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
77,100 - FRA Check Security, Integrity and Length of Ground Straps	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
77,110 - FRA Check Fuel Tank	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
77,120 - Check Suspension Components	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
77,130 - FRA Check Brake Pad Thickness and Rotor for Wear	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
77,131 - Brake Pad Thickness LF	6 Inch		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
77,132 - Brake Pad Thickness RF	6 Inch		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
77,133 - Brake Pad Thickness LR	8 Inch		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
77,134 - Brake Pad Thickness RR	8 Inch		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
77,135 - Brake Rotor LF	38 Inch		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
77,136 - Brake Rotor RF	38 Inch		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
77,137 - Brake Rotor LR	40 Inch		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
77,138 - Brake Rotor RR	40 Inch		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
77,140 - FRA Check Brake Hoses	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
77,150 - Check King Pins	-	NA	RGASPARD	Apr 25, 2018 11:44:22 PM	No	
77,160 - FRA Check for Loose or Noisy Wheel Bearings	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
80,000 - SECTION 8 PMI Report Completion	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
80,810 - Completion of PMI Report	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
90,000 - SECTION 9 Completion of PMI	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	
90,910 - Vehicle Returned to predetermined location	Done		RGASPARD	Apr 25, 2018 11:44:22 PM	No	

Activity Sub Total

Activity 10 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	1.53
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 51132389
Invoice No. 55345 - 51132389

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FD4E4FS7EDB17176
PM A		Ford E450 Champion Challenger	
Requested By:	DKNOTT	Status:	40 - Closed (40)
Created By:	DKNOTT	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	104,442 - DH

Activity Header
Activity:20 999 TOTAL VEHICLE
Activity Note: PM A
Reason for Repair: 08 Preventive Maintenance
Work Accomplished: A PM Level A
Part Failure:
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
25-Apr-18	B329	FILTER, OIL, SPIN-ON SEE P550965	1	1.96	1.96

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
25-Apr-18	Gaspard,Ronald	1.05	0	0

Activity Sublet
No Data Available

Activity Checklist						
Check List						
20 Desc: PM A						
Task: PM A SERVICE Performed by: RGASPARD Performed on: 25-APR-18						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
100,000 - "A" PMI SERVICING ITEMS	Done		RGASPARD	Apr 25, 2018 11:45:07 PM	No	
101,000 - FRA Change Oil Filters	Yes		RGASPARD	Apr 25, 2018 11:45:07 PM	No	
102,000 - FRA Drain Engine Oil	Yes		RGASPARD	Apr 25, 2018 11:45:07 PM	No	
103,000 - FRA Check Transmission Fluid	Done		RGASPARD	Apr 25, 2018 11:45:07 PM	No	
104,000 - Lubricate Chassis	-	NA	RGASPARD	Apr 25, 2018 11:45:07 PM	No	
105,000 - Replace or Clean A/C Filters	Done		RGASPARD	Apr 25, 2018 11:45:07 PM	No	
107,000 - FRA Change Primary Fuel Filter	No	NA	RGASPARD	Apr 25, 2018 11:45:07 PM	No	
108,000 - Lube all pivoting Mechanisms	Done		RGASPARD	Apr 25, 2018 11:45:07 PM	No	

Activity Sub Total	Activity 20 Sub Total
--------------------	-----------------------

	Parts:	1.96
	Labor:	0.00
	Labor Hours:	1.05
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	1.96



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 51132389
Invoice No. 55345 - 51132389

Client Department:

Department: 55345M

Work Order Description

PM A

Requested By: DKNOTT

Created By: DKNOTT

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 104,442 - DH

Activity Header

Activity: 30 999 TOTAL VEHICLE

Activity Note: PRAMETER

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
25-Apr-18	Gaspard,Ronald	0.25	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

30 Desc: PRAMETER

Task: PRA and Meter Readings Performed by: RGASPARD Performed on: 25-APR-18

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		RGASPARD	Apr 25, 2018 11:45:31 PM	No	
20 - Miles			RGASPARD	Apr 25, 2018 11:45:31 PM	No	
30 - Kilometers			RGASPARD	Apr 25, 2018 11:45:31 PM	No	
40 - Hours			RGASPARD	Apr 25, 2018 11:45:31 PM	No	

Activity Sub Total

Activity 30 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	0.25
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00

Work Order Footer


Work Order 51132389 Total

Parts:	1.96
Labor:	0.00
Labor Hours:	2.83

	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	1.96



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 51120666
Invoice No. 55345 - 51120666

Client Department:

Department: 55345M

Work Order Description

PMC_FollowUp_Rear Tires

Requested By: TDELVA

Created By: TDELVA

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 99,814 - DH

Chronology

Reported	Mar 23, 2018 7:13:02 PM	Mar 23, 2018 7:13:02 PM
Started	Mar 23, 2018 12:00:00 AM	
Completed	Mar 26, 2018 2:35:25 PM	Mar 26, 2018 2:35:25 PM
Down Time		

Work Order Notes

Line 10 To file warranty be sure to do the following:

- 1) Enter a COMPLAINT statement for each activity.
- 2) Enter CAUSE statement in the Notes field of each activity.
- 3) Enter CORRECTION statement in the Comment section of each activity.

=====

Complaint: PMC_FollowUp_Rear Tires

Cause: Tires below expect...

Correction: Dismounted and Mounted four Rear Tires

Part Used #189752. Qty:4

Activity Header

Activity:5 999 TOTAL VEHICLE

Activity Note: Personal Risk Assessment

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
23-Mar-18	Delva, Terry	0.7666666	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: Personal Risk Assessment


Task: PRA and Meter Readings Performed by: TDELVA Performed on: 23-MAR-18

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		TDELVA	Mar 23, 2018 7:18:56 PM	No	
20 - Miles			TDELVA	Mar 23, 2018	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
				7:18:56 PM		
30 - Kilometers			TDELVA	Mar 23, 2018 7:18:56 PM	No	
40 - Hours			TDELVA	Mar 23, 2018 7:18:56 PM	No	
Activity Sub Total						
				Activity 5 Sub Total		
				Parts:		0.00
				Labor:		0.00
				Labor Hours:		0.77
				Sublet Parts:		0.00
				Sublet Labor:		0.00
				Activity Sub Total		0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 51120666
Invoice No. 55345 - 51120666

Client Department:

Department: 55345M

Work Order Description

PMC_FollowUp_Rear Tires

Requested By: TDELVA

Created By: TDELVA

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 99,814 - DH

Activity Header

Activity: 15 017/001/000 TIRE, PNEUMATIC

Activity Note: PMC_FollowUp_Rear Tires

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 03 Replace New

Part Failure: 44 Worn

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
23-Mar-18	189752	TIRE, LT225/75R16, TLBLPS115RE, TRANSFORCE HT 10PLY 1622575E, NEW	4	103.44	413.76

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
23-Mar-18	Delva,Terry	2	0	0

Activity Sublet

No Data Available

Activity Checklist

No Data Available

No Data Available

Activity Sub Total


Activity 15 Sub Total	
Parts:	413.76
Labor:	0.00
Labor Hours:	2.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	413.76

Work Order Footer

Work Order 51120666 Total	
Parts:	413.76
Labor:	0.00
Labor Hours:	2.77
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	413.76



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 51054617
Invoice No. 55345 - 51054617

Client Department:

Department: 55345M

Work Order Description

PM C

Requested By: CVERGARA

Created By: CVERGARA

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 100,008 - DH

Chronology

Reported	Mar 23, 2018 11:28:27 AM	Mar 23, 2018 11:28:27 AM
Started	Mar 23, 2018 12:00:00 AM	
Completed	Mar 26, 2018 2:34:34 PM	Mar 26, 2018 2:34:34 PM
Down Time		

Work Order Notes

Line 10 COMPLAINTS: PM C

CAUSE: PM C Service due

CORRECTION: Performed and Completed PM C..

Changed engine oil and replaced engine oil filter

Changed transmission fluid and replaced transmission filter

Part used #B329F. Qty:1

#20021. Qty:1

Activity Header

Activity:10 999 TOTAL VEHICLE

Activity Note: Light Medium Duty PMI

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
23-Mar-18	B329	FILTER, OIL, SPIN-ON SEE P550965	1	1.96	1.96
23-Mar-18	20021	FILTER, TRANSMISSION 20021	1	17.24	17.24

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
23-Mar-18	Delva,Terry	3	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: Light Medium Duty PMI

Task: First Transit Light-Medium Duty PMI Performed by: TDELVA Performed on: 23-MAR-18

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,000 - SECTION 1 Preparation and Drive On (In Lot) Inspection	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
10,100 - Safety Inspection	Done		TDELVA	Mar 23, 2018	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
				7:04:32 PM		
10,110 - FRA Check Drivers Pre-trip or DVIR/EVIR & Authorization Forms	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
10,120 - FRA Check All Warning Lights and Alarms	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
10,130 - FRA Check Automatic Transmission Neutral Start Operation	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
10,140 - Check Service Brakes	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
10,150 - FRA Start Engine and Listen for Any Unusual Noises	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
10,160 - FRA Check Instruments and Horns	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
10,170 - Check Fast Idle	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
10,180 - Check Starter Protection Circuit	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
10,190 - Check Reverse Warning System	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
11,100 - Check Parking Brake	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
11,110 - Check HVAC Switches and Other Controls	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
11,120 - FRA Inspect Windshields, Mirror and Sun Visor Condition	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
11,130 - FRA Check Wiper and Washer Operation	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
11,140 - Road Test: Check for Proper Operation	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
11,150 - Perform Brake Test	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
11,152 - Decelerometer Results Test 1	FEET	n/a	TDELVA	Mar 23, 2018 7:04:32 PM	No	
11,154 - Decelerometer Results Test 2	FEET	n/a	TDELVA	Mar 23, 2018 7:04:32 PM	No	
11,156 - Decelerometer Results Test 3	FEET	n/a	TDELVA	Mar 23, 2018 7:04:32 PM	No	
11,161 - FRA Check/Record Oil Pressure / @1500 rpm	Pounds per Square Inch	n/a	TDELVA	Mar 23, 2018 7:04:32 PM	No	
11,162 - FRA Check/Record Water Temperature	Degree Fahrenheit	n/a	TDELVA	Mar 23, 2018 7:04:32 PM	No	
11,170 - FRA Check Door Operation	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
11,180 - FRA Check Operation of All Other Accessories	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
20,000 - SECTION 2 Interior Circle Inspection	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
20,210 - Check Condition of Operator's Area	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
20,220 - Check Accelerator and Brake Pedals	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
20,230 - FRA Check Wiring Under Dash	Done		TDELVA	Mar 23, 2018	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
				7:04:32 PM		
20,240 - FRA Check Interior Lights	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
20,250 - FRA Check Interior Electrical Panels	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
20,260 - Check Stop Request System	-	n/a	TDELVA	Mar 23, 2018 7:04:32 PM	No	
20,270 - Check Fare Box Mounting (If Applicable)	-	n/a	TDELVA	Mar 23, 2018 7:04:32 PM	No	
20,280 - Check Seats, Seat Belts, Hand Rails and Floor Covering	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
20,290 - Check for Physical Damage, Water Leaks, and Graffiti	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
22,100 - Check Emergency Windows and Glass Condition	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
22,110 - Check Emergency Hatches	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
22,120 - Check All Safety Equipment	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
30,000 - SECTION 3 Exterior Circle Inspection	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
30,310 - Check Passenger Doors	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
30,320 - Inspect Step-well and Hand Rails	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
30,330 - Check Wheelchair Lift Operation	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
30,340 - FRA Check Destination Sign and Run Box	-	n/a	TDELVA	Mar 23, 2018 7:04:32 PM	No	
30,350 - FRA Inspect Mirror and Mountings	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
30,360 - Check for Physical Damage and Decals	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
30,370 - Check Wiper Blade and Arm Condition	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
30,380 - Check Exterior Compartment Doors	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
30,390 - FRA Check Fuel Tank Cap	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
33,100 - Check Lights and Reflectors	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
33,110 - Check License Plate, Permits and State Inspection Decals	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
40,000 - SECTION 4 Engine Compartment Inspection	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
40,410 - FRA Check Engine Compartment/Condition for Fire Risk	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
40,420 - Check Hood	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
40,430 - Check Fan, Shroud and Radiator	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
40,440 - Test Coolant System Using Test Strips	-	n/a	TDELVA	Mar 23, 2018	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
and Record Results				7:04:32 PM		
40,441 - Inhibitor Test Pass or Fail (Indicate with a Yes or No)	No	n/a	TDELVA	Mar 23, 2018 7:04:32 PM	No	
40,442 - Freeze Point	Degree Fahrenheit	n/a	TDELVA	Mar 23, 2018 7:04:32 PM	No	
40,450 - FRA Check Coolant Recovery System Condition & for Leaks	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
40,460 - Record Antifreeze Protection Level Using Refractometer	-	n/a	TDELVA	Mar 23, 2018 7:04:32 PM	No	
40,461 - Refractometer Reading	Degree Fahrenheit	n/a	TDELVA	Mar 23, 2018 7:04:32 PM	No	
40,470 - Pressure Test Cooling System and Check for Leaks	-	n/a	TDELVA	Mar 23, 2018 7:04:32 PM	No	
40,480 - FRA Check Coolant Hose Condition	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
40,490 - FRA Check Alternator Mount and Condition	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
44,100 - FRA Check Fuel Control and Transmission Connections	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
44,110 - FRA Check Master Cylinder Fluid Level	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
44,120 - FRA Check All Belts for Condition, Alignment and Tension	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
44,130 - FRA Check Exhaust System	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
44,140 - FRA Check Intake System	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
44,150 - FRA Inspect Turbocharger	-	n/a	TDELVA	Mar 23, 2018 7:04:32 PM	No	
44,160 - FRA Inspect Power Steering and Hydraulic Fluid	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
44,170 - FRA Check All Engine or Belt Driven Components	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
44,180 - FRA Check for Leaks	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
44,190 - FRA Perform Battery Inspection	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
44,200 - FRA Check Battery Box Corrosion, Cables and Hold-Downs	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
50,000 - SECTION 5 Steering System Inspection	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
50,510 - Check Entire Steering System	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
60,000 - SECTION 6 Tires and Wheel Inspection	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
60,610 - FRA Check and Record Air Pressure	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
60,611 - Air Pressure RF	65 Pounds per Square Inch		TDELVA	Mar 23, 2018 7:04:32 PM	No	
60,612 - Air Pressure LF	65 Pounds per Square Inch		TDELVA	Mar 23, 2018 7:04:32 PM	No	
60,613 - Air Pressure RRO	65 Pounds per		TDELVA	Mar 23, 2018	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
	Square Inch			7:04:32 PM		
60,614 - Air Pressure RRI	65 Pounds per Square Inch		TDELVA	Mar 23, 2018 7:04:32 PM	No	
60,615 - Air Pressure LRI	65 Pounds per Square Inch		TDELVA	Mar 23, 2018 7:04:32 PM	No	
60,616 - Air Pressure LRO	65 Pounds per Square Inch		TDELVA	Mar 23, 2018 7:04:32 PM	No	
60,620 - Check Valve Stems and Caps	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
60,630 - Check and Record Tread Depth	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
60,631 - Tread Depth RF	14 32nds of an inch		TDELVA	Mar 23, 2018 7:04:32 PM	No	
60,632 - Tread Depth LF	14 32nds of an inch		TDELVA	Mar 23, 2018 7:04:32 PM	No	
60,633 - Tread Depth RRO	4 32nds of an inch	Rear Tires	TDELVA	Mar 23, 2018 7:04:32 PM	Yes	51120881
60,634 - Tread Depth RRI	5 32nds of an inch		TDELVA	Mar 23, 2018 7:04:32 PM	No	
60,635 - Tread Depth LRI	4 32nds of an inch		TDELVA	Mar 23, 2018 7:04:32 PM	No	
60,636 - Tread Depth LRO	4 32nds of an inch		TDELVA	Mar 23, 2018 7:04:32 PM	No	
60,640 - Check for Mismatched Tread or Casing Design	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
60,650 - Check Sidewall Wear	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
60,660 - Inspect for Cuts and Tears	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
60,670 - Check Dual Mating With Square	-	n/a	TDELVA	Mar 23, 2018 7:04:32 PM	No	
60,680 - Check Wheels for Cracks and Loose Lugs	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
60,690 - Check Tires for Irregular or Alignment Wear	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
66,100 - FRA Check Outer Hubs for Leaks	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
70,000 - SECTION 7 Under Vehicle Inspection	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
70,710 - Check Vibration Damper	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
70,720 - Check Engine and Transmission Mounts	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
70,730 - FRA Check Starter	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
70,740 - FRA Check Bottom of Engine for Fluid Leaks	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
70,750 - FRA Check Transmission for Leaks	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
70,760 - FRA Check Differential Breather and Fluid	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
70,770 - FRA Check Exhaust System	Done		TDELVA	Mar 23, 2018	No	


Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
				7:04:32 PM		
70,780 - Check Driveline, U-joint and Slip Yokes	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
70,790 - Check All Body Mounts and Chassis Frame	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
77,100 - FRA Check Security, Integrity and Length of Ground Straps	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
77,110 - FRA Check Fuel Tank	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
77,120 - Check Suspension Components	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
77,130 - FRA Check Brake Pad Thickness and Rotor for Wear	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
77,131 - Brake Pad Thickness LF	6 Inch		TDELVA	Mar 23, 2018 7:04:32 PM	No	
77,132 - Brake Pad Thickness RF	6 Inch		TDELVA	Mar 23, 2018 7:04:32 PM	No	
77,133 - Brake Pad Thickness LR	10 Inch		TDELVA	Mar 23, 2018 7:04:32 PM	No	
77,134 - Brake Pad Thickness RR	10 Inch		TDELVA	Mar 23, 2018 7:04:32 PM	No	
77,135 - Brake Rotor LF	39.5 Inch		TDELVA	Mar 23, 2018 7:04:32 PM	No	
77,136 - Brake Rotor RF	39.5 Inch		TDELVA	Mar 23, 2018 7:04:32 PM	No	
77,137 - Brake Rotor LR	1.66 Inch		TDELVA	Mar 23, 2018 7:04:32 PM	No	
77,138 - Brake Rotor RR	1.66 Inch		TDELVA	Mar 23, 2018 7:04:32 PM	No	
77,140 - FRA Check Brake Hoses	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
77,150 - Check King Pins	-	n/a	TDELVA	Mar 23, 2018 7:04:32 PM	No	
77,160 - FRA Check for Loose or Noisy Wheel Bearings	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
80,000 - SECTION 8 PMI Report Completion	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
80,810 - Completion of PMI Report	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
90,000 - SECTION 9 Completion of PMI	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	
90,910 - Vehicle Returned to predetermined location	Done		TDELVA	Mar 23, 2018 7:04:32 PM	No	

Activity Sub Total

Activity 10 Sub Total	
Parts:	19.20
Labor:	0.00
Labor Hours:	3.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	19.20



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 51054617
Invoice No. 55345 - 51054617

Client Department:

Department: 55345M

Work Order Description

PM C

Requested By: CVERGARA

Created By: CVERGARA

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 100,008 - DH

Activity Header

Activity: 20 999 TOTAL VEHICLE

Activity Note: PM C

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: C PM Level C

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
23-Mar-18	Delva, Terry	1	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

20 Desc: PM C

Task: PM C SERVICE Performed by: TDELVA Performed on: 23-MAR-18

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
100,000 - "A" PMI SERVICING ITEMS	Done		TDELVA	Mar 23, 2018 7:05:54 PM	No	
101,000 - FRA Change Oil Filters	Yes		TDELVA	Mar 23, 2018 7:05:54 PM	No	
102,000 - FRA Drain Engine Oil	Yes		TDELVA	Mar 23, 2018 7:05:54 PM	No	
103,000 - FRA Check Transmission Fluid	Done		TDELVA	Mar 23, 2018 7:05:54 PM	No	
104,000 - Lubricate Chassis	Done		TDELVA	Mar 23, 2018 7:05:54 PM	No	
105,000 - Replace or Clean A/C Filters	Done		TDELVA	Mar 23, 2018 7:05:54 PM	No	
107,000 - FRA Change Primary Fuel Filter	-	n/a	TDELVA	Mar 23, 2018 7:05:54 PM	No	
108,000 - Lube all pivoting Mechanisms	Done		TDELVA	Mar 23, 2018 7:05:54 PM	No	
200,000 - "B" PMI SERVICING ITEMS (12 MONTH)	Done		TDELVA	Mar 23, 2018 7:05:54 PM	No	
201,000 - Service Crankcase Breather	Done		TDELVA	Mar 23, 2018 7:05:54 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
203,000 - FRA Change Automatic Transmission Fluid	Yes		TDELVA	Mar 23, 2018 7:05:54 PM	No	
204,000 - FRA Change Power Steering Fluid and Filter	Yes		TDELVA	Mar 23, 2018 7:05:54 PM	No	
205,000 - Complete Engine Diagnostics and Clear Codes when Completed	Done		TDELVA	Mar 23, 2018 7:05:54 PM	No	
300,000 - "C" PMI SERVICING ITEMS (24 MONTH)	Done		TDELVA	Mar 23, 2018 7:05:54 PM	No	
301,000 - Check and Lubricate Door Linkages	Done		TDELVA	Mar 23, 2018 7:05:54 PM	No	
302,000 - Check Toe-In and Record Reading	-	n/a	TDELVA	Mar 23, 2018 7:05:54 PM	No	
302,001 - Record Toe-In Reading	Inches, fraction-actual	n/a	TDELVA	Mar 23, 2018 7:05:54 PM	No	
304,000 - 1st "C" PMI ONLY: Tune Up Per Engine Mfg's Specifications	Yes		TDELVA	Mar 23, 2018 7:05:54 PM	No	
305,000 - FRA Change Differential Fluid	Yes		TDELVA	Mar 23, 2018 7:05:54 PM	No	


Activity Sub Total

Activity 20 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	1.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 51054617
Invoice No. 55345 - 51054617

Client Department:

Department: 55345M

Work Order Description

PM C

Requested By: CVERGARA

Created By: CVERGARA

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 100,008 - DH

Activity Header

Activity: 30 999 TOTAL VEHICLE

Activity Note: PRAMETER

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
23-Mar-18	Delva, Terry	0.3333333	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

30 Desc: PRAMETER

Task: PRA and Meter Readings Performed by: TDELVA Performed on: 23-MAR-18

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		TDELVA	Mar 23, 2018 7:06:15 PM	No	
20 - Miles			TDELVA	Mar 23, 2018 7:06:15 PM	No	
30 - Kilometers			TDELVA	Mar 23, 2018 7:06:15 PM	No	
40 - Hours			TDELVA	Mar 23, 2018 7:06:15 PM	No	

Activity Sub Total

Activity 30 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	0.33
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00

Work Order Footer


Work Order 51054617 Total

Parts:	19.20
Labor:	0.00
Labor Hours:	4.33

	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	19.20



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 51114102
Invoice No. 55345 - 51114102

Client Department:

Department: 55345M

Work Order Description

Vehicle is pulling

Requested By: JAPEREZ

Created By: JAPEREZ

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 99,643 - DH

Chronology

Reported	Mar 22, 2018 10:38:20 AM	Mar 22, 2018 10:38:20 AM
Started	Mar 22, 2018 12:00:00 AM	
Completed	Mar 22, 2018 12:03:00 PM	Mar 22, 2018 12:03:00 PM
Down Time		

Work Order Notes

Line 10 To file warranty be sure to do the following:

- 1) Enter a COMPLAINT statement for each activity.
- 2) Enter CAUSE statement in the Notes field of each activity.
- 3) Enter CORRECTION statement in the Comment section of each activity.

Complaint:vehicle is pulling

Cause: inspect steering system, road test vehicle found vehicle drift to the right

Correction:cross front tires check tire pressure road test vehicle ok at this time

Activity Header

Activity:5 999 TOTAL VEHICLE

Activity Note: Personal Risk Assessment

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List


5 Desc: Personal Risk Assessment

Task: PRA and Meter Readings Performed by: JAPEREZ Performed on: 22-MAR-18

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO	
10 - Have you successfully completed the Personal Risk Assessment?	Done		JAPEREZ	Mar 22, 2018 10:47:55 AM	No		
20 - Miles			JAPEREZ	Mar 22, 2018 10:47:55 AM	No		
30 - Kilometers			JAPEREZ	Mar 22, 2018 10:47:55 AM	No		
40 - Hours			JAPEREZ	Mar 22, 2018 10:47:55 AM	No		
Activity Sub Total							
			Activity 5 Sub Total				
			Parts:				0.00
			Labor:				0.00
			Labor Hours:				0.00
			Sublet Parts:				0.00
			Sublet Labor:				0.00
			Activity Sub Total				0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 51114102
Invoice No. 55345 - 51114102

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FD4E4FS7EDB17176
Vehicle is pulling		Ford E450 Champion Challenger	
Requested By:	JAPEREZ	Status:	40 - Closed (40)
Created By:	JAPEREZ	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	99,643 - DH

Activity Header
Activity:15 015 STEERING
Activity Note: Vehicle is pulling
Reason for Repair: 04 Driver's Report
Work Accomplished:
Part Failure:
Activity Comments:

Activity Parts
No Data Available

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
22-Mar-18	Perez,Javier	1.5	0	0

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available

Activity Sub Total		Activity 15 Sub Total	
		Parts:	0.00
		Labor:	0.00
		Labor Hours:	1.50
		Sublet Parts:	0.00
		Sublet Labor:	0.00
		Activity Sub Total	0.00

Work Order Footer		Work Order 51114102 Total	
		Parts:	0.00
		Labor:	0.00
		Labor Hours:	1.50
		Sublet Parts:	0.00
		Sublet Labor:	0.00
		Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 51063638
Invoice No. 55345 - 51063638

Client Department:

Department: 55345M

Work Order Description

Alternator

Requested By: TDELVA

Created By: TDELVA

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 96,552 - DH

Chronology

Reported	Feb 26, 2018 8:13:19 PM	Feb 26, 2018 8:13:19 PM
Started	Feb 26, 2018 12:00:00 AM	
Completed	Feb 26, 2018 8:35:00 PM	Feb 26, 2018 8:35:00 PM
Down Time		

Work Order Notes

Line 10 To file warranty be sure to do the following:

- 1) Enter a COMPLAINT statement for each activity.
- 2) Enter CAUSE statement in the Notes field of each activity.
- 3) Enter CORRECTION statement in the Comment section of each activity.

Complaint: Battery light on

Cause: bad Alternator

Correction: Replaced alternator

Part used #GC2Z-10346-B. Qty:1

Activity Header

Activity:5 999 TOTAL VEHICLE

Activity Note: Personal Risk Assessment

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
26-Feb-18	Delva,Terry	0.55	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: Personal Risk Assessment

Task: PRA and Meter Readings Performed by: TDELVA Performed on: 26-FEB-18

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		TDELVA	Feb 26, 2018 8:20:15 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
20 - Miles			TDELVA	Feb 26, 2018 8:20:15 PM	No	
30 - Kilometers			TDELVA	Feb 26, 2018 8:20:15 PM	No	
40 - Hours			TDELVA	Feb 26, 2018 8:20:15 PM	No	
Activity Sub Total						
			Activity 5 Sub Total			
			Parts: 0.00			
			Labor: 0.00			
			Labor Hours: 0.55			
			Sublet Parts: 0.00			
			Sublet Labor: 0.00			
			Activity Sub Total 0.00			



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 51063638
Invoice No. 55345 - 51063638

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Alternator		Ford E450 Champion Challenger	
Requested By:	TDELVA	Status:	40 - Closed (40)
Created By:	TDELVA	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	96,552 - DH

Activity Header
Activity:15 031/002/001 REGULATOR, VOLTAGE
Activity Note: Alternator
Reason for Repair: 05 Inspection, Routine
Work Accomplished:
Part Failure:
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
26-Feb-18	GC2Z-10346-B	ALTERNATOR, E450	1	345.97	345.97

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
26-Feb-18	Delva,Terry	1	0	0

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available

Activity Sub Total		Activity 15 Sub Total	
Parts:			345.97
Labor:			0.00
Labor Hours:			1.00
Sublet Parts:			0.00
Sublet Labor:			0.00
Activity Sub Total			345.97

Work Order Footer		Work Order 51063638 Total	
Parts:			345.97
Labor:			0.00
Labor Hours:			1.55
Sublet Parts:			0.00
Sublet Labor:			0.00
Activity Sub Total			345.97



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 51054548
Invoice No. 55345 - 51054548

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Pma follow up need front tires		Ford E450 Champion Challenger	
Requested By:	HPIERRE	Status:	40 - Closed (40)
Created By:	HPIERRE	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	95,946 - DH

Chronology		
Reported	Feb 21, 2018 5:54:47 AM	Feb 21, 2018 5:54:47 AM
Started	Feb 21, 2018 12:00:00 AM	
Completed	Feb 22, 2018 7:46:00 AM	Feb 22, 2018 7:46:00 AM
Down Time		

Work Order Notes

Line 10 To file warranty be sure to do the following:
1) Enter a COMPLAINT statement for each activity.
2) Enter CAUSE statement in the Notes field of each activity.
3) Enter CORRECTION statement in the Comment section of each activity.

Complaint: PmA follow up need front tires

Cause: below spect

Correction: mount and balance 2 tires complete
Part # 189752 qty 2

Activity Header				
Activity:5 999 TOTAL VEHICLE				
Activity Note: Personal Risk Assessment				
Reason for Repair:		05 Inspection, Routine		
Work Accomplished:		06 Inspect		
Part Failure:				
Activity Comments:				
Activity Parts				
No Data Available				
Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
21-Feb-18	Pierre,Hubert J	0.0833333	0	0
Activity Sublet				
No Data Available				
Activity Checklist				
Check List				
5 Desc: Personal Risk Assessment				
Task: PRA and Meter Readings Performed by: HPIERRE Performed on: 22-FEB-18				

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		HPIERRE	Feb 22, 2018 7:45:44 AM	No	
20 - Miles			HPIERRE	Feb 22, 2018 7:45:44 AM	No	
30 - Kilometers			HPIERRE	Feb 22, 2018 7:45:44 AM	No	
40 - Hours			HPIERRE	Feb 22, 2018 7:45:44 AM	No	
Activity Sub Total						
			Activity 5 Sub Total			
			Parts: 0.00			
			Labor: 0.00			
			Labor Hours: 0.08			
			Sublet Parts: 0.00			
			Sublet Labor: 0.00			
			Activity Sub Total 0.00			



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 51054548
Invoice No. 55345 - 51054548

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Pma follow up need front tires		Ford E450 Champion Challenger	
Requested By:	HPIERRE	Status:	40 - Closed (40)
Created By:	HPIERRE	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	95,946 - DH

Activity Header
Activity:15 017/001/000 TIRE, PNEUMATIC
Activity Note:
Reason for Repair: 05 Inspection, Routine
Work Accomplished: 03 Replace New
Part Failure: 44 Worn
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
21-Feb-18	189752	TIRE, LT225/75R16, TLBLPS115RE, TRANSFORCE HT 10PLY 1622575E, NEW	2	103.44	206.88

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
21-Feb-18	Pierre,Hubert J	1	0	0

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available

Activity Sub Total		Activity 15 Sub Total	
Parts:	206.88	Labor:	0.00
Labor Hours:	1.00	Labor Hours:	1.00
Sublet Parts:	0.00	Sublet Parts:	0.00
Sublet Labor:	0.00	Sublet Labor:	0.00
Activity Sub Total		206.88	

Work Order Footer		Work Order 51054548 Total	
Parts:	206.88	Labor:	0.00
Labor Hours:	1.08	Labor Hours:	1.08
Sublet Parts:	0.00	Sublet Parts:	0.00
Sublet Labor:	0.00	Sublet Labor:	0.00
Activity Sub Total		206.88	



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 51006915
Invoice No. 55345 - 51006915

Client Department:

Department: 55345M

Work Order Description

PM A

Requested By: TDELVA

Created By: TDELVA

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 95,946 - DH

Chronology

Reported	Feb 20, 2018 10:04:38 AM	Feb 20, 2018 10:04:38 AM
Started	Feb 21, 2018 12:00:00 AM	
Completed	Feb 21, 2018 7:20:00 AM	Feb 21, 2018 7:20:00 AM
Down Time		

Work Order Notes

Line 10 COMPLAINT: PmA

CAUSE: preventive maintenance

CORRECTION:perform service lube all Pivoting Points cross rotate tires complete

Part #B329 qty 1

Oil5w20 Qts 6

Activity Header

Activity:10 999 TOTAL VEHICLE

Activity Note: Light Medium Duty PMI

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
21-Feb-18	B329(F)	GOING OUT OF SERVICE SEE BALDWIN B329 IN THE FLEET ORG. FILTER, OIL, SPIN-ON	1	1.96	1.96

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
21-Feb-18	Pierre,Hubert J	6	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: Light Medium Duty PMI

Task: First Transit Light-Medium Duty PMI Performed by: HPIERRE Performed on: 21-FEB-18

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,000 - SECTION 1 Preparation and Drive On (In Lot) Inspection	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
10,100 - Safety Inspection	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,110 - FRA Check Drivers Pre-trip or DVIR/EVIR & Authorization Forms	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
10,120 - FRA Check All Warning Lights and Alarms	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
10,130 - FRA Check Automatic Transmission Neutral Start Operation	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
10,140 - Check Service Brakes	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
10,150 - FRA Start Engine and Listen for Any Unusual Noises	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
10,160 - FRA Check Instruments and Horns	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
10,170 - Check Fast Idle	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
10,180 - Check Starter Protection Circuit	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
10,190 - Check Reverse Warning System	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
11,100 - Check Parking Brake	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
11,110 - Check HVAC Switches and Other Controls	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
11,120 - FRA Inspect Windshields, Mirror and Sun Visor Condition	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
11,130 - FRA Check Wiper and Washer Operation	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
11,140 - Road Test: Check for Proper Operation	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
11,150 - Perform Brake Test	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
11,152 - Decelerometer Results Test 1	FEET	N/A	HPIERRE	Feb 21, 2018 5:47:30 AM	No	
11,154 - Decelerometer Results Test 2	FEET	N/A	HPIERRE	Feb 21, 2018 5:47:30 AM	No	
11,156 - Decelerometer Results Test 3	FEET	N/A	HPIERRE	Feb 21, 2018 5:47:30 AM	No	
11,161 - FRA Check/Record Oil Pressure / @1500 rpm	1500 Pounds per Square Inch	N/A	HPIERRE	Feb 21, 2018 5:47:30 AM	No	
11,162 - FRA Check/Record Water Temperature	190 Degree Fahrenheit	N/A	HPIERRE	Feb 21, 2018 5:47:30 AM	No	
11,170 - FRA Check Door Operation	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
11,180 - FRA Check Operation of All Other Accessories	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
20,000 - SECTION 2 Interior Circle Inspection	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
20,210 - Check Condition of Operator's Area	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
20,220 - Check Accelerator and Brake Pedals	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
20,230 - FRA Check Wiring Under Dash	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
20,240 - FRA Check Interior Lights	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
20,250 - FRA Check Interior Electrical Panels	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
20,260 - Check Stop Request System	-	N/A	HPIERRE	Feb 21, 2018 5:47:30 AM	No	
20,270 - Check Fare Box Mounting (If Applicable)	-	N/A	HPIERRE	Feb 21, 2018 5:47:30 AM	No	
20,280 - Check Seats, Seat Belts, Hand Rails and Floor Covering	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
20,290 - Check for Physical Damage, Water Leaks, and Graffiti	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
22,100 - Check Emergency Windows and Glass Condition	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
22,110 - Check Emergency Hatches	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
22,120 - Check All Safety Equipment	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
30,000 - SECTION 3 Exterior Circle Inspection	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
30,310 - Check Passenger Doors	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
30,320 - Inspect Step-well and Hand Rails	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
30,330 - Check Wheelchair Lift Operation	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
30,340 - FRA Check Destination Sign and Run Box	-	N/A	HPIERRE	Feb 21, 2018 5:47:30 AM	No	
30,350 - FRA Inspect Mirror and Mountings	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
30,360 - Check for Physical Damage and Decals	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
30,370 - Check Wiper Blade and Arm Condition	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
30,380 - Check Exterior Compartment Doors	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
30,390 - FRA Check Fuel Tank Cap	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
33,100 - Check Lights and Reflectors	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
33,110 - Check License Plate, Permits and State Inspection Decals	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
40,000 - SECTION 4 Engine Compartment Inspection	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
40,410 - FRA Check Engine Compartment/Condition for Fire Risk	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
40,420 - Check Hood	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
40,430 - Check Fan, Shroud and Radiator	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
40,440 - Test Coolant System Using Test Strips and Record Results	-	N/A	HPIERRE	Feb 21, 2018 5:47:30 AM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
40,441 - Inhibitor Test Pass or Fail (Indicate with a Yes or No)	No	N/A	HPIERRE	Feb 21, 2018 5:47:30 AM	No	
40,442 - Freeze Point	Degree Fahrenheit	N/A	HPIERRE	Feb 21, 2018 5:47:30 AM	No	
40,450 - FRA Check Coolant Recovery System Condition & for Leaks	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
40,460 - Record Antifreeze Protection Level Using Refractometer	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
40,461 - Refractometer Reading	Degree Fahrenheit	N/A	HPIERRE	Feb 21, 2018 5:47:30 AM	No	
40,470 - Pressure Test Cooling System and Check for Leaks	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
40,480 - FRA Check Coolant Hose Condition	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
40,490 - FRA Check Alternator Mount and Condition	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
44,100 - FRA Check Fuel Control and Transmission Connections	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
44,110 - FRA Check Master Cylinder Fluid Level	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
44,120 - FRA Check All Belts for Condition, Alignment and Tension	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
44,130 - FRA Check Exhaust System	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
44,140 - FRA Check Intake System	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
44,150 - FRA Inspect Turbocharger	-	N/A	HPIERRE	Feb 21, 2018 5:47:30 AM	No	
44,160 - FRA Inspect Power Steering and Hydraulic Fluid	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
44,170 - FRA Check All Engine or Belt Driven Components	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
44,180 - FRA Check for Leaks	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
44,190 - FRA Perform Battery Inspection	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
44,200 - FRA Check Battery Box Corrosion, Cables and Hold-Downs	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
50,000 - SECTION 5 Steering System Inspection	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
50,510 - Check Entire Steering System	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
60,000 - SECTION 6 Tires and Wheel Inspection	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
60,610 - FRA Check and Record Air Pressure	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
60,611 - Air Pressure RF	65 Pounds per Square Inch		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
60,612 - Air Pressure LF	65 Pounds per Square Inch		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
60,613 - Air Pressure RRO	70 Pounds per Square Inch		HPIERRE	Feb 21, 2018 5:47:30 AM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
60,614 - Air Pressure RRI	70 Pounds per Square Inch		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
60,615 - Air Pressure LRI	70 Pounds per Square Inch		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
60,616 - Air Pressure LRO	70 Pounds per Square Inch		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
60,620 - Check Valve Stems and Caps	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
60,630 - Check and Record Tread Depth	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
60,631 - Tread Depth RF	4 32nds of an inch		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
60,632 - Tread Depth LF	4 32nds of an inch		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
60,633 - Tread Depth RRO	4 32nds of an inch		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
60,634 - Tread Depth RRI	6 32nds of an inch		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
60,635 - Tread Depth LRI	6 32nds of an inch		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
60,636 - Tread Depth LRO	6 32nds of an inch		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
60,640 - Check for Mismatched Tread or Casing Design	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
60,650 - Check Sidewall Wear	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
60,660 - Inspect for Cuts and Tears	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
60,670 - Check Dual Mating With Square	-	N/A	HPIERRE	Feb 21, 2018 5:47:30 AM	No	
60,680 - Check Wheels for Cracks and Loose Lugs	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
60,690 - Check Tires for Irregular or Alignment Wear	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
66,100 - FRA Check Outer Hubs for Leaks	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
70,000 - SECTION 7 Under Vehicle Inspection	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
70,710 - Check Vibration Damper	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
70,720 - Check Engine and Transmission Mounts	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
70,730 - FRA Check Starter	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
70,740 - FRA Check Bottom of Engine for Fluid Leaks	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
70,750 - FRA Check Transmission for Leaks	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
70,760 - FRA Check Differential Breather and Fluid	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
70,770 - FRA Check Exhaust System	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
70,780 - Check Driveline, U-joint and Slip Yokes	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
70,790 - Check All Body Mounts and Chassis Frame	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
77,100 - FRA Check Security, Integrity and Length of Ground Straps	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
77,110 - FRA Check Fuel Tank	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
77,120 - Check Suspension Components	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
77,130 - FRA Check Brake Pad Thickness and Rotor for Wear	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
77,131 - Brake Pad Thickness LF	8 Inch		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
77,132 - Brake Pad Thickness RF	8 Inch		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
77,133 - Brake Pad Thickness LR	7 Inch		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
77,134 - Brake Pad Thickness RR	7 Inch		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
77,135 - Brake Rotor LF	1.6 Inch		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
77,136 - Brake Rotor RF	1.6 Inch		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
77,137 - Brake Rotor LR	1.7 Inch		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
77,138 - Brake Rotor RR	1.7 Inch		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
77,140 - FRA Check Brake Hoses	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
77,150 - Check King Pins	-	N/A	HPIERRE	Feb 21, 2018 5:47:30 AM	No	
77,160 - FRA Check for Loose or Noisy Wheel Bearings	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
80,000 - SECTION 8 PMI Report Completion	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
80,810 - Completion of PMI Report	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
90,000 - SECTION 9 Completion of PMI	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	
90,910 - Vehicle Returned to predetermined location	Done		HPIERRE	Feb 21, 2018 5:47:30 AM	No	

Activity Sub Total

Activity 10 Sub Total	
Parts:	1.96
Labor:	0.00
Labor Hours:	6.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	1.96



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 51006915
Invoice No. 55345 - 51006915

Client Department:

Department: 55345M

Work Order Description

PM A

Requested By: TDELVA

Created By: TDELVA

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 95,946 - DH

Activity Header

Activity: 20 999 TOTAL VEHICLE

Activity Note: PM A

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: A PM Level A

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
21-Feb-18	Pierre,Hubert J	0.4166666	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List						
20 Desc: PM A						
Task: PM A SERVICE Performed by: HPIERRE Performed on: 21-FEB-18						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
100,000 - "A" PMI SERVICING ITEMS	Done		HPIERRE	Feb 21, 2018 5:48:23 AM	No	
101,000 - FRA Change Oil Filters	Yes		HPIERRE	Feb 21, 2018 5:48:23 AM	No	
102,000 - FRA Drain Engine Oil	Yes		HPIERRE	Feb 21, 2018 5:48:23 AM	No	
103,000 - FRA Check Transmission Fluid	Done		HPIERRE	Feb 21, 2018 5:48:23 AM	No	
104,000 - Lubricate Chassis	Done		HPIERRE	Feb 21, 2018 5:48:23 AM	No	
105,000 - Replace or Clean A/C Filters	Done		HPIERRE	Feb 21, 2018 5:48:23 AM	No	
107,000 - FRA Change Primary Fuel Filter	No	N/A	HPIERRE	Feb 21, 2018 5:48:23 AM	No	
108,000 - Lube all pivoting Mechanisms	Done		HPIERRE	Feb 21, 2018 5:48:23 AM	No	

Activity Sub Total

Activity 20 Sub Total

Parts:	0.00
Labor:	0.00

	Labor Hours:	0.42
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 51006915
Invoice No. 55345 - 51006915

Client Department:

Department: 55345M

Work Order Description

PM A

Requested By: TDELVA

Created By: TDELVA

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 95,946 - DH

Activity Header

Activity: 30 999 TOTAL VEHICLE

Activity Note: PRAMETER

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
21-Feb-18	Pierre,Hubert J	0.0833333	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

30 Desc: PRAMETER

Task: PRA and Meter Readings Performed by: HPIERRE Performed on: 21-FEB-18

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		HPIERRE	Feb 21, 2018 5:48:59 AM	No	
20 - Miles			HPIERRE	Feb 21, 2018 5:48:59 AM	No	
30 - Kilometers			HPIERRE	Feb 21, 2018 5:48:59 AM	No	
40 - Hours			HPIERRE	Feb 21, 2018 5:48:59 AM	No	

Activity Sub Total

Activity 30 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	0.08
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00

Work Order Footer


Work Order 51006915 Total

Parts:	1.96
Labor:	0.00
Labor Hours:	6.50

	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	1.96



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 51042616
Invoice No. 55345 - 51042616

Client Department:

Department: 55345M

Work Order Description

Alternator light is on

Requested By: JAPEREZ

Created By: JAPEREZ

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 95,179 - DH

Chronology

Reported	Feb 15, 2018 7:46:16 AM	Feb 15, 2018 7:46:16 AM
Started	Feb 15, 2018 12:00:00 AM	
Completed	Feb 15, 2018 8:38:00 AM	Feb 15, 2018 8:38:00 AM
Down Time		

Work Order Notes

Line 10 To file warranty be sure to do the following:

- 1) Enter a COMPLAINT statement for each activity.
- 2) Enter CAUSE statement in the Notes field of each activity.
- 3) Enter CORRECTION statement in the Comment section of each activity.

Complaint:alternator light is on

Cause: check charging system found is at 13.8 volts, check alternator connector found is loose causing the alt. Light to come on

Correction:replaced alternator pig tail wire harness connector, retest system light is out and charging ok at this time

Part:

1 pig tail connector wpt118

Activity Header

Activity:5 999 TOTAL VEHICLE

Activity Note: Personal Risk Assessment

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List						
5 Desc: Personal Risk Assessment						
Task: PRA and Meter Readings Performed by: JAPEREZ Performed on: 15-FEB-18						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		JAPEREZ	Feb 15, 2018 8:01:16 AM	No	
20 - Miles			JAPEREZ	Feb 15, 2018 8:01:16 AM	No	
30 - Kilometers			JAPEREZ	Feb 15, 2018 8:01:16 AM	No	
40 - Hours			JAPEREZ	Feb 15, 2018 8:01:16 AM	No	
Activity Sub Total						
			Activity 5 Sub Total			
			Parts: 0.00			
			Labor: 0.00			
			Labor Hours: 0.00			
			Sublet Parts: 0.00			
			Sublet Labor: 0.00			
			Activity Sub Total 0.00			



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 51042616
Invoice No. 55345 - 51042616

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Alternator light is on		Ford E450 Champion Challenger	
Requested By:	JAPEREZ	Status:	40 - Closed (40)
Created By:	JAPEREZ	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	95,179 - DH

Activity Header
Activity:15 031 CHARGING
Activity Note: Alternator light is on
Reason for Repair: 04 Driver's Report
Work Accomplished:
Part Failure:
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
15-Feb-18	WPT118	PIGTAIL, SENSOR, CAM SAME AS 1U2Z-14S411-TA	1	35.77	35.77

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
15-Feb-18	Perez,Javier	2	0	0

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available

Activity Sub Total		Activity 15 Sub Total	
Parts:			35.77
Labor:			0.00
Labor Hours:			2.00
Sublet Parts:			0.00
Sublet Labor:			0.00
Activity Sub Total			35.77

Work Order Footer		Work Order 51042616 Total	
Parts:			35.77
Labor:			0.00
Labor Hours:			2.00
Sublet Parts:			0.00
Sublet Labor:			0.00
Activity Sub Total			35.77



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 51006899
Invoice No. 55345 - 51006899

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
PMI_FOLLOWUP_Rear Brakes		Ford E450 Champion Challenger	
Requested By:	TDELVA	Status:	40 - Closed (40)
Created By:	TDELVA	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	91,859 - DH

Chronology		
Reported	Jan 24, 2018 3:56:45 PM	Jan 24, 2018 3:56:45 PM
Started	Jan 24, 2018 12:00:00 AM	
Completed	Jan 24, 2018 4:17:00 PM	Jan 24, 2018 4:17:00 PM
Down Time		

Work Order Notes

Line 10 Replaced rear brakes
Part used #BRSD-1330. Qty:1

Activity Header				
Activity:10 013 BRAKES				
Activity Note: Rear Brakes				
Reason for Repair: 05 Inspection, Routine				
Work Accomplished:				
Part Failure:				
Activity Comments:				
Activity Parts				
No Data Available				
Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
24-Jan-18	Delva,Terry	0.8	0	0
Activity Sublet				
No Data Available				
Activity Checklist				
No Data Available				
No Data Available				
Activity Sub Total				
			Activity 10 Sub Total	
			Parts:	0.00
			Labor:	0.00
			Labor Hours:	0.80
			Sublet Parts:	0.00
			Sublet Labor:	0.00
			Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 51006899
Invoice No. 55345 - 51006899

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
PMI_FOLLOWUP_Rear Brakes		Ford E450 Champion Challenger	
Requested By:	TDELVA	Status:	40 - Closed (40)
Created By:	TDELVA	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	91,859 - DH

Activity Header
Activity:20 999/999/999 TOTAL VEHICLE
Activity Note: PRAMETER
Reason for Repair: 05 Inspection, Routine
Work Accomplished: 06 Inspect
Part Failure: 00 No Failure
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
24-Jan-18	BRSD-1330	PADS, BRAKE, DISC, REAR, FORD SAME AS PFH133020	1	43.15	43.15

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
24-Jan-18	Delva,Terry	2	0	0

Activity Sublet
No Data Available

Activity Checklist						
Check List						
20 Desc: PRAMETER						
Task: PRA and Meter Readings Performed by: TDELVA Performed on: 24-JAN-18						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		TDELVA	Jan 24, 2018 4:17:04 PM	No	
20 - Miles			TDELVA	Jan 24, 2018 4:17:04 PM	No	
30 - Kilometers			TDELVA	Jan 24, 2018 4:17:04 PM	No	
40 - Hours			TDELVA	Jan 24, 2018 4:17:04 PM	No	

Activity Sub Total		Activity 20 Sub Total	
Parts:	43.15	Parts:	43.15
Labor:	0.00	Labor:	0.00
Labor Hours:	2.00	Labor Hours:	2.00
Sublet Parts:	0.00	Sublet Parts:	0.00
Sublet Labor:	0.00	Sublet Labor:	0.00
Activity Sub Total	43.15	Activity Sub Total	43.15

Work Order Footer		Work Order 51006899 Total	
Parts:	43.15	Parts:	43.15

	Labor:	0.00
	Labor Hours:	2.80
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	43.15



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 50957173
Invoice No. 55345 - 50957173

Client Department:

Department: 55345M

Work Order Description

PM A

Requested By: CKARLENS

Created By: CKARLENS

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 91,859 - DH

Chronology

Reported	Jan 24, 2018 11:45:50 AM	Jan 24, 2018 11:45:50 AM
Started	Jan 24, 2018 12:00:00 AM	
Completed	Jan 24, 2018 4:07:00 PM	Jan 24, 2018 4:07:00 PM
Down Time		

Work Order Notes

Line 10 COMPLAINT: PM A

CAUSE: PM A service due

CORRECTION: Performed and completed PM A

Changed engine oil and replaced engine oil filter

Part Used #B329. Qty:1

****Front rotor need to be change upon next front brakes service.

Activity Header

Activity:10 999 TOTAL VEHICLE

Activity Note: Light Medium Duty PMI

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
24-Jan-18	B329(F)	GOING OUT OF SERVICE SEE BALDWIN B329 IN THE FLEET ORG. FILTER, OIL, SPIN-ON	1	1.92	1.92

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
24-Jan-18	Delva,Terry	2	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: Light Medium Duty PMI

Task: First Transit Light-Medium Duty PMI Performed by: TDELVA Performed on: 24-JAN-18

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,000 - SECTION 1 Preparation and Drive On (In Lot) Inspection	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
10,100 - Safety Inspection	Done		TDELVA	Jan 24, 2018	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
				3:56:44 PM		
10,110 - FRA Check Drivers Pre-trip or DVIR/EVIR & Authorization Forms	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
10,120 - FRA Check All Warning Lights and Alarms	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
10,130 - FRA Check Automatic Transmission Neutral Start Operation	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
10,140 - Check Service Brakes	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
10,150 - FRA Start Engine and Listen for Any Unusual Noises	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
10,160 - FRA Check Instruments and Horns	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
10,170 - Check Fast Idle	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
10,180 - Check Starter Protection Circuit	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
10,190 - Check Reverse Warning System	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
11,100 - Check Parking Brake	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
11,110 - Check HVAC Switches and Other Controls	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
11,120 - FRA Inspect Windshields, Mirror and Sun Visor Condition	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
11,130 - FRA Check Wiper and Washer Operation	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
11,140 - Road Test: Check for Proper Operation	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
11,150 - Perform Brake Test	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
11,152 - Decelerometer Results Test 1	FEET	n/a	TDELVA	Jan 24, 2018 3:56:44 PM	No	
11,154 - Decelerometer Results Test 2	FEET	n/a	TDELVA	Jan 24, 2018 3:56:44 PM	No	
11,156 - Decelerometer Results Test 3	FEET	n/a	TDELVA	Jan 24, 2018 3:56:44 PM	No	
11,161 - FRA Check/Record Oil Pressure / @1500 rpm	Pounds per Square Inch	n/a	TDELVA	Jan 24, 2018 3:56:44 PM	No	
11,162 - FRA Check/Record Water Temperature	Degree Fahrenheit	n/a	TDELVA	Jan 24, 2018 3:56:44 PM	No	
11,170 - FRA Check Door Operation	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
11,180 - FRA Check Operation of All Other Accessories	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
20,000 - SECTION 2 Interior Circle Inspection	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
20,210 - Check Condition of Operator's Area	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
20,220 - Check Accelerator and Brake Pedals	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
20,230 - FRA Check Wiring Under Dash	Done		TDELVA	Jan 24, 2018	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
				3:56:44 PM		
20,240 - FRA Check Interior Lights	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
20,250 - FRA Check Interior Electrical Panels	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
20,260 - Check Stop Request System	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
20,270 - Check Fare Box Mounting (If Applicable)	-	n/a	TDELVA	Jan 24, 2018 3:56:44 PM	No	
20,280 - Check Seats, Seat Belts, Hand Rails and Floor Covering	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
20,290 - Check for Physical Damage, Water Leaks, and Graffiti	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
22,100 - Check Emergency Windows and Glass Condition	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
22,110 - Check Emergency Hatches	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
22,120 - Check All Safety Equipment	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
30,000 - SECTION 3 Exterior Circle Inspection	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
30,310 - Check Passenger Doors	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
30,320 - Inspect Step-well and Hand Rails	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
30,330 - Check Wheelchair Lift Operation	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
30,340 - FRA Check Destination Sign and Run Box	-	n/a	TDELVA	Jan 24, 2018 3:56:44 PM	No	
30,350 - FRA Inspect Mirror and Mountings	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
30,360 - Check for Physical Damage and Decals	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
30,370 - Check Wiper Blade and Arm Condition	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
30,380 - Check Exterior Compartment Doors	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
30,390 - FRA Check Fuel Tank Cap	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
33,100 - Check Lights and Reflectors	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
33,110 - Check License Plate, Permits and State Inspection Decals	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
40,000 - SECTION 4 Engine Compartment Inspection	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
40,410 - FRA Check Engine Compartment/Condition for Fire Risk	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
40,420 - Check Hood	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
40,430 - Check Fan, Shroud and Radiator	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
40,440 - Test Coolant System Using Test Strips	-	n/a	TDELVA	Jan 24, 2018	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
and Record Results				3:56:44 PM		
40,441 - Inhibitor Test Pass or Fail (Indicate with a Yes or No)	No	n/a	TDELVA	Jan 24, 2018 3:56:44 PM	No	
40,442 - Freeze Point	Degree Fahrenheit	n/a	TDELVA	Jan 24, 2018 3:56:44 PM	No	
40,450 - FRA Check Coolant Recovery System Condition & for Leaks	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
40,460 - Record Antifreeze Protection Level Using Refractometer	-	n/a	TDELVA	Jan 24, 2018 3:56:44 PM	No	
40,461 - Refractometer Reading	Degree Fahrenheit	n/a	TDELVA	Jan 24, 2018 3:56:44 PM	No	
40,470 - Pressure Test Cooling System and Check for Leaks	Done	n/a	TDELVA	Jan 24, 2018 3:56:44 PM	No	
40,480 - FRA Check Coolant Hose Condition	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
40,490 - FRA Check Alternator Mount and Condition	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
44,100 - FRA Check Fuel Control and Transmission Connections	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
44,110 - FRA Check Master Cylinder Fluid Level	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
44,120 - FRA Check All Belts for Condition, Alignment and Tension	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
44,130 - FRA Check Exhaust System	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
44,140 - FRA Check Intake System	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
44,150 - FRA Inspect Turbocharger	-	n/a	TDELVA	Jan 24, 2018 3:56:44 PM	No	
44,160 - FRA Inspect Power Steering and Hydraulic Fluid	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
44,170 - FRA Check All Engine or Belt Driven Components	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
44,180 - FRA Check for Leaks	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
44,190 - FRA Perform Battery Inspection	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
44,200 - FRA Check Battery Box Corrosion, Cables and Hold-Downs	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
50,000 - SECTION 5 Steering System Inspection	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
50,510 - Check Entire Steering System	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
60,000 - SECTION 6 Tires and Wheel Inspection	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
60,610 - FRA Check and Record Air Pressure	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
60,611 - Air Pressure RF	65 Pounds per Square Inch		TDELVA	Jan 24, 2018 3:56:44 PM	No	
60,612 - Air Pressure LF	65 Pounds per Square Inch		TDELVA	Jan 24, 2018 3:56:44 PM	No	
60,613 - Air Pressure RRO	65 Pounds per		TDELVA	Jan 24, 2018	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
	Square Inch			3:56:44 PM		
60,614 - Air Pressure RRI	65 Pounds per Square Inch		TDELVA	Jan 24, 2018 3:56:44 PM	No	
60,615 - Air Pressure LRI	65 Pounds per Square Inch		TDELVA	Jan 24, 2018 3:56:44 PM	No	
60,616 - Air Pressure LRO	65 Pounds per Square Inch		TDELVA	Jan 24, 2018 3:56:44 PM	No	
60,620 - Check Valve Stems and Caps	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
60,630 - Check and Record Tread Depth	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
60,631 - Tread Depth RF	10 32nds of an inch		TDELVA	Jan 24, 2018 3:56:44 PM	No	
60,632 - Tread Depth LF	8 32nds of an inch		TDELVA	Jan 24, 2018 3:56:44 PM	No	
60,633 - Tread Depth RRO	7 32nds of an inch		TDELVA	Jan 24, 2018 3:56:44 PM	No	
60,634 - Tread Depth RRI	8 32nds of an inch		TDELVA	Jan 24, 2018 3:56:44 PM	No	
60,635 - Tread Depth LRI	8 32nds of an inch		TDELVA	Jan 24, 2018 3:56:44 PM	No	
60,636 - Tread Depth LRO	7 32nds of an inch		TDELVA	Jan 24, 2018 3:56:44 PM	No	
60,640 - Check for Mismatched Tread or Casing Design	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
60,650 - Check Sidewall Wear	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
60,660 - Inspect for Cuts and Tears	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
60,670 - Check Dual Mating With Square	-	n/a	TDELVA	Jan 24, 2018 3:56:44 PM	No	
60,680 - Check Wheels for Cracks and Loose Lugs	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
60,690 - Check Tires for Irregular or Alignment Wear	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
66,100 - FRA Check Outer Hubs for Leaks	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
70,000 - SECTION 7 Under Vehicle Inspection	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
70,710 - Check Vibration Damper	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
70,720 - Check Engine and Transmission Mounts	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
70,730 - FRA Check Starter	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
70,740 - FRA Check Bottom of Engine for Fluid Leaks	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
70,750 - FRA Check Transmission for Leaks	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
70,760 - FRA Check Differential Breather and Fluid	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
70,770 - FRA Check Exhaust System	Done		TDELVA	Jan 24, 2018	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
				3:56:44 PM		
70,780 - Check Driveline, U-joint and Slip Yokes	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
70,790 - Check All Body Mounts and Chassis Frame	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
77,100 - FRA Check Security, Integrity and Length of Ground Straps	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
77,110 - FRA Check Fuel Tank	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
77,120 - Check Suspension Components	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
77,130 - FRA Check Brake Pad Thickness and Rotor for Wear	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
77,131 - Brake Pad Thickness LF	8 Inch		TDELVA	Jan 24, 2018 3:56:44 PM	No	
77,132 - Brake Pad Thickness RF	8 Inch		TDELVA	Jan 24, 2018 3:56:44 PM	No	
77,133 - Brake Pad Thickness LR	4 Inch	Rear Brakes	TDELVA	Jan 24, 2018 3:56:44 PM	Yes	51006899
77,134 - Brake Pad Thickness RR	5 Inch		TDELVA	Jan 24, 2018 3:56:44 PM	No	
77,135 - Brake Rotor LF	39.6 Inch		TDELVA	Jan 24, 2018 3:56:44 PM	No	
77,136 - Brake Rotor RF	39.6 Inch		TDELVA	Jan 24, 2018 3:56:44 PM	No	
77,137 - Brake Rotor LR	38.5 Inch		TDELVA	Jan 24, 2018 3:56:44 PM	No	
77,138 - Brake Rotor RR	38.5 Inch		TDELVA	Jan 24, 2018 3:56:44 PM	No	
77,140 - FRA Check Brake Hoses	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
77,150 - Check King Pins	-	n/a	TDELVA	Jan 24, 2018 3:56:44 PM	No	
77,160 - FRA Check for Loose or Noisy Wheel Bearings	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
80,000 - SECTION 8 PMI Report Completion	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
80,810 - Completion of PMI Report	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
90,000 - SECTION 9 Completion of PMI	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	
90,910 - Vehicle Returned to predetermined location	Done		TDELVA	Jan 24, 2018 3:56:44 PM	No	

Activity Sub Total

Activity 10 Sub Total	
Parts:	1.92
Labor:	0.00
Labor Hours:	2.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	1.92



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 50957173
Invoice No. 55345 - 50957173

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
PM A		Ford E450 Champion Challenger	
Requested By:	CKARLENS	Status:	40 - Closed (40)
Created By:	CKARLENS	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	91,859 - DH

Activity Header
Activity:20 999 TOTAL VEHICLE
Activity Note: PM A
Reason for Repair: 08 Preventive Maintenance
Work Accomplished: A PM Level A
Part Failure:
Activity Comments:

Activity Parts
No Data Available

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
24-Jan-18	Delva,Terry	0.7166666	0	0

Activity Sublet
No Data Available

Activity Checklist						
Check List						
20 Desc: PM A						
Task: PM A SERVICE Performed by: TDELVA Performed on: 24-JAN-18						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
100,000 - "A" PMI SERVICING ITEMS	Done		TDELVA	Jan 24, 2018 3:36:14 PM	No	
101,000 - FRA Change Oil Filters	Yes		TDELVA	Jan 24, 2018 3:36:14 PM	No	
102,000 - FRA Drain Engine Oil	Yes		TDELVA	Jan 24, 2018 3:36:14 PM	No	
103,000 - FRA Check Transmission Fluid	Done		TDELVA	Jan 24, 2018 3:36:14 PM	No	
104,000 - Lubricate Chassis	Done		TDELVA	Jan 24, 2018 3:36:14 PM	No	
105,000 - Replace or Clean A/C Filters	Done		TDELVA	Jan 24, 2018 3:36:14 PM	No	
107,000 - FRA Change Primary Fuel Filter	No	n/a	TDELVA	Jan 24, 2018 3:36:14 PM	No	
108,000 - Lube all pivoting Mechanisms	Done		TDELVA	Jan 24, 2018 3:36:14 PM	No	

Activity Sub Total	
Activity 20 Sub Total	
Parts:	0.00
Labor:	0.00

	Labor Hours:	0.72
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 50957173
Invoice No. 55345 - 50957173

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
PM A		Ford E450 Champion Challenger	
Requested By:	CKARLENS	Status:	40 - Closed (40)
Created By:	CKARLENS	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	91,859 - DH

Activity Header
Activity:30 999 TOTAL VEHICLE
Activity Note: PRAMETER
Reason for Repair: 05 Inspection, Routine
Work Accomplished: 06 Inspect
Part Failure:
Activity Comments:

Activity Parts
No Data Available

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
24-Jan-18	Delva,Terry	0.55	0	0

Activity Sublet
No Data Available

Activity Checklist						
Check List						
30 Desc: PRAMETER						
Task: PRA and Meter Readings Performed by: TDELVA Performed on: 24-JAN-18						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		TDELVA	Jan 24, 2018 11:49:31 AM	No	
20 - Miles			TDELVA	Jan 24, 2018 11:49:31 AM	No	
30 - Kilometers			TDELVA	Jan 24, 2018 11:49:31 AM	No	
40 - Hours			TDELVA	Jan 24, 2018 11:49:31 AM	No	

Activity Sub Total	
Activity 30 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	0.55
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00

Work Order Footer	
Work Order 50957173 Total	
Parts:	1.92
Labor:	0.00
Labor Hours:	3.27

	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	1.92



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 51003047
Invoice No. 55345 - 51003047

Client Department:

Department: 55345M

Work Order Description

Passenger mirror broken

Requested By: CKARLENS

Created By: CKARLENS

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 2 - Medium

Driver:

Phone:

ETA:

Meter: 91,334 - DH

Chronology

Reported	Jan 22, 2018 12:43:07 PM	Jan 22, 2018 12:43:07 PM
Started	Jan 22, 2018 12:00:00 AM	
Completed	Jan 23, 2018 2:33:00 PM	Jan 23, 2018 2:33:00 PM
Down Time		

Work Order Notes

Line 10 To file warranty be sure to do the following:

- 1) Enter a COMPLAINT statement for each activity.
- 2) Enter CAUSE statement in the Notes field of each activity.
- 3) Enter CORRECTION statement in the Comment section of each activity.

Complaint: Driver reported passenger mirror is broken

Cause: Driver misuse

Correction:tech replaced passenger mirror

Activity Header

Activity:5 999 TOTAL VEHICLE

Activity Note: Personal Risk Assessment

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
22-Jan-18	KARLENS,Cyrus	0.2833333	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: Personal Risk Assessment

Task: PRA and Meter Readings Performed by: CKARLENS Performed on: 22-JAN-18

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the	Done		CKARLENS	Jan 22, 2018	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
Personal Risk Assessment?				9:45:55 PM		
20 - Miles			CKARLENS	Jan 22, 2018 9:45:55 PM	No	
30 - Kilometers			CKARLENS	Jan 22, 2018 9:45:55 PM	No	
40 - Hours			CKARLENS	Jan 22, 2018 9:45:55 PM	No	
Activity Sub Total						
			Activity 5 Sub Total			
			Parts:			0.00
			Labor:			0.00
			Labor Hours:			0.28
			Sublet Parts:			0.00
			Sublet Labor:			0.00
			Activity Sub Total			0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 51003047
Invoice No. 55345 - 51003047

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Passenger mirror broken		Ford E450 Champion Challenger	
Requested By:	CKARLENS	Status:	40 - Closed (40)
Created By:	CKARLENS	Priority:	2 - Medium
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	91,334 - DH

Activity Header				
Activity: 15 050/000 GROUP, ACCESSORIES				
Activity Note: Driver reported passenger mirror broken				
Reason for Repair: 41 Abuse of Equipment - 56210				
Work Accomplished: 14 Install				
Part Failure: 00 No Failure				
Activity Comments:				
Activity Parts				
No Data Available				
Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
22-Jan-18	KARLENS,Cyrius	1.75	0	0
Activity Sublet				
No Data Available				
Activity Checklist				
No Data Available				
No Data Available				
Activity Sub Total				
			Activity 15 Sub Total	
			Parts:	0.00
			Labor:	0.00
			Labor Hours:	1.75
			Sublet Parts:	0.00
			Sublet Labor:	0.00
			Activity Sub Total	0.00
Work Order Footer				
			Work Order 51003047 Total	
			Parts:	0.00
			Labor:	0.00
			Labor Hours:	2.03
			Sublet Parts:	0.00
			Sublet Labor:	0.00
			Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 47788995
Invoice No. 55345 - 47788995

Client Department:

Department: 55345M

Work Order Description

PM B

Requested By: RGASPARD

Created By: RGASPARD

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 87,621 - DH

Chronology

Reported	Dec 19, 2017 2:28:54 PM	Dec 19, 2017 2:28:54 PM
Started	Dec 19, 2017 12:00:00 AM	
Completed	Dec 19, 2017 11:33:00 PM	Dec 19, 2017 11:33:00 PM
Down Time		

Work Order Notes

Line 10 COMPLAINT: Perform PM-B

CAUSE: Preventive Maintenance

CORRECTION: Tech Performed PM-B

Part used: Oil Qty:6. Filter Qty:1

Activity Header

Activity:10 999 TOTAL VEHICLE

Activity Note: Light Medium Duty PMI

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
19-Dec-17	B329(F)	GOING OUT OF SERVICE SEE BALDWIN B329 IN THE FLEET ORG. FILTER, OIL, SPIN-ON	1	1.92	1.92

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
19-Dec-17	KARLENS,Cyrius	2.5	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: Light Medium Duty PMI

Task: First Transit Light-Medium Duty PMI Performed by: CKARLENS Performed on: 19-DEC-17

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,000 - SECTION 1 Preparation and Drive On (In Lot) Inspection	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
10,100 - Safety Inspection	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
10,110 - FRA Check Drivers Pre-trip or DVIR/EVIR & Authorization Forms	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,120 - FRA Check All Warning Lights and Alarms	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
10,130 - FRA Check Automatic Transmission Neutral Start Operation	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
10,140 - Check Service Brakes	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
10,150 - FRA Start Engine and Listen for Any Unusual Noises	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
10,160 - FRA Check Instruments and Horns	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
10,170 - Check Fast Idle	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
10,180 - Check Starter Protection Circuit	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
10,190 - Check Reverse Warning System	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
11,100 - Check Parking Brake	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
11,110 - Check HVAC Switches and Other Controls	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
11,120 - FRA Inspect Windshields, Mirror and Sun Visor Condition	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
11,130 - FRA Check Wiper and Washer Operation	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
11,140 - Road Test: Check for Proper Operation	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
11,150 - Perform Brake Test	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
11,152 - Decelerometer Results Test 1	FEET	na	CKARLENS	Dec 19, 2017 11:15:20 PM	No	
11,154 - Decelerometer Results Test 2	FEET	na	CKARLENS	Dec 19, 2017 11:15:20 PM	No	
11,156 - Decelerometer Results Test 3	FEET	na	CKARLENS	Dec 19, 2017 11:15:20 PM	No	
11,161 - FRA Check/Record Oil Pressure / @1500 rpm	Pounds per Square Inch	na	CKARLENS	Dec 19, 2017 11:15:20 PM	No	
11,162 - FRA Check/Record Water Temperature	Degree Fahrenheit	na	CKARLENS	Dec 19, 2017 11:15:20 PM	No	
11,170 - FRA Check Door Operation	-	na	CKARLENS	Dec 19, 2017 11:15:20 PM	No	
11,180 - FRA Check Operation of All Other Accessories	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
20,000 - SECTION 2 Interior Circle Inspection	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
20,210 - Check Condition of Operator's Area	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
20,220 - Check Accelerator and Brake Pedals	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
20,230 - FRA Check Wiring Under Dash	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
20,240 - FRA Check Interior Lights	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
20,250 - FRA Check Interior Electrical Panels	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
20,260 - Check Stop Request System	-	na	CKARLENS	Dec 19, 2017 11:15:20 PM	No	
20,270 - Check Fare Box Mounting (If Applicable)	-	na	CKARLENS	Dec 19, 2017 11:15:20 PM	No	
20,280 - Check Seats, Seat Belts, Hand Rails and Floor Covering	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
20,290 - Check for Physical Damage, Water Leaks, and Graffiti	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
22,100 - Check Emergency Windows and Glass Condition	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
22,110 - Check Emergency Hatches	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
22,120 - Check All Safety Equipment	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
30,000 - SECTION 3 Exterior Circle Inspection	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
30,310 - Check Passenger Doors	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
30,320 - Inspect Step-well and Hand Rails	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
30,330 - Check Wheelchair Lift Operation	Done	na	CKARLENS	Dec 19, 2017 11:15:20 PM	No	
30,340 - FRA Check Destination Sign and Run Box	-	na	CKARLENS	Dec 19, 2017 11:15:20 PM	No	
30,350 - FRA Inspect Mirror and Mountings	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
30,360 - Check for Physical Damage and Decals	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
30,370 - Check Wiper Blade and Arm Condition	-	replace wiper blades	CKARLENS	Dec 19, 2017 11:15:20 PM	Yes	50957118
30,380 - Check Exterior Compartment Doors	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
30,390 - FRA Check Fuel Tank Cap	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
33,100 - Check Lights and Reflectors	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
33,110 - Check License Plate, Permits and State Inspection Decals	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
40,000 - SECTION 4 Engine Compartment Inspection	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
40,410 - FRA Check Engine Compartment/Condition for Fire Risk	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
40,420 - Check Hood	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
40,430 - Check Fan, Shroud and Radiator	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
40,440 - Test Coolant System Using Test Strips and Record Results	-	na	CKARLENS	Dec 19, 2017 11:15:20 PM	No	
40,441 - Inhibitor Test Pass or Fail (Indicate with a Yes or No)	Yes		CKARLENS	Dec 19, 2017 11:15:20 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
40,442 - Freeze Point	Degree Fahrenheit	na	CKARLENS	Dec 19, 2017 11:15:20 PM	No	
40,450 - FRA Check Coolant Recovery System Condition & for Leaks	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
40,460 - Record Antifreeze Protection Level Using Refractometer	-	na	CKARLENS	Dec 19, 2017 11:15:20 PM	No	
40,461 - Refractometer Reading	Degree Fahrenheit	na	CKARLENS	Dec 19, 2017 11:15:20 PM	No	
40,470 - Pressure Test Cooling System and Check for Leaks	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
40,480 - FRA Check Coolant Hose Condition	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
40,490 - FRA Check Alternator Mount and Condition	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
44,100 - FRA Check Fuel Control and Transmission Connections	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
44,110 - FRA Check Master Cylinder Fluid Level	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
44,120 - FRA Check All Belts for Condition, Alignment and Tension	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
44,130 - FRA Check Exhaust System	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
44,140 - FRA Check Intake System	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
44,150 - FRA Inspect Turbocharger	-	na	CKARLENS	Dec 19, 2017 11:15:20 PM	No	
44,160 - FRA Inspect Power Steering and Hydraulic Fluid	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
44,170 - FRA Check All Engine or Belt Driven Components	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
44,180 - FRA Check for Leaks	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
44,190 - FRA Perform Battery Inspection	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
44,200 - FRA Check Battery Box Corrosion, Cables and Hold-Downs	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
50,000 - SECTION 5 Steering System Inspection	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
50,510 - Check Entire Steering System	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
60,000 - SECTION 6 Tires and Wheel Inspection	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
60,610 - FRA Check and Record Air Pressure	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
60,611 - Air Pressure RF	70 Pounds per Square Inch		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
60,612 - Air Pressure LF	70 Pounds per Square Inch		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
60,613 - Air Pressure RRO	65 Pounds per Square Inch		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
60,614 - Air Pressure RRI	65 Pounds per Square Inch		CKARLENS	Dec 19, 2017 11:15:20 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
60,615 - Air Pressure LRI	65 Pounds per Square Inch		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
60,616 - Air Pressure LRO	65 Pounds per Square Inch		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
60,620 - Check Valve Stems and Caps	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
60,630 - Check and Record Tread Depth	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
60,631 - Tread Depth RF	10 32nds of an inch		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
60,632 - Tread Depth LF	10 32nds of an inch		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
60,633 - Tread Depth RRO	6 32nds of an inch		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
60,634 - Tread Depth RRI	6 32nds of an inch		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
60,635 - Tread Depth LRI	5 32nds of an inch		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
60,636 - Tread Depth LRO	6 32nds of an inch		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
60,640 - Check for Mismatched Tread or Casing Design	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
60,650 - Check Sidewall Wear	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
60,660 - Inspect for Cuts and Tears	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
60,670 - Check Dual Mating With Square	-		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
60,680 - Check Wheels for Cracks and Loose Lugs	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
60,690 - Check Tires for Irregular or Alignment Wear	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
66,100 - FRA Check Outer Hubs for Leaks	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
70,000 - SECTION 7 Under Vehicle Inspection	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
70,710 - Check Vibration Damper	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
70,720 - Check Engine and Transmission Mounts	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
70,730 - FRA Check Starter	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
70,740 - FRA Check Bottom of Engine for Fluid Leaks	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
70,750 - FRA Check Transmission for Leaks	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
70,760 - FRA Check Differential Breather and Fluid	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
70,770 - FRA Check Exhaust System	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
70,780 - Check Driveline, U-joint and Slip Yokes	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
70,790 - Check All Body Mounts and Chassis Frame	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
77,100 - FRA Check Security, Integrity and Length of Ground Straps	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
77,110 - FRA Check Fuel Tank	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
77,120 - Check Suspension Components	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
77,130 - FRA Check Brake Pad Thickness and Rotor for Wear	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
77,131 - Brake Pad Thickness LF	8 Inch		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
77,132 - Brake Pad Thickness RF	8 Inch	8	CKARLENS	Dec 19, 2017 11:15:20 PM	No	
77,133 - Brake Pad Thickness LR	6 Inch	6	CKARLENS	Dec 19, 2017 11:15:20 PM	No	
77,134 - Brake Pad Thickness RR	6 Inch		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
77,135 - Brake Rotor LF	1.54 Inch		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
77,136 - Brake Rotor RF	1.55 Inch		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
77,137 - Brake Rotor LR	1.62 Inch		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
77,138 - Brake Rotor RR	1.63 Inch		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
77,140 - FRA Check Brake Hoses	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
77,150 - Check King Pins	-	na	CKARLENS	Dec 19, 2017 11:15:20 PM	No	
77,160 - FRA Check for Loose or Noisy Wheel Bearings	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
80,000 - SECTION 8 PMI Report Completion	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
80,810 - Completion of PMI Report	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
90,000 - SECTION 9 Completion of PMI	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	
90,910 - Vehicle Returned to predetermined location	Done		CKARLENS	Dec 19, 2017 11:15:20 PM	No	

Activity Sub Total

Activity 10 Sub Total	
Parts:	1.92
Labor:	0.00
Labor Hours:	2.50
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	1.92



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 50957118
Invoice No. 55345 - 50957118

Client Department:

Department: 55345M

Work Order Description

FOLLOWUP -----> replace wiper blades

Requested By: CKARLENS

Created By: CKARLENS

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 87,621 - DH

Chronology

Reported	Dec 19, 2017 10:47:14 PM	Dec 19, 2017 10:47:14 PM
Started	Dec 19, 2017 12:00:00 AM	
Completed	Dec 19, 2017 11:33:00 PM	Dec 19, 2017 11:33:00 PM
Down Time		

Work Order Notes

Line 10 Tech replaced wiper blades

Part used.

Wipers: 40520 Qty:2

Activity Header

Activity: 10 050/000 GROUP, ACCESSORIES

Activity Note: replace wiper blades

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 14 Install

Part Failure: 00 No Failure

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
19-Dec-17	40520	BLADE, WIPER, WINDSHIELD, 20"	2	4.28	8.56

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
19-Dec-17	KARLENS, Cyrius	0.75	0	0

Activity Sublet

No Data Available

Activity Checklist

No Data Available

No Data Available

Activity Sub Total

Activity 10 Sub Total

Parts:	8.56
Labor:	0.00
Labor Hours:	0.75
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	8.56



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 47788995
Invoice No. 55345 - 47788995

Client Department:

Department: 55345M

Work Order Description

PM B

Requested By: RGASPARD

Created By: RGASPARD

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 87,621 - DH

Activity Header

Activity: 20 999 TOTAL VEHICLE

Activity Note: PM B

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: B PM Level B

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
19-Dec-17	KARLENS, Cyrius	2	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

20 Desc: PM B

Task: PM B SERVICE Performed by: CKARLENS Performed on: 19-DEC-17

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
100,000 - "A" PMI SERVICING ITEMS	Done		CKARLENS	Dec 19, 2017 11:14:53 PM	No	
101,000 - FRA Change Oil Filters	Yes		CKARLENS	Dec 19, 2017 11:14:53 PM	No	
102,000 - FRA Drain Engine Oil	Yes		CKARLENS	Dec 19, 2017 11:14:53 PM	No	
103,000 - FRA Check Transmission Fluid	Done		CKARLENS	Dec 19, 2017 11:14:53 PM	No	
104,000 - Lubricate Chassis	Done		CKARLENS	Dec 19, 2017 11:14:53 PM	No	
105,000 - Replace or Clean A/C Filters	-	Replace Air Filter	CKARLENS	Dec 19, 2017 11:14:53 PM	Yes	50957047
107,000 - FRA Change Primary Fuel Filter	No	na	CKARLENS	Dec 19, 2017 11:14:53 PM	No	
108,000 - Lube all pivoting Mechanisms	Done		CKARLENS	Dec 19, 2017 11:14:53 PM	No	
200,000 - "B" PMI SERVICING ITEMS (12 MONTH)	Done		CKARLENS	Dec 19, 2017 11:14:53 PM	No	
201,000 - Service Crankcase Breather	Done		CKARLENS	Dec 19, 2017 11:14:53 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
203,000 - FRA Change Automatic Transmission Fluid	No		CKARLENS	Dec 19, 2017 11:14:53 PM	No	
204,000 - FRA Change Power Steering Fluid and Filter	No		CKARLENS	Dec 19, 2017 11:14:53 PM	No	
205,000 - Complete Engine Diagnostics and Clear Codes when Completed	Done		CKARLENS	Dec 19, 2017 11:14:53 PM	No	

Activity Sub Total

Activity 20 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	2.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 50957118
Invoice No. 55345 - 50957118

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FD4E4FS7EDB17176
FOLLOWUP -----> replace wiper blades		Ford E450 Champion Challenger	
Requested By:	CKARLENS	Status:	40 - Closed (40)
Created By:	CKARLENS	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	87,621 - DH

Activity Header
Activity:20 999/999/999 TOTAL VEHICLE
Activity Note: Risk assesment
Reason for Repair: 05 Inspection, Routine
Work Accomplished: 06 Inspect
Part Failure: 00 No Failure
Activity Comments:

Activity Parts
No Data Available

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
19-Dec-17	KARLENS,Cyrus	0.2833333	0	0

Activity Sublet
No Data Available

Activity Checklist						
Check List						
20 Desc: Risk assesment						
Task: PRA and Meter Readings Performed by: CKARLENS Performed on: 19-DEC-17						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		CKARLENS	Dec 19, 2017 11:31:07 PM	No	
20 - Miles			CKARLENS	Dec 19, 2017 11:31:07 PM	No	
30 - Kilometers			CKARLENS	Dec 19, 2017 11:31:07 PM	No	
40 - Hours			CKARLENS	Dec 19, 2017 11:31:07 PM	No	

Activity Sub Total	
Activity 20 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	0.28
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00

Work Order Footer	
Work Order 50957118 Total	
Parts:	8.56
Labor:	0.00
Labor Hours:	1.03

	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	8.56



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 47788995
Invoice No. 55345 - 47788995

Client Department:

Department: 55345M

Work Order Description

PM B

Requested By: RGASPARD

Created By: RGASPARD

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 87,621 - DH

Activity Header

Activity: 30 999 TOTAL VEHICLE

Activity Note: PRAMETER

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
19-Dec-17	KARLENS, Cyrius	0.2833333	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

30 Desc: PRAMETER

Task: PRA and Meter Readings Performed by: CKARLENS Performed on: 19-DEC-17

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		CKARLENS	Dec 19, 2017 9:42:03 PM	No	
20 - Miles			CKARLENS	Dec 19, 2017 9:42:03 PM	No	
30 - Kilometers			CKARLENS	Dec 19, 2017 9:42:03 PM	No	
40 - Hours			CKARLENS	Dec 19, 2017 9:42:03 PM	No	

Activity Sub Total

Activity 30 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	0.28
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00

Work Order Footer

Work Order 47788995 Total

Parts:	1.92
Labor:	0.00
Labor Hours:	4.78

	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	1.92



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 50957047
Invoice No. 55345 - 50957047

Client Department:

Department: 55345M

Work Order Description

FOLLOW UP -----> Replace air filter

Requested By: CKARLENS

Created By: CKARLENS

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 87,621 - DH

Chronology

Reported	Dec 19, 2017 9:43:35 PM	Dec 19, 2017 9:43:35 PM
Started	Dec 19, 2017 12:00:00 AM	
Completed	Dec 19, 2017 11:15:00 PM	Dec 19, 2017 11:15:00 PM
Down Time		

Work Order Notes

Line 10 Tech replace Air Filter.

Part used: pa4075 Qty:1

Activity Header

Activity: 10 050/000 GROUP, ACCESSORIES

Activity Note: Replace Air Filter

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 14 Install

Part Failure: 00 No Failure

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
19-Dec-17	PA4075	OUT OF SERVICE DO NOT ORDER FILTER, AIR, PAPER SAME AS AF25590	1	5.18	5.18

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
19-Dec-17	KARLENS, Cyrius	0.6333333	0	0

Activity Sublet

No Data Available

Activity Checklist

No Data Available

No Data Available

Activity Sub Total

Activity 10 Sub Total

Parts:	5.18
Labor:	0.00
Labor Hours:	0.63
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	5.18



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 50957047
Invoice No. 55345 - 50957047

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
FOLLOW UP -----> Replace air filter		Ford E450 Champion Challenger	
Requested By:	CKARLENS	Status:	40 - Closed (40)
Created By:	CKARLENS	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	87,621 - DH

Activity Header
Activity:20 999/999/999 TOTAL VEHICLE
Activity Note: Risk assesment
Reason for Repair: 05 Inspection, Routine
Work Accomplished: 06 Inspect
Part Failure: 00 No Failure
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
19-Dec-17	PA4075	FILTER, AIR SEE P546597	-1	5.18	-5.18
19-Dec-17	PA4075	FILTER, AIR SEE P546597	1	5.18	5.18

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
19-Dec-17	KARLENS,Cyrius	0.2833333	0	0

Activity Sublet
No Data Available

Activity Checklist							
Check List							
20 Desc: Risk assesment							
Task: PRA and Meter Readings Performed by: CKARLENS Performed on: 19-DEC-17							
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO	
10 - Have you successfully completed the Personal Risk Assessment?	Done		CKARLENS	Dec 19, 2017 10:54:24 PM	No		
20 - Miles			CKARLENS	Dec 19, 2017 10:54:24 PM	No		
30 - Kilometers			CKARLENS	Dec 19, 2017 10:54:24 PM	No		
40 - Hours			CKARLENS	Dec 19, 2017 10:54:24 PM	No		


Activity Sub Total		Activity 20 Sub Total	
Parts:			0.00
Labor:			0.00
Labor Hours:			0.28
Sublet Parts:			0.00
Sublet Labor:			0.00
Activity Sub Total			0.00

Work Order Footer

Work Order 50957047 Total	
Parts:	5.18
Labor:	0.00
Labor Hours:	0.92
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	5.18



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 50446912
Invoice No. 55345 - 50446912

Client Department:

Department: 55345M

Work Order Description

Needs batteries and battery terminals

Requested By: RGASPARD

Created By: RGASPARD

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 86,499 - DH

Chronology

Reported	Dec 8, 2017 9:16:32 PM	Dec 8, 2017 9:16:32 PM
Started	Dec 8, 2017 12:00:00 AM	
Completed	Dec 8, 2017 10:31:00 PM	Dec 8, 2017 10:31:00 PM
Down Time		

Work Order Notes

Line 10

COMPLAINT: needs batteries and terminals

CAUSE:bad batteries and terminals crack

CORRECTION: replaced batteries and terminals

Terminal part number 3940905 qty 2

Batteries part number 34-AGM qty2

Activity Header

Activity:5 999 TOTAL VEHICLE

Activity Note: Personal Risk Assessment

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
08-Dec-17	Gaspard,Ronald	0.0833333	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: Personal Risk Assessment

Task: PRA and Meter Readings Performed by: RGASPARD Performed on: 08-DEC-17

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		RGASPARD	Dec 8, 2017 9:20:56 PM	No	
20 - Miles			RGASPARD	Dec 8, 2017 9:20:56 PM	No	
30 - Kilometers			RGASPARD	Dec 8, 2017	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO	
				9:20:56 PM			
40 - Hours			RGASPARD	Dec 8, 2017 9:20:56 PM	No		
Activity Sub Total							
				Activity 5 Sub Total			
				Parts:			0.00
				Labor:			0.00
				Labor Hours:			0.08
				Sublet Parts:			0.00
				Sublet Labor:			0.00
				Activity Sub Total			0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 50446912
Invoice No. 55345 - 50446912

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Needs batteries and battery terminals		Ford E450 Champion Challenger	
Requested By:	RGASPARD	Status:	40 - Closed (40)
Created By:	RGASPARD	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	86,499 - DH

Activity Header
Activity: 15 030 ELECTRICAL GROUP
Activity Note:
Reason for Repair: 05 Inspection, Routine
Work Accomplished:
Part Failure:
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
08-Dec-17	34AGM	BATTERY, AGM, GROUP-34	2	107.67	215.34

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
08-Dec-17	Gaspard,Ronald	1.5	0	0

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available

Activity Sub Total	
	Activity 15 Sub Total
Parts:	215.34
Labor:	0.00
Labor Hours:	1.50
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	215.34

Work Order Footer	
	Work Order 50446912 Total
Parts:	215.34
Labor:	0.00
Labor Hours:	1.58
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	215.34



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 44016737
Invoice No. 55345 - 44016737

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
PM A		Ford E450 Champion Challenger	
Requested By:	AOWENS	Status:	40 - Closed (40)
Created By:	AOWENS	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	83,270 - DH

Chronology		
Reported	Nov 9, 2017 12:31:29 PM	Nov 9, 2017 12:31:29 PM
Started	Nov 10, 2017 12:00:00 AM	
Completed	Nov 10, 2017 11:38:00 PM	Nov 10, 2017 11:38:00 PM
Down Time		

Work Order Notes

Line 10 COMPLAINT:pmA

CAUSE:Service

CORRECTION:perform pmA Service
Oil filter B329 qty 1
Engine oil 5w20 qty 7 qts

Activity Header						
Activity: 10 999 TOTAL VEHICLE						
Activity Note: Light Medium Duty PMI						
Reason for Repair: 08 Preventive Maintenance						
Work Accomplished: 06 Inspect						
Part Failure:						
Activity Comments:						
Activity Parts						
No Data Available						
Activity Labor						
Booked Date	Technician	Hours	Shop Rate	Extended		
10-Nov-17	Gaspard,Ronald	1.5333333	0	0		
Activity Sublet						
No Data Available						
Activity Checklist						
Check List						
10 Desc: Light Medium Duty PMI						
Task: First Transit Light-Medium Duty PMI Performed by: RGASPARD Performed on: 10-NOV-17						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,000 - SECTION 1 Preparation and Drive On (In Lot) Inspection	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
10,100 - Safety Inspection	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
10,110 - FRA Check Drivers Pre-trip or DVIR/EVIR & Authorization Forms	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
10,120 - FRA Check All Warning Lights and Alarms	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,130 - FRA Check Automatic Transmission Neutral Start Operation	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
10,140 - Check Service Brakes	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
10,150 - FRA Start Engine and Listen for Any Unusual Noises	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
10,160 - FRA Check Instruments and Horns	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
10,170 - Check Fast Idle	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
10,180 - Check Starter Protection Circuit	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
10,190 - Check Reverse Warning System	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
11,100 - Check Parking Brake	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
11,110 - Check HVAC Switches and Other Controls	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
11,120 - FRA Inspect Windshields, Mirror and Sun Visor Condition	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
11,130 - FRA Check Wiper and Washer Operation	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
11,140 - Road Test: Check for Proper Operation	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
11,150 - Perform Brake Test	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
11,152 - Decelerometer Results Test 1	FEET	na	RGASPARD	Nov 10, 2017 11:04:33 PM	No	
11,154 - Decelerometer Results Test 2	FEET	na	RGASPARD	Nov 10, 2017 11:04:33 PM	No	
11,156 - Decelerometer Results Test 3	FEET	na	RGASPARD	Nov 10, 2017 11:04:33 PM	No	
11,161 - FRA Check/Record Oil Pressure / @1500 rpm	Pounds per Square Inch	na	RGASPARD	Nov 10, 2017 11:04:33 PM	No	
11,162 - FRA Check/Record Water Temperature	Degree Fahrenheit	na	RGASPARD	Nov 10, 2017 11:04:33 PM	No	
11,170 - FRA Check Door Operation	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
11,180 - FRA Check Operation of All Other Accessories	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
20,000 - SECTION 2 Interior Circle Inspection	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
20,210 - Check Condition of Operator's Area	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
20,220 - Check Accelerator and Brake Pedals	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
20,230 - FRA Check Wiring Under Dash	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
20,240 - FRA Check Interior Lights	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
20,250 - FRA Check Interior Electrical Panels	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
20,260 - Check Stop Request System	-	na	RGASPARD	Nov 10, 2017 11:04:33 PM	No	
20,270 - Check Fare Box Mounting (If Applicable)	-	na	RGASPARD	Nov 10, 2017 11:04:33 PM	No	
20,280 - Check Seats, Seat Belts, Hand Rails and Floor Covering	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
20,290 - Check for Physical Damage, Water Leaks, and Graffiti	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
22,100 - Check Emergency Windows and Glass Condition	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
22,110 - Check Emergency Hatches	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
22,120 - Check All Safety Equipment	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
30,000 - SECTION 3 Exterior Circle Inspection	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
30,310 - Check Passenger Doors	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
30,320 - Inspect Step-well and Hand Rails	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
30,330 - Check Wheelchair Lift Operation	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
30,340 - FRA Check Destination Sign and Run Box	-	na	RGASPARD	Nov 10, 2017 11:04:33 PM	No	
30,350 - FRA Inspect Mirror and Mountings	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
30,360 - Check for Physical Damage and Decals	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
30,370 - Check Wiper Blade and Arm Condition	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
30,380 - Check Exterior Compartment Doors	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
30,390 - FRA Check Fuel Tank Cap	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
33,100 - Check Lights and Reflectors	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
33,110 - Check License Plate, Permits and State Inspection Decals	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
40,000 - SECTION 4 Engine Compartment Inspection	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
40,410 - FRA Check Engine Compartment/Condition for Fire Risk	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
40,420 - Check Hood	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
40,430 - Check Fan, Shroud and Radiator	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
40,440 - Test Coolant System Using Test Strips and Record Results	-	na	RGASPARD	Nov 10, 2017 11:04:33 PM	No	
40,441 - Inhibitor Test Pass or Fail (Indicate with a Yes or No)	No	na	RGASPARD	Nov 10, 2017 11:04:33 PM	No	
40,442 - Freeze Point	Degree Fahrenheit	na	RGASPARD	Nov 10, 2017 11:04:33 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
40,450 - FRA Check Coolant Recovery System Condition & for Leaks	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
40,460 - Record Antifreeze Protection Level Using Refractometer	-	na	RGASPARD	Nov 10, 2017 11:04:33 PM	No	
40,461 - Refractometer Reading	Degree Fahrenheit	na	RGASPARD	Nov 10, 2017 11:04:33 PM	No	
40,470 - Pressure Test Cooling System and Check for Leaks	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
40,480 - FRA Check Coolant Hose Condition	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
40,490 - FRA Check Alternator Mount and Condition	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
44,100 - FRA Check Fuel Control and Transmission Connections	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
44,110 - FRA Check Master Cylinder Fluid Level	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
44,120 - FRA Check All Belts for Condition, Alignment and Tension	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
44,130 - FRA Check Exhaust System	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
44,140 - FRA Check Intake System	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
44,150 - FRA Inspect Turbocharger	-	na	RGASPARD	Nov 10, 2017 11:04:33 PM	No	
44,160 - FRA Inspect Power Steering and Hydraulic Fluid	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
44,170 - FRA Check All Engine or Belt Driven Components	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
44,180 - FRA Check for Leaks	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
44,190 - FRA Perform Battery Inspection	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
44,200 - FRA Check Battery Box Corrosion, Cables and Hold-Downs	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
50,000 - SECTION 5 Steering System Inspection	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
50,510 - Check Entire Steering System	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
60,000 - SECTION 6 Tires and Wheel Inspection	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
60,610 - FRA Check and Record Air Pressure	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
60,611 - Air Pressure RF	70 Pounds per Square Inch		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
60,612 - Air Pressure LF	70 Pounds per Square Inch		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
60,613 - Air Pressure RRO	65 Pounds per Square Inch		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
60,614 - Air Pressure RRI	65 Pounds per Square Inch		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
60,615 - Air Pressure LRI	65 Pounds per Square Inch		RGASPARD	Nov 10, 2017 11:04:33 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
60,616 - Air Pressure LRO	65 Pounds per Square Inch		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
60,620 - Check Valve Stems and Caps	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
60,630 - Check and Record Tread Depth	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
60,631 - Tread Depth RF	12 32nds of an inch		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
60,632 - Tread Depth LF	12 32nds of an inch		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
60,633 - Tread Depth RRO	6 32nds of an inch		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
60,634 - Tread Depth RRI	6 32nds of an inch		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
60,635 - Tread Depth LRI	8 32nds of an inch		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
60,636 - Tread Depth LRO	6 32nds of an inch		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
60,640 - Check for Mismatched Tread or Casing Design	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
60,650 - Check Sidewall Wear	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
60,660 - Inspect for Cuts and Tears	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
60,670 - Check Dual Mating With Square	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
60,680 - Check Wheels for Cracks and Loose Lugs	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
60,690 - Check Tires for Irregular or Alignment Wear	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
66,100 - FRA Check Outer Hubs for Leaks	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
70,000 - SECTION 7 Under Vehicle Inspection	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
70,710 - Check Vibration Damper	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
70,720 - Check Engine and Transmission Mounts	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
70,730 - FRA Check Starter	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
70,740 - FRA Check Bottom of Engine for Fluid Leaks	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
70,750 - FRA Check Transmission for Leaks	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
70,760 - FRA Check Differential Breather and Fluid	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
70,770 - FRA Check Exhaust System	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
70,780 - Check Driveline, U-joint and Slip Yokes	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
70,790 - Check All Body Mounts and Chassis Frame	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	


Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
77,100 - FRA Check Security, Integrity and Length of Ground Straps	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
77,110 - FRA Check Fuel Tank	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
77,120 - Check Suspension Components	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
77,130 - FRA Check Brake Pad Thickness and Rotor for Wear	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
77,131 - Brake Pad Thickness LF	4 Inch		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
77,132 - Brake Pad Thickness RF	4 Inch	needs front brakes job	RGASPARD	Nov 10, 2017 11:04:33 PM	Yes	47786703
77,133 - Brake Pad Thickness LR	10 Inch		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
77,134 - Brake Pad Thickness RR	10 Inch		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
77,135 - Brake Rotor LF	36 Inch		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
77,136 - Brake Rotor RF	36 Inch		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
77,137 - Brake Rotor LR	38 Inch		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
77,138 - Brake Rotor RR	38 Inch		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
77,140 - FRA Check Brake Hoses	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
77,150 - Check King Pins	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
77,160 - FRA Check for Loose or Noisy Wheel Bearings	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
80,000 - SECTION 8 PMI Report Completion	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
80,810 - Completion of PMI Report	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
90,000 - SECTION 9 Completion of PMI	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	
90,910 - Vehicle Returned to predetermined location	Done		RGASPARD	Nov 10, 2017 11:04:33 PM	No	

Activity Sub Total

Activity 10 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	1.53
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 47786703
Invoice No. 55345 - 47786703

Client Department:

Department: 55345M

Work Order Description

Followup-----> needs front brakes job

Requested By: RGASPARD

Created By: RGASPARD

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 83,270 - DH

Chronology

Reported	Nov 10, 2017 11:04:33 PM	Nov 10, 2017 11:04:33 PM
Started	Nov 10, 2017 12:00:00 AM	
Completed	Nov 10, 2017 11:38:00 PM	Nov 10, 2017 11:38:00 PM
Down Time		

Work Order Notes

Line 10 Needs front brakes job

Wear

Replaced front brake pads and lubed guide pins

Torque wheels 140 lbs second torque 140 lbs

Part number BRSD 1328 qty 1

Activity Header

Activity: 10 013/001 BRAKES & DRUMS, FRONT

Activity Note: needs front brakes job

Reason for Repair: 05 Inspection, Routine

Work Accomplished:

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
10-Nov-17	BRSD-1328	PADS, BRAKE, DISC, FRONT	1	50.32	50.32

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
10-Nov-17	Gaspard,Ronald	1	0	0

Activity Sublet

No Data Available

Activity Checklist

No Data Available

No Data Available

Activity Sub Total

Activity 10 Sub Total

Parts:	50.32
Labor:	0.00
Labor Hours:	1.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	50.32



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 44016737
Invoice No. 55345 - 44016737

Client Department:

Department: 55345M

Work Order Description

PM A

Requested By: AOWENS

Created By: AOWENS

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 83,270 - DH

Activity Header

Activity: 20 999 TOTAL VEHICLE

Activity Note: PM A

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: A PM Level A

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
10-Nov-17	B329(F)	GOING OUT OF SERVICE SEE BALDWIN B329 IN THE FLEET ORG. FILTER, OIL, SPIN-ON	1	1.92	1.92

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
10-Nov-17	Gaspard, Ronald	1.0333333	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List						
20 Desc: PM A						
Task: PM A SERVICE Performed by: RGASPARD Performed on: 10-NOV-17						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
100,000 - "A" PMI SERVICING ITEMS	Done		RGASPARD	Nov 10, 2017 11:05:22 PM	No	
101,000 - FRA Change Oil Filters	Yes		RGASPARD	Nov 10, 2017 11:05:22 PM	No	
102,000 - FRA Drain Engine Oil	Yes		RGASPARD	Nov 10, 2017 11:05:22 PM	No	
103,000 - FRA Check Transmission Fluid	Done		RGASPARD	Nov 10, 2017 11:05:22 PM	No	
104,000 - Lubricate Chassis	-	na	RGASPARD	Nov 10, 2017 11:05:22 PM	No	
105,000 - Replace or Clean A/C Filters	Done		RGASPARD	Nov 10, 2017 11:05:22 PM	No	
107,000 - FRA Change Primary Fuel Filter	No	na	RGASPARD	Nov 10, 2017 11:05:22 PM	No	
108,000 - Lube all pivoting Mechanisms	Done		RGASPARD	Nov 10, 2017 11:05:22 PM	No	

Activity Sub Total

		Activity 20 Sub Total	
		Parts:	1.92
		Labor:	0.00
		Labor Hours:	1.03
		Sublet Parts:	0.00
		Sublet Labor:	0.00
		Activity Sub Total	1.92



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 47786703
Invoice No. 55345 - 47786703

Client Department:

Department: 55345M

Work Order Description

Followup-----> needs front brakes job

Requested By: RGASPARD

Created By: RGASPARD

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 83,270 - DH

Activity Header

Activity: 20 079 DEVICES, SAFETY/STABILITY, TRAILER

Activity Note:

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure: 00 No Failure

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
10-Nov-17	Gaspard, Ronald	0.0666666	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List						
20 Desc: Task: PRA and Meter Readings Performed by: RGASPARD Performed on: 10-NOV-17						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		RGASPARD	Nov 10, 2017 11:19:28 PM	No	
20 - Miles			RGASPARD	Nov 10, 2017 11:19:28 PM	No	
30 - Kilometers			RGASPARD	Nov 10, 2017 11:19:28 PM	No	
40 - Hours			RGASPARD	Nov 10, 2017 11:19:28 PM	No	

Activity Sub Total

Activity 20 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	0.07
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00

Work Order Footer

Work Order 47786703 Total	
Parts:	50.32
Labor:	0.00
Labor Hours:	1.07

	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	50.32



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 44016737
Invoice No. 55345 - 44016737

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
PM A		Ford E450 Champion Challenger	
Requested By:	AOWENS	Status:	40 - Closed (40)
Created By:	AOWENS	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	83,270 - DH

Activity Header
Activity:30 999 TOTAL VEHICLE
Activity Note: PRAMETER
Reason for Repair: 05 Inspection, Routine
Work Accomplished: 06 Inspect
Part Failure:
Activity Comments:

Activity Parts
No Data Available

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
10-Nov-17	Gaspard,Ronald	0.1833333	0	0

Activity Sublet
No Data Available

Activity Checklist						
Check List						
30 Desc: PRAMETER						
Task: PRA and Meter Readings Performed by: RGASPARD Performed on: 10-NOV-17						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		RGASPARD	Nov 10, 2017 11:05:47 PM	No	
20 - Miles			RGASPARD	Nov 10, 2017 11:05:47 PM	No	
30 - Kilometers			RGASPARD	Nov 10, 2017 11:05:47 PM	No	
40 - Hours			RGASPARD	Nov 10, 2017 11:05:47 PM	No	

Activity Sub Total	
Activity 30 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	0.18
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00

Work Order Footer	
Work Order 44016737 Total	
Parts:	1.92
Labor:	0.00
Labor Hours:	2.75

	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	1.92



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 45619636
Invoice No. 55345 - 45619636

Client Department:

Department: 55345M

Work Order Description

Spark plugs///serpentine belt /// clean throttle body and mass air flow sensor

Requested By: EDTORRES

Created By: EDTORRES

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.:4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 80,929 - DH

Chronology

Reported	Oct 19, 2017 12:23:31 PM	Oct 19, 2017 12:23:31 PM
Started	Oct 19, 2017 12:00:00 AM	
Completed	Oct 19, 2017 1:15:00 PM	Oct 19, 2017 1:15:00 PM
Down Time		

Work Order Notes

Line 10

Spark plug

¿

COMPLAINT:

Manufacturer recommended spark plug service by mileage

¿

CAUSE:

Normal wear.

¿

CORRECTION:

Removed all spark plugs and spark plug boots. Replaced them with new spark plugs and spark plug boots. Applied dielectric grease to the the spring inside the spark plug boot.

#2 spark plug was difficult to remove because it was stuck. I imagine next time it will be easier but with some difficulty.

PARTS

Qty 10 Boot WR-6128

Qty 10 spark plug SP521

Line 20 Cleaned throttle body and mass air flow sensor with appropriate adorable cleaners. Line 30 Noticed the serpentine belt has cracks

Replaced belt with a new serpentine belt.

Parts

Qty 1 serpentine belt 5061360

Activity Header

Activity:5 999 TOTAL VEHICLE

Activity Note: Personal Risk Assessment

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet No Data Available						
Activity Checklist						
Check List 5 Desc: Personal Risk Assessment Task: PRA and Meter Readings Performed by: EDTORRES Performed on: 19-OCT-17						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		EDTORRES	Oct 19, 2017 12:36:34 PM	No	
20 - Miles			EDTORRES	Oct 19, 2017 12:36:34 PM	No	
30 - Kilometers			EDTORRES	Oct 19, 2017 12:36:34 PM	No	
40 - Hours			EDTORRES	Oct 19, 2017 12:36:34 PM	No	
Activity Sub Total						
			Activity 5 Sub Total			
			Parts: 0.00			
			Labor: 0.00			
			Labor Hours: 0.00			
			Sublet Parts: 0.00			
			Sublet Labor: 0.00			
			Activity Sub Total <u>0.00</u>			



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 45619636
Invoice No. 55345 - 45619636

Client Department:		
Department:	55345M	Equipment No.: 4514-P
Work Order Description		VIN: 1FDFE4FS7EDB17176
Spark plugs///serpentine belt /// clean throttle body and mass air flow sensor		Ford E450 Champion Challenger
Requested By:	EDITORRES	Status: 40 - Closed (40)
Created By:	EDITORRES	Priority: 1 - Low
Assigned To:		Driver:
Class:	WO - WORK ORDER	Phone:
Arrangement:	Unassigned	ETA:
Potential Warranty:	No	Meter: 80,929 - DH

Activity Header
Activity:15 040 ENGINE/MOTOR SYSTEMS GROUP
Activity Note: Spark plugs///serpentine belt /// clean throttle body and mass air flow sensor
Reason for Repair: 05 Inspection, Routine
Work Accomplished:
Part Failure:
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
19-Oct-17	SP521	PLUG, SPARK, 5.4L, FORD	10	4.15	41.5
19-Oct-17	WR6128	BOOT, PLUG, SPARK	10	5.48	54.8
19-Oct-17	5061360	BELT, SERPENTINE, 6-RIB, 136.02"L X 0.82"W	1	27.31	27.31

Activity Labor					
Booked Date	Technician	Hours	Shop Rate	Extended	
19-Oct-17	Torres,Edwin	4.25	0	0	

Activity Sublet
No Data Available


Activity Checklist
No Data Available
No Data Available

Activity Sub Total		Activity 15 Sub Total	
Parts:	123.61	Labor:	0.00
Labor Hours:	4.25	Labor Hours:	4.25
Sublet Parts:	0.00	Sublet Parts:	0.00
Sublet Labor:	0.00	Sublet Labor:	0.00
Activity Sub Total		123.61	

Work Order Footer		Work Order 45619636 Total	
Parts:	123.61	Labor:	0.00
Labor Hours:	4.25	Labor Hours:	4.25
Sublet Parts:	0.00	Sublet Parts:	0.00
Sublet Labor:	0.00	Sublet Labor:	0.00
Activity Sub Total		123.61	



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 45400328
Invoice No. 55345 - 45400328

Client Department:

Department: 55345M

Work Order Description

Front tires near min specs.

Requested By: RAURODRIGUEZ

Created By: RAURODRIGUEZ

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 80,552 - DH

Chronology

Reported	Oct 17, 2017 6:20:40 AM	Oct 17, 2017 6:20:40 AM
Started	Oct 17, 2017 12:00:00 AM	
Completed	Oct 17, 2017 7:31:00 AM	Oct 17, 2017 7:31:00 AM
Down Time		

Work Order Notes

Line 10

COMPLAINT:

Front tires near min specs.

CAUSE:

Normal wear

CORRECTION:

Removed and replaced front tires. Torque and re torque 140 f/pounds, road test.

Parts: 2 tires 189752

Activity Header

Activity: 5 999 TOTAL VEHICLE

Activity Note: Personal Risk Assessment

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: Personal Risk Assessment


Task: PRA and Meter Readings Performed by: RAURODRIGUEZ Performed on: 17-OCT-17

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		RAURODRIGUEZ	Oct 17, 2017 6:27:15 AM	No	
20 - Miles			RAURODRIGUEZ	Oct 17, 2017 6:27:15 AM	No	
30 - Kilometers			RAURODRIGUEZ	Oct 17, 2017 6:27:15 AM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
40 - Hours			RAURODRIGUEZ	Oct 17, 2017 6:27:15 AM	No	
Activity Sub Total						
				Activity 5 Sub Total		
				Parts:		0.00
				Labor:		0.00
				Labor Hours:		0.00
				Sublet Parts:		0.00
				Sublet Labor:		0.00
				Activity Sub Total		0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 45400328
Invoice No. 55345 - 45400328

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Front tires near min specs.		Ford E450 Champion Challenger	
Requested By:	RAURODRIGUEZ	Status:	40 - Closed (40)
Created By:	RAURODRIGUEZ	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	80,552 - DH

Activity Header
Activity: 15 017/001/000 TIRE, PNEUMATIC
Activity Note: Front tires near min specs.
Reason for Repair: 05 Inspection, Routine
Work Accomplished: 03 Replace New
Part Failure: 44 Worn
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
17-Oct-17	189752	TIRE, LT225/75R16, TLBLPS115RE, TRANSFORCE HT 10PLY 1622575E, NEW	2	104.92	209.84

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
17-Oct-17	Rodriguez,Raul	1.3166666	0	0

Activity Sublet
No Data Available


Activity Checklist
No Data Available
No Data Available

Activity Sub Total		Activity 15 Sub Total	
Parts:	209.84	Labor:	0.00
Labor Hours:	1.32	Labor Hours:	1.32
Sublet Parts:	0.00	Sublet Parts:	0.00
Sublet Labor:	0.00	Sublet Labor:	0.00
Activity Sub Total		209.84	

Work Order Footer		Work Order 45400328 Total	
Parts:	209.84	Labor:	0.00
Labor Hours:	1.32	Labor Hours:	1.32
Sublet Parts:	0.00	Sublet Parts:	0.00
Sublet Labor:	0.00	Sublet Labor:	0.00
Activity Sub Total		209.84	



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 38676455
Invoice No. 55345 - 38676455

Client Department:

Department: 55345M

Work Order Description

PM A

Requested By: CVERGARA

Created By: CVERGARA

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 78,985 - DH

Chronology

Reported	Oct 2, 2017 12:20:41 PM	Oct 2, 2017 12:20:41 PM
Started	Oct 2, 2017 12:00:00 AM	
Completed	Oct 2, 2017 11:57:00 PM	Oct 2, 2017 11:57:00 PM
Down Time		

Work Order Notes

Line 10 COMPLAINT: PM A

CAUSE: PM A service due

CORRECTION: Performed and completed PM A...

Changed engine oil and replaced engine oil filter..

Added Six (6) Quarts of engine oil

Replaced Rear A/C filter

Replaced engine oil drain plug

Parts used #B329. Qty:1

#F75Z-6730-BA. Qty:1

Activity Header

Activity:10 999 TOTAL VEHICLE

Activity Note: Light Medium Duty PMI

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
02-Oct-17	B329	GOING OUT OF SERVICE DO NOT ORDER USE B329 IN THE FLEET ORG FILTER, OIL	1	1.92	1.92
02-Oct-17	F75Z-6730-BA	PLUG, DRAIN, OIL, ENGINE, 3.0L	1	6.66	6.66

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
02-Oct-17	Delva,Terry	2	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: Light Medium Duty PMI

Task: First Transit Light-Medium Duty PMI Performed by: TDELVA Performed on: 02-OCT-17

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,000 - SECTION 1 Preparation and Drive On (In Lot) Inspection	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
10,100 - Safety Inspection	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
10,110 - FRA Check Drivers Pre-trip or DVIR/EVIR & Authorization Forms	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
10,120 - FRA Check All Warning Lights and Alarms	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
10,130 - FRA Check Automatic Transmission Neutral Start Operation	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
10,140 - Check Service Brakes	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
10,150 - FRA Start Engine and Listen for Any Unusual Noises	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
10,160 - FRA Check Instruments and Horns	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
10,170 - Check Fast Idle	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
10,180 - Check Starter Protection Circuit	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
10,190 - Check Reverse Warning System	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
11,100 - Check Parking Brake	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
11,110 - Check HVAC Switches and Other Controls	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
11,120 - FRA Inspect Windshields, Mirror and Sun Visor Condition	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
11,130 - FRA Check Wiper and Washer Operation	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
11,140 - Road Test: Check for Proper Operation	-		TDELVA	Oct 2, 2017 8:44:54 PM	Yes	44003796
11,150 - Perform Brake Test	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
11,152 - Decelerometer Results Test 1	FEET	n/a	TDELVA	Oct 2, 2017 8:44:54 PM	No	
11,154 - Decelerometer Results Test 2	FEET	n/a	TDELVA	Oct 2, 2017 8:44:54 PM	No	
11,156 - Decelerometer Results Test 3	FEET	n/a	TDELVA	Oct 2, 2017 8:44:54 PM	No	
11,161 - FRA Check/Record Oil Pressure / @1500 rpm	Pounds per Square Inch	n/a	TDELVA	Oct 2, 2017 8:44:54 PM	No	
11,162 - FRA Check/Record Water Temperature	Degree Fahrenheit	n/a	TDELVA	Oct 2, 2017 8:44:54 PM	No	
11,170 - FRA Check Door Operation	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
11,180 - FRA Check Operation of All Other Accessories	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
20,000 - SECTION 2 Interior Circle Inspection	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
20,210 - Check Condition of Operator's Area	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
20,220 - Check Accelerator and Brake Pedals	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
20,230 - FRA Check Wiring Under Dash	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
20,240 - FRA Check Interior Lights	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
20,250 - FRA Check Interior Electrical Panels	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
20,260 - Check Stop Request System	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
20,270 - Check Fare Box Mounting (If Applicable)	-	n/a	TDELVA	Oct 2, 2017 8:44:54 PM	No	
20,280 - Check Seats, Seat Belts, Hand Rails and Floor Covering	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
20,290 - Check for Physical Damage, Water Leaks, and Graffiti	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
22,100 - Check Emergency Windows and Glass Condition	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
22,110 - Check Emergency Hatches	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
22,120 - Check All Safety Equipment	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
30,000 - SECTION 3 Exterior Circle Inspection	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
30,310 - Check Passenger Doors	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
30,320 - Inspect Step-well and Hand Rails	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
30,330 - Check Wheelchair Lift Operation	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
30,340 - FRA Check Destination Sign and Run Box	-	n/a	TDELVA	Oct 2, 2017 8:44:54 PM	No	
30,350 - FRA Inspect Mirror and Mountings	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
30,360 - Check for Physical Damage and Decals	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
30,370 - Check Wiper Blade and Arm Condition	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
30,380 - Check Exterior Compartment Doors	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
30,390 - FRA Check Fuel Tank Cap	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
33,100 - Check Lights and Reflectors	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
33,110 - Check License Plate, Permits and State Inspection Decals	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
40,000 - SECTION 4 Engine Compartment Inspection	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
40,410 - FRA Check Engine Compartment/Condition for Fire Risk	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
40,420 - Check Hood	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
40,430 - Check Fan, Shroud and Radiator	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
40,440 - Test Coolant System Using Test Strips and Record Results	-	n/a	TDELVA	Oct 2, 2017 8:44:54 PM	No	
40,441 - Inhibitor Test Pass or Fail (Indicate with a Yes or No)	No	n/a	TDELVA	Oct 2, 2017 8:44:54 PM	No	
40,442 - Freeze Point	Degree Fahrenheit	n/a	TDELVA	Oct 2, 2017 8:44:54 PM	No	
40,450 - FRA Check Coolant Recovery System Condition & for Leaks	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
40,460 - Record Antifreeze Protection Level Using Refractometer	-	n/a	TDELVA	Oct 2, 2017 8:44:54 PM	No	
40,461 - Refractometer Reading	Degree Fahrenheit	n/a	TDELVA	Oct 2, 2017 8:44:54 PM	No	
40,470 - Pressure Test Cooling System and Check for Leaks	-	n/a	TDELVA	Oct 2, 2017 8:44:54 PM	No	
40,480 - FRA Check Coolant Hose Condition	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
40,490 - FRA Check Alternator Mount and Condition	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
44,100 - FRA Check Fuel Control and Transmission Connections	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
44,110 - FRA Check Master Cylinder Fluid Level	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
44,120 - FRA Check All Belts for Condition, Alignment and Tension	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
44,130 - FRA Check Exhaust System	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
44,140 - FRA Check Intake System	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
44,150 - FRA Inspect Turbocharger	-	n/a	TDELVA	Oct 2, 2017 8:44:54 PM	No	
44,160 - FRA Inspect Power Steering and Hydraulic Fluid	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
44,170 - FRA Check All Engine or Belt Driven Components	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
44,180 - FRA Check for Leaks	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
44,190 - FRA Perform Battery Inspection	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
44,200 - FRA Check Battery Box Corrosion, Cables and Hold-Downs	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
50,000 - SECTION 5 Steering System Inspection	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
50,510 - Check Entire Steering System	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
60,000 - SECTION 6 Tires and Wheel Inspection	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
60,610 - FRA Check and Record Air Pressure	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
60,611 - Air Pressure RF	65 Pounds per Square Inch		TDELVA	Oct 2, 2017 8:44:54 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
60,612 - Air Pressure LF	65 Pounds per Square Inch		TDELVA	Oct 2, 2017 8:44:54 PM	No	
60,613 - Air Pressure RRO	65 Pounds per Square Inch		TDELVA	Oct 2, 2017 8:44:54 PM	No	
60,614 - Air Pressure RRI	65 Pounds per Square Inch		TDELVA	Oct 2, 2017 8:44:54 PM	No	
60,615 - Air Pressure LRI	65 Pounds per Square Inch		TDELVA	Oct 2, 2017 8:44:54 PM	No	
60,616 - Air Pressure LRO	65 Pounds per Square Inch		TDELVA	Oct 2, 2017 8:44:54 PM	No	
60,620 - Check Valve Stems and Caps	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
60,630 - Check and Record Tread Depth	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
60,631 - Tread Depth RF	10 32nds of an inch		TDELVA	Oct 2, 2017 8:44:54 PM	No	
60,632 - Tread Depth LF	9 32nds of an inch		TDELVA	Oct 2, 2017 8:44:54 PM	No	
60,633 - Tread Depth RRO	11 32nds of an inch		TDELVA	Oct 2, 2017 8:44:54 PM	No	
60,634 - Tread Depth RRI	12 32nds of an inch		TDELVA	Oct 2, 2017 8:44:54 PM	No	
60,635 - Tread Depth LRI	9 32nds of an inch		TDELVA	Oct 2, 2017 8:44:54 PM	No	
60,636 - Tread Depth LRO	10 32nds of an inch		TDELVA	Oct 2, 2017 8:44:54 PM	No	
60,640 - Check for Mismatched Tread or Casing Design	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
60,650 - Check Sidewall Wear	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
60,660 - Inspect for Cuts and Tears	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
60,670 - Check Dual Mating With Square	-	n/a	TDELVA	Oct 2, 2017 8:44:54 PM	No	
60,680 - Check Wheels for Cracks and Loose Lugs	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
60,690 - Check Tires for Irregular or Alignment Wear	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
66,100 - FRA Check Outer Hubs for Leaks	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
70,000 - SECTION 7 Under Vehicle Inspection	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
70,710 - Check Vibration Damper	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
70,720 - Check Engine and Transmission Mounts	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
70,730 - FRA Check Starter	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
70,740 - FRA Check Bottom of Engine for Fluid Leaks	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
70,750 - FRA Check Transmission for Leaks	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
70,760 - FRA Check Differential Breather and Fluid	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
70,770 - FRA Check Exhaust System	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
70,780 - Check Driveline, U-joint and Slip Yokes	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
70,790 - Check All Body Mounts and Chassis Frame	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
77,100 - FRA Check Security, Integrity and Length of Ground Straps	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
77,110 - FRA Check Fuel Tank	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
77,120 - Check Suspension Components	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
77,130 - FRA Check Brake Pad Thickness and Rotor for Wear	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
77,131 - Brake Pad Thickness LF	8 Inch		TDELVA	Oct 2, 2017 8:44:54 PM	No	
77,132 - Brake Pad Thickness RF	8 Inch		TDELVA	Oct 2, 2017 8:44:54 PM	No	
77,133 - Brake Pad Thickness LR	10 Inch		TDELVA	Oct 2, 2017 8:44:54 PM	No	
77,134 - Brake Pad Thickness RR	10 Inch		TDELVA	Oct 2, 2017 8:44:54 PM	No	
77,135 - Brake Rotor LF	39.5 Inch		TDELVA	Oct 2, 2017 8:44:54 PM	No	
77,136 - Brake Rotor RF	39.5 Inch		TDELVA	Oct 2, 2017 8:44:54 PM	No	
77,137 - Brake Rotor LR	1.69 Inch		TDELVA	Oct 2, 2017 8:44:54 PM	No	
77,138 - Brake Rotor RR	1.69 Inch		TDELVA	Oct 2, 2017 8:44:54 PM	No	
77,140 - FRA Check Brake Hoses	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
77,150 - Check King Pins	-	n/a	TDELVA	Oct 2, 2017 8:44:54 PM	No	
77,160 - FRA Check for Loose or Noisy Wheel Bearings	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
80,000 - SECTION 8 PMI Report Completion	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
80,810 - Completion of PMI Report	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
90,000 - SECTION 9 Completion of PMI	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	
90,910 - Vehicle Returned to predetermined location	Done		TDELVA	Oct 2, 2017 8:44:54 PM	No	


Activity Sub Total

Activity 10 Sub Total	
Parts:	8.58
Labor:	0.00
Labor Hours:	2.00
Sublet Parts:	0.00
Sublet Labor:	0.00

	Activity Sub Total	8.58
--	---------------------------	-------------



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 38676455
Invoice No. 55345 - 38676455

Client Department:

Department: 55345M

Work Order Description

PM A

Requested By: CVERGARA

Created By: CVERGARA

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 78,985 - DH

Activity Header

Activity: 20 999 TOTAL VEHICLE

Activity Note: PM A

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: A PM Level A

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
02-Oct-17	Delva, Terry	0.2	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List						
20 Desc: PM A						
Task: PM A SERVICE Performed by: TDELVA Performed on: 02-OCT-17						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
100,000 - "A" PMI SERVICING ITEMS	Done		TDELVA	Oct 2, 2017 8:45:25 PM	No	
101,000 - FRA Change Oil Filters	Yes		TDELVA	Oct 2, 2017 8:45:25 PM	No	
102,000 - FRA Drain Engine Oil	Yes		TDELVA	Oct 2, 2017 8:45:25 PM	No	
103,000 - FRA Check Transmission Fluid	Done		TDELVA	Oct 2, 2017 8:45:25 PM	No	
104,000 - Lubricate Chassis	Done		TDELVA	Oct 2, 2017 8:45:25 PM	No	
105,000 - Replace or Clean A/C Filters	Done		TDELVA	Oct 2, 2017 8:45:25 PM	No	
107,000 - FRA Change Primary Fuel Filter	Yes		TDELVA	Oct 2, 2017 8:45:25 PM	No	
108,000 - Lube all pivoting Mechanisms	Done		TDELVA	Oct 2, 2017 8:45:25 PM	No	

Activity Sub Total

Activity 20 Sub Total

Parts:	0.00
Labor:	0.00

	Labor Hours:	0.20
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 38676455
Invoice No. 55345 - 38676455

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
PM A		Ford E450 Champion Challenger	
Requested By:	CVERGARA	Status:	40 - Closed (40)
Created By:	CVERGARA	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	78,985 - DH

Activity Header
Activity:30 999 TOTAL VEHICLE
Activity Note: PRAMETER
Reason for Repair: 05 Inspection, Routine
Work Accomplished: 06 Inspect
Part Failure:
Activity Comments:

Activity Parts
No Data Available

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
02-Oct-17	Delva,Terry	0.5	0	0

Activity Sublet
No Data Available

Activity Checklist						
Check List						
30 Desc: PRAMETER						
Task: PRA and Meter Readings Performed by: TDELVA Performed on: 02-OCT-17						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		TDELVA	Oct 2, 2017 8:45:52 PM	No	
20 - Miles			TDELVA	Oct 2, 2017 8:45:52 PM	No	
30 - Kilometers			TDELVA	Oct 2, 2017 8:45:52 PM	No	
40 - Hours			TDELVA	Oct 2, 2017 8:45:52 PM	No	

Activity Sub Total	
Activity 30 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	0.50
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00

Work Order Footer	
Work Order 38676455 Total	
Parts:	8.58
Labor:	0.00
Labor Hours:	2.70

	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	8.58



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 1



Work Order No. 44003796
Invoice No. 55345 - 44003796

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Front signal_PMI_FOLLOWUP		Ford E450 Champion Challenger	
Requested By:	TDELVA	Status:	40 - Closed (40)
Created By:	TDELVA	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	78,985 - DH

Chronology		
Reported	Oct 2, 2017 8:44:54 PM	Oct 2, 2017 8:44:54 PM
Started	Oct 2, 2017 12:00:00 AM	
Completed	Oct 2, 2017 9:08:00 PM	Oct 2, 2017 9:08:00 PM
Down Time		

Work Order Notes

Line 10 COMPLAINT: no right front signal

CAUSE: Right front Signal bulb blown

Correction: Replaced right front signal bulb
Parts Used #3157NA. Qty:1

Activity Header					
Activity:10 050/000 GROUP, ACCESSORIES					
Activity Note: Fornt signal					
Reason for Repair:		05 Inspection, Routine			
Work Accomplished:		14 Install			
Part Failure:		00 No Failure			
Activity Comments:					
Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
02-Oct-17	3157NA	LAMP, MINIATURE, WEDGE-MOUNT, AMBER SAME AS GE3157NA	1	0.85	0.85
Activity Labor					
Booked Date	Technician	Hours	Shop Rate	Extended	
02-Oct-17	Delva,Terry	0.5	0	0	
Activity Sublet					
No Data Available					
Activity Checklist					
No Data Available					
No Data Available					
Activity Sub Total					
			Activity 10 Sub Total		
			Parts:	0.85	
			Labor:	0.00	
			Labor Hours:	0.50	
			Sublet Parts:	0.00	
			Sublet Labor:	0.00	
			Activity Sub Total	0.85	
Work Order Footer					
			Work Order 44003796 Total		
			Parts:	0.85	

	Labor:	0.00
	Labor Hours:	0.50
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	0.85



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 34982806
Invoice No. 55345 - 34982806

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
PM C		Ford E450 Champion Challenger	
Requested By:	HPIERRE	Status:	40 - Closed (40)
Created By:	HPIERRE	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	74,810 - DH

Chronology		
Reported	Aug 8, 2017 1:27:15 PM	Aug 8, 2017 1:27:15 PM
Started	Aug 8, 2017 12:00:00 AM	
Completed	Aug 9, 2017 11:08:58 AM	Aug 9, 2017 11:08:58 AM
Down Time		

Work Order Notes

Line 10 COMPLAINT: PM C

CAUSE: PM C Due

CORRECTION: Performed PM C. Changed engine oil. Replaced engine oil filter.
Changed transmission Fluid. Replaced transmission filter...
Changed dif. Fluid.
Parts used #B329 Qty:1
#20021. Qty:1

Activity Header						
Activity:10 999 TOTAL VEHICLE						
Activity Note: Light Medium Duty PMI						
Reason for Repair: 05 Inspection, Routine						
Work Accomplished: 06 Inspect						
Part Failure:						
Activity Comments:						
Activity Parts						
Booked Date	Part Number	Part Description	Quantity	Each	Extended	
08-Aug-17	20021	FILTER, TRANSMISSION 20021	1	13.68	13.68	
08-Aug-17	B329	GOING OUT OF SERVICE DO NOT ORDER USE B329 IN THE FLEET ORG FILTER, OIL	1	1.92	1.92	
Activity Labor						
Booked Date	Technician	Hours	Shop Rate	Extended		
08-Aug-17	Delva,Terry	4	0	0		
Activity Sublet						
No Data Available						
Activity Checklist						
Check List						
10 Desc: Light Medium Duty PMI						
Task: First Transit Light-Medium Duty PMI Performed by: TDELVA Performed on: 08-AUG-17						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,000 - SECTION 1 Preparation and Drive On (In Lot) Inspection	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,100 - Safety Inspection	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
10,110 - FRA Check Drivers Pre-trip or DVIR/EVIR & Authorization Forms	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
10,120 - FRA Check All Warning Lights and Alarms	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
10,130 - FRA Check Automatic Transmission Neutral Start Operation	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
10,140 - Check Service Brakes	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
10,150 - FRA Start Engine and Listen for Any Unusual Noises	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
10,160 - FRA Check Instruments and Horns	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
10,170 - Check Fast Idle	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
10,180 - Check Starter Protection Circuit	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
10,190 - Check Reverse Warning System	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
11,100 - Check Parking Brake	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
11,110 - Check HVAC Switches and Other Controls	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
11,120 - FRA Inspect Windshields, Mirror and Sun Visor Condition	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
11,130 - FRA Check Wiper and Washer Operation	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
11,140 - Road Test: Check for Proper Operation	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
11,150 - Perform Brake Test	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
11,152 - Decelerometer Results Test 1	FEET	N/A	TDELVA	Aug 8, 2017 11:05:27 PM	No	
11,154 - Decelerometer Results Test 2	FEET	N/A	TDELVA	Aug 8, 2017 11:05:27 PM	No	
11,156 - Decelerometer Results Test 3	FEET	N/A	TDELVA	Aug 8, 2017 11:05:27 PM	No	
11,161 - FRA Check/Record Oil Pressure / @1500 rpm	Pounds per Square Inch	N/A	TDELVA	Aug 8, 2017 11:05:27 PM	No	
11,162 - FRA Check/Record Water Temperature	Degree Fahrenheit	N/A	TDELVA	Aug 8, 2017 11:05:27 PM	No	
11,170 - FRA Check Door Operation	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
11,180 - FRA Check Operation of All Other Accessories	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
20,000 - SECTION 2 Interior Circle Inspection	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
20,210 - Check Condition of Operator's Area	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
20,220 - Check Accelerator and Brake Pedals	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
20,230 - FRA Check Wiring Under Dash	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
20,240 - FRA Check Interior Lights	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
20,250 - FRA Check Interior Electrical Panels	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
20,260 - Check Stop Request System	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
20,270 - Check Fare Box Mounting (If Applicable)	-	N/A	TDELVA	Aug 8, 2017 11:05:27 PM	No	
20,280 - Check Seats, Seat Belts, Hand Rails and Floor Covering	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
20,290 - Check for Physical Damage, Water Leaks, and Graffiti	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
22,100 - Check Emergency Windows and Glass Condition	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
22,110 - Check Emergency Hatches	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
22,120 - Check All Safety Equipment	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
30,000 - SECTION 3 Exterior Circle Inspection	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
30,310 - Check Passenger Doors	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
30,320 - Inspect Step-well and Hand Rails	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
30,330 - Check Wheelchair Lift Operation	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
30,340 - FRA Check Destination Sign and Run Box	-	N/A	TDELVA	Aug 8, 2017 11:05:27 PM	No	
30,350 - FRA Inspect Mirror and Mountings	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
30,360 - Check for Physical Damage and Decals	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
30,370 - Check Wiper Blade and Arm Condition	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
30,380 - Check Exterior Compartment Doors	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
30,390 - FRA Check Fuel Tank Cap	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
33,100 - Check Lights and Reflectors	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
33,110 - Check License Plate, Permits and State Inspection Decals	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
40,000 - SECTION 4 Engine Compartment Inspection	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
40,410 - FRA Check Engine Compartment/Condition for Fire Risk	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
40,420 - Check Hood	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
40,430 - Check Fan, Shroud and Radiator	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
40,440 - Test Coolant System Using Test Strips and Record Results	-	N/A	TDELVA	Aug 8, 2017 11:05:27 PM	No	
40,441 - Inhibitor Test Pass or Fail (Indicate with a Yes or No)	No	N/A	TDELVA	Aug 8, 2017 11:05:27 PM	No	
40,442 - Freeze Point	Degree Fahrenheit	N/A	TDELVA	Aug 8, 2017 11:05:27 PM	No	
40,450 - FRA Check Coolant Recovery System Condition & for Leaks	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
40,460 - Record Antifreeze Protection Level Using Refractometer	-	N/A	TDELVA	Aug 8, 2017 11:05:27 PM	No	
40,461 - Refractometer Reading	Degree Fahrenheit	n/A	TDELVA	Aug 8, 2017 11:05:27 PM	No	
40,470 - Pressure Test Cooling System and Check for Leaks	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
40,480 - FRA Check Coolant Hose Condition	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
40,490 - FRA Check Alternator Mount and Condition	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
44,100 - FRA Check Fuel Control and Transmission Connections	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
44,110 - FRA Check Master Cylinder Fluid Level	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
44,120 - FRA Check All Belts for Condition, Alignment and Tension	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
44,130 - FRA Check Exhaust System	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
44,140 - FRA Check Intake System	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
44,150 - FRA Inspect Turbocharger	-	n/A	TDELVA	Aug 8, 2017 11:05:27 PM	No	
44,160 - FRA Inspect Power Steering and Hydraulic Fluid	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
44,170 - FRA Check All Engine or Belt Driven Components	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
44,180 - FRA Check for Leaks	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
44,190 - FRA Perform Battery Inspection	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
44,200 - FRA Check Battery Box Corrosion, Cables and Hold-Downs	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
50,000 - SECTION 5 Steering System Inspection	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
50,510 - Check Entire Steering System	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
60,000 - SECTION 6 Tires and Wheel Inspection	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
60,610 - FRA Check and Record Air Pressure	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
60,611 - Air Pressure RF	65 Pounds per Square Inch		TDELVA	Aug 8, 2017 11:05:27 PM	No	
60,612 - Air Pressure LF	65 Pounds per Square Inch		TDELVA	Aug 8, 2017 11:05:27 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
60,613 - Air Pressure RRO	65 Pounds per Square Inch		TDELVA	Aug 8, 2017 11:05:27 PM	No	
60,614 - Air Pressure RRI	65 Pounds per Square Inch		TDELVA	Aug 8, 2017 11:05:27 PM	No	
60,615 - Air Pressure LRI	65 Pounds per Square Inch		TDELVA	Aug 8, 2017 11:05:27 PM	No	
60,616 - Air Pressure LRO	65 Pounds per Square Inch		TDELVA	Aug 8, 2017 11:05:27 PM	No	
60,620 - Check Valve Stems and Caps	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
60,630 - Check and Record Tread Depth	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
60,631 - Tread Depth RF	10 32nds of an inch		TDELVA	Aug 8, 2017 11:05:27 PM	No	
60,632 - Tread Depth LF	9 32nds of an inch		TDELVA	Aug 8, 2017 11:05:27 PM	No	
60,633 - Tread Depth RRO	11 32nds of an inch		TDELVA	Aug 8, 2017 11:05:27 PM	No	
60,634 - Tread Depth RRI	11 32nds of an inch		TDELVA	Aug 8, 2017 11:05:27 PM	No	
60,635 - Tread Depth LRI	11 32nds of an inch		TDELVA	Aug 8, 2017 11:05:27 PM	No	
60,636 - Tread Depth LRO	11 32nds of an inch		TDELVA	Aug 8, 2017 11:05:27 PM	No	
60,640 - Check for Mismatched Tread or Casing Design	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
60,650 - Check Sidewall Wear	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
60,660 - Inspect for Cuts and Tears	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
60,670 - Check Dual Mating With Square	-	n/A	TDELVA	Aug 8, 2017 11:05:27 PM	No	
60,680 - Check Wheels for Cracks and Loose Lugs	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
60,690 - Check Tires for Irregular or Alignment Wear	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
66,100 - FRA Check Outer Hubs for Leaks	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
70,000 - SECTION 7 Under Vehicle Inspection	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
70,710 - Check Vibration Damper	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
70,720 - Check Engine and Transmission Mounts	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
70,730 - FRA Check Starter	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
70,740 - FRA Check Bottom of Engine for Fluid Leaks	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
70,750 - FRA Check Transmission for Leaks	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
70,760 - FRA Check Differential Breather and Fluid	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
70,770 - FRA Check Exhaust System	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
70,780 - Check Driveline, U-joint and Slip Yokes	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
70,790 - Check All Body Mounts and Chassis Frame	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
77,100 - FRA Check Security, Integrity and Length of Ground Straps	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
77,110 - FRA Check Fuel Tank	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
77,120 - Check Suspension Components	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
77,130 - FRA Check Brake Pad Thickness and Rotor for Wear	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
77,131 - Brake Pad Thickness LF	8 Inch		TDELVA	Aug 8, 2017 11:05:27 PM	No	
77,132 - Brake Pad Thickness RF	8 Inch		TDELVA	Aug 8, 2017 11:05:27 PM	No	
77,133 - Brake Pad Thickness LR	6 Inch		TDELVA	Aug 8, 2017 11:05:27 PM	No	
77,134 - Brake Pad Thickness RR	4 Inch		TDELVA	Aug 8, 2017 11:05:27 PM	Yes	38627044
77,135 - Brake Rotor LF	1.67 Inch		TDELVA	Aug 8, 2017 11:05:27 PM	No	
77,136 - Brake Rotor RF	1.67 Inch		TDELVA	Aug 8, 2017 11:05:27 PM	No	
77,137 - Brake Rotor LR	1.65 Inch		TDELVA	Aug 8, 2017 11:05:27 PM	No	
77,138 - Brake Rotor RR	1.65 Inch		TDELVA	Aug 8, 2017 11:05:27 PM	No	
77,140 - FRA Check Brake Hoses	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
77,150 - Check King Pins	-	n/a	TDELVA	Aug 8, 2017 11:05:27 PM	No	
77,160 - FRA Check for Loose or Noisy Wheel Bearings	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
80,000 - SECTION 8 PMI Report Completion	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
80,810 - Completion of PMI Report	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
90,000 - SECTION 9 Completion of PMI	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	
90,910 - Vehicle Returned to predetermined location	Done		TDELVA	Aug 8, 2017 11:05:27 PM	No	

Activity Sub Total

Activity 10 Sub Total	
Parts:	15.60
Labor:	0.00
Labor Hours:	4.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	15.60



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 34982806
Invoice No. 55345 - 34982806

Client Department:

Department: 55345M

Work Order Description

PM C

Requested By: HPIERRE

Created By: HPIERRE

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 74,810 - DH

Activity Header

Activity: 20 999 TOTAL VEHICLE

Activity Note: PM C

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: C PM Level C

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
08-Aug-17	Delva, Terry	1	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

20 Desc: PM C

Task: PM C SERVICE Performed by: TDELVA Performed on: 08-AUG-17

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
100,000 - "A" PMI SERVICING ITEMS	Done		TDELVA	Aug 8, 2017 10:52:50 PM	No	
101,000 - FRA Change Oil Filters	Yes		TDELVA	Aug 8, 2017 10:52:50 PM	No	
102,000 - FRA Drain Engine Oil	Yes		TDELVA	Aug 8, 2017 10:52:50 PM	No	
103,000 - FRA Check Transmission Fluid	Done		TDELVA	Aug 8, 2017 10:52:50 PM	No	
104,000 - Lubricate Chassis	Done		TDELVA	Aug 8, 2017 10:52:50 PM	No	
105,000 - Replace or Clean A/C Filters	Done		TDELVA	Aug 8, 2017 10:52:50 PM	No	
107,000 - FRA Change Primary Fuel Filter	Done		TDELVA	Aug 8, 2017 10:52:50 PM	No	
108,000 - Lube all pivoting Mechanisms	Done		TDELVA	Aug 8, 2017 10:52:50 PM	No	
200,000 - "B" PMI SERVICING ITEMS (12 MONTH)	Done		TDELVA	Aug 8, 2017 10:52:50 PM	No	
201,000 - Service Crankcase Breather	Done		TDELVA	Aug 8, 2017 10:52:50 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
203,000 - FRA Change Automatic Transmission Fluid	Yes		TDELVA	Aug 8, 2017 10:52:50 PM	No	
204,000 - FRA Change Power Steering Fluid and Filter	Yes		TDELVA	Aug 8, 2017 10:52:50 PM	No	
205,000 - Complete Engine Diagnostics and Clear Codes when Completed	Done		TDELVA	Aug 8, 2017 10:52:50 PM	No	
300,000 - "C" PMI SERVICING ITEMS (24 MONTH)	Done		TDELVA	Aug 8, 2017 10:52:50 PM	No	
301,000 - Check and Lubricate Door Linkages	Done		TDELVA	Aug 8, 2017 10:52:50 PM	No	
302,000 - Check Toe-In and Record Reading	-	n/a	TDELVA	Aug 8, 2017 10:52:50 PM	No	
302,001 - Record Toe-In Reading	Inches, fraction-actual	n/a	TDELVA	Aug 8, 2017 10:52:50 PM	No	
304,000 - 1st "C" PMI ONLY: Tune Up Per Engine Mfg's Specifications	Yes		TDELVA	Aug 8, 2017 10:52:50 PM	No	
305,000 - FRA Change Differential Fluid	Yes		TDELVA	Aug 8, 2017 10:52:50 PM	No	

Activity Sub Total

Activity 20 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	1.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 34982806
Invoice No. 55345 - 34982806

Client Department:

Department: 55345M

Work Order Description

PM C

Requested By: HPIERRE

Created By: HPIERRE

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 74,810 - DH

Activity Header

Activity: 30 999 TOTAL VEHICLE

Activity Note: PRAMETER

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
08-Aug-17	Delva,Terry	0.4166666	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List							
30 Desc: PRAMETER							
Task: PRA and Meter Readings Performed by: TDELVA Performed on: 08-AUG-17							
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO	
10 - Have you successfully completed the Personal Risk Assessment?	Done		TDELVA	Aug 8, 2017 10:53:13 PM	No		
20 - Miles			TDELVA	Aug 8, 2017 10:53:13 PM	No		
30 - Kilometers			TDELVA	Aug 8, 2017 10:53:13 PM	No		
40 - Hours			TDELVA	Aug 8, 2017 10:53:13 PM	No		

Activity Sub Total

Activity 30 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	0.42
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00

Work Order Footer

Work Order 34982806 Total	
Parts:	15.60
Labor:	0.00
Labor Hours:	5.42

	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	15.60



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 38627044
Invoice No. 55345 - 38627044

Client Department:

Department: 55345M

Work Order Description

Rear Brakes

Requested By: TDELVA

Created By: TDELVA

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 74,807 - DH

Chronology

Reported	Aug 8, 2017 10:51:39 PM	Aug 8, 2017 10:51:39 PM
Started	Aug 8, 2017 12:00:00 AM	
Completed	Aug 8, 2017 11:03:00 PM	Aug 8, 2017 11:03:00 PM
Down Time		

Work Order Notes

Line 10 COMPLAINT: PM C Follow up

CAUSE: Normal Wear

CORRECTION: Replaced rear brakes

Part #BRSD-1330 Qty:1

Activity Header

Activity:10 013/002 REAR BRAKES & DRUMS

Activity Note: Rear Brakes

Reason for Repair: 08 Preventive Maintenance

Work Accomplished:

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
08-Aug-17	BRSD-1330	PADS, BRAKE, DISC, REAR, FORD SAME AS PFH133020	1	43.15	43.15

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
08-Aug-17	Delva,Terry	1	0	0

Activity Sublet

No Data Available

Activity Checklist

No Data Available

No Data Available

Activity Sub Total

Activity 10 Sub Total

Parts:	43.15
Labor:	0.00
Labor Hours:	1.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	43.15



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 38627044
Invoice No. 55345 - 38627044

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Rear Brakes		Ford E450 Champion Challenger	
Requested By:	TDELVA	Status:	40 - Closed (40)
Created By:	TDELVA	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	74,807 - DH

Activity Header
Activity:20 999 TOTAL VEHICLE
Activity Note:
Reason for Repair: 08 Preventive Maintenance
Work Accomplished: 06 Inspect
Part Failure:
Activity Comments:

Activity Parts
No Data Available

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
08-Aug-17	Delva,Terry	0.6166666	0	0

Activity Sublet
No Data Available

Activity Checklist							
Check List							
20 Desc: Task: PRA and Meter Readings Performed by: TDELVA Performed on: 08-AUG-17							
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO	
10 - Have you successfully completed the Personal Risk Assessment?	Done		TDELVA	Aug 8, 2017 10:59:14 PM	No		
20 - Miles			TDELVA	Aug 8, 2017 10:59:14 PM	No		
30 - Kilometers			TDELVA	Aug 8, 2017 10:59:14 PM	No		
40 - Hours			TDELVA	Aug 8, 2017 10:59:14 PM	No		


Activity Sub Total		Activity 20 Sub Total	
		Parts:	0.00
		Labor:	0.00
		Labor Hours:	0.62
		Sublet Parts:	0.00
		Sublet Labor:	0.00
		Activity Sub Total	0.00

Work Order Footer		Work Order 38627044 Total	
		Parts:	43.15
		Labor:	0.00
		Labor Hours:	1.62

	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	43.15



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 34843531
Invoice No. 55345 - 34843531

Client Department:

Department: 55345M

Work Order Description

PM A

Requested By: CVERGARA

Created By: CVERGARA

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 71,061 - DH

Chronology

Reported	Jun 22, 2017 6:47:54 AM	Jun 22, 2017 6:47:54 AM
Started	Jun 22, 2017 12:00:00 AM	
Completed	Jun 22, 2017 1:32:00 PM	Jun 22, 2017 1:32:00 PM
Down Time		

Work Order Notes

Line 10 COMPLAINT: PMA

CAUSE:preventive maintenance

CORRECTION:perform service lube all pivoting points cross rotate tires torque and re-torque tires completed

Part# B329 qty1

Oil5w20 Qts 6

Activity Header

Activity:10 999 TOTAL VEHICLE

Activity Note: Light Medium Duty PMI

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
22-Jun-17	B329	GOING OUT OF SERVICE DO NOT ORDER USE B329 IN THE FLEET ORG FILTER, OIL	1	1.92	1.92

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
22-Jun-17	Pierre,Hubert J	5	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: Light Medium Duty PMI

Task: First Transit Light-Medium Duty PMI Performed by: HPIERRE Performed on: 22-JUN-17

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,000 - SECTION 1 Preparation and Drive On (In Lot) Inspection	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
10,100 - Safety Inspection	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,110 - FRA Check Drivers Pre-trip or DVIR/EVIR & Authorization Forms	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
10,120 - FRA Check All Warning Lights and Alarms	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
10,130 - FRA Check Automatic Transmission Neutral Start Operation	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
10,140 - Check Service Brakes	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
10,150 - FRA Start Engine and Listen for Any Unusual Noises	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
10,160 - FRA Check Instruments and Horns	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
10,170 - Check Fast Idle	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
10,180 - Check Starter Protection Circuit	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
10,190 - Check Reverse Warning System	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
11,100 - Check Parking Brake	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
11,110 - Check HVAC Switches and Other Controls	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
11,120 - FRA Inspect Windshields, Mirror and Sun Visor Condition	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
11,130 - FRA Check Wiper and Washer Operation	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
11,140 - Road Test: Check for Proper Operation	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
11,150 - Perform Brake Test	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
11,152 - Decelerometer Results Test 1	FEET	N/A	HPIERRE	Jun 22, 2017 1:24:31 PM	No	
11,154 - Decelerometer Results Test 2	FEET	N/A	HPIERRE	Jun 22, 2017 1:24:31 PM	No	
11,156 - Decelerometer Results Test 3	FEET	N/A	HPIERRE	Jun 22, 2017 1:24:31 PM	No	
11,161 - FRA Check/Record Oil Pressure / @1500 rpm	1500 Pounds per Square Inch	N/A	HPIERRE	Jun 22, 2017 1:24:31 PM	No	
11,162 - FRA Check/Record Water Temperature	190 Degree Fahrenheit	N/A	HPIERRE	Jun 22, 2017 1:24:31 PM	No	
11,170 - FRA Check Door Operation	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
11,180 - FRA Check Operation of All Other Accessories	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
20,000 - SECTION 2 Interior Circle Inspection	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
20,210 - Check Condition of Operator's Area	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
20,220 - Check Accelerator and Brake Pedals	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
20,230 - FRA Check Wiring Under Dash	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
20,240 - FRA Check Interior Lights	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
20,250 - FRA Check Interior Electrical Panels	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
20,260 - Check Stop Request System	-	N/A	HPIERRE	Jun 22, 2017 1:24:31 PM	No	
20,270 - Check Fare Box Mounting (If Applicable)	-	N/A	HPIERRE	Jun 22, 2017 1:24:31 PM	No	
20,280 - Check Seats, Seat Belts, Hand Rails and Floor Covering	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
20,290 - Check for Physical Damage, Water Leaks, and Graffiti	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
22,100 - Check Emergency Windows and Glass Condition	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
22,110 - Check Emergency Hatches	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
22,120 - Check All Safety Equipment	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
30,000 - SECTION 3 Exterior Circle Inspection	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
30,310 - Check Passenger Doors	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
30,320 - Inspect Step-well and Hand Rails	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
30,330 - Check Wheelchair Lift Operation	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
30,340 - FRA Check Destination Sign and Run Box	-	N/A	HPIERRE	Jun 22, 2017 1:24:31 PM	No	
30,350 - FRA Inspect Mirror and Mountings	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
30,360 - Check for Physical Damage and Decals	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
30,370 - Check Wiper Blade and Arm Condition	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
30,380 - Check Exterior Compartment Doors	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
30,390 - FRA Check Fuel Tank Cap	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
33,100 - Check Lights and Reflectors	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
33,110 - Check License Plate, Permits and State Inspection Decals	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
40,000 - SECTION 4 Engine Compartment Inspection	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
40,410 - FRA Check Engine Compartment/Condition for Fire Risk	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
40,420 - Check Hood	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
40,430 - Check Fan, Shroud and Radiator	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
40,440 - Test Coolant System Using Test Strips and Record Results	-	N/A	HPIERRE	Jun 22, 2017 1:24:31 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
40,441 - Inhibitor Test Pass or Fail (Indicate with a Yes or No)	No	N/A	HPIERRE	Jun 22, 2017 1:24:31 PM	No	
40,442 - Freeze Point	Degree Fahrenheit	N/A	HPIERRE	Jun 22, 2017 1:24:31 PM	No	
40,450 - FRA Check Coolant Recovery System Condition & for Leaks	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
40,460 - Record Antifreeze Protection Level Using Refractometer	-	N/A	HPIERRE	Jun 22, 2017 1:24:31 PM	No	
40,461 - Refractometer Reading	Degree Fahrenheit	N/A	HPIERRE	Jun 22, 2017 1:24:31 PM	No	
40,470 - Pressure Test Cooling System and Check for Leaks	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
40,480 - FRA Check Coolant Hose Condition	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
40,490 - FRA Check Alternator Mount and Condition	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
44,100 - FRA Check Fuel Control and Transmission Connections	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
44,110 - FRA Check Master Cylinder Fluid Level	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
44,120 - FRA Check All Belts for Condition, Alignment and Tension	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
44,130 - FRA Check Exhaust System	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
44,140 - FRA Check Intake System	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
44,150 - FRA Inspect Turbocharger	-	N/A	HPIERRE	Jun 22, 2017 1:24:31 PM	No	
44,160 - FRA Inspect Power Steering and Hydraulic Fluid	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
44,170 - FRA Check All Engine or Belt Driven Components	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
44,180 - FRA Check for Leaks	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
44,190 - FRA Perform Battery Inspection	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
44,200 - FRA Check Battery Box Corrosion, Cables and Hold-Downs	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
50,000 - SECTION 5 Steering System Inspection	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
50,510 - Check Entire Steering System	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
60,000 - SECTION 6 Tires and Wheel Inspection	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
60,610 - FRA Check and Record Air Pressure	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
60,611 - Air Pressure RF	65 Pounds per Square Inch		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
60,612 - Air Pressure LF	65 Pounds per Square Inch		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
60,613 - Air Pressure RRO	70 Pounds per Square Inch		HPIERRE	Jun 22, 2017 1:24:31 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
60,614 - Air Pressure RRI	70 Pounds per Square Inch		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
60,615 - Air Pressure LRI	70 Pounds per Square Inch		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
60,616 - Air Pressure LRO	70 Pounds per Square Inch		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
60,620 - Check Valve Stems and Caps	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
60,630 - Check and Record Tread Depth	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
60,631 - Tread Depth RF	12 32nds of an inch		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
60,632 - Tread Depth LF	12 32nds of an inch		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
60,633 - Tread Depth RRO	13 32nds of an inch		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
60,634 - Tread Depth RRI	13 32nds of an inch		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
60,635 - Tread Depth LRI	13 32nds of an inch		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
60,636 - Tread Depth LRO	13 32nds of an inch		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
60,640 - Check for Mismatched Tread or Casing Design	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
60,650 - Check Sidewall Wear	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
60,660 - Inspect for Cuts and Tears	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
60,670 - Check Dual Mating With Square	-	N/A	HPIERRE	Jun 22, 2017 1:24:31 PM	No	
60,680 - Check Wheels for Cracks and Loose Lugs	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
60,690 - Check Tires for Irregular or Alignment Wear	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
66,100 - FRA Check Outer Hubs for Leaks	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
70,000 - SECTION 7 Under Vehicle Inspection	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
70,710 - Check Vibration Damper	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
70,720 - Check Engine and Transmission Mounts	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
70,730 - FRA Check Starter	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
70,740 - FRA Check Bottom of Engine for Fluid Leaks	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
70,750 - FRA Check Transmission for Leaks	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
70,760 - FRA Check Differential Breather and Fluid	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
70,770 - FRA Check Exhaust System	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	


Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
70,780 - Check Driveline, U-joint and Slip Yokes	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
70,790 - Check All Body Mounts and Chassis Frame	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
77,100 - FRA Check Security, Integrity and Length of Ground Straps	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
77,110 - FRA Check Fuel Tank	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
77,120 - Check Suspension Components	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
77,130 - FRA Check Brake Pad Thickness and Rotor for Wear	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
77,131 - Brake Pad Thickness LF	10 Inch		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
77,132 - Brake Pad Thickness RF	10 Inch		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
77,133 - Brake Pad Thickness LR	8 Inch		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
77,134 - Brake Pad Thickness RR	8 Inch		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
77,135 - Brake Rotor LF	1.6 Inch		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
77,136 - Brake Rotor RF	1.6 Inch		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
77,137 - Brake Rotor LR	1.7 Inch		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
77,138 - Brake Rotor RR	1.7 Inch		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
77,140 - FRA Check Brake Hoses	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
77,150 - Check King Pins	-	N/A	HPIERRE	Jun 22, 2017 1:24:31 PM	No	
77,160 - FRA Check for Loose or Noisy Wheel Bearings	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
80,000 - SECTION 8 PMI Report Completion	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
80,810 - Completion of PMI Report	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
90,000 - SECTION 9 Completion of PMI	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	
90,910 - Vehicle Returned to predetermined location	Done		HPIERRE	Jun 22, 2017 1:24:31 PM	No	

Activity Sub Total

Activity 10 Sub Total	
Parts:	1.92
Labor:	0.00
Labor Hours:	5.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	1.92



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 34843531
Invoice No. 55345 - 34843531

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
PM A		Ford E450 Champion Challenger	
Requested By:	CVERGARA	Status:	40 - Closed (40)
Created By:	CVERGARA	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	71,061 - DH

Activity Header
Activity:20 999 TOTAL VEHICLE
Activity Note: PM A
Reason for Repair: 08 Preventive Maintenance
Work Accomplished: A PM Level A
Part Failure:
Activity Comments:

Activity Parts
No Data Available

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
22-Jun-17	Pierre,Hubert J	0.4166666	0	0

Activity Sublet
No Data Available


Activity Checklist						
Check List						
20 Desc: PM A						
Task: PM A SERVICE Performed by: HPIERRE Performed on: 22-JUN-17						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
100,000 - "A" PMI SERVICING ITEMS	Done		HPIERRE	Jun 22, 2017 1:25:32 PM	No	
101,000 - FRA Change Oil Filters	Yes		HPIERRE	Jun 22, 2017 1:25:32 PM	No	
102,000 - FRA Drain Engine Oil	Yes		HPIERRE	Jun 22, 2017 1:25:32 PM	No	
103,000 - FRA Check Transmission Fluid	Done		HPIERRE	Jun 22, 2017 1:25:32 PM	No	
104,000 - Lubricate Chassis	Done		HPIERRE	Jun 22, 2017 1:25:32 PM	No	
105,000 - Replace or Clean A/C Filters	Done		HPIERRE	Jun 22, 2017 1:25:32 PM	No	
107,000 - FRA Change Primary Fuel Filter	No	N/A	HPIERRE	Jun 22, 2017 1:25:32 PM	No	
108,000 - Lube all pivoting Mechanisms	Done		HPIERRE	Jun 22, 2017 1:25:32 PM	No	

Activity Sub Total	
Activity 20 Sub Total	
Parts:	0.00
Labor:	0.00

	Labor Hours:	0.42
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 34843531
Invoice No. 55345 - 34843531

Client Department:

Department: 55345M

Work Order Description

PM A

Requested By: CVERGARA

Created By: CVERGARA

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 71,061 - DH

Activity Header

Activity: 30 999 TOTAL VEHICLE

Activity Note: PRAMETER

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
22-Jun-17	Pierre,Hubert J	0.0833333	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

30 Desc: PRAMETER

Task: PRA and Meter Readings Performed by: HPIERRE Performed on: 22-JUN-17

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		HPIERRE	Jun 22, 2017 1:25:55 PM	No	
20 - Miles			HPIERRE	Jun 22, 2017 1:25:55 PM	No	
30 - Kilometers			HPIERRE	Jun 22, 2017 1:25:55 PM	No	
40 - Hours			HPIERRE	Jun 22, 2017 1:25:55 PM	No	

Activity Sub Total

Activity 30 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	0.08
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00

Work Order Footer

Work Order 34843531 Total

Parts:	1.92
Labor:	0.00
Labor Hours:	5.50

	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	1.92



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 34758489
Invoice No. 55345 - 34758489

Client Department:

Department: 55345M

Work Order Description

PM A

Requested By: RGASPARD

Created By: RGASPARD

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 67,212 - DH

Chronology

Reported	May 18, 2017 8:36:25 AM	May 18, 2017 8:36:25 AM
Started	May 18, 2017 12:00:00 AM	
Completed	May 19, 2017 7:43:00 AM	May 19, 2017 7:43:00 AM
Down Time		

Work Order Notes

Line 10 COMPLAINT: pm-A Inspection due

CAUSE: mileage

CORRECTION: Completed pm A Inspection. Replace oil and oil filter

Parts used 6 quarts oil. 5w20. 1 oil filter B329

Activity Header

Activity: 10 999 TOTAL VEHICLE

Activity Note: Light Medium Duty PMI

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
18-May-17	B329	GOING OUT OF SERVICE DO NOT ORDER USE B329 IN THE FLEET ORG FILTER, OIL	1	1.92	1.92

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
18-May-17	Capazzoli, Louis	1	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: Light Medium Duty PMI

Task: First Transit Light-Medium Duty PMI Performed by: LCAPAZZOLI Performed on: 19-MAY-17

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,000 - SECTION 1 Preparation and Drive On (In Lot) Inspection	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
10,100 - Safety Inspection	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,110 - FRA Check Drivers Pre-trip or DVIR/EVIR & Authorization Forms	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
10,120 - FRA Check All Warning Lights and Alarms	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
10,130 - FRA Check Automatic Transmission Neutral Start Operation	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
10,140 - Check Service Brakes	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
10,150 - FRA Start Engine and Listen for Any Unusual Noises	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
10,160 - FRA Check Instruments and Horns	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
10,170 - Check Fast Idle	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
10,180 - Check Starter Protection Circuit	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
10,190 - Check Reverse Warning System	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
11,100 - Check Parking Brake	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
11,110 - Check HVAC Switches and Other Controls	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
11,120 - FRA Inspect Windshields, Mirror and Sun Visor Condition	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
11,130 - FRA Check Wiper and Washer Operation	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
11,140 - Road Test: Check for Proper Operation	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
11,150 - Perform Brake Test	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
11,152 - Decelerometer Results Test 1	FEET	n/a	LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
11,154 - Decelerometer Results Test 2	FEET	n/a	LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
11,156 - Decelerometer Results Test 3	FEET	n/a	LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
11,161 - FRA Check/Record Oil Pressure / @1500 rpm	Pounds per Square Inch	n/a	LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
11,162 - FRA Check/Record Water Temperature	Degree Fahrenheit	n/a	LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
11,170 - FRA Check Door Operation	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
11,180 - FRA Check Operation of All Other Accessories	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
20,000 - SECTION 2 Interior Circle Inspection	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
20,210 - Check Condition of Operator's Area	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
20,220 - Check Accelerator and Brake Pedals	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
20,230 - FRA Check Wiring Under Dash	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
20,240 - FRA Check Interior Lights	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
20,250 - FRA Check Interior Electrical Panels	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
20,260 - Check Stop Request System	-	n/a	LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
20,270 - Check Fare Box Mounting (If Applicable)	-	n/a	LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
20,280 - Check Seats, Seat Belts, Hand Rails and Floor Covering	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
20,290 - Check for Physical Damage, Water Leaks, and Graffiti	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
22,100 - Check Emergency Windows and Glass Condition	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
22,110 - Check Emergency Hatches	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
22,120 - Check All Safety Equipment	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
30,000 - SECTION 3 Exterior Circle Inspection	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
30,310 - Check Passenger Doors	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
30,320 - Inspect Step-well and Hand Rails	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
30,330 - Check Wheelchair Lift Operation	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
30,340 - FRA Check Destination Sign and Run Box	-	n/a	LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
30,350 - FRA Inspect Mirror and Mountings	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
30,360 - Check for Physical Damage and Decals	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
30,370 - Check Wiper Blade and Arm Condition	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
30,380 - Check Exterior Compartment Doors	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
30,390 - FRA Check Fuel Tank Cap	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
33,100 - Check Lights and Reflectors	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
33,110 - Check License Plate, Permits and State Inspection Decals	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
40,000 - SECTION 4 Engine Compartment Inspection	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
40,410 - FRA Check Engine Compartment/Condition for Fire Risk	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
40,420 - Check Hood	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
40,430 - Check Fan, Shroud and Radiator	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
40,440 - Test Coolant System Using Test Strips and Record Results	-	n/a	LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
40,441 - Inhibitor Test Pass or Fail (Indicate with a Yes or No)	No	n/a	LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
40,442 - Freeze Point	Degree Fahrenheit	n/a	LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
40,450 - FRA Check Coolant Recovery System Condition & for Leaks	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
40,460 - Record Antifreeze Protection Level Using Refractometer	-	n/a	LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
40,461 - Refractometer Reading	Degree Fahrenheit	n/a	LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
40,470 - Pressure Test Cooling System and Check for Leaks	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
40,480 - FRA Check Coolant Hose Condition	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
40,490 - FRA Check Alternator Mount and Condition	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
44,100 - FRA Check Fuel Control and Transmission Connections	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
44,110 - FRA Check Master Cylinder Fluid Level	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
44,120 - FRA Check All Belts for Condition, Alignment and Tension	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
44,130 - FRA Check Exhaust System	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
44,140 - FRA Check Intake System	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
44,150 - FRA Inspect Turbocharger	-	n/a	LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
44,160 - FRA Inspect Power Steering and Hydraulic Fluid	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
44,170 - FRA Check All Engine or Belt Driven Components	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
44,180 - FRA Check for Leaks	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
44,190 - FRA Perform Battery Inspection	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
44,200 - FRA Check Battery Box Corrosion, Cables and Hold-Downs	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
50,000 - SECTION 5 Steering System Inspection	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
50,510 - Check Entire Steering System	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
60,000 - SECTION 6 Tires and Wheel Inspection	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
60,610 - FRA Check and Record Air Pressure	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
60,611 - Air Pressure RF	70 Pounds per Square Inch		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
60,612 - Air Pressure LF	70 Pounds per Square Inch		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
60,613 - Air Pressure RRO	65 Pounds per Square Inch		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
60,614 - Air Pressure RRI	65 Pounds per Square Inch		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
60,615 - Air Pressure LRI	65 Pounds per Square Inch		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
60,616 - Air Pressure LRO	65 Pounds per Square Inch		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
60,620 - Check Valve Stems and Caps	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
60,630 - Check and Record Tread Depth	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
60,631 - Tread Depth RF	12 32nds of an inch		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
60,632 - Tread Depth LF	12 32nds of an inch		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
60,633 - Tread Depth RRO	12 32nds of an inch		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
60,634 - Tread Depth RRI	12 32nds of an inch		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
60,635 - Tread Depth LRI	12 32nds of an inch		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
60,636 - Tread Depth LRO	12 32nds of an inch		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
60,640 - Check for Mismatched Tread or Casing Design	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
60,650 - Check Sidewall Wear	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
60,660 - Inspect for Cuts and Tears	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
60,670 - Check Dual Mating With Square	-	n/a	LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
60,680 - Check Wheels for Cracks and Loose Lugs	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
60,690 - Check Tires for Irregular or Alignment Wear	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
66,100 - FRA Check Outer Hubs for Leaks	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
70,000 - SECTION 7 Under Vehicle Inspection	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
70,710 - Check Vibration Damper	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
70,720 - Check Engine and Transmission Mounts	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
70,730 - FRA Check Starter	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
70,740 - FRA Check Bottom of Engine for Fluid Leaks	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
70,750 - FRA Check Transmission for Leaks	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
70,760 - FRA Check Differential Breather and Fluid	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
70,770 - FRA Check Exhaust System	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
70,780 - Check Driveline, U-joint and Slip Yokes	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
70,790 - Check All Body Mounts and Chassis Frame	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
77,100 - FRA Check Security, Integrity and Length of Ground Straps	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
77,110 - FRA Check Fuel Tank	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
77,120 - Check Suspension Components	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
77,130 - FRA Check Brake Pad Thickness and Rotor for Wear	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
77,131 - Brake Pad Thickness LF	Inch	12 mm	LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
77,132 - Brake Pad Thickness RF	Inch	12 mm	LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
77,133 - Brake Pad Thickness LR	Inch	12 mm	LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
77,134 - Brake Pad Thickness RR	Inch	12 mm	LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
77,135 - Brake Rotor LF	Inch	40	LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
77,136 - Brake Rotor RF	Inch	40	LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
77,137 - Brake Rotor LR	Inch	40	LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
77,138 - Brake Rotor RR	Inch	40	LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
77,140 - FRA Check Brake Hoses	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
77,150 - Check King Pins	-	n/a	LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
77,160 - FRA Check for Loose or Noisy Wheel Bearings	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
80,000 - SECTION 8 PMI Report Completion	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
80,810 - Completion of PMI Report	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
90,000 - SECTION 9 Completion of PMI	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	
90,910 - Vehicle Returned to predetermined location	Done		LCAPAZZOLI	May 19, 2017 1:40:07 PM	No	

Activity Sub Total

Activity 10 Sub Total	
Parts:	1.92
Labor:	0.00
Labor Hours:	1.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	1.92



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 34758489
Invoice No. 55345 - 34758489

Client Department:

Department: 55345M

Work Order Description

PM A

Requested By: RGASPARD

Created By: RGASPARD

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 67,212 - DH

Activity Header

Activity: 20 999 TOTAL VEHICLE

Activity Note: PM A

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: A PM Level A

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
18-May-17	Capazzoli, Louis	0.5	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List						
20 Desc: PM A						
Task: PM A SERVICE Performed by: LCAPAZZOLI Performed on: 18-MAY-17						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
100,000 - "A" PMI SERVICING ITEMS	Done		LCAPAZZOLI	May 18, 2017 1:55:44 PM	No	
101,000 - FRA Change Oil Filters	Yes		LCAPAZZOLI	May 18, 2017 1:55:44 PM	No	
102,000 - FRA Drain Engine Oil	Yes		LCAPAZZOLI	May 18, 2017 1:55:44 PM	No	
103,000 - FRA Check Transmission Fluid	Done		LCAPAZZOLI	May 18, 2017 1:55:44 PM	No	
104,000 - Lubricate Chassis	Done		LCAPAZZOLI	May 18, 2017 1:55:44 PM	No	
105,000 - Replace or Clean A/C Filters	Done		LCAPAZZOLI	May 18, 2017 1:55:44 PM	No	
107,000 - FRA Change Primary Fuel Filter	No		LCAPAZZOLI	May 18, 2017 1:55:44 PM	No	
108,000 - Lube all pivoting Mechanisms	Done		LCAPAZZOLI	May 18, 2017 1:55:44 PM	No	

Activity Sub Total

Activity 20 Sub Total

Parts:	0.00
Labor:	0.00

	Labor Hours:	0.50
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 34758489
Invoice No. 55345 - 34758489

Client Department:

Department: 55345M

Work Order Description

PM A

Requested By: RGASPARD

Created By: RGASPARD

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 67,212 - DH

Activity Header

Activity: 30 999 TOTAL VEHICLE

Activity Note: PRAMETER

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
18-May-17	Capazzoli, Louis	0.0833333	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

30 Desc: PRAMETER

Task: PRA and Meter Readings Performed by: LCAPAZZOLI Performed on: 18-MAY-17

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		LCAPAZZOLI	May 18, 2017 1:56:02 PM	No	
20 - Miles			LCAPAZZOLI	May 18, 2017 1:56:02 PM	No	
30 - Kilometers			LCAPAZZOLI	May 18, 2017 1:56:02 PM	No	
40 - Hours			LCAPAZZOLI	May 18, 2017 1:56:02 PM	No	

Activity Sub Total

Activity 30 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	0.08
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00

Work Order Footer

Work Order 34758489 Total

Parts:	1.92
Labor:	0.00
Labor Hours:	1.58

	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	1.92



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 34831221
Invoice No. 55345 - 34831221

Client Department:

Department: 55345M

Work Order Description

Passenger side headlight is out

Requested By: EDITORRES

Created By: EDITORRES

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 66,514 - DH

Chronology

Reported	May 16, 2017 7:03:30 AM	May 16, 2017 7:03:30 AM
Started	May 16, 2017 12:00:00 AM	
Completed	May 16, 2017 7:33:00 AM	May 16, 2017 7:33:00 AM
Down Time		

Work Order Notes

Line 10 Headlight P

COMPLAINT:

Passenger side headlight is out

CAUSE:

Normal wear

CORRECTION:

Replaced passenger side headlight bulb.

PARTS:

Shop supply headlight bulb qty 1

Activity Header

Activity: 5 999 TOTAL VEHICLE

Activity Note: Personal Risk Assessment

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: Personal Risk Assessment


Task: PRA and Meter Readings Performed by: EDITORRES Performed on: 16-MAY-17

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		EDITORRES	May 16, 2017 7:05:48 AM	No	
20 - Miles			EDITORRES	May 16, 2017	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
				7:05:48 AM		
30 - Kilometers			EDTORRES	May 16, 2017 7:05:48 AM	No	
40 - Hours			EDTORRES	May 16, 2017 7:05:48 AM	No	
Activity Sub Total						
				Activity 5 Sub Total		
				Parts:		0.00
				Labor:		0.00
				Labor Hours:		0.00
				Sublet Parts:		0.00
				Sublet Labor:		0.00
				Activity Sub Total		0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 34831221
Invoice No. 55345 - 34831221

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FD4E4FS7EDB17176
Passenger side headlight is out		Ford E450 Champion Challenger	
Requested By:	EDITORRES	Status:	40 - Closed (40)
Created By:	EDITORRES	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	66,514 - DH

Activity Header
Activity: 15 034 LIGHTING SYSTEM
Activity Note: Passenger side headlight is out
Reason for Repair: 04 Driver's Report
Work Accomplished:
Part Failure:
Activity Comments:

Activity Parts
No Data Available

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
16-May-17	Torres,Edwin	0.4333333	0	0

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available

Activity Sub Total		Activity 15 Sub Total	
		Parts:	0.00
		Labor:	0.00
		Labor Hours:	0.43
		Sublet Parts:	0.00
		Sublet Labor:	0.00
		Activity Sub Total	0.00

Work Order Footer		Work Order 34831221 Total	
		Parts:	0.00
		Labor:	0.00
		Labor Hours:	0.43
		Sublet Parts:	0.00
		Sublet Labor:	0.00
		Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 34805514
Invoice No. 55345 - 34805514

Client Department:

Department: 55345M

Work Order Description

Front A/C and W/C lift inspection

Requested By: FSIMON

Created By: FSIMON

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 64,945 - DH

Chronology

Reported	May 3, 2017 1:13:59 PM	May 3, 2017 1:13:59 PM
Started	May 4, 2017 12:00:00 AM	
Completed	May 5, 2017 12:44:00 PM	May 5, 2017 12:44:00 PM
Down Time		

Work Order Notes

Line 10

COMPLAINT:W/C lift outer barrier not working properly

CAUSE:Weak gas spring

CORRECTION:Outer barrier gas spring replacement

Complaint verified

Outer barrier spring tested weak

Outer barrier gas springs changed

Parts used:

Two (2) outer barrier gas springs changed(under warranty).

Line 20

COMPLAINT:Front A/C blowing through the windshield

CAUSE:Defective vacuum reservoir

CORRECTION:Vacuum reservoir replacement

Complaint verified

Vacuum reservoir tested defective

Vacuum reservoir replaced and front A/C blowing normally.

Parts used:

One (1) valve#YG-193

One (1) vacuum reservoir #YC2Z-19A566-AA

Line 30

COMPLAINT:W/C accessories bags issues

CAUSE:Bags not attached properly

CORRECTION: Bags properly attached to the bus wall.

No part used

Activity Header Activity: 5 999 TOTAL VEHICLE Activity Note: Personal Risk Assessment Reason for Repair: 05 Inspection, Routine Work Accomplished: 06 Inspect Part Failure: Activity Comments:																																																							
Activity Parts No Data Available																																																							
Activity Labor No Data Available																																																							
Activity Sublet No Data Available																																																							
Activity Checklist																																																							
<table border="1"><thead><tr><th colspan="7">Check List</th></tr></thead><tbody><tr><td colspan="7">5 Desc: Personal Risk Assessment Task: PRA and Meter Readings Performed by: FSIMON Performed on: 04-MAY-17</td></tr><tr><th>Inspection Item</th><th>RESULTS</th><th>Inspector's Note</th><th>Inspector</th><th>Date Inspected</th><th>Follow Up Needed</th><th>Follow Up WO</th></tr><tr><td>10 - Have you successfully completed the Personal Risk Assessment?</td><td>Done</td><td></td><td>FSIMON</td><td>May 4, 2017 3:28:16 PM</td><td>No</td><td></td></tr><tr><td>20 - Miles</td><td></td><td></td><td>FSIMON</td><td>May 4, 2017 3:28:16 PM</td><td>No</td><td></td></tr><tr><td>30 - Kilometers</td><td></td><td></td><td>FSIMON</td><td>May 4, 2017 3:28:16 PM</td><td>No</td><td></td></tr><tr><td>40 - Hours</td><td></td><td></td><td>FSIMON</td><td>May 4, 2017 3:28:16 PM</td><td>No</td><td></td></tr></tbody></table>							Check List							5 Desc: Personal Risk Assessment Task: PRA and Meter Readings Performed by: FSIMON Performed on: 04-MAY-17							Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO	10 - Have you successfully completed the Personal Risk Assessment?	Done		FSIMON	May 4, 2017 3:28:16 PM	No		20 - Miles			FSIMON	May 4, 2017 3:28:16 PM	No		30 - Kilometers			FSIMON	May 4, 2017 3:28:16 PM	No		40 - Hours			FSIMON	May 4, 2017 3:28:16 PM	No	
Check List																																																							
5 Desc: Personal Risk Assessment Task: PRA and Meter Readings Performed by: FSIMON Performed on: 04-MAY-17																																																							
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO																																																	
10 - Have you successfully completed the Personal Risk Assessment?	Done		FSIMON	May 4, 2017 3:28:16 PM	No																																																		
20 - Miles			FSIMON	May 4, 2017 3:28:16 PM	No																																																		
30 - Kilometers			FSIMON	May 4, 2017 3:28:16 PM	No																																																		
40 - Hours			FSIMON	May 4, 2017 3:28:16 PM	No																																																		
Activity Sub Total																																																							
			<table border="1"><thead><tr><th colspan="2">Activity 5 Sub Total</th></tr></thead><tbody><tr><td>Parts:</td><td>0.00</td></tr><tr><td>Labor:</td><td>0.00</td></tr><tr><td>Labor Hours:</td><td>0.00</td></tr><tr><td>Sublet Parts:</td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td>0.00</td></tr></tbody></table>				Activity 5 Sub Total		Parts:	0.00	Labor:	0.00	Labor Hours:	0.00	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	0.00																																			
Activity 5 Sub Total																																																							
Parts:	0.00																																																						
Labor:	0.00																																																						
Labor Hours:	0.00																																																						
Sublet Parts:	0.00																																																						
Sublet Labor:	0.00																																																						
Activity Sub Total	0.00																																																						



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 34805514
Invoice No. 55345 - 34805514

Client Department:

Department: 55345M

Work Order Description

Front A/C and W/C lift inspection

Requested By: FSIMON

Created By: FSIMON

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 64,945 - DH

Activity Header

Activity: 15 055/023 LIFT, WHEELCHAIR, PASSENGER

Activity Note: W/C lift inspection

Reason for Repair: 05 Inspection, Routine

Work Accomplished:

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
04-May-17	Simon,Fritz	1	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

15 Desc: W/C lift inspection

Task: Braun Wheelchair Lift Inspection Performed by: FSIMON Performed on: 05-MAY-17

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
100 - Record Lift Model in Notes	Done	NCL954FIB3454HB-2	FSIMON	May 5, 2017 12:24:18 PM	No	
200 - Record Serial # in Notes	Done	GA-01041	FSIMON	May 5, 2017 12:24:18 PM	No	
300 - Cycle Count	Cycles	3274	FSIMON	May 5, 2017 12:24:18 PM	No	
10,000 - A - GENERAL INSPECTION	Done		FSIMON	May 5, 2017 12:24:18 PM	No	
10,100 - Lift Battery, Circuit Breaker & Cable	Done		FSIMON	May 5, 2017 12:24:18 PM	No	
10,200 - Lift Ground & Secondary Ground	Done		FSIMON	May 5, 2017 12:24:18 PM	No	
10,300 - Vehicle Interlock Power	Done		FSIMON	May 5, 2017 12:24:18 PM	No	
10,400 - Vehicle Interlock Prohibits Vehicle Movement	Done		FSIMON	May 5, 2017 12:24:18 PM	No	
10,500 - Lift Door Condition	Done		FSIMON	May 5, 2017 12:24:18 PM	No	
10,600 - Hand Pendant Condition/Function	Done		FSIMON	May 5, 2017 12:24:18 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,700 - Inspect Mounting Components	Done		FSIMON	May 5, 2017 12:24:18 PM	No	
20,000 - B - CYCLE CHECK	Done		FSIMON	May 5, 2017 12:24:18 PM	No	
20,100 - General Operation Throug Comple Cycle	Done		FSIMON	May 5, 2017 12:24:18 PM	No	
20,200 - Main, Handrail, OB & IB Bumper Adjustments	Done		FSIMON	May 5, 2017 12:24:18 PM	No	
20,300 - Floor Level Adjustment	Done		FSIMON	May 5, 2017 12:24:18 PM	No	
20,400 - Platform Angle Adjustment	Done		FSIMON	May 5, 2017 12:24:18 PM	No	
20,500 - Outer Barrier Interlock	Done		FSIMON	May 5, 2017 12:24:18 PM	No	
20,600 - Inner Barrier Interlock	Done		FSIMON	May 5, 2017 12:24:18 PM	No	
20,700 - Threshold Warning Interlock	Done		FSIMON	May 5, 2017 12:24:18 PM	No	
20,800 - 50 Pound Fold Interlock	Done		FSIMON	May 5, 2017 12:24:18 PM	No	
20,900 - Platform Lights	Done		FSIMON	May 5, 2017 12:24:18 PM	No	
21,000 - Anti-Skid	Done		FSIMON	May 5, 2017 12:24:18 PM	No	
21,100 - Operation & Warning Decals	Done		FSIMON	May 5, 2017 12:24:18 PM	No	
21,200 - Back Pump Handdle Location	Done		FSIMON	May 5, 2017 12:24:18 PM	No	
21,300 - Manual Override/Back-up System Function	Done		FSIMON	May 5, 2017 12:24:18 PM	No	
30,000 - C - MECHANICAL COMPONENTS	Done		FSIMON	May 5, 2017 12:24:18 PM	No	
30,100 - Base Plate, Tower, Arm & Platform Welds	Done		FSIMON	May 5, 2017 12:24:18 PM	No	
30,200 - Outer Barrier Pins, Gas Springs & Fasteners	Done		FSIMON	May 5, 2017 12:24:18 PM	No	
30,300 - Inner Barrier Pins, Gas Springs & Fasteners	Done		FSIMON	May 5, 2017 12:24:18 PM	No	
30,400 - Pivot Pin Fasteners	Done		FSIMON	May 5, 2017 12:24:18 PM	No	
30,500 - Pivot Pins & Bushing Condition	Done		FSIMON	May 5, 2017 12:24:18 PM	No	
30,600 - Handrails	Done		FSIMON	May 5, 2017 12:24:18 PM	No	
30,700 - Lift-Tite System	Done		FSIMON	May 5, 2017 12:24:18 PM	No	
40,000 - D - HYDRAULIC COMPONENT CHECKS	Done		FSIMON	May 5, 2017 12:24:18 PM	No	
40,100 - Leaks	Done		FSIMON	May 5, 2017 12:24:18 PM	No	
40,200 - Hoses & Harness Routing/Condition (pump,parallel-vertical arms,platform)	Done		FSIMON	May 5, 2017 12:24:18 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
40,300 - Remove Pump Cover & Check Fluid Level	Done		FSIMON	May 5, 2017 12:24:18 PM	No	
40,400 - Fluid Condition	Done		FSIMON	May 5, 2017 12:24:18 PM	No	
40,500 - LiftPump Motor Cables/Connections	Done		FSIMON	May 5, 2017 12:24:18 PM	No	
40,600 - Lift Pump Harnesses/Fuses/Electrical Components	Done		FSIMON	May 5, 2017 12:24:18 PM	No	

Activity Sub Total

Activity 15 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	1.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 34805514
Invoice No. 55345 - 34805514

Client Department:

Department: 55345M

Work Order Description

Front A/C and W/C lift inspection

Requested By: FSIMON

Created By: FSIMON

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 64,945 - DH

Activity Header

Activity:25

Activity Note: Front A/C check

Reason for Repair: 05 Inspection, Routine

Work Accomplished:

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
04-May-17	YG380	TUBE, ORIFICE, A/C, E450, BLACK	1	4.26	4.26
04-May-17	YC2Z-19A566-AA	RESERVOIR, VACUUM W/BRACKET	1	27.39	27.39

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
04-May-17	Simon,Fritz	1	0	0

Activity Sublet

No Data Available

Activity Checklist

No Data Available

No Data Available

Activity Sub Total

Activity 25 Sub Total

Parts:	31.65
Labor:	0.00
Labor Hours:	1.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	31.65

Work Order Footer

Work Order 34805514 Total

Parts:	31.65
Labor:	0.00
Labor Hours:	2.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	31.65



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 34791015
Invoice No. 55345 - 34791015

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Check and replace wiper Arm clip		Ford E450 Champion Challenger	
Requested By:	HPIERRE	Status:	40 - Closed (40)
Created By:	HPIERRE	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	64,051 - DH

Chronology		
Reported	Apr 27, 2017 8:41:26 AM	Apr 27, 2017 8:41:26 AM
Started	Apr 27, 2017 12:00:00 AM	
Completed	Apr 28, 2017 7:11:00 AM	Apr 28, 2017 7:11:00 AM
Down Time		

Work Order Notes

Line 10
COMPLAINT: check and replace wiper Arm clip

CAUSE:preventive maintenance

CORRECTION: replace wiper Arm clip completed
Part# 17531 clip arm Qty 1

Activity Header						
Activity:5 999 TOTAL VEHICLE						
Activity Note: Personal Risk Assessment						
Reason for Repair: 05 Inspection, Routine						
Work Accomplished: 06 Inspect						
Part Failure:						
Activity Comments:						
Activity Parts						
No Data Available						
Activity Labor						
Booked Date	Technician	Hours	Shop Rate	Extended		
27-Apr-17	Pierre,Hubert J	0.0833333	0	0		
Activity Sublet						
No Data Available						
Activity Checklist						
Check List						
5 Desc: Personal Risk Assessment						
Task: PRA and Meter Readings Performed by: HPIERRE Performed on: 27-APR-17						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		HPIERRE	Apr 27, 2017 8:44:28 AM	No	
20 - Miles			HPIERRE	Apr 27, 2017 8:44:28 AM	No	
30 - Kilometers			HPIERRE	Apr 27, 2017 8:44:28 AM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO	
40 - Hours			HPIERRE	Apr 27, 2017 8:44:28 AM	No		
Activity Sub Total							
				Activity 5 Sub Total			
				Parts:			0.00
				Labor:			0.00
				Labor Hours:			0.08
				Sublet Parts:			0.00
				Sublet Labor:			0.00
				Activity Sub Total			0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 34791015
Invoice No. 55345 - 34791015

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Check and replace wiper Arm clip		Ford E450 Champion Challenger	
Requested By:	HPIERRE	Status:	40 - Closed (40)
Created By:	HPIERRE	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	64,051 - DH

Activity Header
Activity: 15
Activity Note:
Reason for Repair: 08 Preventive Maintenance
Work Accomplished:
Part Failure:
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
27-Apr-17	E3TZ-17531-A	CLIP, ARM, WPER	1	10.51	10.51

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
27-Apr-17	Pierre,Hubert J	0.4166666	0	0

Activity Sublet
No Data Available


Activity Checklist
No Data Available
No Data Available

Activity Sub Total	
Activity 15 Sub Total	
Parts:	10.51
Labor:	0.00
Labor Hours:	0.42
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	10.51

Work Order Footer	
Work Order 34791015 Total	
Parts:	10.51
Labor:	0.00
Labor Hours:	0.50
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	10.51



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 34785210
Invoice No. 55345 - 34785210

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Tires		Ford E450 Champion Challenger	
Requested By:	FSIMON	Status:	40 - Closed (40)
Created By:	FSIMON	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	63,685 - DH

Chronology		
Reported	Apr 24, 2017 3:49:58 PM	Apr 24, 2017 3:49:58 PM
Started	Apr 24, 2017 12:00:00 AM	
Completed	Apr 25, 2017 7:45:00 AM	Apr 25, 2017 7:45:00 AM
Down Time		

Work Order Notes

Line 10
COMPLAINT:Tires

CAUSE:Low treads

CORRECTION:Tires replacement

Four tires replaced


Parts used:
Four (4) tires #189752

Activity Header						
Activity:5 999 TOTAL VEHICLE						
Activity Note: Personal Risk Assessment						
Reason for Repair: 05 Inspection, Routine						
Work Accomplished: 06 Inspect						
Part Failure:						
Activity Comments:						
Activity Parts						
No Data Available						
Activity Labor						
No Data Available						
Activity Sublet						
No Data Available						
Activity Checklist						
Check List						
5 Desc: Personal Risk Assessment						
Task: PRA and Meter Readings Performed by: FSIMON Performed on: 24-APR-17						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		FSIMON	Apr 24, 2017 4:03:41 PM	No	
20 - Miles			FSIMON	Apr 24, 2017 4:03:41 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
30 - Kilometers			FSIMON	Apr 24, 2017 4:03:41 PM	No	
40 - Hours			FSIMON	Apr 24, 2017 4:03:41 PM	No	
Activity Sub Total			Activity 5 Sub Total			
			Parts:		0.00	
			Labor:		0.00	
			Labor Hours:		0.00	
			Sublet Parts:		0.00	
			Sublet Labor:		0.00	
			Activity Sub Total		0.00	



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 34785210
Invoice No. 55345 - 34785210

Client Department:

Department: 55345M

Work Order Description

Tires

Requested By: FSIMON

Created By: FSIMON

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 63,685 - DH

Activity Header

Activity: 15

Activity Note:

Reason for Repair: 05 Inspection, Routine

Work Accomplished:

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
24-Apr-17	189752	TIRE, LT225/75R16, TLBLPS115RE, TRANSFORCE HT 10PLY 1622575E, NEW	4	104.82	419.28

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
24-Apr-17	Simon,Fritz	1	0	0

Activity Sublet

No Data Available

Activity Checklist

No Data Available

No Data Available

Activity Sub Total

Activity 15 Sub Total

Parts:	419.28
Labor:	0.00
Labor Hours:	1.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	419.28


Work Order Footer

Work Order 34785210 Total

Parts:	419.28
Labor:	0.00
Labor Hours:	1.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	419.28



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 34652369
Invoice No. 55345 - 34652369

Client Department:

Department: 55345M

Work Order Description

PM B

Requested By: CVERGARA

Created By: CVERGARA

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 62,834 - DH

Chronology

Reported	Apr 13, 2017 10:23:38 AM	Apr 13, 2017 10:23:38 AM
Started	Apr 13, 2017 12:00:00 AM	
Completed	Apr 13, 2017 11:06:00 PM	Apr 13, 2017 11:06:00 PM
Down Time		

Work Order Notes

Line 10 COMPLAINT:PMB

CAUSE:service

CORRECTION:perform PMB service

Oil filter B329 qty 1

Engine oil 5w20 qty 7 qts

Activity Header

Activity:10 999 TOTAL VEHICLE

Activity Note: Light Medium Duty PMI

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
13-Apr-17	Gaspard,Ronald	1.5333333	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: Light Medium Duty PMI

Task: First Transit Light-Medium Duty PMI Performed by: RGASPARD Performed on: 13-APR-17

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,000 - SECTION 1 Preparation and Drive On (In Lot) Inspection	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
10,100 - Safety Inspection	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
10,110 - FRA Check Drivers Pre-trip or DVIR/EVIR & Authorization Forms	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
10,120 - FRA Check All Warning Lights and Alarms	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,130 - FRA Check Automatic Transmission Neutral Start Operation	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
10,140 - Check Service Brakes	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
10,150 - FRA Start Engine and Listen for Any Unusual Noises	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
10,160 - FRA Check Instruments and Horns	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
10,170 - Check Fast Idle	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
10,180 - Check Starter Protection Circuit	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
10,190 - Check Reverse Warning System	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
11,100 - Check Parking Brake	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
11,110 - Check HVAC Switches and Other Controls	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
11,120 - FRA Inspect Windshields, Mirror and Sun Visor Condition	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
11,130 - FRA Check Wiper and Washer Operation	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
11,140 - Road Test: Check for Proper Operation	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
11,150 - Perform Brake Test	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
11,152 - Decelerometer Results Test 1	FEET	na	RGASPARD	Apr 13, 2017 10:26:51 PM	No	
11,154 - Decelerometer Results Test 2	FEET	na	RGASPARD	Apr 13, 2017 10:26:51 PM	No	
11,156 - Decelerometer Results Test 3	FEET	na	RGASPARD	Apr 13, 2017 10:26:51 PM	No	
11,161 - FRA Check/Record Oil Pressure / @1500 rpm	Pounds per Square Inch	na	RGASPARD	Apr 13, 2017 10:26:51 PM	No	
11,162 - FRA Check/Record Water Temperature	Degree Fahrenheit	na	RGASPARD	Apr 13, 2017 10:26:51 PM	No	
11,170 - FRA Check Door Operation	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
11,180 - FRA Check Operation of All Other Accessories	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
20,000 - SECTION 2 Interior Circle Inspection	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
20,210 - Check Condition of Operator's Area	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
20,220 - Check Accelerator and Brake Pedals	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
20,230 - FRA Check Wiring Under Dash	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
20,240 - FRA Check Interior Lights	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
20,250 - FRA Check Interior Electrical Panels	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
20,260 - Check Stop Request System	-	na	RGASPARD	Apr 13, 2017 10:26:51 PM	No	
20,270 - Check Fare Box Mounting (If Applicable)	-	na	RGASPARD	Apr 13, 2017 10:26:51 PM	No	
20,280 - Check Seats, Seat Belts, Hand Rails and Floor Covering	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
20,290 - Check for Physical Damage, Water Leaks, and Graffiti	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
22,100 - Check Emergency Windows and Glass Condition	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
22,110 - Check Emergency Hatches	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
22,120 - Check All Safety Equipment	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
30,000 - SECTION 3 Exterior Circle Inspection	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
30,310 - Check Passenger Doors	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
30,320 - Inspect Step-well and Hand Rails	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
30,330 - Check Wheelchair Lift Operation	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
30,340 - FRA Check Destination Sign and Run Box	-	na	RGASPARD	Apr 13, 2017 10:26:51 PM	No	
30,350 - FRA Inspect Mirror and Mountings	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
30,360 - Check for Physical Damage and Decals	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
30,370 - Check Wiper Blade and Arm Condition	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
30,380 - Check Exterior Compartment Doors	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
30,390 - FRA Check Fuel Tank Cap	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
33,100 - Check Lights and Reflectors	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
33,110 - Check License Plate, Permits and State Inspection Decals	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
40,000 - SECTION 4 Engine Compartment Inspection	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
40,410 - FRA Check Engine Compartment/Condition for Fire Risk	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
40,420 - Check Hood	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
40,430 - Check Fan, Shroud and Radiator	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
40,440 - Test Coolant System Using Test Strips and Record Results	-	na	RGASPARD	Apr 13, 2017 10:26:51 PM	No	
40,441 - Inhibitor Test Pass or Fail (Indicate with a Yes or No)	No	na	RGASPARD	Apr 13, 2017 10:26:51 PM	No	
40,442 - Freeze Point	Degree Fahrenheit	na	RGASPARD	Apr 13, 2017 10:26:51 PM	No	


Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
40,450 - FRA Check Coolant Recovery System Condition & for Leaks	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
40,460 - Record Antifreeze Protection Level Using Refractometer	-	na	RGASPARD	Apr 13, 2017 10:26:51 PM	No	
40,461 - Refractometer Reading	Degree Fahrenheit	na	RGASPARD	Apr 13, 2017 10:26:51 PM	No	
40,470 - Pressure Test Cooling System and Check for Leaks	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
40,480 - FRA Check Coolant Hose Condition	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
40,490 - FRA Check Alternator Mount and Condition	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
44,100 - FRA Check Fuel Control and Transmission Connections	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
44,110 - FRA Check Master Cylinder Fluid Level	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
44,120 - FRA Check All Belts for Condition, Alignment and Tension	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
44,130 - FRA Check Exhaust System	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
44,140 - FRA Check Intake System	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
44,150 - FRA Inspect Turbocharger	-	na	RGASPARD	Apr 13, 2017 10:26:51 PM	No	
44,160 - FRA Inspect Power Steering and Hydraulic Fluid	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
44,170 - FRA Check All Engine or Belt Driven Components	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
44,180 - FRA Check for Leaks	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
44,190 - FRA Perform Battery Inspection	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
44,200 - FRA Check Battery Box Corrosion, Cables and Hold-Downs	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
50,000 - SECTION 5 Steering System Inspection	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
50,510 - Check Entire Steering System	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
60,000 - SECTION 6 Tires and Wheel Inspection	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
60,610 - FRA Check and Record Air Pressure	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
60,611 - Air Pressure RF	70 Pounds per Square Inch		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
60,612 - Air Pressure LF	70 Pounds per Square Inch		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
60,613 - Air Pressure RRO	65 Pounds per Square Inch		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
60,614 - Air Pressure RRI	65 Pounds per Square Inch		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
60,615 - Air Pressure LRI	65 Pounds per Square Inch		RGASPARD	Apr 13, 2017 10:26:51 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
60,616 - Air Pressure LRO	65 Pounds per Square Inch		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
60,620 - Check Valve Stems and Caps	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
60,630 - Check and Record Tread Depth	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
60,631 - Tread Depth RF	12 32nds of an inch		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
60,632 - Tread Depth LF	12 32nds of an inch		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
60,633 - Tread Depth RRO	4 32nds of an inch		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
60,634 - Tread Depth RRI	5 32nds of an inch		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
60,635 - Tread Depth LRI	6 32nds of an inch		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
60,636 - Tread Depth LRO	6 32nds of an inch		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
60,640 - Check for Mismatched Tread or Casing Design	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
60,650 - Check Sidewall Wear	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
60,660 - Inspect for Cuts and Tears	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
60,670 - Check Dual Mating With Square	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
60,680 - Check Wheels for Cracks and Loose Lugs	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
60,690 - Check Tires for Irregular or Alignment Wear	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
66,100 - FRA Check Outer Hubs for Leaks	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
70,000 - SECTION 7 Under Vehicle Inspection	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
70,710 - Check Vibration Damper	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
70,720 - Check Engine and Transmission Mounts	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
70,730 - FRA Check Starter	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
70,740 - FRA Check Bottom of Engine for Fluid Leaks	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
70,750 - FRA Check Transmission for Leaks	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
70,760 - FRA Check Differential Breather and Fluid	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
70,770 - FRA Check Exhaust System	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
70,780 - Check Driveline, U-joint and Slip Yokes	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
70,790 - Check All Body Mounts and Chassis Frame	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
77,100 - FRA Check Security, Integrity and Length of Ground Straps	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
77,110 - FRA Check Fuel Tank	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
77,120 - Check Suspension Components	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
77,130 - FRA Check Brake Pad Thickness and Rotor for Wear	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
77,131 - Brake Pad Thickness LF	10 Inch		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
77,132 - Brake Pad Thickness RF	10 Inch		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
77,133 - Brake Pad Thickness LR	10 Inch		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
77,134 - Brake Pad Thickness RR	10 Inch		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
77,135 - Brake Rotor LF	36 Inch		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
77,136 - Brake Rotor RF	36 Inch		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
77,137 - Brake Rotor LR	38 Inch		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
77,138 - Brake Rotor RR	38 Inch		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
77,140 - FRA Check Brake Hoses	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
77,150 - Check King Pins	-	na	RGASPARD	Apr 13, 2017 10:26:51 PM	No	
77,160 - FRA Check for Loose or Noisy Wheel Bearings	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
80,000 - SECTION 8 PMI Report Completion	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
80,810 - Completion of PMI Report	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
90,000 - SECTION 9 Completion of PMI	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
90,910 - Vehicle Returned to predetermined location	Done		RGASPARD	Apr 13, 2017 10:26:51 PM	No	
Activity Sub Total						
				Activity 10 Sub Total		
				Parts:		0.00
				Labor:		0.00
				Labor Hours:		1.53
				Sublet Parts:		0.00
				Sublet Labor:		0.00
				Activity Sub Total		0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 34652369
Invoice No. 55345 - 34652369

Client Department:

Department: 55345M

Work Order Description

PM B

Requested By: CVERGARA

Created By: CVERGARA

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 62,834 - DH

Activity Header

Activity: 20 999 TOTAL VEHICLE

Activity Note: PM B

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: B PM Level B

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
13-Apr-17	B329	GOING OUT OF SERVICE DO NOT ORDER USE B329 IN THE FLEET ORG FILTER, OIL	1	1.92	1.92

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
13-Apr-17	Gaspard,Ronald	1.1	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List						
20 Desc: PM B						
Task: PM B SERVICE Performed by: RGASPARD Performed on: 13-APR-17						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
100,000 - "A" PMI SERVICING ITEMS	Done		RGASPARD	Apr 13, 2017 10:27:41 PM	No	
101,000 - FRA Change Oil Filters	Yes		RGASPARD	Apr 13, 2017 10:27:41 PM	No	
102,000 - FRA Drain Engine Oil	Yes		RGASPARD	Apr 13, 2017 10:27:41 PM	No	
103,000 - FRA Check Transmission Fluid	Done		RGASPARD	Apr 13, 2017 10:27:41 PM	No	
104,000 - Lubricate Chassis	-	na	RGASPARD	Apr 13, 2017 10:27:41 PM	No	
105,000 - Replace or Clean A/C Filters	Done		RGASPARD	Apr 13, 2017 10:27:41 PM	No	
107,000 - FRA Change Primary Fuel Filter	No	na	RGASPARD	Apr 13, 2017 10:27:41 PM	No	
108,000 - Lube all pivoting Mechanisms	Done		RGASPARD	Apr 13, 2017 10:27:41 PM	No	
200,000 - "B" PMI SERVICING ITEMS (12	Done		RGASPARD	Apr 13, 2017	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
MONTH)				10:27:41 PM		
201,000 - Service Crankcase Breather	Done		RGASPARD	Apr 13, 2017 10:27:41 PM	No	
203,000 - FRA Change Automatic Transmission Fluid	No		RGASPARD	Apr 13, 2017 10:27:41 PM	No	
204,000 - FRA Change Power Steering Fluid and Filter	No		RGASPARD	Apr 13, 2017 10:27:41 PM	No	
205,000 - Complete Engine Diagnostics and Clear Codes when Completed	Done		RGASPARD	Apr 13, 2017 10:27:41 PM	No	

Activity Sub Total

Activity 20 Sub Total	
Parts:	1.92
Labor:	0.00
Labor Hours:	1.10
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	1.92



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 34652369
Invoice No. 55345 - 34652369

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
PM B		Ford E450 Champion Challenger	
Requested By:	CVERGARA	Status:	40 - Closed (40)
Created By:	CVERGARA	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	62,834 - DH

Activity Header
Activity:30 999 TOTAL VEHICLE
Activity Note: PRAMETER
Reason for Repair: 05 Inspection, Routine
Work Accomplished: 06 Inspect
Part Failure:
Activity Comments:

Activity Parts
No Data Available

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
13-Apr-17	Gaspard,Ronald	0.0833333	0	0

Activity Sublet
No Data Available

Activity Checklist						
Check List						
30 Desc: PRAMETER						
Task: PRA and Meter Readings Performed by: RGASPARD Performed on: 13-APR-17						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		RGASPARD	Apr 13, 2017 10:28:02 PM	No	
20 - Miles			RGASPARD	Apr 13, 2017 10:28:02 PM	No	
30 - Kilometers			RGASPARD	Apr 13, 2017 10:28:02 PM	No	
40 - Hours			RGASPARD	Apr 13, 2017 10:28:02 PM	No	

Activity Sub Total	
Activity 30 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	0.08
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00

Work Order Footer	
Work Order 34652369 Total	
Parts:	1.92
Labor:	0.00
Labor Hours:	2.72

	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	1.92



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 34749588
Invoice No. 55345 - 34749588

Client Department:

Department: 55345M

Work Order Description

Need rear tires

Requested By: HPIERRE

Created By: HPIERRE

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 62,372 - DH

Chronology

Reported	Apr 10, 2017 1:28:54 PM	Apr 10, 2017 1:28:54 PM
Started	Apr 10, 2017 12:00:00 AM	
Completed	Apr 10, 2017 2:26:00 PM	Apr 10, 2017 2:26:00 PM
Down Time		

Work Order Notes

Line 10

COMPLAINT: need rear tires

CAUSE: below spect

CORRECTION: replace 2 left rear tires completed

2 use tires

Activity Header

Activity: 5 999 TOTAL VEHICLE

Activity Note: Personal Risk Assessment

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
10-Apr-17	Pierre,Hubert J	0.0833333	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: Personal Risk Assessment

Task: PRA and Meter Readings Performed by: HPIERRE Performed on: 10-APR-17

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		HPIERRE	Apr 10, 2017 1:31:12 PM	No	
20 - Miles			HPIERRE	Apr 10, 2017 1:31:12 PM	No	
30 - Kilometers			HPIERRE	Apr 10, 2017 1:31:12 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO	
40 - Hours			HPIERRE	Apr 10, 2017 1:31:12 PM	No		
Activity Sub Total				Activity 5 Sub Total			
				Parts:			0.00
				Labor:			0.00
				Labor Hours:			0.08
				Sublet Parts:			0.00
				Sublet Labor:			0.00
				Activity Sub Total			0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 34749588
Invoice No. 55345 - 34749588

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Need rear tires		Ford E450 Champion Challenger	
Requested By:	HPIERRE	Status:	40 - Closed (40)
Created By:	HPIERRE	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	62,372 - DH

Activity Header
Activity:15 017 TIRES, TUBES, LINERS & VALVES
Activity Note:
Reason for Repair: 08 Preventive Maintenance
Work Accomplished:
Part Failure:
Activity Comments:

Activity Parts
No Data Available

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
10-Apr-17	Pierre,Hubert J	1	0	0

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available

Activity Sub Total		Activity 15 Sub Total	
Parts:			0.00
Labor:			0.00
Labor Hours:			1.00
Sublet Parts:			0.00
Sublet Labor:			0.00
Activity Sub Total			0.00

Work Order Footer		Work Order 34749588 Total	
Parts:			0.00
Labor:			0.00
Labor Hours:			1.08
Sublet Parts:			0.00
Sublet Labor:			0.00
Activity Sub Total			0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 34746062
Invoice No. 55345 - 34746062

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
W/C Lift inspection		Ford E450 Champion Challenger	
Requested By:	FSIMON	Status:	40 - Closed (40)
Created By:	FSIMON	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	62,082 - DH

Chronology		
Reported	Apr 7, 2017 8:10:35 AM	Apr 7, 2017 8:10:35 AM
Started	Apr 7, 2017 12:00:00 AM	
Completed	Apr 7, 2017 2:03:00 PM	Apr 7, 2017 2:03:00 PM
Down Time		

Work Order Notes

Line 10
COMPLAINT:W/C lift inspection

CAUSE:Preventive maintenance

CORRECTION:W/C PMI completion

W/C lift inspection completed

Line 20 W/C lift inspection performed
Bridge plate switch found broken
Bridge plate replaced

Part used:
One (1) bridge plate switch#32519KS(under warranty)

Activity Header
Activity: 5 999 TOTAL VEHICLE
Activity Note: Personal Risk Assessment
Reason for Repair: 05 Inspection, Routine
Work Accomplished: 06 Inspect
Part Failure:
Activity Comments:
Activity Parts
No Data Available
Activity Labor
No Data Available
Activity Sublet
No Data Available
Activity Checklist
Check List
5 Desc: Personal Risk Assessment
Task: PRA and Meter Readings Performed by: FSIMON Performed on: 07-APR-17

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		FSIMON	Apr 7, 2017 1:23:22 PM	No	
20 - Miles			FSIMON	Apr 7, 2017 1:23:22 PM	No	
30 - Kilometers			FSIMON	Apr 7, 2017 1:23:22 PM	No	
40 - Hours			FSIMON	Apr 7, 2017 1:23:22 PM	No	
Activity Sub Total						
			Activity 5 Sub Total			
			Parts:			0.00
			Labor:			0.00
			Labor Hours:			0.00
			Sublet Parts:			0.00
			Sublet Labor:			0.00
			Activity Sub Total			0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 34746062
Invoice No. 55345 - 34746062

Client Department:

Department: 55345M

Work Order Description

W/C Lift inspection

Requested By: FSIMON

Created By: FSIMON

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 62,082 - DH

Activity Header

Activity: 15

Activity Note:

Reason for Repair: 08 Preventive Maintenance

Work Accomplished:

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
07-Apr-17	Simon,Fritz	1	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

15 Desc:

Task: Braun Wheelchair Lift Inspection Performed by: FSIMON Performed on: 07-APR-17

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
100 - Record Lift Model in Notes	Done	NCL954FIB3454HB-2	FSIMON	Apr 7, 2017 1:23:01 PM	No	
200 - Record Serial # in Notes	Done	GA-01041	FSIMON	Apr 7, 2017 1:23:01 PM	No	
300 - Cycle Count	Cycles	3081	FSIMON	Apr 7, 2017 1:23:01 PM	No	
10,000 - A - GENERAL INSPECTION	Done		FSIMON	Apr 7, 2017 1:23:01 PM	No	
10,100 - Lift Battery, Circuit Breaker & Cable	Done		FSIMON	Apr 7, 2017 1:23:01 PM	No	
10,200 - Lift Ground & Secondary Ground	Done		FSIMON	Apr 7, 2017 1:23:01 PM	No	
10,300 - Vehicle Interlock Power	Done		FSIMON	Apr 7, 2017 1:23:01 PM	No	
10,400 - Vehicle Interlock Prohibits Vehicle Movement	Done		FSIMON	Apr 7, 2017 1:23:01 PM	No	
10,500 - Lift Door Condition	Done		FSIMON	Apr 7, 2017 1:23:01 PM	No	
10,600 - Hand Pendant Condition/Function	Done		FSIMON	Apr 7, 2017 1:23:01 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,700 - Inspect Mounting Components	Done		FSIMON	Apr 7, 2017 1:23:01 PM	No	
20,000 - B - CYCLE CHECK	Done		FSIMON	Apr 7, 2017 1:23:01 PM	No	
20,100 - General Operation Thruout Complete Cycle	Done		FSIMON	Apr 7, 2017 1:23:01 PM	No	
20,200 - Main, Handrail, OB & IB Bumper Adjustments	Done		FSIMON	Apr 7, 2017 1:23:01 PM	No	
20,300 - Floor Level Adjustment	Done		FSIMON	Apr 7, 2017 1:23:01 PM	No	
20,400 - Platform Angle Adjustment	Done		FSIMON	Apr 7, 2017 1:23:01 PM	No	
20,500 - Outer Barrier Interlock	Done		FSIMON	Apr 7, 2017 1:23:01 PM	No	
20,600 - Inner Barrier Interlock	Done		FSIMON	Apr 7, 2017 1:23:01 PM	No	
20,700 - Threshold Warning Interlock	Done		FSIMON	Apr 7, 2017 1:23:01 PM	No	
20,800 - 50 Pound Load Interlock	Done		FSIMON	Apr 7, 2017 1:23:01 PM	No	
20,900 - Platform Lights	Done		FSIMON	Apr 7, 2017 1:23:01 PM	No	
21,000 - Anti-Skid	Done		FSIMON	Apr 7, 2017 1:23:01 PM	No	
21,100 - Operation & Warning Decals	Done		FSIMON	Apr 7, 2017 1:23:01 PM	No	
21,200 - Back Pump Handle Location	Done		FSIMON	Apr 7, 2017 1:23:01 PM	No	
21,300 - Manual Override/Back-up System Function	Done		FSIMON	Apr 7, 2017 1:23:01 PM	No	
30,000 - C - MECHANICAL COMPONENTS	Done		FSIMON	Apr 7, 2017 1:23:01 PM	No	
30,100 - Base Plate, Tower, Arm & Platform Welds	Done		FSIMON	Apr 7, 2017 1:23:01 PM	No	
30,200 - Outer Barrier Pins, Gas Springs & Fasteners	Done		FSIMON	Apr 7, 2017 1:23:01 PM	No	
30,300 - Inner Barrier Pins, Gas Springs & Fasteners	Done		FSIMON	Apr 7, 2017 1:23:01 PM	No	
30,400 - Pivot Pin Fasteners	Done		FSIMON	Apr 7, 2017 1:23:01 PM	No	
30,500 - Pivot Pins & Bushing Condition	Done		FSIMON	Apr 7, 2017 1:23:01 PM	No	
30,600 - Handrails	Done		FSIMON	Apr 7, 2017 1:23:01 PM	No	
30,700 - Lift-Tite System	Done		FSIMON	Apr 7, 2017 1:23:01 PM	No	
40,000 - D - HYDRAULIC COMPONENT CHECKS	Done		FSIMON	Apr 7, 2017 1:23:01 PM	No	
40,100 - Leaks	Done		FSIMON	Apr 7, 2017 1:23:01 PM	No	
40,200 - Hoses & Harness Routing/Condition (pump,parallel-vertical arms,platform)	Done		FSIMON	Apr 7, 2017 1:23:01 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
40,300 - Remove Pump Cover & Check Fluid Level	Done		FSIMON	Apr 7, 2017 1:23:01 PM	No	
40,400 - Fluid Condition	Done		FSIMON	Apr 7, 2017 1:23:01 PM	No	
40,500 - LiftPump Motor Cables/Connections	Done		FSIMON	Apr 7, 2017 1:23:01 PM	No	
40,600 - Lift Pump Harnesses/Fuses/Electrical Components	Done		FSIMON	Apr 7, 2017 1:23:01 PM	No	

Activity Sub Total

Activity 15 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	1.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 34746062
Invoice No. 55345 - 34746062

Client Department:

Department: 55345M

Work Order Description

W/C Lift inspection

Requested By: FSIMON

Created By: FSIMON

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 62,082 - DH

Activity Header

Activity: 25

Activity Note: Bridge plate switch

Reason for Repair: 08 Preventive Maintenance

Work Accomplished:

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
07-Apr-17	Simon,Fritz	1	0	0

Activity Sublet

No Data Available

Activity Checklist

No Data Available

No Data Available

Activity Sub Total

Activity 25 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	1.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00

Work Order Footer

Work Order 34746062 Total

Parts:	0.00
Labor:	0.00
Labor Hours:	2.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 34728816
Invoice No. 55345 - 34728816

Client Department:

Department: 55345M

Work Order Description

Rear A/C not working on low position (Resistor)

Requested By: EDITORRES

Created By: EDITORRES

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 60,728 - DH

Chronology

Reported	Mar 27, 2017 10:05:20 AM	Mar 27, 2017 10:05:20 AM
Started	Mar 27, 2017 12:00:00 AM	
Completed	Mar 27, 2017 10:54:00 AM	Mar 27, 2017 10:54:00 AM
Down Time		

Work Order Notes

Line 10

COMPLAINT:

Rear A/C not working on low position (Resistor)

CAUSE:

Found that the left resistor for the rear A/C was bad.

CORRECTION:

Turned batteries off, Removed and replaced fan resistor.

Parts under shop supply.

Activity Header

Activity: 5 999 TOTAL VEHICLE

Activity Note: Personal Risk Assessment

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: Personal Risk Assessment

Task: PRA and Meter Readings Performed by: EDITORRES Performed on: 27-MAR-17

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		EDITORRES	Mar 27, 2017 10:07:25 AM	No	
20 - Miles			EDITORRES	Mar 27, 2017 10:07:25 AM	No	
30 - Kilometers			EDITORRES	Mar 27, 2017	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO	
				10:07:25 AM			
40 - Hours			EDITORRES	Mar 27, 2017 10:07:25 AM	No		
Activity Sub Total							
				Activity 5 Sub Total			
				Parts:			0.00
				Labor:			0.00
				Labor Hours:			0.00
				Sublet Parts:			0.00
				Sublet Labor:			0.00
				Activity Sub Total			0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 34728816
Invoice No. 55345 - 34728816

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Rear A/C not working on low position (Resistor)		Ford E450 Champion Challenger	
Requested By:	EDITORRES	Status:	40 - Closed (40)
Created By:	EDITORRES	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	60,728 - DH

Activity Header				
Activity: 15 001 AIR CONDITIONING, HEATING AND VENTILATION				
Activity Note: Rear A/C not working on low position (Resistor)				
Reason for Repair: 04 Driver's Report				
Work Accomplished:				
Part Failure:				
Activity Comments:				
Activity Parts				
No Data Available				
Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
27-Mar-17	Torres,Edwin	2.3833333	0	0
Activity Sublet				
No Data Available				
Activity Checklist				
No Data Available				
No Data Available				
Activity Sub Total				
			Activity 15 Sub Total	
			Parts:	0.00
			Labor:	0.00
			Labor Hours:	2.38
			Sublet Parts:	0.00
			Sublet Labor:	0.00
			Activity Sub Total	0.00
Work Order Footer				
			Work Order 34728816 Total	
			Parts:	0.00
			Labor:	0.00
			Labor Hours:	2.38
			Sublet Parts:	0.00
			Sublet Labor:	0.00
			Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 33336897
Invoice No. 55345 - 33336897

Client Department:

Department: 55345M

Work Order Description

PM A

Requested By: CVERGARA

Created By: CVERGARA

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 58,927 - DH

Chronology

Reported	Mar 6, 2017 2:16:28 PM	Mar 6, 2017 2:16:28 PM
Started	Mar 6, 2017 12:00:00 AM	
Completed	Mar 7, 2017 8:53:00 AM	Mar 7, 2017 8:53:00 AM
Down Time		

Work Order Notes

Line 10 COMPLAINT:PMA

CAUSE:PMA service due

CORRECTION:PMA completion

PMA performed

Engine oil filter replaced

Engine oil changed

Grease fittings lubricated

Materials used:

One (1) oil filter B329

Six(6) quarts of oil 5w20

Activity Header

Activity:10 999 TOTAL VEHICLE

Activity Note: Light Medium Duty PMI

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
06-Mar-17	Simon,Fritz	1.5	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: Light Medium Duty PMI

Task: First Transit Light-Medium Duty PMI Performed by: FSIMON Performed on: 07-MAR-17

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,000 - SECTION 1 Preparation and Drive On (In Lot) Inspection	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
10,100 - Safety Inspection	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
10,110 - FRA Check Drivers Pre-trip or DVIR/EVIR & Authorization Forms	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
10,120 - FRA Check All Warning Lights and Alarms	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
10,130 - FRA Check Automatic Transmission Neutral Start Operation	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
10,140 - Check Service Brakes	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
10,150 - FRA Start Engine and Listen for Any Unusual Noises	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
10,160 - FRA Check Instruments and Horns	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
10,170 - Check Fast Idle	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
10,180 - Check Starter Protection Circuit	-	NA	FSIMON	Mar 7, 2017 9:15:00 AM	No	
10,190 - Check Reverse Warning System	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
11,100 - Check Parking Brake	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
11,110 - Check HVAC Switches and Other Controls	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
11,120 - FRA Inspect Windshields, Mirror and Sun Visor Condition	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
11,130 - FRA Check Wiper and Washer Operation	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
11,140 - Road Test: Check for Proper Operation	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
11,150 - Perform Brake Test	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
11,161 - FRA Check/Record Oil Pressure / @1500 rpm	Pounds per Square Inch	NA	FSIMON	Mar 7, 2017 9:15:00 AM	No	
11,162 - FRA Check/Record Water Temperature	Degree Fahrenheit	NA	FSIMON	Mar 7, 2017 9:15:00 AM	No	
11,170 - FRA Check Door Operation	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
11,180 - FRA Check Operation of All Other Accessories	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
20,000 - SECTION 2 Interior Circle Inspection	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
20,210 - Check Condition of Operator's Area	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
20,220 - Check Accelerator and Brake Pedals	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
20,230 - FRA Check Wiring Under Dash	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
20,240 - FRA Check Interior Lights	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
20,250 - FRA Check Interior Electrical Panels	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
20,260 - Check Stop Request System	-	NA	FSIMON	Mar 7, 2017 9:15:00 AM	No	
20,270 - Check Fare Box Mounting (If Applicable)	-	NA	FSIMON	Mar 7, 2017 9:15:00 AM	No	
20,280 - Check Seats, Seat Belts, Hand Rails and Floor Covering	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
20,290 - Check for Physical Damage, Water Leaks, and Graffiti	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
22,100 - Check Emergency Windows and Glass Condition	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
22,110 - Check Emergency Hatches	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
22,120 - Check All Safety Equipment	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
30,000 - SECTION 3 Exterior Circle Inspection	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
30,310 - Check Passenger Doors	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
30,320 - Inspect Step-well and Hand Rails	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
30,330 - Check Wheelchair Lift Operation	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
30,340 - FRA Check Destination Sign and Run Box	-	NA	FSIMON	Mar 7, 2017 9:15:00 AM	No	
30,350 - FRA Inspect Mirror and Mountings	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
30,360 - Check for Physical Damage and Decals	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
30,370 - Check Wiper Blade and Arm Condition	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
30,380 - Check Exterior Compartment Doors	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
30,390 - FRA Check Fuel Tank Cap	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
33,100 - Check Lights and Reflectors	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
33,110 - Check License Plate, Permits and State Inspection Decals	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
40,000 - SECTION 4 Engine Compartment Inspection	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
40,410 - FRA Check Engine Compartment/Condition for Fire Risk	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
40,420 - Check Hood	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
40,430 - Check Fan, Shroud and Radiator	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
40,440 - Test Coolant System Using Test Strips and Record Results	-	NA	FSIMON	Mar 7, 2017 9:15:00 AM	No	
40,441 - Inhibitor Test Pass or Fail (Indicate with a Yes or No)	No	NA	FSIMON	Mar 7, 2017 9:15:00 AM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
40,442 - Freeze Point	Degree Fahrenheit	NA	FSIMON	Mar 7, 2017 9:15:00 AM	No	
40,450 - FRA Check Coolant Recovery System Condition & for Leaks	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
40,460 - Record Antifreeze Protection Level Using Refractometer	-	NA	FSIMON	Mar 7, 2017 9:15:00 AM	No	
40,461 - Refractometer Reading	Degree Fahrenheit	NA	FSIMON	Mar 7, 2017 9:15:00 AM	No	
40,470 - Pressure Test Cooling System and Check for Leaks	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
40,480 - FRA Check Coolant Hose Condition	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
40,490 - FRA Check Alternator Mount and Condition	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
44,100 - FRA Check Fuel Control and Transmission Connections	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
44,110 - FRA Check Master Cylinder Fluid Level	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
44,120 - FRA Check All Belts for Condition, Alignment and Tension	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
44,130 - FRA Check Exhaust System	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
44,140 - FRA Check Intake System	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
44,150 - FRA Inspect Turbocharger	-	NA	FSIMON	Mar 7, 2017 9:15:00 AM	No	
44,160 - FRA Inspect Power Steering and Hydraulic Fluid	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
44,170 - FRA Check All Engine or Belt Driven Components	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
44,180 - FRA Check for Leaks	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
44,190 - FRA Perform Battery Inspection	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
44,200 - FRA Check Battery Box Corrosion, Cables and Hold-Downs	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
50,000 - SECTION 5 Steering System Inspection	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
50,510 - Check Entire Steering System	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
60,000 - SECTION 6 Tires and Wheel Inspection	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
60,610 - FRA Check and Record Air Pressure	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
60,611 - Air Pressure RF	65 Pounds per Square Inch		FSIMON	Mar 7, 2017 9:15:00 AM	No	
60,612 - Air Pressure LF	65 Pounds per Square Inch		FSIMON	Mar 7, 2017 9:15:00 AM	No	
60,613 - Air Pressure RRO	70 Pounds per Square Inch		FSIMON	Mar 7, 2017 9:15:00 AM	No	
60,614 - Air Pressure RRI	70 Pounds per Square Inch		FSIMON	Mar 7, 2017 9:15:00 AM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
60,615 - Air Pressure LRI	70 Pounds per Square Inch		FSIMON	Mar 7, 2017 9:15:00 AM	No	
60,616 - Air Pressure LRO	70 Pounds per Square Inch		FSIMON	Mar 7, 2017 9:15:00 AM	No	
60,620 - Check Valve Stems and Caps	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
60,630 - Check and Record Tread Depth	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
60,631 - Tread Depth RF	13 32nds of an inch		FSIMON	Mar 7, 2017 9:15:00 AM	No	
60,632 - Tread Depth LF	13 32nds of an inch		FSIMON	Mar 7, 2017 9:15:00 AM	No	
60,633 - Tread Depth RRO	6 32nds of an inch		FSIMON	Mar 7, 2017 9:15:00 AM	No	
60,634 - Tread Depth RRI	6 32nds of an inch		FSIMON	Mar 7, 2017 9:15:00 AM	No	
60,635 - Tread Depth LRI	3 32nds of an inch		FSIMON	Mar 7, 2017 9:15:00 AM	No	
60,636 - Tread Depth LRO	6 32nds of an inch		FSIMON	Mar 7, 2017 9:15:00 AM	No	
60,640 - Check for Mismatched Tread or Casing Design	Done	6mm	FSIMON	Mar 7, 2017 9:15:00 AM	No	
60,650 - Check Sidewall Wear	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
60,660 - Inspect for Cuts and Tears	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
60,670 - Check Dual Mating With Square	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
60,680 - Check Wheels for Cracks and Loose Lugs	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
60,690 - Check Tires for Irregular or Alignment Wear	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
66,100 - FRA Check Outer Hubs for Leaks	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
70,000 - SECTION 7 Under Vehicle Inspection	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
70,710 - Check Vibration Damper	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
70,720 - Check Engine and Transmission Mounts	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
70,730 - FRA Check Starter	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
70,740 - FRA Check Bottom of Engine for Fluid Leaks	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
70,750 - FRA Check Transmission for Leaks	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
70,760 - FRA Check Differential Breather and Fluid	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
70,770 - FRA Check Exhaust System	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
70,780 - Check Driveline, U-joint and Slip Yokes	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
70,790 - Check All Body Mounts and Chassis Frame	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
77,100 - FRA Check Security, Integrity and Length of Ground Straps	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
77,110 - FRA Check Fuel Tank	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
77,120 - Check Suspension Components	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
77,130 - FRA Check Brake Pad Thickness and Rotor for Wear	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
77,131 - Brake Pad Thickness LF	Inch	10mm	FSIMON	Mar 7, 2017 9:15:00 AM	No	
77,132 - Brake Pad Thickness RF	Inch	10mm	FSIMON	Mar 7, 2017 9:15:00 AM	No	
77,133 - Brake Pad Thickness LR	Inch	10mm	FSIMON	Mar 7, 2017 9:15:00 AM	No	
77,134 - Brake Pad Thickness RR	Inch	10mm	FSIMON	Mar 7, 2017 9:15:00 AM	No	
77,135 - Brake Rotor LF	Inch	40mm	FSIMON	Mar 7, 2017 9:15:00 AM	No	
77,136 - Brake Rotor RF	Inch	40mm	FSIMON	Mar 7, 2017 9:15:00 AM	No	
77,137 - Brake Rotor LR	Inch	40mm	FSIMON	Mar 7, 2017 9:15:00 AM	No	
77,138 - Brake Rotor RR	Inch	40mm	FSIMON	Mar 7, 2017 9:15:00 AM	No	
77,140 - FRA Check Brake Hoses	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
77,150 - Check King Pins	-	NA	FSIMON	Mar 7, 2017 9:15:00 AM	No	
77,160 - FRA Check for Loose or Noisy Wheel Bearings	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
80,000 - SECTION 8 PMI Report Completion	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
80,810 - Completion of PMI Report	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
90,000 - SECTION 9 Completion of PMI	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	
90,910 - Vehicle Returned to predetermined location	Done		FSIMON	Mar 7, 2017 9:15:00 AM	No	

Activity Sub Total

Activity 10 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	1.50
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 33336897
Invoice No. 55345 - 33336897

Client Department:

Department: 55345M

Work Order Description

PM A

Requested By: CVERGARA

Created By: CVERGARA

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 58,927 - DH

Activity Header

Activity: 20 999 TOTAL VEHICLE

Activity Note: PM A

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: A PM Level A

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
06-Mar-17	B329	GOING OUT OF SERVICE DO NOT ORDER USE B329 IN THE FLEET ORG FILTER, OIL	1	1.92	1.92

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
06-Mar-17	Simon,Fritz	0.5	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List						
20 Desc: PM A						
Task: PM A SERVICE Performed by: FSIMON Performed on: 07-MAR-17						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
100,000 - "A" PMI SERVICING ITEMS	Done		FSIMON	Mar 7, 2017 9:09:22 AM	No	
101,000 - FRA Change Oil Filters	Yes		FSIMON	Mar 7, 2017 9:09:22 AM	No	
102,000 - FRA Drain Engine Oil	Yes		FSIMON	Mar 7, 2017 9:09:22 AM	No	
103,000 - FRA Check Transmission Fluid	Done		FSIMON	Mar 7, 2017 9:09:22 AM	No	
104,000 - Lubricate Chassis	Done		FSIMON	Mar 7, 2017 9:09:22 AM	No	
105,000 - Replace or Clean A/C Filters	Done		FSIMON	Mar 7, 2017 9:09:22 AM	No	
107,000 - FRA Change Primary Fuel Filter	No	NA	FSIMON	Mar 7, 2017 9:09:22 AM	No	
108,000 - Lube all pivoting Mechanisms	Done		FSIMON	Mar 7, 2017 9:09:22 AM	No	

Activity Sub Total

Activity 20 Sub Total	
Parts:	1.92
Labor:	0.00
Labor Hours:	0.50
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	1.92



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 33336897
Invoice No. 55345 - 33336897

Client Department:

Department: 55345M

Work Order Description

PM A

Requested By: CVERGARA

Created By: CVERGARA

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 58,927 - DH

Activity Header

Activity: 30 999 TOTAL VEHICLE

Activity Note: PRAMETER

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

30 Desc: PRAMETER

Task: PRA and Meter Readings Performed by: FSIMON Performed on: 06-MAR-17

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		FSIMON	Mar 6, 2017 3:31:57 PM	No	
20 - Miles			FSIMON	Mar 6, 2017 3:31:57 PM	No	
30 - Kilometers			FSIMON	Mar 6, 2017 3:31:57 PM	No	
40 - Hours			FSIMON	Mar 6, 2017 3:31:57 PM	No	

Activity Sub Total

Activity 30 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00

Work Order Footer


Work Order 33336897 Total

Parts:	1.92
Labor:	0.00
Labor Hours:	2.00
Sublet Parts:	0.00
Sublet Labor:	0.00

	Activity Sub Total	1.92
--	---------------------------	-------------



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 33326610
Invoice No. 55345 - 33326610

Client Department:

Department: 55345M

Work Order Description

Front and rear brakes and Pulley bearings FTLMPMI_FOLLOWUP

Requested By: FSIMON

Created By: FSIMON

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 54,872 - DH

Chronology

Reported	Feb 1, 2017 8:58:23 AM	Feb 1, 2017 8:58:23 AM
Started	Feb 1, 2017 12:00:00 AM	
Completed	Feb 2, 2017 2:06:00 PM	Feb 2, 2017 2:06:00 PM
Down Time		

Work Order Notes

Line 10

COMPLAINT:Front and rear brake pads out of specs.

CAUSE:Normal wear

CORRECTION:Brake pads replacement

Front and rear brake pads replaced

Engine compartment inspected and checked for noise,Idler pulley bearings found faulty.

Idler pulley removed

Idler pulley bearings replaced

Idler pulley reinstalled

Parts used:

One (1) brake pads BRSD1328

One (1) brake pads BRSD1330

Two(2) idler pulley bearings #6203-3RSJ

Activity Header

Activity:10 013/002 REAR BRAKES & DRUMS

Activity Note: 3mm

Reason for Repair:

Work Accomplished:

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
01-Feb-17	BRSD-1328	PADS, BRAKE, DISC, FRONT	1	50.32	50.32
01-Feb-17	BRSD-1330	PADS, BRAKE, DISC, REAR, FORD SAME AS PFH133020	1	43.15	43.15

Activity Labor

No Data Available


Activity Sublet

No Data Available

Activity Checklist															
No Data Available															
No Data Available															
Activity Sub Total															
<table> <tr> <td colspan="2">Activity 10 Sub Total</td></tr> <tr> <td>Parts:</td><td>93.47</td></tr> <tr> <td>Labor:</td><td>0.00</td></tr> <tr> <td>Labor Hours:</td><td>0.00</td></tr> <tr> <td>Sublet Parts:</td><td>0.00</td></tr> <tr> <td>Sublet Labor:</td><td>0.00</td></tr> <tr> <td>Activity Sub Total</td><td>93.47</td></tr> </table>		Activity 10 Sub Total		Parts:	93.47	Labor:	0.00	Labor Hours:	0.00	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	93.47
Activity 10 Sub Total															
Parts:	93.47														
Labor:	0.00														
Labor Hours:	0.00														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	93.47														



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 33326610
Invoice No. 55345 - 33326610

Client Department:
Department: 55345M
Work Order Description
Front and rear brakes and Pulley bearings FTLMPMI_FOLLOWUP
Requested By: FSIMON
Created By: FSIMON
Assigned To:
Class: WO - WORK ORDER
Arrangement: Unassigned
Potential Warranty: No

Equipment No.: 4514-P
VIN: 1FDFE4FS7EDB17176
Ford E450 Champion Challenger
Status: 40 - Closed (40)
Priority: 1 - Low
Driver:
Phone:
ETA:
Meter: 54,872 - DH

Activity Header
Activity:20
Activity Note:
Reason for Repair: 08 Preventive Maintenance
Work Accomplished:
Part Failure:
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
02-Feb-17	6203	BEARING, SHAFT, STEERING, POWER	2	2.54	5.08

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
01-Feb-17	Simon,Fritz	4	0	0

Activity Sublet
No Data Available

Activity Checklist						
Check List						
20 Desc: Task: PRA and Meter Readings Performed by: FSIMON Performed on: 01-FEB-17						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		FSIMON	Feb 1, 2017 9:17:36 AM	No	
20 - Miles			FSIMON	Feb 1, 2017 9:17:36 AM	No	
30 - Kilometers			FSIMON	Feb 1, 2017 9:17:36 AM	No	
40 - Hours			FSIMON	Feb 1, 2017 9:17:36 AM	No	

Activity Sub Total															
<table><tr><th colspan="2">Activity 20 Sub Total</th></tr><tr><td>Parts:</td><td>5.08</td></tr><tr><td>Labor:</td><td>0.00</td></tr><tr><td>Labor Hours:</td><td>4.00</td></tr><tr><td>Sublet Parts:</td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td>5.08</td></tr></table>		Activity 20 Sub Total		Parts:	5.08	Labor:	0.00	Labor Hours:	4.00	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	5.08
Activity 20 Sub Total															
Parts:	5.08														
Labor:	0.00														
Labor Hours:	4.00														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	5.08														

Work Order Footer					
<table><tr><th colspan="2">Work Order 33326610 Total</th></tr><tr><td>Parts:</td><td>98.55</td></tr></table>		Work Order 33326610 Total		Parts:	98.55
Work Order 33326610 Total					
Parts:	98.55				

	Labor:	0.00
	Labor Hours:	4.00
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	98.55



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 28925584
Invoice No. 55345 - 28925584

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
PM A		Ford E450 Champion Challenger	
Requested By:	CVERGARA	Status:	40 - Closed (40)
Created By:	CVERGARA	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	55,088 - DH

Chronology		
Reported	Jan 31, 2017 11:34:53 AM	Jan 31, 2017 11:34:53 AM
Started		
Completed	Feb 1, 2017 1:31:00 PM	Feb 1, 2017 1:31:00 PM
Down Time		

Work Order Notes

Line 10 COMPLAINT:PMA

CAUSE:PMA due

CORRECTION:PMA completion

PMA performed
Engine oil filter replaced
Engine oil changed
Grease fittings lubricated
Tires rotated
Tires inflated to specs.

Materials used:
One (1) oil filter B329
Six (6) quarts of oil 5w20

Activity Header					
Activity:10 999 TOTAL VEHICLE					
Activity Note: Light Medium Duty PMI					
Reason for Repair: 08 Preventive Maintenance					
Work Accomplished: 06 Inspect					
Part Failure:					
Activity Comments:					
Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
01-Feb-17	B329	GOING OUT OF SERVICE DO NOT ORDER USE B329 IN THE FLEET ORG FILTER, OIL	1	1.92	1.92
Activity Labor					
No Data Available					
Activity Sublet					
No Data Available					
Activity Checklist					

Check List

10 Desc: Light Medium Duty PMI

Task: First Transit Light-Medium Duty PMI Performed by: FSIMON Performed on: 01-FEB-17

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,000 - SECTION 1 Preparation and Drive On (In Lot) Inspection	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
10,100 - Safety Inspection	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
10,110 - FRA Check Drivers Pre-trip or DVIR/EVIR & Authorization Forms	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
10,120 - FRA Check All Warning Lights and Alarms	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
10,130 - FRA Check Automatic Transmission Neutral Start Operation	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
10,140 - Check Service Brakes	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
10,150 - FRA Start Engine and Listen for Any Unusual Noises	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
10,160 - FRA Check Instruments and Horns	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
10,170 - Check Fast Idle	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
10,180 - Check Starter Protection Circuit	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
10,190 - Check Reverse Warning System	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
11,100 - Check Parking Brake	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
11,110 - Check HVAC Switches and Other Controls	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
11,120 - FRA Inspect Windshields, Mirror and Sun Visor Condition	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
11,130 - FRA Check Wiper and Washer Operation	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
11,140 - Road Test: Check for Proper Operation	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
11,150 - Perform Brake Test	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
11,161 - FRA Check/Record Oil Pressure / @1500 rpm	Pounds per Square Inch	NA	FSIMON	Feb 1, 2017 9:02:51 AM	No	
11,162 - FRA Check/Record Water Temperature	Degree Fahrenheit	NA	FSIMON	Feb 1, 2017 9:02:51 AM	No	
11,170 - FRA Check Door Operation	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
11,180 - FRA Check Operation of All Other Accessories	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
20,000 - SECTION 2 Interior Circle Inspection	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
20,210 - Check Condition of Operator's Area	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
20,220 - Check Accelerator and Brake Pedals	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
20,230 - FRA Check Wiring Under Dash	Done		FSIMON	Feb 1, 2017	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
				9:02:51 AM		
20,240 - FRA Check Interior Lights	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
20,250 - FRA Check Interior Electrical Panels	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
20,260 - Check Stop Request System	-	NA	FSIMON	Feb 1, 2017 9:02:51 AM	No	
20,270 - Check Fare Box Mounting (If Applicable)	-	NA	FSIMON	Feb 1, 2017 9:02:51 AM	No	
20,280 - Check Seats, Seat Belts, Hand Rails and Floor Covering	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
20,290 - Check for Physical Damage, Water Leaks, and Graffiti	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
22,100 - Check Emergency Windows and Glass Condition	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
22,110 - Check Emergency Hatches	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
22,120 - Check All Safety Equipment	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
30,000 - SECTION 3 Exterior Circle Inspection	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
30,310 - Check Passenger Doors	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
30,320 - Inspect Step-well and Hand Rails	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
30,330 - Check Wheelchair Lift Operation	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
30,340 - FRA Check Destination Sign and Run Box	-	NA	FSIMON	Feb 1, 2017 9:02:51 AM	No	
30,350 - FRA Inspect Mirror and Mountings	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
30,360 - Check for Physical Damage and Decals	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
30,370 - Check Wiper Blade and Arm Condition	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
30,380 - Check Exterior Compartment Doors	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
30,390 - FRA Check Fuel Tank Cap	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
33,100 - Check Lights and Reflectors	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
33,110 - Check License Plate, Permits and State Inspection Decals	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
40,000 - SECTION 4 Engine Compartment Inspection	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
40,410 - FRA Check Engine Compartment/Condition for Fire Risk	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
40,420 - Check Hood	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
40,430 - Check Fan, Shroud and Radiator	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
40,440 - Test Coolant System Using Test Strips	-	NA	FSIMON	Feb 1, 2017	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
and Record Results				9:02:51 AM		
40,441 - Inhibitor Test Pass or Fail (Indicate with a Yes or No)	No	NA	FSIMON	Feb 1, 2017 9:02:51 AM	No	
40,442 - Freeze Point	Degree Fahrenheit	NA	FSIMON	Feb 1, 2017 9:02:51 AM	No	
40,450 - FRA Check Coolant Recovery System Condition & for Leaks	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
40,460 - Record Antifreeze Protection Level Using Refractometer	-	NA	FSIMON	Feb 1, 2017 9:02:51 AM	No	
40,461 - Refractometer Reading	Degree Fahrenheit	NA	FSIMON	Feb 1, 2017 9:02:51 AM	No	
40,470 - Pressure Test Cooling System and Check for Leaks	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
40,480 - FRA Check Coolant Hose Condition	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
40,490 - FRA Check Alternator Mount and Condition	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
44,100 - FRA Check Fuel Control and Transmission Connections	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
44,110 - FRA Check Master Cylinder Fluid Level	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
44,120 - FRA Check All Belts for Condition, Alignment and Tension	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
44,130 - FRA Check Exhaust System	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
44,140 - FRA Check Intake System	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
44,150 - FRA Inspect Turbocharger	-	NA	FSIMON	Feb 1, 2017 9:02:51 AM	No	
44,160 - FRA Inspect Power Steering and Hydraulic Fluid	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
44,170 - FRA Check All Engine or Belt Driven Components	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
44,180 - FRA Check for Leaks	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
44,190 - FRA Perform Battery Inspection	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
44,200 - FRA Check Battery Box Corrosion, Cables and Hold-Downs	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
50,000 - SECTION 5 Steering System Inspection	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
50,510 - Check Entire Steering System	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
60,000 - SECTION 6 Tires and Wheel Inspection	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
60,610 - FRA Check and Record Air Pressure	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
60,611 - Air Pressure RF	65 Pounds per Square Inch		FSIMON	Feb 1, 2017 9:02:51 AM	No	
60,612 - Air Pressure LF	65 Pounds per Square Inch		FSIMON	Feb 1, 2017 9:02:51 AM	No	
60,613 - Air Pressure RRO	65 Pounds per		FSIMON	Feb 1, 2017	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
	Square Inch			9:02:51 AM		
60,614 - Air Pressure RRI	65 Pounds per Square Inch		FSIMON	Feb 1, 2017 9:02:51 AM	No	
60,615 - Air Pressure LRI	65 Pounds per Square Inch		FSIMON	Feb 1, 2017 9:02:51 AM	No	
60,616 - Air Pressure LRO	65 Pounds per Square Inch		FSIMON	Feb 1, 2017 9:02:51 AM	No	
60,620 - Check Valve Stems and Caps	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
60,630 - Check and Record Tread Depth	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
60,631 - Tread Depth RF	9 32nds of an inch		FSIMON	Feb 1, 2017 9:02:51 AM	No	
60,632 - Tread Depth LF	9 32nds of an inch		FSIMON	Feb 1, 2017 9:02:51 AM	No	
60,633 - Tread Depth RRO	8 32nds of an inch		FSIMON	Feb 1, 2017 9:02:51 AM	No	
60,634 - Tread Depth RRI	8 32nds of an inch		FSIMON	Feb 1, 2017 9:02:51 AM	No	
60,635 - Tread Depth LRI	8 32nds of an inch		FSIMON	Feb 1, 2017 9:02:51 AM	No	
60,636 - Tread Depth LRO	7 32nds of an inch		FSIMON	Feb 1, 2017 9:02:51 AM	No	
60,640 - Check for Mismatched Tread or Casing Design	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
60,650 - Check Sidewall Wear	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
60,660 - Inspect for Cuts and Tears	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
60,670 - Check Dual Mating With Square	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
60,680 - Check Wheels for Cracks and Loose Lugs	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
60,690 - Check Tires for Irregular or Alignment Wear	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
66,100 - FRA Check Outer Hubs for Leaks	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
70,000 - SECTION 7 Under Vehicle Inspection	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
70,710 - Check Vibration Damper	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
70,720 - Check Engine and Transmission Mounts	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
70,730 - FRA Check Starter	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
70,740 - FRA Check Bottom of Engine for Fluid Leaks	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
70,750 - FRA Check Transmission for Leaks	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
70,760 - FRA Check Differential Breather and Fluid	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
70,770 - FRA Check Exhaust System	Done		FSIMON	Feb 1, 2017	No	


Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
				9:02:51 AM		
70,780 - Check Driveline, U-joint and Slip Yokes	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
70,790 - Check All Body Mounts and Chassis Frame	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
77,100 - FRA Check Security, Integrity and Length of Ground Straps	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
77,110 - FRA Check Fuel Tank	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
77,120 - Check Suspension Components	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
77,130 - FRA Check Brake Pad Thickness and Rotor for Wear	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
77,131 - Brake Pad Thickness LF	Inch	4mm	FSIMON	Feb 1, 2017 9:02:51 AM	No	
77,132 - Brake Pad Thickness RF	Inch	4mm	FSIMON	Feb 1, 2017 9:02:51 AM	No	
77,133 - Brake Pad Thickness LR	Inch	3mm	FSIMON	Feb 1, 2017 9:02:51 AM	No	
77,134 - Brake Pad Thickness RR	Inch	3mm	FSIMON	Feb 1, 2017 9:02:51 AM	Yes	33326610
77,135 - Brake Rotor LF	Inch	40mm	FSIMON	Feb 1, 2017 9:02:51 AM	No	
77,136 - Brake Rotor RF	Inch	40mm	FSIMON	Feb 1, 2017 9:02:51 AM	No	
77,137 - Brake Rotor LR	0 Inch	36mm	FSIMON	Feb 1, 2017 9:02:51 AM	No	
77,138 - Brake Rotor RR	Inch	36mm	FSIMON	Feb 1, 2017 9:02:51 AM	No	
77,140 - FRA Check Brake Hoses	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
77,150 - Check King Pins	-	NA	FSIMON	Feb 1, 2017 9:02:51 AM	No	
77,160 - FRA Check for Loose or Noisy Wheel Bearings	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
80,000 - SECTION 8 PMI Report Completion	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
80,810 - Completion of PMI Report	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
90,000 - SECTION 9 Completion of PMI	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	
90,910 - Vehicle Returned to predetermined location	Done		FSIMON	Feb 1, 2017 9:02:51 AM	No	

Activity Sub Total

Activity 10 Sub Total	
Parts:	1.92
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	1.92



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 28925584
Invoice No. 55345 - 28925584

Client Department:

Department: 55345M

Work Order Description

PM A

Requested By: CVERGARA

Created By: CVERGARA

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 55,088 - DH

Activity Header

Activity: 20 999 TOTAL VEHICLE

Activity Note: PM A

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: A PM Level A

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

20 Desc: PM A

Task: PM A SERVICE Performed by: FSIMON Performed on: 01-FEB-17

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
100,000 - "A" PMI SERVICING ITEMS	Done		FSIMON	Feb 1, 2017 8:59:41 AM	No	
101,000 - FRA Change Oil Filters	Yes		FSIMON	Feb 1, 2017 8:59:41 AM	No	
102,000 - FRA Drain Engine Oil	Yes		FSIMON	Feb 1, 2017 8:59:41 AM	No	
103,000 - FRA Check Transmission Fluid	Done		FSIMON	Feb 1, 2017 8:59:41 AM	No	
104,000 - Lubricate Chassis	Done		FSIMON	Feb 1, 2017 8:59:41 AM	No	
105,000 - Replace or Clean A/C Filters	Done		FSIMON	Feb 1, 2017 8:59:41 AM	No	
107,000 - FRA Change Primary Fuel Filter	No		FSIMON	Feb 1, 2017 8:59:41 AM	No	
108,000 - Lube all pivoting Mechanisms	Done		FSIMON	Feb 1, 2017 8:59:41 AM	No	

Activity Sub Total


Activity 20 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00

	Sublet Labor:	0.00
	Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 28925584
Invoice No. 55345 - 28925584

Client Department:

Department: 55345M

Work Order Description

PM A

Requested By: CVERGARA

Created By: CVERGARA

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 55,088 - DH

Activity Header

Activity: 30 999 TOTAL VEHICLE

Activity Note: PRAMETER

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

30 Desc: PRAMETER

Task: PRA and Meter Readings Performed by: FSIMON Performed on: 01-FEB-17

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		FSIMON	Feb 1, 2017 9:00:21 AM	No	
20 - Miles			FSIMON	Feb 1, 2017 9:00:21 AM	No	
30 - Kilometers			FSIMON	Feb 1, 2017 9:00:21 AM	No	
40 - Hours			FSIMON	Feb 1, 2017 9:00:21 AM	No	

Activity Sub Total

Activity 30 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00

Work Order Footer


Work Order 28925584 Total

Parts:	1.92
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00

	Activity Sub Total	1.92
--	---------------------------	-------------



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 30026816
Invoice No. 55345 - 30026816

Client Department:

Department: 55345M

Work Order Description

Need transmission service

Requested By: HPIERRE

Created By: HPIERRE

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 51,190 - DH

Chronology

Reported	Dec 13, 2016 8:30:06 AM	Dec 13, 2016 8:30:06 AM
Started	Dec 14, 2016 12:00:00 AM	
Completed	Dec 15, 2016 10:24:55 AM	Dec 15, 2016 10:24:55 AM
Down Time		

Work Order Notes

Line 10

COMPLAINT: need transmission service

CAUSE:regular maintenance

CORRECTION: perform transmission service replace filter add fluids completed

Transmission filter #FT-180-8C3Z-7A098-D qty 1

Transmission fluids #qts 10

Activity Header

Activity:5 999 TOTAL VEHICLE

Activity Note: Personal Risk Assessment

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
14-Dec-16	Pierre,Hubert J	0.0833333	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: Personal Risk Assessment

Task: PRA and Meter Readings Performed by: HPIERRE Performed on: 13-DEC-16

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		HPIERRE	Dec 13, 2016 8:35:34 AM	No	
20 - Miles			HPIERRE	Dec 13, 2016 8:35:34 AM	No	
30 - Kilometers			HPIERRE	Dec 13, 2016	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
				8:35:34 AM		
40 - Hours			HPIERRE	Dec 13, 2016 8:35:34 AM	No	
Activity Sub Total				Activity 5 Sub Total		
				Parts:		0.00
				Labor:		0.00
				Labor Hours:		0.08
				Sublet Parts:		0.00
				Sublet Labor:		0.00
				Activity Sub Total		0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 30026816
Invoice No. 55345 - 30026816

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Need transmission service		Ford E450 Champion Challenger	
Requested By:	HPIERRE	Status:	40 - Closed (40)
Created By:	HPIERRE	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	51,190 - DH

Activity Header
Activity: 15 027 TRANSMISSION, MAIN, AUTOMATIC
Activity Note:
Reason for Repair: 08 Preventive Maintenance
Work Accomplished:
Part Failure:
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
14-Dec-16	FT180	FILTER, TRANSMISSION	1	35.76	35.76

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
14-Dec-16	Pierre, Hubert J	2	0	0

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available

Activity Sub Total		Activity 15 Sub Total	
Parts:			35.76
Labor:			0.00
Labor Hours:			2.00
Sublet Parts:			0.00
Sublet Labor:			0.00
Activity Sub Total			35.76

Work Order Footer		Work Order 30026816 Total	
Parts:			35.76
Labor:			0.00
Labor Hours:			2.08
Sublet Parts:			0.00
Sublet Labor:			0.00
Activity Sub Total			35.76



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 29596213
Invoice No. 55345 - 29596213

Client Department:

Department: 55345M

Work Order Description

Check rear A/C

Requested By: FSIMON

Created By: FSIMON

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 51,156 - DH

Chronology

Reported	Dec 8, 2016 1:33:09 PM	Dec 8, 2016 1:33:09 PM
Started	Dec 8, 2016 12:00:00 AM	
Completed	Dec 8, 2016 3:05:25 PM	Dec 8, 2016 3:05:25 PM
Down Time		

Work Order Notes

Line 10

COMPLAINT:Rear A/C not working properly

CAUSE:Not identified

CORRECTION:Rear A/C under monitoring

Complaint cannot be verified

Visual inspection performed no leak noticed

Road test performed ,Rear A/C working ok

Rear A/C system checked , high and low sides lines pressures found within specifications.

Rear A/C under monitoring

No parts used

Activity Header

Activity:5 999 TOTAL VEHICLE

Activity Note: Personal Risk Assessment

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: Personal Risk Assessment

Task: PRA and Meter Readings Performed by: FSIMON Performed on: 08-DEC-16

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal	Done		FSIMON	Dec 8, 2016	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
Risk Assessment?				1:52:13 PM		
20 - Miles			FSIMON	Dec 8, 2016 1:52:13 PM	No	
30 - Kilometers			FSIMON	Dec 8, 2016 1:52:13 PM	No	
40 - Hours			FSIMON	Dec 8, 2016 1:52:13 PM	No	
Activity Sub Total						
			Activity 5 Sub Total			
			Parts:			0.00
			Labor:			0.00
			Labor Hours:			0.00
			Sublet Parts:			0.00
			Sublet Labor:			0.00
			Activity Sub Total			0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 29596213
Invoice No. 55345 - 29596213

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FD4E4FS7EDB17176
Check rear A/C		Ford E450 Champion Challenger	
Requested By:	FSIMON	Status:	40 - Closed (40)
Created By:	FSIMON	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	51,156 - DH

Activity Header
Activity: 15
Activity Note:
Reason for Repair: 04 Driver's Report
Work Accomplished:
Part Failure:
Activity Comments:

Activity Parts
No Data Available

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
08-Dec-16	Simon,Fritz	3	0	0

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available

Activity Sub Total		Activity 15 Sub Total	
		Parts:	0.00
		Labor:	0.00
		Labor Hours:	3.00
		Sublet Parts:	0.00
		Sublet Labor:	0.00
		Activity Sub Total	0.00

Work Order Footer		Work Order 29596213 Total	
		Parts:	0.00
		Labor:	0.00
		Labor Hours:	3.00
		Sublet Parts:	0.00
		Sublet Labor:	0.00
		Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 29388443
Invoice No. 55345 - 29388443

Client Department:

Department: 55345M

Work Order Description

Vehicle involved in an accident

Requested By: EDITORRES

Created By: EDITORRES

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 50,879 - DH

Chronology

Reported	Dec 6, 2016 10:43:37 AM	Dec 6, 2016 10:43:37 AM
Started	Dec 6, 2016 12:00:00 AM	
Completed	Dec 6, 2016 1:34:00 PM	Dec 6, 2016 1:34:00 PM
Down Time		

Work Order Notes

Line 10

COMPLAINT:

Damage to the body panel around rear A/C condenser and to the condenser grill.

CAUSE:

Involved in an accident

CORRECTION:

Removed the damaged panel and cut out holes for new panel, painted new panel, installed new panel. Installed a new grill over condenser.

Parts

4342879 Qty 1 Grill

panel

Activity Header

Activity: 5 999 TOTAL VEHICLE

Activity Note: Personal Risk Assessment

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: Personal Risk Assessment

Task: PRA and Meter Readings Performed by: EDITORRES Performed on: 06-DEC-16

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		EDITORRES	Dec 6, 2016 11:27:43 AM	No	
20 - Miles			EDITORRES	Dec 6, 2016	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO	
				11:27:43 AM			
30 - Kilometers			EDTORRES	Dec 6, 2016 11:27:43 AM	No		
40 - Hours			EDTORRES	Dec 6, 2016 11:27:43 AM	No		
Activity Sub Total							
				Activity 5 Sub Total			
				Parts:		0.00	
				Labor:		0.00	
				Labor Hours:		0.00	
				Sublet Parts:		0.00	
				Sublet Labor:		0.00	
				Activity Sub Total		0.00	



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 29388443
Invoice No. 55345 - 29388443

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Vehicle involved in an accident		Ford E450 Champion Challenger	
Requested By:	EDITORRES	Status:	40 - Closed (40)
Created By:	EDITORRES	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	50,879 - DH

Activity Header
Activity: 15
Activity Note: Vehicle involved in an accident.
Reason for Repair: 41 Abuse of Equipment - 56210
Work Accomplished:
Part Failure:
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
06-Dec-16	4342879	OUT OF SERVICE PANEL, BUMPER, REAR	41	21.64	887.24

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
06-Dec-16	Torres, Edwin	4.75	0	0

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available

Activity Sub Total															
<table><tr><th colspan="2">Activity 15 Sub Total</th></tr><tr><td>Parts:</td><td>887.24</td></tr><tr><td>Labor:</td><td>0.00</td></tr><tr><td>Labor Hours:</td><td>4.75</td></tr><tr><td>Sublet Parts:</td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td>887.24</td></tr></table>	Activity 15 Sub Total		Parts:	887.24	Labor:	0.00	Labor Hours:	4.75	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	887.24	
Activity 15 Sub Total															
Parts:	887.24														
Labor:	0.00														
Labor Hours:	4.75														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	887.24														

Work Order Footer															
<table><tr><th colspan="2">Work Order 29388443 Total</th></tr><tr><td>Parts:</td><td>887.24</td></tr><tr><td>Labor:</td><td>0.00</td></tr><tr><td>Labor Hours:</td><td>4.75</td></tr><tr><td>Sublet Parts:</td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td>887.24</td></tr></table>	Work Order 29388443 Total		Parts:	887.24	Labor:	0.00	Labor Hours:	4.75	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	887.24	
Work Order 29388443 Total															
Parts:	887.24														
Labor:	0.00														
Labor Hours:	4.75														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	887.24														



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 27712220
Invoice No. 55345 - 27712220

Client Department:

Department: 55345M

Work Order Description

PM C

Requested By: RGASPARD

Created By: RGASPARD

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 50,876 - DH

Chronology

Reported	Nov 30, 2016 9:37:51 AM	Nov 30, 2016 9:37:51 AM
Started	Dec 1, 2016 12:00:00 AM	
Completed	Dec 1, 2016 8:17:00 AM	Dec 1, 2016 8:17:00 AM
Down Time		

Work Order Notes

Line 10 COMPLAINT:PMC

CAUSE:PMC due

CORRECTION:PMC Completion

PMC performed

Engine oil filter changed

Engine oil changed

Grease fittings lubricated

Front hubs bearing lubricated

Two tires replaced

Tires rotated

Two front hub seals replaced

Materials used

One (1) Engine oil filter#B329

Six (6) quarts of oil 5w20

Two (2) tires #050017

Two (2) seals#CR24000

Activity Header

Activity:10 999 TOTAL VEHICLE

Activity Note: Light Medium Duty PMI

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
30-Nov-16	050017	OUT OF SERVICE TIRE, LT225/75R16, KRO5, KENDA	2	81.5	163
30-Nov-16	CR24000	SEAL, WHEEL, HUB, FRONT	2	7.53	15.06

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
01-Dec-16	Simon,Fritz	3	0	0

Activity Sublet

No Data Available

Activity Checklist**Check List**

10 Desc: Light Medium Duty PMI

Task: First Transit Light-Medium Duty PMI Performed by: FSIMON Performed on: 01-DEC-16

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,000 - SECTION 1 Preparation and Drive On (In Lot) Inspection	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
10,100 - Safety Inspection	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
10,110 - FRA Check Drivers Pre-trip or DVIR/EVIR & Authorization Forms	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
10,120 - FRA Check All Warning Lights and Alarms	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
10,130 - FRA Check Automatic Transmission Neutral Start Operation	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
10,140 - Check Service Brakes	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
10,150 - FRA Start Engine and Listen for Any Unusual Noises	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
10,160 - FRA Check Instruments and Horns	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
10,170 - Check Fast Idle	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
10,180 - Check Starter Protection Circuit	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
10,190 - Check Reverse Warning System	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
11,100 - Check Parking Brake	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
11,110 - Check HVAC Switches and Other Controls	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
11,120 - FRA Inspect Windshields, Mirror and Sun Visor Condition	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
11,130 - FRA Check Wiper and Washer Operation	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
11,140 - Road Test: Check for Proper Operation	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
11,150 - Perform Brake Test	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
11,161 - FRA Check/Record Oil Pressure / @1500 rpm	Pounds per Square Inch	NA	FSIMON	Dec 1, 2016 7:49:30 AM	No	
11,162 - FRA Check/Record Water Temperature	Degree Fahrenheit	NA	FSIMON	Dec 1, 2016 7:49:30 AM	No	
11,170 - FRA Check Door Operation	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
11,180 - FRA Check Operation of All Other Accessories	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
20,000 - SECTION 2 Interior Circle Inspection	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
20,210 - Check Condition of Operator's Area	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
20,220 - Check Accelerator and Brake Pedals	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
20,230 - FRA Check Wiring Under Dash	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
20,240 - FRA Check Interior Lights	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
20,250 - FRA Check Interior Electrical Panels	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
20,260 - Check Stop Request System	-	NA	FSIMON	Dec 1, 2016 7:49:30 AM	No	
20,270 - Check Fare Box Mounting (If Applicable)	-	NA	FSIMON	Dec 1, 2016 7:49:30 AM	No	
20,280 - Check Seats, Seat Belts, Hand Rails and Floor Covering	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
20,290 - Check for Physical Damage, Water Leaks, and Graffiti	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
22,100 - Check Emergency Windows and Glass Condition	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
22,110 - Check Emergency Hatches	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
22,120 - Check All Safety Equipment	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
30,000 - SECTION 3 Exterior Circle Inspection	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
30,310 - Check Passenger Doors	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
30,320 - Inspect Step-well and Hand Rails	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
30,330 - Check Wheelchair Lift Operation	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
30,340 - FRA Check Destination Sign and Run Box	-	NA	FSIMON	Dec 1, 2016 7:49:30 AM	No	
30,350 - FRA Inspect Mirror and Mountings	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
30,360 - Check for Physical Damage and Decals	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
30,370 - Check Wiper Blade and Arm Condition	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
30,380 - Check Exterior Compartment Doors	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
30,390 - FRA Check Fuel Tank Cap	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
33,100 - Check Lights and Reflectors	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
33,110 - Check License Plate, Permits and State Inspection Decals	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
40,000 - SECTION 4 Engine Compartment Inspection	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
40,410 - FRA Check Engine Compartment/Condition for Fire Risk	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
40,420 - Check Hood	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
40,430 - Check Fan, Shroud and Radiator	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
40,440 - Test Coolant System Using Test Strips and Record Results	-	NA	FSIMON	Dec 1, 2016 7:49:30 AM	No	
40,441 - Inhibitor Test Pass or Fail (Indicate with a Yes or No)	No	NA	FSIMON	Dec 1, 2016 7:49:30 AM	No	
40,442 - Freeze Point	Degree Fahrenheit	NA	FSIMON	Dec 1, 2016 7:49:30 AM	No	
40,450 - FRA Check Coolant Recovery System Condition & for Leaks	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
40,460 - Record Antifreeze Protection Level Using Refractometer	-	NA	FSIMON	Dec 1, 2016 7:49:30 AM	No	
40,461 - Refractometer Reading	Degree Fahrenheit	NA	FSIMON	Dec 1, 2016 7:49:30 AM	No	
40,470 - Pressure Test Cooling System and Check for Leaks	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
40,480 - FRA Check Coolant Hose Condition	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
40,490 - FRA Check Alternator Mount and Condition	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
44,100 - FRA Check Fuel Control and Transmission Connections	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
44,110 - FRA Check Master Cylinder Fluid Level	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
44,120 - FRA Check All Belts for Condition, Alignment and Tension	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
44,130 - FRA Check Exhaust System	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
44,140 - FRA Check Intake System	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
44,150 - FRA Inspect Turbocharger	-	NA	FSIMON	Dec 1, 2016 7:49:30 AM	No	
44,160 - FRA Inspect Power Steering and Hydraulic Fluid	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
44,170 - FRA Check All Engine or Belt Driven Components	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
44,180 - FRA Check for Leaks	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
44,190 - FRA Perform Battery Inspection	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
44,200 - FRA Check Battery Box Corrosion, Cables and Hold-Downs	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
50,000 - SECTION 5 Steering System Inspection	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
50,510 - Check Entire Steering System	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
60,000 - SECTION 6 Tires and Wheel Inspection	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
60,610 - FRA Check and Record Air Pressure	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
60,611 - Air Pressure RF	70 Pounds per Square Inch		FSIMON	Dec 1, 2016 7:49:30 AM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
60,612 - Air Pressure LF	70 Pounds per Square Inch		FSIMON	Dec 1, 2016 7:49:30 AM	No	
60,613 - Air Pressure RRO	70 Pounds per Square Inch		FSIMON	Dec 1, 2016 7:49:30 AM	No	
60,614 - Air Pressure RRI	70 Pounds per Square Inch		FSIMON	Dec 1, 2016 7:49:30 AM	No	
60,615 - Air Pressure LRI	70 Pounds per Square Inch		FSIMON	Dec 1, 2016 7:49:30 AM	No	
60,616 - Air Pressure LRO	70 Pounds per Square Inch		FSIMON	Dec 1, 2016 7:49:30 AM	No	
60,620 - Check Valve Stems and Caps	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
60,630 - Check and Record Tread Depth	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
60,631 - Tread Depth RF	32nds of an inch	10mm	FSIMON	Dec 1, 2016 7:49:30 AM	No	
60,632 - Tread Depth LF	32nds of an inch	10mm	FSIMON	Dec 1, 2016 7:49:30 AM	No	
60,633 - Tread Depth RRO	32nds of an inch	9mm	FSIMON	Dec 1, 2016 7:49:30 AM	No	
60,634 - Tread Depth RRI	32nds of an inch	9mm	FSIMON	Dec 1, 2016 7:49:30 AM	No	
60,635 - Tread Depth LRI	32nds of an inch	3mm	FSIMON	Dec 1, 2016 7:49:30 AM	No	
60,636 - Tread Depth LRO	32nds of an inch	3mm	FSIMON	Dec 1, 2016 7:49:30 AM	No	
60,640 - Check for Mismatched Tread or Casing Design	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
60,650 - Check Sidewall Wear	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
60,660 - Inspect for Cuts and Tears	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
60,670 - Check Dual Mating With Square	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
60,680 - Check Wheels for Cracks and Loose Lugs	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
60,690 - Check Tires for Irregular or Alignment Wear	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
66,100 - FRA Check Outer Hubs for Leaks	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
70,000 - SECTION 7 Under Vehicle Inspection	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
70,710 - Check Vibration Damper	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
70,720 - Check Engine and Transmission Mounts	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
70,730 - FRA Check Starter	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
70,740 - FRA Check Bottom of Engine for Fluid Leaks	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
70,750 - FRA Check Transmission for Leaks	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
70,760 - FRA Check Differential Breather and Fluid	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
70,770 - FRA Check Exhaust System	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
70,780 - Check Driveline, U-joint and Slip Yokes	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
70,790 - Check All Body Mounts and Chassis Frame	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
77,100 - FRA Check Security, Integrity and Length of Ground Straps	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
77,110 - FRA Check Fuel Tank	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
77,120 - Check Suspension Components	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
77,130 - FRA Check Brake Pad Thickness and Rotor for Wear	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
77,131 - Brake Pad Thickness LF	0 Inch	8mm	FSIMON	Dec 1, 2016 7:49:30 AM	No	
77,132 - Brake Pad Thickness RF	Inch	8mm	FSIMON	Dec 1, 2016 7:49:30 AM	No	
77,133 - Brake Pad Thickness LR	Inch	8mm	FSIMON	Dec 1, 2016 7:49:30 AM	No	
77,134 - Brake Pad Thickness RR	Inch	8mm	FSIMON	Dec 1, 2016 7:49:30 AM	No	
77,135 - Brake Rotor LF	0 Inch	40mm	FSIMON	Dec 1, 2016 7:49:30 AM	No	
77,136 - Brake Rotor RF	Inch	40mm	FSIMON	Dec 1, 2016 7:49:30 AM	No	
77,137 - Brake Rotor LR	Inch	35mm	FSIMON	Dec 1, 2016 7:49:30 AM	No	
77,138 - Brake Rotor RR	Inch	35mm	FSIMON	Dec 1, 2016 7:49:30 AM	No	
77,140 - FRA Check Brake Hoses	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
77,150 - Check King Pins	-	NA	FSIMON	Dec 1, 2016 7:49:30 AM	No	
77,160 - FRA Check for Loose or Noisy Wheel Bearings	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
80,000 - SECTION 8 PMI Report Completion	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
80,810 - Completion of PMI Report	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
90,000 - SECTION 9 Completion of PMI	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	
90,910 - Vehicle Returned to predetermined location	Done		FSIMON	Dec 1, 2016 7:49:30 AM	No	

Activity Sub Total

Activity 10 Sub Total	
Parts:	178.06
Labor:	0.00
Labor Hours:	3.00
Sublet Parts:	0.00
Sublet Labor:	0.00

	Activity Sub Total	178.06
--	---------------------------	---------------



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 27712220
Invoice No. 55345 - 27712220

Client Department:

Department: 55345M

Work Order Description

PM C

Requested By: RGASPARD

Created By: RGASPARD

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 50,876 - DH

Activity Header

Activity: 20 999 TOTAL VEHICLE

Activity Note: PM C

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: C PM Level C

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
30-Nov-16	B329	GOING OUT OF SERVICE DO NOT ORDER USE B329 IN THE FLEET ORG FILTER, OIL	1	1.92	1.92

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
01-Dec-16	Simon,Fritz	1	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List						
20 Desc: PM C						
Task: PM C SERVICE Performed by: FSIMON Performed on: 30-NOV-16						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
100,000 - "A" PMI SERVICING ITEMS	Done		FSIMON	Nov 30, 2016 12:37:37 PM	No	
101,000 - FRA Change Oil Filters	Yes		FSIMON	Nov 30, 2016 12:37:37 PM	No	
102,000 - FRA Drain Engine Oil	Yes		FSIMON	Nov 30, 2016 12:37:37 PM	No	
103,000 - FRA Check Transmission Fluid	Done		FSIMON	Nov 30, 2016 12:37:37 PM	No	
104,000 - Lubricate Chassis	Done		FSIMON	Nov 30, 2016 12:37:37 PM	No	
105,000 - Replace or Clean A/C Filters	Done		FSIMON	Nov 30, 2016 12:37:37 PM	No	
107,000 - FRA Change Primary Fuel Filter	-	n/a	FSIMON	Nov 30, 2016 12:37:37 PM	No	
108,000 - Lube all pivoting Mechanisms	Done		FSIMON	Nov 30, 2016 12:37:37 PM	No	
200,000 - "B" PMI SERVICING ITEMS (12	Done		FSIMON	Nov 30, 2016	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
MONTH)				12:37:37 PM		
201,000 - Service Crankcase Breather	Done		FSIMON	Nov 30, 2016 12:37:37 PM	No	
203,000 - FRA Change Automatic Transmission Fluid	No	NA	FSIMON	Nov 30, 2016 12:37:37 PM	No	
204,000 - FRA Change Power Steering Fluid and Filter	No	NA	FSIMON	Nov 30, 2016 12:37:37 PM	No	
205,000 - Complete Engine Diagnostics and Clear Codes when Completed	-	NA	FSIMON	Nov 30, 2016 12:37:37 PM	No	
300,000 - "C" PMI SERVICING ITEMS (24 MONTH)	Done		FSIMON	Nov 30, 2016 12:37:37 PM	No	
301,000 - Check and Lubricate Door Linkages	Done		FSIMON	Nov 30, 2016 12:37:37 PM	No	
302,000 - Check Toe-In and Record Reading	-	NA	FSIMON	Nov 30, 2016 12:37:37 PM	No	
302,001 - Record Toe-In Reading	Inches, fraction-actual	NA	FSIMON	Nov 30, 2016 12:37:37 PM	No	
304,000 - 1st "C" PMI ONLY: Tune Up Per Engine Mfg's Specifications	Yes		FSIMON	Nov 30, 2016 12:37:37 PM	No	
305,000 - FRA Change Differential Fluid	Yes		FSIMON	Nov 30, 2016 12:37:37 PM	No	

Activity Sub Total

Activity 20 Sub Total

Parts:	1.92
Labor:	0.00
Labor Hours:	1.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	1.92



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 27712220
Invoice No. 55345 - 27712220

Client Department:

Department: 55345M

Work Order Description

PM C

Requested By: RGASPARD

Created By: RGASPARD

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 50,876 - DH

Activity Header

Activity: 30 999 TOTAL VEHICLE

Activity Note: PRAMETER

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

30 Desc: PRAMETER

Task: PRA and Meter Readings Performed by: FSIMON Performed on: 30-NOV-16

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		FSIMON	Nov 30, 2016 12:38:03 PM	No	
20 - Miles			FSIMON	Nov 30, 2016 12:38:03 PM	No	
30 - Kilometers			FSIMON	Nov 30, 2016 12:38:03 PM	No	
40 - Hours			FSIMON	Nov 30, 2016 12:38:03 PM	No	

Activity Sub Total

Activity 30 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00

Work Order Footer

Work Order 27712220 Total

Parts:	179.98
Labor:	0.00
Labor Hours:	4.00
Sublet Parts:	0.00
Sublet Labor:	0.00

	Activity Sub Total	179.98
--	---------------------------	---------------



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 27879748
Invoice No. 55345 - 27879748

Client Department:

Department: 55345M

Work Order Description

External fuel filter

Requested By: FSIMON

Created By: FSIMON

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 49,674 - DH

Chronology

Reported	Nov 4, 2016 4:18:55 PM	Nov 4, 2016 4:18:55 PM
Started	Nov 7, 2016 12:00:00 AM	
Completed	Nov 8, 2016 8:41:41 AM	Nov 8, 2016 8:41:41 AM
Down Time		

Work Order Notes

Line 10

COMPLAINT:External fuel filter (service)

CAUSE:Preventive maintenance

CORRECTION:External fuel filter replacement

External Fuel filter reached the bus mileage required to be changed

External fuel filter changed

Part used

One (1) fuel filter#P11BB-9155-AB (under warranty)

Activity Header

Activity:5 999 TOTAL VEHICLE

Activity Note: Personal Risk Assessment

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: Personal Risk Assessment

Task: PRA and Meter Readings Performed by: FSIMON Performed on: 07-NOV-16

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		FSIMON	Nov 7, 2016 3:57:25 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
20 - Miles			FSIMON	Nov 7, 2016 3:57:25 PM	No	
30 - Kilometers			FSIMON	Nov 7, 2016 3:57:25 PM	No	
40 - Hours			FSIMON	Nov 7, 2016 3:57:25 PM	No	
Activity Sub Total						
			Activity 5 Sub Total			
			Parts: 0.00			
			Labor: 0.00			
			Labor Hours: 0.00			
			Sublet Parts: 0.00			
			Sublet Labor: 0.00			
			Activity Sub Total 0.00			



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 27879748
Invoice No. 55345 - 27879748

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
External fuel filter		Ford E450 Champion Challenger	
Requested By:	FSIMON	Status:	40 - Closed (40)
Created By:	FSIMON	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	49,674 - DH

Activity Header
Activity: 15
Activity Note:
Reason for Repair: 08 Preventive Maintenance
Work Accomplished:
Part Failure:
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
08-Nov-16	P11BB-9155-AB	FILTER, FUEL, ROUSH NO CROSS	1	78.94	78.94

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
07-Nov-16	Simon,Fritz	1	0	0

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available

Activity Sub Total															
<table><tr><th colspan="2">Activity 15 Sub Total</th></tr><tr><td>Parts:</td><td>78.94</td></tr><tr><td>Labor:</td><td>0.00</td></tr><tr><td>Labor Hours:</td><td>1.00</td></tr><tr><td>Sublet Parts:</td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td>78.94</td></tr></table>	Activity 15 Sub Total		Parts:	78.94	Labor:	0.00	Labor Hours:	1.00	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	78.94	
Activity 15 Sub Total															
Parts:	78.94														
Labor:	0.00														
Labor Hours:	1.00														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	78.94														

Work Order Footer															
<table><tr><th colspan="2">Work Order 27879748 Total</th></tr><tr><td>Parts:</td><td>78.94</td></tr><tr><td>Labor:</td><td>0.00</td></tr><tr><td>Labor Hours:</td><td>1.00</td></tr><tr><td>Sublet Parts:</td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td>78.94</td></tr></table>	Work Order 27879748 Total		Parts:	78.94	Labor:	0.00	Labor Hours:	1.00	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	78.94	
Work Order 27879748 Total															
Parts:	78.94														
Labor:	0.00														
Labor Hours:	1.00														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	78.94														



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 27824331
Invoice No. 55345 - 27824331

Client Department:

Department: 55345M

Work Order Description

Driver said bus making noise when turning

Requested By: HPIERRE

Created By: HPIERRE

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 48,553 - DH

Chronology

Reported	Oct 27, 2016 2:31:34 PM	Oct 27, 2016 2:31:34 PM
Started	Oct 27, 2016 12:00:00 AM	
Completed	Oct 28, 2016 8:26:00 AM	Oct 28, 2016 8:26:00 AM
Down Time		

Work Order Notes

Line 10

COMPLAINT: Driver said bus making noise when turning

CAUSE: gear box leaking fluids

CORRECTION: replace gear box add fluids and text drive bus completed

Part# aftermarket part #qty 1

Activity Header

Activity: 5 999 TOTAL VEHICLE

Activity Note: Personal Risk Assessment

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
27-Oct-16	Pierre, Hubert J	0.5	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: Personal Risk Assessment

Task: PRA and Meter Readings Performed by: HPIERRE Performed on: 27-OCT-16

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		HPIERRE	Oct 27, 2016 2:37:36 PM	No	
20 - Miles			HPIERRE	Oct 27, 2016 2:37:36 PM	No	
30 - Kilometers			HPIERRE	Oct 27, 2016 2:37:36 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO	
40 - Hours			HPIERRE	Oct 27, 2016 2:37:36 PM	No		
Activity Sub Total							
				Activity 5 Sub Total			
				Parts:			0.00
				Labor:			0.00
				Labor Hours:			0.50
				Sublet Parts:			0.00
				Sublet Labor:			0.00
				Activity Sub Total			0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 27824331
Invoice No. 55345 - 27824331

Client Department:

Department: 55345M

Work Order Description

Driver said bus making noise when turning

Requested By: HPIERRE

Created By: HPIERRE

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 48,553 - DH

Activity Header

Activity: 15 015 STEERING

Activity Note:

Reason for Repair: 05 Inspection, Routine

Work Accomplished:

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
27-Oct-16	Pierre, Hubert J	4	0	0

Activity Sublet

No Data Available

Activity Checklist

No Data Available

No Data Available

Activity Sub Total

Activity 15 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	4.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00

Work Order Footer

Work Order 27824331 Total

Parts:	0.00
Labor:	0.00
Labor Hours:	4.50
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 27711763
Invoice No. 55345 - 27711763

Client Department:

Department: 55345M

Work Order Description

Followup----->needs 4tires

Requested By: RGASPARD

Created By: RGASPARD

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 46,785 - DH

Chronology

Reported	Oct 13, 2016 11:26:41 PM	Oct 13, 2016 11:26:41 PM
Started	Oct 14, 2016 12:00:00 AM	
Completed	Oct 14, 2016 12:13:00 AM	Oct 14, 2016 12:13:00 AM
Down Time		

Work Order Notes

Line 10 Needs 4tires

Wear

Replaced tires

Mounted balanced torque tires 140 lbs second torque 140 lbs

Part number 050017 qty 2 in the front

Line 20 Replaced 2 right rear tires

Torque tires 140 lbs second torque 140 lbs

Part number 050017 qty 2 right rear tires

Mounted and balanced

Activity Header

Activity:10 017 TIRES, TUBES, LINERS & VALVES

Activity Note: needs 4 tires

Reason for Repair: 05 Inspection, Routine

Work Accomplished:

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
14-Oct-16	050017	OUT OF SERVICE TIRE, LT225/75R16, KRO5, KENDA	2	81.5	163

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
14-Oct-16	Gaspard,Ronald	1	0	0

Activity Sublet

No Data Available

Activity Checklist

No Data Available

No Data Available

Activity Sub Total

Activity 10 Sub Total

Parts:	163.00
Labor:	0.00
Labor Hours:	1.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	163.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 27711763
Invoice No. 55345 - 27711763

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Followup----->needs 4tires		Ford E450 Champion Challenger	
Requested By:	RGASPARD	Status:	40 - Closed (40)
Created By:	RGASPARD	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	46,785 - DH

Activity Header					
Activity:20 017 TIRES, TUBES, LINERS & VALVES					
Activity Note:					
Reason for Repair: 05 Inspection, Routine					
Work Accomplished:					
Part Failure:					
Activity Comments:					
Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
14-Oct-16	050017	OUT OF SERVICE TIRE, LT225/75R16, KRO5, KENDA	2	81.5	163
Activity Labor					
Booked Date	Technician	Hours	Shop Rate	Extended	
14-Oct-16	Gaspard,Ronald	1	0	0	
Activity Sublet					
No Data Available					
Activity Checklist					
No Data Available					
No Data Available					
Activity Sub Total					
			Activity 20 Sub Total		
			Parts:	163.00	
			Labor:	0.00	
			Labor Hours:	1.00	
			Sublet Parts:	0.00	
			Sublet Labor:	0.00	
			Activity Sub Total	163.00	



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 27711763
Invoice No. 55345 - 27711763

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Followup----->needs 4tires		Ford E450 Champion Challenger	
Requested By:	RGASPARD	Status:	40 - Closed (40)
Created By:	RGASPARD	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	46,785 - DH

Activity Header

Activity:30 999 TOTAL VEHICLE

Activity Note:

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
14-Oct-16	Gaspard,Ronald	0.0666666	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List						
30 Desc: Task: PRA and Meter Readings Performed by: RGASPARD Performed on: 13-OCT-16						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		RGASPARD	Oct 13, 2016 11:52:17 PM	No	
20 - Miles			RGASPARD	Oct 13, 2016 11:52:17 PM	No	
30 - Kilometers			RGASPARD	Oct 13, 2016 11:52:17 PM	No	
40 - Hours			RGASPARD	Oct 13, 2016 11:52:17 PM	No	

Activity Sub Total

Activity 30 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	0.07
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00

Work Order Footer

Work Order 27711763 Total	
Parts:	326.00
Labor:	0.00
Labor Hours:	2.07

	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	326.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 27405479
Invoice No. 55345 - 27405479

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
PM A		Ford E450 Champion Challenger	
Requested By:	CVERGARA	Status:	40 - Closed (40)
Created By:	CVERGARA	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	46,785 - DH

Chronology		
Reported	Oct 13, 2016 1:39:31 PM	Oct 13, 2016 1:39:31 PM
Started	Oct 13, 2016 12:00:00 AM	
Completed	Oct 13, 2016 11:47:00 PM	Oct 13, 2016 11:47:00 PM
Down Time		

Work Order Notes

Line 10 COMPLAINT:pmA

CAUSE:service

CORRECTION:perform pmA service
Oil filter B329 qty 1
Engine oil 5w20 qty 7 qts

Activity Header
Activity:10 999 TOTAL VEHICLE
Activity Note: Light Medium Duty PMI
Reason for Repair: 08 Preventive Maintenance
Work Accomplished: 06 Inspect
Part Failure:
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
13-Oct-16	B329	GOING OUT OF SERVICE DO NOT ORDER USE B329 IN THE FLEET ORG FILTER, OIL	1	1.92	1.92

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
13-Oct-16	Gaspard,Ronald	1.5	0	0

Activity Sublet
No Data Available

Activity Checklist						
Check List						
10 Desc: Light Medium Duty PMI Task: First Transit Light-Medium Duty PMI Performed by: RGASPARD Performed on: 13-OCT-16						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,000 - SECTION 1 Preparation and Drive On (In Lot) Inspection	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
10,100 - Safety Inspection	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,110 - FRA Check Drivers Pre-trip or DVIR/EVIR & Authorization Forms	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
10,120 - FRA Check All Warning Lights and Alarms	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
10,130 - FRA Check Automatic Transmission Neutral Start Operation	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
10,140 - Check Service Brakes	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
10,150 - FRA Start Engine and Listen for Any Unusual Noises	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
10,160 - FRA Check Instruments and Horns	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
10,170 - Check Fast Idle	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
10,180 - Check Starter Protection Circuit	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
10,190 - Check Reverse Warning System	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
11,100 - Check Parking Brake	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
11,110 - Check HVAC Switches and Other Controls	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
11,120 - FRA Inspect Windshields, Mirror and Sun Visor Condition	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
11,130 - FRA Check Wiper and Washer Operation	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
11,140 - Road Test: Check for Proper Operation	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
11,150 - Perform Brake Test	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
11,161 - FRA Check/Record Oil Pressure / @1500 rpm	Pounds per Square Inch	na	RGASPARD	Oct 13, 2016 11:26:41 PM	No	
11,162 - FRA Check/Record Water Temperature	Degree Fahrenheit	na	RGASPARD	Oct 13, 2016 11:26:41 PM	No	
11,170 - FRA Check Door Operation	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
11,180 - FRA Check Operation of All Other Accessories	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
20,000 - SECTION 2 Interior Circle Inspection	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
20,210 - Check Condition of Operator's Area	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
20,220 - Check Accelerator and Brake Pedals	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
20,230 - FRA Check Wiring Under Dash	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
20,240 - FRA Check Interior Lights	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
20,250 - FRA Check Interior Electrical Panels	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
20,260 - Check Stop Request System	-	na	RGASPARD	Oct 13, 2016 11:26:41 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
20,270 - Check Fare Box Mounting (If Applicable)	-	na	RGASPARD	Oct 13, 2016 11:26:41 PM	No	
20,280 - Check Seats, Seat Belts, Hand Rails and Floor Covering	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
20,290 - Check for Physical Damage, Water Leaks, and Graffiti	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
22,100 - Check Emergency Windows and Glass Condition	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
22,110 - Check Emergency Hatches	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
22,120 - Check All Safety Equipment	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
30,000 - SECTION 3 Exterior Circle Inspection	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
30,310 - Check Passenger Doors	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
30,320 - Inspect Step-well and Hand Rails	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
30,330 - Check Wheelchair Lift Operation	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
30,340 - FRA Check Destination Sign and Run Box	-	na	RGASPARD	Oct 13, 2016 11:26:41 PM	No	
30,350 - FRA Inspect Mirror and Mountings	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
30,360 - Check for Physical Damage and Decals	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
30,370 - Check Wiper Blade and Arm Condition	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
30,380 - Check Exterior Compartment Doors	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
30,390 - FRA Check Fuel Tank Cap	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
33,100 - Check Lights and Reflectors	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
33,110 - Check License Plate, Permits and State Inspection Decals	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
40,000 - SECTION 4 Engine Compartment Inspection	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
40,410 - FRA Check Engine Compartment/Condition for Fire Risk	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
40,420 - Check Hood	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
40,430 - Check Fan, Shroud and Radiator	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
40,440 - Test Coolant System Using Test Strips and Record Results	-	na	RGASPARD	Oct 13, 2016 11:26:41 PM	No	
40,441 - Inhibitor Test Pass or Fail (Indicate with a Yes or No)	No	na	RGASPARD	Oct 13, 2016 11:26:41 PM	No	
40,442 - Freeze Point	Degree Fahrenheit	na	RGASPARD	Oct 13, 2016 11:26:41 PM	No	
40,450 - FRA Check Coolant Recovery System Condition & for Leaks	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
40,460 - Record Antifreeze Protection Level Using Refractometer	-	na	RGASPARD	Oct 13, 2016 11:26:41 PM	No	
40,461 - Refractometer Reading	Degree Fahrenheit	na	RGASPARD	Oct 13, 2016 11:26:41 PM	No	
40,470 - Pressure Test Cooling System and Check for Leaks	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
40,480 - FRA Check Coolant Hose Condition	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
40,490 - FRA Check Alternator Mount and Condition	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
44,100 - FRA Check Fuel Control and Transmission Connections	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
44,110 - FRA Check Master Cylinder Fluid Level	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
44,120 - FRA Check All Belts for Condition, Alignment and Tension	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
44,130 - FRA Check Exhaust System	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
44,140 - FRA Check Intake System	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
44,150 - FRA Inspect Turbocharger	-	na	RGASPARD	Oct 13, 2016 11:26:41 PM	No	
44,160 - FRA Inspect Power Steering and Hydraulic Fluid	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
44,170 - FRA Check All Engine or Belt Driven Components	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
44,180 - FRA Check for Leaks	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
44,190 - FRA Perform Battery Inspection	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
44,200 - FRA Check Battery Box Corrosion, Cables and Hold-Downs	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
50,000 - SECTION 5 Steering System Inspection	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
50,510 - Check Entire Steering System	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
60,000 - SECTION 6 Tires and Wheel Inspection	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
60,610 - FRA Check and Record Air Pressure	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
60,611 - Air Pressure RF	70 Pounds per Square Inch		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
60,612 - Air Pressure LF	70 Pounds per Square Inch		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
60,613 - Air Pressure RRO	70 Pounds per Square Inch		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
60,614 - Air Pressure RRI	70 Pounds per Square Inch		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
60,615 - Air Pressure LRI	70 Pounds per Square Inch		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
60,616 - Air Pressure LRO	70 Pounds per Square Inch		RGASPARD	Oct 13, 2016 11:26:41 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
60,620 - Check Valve Stems and Caps	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
60,630 - Check and Record Tread Depth	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
60,631 - Tread Depth RF	3 32nds of an inch		RGASPARD	Oct 13, 2016 11:26:41 PM	Yes	27711763
60,632 - Tread Depth LF	7 32nds of an inch		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
60,633 - Tread Depth RRO	3 32nds of an inch		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
60,634 - Tread Depth RRI	3 32nds of an inch	needs 4 tires	RGASPARD	Oct 13, 2016 11:26:41 PM	Yes	27711763
60,635 - Tread Depth LRI	6 32nds of an inch		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
60,636 - Tread Depth LRO	3 32nds of an inch		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
60,640 - Check for Mismatched Tread or Casing Design	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
60,650 - Check Sidewall Wear	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
60,660 - Inspect for Cuts and Tears	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
60,670 - Check Dual Mating With Square	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
60,680 - Check Wheels for Cracks and Loose Lugs	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
60,690 - Check Tires for Irregular or Alignment Wear	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
66,100 - FRA Check Outer Hubs for Leaks	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
70,000 - SECTION 7 Under Vehicle Inspection	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
70,710 - Check Vibration Damper	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
70,720 - Check Engine and Transmission Mounts	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
70,730 - FRA Check Starter	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
70,740 - FRA Check Bottom of Engine for Fluid Leaks	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
70,750 - FRA Check Transmission for Leaks	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
70,760 - FRA Check Differential Breather and Fluid	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
70,770 - FRA Check Exhaust System	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
70,780 - Check Driveline, U-joint and Slip Yokes	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
70,790 - Check All Body Mounts and Chassis Frame	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
77,100 - FRA Check Security, Integrity and Length of Ground Straps	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
77,110 - FRA Check Fuel Tank	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
77,120 - Check Suspension Components	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
77,130 - FRA Check Brake Pad Thickness and Rotor for Wear	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
77,131 - Brake Pad Thickness LF	8 Inch		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
77,132 - Brake Pad Thickness RF	8 Inch		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
77,133 - Brake Pad Thickness LR	8 Inch		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
77,134 - Brake Pad Thickness RR	8 Inch		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
77,135 - Brake Rotor LF	36 Inch		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
77,136 - Brake Rotor RF	36 Inch		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
77,137 - Brake Rotor LR	38 Inch		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
77,138 - Brake Rotor RR	38 Inch		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
77,140 - FRA Check Brake Hoses	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
77,150 - Check King Pins	-	na	RGASPARD	Oct 13, 2016 11:26:41 PM	No	
77,160 - FRA Check for Loose or Noisy Wheel Bearings	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
80,000 - SECTION 8 PMI Report Completion	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
80,810 - Completion of PMI Report	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
90,000 - SECTION 9 Completion of PMI	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	
90,910 - Vehicle Returned to predetermined location	Done		RGASPARD	Oct 13, 2016 11:26:41 PM	No	

Activity Sub Total

Activity 10 Sub Total	
Parts:	1.92
Labor:	0.00
Labor Hours:	1.50
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	1.92



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 27405479
Invoice No. 55345 - 27405479

Client Department:

Department: 55345M

Work Order Description

PM A

Requested By: CVERGARA

Created By: CVERGARA

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 46,785 - DH

Activity Header

Activity: 20 999 TOTAL VEHICLE

Activity Note: PM A

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: A PM Level A

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
13-Oct-16	Gaspard,Ronald	1	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List						
20 Desc: PM A						
Task: PM A SERVICE Performed by: RGASPARD Performed on: 13-OCT-16						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
100,000 - "A" PMI SERVICING ITEMS	Done		RGASPARD	Oct 13, 2016 11:27:19 PM	No	
101,000 - FRA Change Oil Filters	Yes		RGASPARD	Oct 13, 2016 11:27:19 PM	No	
102,000 - FRA Drain Engine Oil	Yes		RGASPARD	Oct 13, 2016 11:27:19 PM	No	
103,000 - FRA Check Transmission Fluid	Done		RGASPARD	Oct 13, 2016 11:27:19 PM	No	
104,000 - Lubricate Chassis	-	na	RGASPARD	Oct 13, 2016 11:27:19 PM	No	
105,000 - Replace or Clean A/C Filters	Done		RGASPARD	Oct 13, 2016 11:27:19 PM	No	
107,000 - FRA Change Primary Fuel Filter	No	na	RGASPARD	Oct 13, 2016 11:27:19 PM	No	
108,000 - Lube all pivoting Mechanisms	Done		RGASPARD	Oct 13, 2016 11:27:19 PM	No	

Activity Sub Total

Activity 20 Sub Total

Parts:	0.00
Labor:	0.00

	Labor Hours:	1.00
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 27405479
Invoice No. 55345 - 27405479

Client Department:

Department: 55345M

Work Order Description

PM A

Requested By: CVERGARA

Created By: CVERGARA

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 46,785 - DH

Activity Header

Activity: 30 999 TOTAL VEHICLE

Activity Note: PRAMETER

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
13-Oct-16	Gaspard, Ronald	0.0666666	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

30 Desc: PRAMETER

Task: PRA and Meter Readings Performed by: RGASPARD Performed on: 13-OCT-16

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		RGASPARD	Oct 13, 2016 11:27:39 PM	No	
20 - Miles			RGASPARD	Oct 13, 2016 11:27:39 PM	No	
30 - Kilometers			RGASPARD	Oct 13, 2016 11:27:39 PM	No	
40 - Hours			RGASPARD	Oct 13, 2016 11:27:39 PM	No	

Activity Sub Total

Activity 30 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	0.07
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00

Work Order Footer

Work Order 27405479 Total

Parts:	1.92
Labor:	0.00
Labor Hours:	2.57

	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	1.92



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 27447615
Invoice No. 55345 - 27447615

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Passenger side front signal light out		Ford E450 Champion Challenger	
Requested By:	RAUODRIGUEZ	Status:	40 - Closed (40)
Created By:	RAUODRIGUEZ	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	44,955 - DH

Chronology		
Reported	Sep 19, 2016 8:47:43 AM	Sep 19, 2016 8:47:43 AM
Started	Sep 19, 2016 12:00:00 AM	
Completed	Sep 19, 2016 2:22:00 PM	Sep 19, 2016 2:22:00 PM
Down Time		

Work Order Notes

Line 10
COMPLAINT:
Passenger side front signal light out

CAUSE:
Normal wear

CORRECTION:
Removed and replaced front passenger side signal bulb

Part: 1 signal light bulb # 3157 na

Activity Header						
Activity:5 999 TOTAL VEHICLE						
Activity Note: Personal Risk Assessment						
Reason for Repair: 05 Inspection, Routine						
Work Accomplished: 06 Inspect						
Part Failure:						
Activity Comments:						
Activity Parts						
No Data Available						
Activity Labor						
No Data Available						
Activity Sublet						
No Data Available						
Activity Checklist						
Check List						
5 Desc: Personal Risk Assessment						
Task: PRA and Meter Readings Performed by: RAUODRIGUEZ Performed on: 19-SEP-16						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		RAUODRIGUEZ	Sep 19, 2016 8:58:22 AM	No	
20 - Miles			RAUODRIGUEZ	Sep 19, 2016 8:58:22 AM	No	
30 - Kilometers			RAUODRIGUEZ	Sep 19, 2016 8:58:22 AM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO																					
40 - Hours			RAURODRIGUEZ	Sep 19, 2016 8:58:22 AM	No																						
Activity Sub Total			<table><tr><td colspan="2">Activity 5 Sub Total</td><td></td></tr><tr><td>Parts:</td><td></td><td>0.00</td></tr><tr><td>Labor:</td><td></td><td>0.00</td></tr><tr><td>Labor Hours:</td><td></td><td>0.00</td></tr><tr><td>Sublet Parts:</td><td></td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td></td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td></td><td>0.00</td></tr></table>				Activity 5 Sub Total			Parts:		0.00	Labor:		0.00	Labor Hours:		0.00	Sublet Parts:		0.00	Sublet Labor:		0.00	Activity Sub Total		0.00
Activity 5 Sub Total																											
Parts:		0.00																									
Labor:		0.00																									
Labor Hours:		0.00																									
Sublet Parts:		0.00																									
Sublet Labor:		0.00																									
Activity Sub Total		0.00																									



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 27447615
Invoice No. 55345 - 27447615

Client Department:

Department: 55345M

Work Order Description

Passenger side front signal light out

Requested By: RAURODRIGUEZ

Created By: RAURODRIGUEZ

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 44,955 - DH

Activity Header

Activity: 15 034 LIGHTING SYSTEM

Activity Note: Passenger side front signal light out

Reason for Repair: 05 Inspection, Routine

Work Accomplished:

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
19-Sep-16	3157NA	LAMP, MINIATURE, WEDGE-MOUNT, AMBER SAME AS GE3157NA	1	0.88	0.88

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
19-Sep-16	Rodriguez,Raul	0.2666666	0	0

Activity Sublet

No Data Available

Activity Checklist

No Data Available

No Data Available

Activity Sub Total

Activity 15 Sub Total	
Parts:	0.88
Labor:	0.00
Labor Hours:	0.27
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.88

Work Order Footer

Work Order 27447615 Total	
Parts:	0.88
Labor:	0.00
Labor Hours:	0.27
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.88



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 27435980
Invoice No. 55345 - 27435980

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Fuel gauge check		Ford E450 Champion Challenger	
Requested By:	FSIMON	Status:	40 - Closed (40)
Created By:	FSIMON	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	44,402 - DH

Chronology		
Reported	Sep 9, 2016 4:09:56 PM	Sep 9, 2016 4:09:56 PM
Started	Sep 12, 2016 12:00:00 AM	
Completed	Sep 16, 2016 8:50:00 AM	Sep 16, 2016 8:50:00 AM
Down Time		

Work Order Notes

Line 10
COMPLAINT:Fuel gauge stuck on full

CAUSE:Fuel level sender

CORRECTION:Bus under monitoring

Complaint cannot be verified
Fuel level sender tested
Fuel level sender replaced

Part used
One (1) fuel level sender(under warranty)

Activity Header							
Activity: 5 999 TOTAL VEHICLE							
Activity Note: Personal Risk Assessment							
Reason for Repair:		05 Inspection, Routine					
Work Accomplished:		06 Inspect					
Part Failure:							
Activity Comments:							
Activity Parts							
No Data Available							
Activity Labor							
No Data Available							
Activity Sublet							
No Data Available							
Activity Checklist							
Check List							
5 Desc: Personal Risk Assessment							
Task: PRA and Meter Readings Performed by: FSIMON Performed on: 14-SEP-16							
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO	
10 - Have you successfully completed the Personal	Done		FSIMON	Sep 14, 2016	No		

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
Risk Assessment?				3:36:25 PM		
20 - Miles			FSIMON	Sep 14, 2016 3:36:25 PM	No	
30 - Kilometers			FSIMON	Sep 14, 2016 3:36:25 PM	No	
40 - Hours			FSIMON	Sep 14, 2016 3:36:25 PM	No	
Activity Sub Total						
				Activity 5 Sub Total		
				Parts:		0.00
				Labor:		0.00
				Labor Hours:		0.00
				Sublet Parts:		0.00
				Sublet Labor:		0.00
				Activity Sub Total		0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 27435980
Invoice No. 55345 - 27435980

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Fuel gauge check		Ford E450 Champion Challenger	
Requested By:	FSIMON	Status:	40 - Closed (40)
Created By:	FSIMON	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	44,402 - DH

Activity Header
Activity: 15
Activity Note:
Reason for Repair: 04 Driver's Report
Work Accomplished:
Part Failure:
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
15-Sep-16	P-10A609-AA	OUT OF SERVICE GAUGE, SIGHT, TWIN, TANK, FUEL	1	89.47	89.47

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
12-Sep-16	Simon,Fritz	1	0	0

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available

Activity Sub Total		Activity 15 Sub Total	
Parts:	89.47	Labor:	0.00
Labor Hours:	1.00	Sublet Parts:	0.00
Sublet Labor:	0.00	Sublet Labor:	0.00
Activity Sub Total		89.47	

Work Order Footer		Work Order 27435980 Total	
Parts:	89.47	Labor:	0.00
Labor Hours:	1.00	Sublet Parts:	0.00
Sublet Labor:	0.00	Sublet Labor:	0.00
Activity Sub Total		89.47	



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 27434286
Invoice No. 55345 - 27434286

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Interior light check		Ford E450 Champion Challenger	
Requested By:	FSIMON	Status:	40 - Closed (40)
Created By:	FSIMON	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	44,285 - DH

Chronology		
Reported	Sep 8, 2016 1:24:05 PM	Sep 8, 2016 1:24:05 PM
Started	Sep 8, 2016 12:00:00 AM	
Completed	Sep 8, 2016 3:22:48 PM	Sep 8, 2016 3:22:48 PM
Down Time		

Work Order Notes

Line 10
COMPLAINT:One interior light not working

CAUSE:Defective light

CORRECTION:Interior light replacement

One interior light replaced
First aid Kit found on the floor has been adjusted
Heater wire cover and yellow padding adjusted

Part used:
One (1) interior light (under warranty).

Activity Header						
Activity: 5 999 TOTAL VEHICLE						
Activity Note: Personal Risk Assessment						
Reason for Repair:		05 Inspection, Routine				
Work Accomplished:		06 Inspect				
Part Failure:						
Activity Comments:						
Activity Parts						
No Data Available						
Activity Labor						
No Data Available						
Activity Sublet						
No Data Available						
Activity Checklist						
Check List						
5 Desc: Personal Risk Assessment						
Task: PRA and Meter Readings Performed by: FSIMON Performed on: 08-SEP-16						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		FSIMON	Sep 8, 2016 1:41:27 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
20 - Miles			FSIMON	Sep 8, 2016 1:41:27 PM	No	
30 - Kilometers			FSIMON	Sep 8, 2016 1:41:27 PM	No	
40 - Hours			FSIMON	Sep 8, 2016 1:41:27 PM	No	
Activity Sub Total						
			Activity 5 Sub Total			
			Parts: 0.00			
			Labor: 0.00			
			Labor Hours: 0.00			
			Sublet Parts: 0.00			
			Sublet Labor: 0.00			
			Activity Sub Total 0.00			



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 27434286
Invoice No. 55345 - 27434286

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Interior light check		Ford E450 Champion Challenger	
Requested By:	FSIMON	Status:	40 - Closed (40)
Created By:	FSIMON	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	44,285 - DH

Activity Header
Activity: 15
Activity Note:
Reason for Repair: 04 Driver's Report
Work Accomplished:
Part Failure:
Activity Comments:

Activity Parts
No Data Available

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
08-Sep-16	Simon,Fritz	1	0	0

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available

Activity Sub Total		Activity 15 Sub Total	
		Parts:	0.00
		Labor:	0.00
		Labor Hours:	1.00
		Sublet Parts:	0.00
		Sublet Labor:	0.00
		Activity Sub Total	0.00

Work Order Footer		Work Order 27434286 Total	
		Parts:	0.00
		Labor:	0.00
		Labor Hours:	1.00
		Sublet Parts:	0.00
		Sublet Labor:	0.00
		Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 27419334
Invoice No. 55345 - 27419334

Client Department:

Department: 55345M

Work Order Description

PARKING LIGHT OUT

Requested By: AOWENS

Created By: AOWENS

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 43,586 - DH

Chronology

Reported	Sep 1, 2016 11:11:44 PM	Sep 1, 2016 11:11:44 PM
Started	Sep 1, 2016 12:00:00 AM	
Completed	Sep 1, 2016 11:30:00 PM	Sep 1, 2016 11:30:00 PM
Down Time		

Work Order Notes

Line 10

COMPLAINT: PARKING LIGHT OUT

CAUSE: PARKING BULB BLOWN

CORRECTION: REPLACE PARKING LIGHT BULB
PARTS 3157 NA QTY 1

Activity Header

Activity: 5 999 TOTAL VEHICLE

Activity Note: Personal Risk Assessment

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: Personal Risk Assessment

Task: PRA and Meter Readings Performed by: AOWENS Performed on: 01-SEP-16

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		AOWENS	Sep 1, 2016 11:17:09 PM	No	
20 - Miles			AOWENS	Sep 1, 2016 11:17:09 PM	No	
30 - Kilometers			AOWENS	Sep 1, 2016 11:17:09 PM	No	
40 - Hours			AOWENS	Sep 1, 2016 11:17:09 PM	No	

Activity Sub Total															
	<table><tr><td colspan="2">Activity 5 Sub Total</td></tr><tr><td>Parts:</td><td>0.00</td></tr><tr><td>Labor:</td><td>0.00</td></tr><tr><td>Labor Hours:</td><td>0.00</td></tr><tr><td>Sublet Parts:</td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td>0.00</td></tr></table>	Activity 5 Sub Total		Parts:	0.00	Labor:	0.00	Labor Hours:	0.00	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	0.00
Activity 5 Sub Total															
Parts:	0.00														
Labor:	0.00														
Labor Hours:	0.00														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	0.00														



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 27419334
Invoice No. 55345 - 27419334

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
PARKING LIGHT OUT		Ford E450 Champion Challenger	
Requested By:	AOWENS	Status:	40 - Closed (40)
Created By:	AOWENS	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	43,586 - DH

Activity Header
Activity:15 079 DEVICES, SAFETY/STABILITY, TRAILER
Activity Note: PARKING LIGHT OUT
Reason for Repair: 05 Inspection, Routine
Work Accomplished:
Part Failure:
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
01-Sep-16	3157NA	LAMP, MINIATURE, WEDGE-MOUNT, AMBER SAME AS GE3157NA	1	0.88	0.88

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
01-Sep-16	Owens,Arthur	0.1166666	0	0
01-Sep-16	Owens,Arthur	0.05	0	0

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available

Activity Sub Total	
Activity 15 Sub Total	
Parts:	0.88
Labor:	0.00
Labor Hours:	0.17
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.88

Work Order Footer	
Work Order 27419334 Total	
Parts:	0.88
Labor:	0.00
Labor Hours:	0.17
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.88



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 27184370
Invoice No. 55345 - 27184370

Client Department:

Department: 55345M

Work Order Description

PM A

Requested By: DARTHURS

Created By: DARTHURS

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 42,561 - DH

Chronology

Reported	Aug 25, 2016 12:19:51 PM	Aug 25, 2016 12:19:51 PM
Started	Aug 25, 2016 12:00:00 AM	
Completed	Aug 26, 2016 7:19:00 AM	Aug 26, 2016 7:19:00 AM
Down Time		

Work Order Notes

Line 10 COMPLAINT: pm Inspection due.

CAUSE: miles

CORRECTION: Replace oil and oil filter. Completed pm

Parts used 6 quarts oil 5w-20. 1 oil filter. B-329

Activity Header

Activity: 10 999 TOTAL VEHICLE

Activity Note: Light Medium Duty PMI

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
25-Aug-16	B329	GOING OUT OF SERVICE DO NOT ORDER USE B329 IN THE FLEET ORG FILTER, OIL	1	1.92	1.92
25-Aug-16	B329	GOING OUT OF SERVICE DO NOT ORDER USE B329 IN THE FLEET ORG FILTER, OIL	-1	1.92	-1.92

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
25-Aug-16	Capazzoli, Louis	1.5	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: Light Medium Duty PMI

Task: First Transit Light-Medium Duty PMI Performed by: LCAPAZZOLI Performed on: 25-AUG-16

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,000 - SECTION 1 Preparation and Drive On (In Lot) Inspection	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,100 - Safety Inspection	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
10,110 - FRA Check Drivers Pre-trip or DVIR/EVIR & Authorization Forms	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
10,120 - FRA Check All Warning Lights and Alarms	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
10,130 - FRA Check Automatic Transmission Neutral Start Operation	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
10,140 - Check Service Brakes	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
10,150 - FRA Start Engine and Listen for Any Unusual Noises	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
10,160 - FRA Check Instruments and Horns	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
10,170 - Check Fast Idle	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
10,180 - Check Starter Protection Circuit	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
10,190 - Check Reverse Warning System	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
11,100 - Check Parking Brake	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
11,110 - Check HVAC Switches and Other Controls	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
11,120 - FRA Inspect Windshields, Mirror and Sun Visor Condition	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
11,130 - FRA Check Wiper and Washer Operation	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
11,140 - Road Test: Check for Proper Operation	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
11,150 - Perform Brake Test	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
11,161 - FRA Check/Record Oil Pressure / @1500 rpm	Pounds per Square Inch	n/a	LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
11,162 - FRA Check/Record Water Temperature	Degree Fahrenheit	n/a	LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
11,170 - FRA Check Door Operation	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
11,180 - FRA Check Operation of All Other Accessories	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
20,000 - SECTION 2 Interior Circle Inspection	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
20,210 - Check Condition of Operator's Area	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
20,220 - Check Accelerator and Brake Pedals	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
20,230 - FRA Check Wiring Under Dash	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
20,240 - FRA Check Interior Lights	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
20,250 - FRA Check Interior Electrical Panels	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
20,260 - Check Stop Request System	-	n/a	LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
20,270 - Check Fare Box Mounting (If Applicable)	-	n/a	LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
20,280 - Check Seats, Seat Belts, Hand Rails and Floor Covering	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
20,290 - Check for Physical Damage, Water Leaks, and Graffiti	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
22,100 - Check Emergency Windows and Glass Condition	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
22,110 - Check Emergency Hatches	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
22,120 - Check All Safety Equipment	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
30,000 - SECTION 3 Exterior Circle Inspection	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
30,310 - Check Passenger Doors	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
30,320 - Inspect Step-well and Hand Rails	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
30,330 - Check Wheelchair Lift Operation	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
30,340 - FRA Check Destination Sign and Run Box	-	n/a	LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
30,350 - FRA Inspect Mirror and Mountings	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
30,360 - Check for Physical Damage and Decals	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
30,370 - Check Wiper Blade and Arm Condition	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
30,380 - Check Exterior Compartment Doors	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
30,390 - FRA Check Fuel Tank Cap	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
33,100 - Check Lights and Reflectors	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
33,110 - Check License Plate, Permits and State Inspection Decals	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
40,000 - SECTION 4 Engine Compartment Inspection	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
40,410 - FRA Check Engine Compartment/Condition for Fire Risk	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
40,420 - Check Hood	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
40,430 - Check Fan, Shroud and Radiator	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
40,440 - Test Coolant System Using Test Strips and Record Results	-	n/a	LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
40,441 - Inhibitor Test Pass or Fail (Indicate with a Yes or No)	No	n/a	LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
40,442 - Freeze Point	Degree Fahrenheit	n/a	LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
40,450 - FRA Check Coolant Recovery System Condition & for Leaks	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
40,460 - Record Antifreeze Protection Level Using Refractometer	-	n/a	LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
40,461 - Refractometer Reading	Degree Fahrenheit	n/a	LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
40,470 - Pressure Test Cooling System and Check for Leaks	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
40,480 - FRA Check Coolant Hose Condition	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
40,490 - FRA Check Alternator Mount and Condition	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
44,100 - FRA Check Fuel Control and Transmission Connections	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
44,110 - FRA Check Master Cylinder Fluid Level	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
44,120 - FRA Check All Belts for Condition, Alignment and Tension	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
44,130 - FRA Check Exhaust System	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
44,140 - FRA Check Intake System	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
44,150 - FRA Inspect Turbocharger	-	n/a	LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
44,160 - FRA Inspect Power Steering and Hydraulic Fluid	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
44,170 - FRA Check All Engine or Belt Driven Components	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
44,180 - FRA Check for Leaks	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
44,190 - FRA Perform Battery Inspection	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
44,200 - FRA Check Battery Box Corrosion, Cables and Hold-Downs	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
50,000 - SECTION 5 Steering System Inspection	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
50,510 - Check Entire Steering System	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
60,000 - SECTION 6 Tires and Wheel Inspection	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
60,610 - FRA Check and Record Air Pressure	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
60,611 - Air Pressure RF	65 Pounds per Square Inch		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
60,612 - Air Pressure LF	65 Pounds per Square Inch		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
60,613 - Air Pressure RRO	70 Pounds per Square Inch		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
60,614 - Air Pressure RRI	70 Pounds per Square Inch		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
60,615 - Air Pressure LRI	70 Pounds per Square Inch		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
60,616 - Air Pressure LRO	70 Pounds per Square Inch		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
60,620 - Check Valve Stems and Caps	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
60,630 - Check and Record Tread Depth	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
60,631 - Tread Depth RF	8 32nds of an inch		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
60,632 - Tread Depth LF	8 32nds of an inch		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
60,633 - Tread Depth RRO	8 32nds of an inch		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
60,634 - Tread Depth RRI	8 32nds of an inch		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
60,635 - Tread Depth LRI	8 32nds of an inch		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
60,636 - Tread Depth LRO	8 32nds of an inch		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
60,640 - Check for Mismatched Tread or Casing Design	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
60,650 - Check Sidewall Wear	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
60,660 - Inspect for Cuts and Tears	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
60,670 - Check Dual Mating With Square	-	n/a	LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
60,680 - Check Wheels for Cracks and Loose Lugs	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
60,690 - Check Tires for Irregular or Alignment Wear	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
66,100 - FRA Check Outer Hubs for Leaks	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
70,000 - SECTION 7 Under Vehicle Inspection	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
70,710 - Check Vibration Damper	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
70,720 - Check Engine and Transmission Mounts	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
70,730 - FRA Check Starter	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
70,740 - FRA Check Bottom of Engine for Fluid Leaks	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
70,750 - FRA Check Transmission for Leaks	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
70,760 - FRA Check Differential Breather and Fluid	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
70,770 - FRA Check Exhaust System	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
70,780 - Check Driveline, U-joint and Slip Yokes	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
70,790 - Check All Body Mounts and Chassis Frame	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
77,100 - FRA Check Security, Integrity and Length of Ground Straps	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
77,110 - FRA Check Fuel Tank	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
77,120 - Check Suspension Components	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
77,130 - FRA Check Brake Pad Thickness and Rotor for Wear	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
77,131 - Brake Pad Thickness LF	Inch	12 mm	LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
77,132 - Brake Pad Thickness RF	Inch	12 mm	LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
77,133 - Brake Pad Thickness LR	Inch	12 mm	LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
77,134 - Brake Pad Thickness RR	Inch	12 mm	LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
77,135 - Brake Rotor LF	Inch	40	LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
77,136 - Brake Rotor RF	Inch	40	LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
77,137 - Brake Rotor LR	Inch	40	LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
77,138 - Brake Rotor RR	Inch	40	LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
77,140 - FRA Check Brake Hoses	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
77,150 - Check King Pins	-	n/a	LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
77,160 - FRA Check for Loose or Noisy Wheel Bearings	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
80,000 - SECTION 8 PMI Report Completion	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
80,810 - Completion of PMI Report	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
90,000 - SECTION 9 Completion of PMI	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	
90,910 - Vehicle Returned to predetermined location	Done		LCAPAZZOLI	Aug 25, 2016 2:41:02 PM	No	

Activity Sub Total

Activity 10 Sub Total

Parts:	1.92
Labor:	0.00
Labor Hours:	1.50
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	1.92



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 27184370
Invoice No. 55345 - 27184370

Client Department:

Department: 55345M

Work Order Description

PM A

Requested By: DARTHURS

Created By: DARTHURS

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 42,561 - DH

Activity Header

Activity: 20 999 TOTAL VEHICLE

Activity Note: PM A

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: A PM Level A

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
25-Aug-16	Capazzoli, Louis	0.5	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

20 Desc: PM A

Task: PM A SERVICE Performed by: LCAPAZZOLI Performed on: 25-AUG-16

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
100,000 - "A" PMI SERVICING ITEMS	Done		LCAPAZZOLI	Aug 25, 2016 2:41:54 PM	No	
101,000 - FRA Change Oil Filters	Yes		LCAPAZZOLI	Aug 25, 2016 2:41:54 PM	No	
102,000 - FRA Drain Engine Oil	Yes		LCAPAZZOLI	Aug 25, 2016 2:41:54 PM	No	
103,000 - FRA Check Transmission Fluid	Done		LCAPAZZOLI	Aug 25, 2016 2:41:54 PM	No	
104,000 - Lubricate Chassis	Done		LCAPAZZOLI	Aug 25, 2016 2:41:54 PM	No	
105,000 - Replace or Clean A/C Filters	Done		LCAPAZZOLI	Aug 25, 2016 2:41:54 PM	No	
107,000 - FRA Change Primary Fuel Filter	No		LCAPAZZOLI	Aug 25, 2016 2:41:54 PM	No	
108,000 - Lube all pivoting Mechanisms	Done		LCAPAZZOLI	Aug 25, 2016 2:41:54 PM	No	

Activity Sub Total

Activity 20 Sub Total

Parts:	0.00
Labor:	0.00

	Labor Hours:	0.50
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 27184370
Invoice No. 55345 - 27184370

Client Department:

Department: 55345M

Work Order Description

PM A

Requested By: DARTHURS

Created By: DARTHURS

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 42,561 - DH

Activity Header

Activity: 30 999 TOTAL VEHICLE

Activity Note: PRAMETER

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
25-Aug-16	Capazzoli, Louis	0.0833333	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

30 Desc: PRAMETER

Task: PRA and Meter Readings Performed by: LCAPAZZOLI Performed on: 25-AUG-16

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		LCAPAZZOLI	Aug 25, 2016 2:42:14 PM	No	
20 - Miles			LCAPAZZOLI	Aug 25, 2016 2:42:14 PM	No	
30 - Kilometers			LCAPAZZOLI	Aug 25, 2016 2:42:14 PM	No	
40 - Hours			LCAPAZZOLI	Aug 25, 2016 2:42:14 PM	No	

Activity Sub Total

Activity 30 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	0.08
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00

Work Order Footer

Work Order 27184370 Total

Parts:	1.92
Labor:	0.00
Labor Hours:	2.08

	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	1.92



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 27346197
Invoice No. 55345 - 27346197

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
One of the clearance lights is out.		Ford E450 Champion Challenger	
Requested By:	EDITORRES	Status:	40 - Closed (40)
Created By:	EDITORRES	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	40,059 - DH

Chronology		
Reported	Jul 28, 2016 8:23:50 AM	Jul 28, 2016 8:23:50 AM
Started	Jul 28, 2016 12:00:00 AM	
Completed	Jul 29, 2016 7:29:00 AM	Jul 29, 2016 7:29:00 AM
Down Time		

Work Order Notes

Line 10
COMPLAINT:
One of the clearance lights is out.

CAUSE:
Unknown.

CORRECTION:
Replaced the bad clearance light.

PARTS
Covered under warranty.

Activity Header						
Activity: 5 999 TOTAL VEHICLE						
Activity Note: Personal Risk Assessment						
Reason for Repair: 05 Inspection, Routine						
Work Accomplished: 06 Inspect						
Part Failure:						
Activity Comments:						
Activity Parts						
No Data Available						
Activity Labor						
No Data Available						
Activity Sublet						
No Data Available						
Activity Checklist						
Check List						
5 Desc: Personal Risk Assessment						
Task: PRA and Meter Readings Performed by: EDITORRES Performed on: 28-JUL-16						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		EDITORRES	Jul 28, 2016 9:08:11 AM	No	
20 - Miles			EDITORRES	Jul 28, 2016 9:08:11 AM	No	
30 - Kilometers			EDITORRES	Jul 28, 2016	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO	
				9:08:11 AM			
40 - Hours			EDITORRES	Jul 28, 2016 9:08:11 AM	No		
Activity Sub Total				Activity 5 Sub Total			
				Parts:			0.00
				Labor:			0.00
				Labor Hours:			0.00
				Sublet Parts:			0.00
				Sublet Labor:			0.00
				Activity Sub Total			0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 27346197
Invoice No. 55345 - 27346197

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FD4E4FS7EDB17176
One of the clearance lights is out.		Ford E450 Champion Challenger	
Requested By:	EDITORRES	Status:	40 - Closed (40)
Created By:	EDITORRES	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	40,059 - DH

Activity Header
Activity:15 034 LIGHTING SYSTEM
Activity Note: One Clearance light is out.
Reason for Repair: 05 Inspection, Routine
Work Accomplished:
Part Failure:
Activity Comments:

Activity Parts
No Data Available

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
28-Jul-16	Torres,Edwin	0.65	0	0

Activity Sublet
No Data Available


Activity Checklist
No Data Available
No Data Available

Activity Sub Total		Activity 15 Sub Total	
		Parts:	0.00
		Labor:	0.00
		Labor Hours:	0.65
		Sublet Parts:	0.00
		Sublet Labor:	0.00
		Activity Sub Total	0.00

Work Order Footer		Work Order 27346197 Total	
		Parts:	0.00
		Labor:	0.00
		Labor Hours:	0.65
		Sublet Parts:	0.00
		Sublet Labor:	0.00
		Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 27209560
Invoice No. 55345 - 27209560

Client Department:

Department: 55345M

Work Order Description

Needs tie down bag

Requested By: RGASPARD

Created By: RGASPARD

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 38,976 - DH

Chronology

Reported	Jun 23, 2016 11:02:30 PM	Jun 23, 2016 11:02:30 PM
Started	Jun 23, 2016 12:00:00 AM	
Completed	Jun 23, 2016 11:11:00 PM	Jun 23, 2016 11:11:00 PM
Down Time		

Work Order Notes

Line 10

COMPLAINT: needs tie down bag

CAUSE:ripped

CORRECTION: replaced tie down bag 1

Under warranty

Activity Header

Activity:5 999 TOTAL VEHICLE

Activity Note: Personal Risk Assessment

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
23-Jun-16	Gaspard,Ronald	0.0666666	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: Personal Risk Assessment

Task: PRA and Meter Readings Performed by: RGASPARD Performed on: 23-JUN-16

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		RGASPARD	Jun 23, 2016 11:04:30 PM	No	
20 - Miles			RGASPARD	Jun 23, 2016 11:04:30 PM	No	
30 - Kilometers			RGASPARD	Jun 23, 2016 11:04:30 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO																													
40 - Hours			RGASPARD	Jun 23, 2016 11:04:30 PM	No																														
Activity Sub Total			<table><tr><td colspan="2">Activity 5 Sub Total</td><td></td><td></td></tr><tr><td>Parts:</td><td></td><td>0.00</td><td></td></tr><tr><td>Labor:</td><td></td><td>0.00</td><td></td></tr><tr><td>Labor Hours:</td><td></td><td>0.07</td><td></td></tr><tr><td>Sublet Parts:</td><td></td><td>0.00</td><td></td></tr><tr><td>Sublet Labor:</td><td></td><td>0.00</td><td></td></tr><tr><td>Activity Sub Total</td><td></td><td>0.00</td><td></td></tr></table>					Activity 5 Sub Total				Parts:		0.00		Labor:		0.00		Labor Hours:		0.07		Sublet Parts:		0.00		Sublet Labor:		0.00		Activity Sub Total		0.00	
Activity 5 Sub Total																																			
Parts:		0.00																																	
Labor:		0.00																																	
Labor Hours:		0.07																																	
Sublet Parts:		0.00																																	
Sublet Labor:		0.00																																	
Activity Sub Total		0.00																																	



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 27209560
Invoice No. 55345 - 27209560

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Needs tie down bag		Ford E450 Champion Challenger	
Requested By:	RGASPARD	Status:	40 - Closed (40)
Created By:	RGASPARD	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	38,976 - DH

Activity Header				
Activity:15 079 DEVICES, SAFETY/STABILITY, TRAILER				
Activity Note:				
Reason for Repair: 08 Preventive Maintenance				
Work Accomplished:				
Part Failure:				
Activity Comments:				
Activity Parts				
No Data Available				
Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
23-Jun-16	Gaspard,Ronald	0.75	0	0
Activity Sublet				
No Data Available				
Activity Checklist				
No Data Available				
No Data Available				
Activity Sub Total				
			Activity 15 Sub Total	
			Parts:	0.00
			Labor:	0.00
			Labor Hours:	0.75
			Sublet Parts:	0.00
			Sublet Labor:	0.00
			Activity Sub Total	0.00
Work Order Footer				
			Work Order 27209560 Total	
			Parts:	0.00
			Labor:	0.00
			Labor Hours:	0.82
			Sublet Parts:	0.00
			Sublet Labor:	0.00
			Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 27200888
Invoice No. 55345 - 27200888

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Check engine		Ford E450 Champion Challenger	
Requested By:	FSIMON	Status:	40 - Closed (40)
Created By:	FSIMON	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	38,609 - DH

Chronology		
Reported	Jun 17, 2016 12:09:04 PM	Jun 17, 2016 12:09:04 PM
Started	Jun 17, 2016 12:00:00 AM	
Completed	Jun 17, 2016 2:22:00 PM	Jun 17, 2016 2:22:00 PM
Down Time		

Work Order Notes

Line 10
COMPLAINT:Bus shaking

CAUSE:Fuel vapor in the tank

CORRECTION:Bleed the fuel system

Complaint verified
Fuel pressures within specs.
Fuel system bled
Road test performed ok
Bus returned to its predetermined spot

No Part used

Activity Header							
Activity: 5 999 TOTAL VEHICLE							
Activity Note: Personal Risk Assessment							
Reason for Repair:		05 Inspection, Routine					
Work Accomplished:		06 Inspect					
Part Failure:							
Activity Comments:							
Activity Parts							
No Data Available							
Activity Labor							
No Data Available							
Activity Sublet							
No Data Available							
Activity Checklist							
Check List							
5 Desc: Personal Risk Assessment							
Task: PRA and Meter Readings Performed by: FSIMON Performed on: 17-JUN-16							
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO	
10 - Have you successfully completed the Personal	Done		FSIMON	Jun 17, 2016	No		

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
Risk Assessment?				12:30:30 PM		
20 - Miles			FSIMON	Jun 17, 2016 12:30:30 PM	No	
30 - Kilometers			FSIMON	Jun 17, 2016 12:30:30 PM	No	
40 - Hours			FSIMON	Jun 17, 2016 12:30:30 PM	No	
Activity Sub Total						
				Activity 5 Sub Total		
				Parts:		0.00
				Labor:		0.00
				Labor Hours:		0.00
				Sublet Parts:		0.00
				Sublet Labor:		0.00
				Activity Sub Total		0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 27200888
Invoice No. 55345 - 27200888

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FD4E4FS7EDB17176
Check engine		Ford E450 Champion Challenger	
Requested By:	FSIMON	Status:	40 - Closed (40)
Created By:	FSIMON	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	38,609 - DH

Activity Header
Activity: 15
Activity Note:
Reason for Repair: 04 Driver's Report
Work Accomplished:
Part Failure:
Activity Comments:

Activity Parts
No Data Available

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
17-Jun-16	Simon,Fritz	2	0	0

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available

Activity Sub Total		Activity 15 Sub Total	
Parts:			0.00
Labor:			0.00
Labor Hours:			2.00
Sublet Parts:			0.00
Sublet Labor:			0.00
Activity Sub Total			0.00

Work Order Footer		Work Order 27200888 Total	
Parts:			0.00
Labor:			0.00
Labor Hours:			2.00
Sublet Parts:			0.00
Sublet Labor:			0.00
Activity Sub Total			0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 27184367
Invoice No. 55345 - 27184367

Client Department:

Department: 55345M

Work Order Description

interior Light

Requested By: DARTHURS

Created By: DARTHURS

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 38,268 - DH

Chronology

Reported	Jun 12, 2016 1:42:29 PM	Jun 12, 2016 1:42:29 PM
Started	Jun 12, 2016 12:00:00 AM	
Completed	Jun 12, 2016 1:54:00 PM	Jun 12, 2016 1:54:00 PM
Down Time		

Work Order Notes

Line 10

COMPLAINT: interior Light Out

CAUSE: Light Bulb Blown

CORRECTION: Replace interior Light Qty 1
Parts under Warranty,

Activity Header

Activity: 5 999 TOTAL VEHICLE

Activity Note: Personal Risk Assessment

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
12-Jun-16	Arthurs,Durvin	0.5	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: Personal Risk Assessment


Task: PRA and Meter Readings Performed by: DARTHURS Performed on: 12-JUN-16

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		DARTHURS	Jun 12, 2016 1:43:40 PM	No	
20 - Miles			DARTHURS	Jun 12, 2016 1:43:40 PM	No	
30 - Kilometers			DARTHURS	Jun 12, 2016 1:43:40 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO																						
40 - Hours			DARTHURS	Jun 12, 2016 1:43:40 PM	No																							
Activity Sub Total			<table><tr><td colspan="2">Activity 5 Sub Total</td><td></td></tr><tr><td>Parts:</td><td></td><td>0.00</td></tr><tr><td>Labor:</td><td></td><td>0.00</td></tr><tr><td>Labor Hours:</td><td></td><td>0.50</td></tr><tr><td>Sublet Parts:</td><td></td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td></td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td></td><td>0.00</td></tr></table>					Activity 5 Sub Total			Parts:		0.00	Labor:		0.00	Labor Hours:		0.50	Sublet Parts:		0.00	Sublet Labor:		0.00	Activity Sub Total		0.00
Activity 5 Sub Total																												
Parts:		0.00																										
Labor:		0.00																										
Labor Hours:		0.50																										
Sublet Parts:		0.00																										
Sublet Labor:		0.00																										
Activity Sub Total		0.00																										



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 27080412
Invoice No. 55345 - 27080412

Client Department:

Department: 55345M

Work Order Description

PM B

Requested By: CVERGARA

Created By: CVERGARA

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 38,268 - DH

Chronology

Reported	Jun 10, 2016 12:09:47 PM	Jun 10, 2016 12:09:47 PM
Started	Jun 12, 2016 12:00:00 AM	
Completed	Jun 12, 2016 1:54:00 PM	Jun 12, 2016 1:54:00 PM
Down Time		

Work Order Notes

Line 10 COMPLAINT:Perform PMB Service

CAUSE:Service Due By Mileage

CORRECTION: Change Oil And Filter Lube All Pivoting Points /Clean Rear A/C Filter

Parts# B329 OilFilter Qty (1)

Oil 5W20 Qty (6) Qts

Activity Header

Activity:10 999 TOTAL VEHICLE

Activity Note: Light Mediu Duty PMI

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
13-Jun-16	B329	GOING OUT OF SERVICE DO NOT ORDER USE B329 IN THE FLEET ORG FILTER, OIL	1	1.92	1.92

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
12-Jun-16	Arthurs,Durvin	1.5	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: Light Mediu Duty PMI

Task: First Transit Light-Medium Duty PMI Performed by: DARTHURS Performed on: 12-JUN-16

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,000 - SECTION 1 Preparation and Drive On (In Lot) Inspection	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
10,100 - Safety Inspection	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,110 - FRA Check Drivers Pre-trip or DVIR/EVIR & Authorization Forms	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
10,120 - FRA Check All Warning Lights and Alarms	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
10,130 - FRA Check Automatic Transmission Neutral Start Operation	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
10,140 - Check Service Brakes	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
10,150 - FRA Start Engine and Listen for Any Unusual Noises	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
10,160 - FRA Check Instruments and Horns	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
10,170 - Check Fast Idle	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
10,180 - Check Starter Protection Circuit	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
10,190 - Check Reverse Warning System	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
11,100 - Check Parking Brake	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
11,110 - Check HVAC Switches and Other Controls	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
11,120 - FRA Inspect Windshields, Mirror and Sun Visor Condition	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
11,130 - FRA Check Wiper and Washer Operation	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
11,140 - Road Test: Check for Proper Operation	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
11,150 - Perform Brake Test	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
11,161 - FRA Check/Record Oil Pressure / @1500 rpm	Pounds per Square Inch	NA	DARTHURS	Jun 12, 2016 1:33:30 PM	No	
11,162 - FRA Check/Record Water Temperature	Degree Fahrenheit	NA	DARTHURS	Jun 12, 2016 1:33:30 PM	No	
11,170 - FRA Check Door Operation	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
11,180 - FRA Check Operation of All Other Accessories	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
20,000 - SECTION 2 Interior Circle Inspection	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
20,210 - Check Condition of Operator's Area	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
20,220 - Check Accelerator and Brake Pedals	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
20,230 - FRA Check Wiring Under Dash	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
20,240 - FRA Check Interior Lights	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
20,250 - FRA Check Interior Electrical Panels	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
20,260 - Check Stop Request System	-	NA	DARTHURS	Jun 12, 2016 1:33:30 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
20,270 - Check Fare Box Mounting (If Applicable)	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
20,280 - Check Seats, Seat Belts, Hand Rails and Floor Covering	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
20,290 - Check for Physical Damage, Water Leaks, and Graffiti	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
22,100 - Check Emergency Windows and Glass Condition	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
22,110 - Check Emergency Hatches	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
22,120 - Check All Safety Equipment	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
30,000 - SECTION 3 Exterior Circle Inspection	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
30,310 - Check Passenger Doors	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
30,320 - Inspect Step-well and Hand Rails	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
30,330 - Check Wheelchair Lift Operation	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
30,340 - FRA Check Destination Sign and Run Box	-	NA	DARTHURS	Jun 12, 2016 1:33:30 PM	No	
30,350 - FRA Inspect Mirror and Mountings	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
30,360 - Check for Physical Damage and Decals	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
30,370 - Check Wiper Blade and Arm Condition	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
30,380 - Check Exterior Compartment Doors	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
30,390 - FRA Check Fuel Tank Cap	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
33,100 - Check Lights and Reflectors	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
33,110 - Check License Plate, Permits and State Inspection Decals	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
40,000 - SECTION 4 Engine Compartment Inspection	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
40,410 - FRA Check Engine Compartment/Condition for Fire Risk	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
40,420 - Check Hood	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
40,430 - Check Fan, Shroud and Radiator	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
40,440 - Test Coolant System Using Test Strips and Record Results	-	NA	DARTHURS	Jun 12, 2016 1:33:30 PM	No	
40,441 - Inhibitor Test Pass or Fail (Indicate with a Yes or No)	No	NA	DARTHURS	Jun 12, 2016 1:33:30 PM	No	
40,442 - Freeze Point	Degree Fahrenheit	NA	DARTHURS	Jun 12, 2016 1:33:30 PM	No	
40,450 - FRA Check Coolant Recovery System Condition & for Leaks	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
40,460 - Record Antifreeze Protection Level Using Refractometer	-	NA	DARTHURS	Jun 12, 2016 1:33:30 PM	No	
40,461 - Refractometer Reading	Degree Fahrenheit	NA	DARTHURS	Jun 12, 2016 1:33:30 PM	No	
40,470 - Pressure Test Cooling System and Check for Leaks	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
40,480 - FRA Check Coolant Hose Condition	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
40,490 - FRA Check Alternator Mount and Condition	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
44,100 - FRA Check Fuel Control and Transmission Connections	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
44,110 - FRA Check Master Cylinder Fluid Level	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
44,120 - FRA Check All Belts for Condition, Alignment and Tension	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
44,130 - FRA Check Exhaust System	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
44,140 - FRA Check Intake System	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
44,150 - FRA Inspect Turbocharger	-	NA	DARTHURS	Jun 12, 2016 1:33:30 PM	No	
44,160 - FRA Inspect Power Steering and Hydraulic Fluid	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
44,170 - FRA Check All Engine or Belt Driven Components	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
44,180 - FRA Check for Leaks	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
44,190 - FRA Perform Battery Inspection	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
44,200 - FRA Check Battery Box Corrosion, Cables and Hold-Downs	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
50,000 - SECTION 5 Steering System Inspection	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
50,510 - Check Entire Steering System	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
60,000 - SECTION 6 Tires and Wheel Inspection	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
60,610 - FRA Check and Record Air Pressure	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
60,611 - Air Pressure RF	65 Pounds per Square Inch		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
60,612 - Air Pressure LF	65 Pounds per Square Inch		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
60,613 - Air Pressure RRO	70 Pounds per Square Inch		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
60,614 - Air Pressure RRI	70 Pounds per Square Inch		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
60,615 - Air Pressure LRI	70 Pounds per Square Inch		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
60,616 - Air Pressure LRO	70 Pounds per Square Inch		DARTHURS	Jun 12, 2016 1:33:30 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
60,620 - Check Valve Stems and Caps	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
60,630 - Check and Record Tread Depth	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
60,631 - Tread Depth RF	8 32nds of an inch		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
60,632 - Tread Depth LF	9 32nds of an inch		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
60,633 - Tread Depth RRO	9 32nds of an inch		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
60,634 - Tread Depth RRI	7 32nds of an inch		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
60,635 - Tread Depth LRI	6 32nds of an inch		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
60,636 - Tread Depth LRO	8 32nds of an inch		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
60,640 - Check for Mismatched Tread or Casing Design	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
60,650 - Check Sidewall Wear	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
60,660 - Inspect for Cuts and Tears	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
60,670 - Check Dual Mating With Square	-	NA	DARTHURS	Jun 12, 2016 1:33:30 PM	No	
60,680 - Check Wheels for Cracks and Loose Lugs	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
60,690 - Check Tires for Irregular or Alignment Wear	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
66,100 - FRA Check Outer Hubs for Leaks	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
70,000 - SECTION 7 Under Vehicle Inspection	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
70,710 - Check Vibration Damper	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
70,720 - Check Engine and Transmission Mounts	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
70,730 - FRA Check Starter	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
70,740 - FRA Check Bottom of Engine for Fluid Leaks	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
70,750 - FRA Check Transmission for Leaks	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
70,760 - FRA Check Differential Breather and Fluid	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
70,770 - FRA Check Exhaust System	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
70,780 - Check Driveline, U-joint and Slip Yokes	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
70,790 - Check All Body Mounts and Chassis Frame	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
77,100 - FRA Check Security, Integrity and Length of Ground Straps	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
77,110 - FRA Check Fuel Tank	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
77,120 - Check Suspension Components	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
77,130 - FRA Check Brake Pad Thickness and Rotor for Wear	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
77,131 - Brake Pad Thickness LF	10 Inch		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
77,132 - Brake Pad Thickness RF	10 Inch		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
77,133 - Brake Pad Thickness LR	10 Inch		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
77,134 - Brake Pad Thickness RR	10 Inch		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
77,135 - Brake Rotor LF	1.602 Inch		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
77,136 - Brake Rotor RF	1.604 Inch		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
77,137 - Brake Rotor LR	1.653 Inch		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
77,138 - Brake Rotor RR	1.654 Inch		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
77,140 - FRA Check Brake Hoses	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
77,150 - Check King Pins	-	NA	DARTHURS	Jun 12, 2016 1:33:30 PM	No	
77,160 - FRA Check for Loose or Noisy Wheel Bearings	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
80,000 - SECTION 8 PMI Report Completion	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
80,810 - Completion of PMI Report	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
90,000 - SECTION 9 Completion of PMI	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	
90,910 - Vehicle Returned to predetermined location	Done		DARTHURS	Jun 12, 2016 1:33:30 PM	No	

Activity Sub Total

Activity 10 Sub Total	
Parts:	1.92
Labor:	0.00
Labor Hours:	1.50
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	1.92



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 27184367
Invoice No. 55345 - 27184367

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FD4E4FS7EDB17176
interior Light		Ford E450 Champion Challenger	
Requested By:	DARTHURS	Status:	40 - Closed (40)
Created By:	DARTHURS	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	38,268 - DH

Activity Header
Activity:15 079 DEVICES, SAFETY/STABILITY, TRAILER
Activity Note: interior Light Out PMB Follow up
Reason for Repair: 05 Inspection, Routine
Work Accomplished:
Part Failure:
Activity Comments:

Activity Parts
No Data Available

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
12-Jun-16	Arthurs,Durvin	0.5	0	0

Activity Sublet
No Data Available


Activity Checklist
No Data Available
No Data Available

Activity Sub Total		Activity 15 Sub Total	
Parts:			0.00
Labor:			0.00
Labor Hours:			0.50
Sublet Parts:			0.00
Sublet Labor:			0.00
Activity Sub Total			0.00

Work Order Footer		Work Order 27184367 Total	
Parts:			0.00
Labor:			0.00
Labor Hours:			1.00
Sublet Parts:			0.00
Sublet Labor:			0.00
Activity Sub Total			0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 27080412
Invoice No. 55345 - 27080412

Client Department:

Department: 55345M

Work Order Description

PM B

Requested By: CVERGARA

Created By: CVERGARA

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 38,268 - DH

Activity Header

Activity: 20 999 TOTAL VEHICLE

Activity Note: PM B

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: B PM Level B

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
12-Jun-16	Arthurs,Durvin	0.4166666	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

20 Desc: PM B

Task: PM B SERVICE Performed by: DARTHURS Performed on: 12-JUN-16

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
100,000 - "A" PMI SERVICING ITEMS	Done		DARTHURS	Jun 12, 2016 1:34:48 PM	No	
101,000 - FRA Change Oil Filters	Yes		DARTHURS	Jun 12, 2016 1:34:48 PM	No	
102,000 - FRA Drain Engine Oil	Yes		DARTHURS	Jun 12, 2016 1:34:48 PM	No	
103,000 - FRA Check Transmission Fluid	Done		DARTHURS	Jun 12, 2016 1:34:48 PM	No	
104,000 - Lubricate Chassis	Done		DARTHURS	Jun 12, 2016 1:34:48 PM	No	
105,000 - Replace or Clean A/C Filters	Done		DARTHURS	Jun 12, 2016 1:34:48 PM	No	
107,000 - FRA Change Primary Fuel Filter	No	NA	DARTHURS	Jun 12, 2016 1:34:48 PM	No	
108,000 - Lube all pivoting Mechanisms	Done		DARTHURS	Jun 12, 2016 1:34:48 PM	No	
200,000 - "B" PMI SERVICING ITEMS (12 MONTH)	Done		DARTHURS	Jun 12, 2016 1:34:48 PM	No	
201,000 - Service Crankcase Breather	-	NA	DARTHURS	Jun 12, 2016 1:34:48 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
203,000 - FRA Change Automatic Transmission Fluid	No		DARTHURS	Jun 12, 2016 1:34:48 PM	No	
204,000 - FRA Change Power Steering Fluid and Filter	No		DARTHURS	Jun 12, 2016 1:34:48 PM	No	
205,000 - Complete Engine Diagnostics and Clear Codes when Completed	Done		DARTHURS	Jun 12, 2016 1:34:48 PM	No	


Activity Sub Total

Activity 20 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	0.42
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 27080412
Invoice No. 55345 - 27080412

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
PM B		Ford E450 Champion Challenger	
Requested By:	CVERGARA	Status:	40 - Closed (40)
Created By:	CVERGARA	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	38,268 - DH

Activity Header
Activity:30 999 TOTAL VEHICLE
Activity Note: PRAMETER
Reason for Repair: 05 Inspection, Routine
Work Accomplished: 06 Inspect
Part Failure:
Activity Comments:

Activity Parts
No Data Available

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
12-Jun-16	Arthurs,Durvin	0.0833333	0	0

Activity Sublet
No Data Available

Activity Checklist						
Check List						
30 Desc: PRAMETER						
Task: PRA and Meter Readings Performed by: DARTHURS Performed on: 12-JUN-16						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		DARTHURS	Jun 12, 2016 1:35:11 PM	No	
20 - Miles			DARTHURS	Jun 12, 2016 1:35:11 PM	No	
30 - Kilometers			DARTHURS	Jun 12, 2016 1:35:11 PM	No	
40 - Hours			DARTHURS	Jun 12, 2016 1:35:11 PM	No	

Activity Sub Total	
Activity 30 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	0.08
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00

Work Order Footer	
Work Order 27080412 Total	
Parts:	1.92
Labor:	0.00
Labor Hours:	2.00

	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	1.92



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 27179881
Invoice No. 55345 - 27179881

Client Department:

Department: 55345M

Work Order Description

Rear A/C check

Requested By: FSIMON

Created By: FSIMON

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 38,078 - DH

Chronology

Reported	Jun 8, 2016 2:52:13 PM	Jun 8, 2016 2:52:13 PM
Started	Jun 8, 2016 12:00:00 AM	
Completed	Jun 9, 2016 8:32:00 AM	Jun 9, 2016 8:32:00 AM
Down Time		

Work Order Notes

Line 10

COMPLAINT:Rear A/C not working

CAUSE:Broken rear A/C Electrical wire

CORRECTION:electrical wire repair

Complaint verified

Rear A/C electrical system tested

No continuity from the module to the A/C relay

The rear A/C electrical circuit repaired

No part used

Activity Header

Activity:5 999 TOTAL VEHICLE

Activity Note: Personal Risk Assessment

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: Personal Risk Assessment


Task: PRA and Meter Readings Performed by: FSIMON Performed on: 08-JUN-16

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		FSIMON	Jun 8, 2016 3:02:12 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
20 - Miles			FSIMON	Jun 8, 2016 3:02:12 PM	No	
30 - Kilometers			FSIMON	Jun 8, 2016 3:02:12 PM	No	
40 - Hours			FSIMON	Jun 8, 2016 3:02:12 PM	No	
Activity Sub Total						
			Activity 5 Sub Total			
			Parts: 0.00			
			Labor: 0.00			
			Labor Hours: 0.00			
			Sublet Parts: 0.00			
			Sublet Labor: 0.00			
			Activity Sub Total 0.00			



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 27179881
Invoice No. 55345 - 27179881

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FD4E4FS7EDB17176
Rear A/C check		Ford E450 Champion Challenger	
Requested By:	FSIMON	Status:	40 - Closed (40)
Created By:	FSIMON	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	38,078 - DH

Activity Header				
Activity:15 001 AIR CONDITIONING, HEATING AND VENTILATION				
Activity Note:				
Reason for Repair: 04 Driver's Report				
Work Accomplished:				
Part Failure:				
Activity Comments:				
Activity Parts				
No Data Available				
Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
08-Jun-16	Simon,Fritz	1.5	0	0
Activity Sublet				
No Data Available				
Activity Checklist				
No Data Available				
No Data Available				
Activity Sub Total				
			Activity 15 Sub Total	
			Parts:	0.00
			Labor:	0.00
			Labor Hours:	1.50
			Sublet Parts:	0.00
			Sublet Labor:	0.00
			Activity Sub Total	0.00
Work Order Footer				
			Work Order 27179881 Total	
			Parts:	0.00
			Labor:	0.00
			Labor Hours:	1.50
			Sublet Parts:	0.00
			Sublet Labor:	0.00
			Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 27089570
Invoice No. 55345 - 27089570

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Driver headlight out.		Ford E450 Champion Challenger	
Requested By:	EDITORRES	Status:	40 - Closed (40)
Created By:	EDITORRES	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	34,658 - DH

Chronology		
Reported	May 3, 2016 6:03:20 AM	May 3, 2016 6:03:20 AM
Started	May 3, 2016 12:00:00 AM	
Completed	May 3, 2016 8:11:00 AM	May 3, 2016 8:11:00 AM
Down Time		

Work Order Notes

Line 10 Headlight D

COMPLAINT:

Driver side headlight is out

CAUSE:

Normal wear

CORRECTION:

Replaced driver side headlight bulb.

PARTS:

9008 headlight bulb qty 1

Activity Header						
Activity:5 999 TOTAL VEHICLE						
Activity Note: Personal Risk Assessment						
Reason for Repair: 05 Inspection, Routine						
Work Accomplished: 06 Inspect						
Part Failure:						
Activity Comments:						
Activity Parts						
No Data Available						
Activity Labor						
No Data Available						
Activity Sublet						
No Data Available						
Activity Checklist						
Check List						
5 Desc: Personal Risk Assessment						
Task: PRA and Meter Readings Performed by: EDITORRES Performed on: 03-MAY-16						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		EDITORRES	May 3, 2016 6:08:05 AM	No	
20 - Miles			EDITORRES	May 3, 2016	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
				6:08:05 AM		
30 - Kilometers			EDITORRES	May 3, 2016 6:08:05 AM	No	
40 - Hours			EDITORRES	May 3, 2016 6:08:05 AM	No	
Activity Sub Total						
				Activity 5 Sub Total		
				Parts:		0.00
				Labor:		0.00
				Labor Hours:		0.00
				Sublet Parts:		0.00
				Sublet Labor:		0.00
				Activity Sub Total		0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 27089570
Invoice No. 55345 - 27089570

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Driver headlight out.		Ford E450 Champion Challenger	
Requested By:	EDITORRES	Status:	40 - Closed (40)
Created By:	EDITORRES	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	34,658 - DH

Activity Header
Activity: 15
Activity Note: Driver headlight out.
Reason for Repair: 04 Driver's Report
Work Accomplished:
Part Failure:
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
03-May-16	9008	BULB, HEADLAMP, HALOGEN, 12V	1	5.79	5.79

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
03-May-16	Torres,Edwin	0.4666666	0	0

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available

Activity Sub Total															
<table><tr><th colspan="2">Activity 15 Sub Total</th></tr><tr><td>Parts:</td><td>5.79</td></tr><tr><td>Labor:</td><td>0.00</td></tr><tr><td>Labor Hours:</td><td>0.47</td></tr><tr><td>Sublet Parts:</td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td>5.79</td></tr></table>		Activity 15 Sub Total		Parts:	5.79	Labor:	0.00	Labor Hours:	0.47	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	5.79
Activity 15 Sub Total															
Parts:	5.79														
Labor:	0.00														
Labor Hours:	0.47														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	5.79														

Work Order Footer															
<table><tr><th colspan="2">Work Order 27089570 Total</th></tr><tr><td>Parts:</td><td>5.79</td></tr><tr><td>Labor:</td><td>0.00</td></tr><tr><td>Labor Hours:</td><td>0.47</td></tr><tr><td>Sublet Parts:</td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td>5.79</td></tr></table>		Work Order 27089570 Total		Parts:	5.79	Labor:	0.00	Labor Hours:	0.47	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	5.79
Work Order 27089570 Total															
Parts:	5.79														
Labor:	0.00														
Labor Hours:	0.47														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	5.79														



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 27080455
Invoice No. 55345 - 27080455

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Rear A/C check		Ford E450 Champion Challenger	
Requested By:	FSIMON	Status:	40 - Closed (40)
Created By:	FSIMON	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	34,155 - DH

Chronology		
Reported	Apr 27, 2016 3:04:40 PM	Apr 27, 2016 3:04:40 PM
Started	Apr 27, 2016 12:00:00 AM	
Completed	Apr 28, 2016 7:13:00 AM	Apr 28, 2016 7:13:00 AM
Down Time		

Work Order Notes

Line 10
COMPLAINT:Rear A/C blowing only on high speed

CAUSE:Bad connection

CORRECTION: Electrical circuit repair

Complaint verified
Rear A/C electrical circuit repaired

No part used:

Activity Header						
Activity:5 999 TOTAL VEHICLE						
Activity Note: Personal Risk Assessment						
Reason for Repair: 05 Inspection, Routine						
Work Accomplished: 06 Inspect						
Part Failure:						
Activity Comments:						
Activity Parts						
No Data Available						
Activity Labor						
No Data Available						
Activity Sublet						
No Data Available						
Activity Checklist						
Check List						
5 Desc: Personal Risk Assessment						
Task: PRA and Meter Readings Performed by: FSIMON Performed on: 27-APR-16						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		FSIMON	Apr 27, 2016 3:18:48 PM	No	
20 - Miles			FSIMON	Apr 27, 2016	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
				3:18:48 PM		
30 - Kilometers			FSIMON	Apr 27, 2016 3:18:48 PM	No	
40 - Hours			FSIMON	Apr 27, 2016 3:18:48 PM	No	
Activity Sub Total						
			Activity 5 Sub Total			
			Parts:			0.00
			Labor:			0.00
			Labor Hours:			0.00
			Sublet Parts:			0.00
			Sublet Labor:			0.00
			Activity Sub Total			0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 27080455
Invoice No. 55345 - 27080455

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Rear A/C check		Ford E450 Champion Challenger	
Requested By:	FSIMON	Status:	40 - Closed (40)
Created By:	FSIMON	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	34,155 - DH

Activity Header				
Activity:15 001 AIR CONDITIONING, HEATING AND VENTILATION				
Activity Note:				
Reason for Repair: 04 Driver's Report				
Work Accomplished:				
Part Failure:				
Activity Comments:				
Activity Parts				
No Data Available				
Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
27-Apr-16	Simon,Fritz	2	0	0
Activity Sublet				
No Data Available				
Activity Checklist				
No Data Available				
No Data Available				
Activity Sub Total				
			Activity 15 Sub Total	
			Parts:	0.00
			Labor:	0.00
			Labor Hours:	2.00
			Sublet Parts:	0.00
			Sublet Labor:	0.00
			Activity Sub Total	0.00
Work Order Footer				
			Work Order 27080455 Total	
			Parts:	0.00
			Labor:	0.00
			Labor Hours:	2.00
			Sublet Parts:	0.00
			Sublet Labor:	0.00
			Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 26931023
Invoice No. 55345 - 26931023

Client Department:

Department: 55345M

Work Order Description

PM A

Requested By: HPIERRE

Created By: HPIERRE

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 34,155 - DH

Chronology

Reported	Apr 27, 2016 12:00:00 AM	Apr 27, 2016 12:00:00 AM
Started	Apr 27, 2016 12:00:00 AM	
Completed	Apr 27, 2016 2:13:00 PM	Apr 27, 2016 2:13:00 PM
Down Time		

Work Order Notes

Line 10 COMPLAINT:PMA

CAUSE: preventive maintenance

CORRECTION: perform service,lube pivoting point and cross rotate front tires

Replace both marker lights and air filter complete

Parts # b329 qty 1 oil filter

Marker lights #168 qty 2

Air filter # pa 4075 qty 1

Activity Header

Activity:10 999 TOTAL VEHICLE

Activity Note: Light Medium Duty PMI

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
27-Apr-16	B329	GOING OUT OF SERVICE DO NOT ORDER USE B329 IN THE FLEET ORG FILTER, OIL	1	1.92	1.92

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
27-Apr-16	Pierre,Hubert J	2	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: Light Medium Duty PMI

Task: First Transit Light-Medium Duty PMI Performed by: HPIERRE Performed on: 27-APR-16

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,000 - SECTION 1 Preparation and Drive On (In Lot) Inspection	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
10,100 - Safety Inspection	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
10,110 - FRA Check Drivers Pre-trip or DVIR/EVIR & Authorization Forms	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
10,120 - FRA Check All Warning Lights and Alarms	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
10,130 - FRA Check Automatic Transmission Neutral Start Operation	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
10,140 - Check Service Brakes	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
10,150 - FRA Start Engine and Listen for Any Unusual Noises	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
10,160 - FRA Check Instruments and Horns	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
10,170 - Check Fast Idle	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
10,180 - Check Starter Protection Circuit	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
10,190 - Check Reverse Warning System	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
11,100 - Check Parking Brake	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
11,110 - Check HVAC Switches and Other Controls	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
11,120 - FRA Inspect Windshields, Mirror and Sun Visor Condition	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
11,130 - FRA Check Wiper and Washer Operation	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
11,140 - Road Test: Check for Proper Operation	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
11,150 - Perform Brake Test	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
11,161 - FRA Check/Record Oil Pressure / @1500 rpm	Pounds per Square Inch	N/A	HPIERRE	Apr 27, 2016 1:19:55 PM	No	
11,162 - FRA Check/Record Water Temperature	Degree Fahrenheit	N/A	HPIERRE	Apr 27, 2016 1:19:55 PM	No	
11,170 - FRA Check Door Operation	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
11,180 - FRA Check Operation of All Other Accessories	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
20,000 - SECTION 2 Interior Circle Inspection	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
20,210 - Check Condition of Operator's Area	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
20,220 - Check Accelerator and Brake Pedals	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
20,230 - FRA Check Wiring Under Dash	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
20,240 - FRA Check Interior Lights	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
20,250 - FRA Check Interior Electrical Panels	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
20,260 - Check Stop Request System	-	N/A	HPIERRE	Apr 27, 2016 1:19:55 PM	No	
20,270 - Check Fare Box Mounting (If Applicable)	-	N/A	HPIERRE	Apr 27, 2016 1:19:55 PM	No	
20,280 - Check Seats, Seat Belts, Hand Rails and Floor Covering	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
20,290 - Check for Physical Damage, Water Leaks, and Graffiti	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
22,100 - Check Emergency Windows and Glass Condition	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
22,110 - Check Emergency Hatches	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
22,120 - Check All Safety Equipment	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
30,000 - SECTION 3 Exterior Circle Inspection	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
30,310 - Check Passenger Doors	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
30,320 - Inspect Step-well and Hand Rails	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
30,330 - Check Wheelchair Lift Operation	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
30,340 - FRA Check Destination Sign and Run Box	-	N/A	HPIERRE	Apr 27, 2016 1:19:55 PM	No	
30,350 - FRA Inspect Mirror and Mountings	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
30,360 - Check for Physical Damage and Decals	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
30,370 - Check Wiper Blade and Arm Condition	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
30,380 - Check Exterior Compartment Doors	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
30,390 - FRA Check Fuel Tank Cap	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
33,100 - Check Lights and Reflectors	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
33,110 - Check License Plate, Permits and State Inspection Decals	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
40,000 - SECTION 4 Engine Compartment Inspection	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
40,410 - FRA Check Engine Compartment/Condition for Fire Risk	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
40,420 - Check Hood	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
40,430 - Check Fan, Shroud and Radiator	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
40,440 - Test Coolant System Using Test Strips and Record Results	-	N/A	HPIERRE	Apr 27, 2016 1:19:55 PM	No	
40,441 - Inhibitor Test Pass or Fail (Indicate with a Yes or No)	No	N/A	HPIERRE	Apr 27, 2016 1:19:55 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
40,442 - Freeze Point	Degree Fahrenheit	N/A	HPIERRE	Apr 27, 2016 1:19:55 PM	No	
40,450 - FRA Check Coolant Recovery System Condition & for Leaks	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
40,460 - Record Antifreeze Protection Level Using Refractometer	-	N/A	HPIERRE	Apr 27, 2016 1:19:55 PM	No	
40,461 - Refractometer Reading	Degree Fahrenheit	N/A	HPIERRE	Apr 27, 2016 1:19:55 PM	No	
40,470 - Pressure Test Cooling System and Check for Leaks	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
40,480 - FRA Check Coolant Hose Condition	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
40,490 - FRA Check Alternator Mount and Condition	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
44,100 - FRA Check Fuel Control and Transmission Connections	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
44,110 - FRA Check Master Cylinder Fluid Level	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
44,120 - FRA Check All Belts for Condition, Alignment and Tension	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
44,130 - FRA Check Exhaust System	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
44,140 - FRA Check Intake System	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
44,150 - FRA Inspect Turbocharger	-	N/A	HPIERRE	Apr 27, 2016 1:19:55 PM	No	
44,160 - FRA Inspect Power Steering and Hydraulic Fluid	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
44,170 - FRA Check All Engine or Belt Driven Components	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
44,180 - FRA Check for Leaks	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
44,190 - FRA Perform Battery Inspection	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
44,200 - FRA Check Battery Box Corrosion, Cables and Hold-Downs	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
50,000 - SECTION 5 Steering System Inspection	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
50,510 - Check Entire Steering System	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
60,000 - SECTION 6 Tires and Wheel Inspection	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
60,610 - FRA Check and Record Air Pressure	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
60,611 - Air Pressure RF	65 Pounds per Square Inch		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
60,612 - Air Pressure LF	65 Pounds per Square Inch		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
60,613 - Air Pressure RRO	70 Pounds per Square Inch		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
60,614 - Air Pressure RRI	70 Pounds per Square Inch		HPIERRE	Apr 27, 2016 1:19:55 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
60,615 - Air Pressure LRI	70 Pounds per Square Inch		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
60,616 - Air Pressure LRO	70 Pounds per Square Inch		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
60,620 - Check Valve Stems and Caps	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
60,630 - Check and Record Tread Depth	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
60,631 - Tread Depth RF	10 32nds of an inch		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
60,632 - Tread Depth LF	10 32nds of an inch		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
60,633 - Tread Depth RRO	7 32nds of an inch		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
60,634 - Tread Depth RRI	7 32nds of an inch		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
60,635 - Tread Depth LRI	7 32nds of an inch		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
60,636 - Tread Depth LRO	7 32nds of an inch		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
60,640 - Check for Mismatched Tread or Casing Design	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
60,650 - Check Sidewall Wear	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
60,660 - Inspect for Cuts and Tears	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
60,670 - Check Dual Mating With Square	-	N/A	HPIERRE	Apr 27, 2016 1:19:55 PM	No	
60,680 - Check Wheels for Cracks and Loose Lugs	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
60,690 - Check Tires for Irregular or Alignment Wear	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
66,100 - FRA Check Outer Hubs for Leaks	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
70,000 - SECTION 7 Under Vehicle Inspection	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
70,710 - Check Vibration Damper	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
70,720 - Check Engine and Transmission Mounts	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
70,730 - FRA Check Starter	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
70,740 - FRA Check Bottom of Engine for Fluid Leaks	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
70,750 - FRA Check Transmission for Leaks	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
70,760 - FRA Check Differential Breather and Fluid	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
70,770 - FRA Check Exhaust System	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
70,780 - Check Driveline, U-joint and Slip Yokes	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
70,790 - Check All Body Mounts and Chassis Frame	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
77,100 - FRA Check Security, Integrity and Length of Ground Straps	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
77,110 - FRA Check Fuel Tank	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
77,120 - Check Suspension Components	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
77,130 - FRA Check Brake Pad Thickness and Rotor for Wear	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
77,131 - Brake Pad Thickness LF	10 Inch		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
77,132 - Brake Pad Thickness RF	10 Inch		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
77,133 - Brake Pad Thickness LR	7 Inch		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
77,134 - Brake Pad Thickness RR	7 Inch		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
77,135 - Brake Rotor LF	1.8 Inch		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
77,136 - Brake Rotor RF	1.8 Inch		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
77,137 - Brake Rotor LR	1.6 Inch		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
77,138 - Brake Rotor RR	1.6 Inch		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
77,140 - FRA Check Brake Hoses	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
77,150 - Check King Pins	-	N/A	HPIERRE	Apr 27, 2016 1:19:55 PM	No	
77,160 - FRA Check for Loose or Noisy Wheel Bearings	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
80,000 - SECTION 8 PMI Report Completion	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
80,810 - Completion of PMI Report	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
90,000 - SECTION 9 Completion of PMI	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	
90,910 - Vehicle Returned to predetermined location	Done		HPIERRE	Apr 27, 2016 1:19:55 PM	No	

Activity Sub Total

Activity 10 Sub Total	
Parts:	1.92
Labor:	0.00
Labor Hours:	2.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	1.92



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 26931023
Invoice No. 55345 - 26931023

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
PM A		Ford E450 Champion Challenger	
Requested By:	HPIERRE	Status:	40 - Closed (40)
Created By:	HPIERRE	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	34,155 - DH

Activity Header
Activity:20 999 TOTAL VEHICLE
Activity Note: PM A
Reason for Repair: 08 Preventive Maintenance
Work Accomplished: A PM Level A
Part Failure:
Activity Comments:

Activity Parts						
Booked Date	Part Number	Part Description	Quantity	Each	Extended	
27-Apr-16	PA4075	OUT OF SERVICE DO NOT ORDER FILTER, AIR, PAPER SAME AS AF25590	1	5.18	5.18	

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
27-Apr-16	Pierre,Hubert J	0.4166666	0	0

Activity Sublet
No Data Available

Activity Checklist						
Check List						
20 Desc: PM A						
Task: PM A SERVICE Performed by: HPIERRE Performed on: 27-APR-16						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
100,000 - "A" PMI SERVICING ITEMS	Done		HPIERRE	Apr 27, 2016 1:26:17 PM	No	
101,000 - FRA Change Oil Filters	Yes		HPIERRE	Apr 27, 2016 1:26:17 PM	No	
102,000 - FRA Drain Engine Oil	Yes		HPIERRE	Apr 27, 2016 1:26:17 PM	No	
103,000 - FRA Check Transmission Fluid	Done		HPIERRE	Apr 27, 2016 1:26:17 PM	No	
104,000 - Lubricate Chassis	Done		HPIERRE	Apr 27, 2016 1:26:17 PM	No	
105,000 - Replace or Clean A/C Filters	Done		HPIERRE	Apr 27, 2016 1:26:17 PM	No	
107,000 - FRA Change Primary Fuel Filter	No	N/A	HPIERRE	Apr 27, 2016 1:26:17 PM	No	
108,000 - Lube all pivoting Mechanisms	Done		HPIERRE	Apr 27, 2016 1:26:17 PM	No	

Activity Sub Total

Activity 20 Sub Total	
Parts:	5.18
Labor:	0.00
Labor Hours:	0.42
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	5.18



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 26931023
Invoice No. 55345 - 26931023

Client Department:

Department: 55345M

Work Order Description

PM A

Requested By: HPIERRE

Created By: HPIERRE

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 34,155 - DH

Activity Header

Activity: 30 999 TOTAL VEHICLE

Activity Note: PRAMETER

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
27-Apr-16	168	BULB, WEDGE, 12V/3CP	3	0.23	0.69

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
27-Apr-16	Pierre,Hubert J	0.0833333	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

30 Desc: PRAMETER

Task: PRA and Meter Readings Performed by: HPIERRE Performed on: 27-APR-16

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		HPIERRE	Apr 27, 2016 1:26:39 PM	No	
20 - Miles			HPIERRE	Apr 27, 2016 1:26:39 PM	No	
30 - Kilometers			HPIERRE	Apr 27, 2016 1:26:39 PM	No	
40 - Hours			HPIERRE	Apr 27, 2016 1:26:39 PM	No	

Activity Sub Total

Activity 30 Sub Total

Parts:	0.69
Labor:	0.00
Labor Hours:	0.08
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.69

Work Order Footer

Work Order 26931023 Total

Parts:	7.79
--------	------

	Labor:	0.00
	Labor Hours:	2.50
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	7.79



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 27064964
Invoice No. 55345 - 27064964

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Missing both extension seat belts.		Ford E450 Champion Challenger	
Requested By:	EDITORRES	Status:	40 - Closed (40)
Created By:	EDITORRES	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	33,071 - DH

Chronology		
Reported	Apr 20, 2016 6:34:25 AM	Apr 20, 2016 6:34:25 AM
Started	Apr 20, 2016 12:00:00 AM	
Completed	Apr 20, 2016 8:18:00 AM	Apr 20, 2016 8:18:00 AM
Down Time		

Work Order Notes

Line 10
COMPLAINT:
Vehicle missing seatbelt extensions.

CAUSE:
Previous driver must have lost it.

CORRECTION:
Placed 2 new seatbelt extension.

Parts Q5-6340-24-INT qty 2 seatbelt extension

Activity Header						
Activity:5 999 TOTAL VEHICLE						
Activity Note: Personal Risk Assessment						
Reason for Repair: 05 Inspection, Routine						
Work Accomplished: 06 Inspect						
Part Failure:						
Activity Comments:						
Activity Parts						
No Data Available						
Activity Labor						
No Data Available						
Activity Sublet						
No Data Available						
Activity Checklist						
Check List						
5 Desc: Personal Risk Assessment						
Task: PRA and Meter Readings Performed by: EDITORRES Performed on: 20-APR-16						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		EDITORRES	Apr 20, 2016 6:45:05 AM	No	
20 - Miles			EDITORRES	Apr 20, 2016 6:45:05 AM	No	
30 - Kilometers			EDITORRES	Apr 20, 2016 6:45:05 AM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO	
40 - Hours			EDITORRES	Apr 20, 2016 6:45:05 AM	No		
Activity Sub Total							
				Activity 5 Sub Total			
				Parts:			0.00
				Labor:			0.00
				Labor Hours:			0.00
				Sublet Parts:			0.00
				Sublet Labor:			0.00
				Activity Sub Total			0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 27064964
Invoice No. 55345 - 27064964

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Missing both extension seat belts.		Ford E450 Champion Challenger	
Requested By:	EDITORRES	Status:	40 - Closed (40)
Created By:	EDITORRES	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	33,071 - DH

Activity Header
Activity: 15 050 GROUP, ACCESSORIES
Activity Note: Missing both seat belt extensions.
Reason for Repair: 41 Abuse of Equipment - 56210
Work Accomplished:
Part Failure:
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
20-Apr-16	Q5-6340-24-INT	EXTENSION	2	20.64	41.28

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
20-Apr-16	Torres, Edwin	0.45	0	0

Activity Sublet
No Data Available


Activity Checklist
No Data Available
No Data Available

Activity Sub Total		Activity 15 Sub Total	
Parts:	41.28	Labor:	0.00
Labor Hours:	0.45	Labor Parts:	0.00
Sublet Parts:	0.00	Sublet Labor:	0.00
Sublet Labor:	0.00	Activity Sub Total	41.28

Work Order Footer		Work Order 27064964 Total	
Parts:	41.28	Labor:	0.00
Labor Hours:	0.45	Labor Parts:	0.00
Sublet Parts:	0.00	Sublet Labor:	0.00
Sublet Labor:	0.00	Activity Sub Total	41.28



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 27050685
Invoice No. 55345 - 27050685

Client Department:

Department: 55345M

Work Order Description

Hood has a dent.

Requested By: EDITORRES

Created By: EDITORRES

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 32,949 - DH

Chronology

Reported	Apr 14, 2016 6:43:17 AM	Apr 14, 2016 6:43:17 AM
Started	Apr 14, 2016 12:00:00 AM	
Completed	Apr 14, 2016 7:45:00 AM	Apr 14, 2016 7:45:00 AM
Down Time		

Work Order Notes

Line 10

COMPLAINT:

Hood has a dent.

CAUSE:

Driver hit a gate arm.

CORRECTION:

Removed Hood from vehicle and sent it to national collision for repair and paint.

We received hood back from national collision, paint is a match, dent has been repaired. Installed hood back on vehicle and placed vehicle back in service.

No parts used.

Activity Header

Activity: 5 999 TOTAL VEHICLE

Activity Note: Personal Risk Assessment

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: Personal Risk Assessment

Task: PRA and Meter Readings Performed by: EDITORRES Performed on: 14-APR-16

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		EDITORRES	Apr 14, 2016 6:50:23 AM	No	
20 - Miles			EDITORRES	Apr 14, 2016 6:50:23 AM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO	
30 - Kilometers			EDITORRES	Apr 14, 2016 6:50:23 AM	No		
40 - Hours			EDITORRES	Apr 14, 2016 6:50:23 AM	No		
Activity Sub Total				Activity 5 Sub Total			
				Parts:			0.00
				Labor:			0.00
				Labor Hours:			0.00
				Sublet Parts:			0.00
				Sublet Labor:			0.00
				Activity Sub Total			0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 27050685
Invoice No. 55345 - 27050685

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Hood has a dent.		Ford E450 Champion Challenger	
Requested By:	EDITORRES	Status:	40 - Closed (40)
Created By:	EDITORRES	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	32,949 - DH

Activity Header
Activity:15 174 BODY, BUS
Activity Note: Hood has a dent.
Reason for Repair: 41 Abuse of Equipment - 56210
Work Accomplished:
Part Failure:
Activity Comments:

Activity Parts
No Data Available

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
14-Apr-16	Torres,Edwin	2	0	0

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available

Activity Sub Total															
<table><tr><th colspan="2">Activity 15 Sub Total</th></tr><tr><td>Parts:</td><td>0.00</td></tr><tr><td>Labor:</td><td>0.00</td></tr><tr><td>Labor Hours:</td><td>2.00</td></tr><tr><td>Sublet Parts:</td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td>0.00</td></tr></table>	Activity 15 Sub Total		Parts:	0.00	Labor:	0.00	Labor Hours:	2.00	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	0.00	
Activity 15 Sub Total															
Parts:	0.00														
Labor:	0.00														
Labor Hours:	2.00														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	0.00														

Work Order Footer															
<table><tr><th colspan="2">Work Order 27050685 Total</th></tr><tr><td>Parts:</td><td>0.00</td></tr><tr><td>Labor:</td><td>0.00</td></tr><tr><td>Labor Hours:</td><td>2.00</td></tr><tr><td>Sublet Parts:</td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td>0.00</td></tr></table>	Work Order 27050685 Total		Parts:	0.00	Labor:	0.00	Labor Hours:	2.00	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	0.00	
Work Order 27050685 Total															
Parts:	0.00														
Labor:	0.00														
Labor Hours:	2.00														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	0.00														



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 27029761
Invoice No. 55345 - 27029761

Client Department:

Department: 55345M

Work Order Description

Rear bumper insulator came out of place

Requested By: DARTHURS

Created By: DARTHURS

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 31,391 - DH

Chronology

Reported	Mar 31, 2016 6:11:45 PM	Mar 31, 2016 6:11:45 PM
Started	Mar 31, 2016 12:00:00 AM	
Completed	Mar 31, 2016 7:20:00 PM	Mar 31, 2016 7:20:00 PM
Down Time		

Work Order Notes

Line 10

COMPLAINT Rear bumper rubber shift out of place:

CAUSE: Driver Complaint

CORRECTION: secure bumper rubber with screws,

Activity Header

Activity: 5 999 TOTAL VEHICLE

Activity Note: Personal Risk Assessment

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
31-Mar-16	Arthurs,Durvin	0.0833333	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: Personal Risk Assessment

Task: PRA and Meter Readings Performed by: DARTHURS Performed on: 31-MAR-16

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		DARTHURS	Mar 31, 2016 7:18:58 PM	No	
20 - Miles			DARTHURS	Mar 31, 2016 7:18:58 PM	No	
30 - Kilometers			DARTHURS	Mar 31, 2016 7:18:58 PM	No	
40 - Hours			DARTHURS	Mar 31, 2016	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO	
				7:18:58 PM			
Activity Sub Total				Activity 5 Sub Total			
				Parts:		0.00	
				Labor:		0.00	
				Labor Hours:		0.08	
				Sublet Parts:		0.00	
				Sublet Labor:		0.00	
				Activity Sub Total		0.00	



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 27029761
Invoice No. 55345 - 27029761

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FD4E4FS7EDB17176
Rear bumper insulator came out of place		Ford E450 Champion Challenger	
Requested By:	DARTHURS	Status:	40 - Closed (40)
Created By:	DARTHURS	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	31,391 - DH

Activity Header
Activity:15 079 DEVICES, SAFETY/STABILITY, TRAILER
Activity Note: Rear bumper
Reason for Repair: 05 Inspection, Routine
Work Accomplished:
Part Failure:
Activity Comments:

Activity Parts
No Data Available

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
31-Mar-16	Arthurs,Durvin	1	0	0

Activity Sublet
No Data Available


Activity Checklist
No Data Available
No Data Available

Activity Sub Total		Activity 15 Sub Total	
Parts:			0.00
Labor:			0.00
Labor Hours:			1.00
Sublet Parts:			0.00
Sublet Labor:			0.00
Activity Sub Total			0.00

Work Order Footer		Work Order 27029761 Total	
Parts:			0.00
Labor:			0.00
Labor Hours:			1.08
Sublet Parts:			0.00
Sublet Labor:			0.00
Activity Sub Total			0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 26790027
Invoice No. 55345 - 26790027

Client Department:

Department: 55345M

Work Order Description

PM A

Requested By: DCARTER

Created By: DCARTER

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 29,560 - DH

Chronology

Reported	Feb 26, 2016 10:01:21 AM	Feb 26, 2016 10:01:21 AM
Started	Feb 29, 2016 12:00:00 AM	
Completed	Feb 29, 2016 3:15:00 PM	Feb 29, 2016 3:15:00 PM
Down Time		

Work Order Notes

Line 10 COMPLAINT: PMA

CAUSE:regular maintenance

CORRECTION: perform service,lube all pivoted point rotates all tires completed

Parts # oil filter B329 qty1

Oil#5w20 qt 6

Activity Header

Activity:10 999 TOTAL VEHICLE

Activity Note: Light Medium Duty PMI

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
29-Feb-16	B329	GOING OUT OF SERVICE DO NOT ORDER USE B329 IN THE FLEET ORG FILTER, OIL	1	1.92	1.92

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
29-Feb-16	Pierre,Hubert J	2	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: Light Medium Duty PMI

Task: First Transit Light-Medium Duty PMI Performed by: HPIERRE Performed on: 29-FEB-16

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,000 - SECTION 1 Preparation and Drive On (In Lot) Inspection	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
10,100 - Safety Inspection	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,110 - FRA Check Drivers Pre-trip or DVIR/EVIR & Authorization Forms	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
10,120 - FRA Check All Warning Lights and Alarms	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
10,130 - FRA Check Automatic Transmission Neutral Start Operation	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
10,140 - Check Service Brakes	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
10,150 - FRA Start Engine and Listen for Any Unusual Noises	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
10,160 - FRA Check Instruments and Horns	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
10,170 - Check Fast Idle	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
10,180 - Check Starter Protection Circuit	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
10,190 - Check Reverse Warning System	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
11,100 - Check Parking Brake	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
11,110 - Check HVAC Switches and Other Controls	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
11,120 - FRA Inspect Windshields, Mirror and Sun Visor Condition	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
11,130 - FRA Check Wiper and Washer Operation	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
11,140 - Road Test: Check for Proper Operation	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
11,150 - Perform Brake Test	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
11,161 - FRA Check/Record Oil Pressure / @1500 rpm	0 Pounds per Square Inch	N/A	HPIERRE	Feb 29, 2016 2:45:05 PM	No	
11,162 - FRA Check/Record Water Temperature	0 Degree Fahrenheit	N/A	HPIERRE	Feb 29, 2016 2:45:05 PM	No	
11,170 - FRA Check Door Operation	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
11,180 - FRA Check Operation of All Other Accessories	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
20,000 - SECTION 2 Interior Circle Inspection	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
20,210 - Check Condition of Operator's Area	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
20,220 - Check Accelerator and Brake Pedals	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
20,230 - FRA Check Wiring Under Dash	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
20,240 - FRA Check Interior Lights	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
20,250 - FRA Check Interior Electrical Panels	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
20,260 - Check Stop Request System	-	N/A	HPIERRE	Feb 29, 2016 2:45:05 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
20,270 - Check Fare Box Mounting (If Applicable)	-	N/A	HPIERRE	Feb 29, 2016 2:45:05 PM	No	
20,280 - Check Seats, Seat Belts, Hand Rails and Floor Covering	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
20,290 - Check for Physical Damage, Water Leaks, and Graffiti	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
22,100 - Check Emergency Windows and Glass Condition	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
22,110 - Check Emergency Hatches	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
22,120 - Check All Safety Equipment	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
30,000 - SECTION 3 Exterior Circle Inspection	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
30,310 - Check Passenger Doors	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
30,320 - Inspect Step-well and Hand Rails	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
30,330 - Check Wheelchair Lift Operation	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
30,340 - FRA Check Destination Sign and Run Box	-	N/A	HPIERRE	Feb 29, 2016 2:45:05 PM	No	
30,350 - FRA Inspect Mirror and Mountings	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
30,360 - Check for Physical Damage and Decals	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
30,370 - Check Wiper Blade and Arm Condition	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
30,380 - Check Exterior Compartment Doors	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
30,390 - FRA Check Fuel Tank Cap	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
33,100 - Check Lights and Reflectors	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
33,110 - Check License Plate, Permits and State Inspection Decals	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
40,000 - SECTION 4 Engine Compartment Inspection	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
40,410 - FRA Check Engine Compartment/Condition for Fire Risk	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
40,420 - Check Hood	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
40,430 - Check Fan, Shroud and Radiator	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
40,440 - Test Coolant System Using Test Strips and Record Results	-	N/A	HPIERRE	Feb 29, 2016 2:45:05 PM	No	
40,441 - Inhibitor Test Pass or Fail (Indicate with a Yes or No)	No	N/A	HPIERRE	Feb 29, 2016 2:45:05 PM	No	
40,442 - Freeze Point	Degree Fahrenheit	N/A	HPIERRE	Feb 29, 2016 2:45:05 PM	No	
40,450 - FRA Check Coolant Recovery System Condition & for Leaks	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
40,460 - Record Antifreeze Protection Level Using Refractometer	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
40,461 - Refractometer Reading	Degree Fahrenheit	N/A	HPIERRE	Feb 29, 2016 2:45:05 PM	No	
40,470 - Pressure Test Cooling System and Check for Leaks	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
40,480 - FRA Check Coolant Hose Condition	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
40,490 - FRA Check Alternator Mount and Condition	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
44,100 - FRA Check Fuel Control and Transmission Connections	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
44,110 - FRA Check Master Cylinder Fluid Level	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
44,120 - FRA Check All Belts for Condition, Alignment and Tension	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
44,130 - FRA Check Exhaust System	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
44,140 - FRA Check Intake System	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
44,150 - FRA Inspect Turbocharger	-	N/A	HPIERRE	Feb 29, 2016 2:45:05 PM	No	
44,160 - FRA Inspect Power Steering and Hydraulic Fluid	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
44,170 - FRA Check All Engine or Belt Driven Components	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
44,180 - FRA Check for Leaks	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
44,190 - FRA Perform Battery Inspection	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
44,200 - FRA Check Battery Box Corrosion, Cables and Hold-Downs	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
50,000 - SECTION 5 Steering System Inspection	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
50,510 - Check Entire Steering System	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
60,000 - SECTION 6 Tires and Wheel Inspection	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
60,610 - FRA Check and Record Air Pressure	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
60,611 - Air Pressure RF	65 Pounds per Square Inch		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
60,612 - Air Pressure LF	65 Pounds per Square Inch		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
60,613 - Air Pressure RRO	70 Pounds per Square Inch		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
60,614 - Air Pressure RRI	70 Pounds per Square Inch		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
60,615 - Air Pressure LRI	70 Pounds per Square Inch		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
60,616 - Air Pressure LRO	70 Pounds per Square Inch		HPIERRE	Feb 29, 2016 2:45:05 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
60,620 - Check Valve Stems and Caps	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
60,630 - Check and Record Tread Depth	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
60,631 - Tread Depth RF	6 32nds of an inch		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
60,632 - Tread Depth LF	6 32nds of an inch		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
60,633 - Tread Depth RRO	10 32nds of an inch		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
60,634 - Tread Depth RRI	10 32nds of an inch		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
60,635 - Tread Depth LRI	10 32nds of an inch		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
60,636 - Tread Depth LRO	10 32nds of an inch		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
60,640 - Check for Mismatched Tread or Casing Design	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
60,650 - Check Sidewall Wear	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
60,660 - Inspect for Cuts and Tears	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
60,670 - Check Dual Mating With Square	-	N/A	HPIERRE	Feb 29, 2016 2:45:05 PM	No	
60,680 - Check Wheels for Cracks and Loose Lugs	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
60,690 - Check Tires for Irregular or Alignment Wear	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
66,100 - FRA Check Outer Hubs for Leaks	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
70,000 - SECTION 7 Under Vehicle Inspection	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
70,710 - Check Vibration Damper	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
70,720 - Check Engine and Transmission Mounts	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
70,730 - FRA Check Starter	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
70,740 - FRA Check Bottom of Engine for Fluid Leaks	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
70,750 - FRA Check Transmission for Leaks	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
70,760 - FRA Check Differential Breather and Fluid	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
70,770 - FRA Check Exhaust System	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
70,780 - Check Driveline, U-joint and Slip Yokes	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
70,790 - Check All Body Mounts and Chassis Frame	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
77,100 - FRA Check Security, Integrity and Length of Ground Straps	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
77,110 - FRA Check Fuel Tank	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
77,120 - Check Suspension Components	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
77,130 - FRA Check Brake Pad Thickness and Rotor for Wear	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
77,131 - Brake Pad Thickness LF	5 Inch		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
77,132 - Brake Pad Thickness RF	5 Inch	need front brake	HPIERRE	Feb 29, 2016 2:45:05 PM	No	
77,133 - Brake Pad Thickness LR	4 Inch		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
77,134 - Brake Pad Thickness RR	4 Inch		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
77,135 - Brake Rotor LF	42 Inch		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
77,136 - Brake Rotor RF	42 Inch		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
77,137 - Brake Rotor LR	40 Inch		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
77,138 - Brake Rotor RR	40 Inch		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
77,140 - FRA Check Brake Hoses	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
77,150 - Check King Pins	-	N/A	HPIERRE	Feb 29, 2016 2:45:05 PM	No	
77,160 - FRA Check for Loose or Noisy Wheel Bearings	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
80,000 - SECTION 8 PMI Report Completion	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
80,810 - Completion of PMI Report	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
90,000 - SECTION 9 Completion of PMI	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	
90,910 - Vehicle Returned to predetermined location	Done		HPIERRE	Feb 29, 2016 2:45:05 PM	No	

Activity Sub Total

Activity 10 Sub Total	
Parts:	1.92
Labor:	0.00
Labor Hours:	2.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	1.92



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 26790027
Invoice No. 55345 - 26790027

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
PM A		Ford E450 Champion Challenger	
Requested By:	DCARTER	Status:	40 - Closed (40)
Created By:	DCARTER	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	29,560 - DH

Activity Header
Activity:20 999 TOTAL VEHICLE
Activity Note: PM A
Reason for Repair: 08 Preventive Maintenance
Work Accomplished: A PM Level A
Part Failure:
Activity Comments:

Activity Parts
No Data Available

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
29-Feb-16	Pierre,Hubert J	0.4166666	0	0

Activity Sublet
No Data Available


Activity Checklist						
Check List						
20 Desc: PM A						
Task: PM A SERVICE Performed by: HPIERRE Performed on: 29-FEB-16						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
100,000 - "A" PMI SERVICING ITEMS	Done		HPIERRE	Feb 29, 2016 2:45:43 PM	No	
101,000 - FRA Change Oil Filters	Yes		HPIERRE	Feb 29, 2016 2:45:43 PM	No	
102,000 - FRA Drain Engine Oil	Yes		HPIERRE	Feb 29, 2016 2:45:43 PM	No	
103,000 - FRA Check Transmission Fluid	Done		HPIERRE	Feb 29, 2016 2:45:43 PM	No	
104,000 - Lubricate Chassis	Done		HPIERRE	Feb 29, 2016 2:45:43 PM	No	
105,000 - Replace or Clean A/C Filters	Done		HPIERRE	Feb 29, 2016 2:45:43 PM	No	
107,000 - FRA Change Primary Fuel Filter	No	N/A	HPIERRE	Feb 29, 2016 2:45:43 PM	No	
108,000 - Lube all pivoting Mechanisms	Done		HPIERRE	Feb 29, 2016 2:45:43 PM	No	

Activity Sub Total		Activity 20 Sub Total	
Parts:			0.00
Labor:			0.00

	Labor Hours:	0.42
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 26790027
Invoice No. 55345 - 26790027

Client Department:

Department: 55345M

Work Order Description

PM A

Requested By: DCARTER

Created By: DCARTER

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 29,560 - DH

Activity Header

Activity: 30 999 TOTAL VEHICLE

Activity Note: PRAMETER

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
29-Feb-16	Pierre,Hubert J	0.0833333	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

30 Desc: PRAMETER

Task: PRA and Meter Readings Performed by: HPIERRE Performed on: 29-FEB-16

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		HPIERRE	Feb 29, 2016 2:46:10 PM	No	
20 - Miles			HPIERRE	Feb 29, 2016 2:46:10 PM	No	
30 - Kilometers			HPIERRE	Feb 29, 2016 2:46:10 PM	No	
40 - Hours			HPIERRE	Feb 29, 2016 2:46:10 PM	No	

Activity Sub Total

Activity 30 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	0.08
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00

Work Order Footer

Work Order 26790027 Total

Parts:	1.92
Labor:	0.00
Labor Hours:	2.50

	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	1.92



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 26930995
Invoice No. 55345 - 26930995

Client Department:

Department: 55345M

Work Order Description

PMA follow up----->need air filter , front and rear brakes

Requested By: HPIERRE

Created By: HPIERRE

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 29,560 - DH

Chronology

Reported	Feb 29, 2016 2:49:45 PM	Feb 29, 2016 2:49:45 PM
Started	Feb 29, 2016 12:00:00 AM	
Completed	Feb 29, 2016 3:14:00 PM	Feb 29, 2016 3:14:00 PM
Down Time		

Work Order Notes

Line 10

COMPLAINT: follow up on a PMA bus need front brakes rear brake and air filter

CAUSE:front brake and rear brake are below spect,air filter was dirty

Parts # front brake pads brsd-1328 qty 1

Rear #. Rear brake pads brsd-1330 qty 1

Air filter# pa 4075 qty 1

CORRECTION: replace front and rear brakes pads , replace air filter also completed

Activity Header

Activity:5 999 TOTAL VEHICLE

Activity Note: Personal Risk Assessment

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
29-Feb-16	BRSD-1328	PADS, BRAKE, DISC, FRONT	1	50.32	50.32

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
29-Feb-16	Pierre,Hubert J	0.0833333	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: Personal Risk Assessment

Task: PRA and Meter Readings Performed by: HPIERRE Performed on: 29-FEB-16

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		HPIERRE	Feb 29, 2016 2:54:47 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
20 - Miles			HPIERRE	Feb 29, 2016 2:54:47 PM	No	
30 - Kilometers			HPIERRE	Feb 29, 2016 2:54:47 PM	No	
40 - Hours			HPIERRE	Feb 29, 2016 2:54:47 PM	No	

Activity Sub Total

Activity 5 Sub Total	
Parts:	50.32
Labor:	0.00
Labor Hours:	0.08
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	50.32



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 26930995
Invoice No. 55345 - 26930995

Client Department:

Department: 55345M

Work Order Description

PMA follow up----->need air filter , front and rear brakes

Requested By: HPIERRE

Created By: HPIERRE

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 29,560 - DH

Activity Header

Activity: 15 079 DEVICES, SAFETY/STABILITY, TRAILER

Activity Note:

Reason for Repair: 08 Preventive Maintenance

Work Accomplished:

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
29-Feb-16	PA4075	OUT OF SERVICE DO NOT ORDER FILTER, AIR, PAPER SAME AS AF25590	1	5.18	5.18
29-Feb-16	BRSD-1330	PADS, BRAKE, DISC, REAR, FORD SAME AS PFH133020	1	43.15	43.15

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
29-Feb-16	Pierre,Hubert J	4.4166666	0	0

Activity Sublet

No Data Available

Activity Checklist

No Data Available

No Data Available

Activity Sub Total

Activity 15 Sub Total

Parts:	48.33
Labor:	0.00
Labor Hours:	4.42
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	48.33

Work Order Footer

Work Order 26930995 Total

Parts:	98.65
Labor:	0.00
Labor Hours:	4.50
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	98.65



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 26924576
Invoice No. 55345 - 26924576

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Camera red panic button not glowing		Ford E450 Champion Challenger	
Requested By:	FSIMON	Status:	40 - Closed (40)
Created By:	FSIMON	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	29,117 - DH

Chronology		
Reported	Feb 24, 2016 11:47:02 AM	Feb 24, 2016 11:47:02 AM
Started	Feb 26, 2016 12:00:00 AM	
Completed	Feb 26, 2016 7:56:00 AM	Feb 26, 2016 7:56:00 AM
Down Time		

Work Order Notes

Line 10
COMPLAINT: Camera Panic button not glowing

CAUSE: Dirty cartridge

CORRECTION: Cleaning cartridge

Complaint verified
Camera cartridge cleaned
Panic button working ok

No part used

Activity Header						
Activity: 5 999 TOTAL VEHICLE						
Activity Note: Personal Risk Assessment						
Reason for Repair: 05 Inspection, Routine						
Work Accomplished: 06 Inspect						
Part Failure:						
Activity Comments:						
Activity Parts						
No Data Available						
Activity Labor						
No Data Available						
Activity Sublet						
No Data Available						
Activity Checklist						
Check List						
5 Desc: Personal Risk Assessment						
Task: PRA and Meter Readings Performed by: FSIMON Performed on: 26-FEB-16						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		FSIMON	Feb 26, 2016 7:28:01 AM	No	
20 - Miles			FSIMON	Feb 26, 2016	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
				7:28:01 AM		
30 - Kilometers			FSIMON	Feb 26, 2016 7:28:01 AM	No	
40 - Hours			FSIMON	Feb 26, 2016 7:28:01 AM	No	
Activity Sub Total						
			Activity 5 Sub Total			
			Parts:			0.00
			Labor:			0.00
			Labor Hours:			0.00
			Sublet Parts:			0.00
			Sublet Labor:			0.00
			Activity Sub Total			0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 26924576
Invoice No. 55345 - 26924576

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Camera red panic button not glowing		Ford E450 Champion Challenger	
Requested By:	FSIMON	Status:	40 - Closed (40)
Created By:	FSIMON	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	29,117 - DH

Activity Header
Activity:15 174 BODY, BUS
Activity Note:
Reason for Repair: 04 Driver's Report
Work Accomplished:
Part Failure:
Activity Comments:

Activity Parts
No Data Available

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
26-Feb-16	Simon,Fritz	1	0	0

Activity Sublet
No Data Available


Activity Checklist
No Data Available
No Data Available

Activity Sub Total		Activity 15 Sub Total	
		Parts:	0.00
		Labor:	0.00
		Labor Hours:	1.00
		Sublet Parts:	0.00
		Sublet Labor:	0.00
		Activity Sub Total	0.00

Work Order Footer		Work Order 26924576 Total	
		Parts:	0.00
		Labor:	0.00
		Labor Hours:	1.00
		Sublet Parts:	0.00
		Sublet Labor:	0.00
		Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 26845404
Invoice No. 55345 - 26845404

Client Department:

Department: 55345M

Work Order Description

REPLACE WHEEL CHAIR SECUREMENT BAG

Requested By: AOWENS

Created By: AOWENS

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 25,295 - DH

Chronology

Reported	Jan 19, 2016 10:06:15 PM	Jan 19, 2016 10:06:15 PM
Started	Jan 19, 2016 12:00:00 AM	
Completed	Jan 19, 2016 10:41:00 PM	Jan 19, 2016 10:41:00 PM
Down Time		

Work Order Notes

Line 10 Have you completed a satisfactory Personal Risk Assessment? Yes() No ().

If the answer is NO stop what you are doing, complete an IP Safety Contact Slip and see your supervisor for further instructions.

=====

COMPLAINT: check wheel chair bag

CAUSE:one bag ripped

CORRECTION: replace wheelchair bag completed

Activity Header

Activity:5 999 TOTAL VEHICLE

Activity Note: Personal Risk Assessment

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
19-Jan-16	Pierre,Hubert J	5	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: Personal Risk Assessment

Task: PRA and Meter Readings Performed by: HPIERRE Performed on: 19-JAN-16

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		HPIERRE	Jan 19, 2016 10:24:17 PM	No	
20 - Miles			HPIERRE	Jan 19, 2016	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
				10:24:17 PM		
30 - Kilometers			HPIERRE	Jan 19, 2016 10:24:17 PM	No	
40 - Hours			HPIERRE	Jan 19, 2016 10:24:17 PM	No	
Activity Sub Total						
				Activity 5 Sub Total		
				Parts:		0.00
				Labor:		0.00
				Labor Hours:		5.00
				Sublet Parts:		0.00
				Sublet Labor:		0.00
				Activity Sub Total		0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 26845404
Invoice No. 55345 - 26845404

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
REPLACE WHEEL CHAIR SECUREMENT BAG		Ford E450 Champion Challenger	
Requested By:	AOWENS	Status:	40 - Closed (40)
Created By:	AOWENS	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	25,295 - DH

Activity Header
Activity: 15 056 POWER TAKE OFF
Activity Note: REPLACE WHEEL CHAIR SECUREMENT BAG
Reason for Repair: 05 Inspection, Routine
Work Accomplished:
Part Failure:
Activity Comments:

Activity Parts
No Data Available

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
19-Jan-16	Pierre,Hubert J	0.75	0	0

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available

Activity Sub Total															
<table><tr><th colspan="2">Activity 15 Sub Total</th></tr><tr><td>Parts:</td><td>0.00</td></tr><tr><td>Labor:</td><td>0.00</td></tr><tr><td>Labor Hours:</td><td>0.75</td></tr><tr><td>Sublet Parts:</td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td>0.00</td></tr></table>	Activity 15 Sub Total		Parts:	0.00	Labor:	0.00	Labor Hours:	0.75	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	0.00	
Activity 15 Sub Total															
Parts:	0.00														
Labor:	0.00														
Labor Hours:	0.75														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	0.00														

Work Order Footer															
<table><tr><th colspan="2">Work Order 26845404 Total</th></tr><tr><td>Parts:</td><td>0.00</td></tr><tr><td>Labor:</td><td>0.00</td></tr><tr><td>Labor Hours:</td><td>5.75</td></tr><tr><td>Sublet Parts:</td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td>0.00</td></tr></table>	Work Order 26845404 Total		Parts:	0.00	Labor:	0.00	Labor Hours:	5.75	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	0.00	
Work Order 26845404 Total															
Parts:	0.00														
Labor:	0.00														
Labor Hours:	5.75														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	0.00														



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 26572269
Invoice No. 55345 - 26572269

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
PM C		Ford E450 Champion Challenger	
Requested By:	HPIERRE	Status:	40 - Closed (40)
Created By:	HPIERRE	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	24,920 - DH

Chronology		
Reported	Jan 13, 2016 11:26:09 AM	Jan 13, 2016 11:26:09 AM
Started	Jan 13, 2016 12:00:00 AM	
Completed	Jan 13, 2016 3:44:52 PM	Jan 13, 2016 3:44:52 PM
Down Time		

Work Order Notes

Line 10 Pm - c inspection.

Replaced oil and oil filter. Service crank case breather. Clear all codes. Lub all doors

Parts used. 6 quarts oil. 5 w-20. 1 oil filter. B-329

Activity Header						
Activity: 10 999 TOTAL VEHICLE						
Activity Note: Light Medium Duty PMI						
Reason for Repair: 08 Preventive Maintenance						
Work Accomplished: 06 Inspect						
Part Failure:						
Activity Comments:						
Activity Parts						
No Data Available						
Activity Labor						
Booked Date	Technician	Hours	Shop Rate	Extended		
13-Jan-16	Capazzoli,Louis	2	0	0		
Activity Sublet						
No Data Available						
Activity Checklist						
Check List						
10 Desc: Light Medium Duty PMI						
Task: First Transit Light-Medium Duty PMI Performed by: LCAPAZZOLI Performed on: 13-JAN-16						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,000 - SECTION 1 Preparation and Drive On (In Lot) Inspection	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
10,100 - Safety Inspection	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
10,110 - FRA Check Drivers Pre-trip or DVIR/EVIR & Authorization Forms	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
10,120 - FRA Check All Warning Lights and Alarms	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,130 - FRA Check Automatic Transmission Neutral Start Operation	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
10,140 - Check Service Brakes	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
10,150 - FRA Start Engine and Listen for Any Unusual Noises	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
10,160 - FRA Check Instruments and Horns	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
10,170 - Check Fast Idle	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
10,180 - Check Starter Protection Circuit	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
10,190 - Check Reverse Warning System	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
11,100 - Check Parking Brake	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
11,110 - Check HVAC Switches and Other Controls	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
11,120 - FRA Inspect Windshields, Mirror and Sun Visor Condition	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
11,130 - FRA Check Wiper and Washer Operation	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
11,140 - Road Test: Check for Proper Operation	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
11,150 - Perform Brake Test	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
11,161 - FRA Check/Record Oil Pressure / @1500 rpm	Pounds per Square Inch	n/a	LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
11,162 - FRA Check/Record Water Temperature	Degree Fahrenheit	n/a	LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
11,170 - FRA Check Door Operation	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
11,180 - FRA Check Operation of All Other Accessories	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
20,000 - SECTION 2 Interior Circle Inspection	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
20,210 - Check Condition of Operator's Area	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
20,220 - Check Accelerator and Brake Pedals	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
20,230 - FRA Check Wiring Under Dash	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
20,240 - FRA Check Interior Lights	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
20,250 - FRA Check Interior Electrical Panels	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
20,260 - Check Stop Request System	-	n/a	LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
20,270 - Check Fare Box Mounting (If Applicable)	-	n/a	LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
20,280 - Check Seats, Seat Belts, Hand Rails and Floor Covering	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
20,290 - Check for Physical Damage, Water Leaks, and Graffiti	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
22,100 - Check Emergency Windows and Glass Condition	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
22,110 - Check Emergency Hatches	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
22,120 - Check All Safety Equipment	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
30,000 - SECTION 3 Exterior Circle Inspection	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
30,310 - Check Passenger Doors	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
30,320 - Inspect Step-well and Hand Rails	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
30,330 - Check Wheelchair Lift Operation	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
30,340 - FRA Check Destination Sign and Run Box	-	n/a	LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
30,350 - FRA Inspect Mirror and Mountings	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
30,360 - Check for Physical Damage and Decals	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
30,370 - Check Wiper Blade and Arm Condition	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
30,380 - Check Exterior Compartment Doors	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
30,390 - FRA Check Fuel Tank Cap	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
33,100 - Check Lights and Reflectors	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
33,110 - Check License Plate, Permits and State Inspection Decals	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
40,000 - SECTION 4 Engine Compartment Inspection	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
40,410 - FRA Check Engine Compartment/Condition for Fire Risk	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
40,420 - Check Hood	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
40,430 - Check Fan, Shroud and Radiator	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
40,440 - Test Coolant System Using Test Strips and Record Results	-	n/a	LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
40,441 - Inhibitor Test Pass or Fail (Indicate with a Yes or No)	No	n/a	LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
40,442 - Freeze Point	Degree Fahrenheit	n/a	LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
40,450 - FRA Check Coolant Recovery System Condition & for Leaks	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
40,460 - Record Antifreeze Protection Level Using Refractometer	-	n/a	LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
40,461 - Refractometer Reading	Degree Fahrenheit	n/a	LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
40,470 - Pressure Test Cooling System and Check for Leaks	-	n/a	LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
40,480 - FRA Check Coolant Hose Condition	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
40,490 - FRA Check Alternator Mount and Condition	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
44,100 - FRA Check Fuel Control and Transmission Connections	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
44,110 - FRA Check Master Cylinder Fluid Level	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
44,120 - FRA Check All Belts for Condition, Alignment and Tension	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
44,130 - FRA Check Exhaust System	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
44,140 - FRA Check Intake System	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
44,150 - FRA Inspect Turbocharger	-	n/a	LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
44,160 - FRA Inspect Power Steering and Hydraulic Fluid	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
44,170 - FRA Check All Engine or Belt Driven Components	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
44,180 - FRA Check for Leaks	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
44,190 - FRA Perform Battery Inspection	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
44,200 - FRA Check Battery Box Corrosion, Cables and Hold-Downs	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
50,000 - SECTION 5 Steering System Inspection	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
50,510 - Check Entire Steering System	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
60,000 - SECTION 6 Tires and Wheel Inspection	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
60,610 - FRA Check and Record Air Pressure	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
60,611 - Air Pressure RF	65 Pounds per Square Inch		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
60,612 - Air Pressure LF	65 Pounds per Square Inch		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
60,613 - Air Pressure RRO	70 Pounds per Square Inch		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
60,614 - Air Pressure RRI	70 Pounds per Square Inch		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
60,615 - Air Pressure LRI	70 Pounds per Square Inch		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
60,616 - Air Pressure LRO	70 Pounds per Square Inch		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
60,620 - Check Valve Stems and Caps	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
60,630 - Check and Record Tread Depth	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
60,631 - Tread Depth RF	12 32nds of an inch		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
60,632 - Tread Depth LF	12 32nds of an inch		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
60,633 - Tread Depth RRO	12 32nds of an inch		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
60,634 - Tread Depth RRI	12 32nds of an inch		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
60,635 - Tread Depth LRI	12 32nds of an inch		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
60,636 - Tread Depth LRO	12 32nds of an inch		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
60,640 - Check for Mismatched Tread or Casing Design	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
60,650 - Check Sidewall Wear	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
60,660 - Inspect for Cuts and Tears	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
60,670 - Check Dual Mating With Square	-	n/a	LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
60,680 - Check Wheels for Cracks and Loose Lugs	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
60,690 - Check Tires for Irregular or Alignment Wear	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
66,100 - FRA Check Outer Hubs for Leaks	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
70,000 - SECTION 7 Under Vehicle Inspection	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
70,710 - Check Vibration Damper	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
70,720 - Check Engine and Transmission Mounts	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
70,730 - FRA Check Starter	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
70,740 - FRA Check Bottom of Engine for Fluid Leaks	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
70,750 - FRA Check Transmission for Leaks	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
70,760 - FRA Check Differential Breather and Fluid	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
70,770 - FRA Check Exhaust System	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
70,780 - Check Driveline, U-joint and Slip Yokes	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
70,790 - Check All Body Mounts and Chassis Frame	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
77,100 - FRA Check Security, Integrity and Length of Ground Straps	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
77,110 - FRA Check Fuel Tank	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
77,120 - Check Suspension Components	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	


Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
77,130 - FRA Check Brake Pad Thickness and Rotor for Wear	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
77,131 - Brake Pad Thickness LF	Inch	7 mm	LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
77,132 - Brake Pad Thickness RF	Inch	7 mm	LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
77,133 - Brake Pad Thickness LR	Inch	7 mm	LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
77,134 - Brake Pad Thickness RR	Inch	7 mm	LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
77,135 - Brake Rotor LF	Inch	n/a	LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
77,136 - Brake Rotor RF	Inch	n/a	LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
77,137 - Brake Rotor LR	Inch	n/a	LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
77,138 - Brake Rotor RR	Inch	n/a	LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
77,140 - FRA Check Brake Hoses	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
77,150 - Check King Pins	-	n/a	LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
77,160 - FRA Check for Loose or Noisy Wheel Bearings	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
80,000 - SECTION 8 PMI Report Completion	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
80,810 - Completion of PMI Report	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
90,000 - SECTION 9 Completion of PMI	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	
90,910 - Vehicle Returned to predetermined location	Done		LCAPAZZOLI	Jan 13, 2016 3:03:06 PM	No	

Activity Sub Total

Activity 10 Sub Total	
Parts:	0.00
Labor:	0.00
Labor Hours:	2.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 26572269
Invoice No. 55345 - 26572269

Client Department:

Department: 55345M

Work Order Description

PM C

Requested By: HPIERRE

Created By: HPIERRE

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 24,920 - DH

Activity Header

Activity: 20 999 TOTAL VEHICLE

Activity Note: PM C

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: C PM Level C

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
13-Jan-16	B329	GOING OUT OF SERVICE DO NOT ORDER USE B329 IN THE FLEET ORG FILTER, OIL	1	1.92	1.92

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
13-Jan-16	Capazzoli, Louis	0.5	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List						
20 Desc: PM C						
Task: PM C SERVICE Performed by: LCAPAZZOLI Performed on: 13-JAN-16						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
100,000 - "A" PMI SERVICING ITEMS	Done		LCAPAZZOLI	Jan 13, 2016 3:04:51 PM	No	
101,000 - FRA Change Oil Filters	Yes		LCAPAZZOLI	Jan 13, 2016 3:04:51 PM	No	
102,000 - FRA Drain Engine Oil	Yes		LCAPAZZOLI	Jan 13, 2016 3:04:51 PM	No	
103,000 - FRA Check Transmission Fluid	Done		LCAPAZZOLI	Jan 13, 2016 3:04:51 PM	No	
104,000 - Lubricate Chassis	Done		LCAPAZZOLI	Jan 13, 2016 3:04:51 PM	No	
105,000 - Replace or Clean A/C Filters	Done		LCAPAZZOLI	Jan 13, 2016 3:04:51 PM	No	
107,000 - FRA Change Primary Fuel Filter	-	n/a	LCAPAZZOLI	Jan 13, 2016 3:04:51 PM	No	
108,000 - Lube all pivoting Mechanisms	Done		LCAPAZZOLI	Jan 13, 2016 3:04:51 PM	No	
200,000 - "B" PMI SERVICING ITEMS (12	Done		LCAPAZZOLI	Jan 13, 2016	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
MONTH)				3:04:51 PM		
201,000 - Service Crankcase Breather	Done		LCAPAZZOLI	Jan 13, 2016 3:04:51 PM	No	
203,000 - FRA Change Automatic Transmission Fluid	No	n/a	LCAPAZZOLI	Jan 13, 2016 3:04:51 PM	No	
204,000 - FRA Change Power Steering Fluid and Filter	No	n/a	LCAPAZZOLI	Jan 13, 2016 3:04:51 PM	No	
205,000 - Complete Engine Diagnostics and Clear Codes when Completed	Done		LCAPAZZOLI	Jan 13, 2016 3:04:51 PM	No	
300,000 - "C" PMI SERVICING ITEMS (24 MONTH)	Done		LCAPAZZOLI	Jan 13, 2016 3:04:51 PM	No	
301,000 - Check and Lubricate Door Linkages	Done		LCAPAZZOLI	Jan 13, 2016 3:04:51 PM	No	
302,000 - Check Toe-In and Record Reading	-	n/a	LCAPAZZOLI	Jan 13, 2016 3:04:51 PM	No	
302,001 - Record Toe-In Reading	Inches, fraction-actual	n/a	LCAPAZZOLI	Jan 13, 2016 3:04:51 PM	No	
304,000 - 1st "C" PMI ONLY: Tune Up Per Engine Mfg's Specifications	Yes		LCAPAZZOLI	Jan 13, 2016 3:04:51 PM	No	
305,000 - FRA Change Differential Fluid	No	n/a	LCAPAZZOLI	Jan 13, 2016 3:04:51 PM	No	


Activity Sub Total

Activity 20 Sub Total

Parts:	1.92
Labor:	0.00
Labor Hours:	0.50
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	1.92



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 26572269
Invoice No. 55345 - 26572269

Client Department:

Department: 55345M

Work Order Description

PM C

Requested By: HPIERRE

Created By: HPIERRE

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 24,920 - DH

Activity Header

Activity: 30 999 TOTAL VEHICLE

Activity Note: PRAMETER

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

30 Desc: PRAMETER

Task: PRA and Meter Readings Performed by: LCAPAZZOLI Performed on: 13-JAN-16

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		LCAPAZZOLI	Jan 13, 2016 2:30:22 PM	No	
20 - Miles			LCAPAZZOLI	Jan 13, 2016 2:30:22 PM	No	
30 - Kilometers			LCAPAZZOLI	Jan 13, 2016 2:30:22 PM	No	
40 - Hours			LCAPAZZOLI	Jan 13, 2016 2:30:22 PM	No	

Activity Sub Total

Activity 30 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00

Work Order Footer

Work Order 26572269 Total

Parts:	1.92
Labor:	0.00
Labor Hours:	2.50
Sublet Parts:	0.00
Sublet Labor:	0.00

	Activity Sub Total	1.92
--	---------------------------	-------------



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 26738775
Invoice No. 55345 - 26738775

Client Department:

Department: 55345M

Work Order Description

Driver states wheel chair lift sticks

Requested By: RMANZINO

Created By: RMANZINO

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 23,830 - DH

Chronology

Reported	Jan 4, 2016 1:07:53 PM	Jan 4, 2016 1:07:53 PM
Started	Jan 4, 2016 12:00:00 AM	
Completed	Jan 5, 2016 1:40:00 PM	Jan 5, 2016 1:40:00 PM
Down Time		

Work Order Notes

Line 10 Have you completed a satisfactory Personal Risk Assessment? Yes() No ().

If the answer is NO stop what you are doing, complete an IP Safety Contact Slip and see your supervisor for further instructions.

=====

COMPLAINT: driver states the wheel chair lift sticks

CAUSE: could not replicate problem at this time.

CORRECTION: lubed all moving parts on lift.

Adjust all micro switches and safety features.

Ran lift through many cycles and worked as intended each time.

No issues present at this time and vehicle was returned to service.

No parts used.

Activity Header

Activity: 5 999 TOTAL VEHICLE

Activity Note: Personal Risk Assessment

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
04-Jan-16	Manzino, Robert C	0.1666666	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: Personal Risk Assessment

Task: PRA and Meter Readings Performed by: RMANZINO Performed on: 04-JAN-16

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		RMANZINO	Jan 4, 2016 1:20:30 PM	No	
20 - Miles			RMANZINO	Jan 4, 2016 1:20:30 PM	No	
30 - Kilometers			RMANZINO	Jan 4, 2016 1:20:30 PM	No	
40 - Hours			RMANZINO	Jan 4, 2016 1:20:30 PM	No	
Activity Sub Total						
			Activity 5 Sub Total			
			Parts:			0.00
			Labor:			0.00
			Labor Hours:			0.17
			Sublet Parts:			0.00
			Sublet Labor:			0.00
			Activity Sub Total			0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 26738775
Invoice No. 55345 - 26738775

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Driver states wheel chair lift sticks		Ford E450 Champion Challenger	
Requested By:	RMANZINO	Status:	40 - Closed (40)
Created By:	RMANZINO	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	23,830 - DH

Activity Header				
Activity:15 999 TOTAL VEHICLE				
Activity Note: Driver states the wheel chair lift sticks				
Reason for Repair: 04 Driver's Report				
Work Accomplished:				
Part Failure:				
Activity Comments:				
Activity Parts				
No Data Available				
Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
04-Jan-16	Manzino,Robert C	1	0	0
Activity Sublet				
No Data Available				
Activity Checklist				
No Data Available				
No Data Available				
Activity Sub Total				
			Activity 15 Sub Total	
			Parts:	0.00
			Labor:	0.00
			Labor Hours:	1.00
			Sublet Parts:	0.00
			Sublet Labor:	0.00
			Activity Sub Total	0.00
Work Order Footer				
			Work Order 26738775 Total	
			Parts:	0.00
			Labor:	0.00
			Labor Hours:	1.17
			Sublet Parts:	0.00
			Sublet Labor:	0.00
			Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 26729133
Invoice No. 55345 - 26729133

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
RIGHT REAR TIRE SIDE WALL DAMAGED		Ford E450 Champion Challenger	
Requested By:	CVERGARA	Status:	40 - Closed (40)
Created By:	CVERGARA	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	23,830 - DH

Chronology

Reported	Dec 28, 2015 9:33:00 AM	Dec 28, 2015 9:33:00 AM
Started	Dec 28, 2015 12:00:00 AM	
Completed	Dec 28, 2015 12:06:00 PM	Dec 28, 2015 12:06:00 PM
Down Time		

Work Order Notes

Line 10 . Line 20
COMPLAINT:
Right rear outer tire flat.

CAUSE:
Driver equipment abuse

CORRECTION:
Outer right rear tire has unrepairable sidewall damage. Mounted and balanced 1 crosswind tire and place it on the outer RR. Torqued lug nuts to 140 lbs. set psi to 70. Washed rims. Test drove and re-torqued to 140lbs.

Parts. Qty 1 crosswind LTR2072LL

Activity Header

Activity:5 999 TOTAL VEHICLE

Activity Note: Personal Risk Assessment

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
28-Dec-15	Torres,Edwin	0.1666666	0	0
28-Dec-15	Torres,Edwin	0.05	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: Personal Risk Assessment

Task: PRA and Meter Readings Performed by: EDTORRES Performed on: 28-DEC-15

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		EDTORRES	Dec 28, 2015 10:47:38 AM	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
20 - Miles			EDITORRES	Dec 28, 2015 10:47:38 AM	No	
30 - Kilometers			EDITORRES	Dec 28, 2015 10:47:38 AM	No	
40 - Hours			EDITORRES	Dec 28, 2015 10:47:38 AM	No	
Activity Sub Total						
				Activity 5 Sub Total		
				Parts:		0.00
				Labor:		0.00
				Labor Hours:		0.22
				Sublet Parts:		0.00
				Sublet Labor:		0.00
				Activity Sub Total		0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 26729133
Invoice No. 55345 - 26729133

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
RIGHT REAR TIRE SIDE WALL DAMAGED		Ford E450 Champion Challenger	
Requested By:	CVERGARA	Status:	40 - Closed (40)
Created By:	CVERGARA	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	23,830 - DH

Activity Header

Activity:15 017/001/000 TIRE, PNEUMATIC

Activity Note:

Reason for Repair: 41 Abuse of Equipment - 56210

Work Accomplished: 03 Replace New

Part Failure: 44 Worn

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
28-Dec-15	LTR2072LL	OUT OF SERVICE DO NOT USE TIRE, LT225 75/R16, L780, LING-LONG	1	69.95	69.95
13-Jan-16	LTR2072LL	OUT OF SERVICE DO NOT USE TIRE, LT225 75/R16, L780, LING-LONG	1	79.95	79.95
13-Jan-16	LTR2072LL	OUT OF SERVICE DO NOT USE TIRE, LT225 75/R16, L780, LING-LONG	-1	75.71	-75.71

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
28-Dec-15	Torres,Edwin	0.8333333	0	0

Activity Sublet

No Data Available

Activity Checklist

No Data Available

No Data Available

Activity Sub Total

Activity 15 Sub Total

Parts:	74.19
Labor:	0.00
Labor Hours:	0.83
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	74.19

Work Order Footer

Work Order 26729133 Total

Parts:	74.19
Labor:	0.00
Labor Hours:	1.05
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	74.19



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 26709322
Invoice No. 55345 - 26709322

Client Department:

Department: 55345M

Work Order Description

FRONT CAMERA ISSUE

Requested By: CVERGARA

Created By: CVERGARA

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 23,009 - DH

Chronology

Reported	Dec 15, 2015 9:31:00 AM	Dec 15, 2015 9:31:00 AM
Started	Dec 15, 2015 12:00:00 AM	
Completed	Dec 15, 2015 11:53:00 AM	Dec 15, 2015 11:53:00 AM
Down Time		

Work Order Notes

Line 10 . Line 20 Have you completed a satisfactory Personal Risk Assessment? Yes() No ().

If the answer is NO stop what you are doing, complete an IP Safety Contact Slip and see your supervisor for further instructions.

=====

COMPLAINT: palm tran wrote an email stating the front windshield camera needed to be replaced.

CAUSE: unknown cause

CORRECTION: removed faulty camera head.

Installed new camera head.

Tested good.

Aimed to correct view.

No parts used (camera head supplied under warranty from angeltrax)

Activity Header

Activity: 5 999 TOTAL VEHICLE

Activity Note: Personal Risk Assessment

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
15-Dec-15	Manzino, Robert C	0.1666666	0	0

Activity Sublet

No Data Available

Activity Checklist


Check List

5 Desc: Personal Risk Assessment

Check List						
Task: PRA and Meter Readings Performed by: RMANZINO Performed on: 15-DEC-15						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		RMANZINO	Dec 15, 2015 11:42:31 AM	No	
20 - Miles			RMANZINO	Dec 15, 2015 11:42:31 AM	No	
30 - Kilometers			RMANZINO	Dec 15, 2015 11:42:31 AM	No	
40 - Hours			RMANZINO	Dec 15, 2015 11:42:31 AM	No	
Activity Sub Total						
				Activity 5 Sub Total		
				Parts:	0.00	
				Labor:	0.00	
				Labor Hours:	0.17	
				Sublet Parts:	0.00	
				Sublet Labor:	0.00	
				Activity Sub Total	0.00	



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 26709322
Invoice No. 55345 - 26709322

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FD4E4FS7EDB17176
FRONT CAMERA ISSUE		Ford E450 Champion Challenger	
Requested By:	CVERGARA	Status:	40 - Closed (40)
Created By:	CVERGARA	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	23,009 - DH

Activity Header
Activity: 15 050/000 GROUP, ACCESSORIES
Activity Note: FRONT CAMERA
Reason for Repair: 05 Inspection, Routine
Work Accomplished: 14 Install
Part Failure: 00 No Failure
Activity Comments:

Activity Parts
No Data Available

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
15-Dec-15	Manzino,Robert C	0.75	0	0

Activity Sublet
No Data Available

Activity Checklist
No Data Available
No Data Available

Activity Sub Total															
<table><tr><th colspan="2">Activity 15 Sub Total</th></tr><tr><td>Parts:</td><td>0.00</td></tr><tr><td>Labor:</td><td>0.00</td></tr><tr><td>Labor Hours:</td><td>0.75</td></tr><tr><td>Sublet Parts:</td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td>0.00</td></tr></table>	Activity 15 Sub Total		Parts:	0.00	Labor:	0.00	Labor Hours:	0.75	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	0.00	
Activity 15 Sub Total															
Parts:	0.00														
Labor:	0.00														
Labor Hours:	0.75														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	0.00														

Work Order Footer															
<table><tr><th colspan="2">Work Order 26709322 Total</th></tr><tr><td>Parts:</td><td>0.00</td></tr><tr><td>Labor:</td><td>0.00</td></tr><tr><td>Labor Hours:</td><td>0.92</td></tr><tr><td>Sublet Parts:</td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td>0.00</td></tr></table>	Work Order 26709322 Total		Parts:	0.00	Labor:	0.00	Labor Hours:	0.92	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	0.00	
Work Order 26709322 Total															
Parts:	0.00														
Labor:	0.00														
Labor Hours:	0.92														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	0.00														



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 26699811
Invoice No. 55345 - 26699811

Client Department:

Department: 55345M

Work Order Description

Rear tires

Requested By: EDITORRES

Created By: EDITORRES

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 22,550 - DH

Chronology

Reported	Dec 10, 2015 11:47:53 AM	Dec 10, 2015 11:47:53 AM
Started	Dec 10, 2015 12:00:00 AM	
Completed	Dec 10, 2015 2:56:00 PM	Dec 10, 2015 2:56:00 PM
Down Time		

Work Order Notes

Line 10 Tires

COMPLAINT:

Check tires for low tread

CAUSE:

Normal wear

CORRECTION:

Mounted and balanced 4 Crosswind tires. Set tires to 70 psi. Torque lug nuts to 140 LBS. Test drove. Re-torqued to 140 lbs.

Parts Ltr2072LL tires qty 4 crosswind

Activity Header

Activity: 5 999 TOTAL VEHICLE

Activity Note: Personal Risk Assessment

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
10-Dec-15	Torres,Edwin	0.0333333	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: Personal Risk Assessment

Task: PRA and Meter Readings Performed by: EDITORRES Performed on: 10-DEC-15

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the	Done		EDITORRES	Dec 10, 2015	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO	
Personal Risk Assessment?				11:49:23 AM			
20 - Miles			EDTORRES	Dec 10, 2015 11:49:23 AM	No		
30 - Kilometers			EDTORRES	Dec 10, 2015 11:49:23 AM	No		
40 - Hours			EDTORRES	Dec 10, 2015 11:49:23 AM	No		
Activity Sub Total							
				Activity 5 Sub Total			
				Parts:			0.00
				Labor:			0.00
				Labor Hours:			0.03
				Sublet Parts:			0.00
				Sublet Labor:			0.00
				Activity Sub Total			0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 26699811
Invoice No. 55345 - 26699811

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Rear tires		Ford E450 Champion Challenger	
Requested By:	EDITORRES	Status:	40 - Closed (40)
Created By:	EDITORRES	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	22,550 - DH

Activity Header
Activity: 15 018/000/000 WHEELS, RIMS, HUBS AND BEARINGS
Activity Note: Rear tires
Reason for Repair: 08 Preventive Maintenance
Work Accomplished: 03 Replace New
Part Failure: 99 Replaced Before Failure
Activity Comments:

Activity Parts					
Booked Date	Part Number	Part Description	Quantity	Each	Extended
13-Jan-16	LTR2072LL	OUT OF SERVICE DO NOT USE TIRE, LT225 75/R16, L780, LING-LONG	4	79.95	319.8
13-Jan-16	LTR2072LL	OUT OF SERVICE DO NOT USE TIRE, LT225 75/R16, L780, LING-LONG	-4	75.71	-302.84
10-Dec-15	LTR2072LL	OUT OF SERVICE DO NOT USE TIRE, LT225 75/R16, L780, LING-LONG	4	69.95	279.8

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
10-Dec-15	Torres, Edwin	1	0	0

Activity Sublet
No Data Available


Activity Checklist
No Data Available
No Data Available

Activity Sub Total		Activity 15 Sub Total	
Parts:	296.76	Labor:	0.00
Labor Hours:	1.00	Labor Parts:	0.00
Sublet Parts:	0.00	Sublet Labor:	0.00
Sublet Labor:	0.00	Activity Sub Total	296.76

Work Order Footer		Work Order 26699811 Total	
Parts:	296.76	Labor:	0.00
Labor Hours:	1.03	Labor Parts:	0.00
Sublet Parts:	0.00	Sublet Labor:	0.00
Sublet Labor:	0.00	Activity Sub Total	296.76



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 26651154
Invoice No. 55345 - 26651154

Client Department:

Department: 55345M

Work Order Description

check for propane smell inside the bus

Requested By: CVERGARA

Created By: CVERGARA

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 21,709 - DH

Chronology

Reported	Nov 30, 2015 9:07:00 AM	Nov 30, 2015 9:07:00 AM
Started	Nov 30, 2015 9:47:00 AM	
Completed	Nov 30, 2015 3:16:00 PM	Nov 30, 2015 3:16:00 PM
Down Time		

Work Order Notes

Line 10 Have you completed a satisfactory Personal Risk Assessment? Yes() No ().

If the answer is NO stop what you are doing, complete an IP Safety Contact Slip and see your supervisor for further instructions.

=====

COMPLAINT:Bus smelling propane

CAUSE:unknown

CORRECTION:Test drive

Bus inside and outside inspected

Road test performed

Problem cannot be verified

No part utilized

FS

Activity Header				
Activity: 5 999 TOTAL VEHICLE				
Activity Note: Personal Risk Assessment				
Reason for Repair: 05 Inspection, Routine				
Work Accomplished: 06 Inspect				
Part Failure:				
Activity Comments:				
Activity Parts				
No Data Available				
Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
30-Nov-15	Simon,Fritz	1	0	0
Activity Sublet				
No Data Available				
Activity Checklist				

Check List						
5 Desc: Personal Risk Assessment						
Task: PRA and Meter Readings Performed by: FSIMON Performed on: 30-NOV-15						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		FSIMON	Nov 30, 2015 9:55:02 AM	No	
20 - Miles			FSIMON	Nov 30, 2015 9:55:02 AM	No	
30 - Kilometers			FSIMON	Nov 30, 2015 9:55:02 AM	No	
40 - Hours			FSIMON	Nov 30, 2015 9:55:02 AM	No	
Activity Sub Total						
			Activity 5 Sub Total			
			Parts: 0.00			
			Labor: 0.00			
			Labor Hours: 1.00			
			Sublet Parts: 0.00			
			Sublet Labor: 0.00			
			Activity Sub Total 0.00			



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 26651154
Invoice No. 55345 - 26651154

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
check for propane smell inside the bus		Ford E450 Champion Challenger	
Requested By:	CVERGARA	Status:	40 - Closed (40)
Created By:	CVERGARA	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	21,709 - DH

Activity Header															
Activity:15 044 FUEL SYSTEM															
Activity Note:															
Reason for Repair: 05 Inspection, Routine															
Work Accomplished:															
Part Failure:															
Activity Comments:															
Activity Parts															
No Data Available															
Activity Labor															
No Data Available															
Activity Sublet															
No Data Available															
Activity Checklist															
No Data Available															
No Data Available															
Activity Sub Total															
<table><tr><td colspan="2">Activity 15 Sub Total</td></tr><tr><td>Parts:</td><td>0.00</td></tr><tr><td>Labor:</td><td>0.00</td></tr><tr><td>Labor Hours:</td><td>0.00</td></tr><tr><td>Sublet Parts:</td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td>0.00</td></tr></table>		Activity 15 Sub Total		Parts:	0.00	Labor:	0.00	Labor Hours:	0.00	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	0.00
Activity 15 Sub Total															
Parts:	0.00														
Labor:	0.00														
Labor Hours:	0.00														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	0.00														
Work Order Footer															
<table><tr><td colspan="2">Work Order 26651154 Total</td></tr><tr><td>Parts:</td><td>0.00</td></tr><tr><td>Labor:</td><td>0.00</td></tr><tr><td>Labor Hours:</td><td>1.00</td></tr><tr><td>Sublet Parts:</td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td>0.00</td></tr></table>		Work Order 26651154 Total		Parts:	0.00	Labor:	0.00	Labor Hours:	1.00	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	0.00
Work Order 26651154 Total															
Parts:	0.00														
Labor:	0.00														
Labor Hours:	1.00														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	0.00														



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 26599699
Invoice No. 55345 - 26599699

Client Department:

Department: 55345M

Work Order Description

Wheel chair lift bridge plate sticking

Requested By: RMANZINO

Created By: RMANZINO

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 21,026 - DH

Chronology

Reported	Nov 18, 2015 11:36:17 AM	Nov 18, 2015 11:36:17 AM
Started	Nov 18, 2015 12:00:00 AM	
Completed	Nov 18, 2015 1:55:00 PM	Nov 18, 2015 1:55:00 PM
Down Time		

Work Order Notes

Line 10 Have you completed a satisfactory Personal Risk Assessment? Yes() No ().

If the answer is NO stop what you are doing, complete an IP Safety Contact Slip and see your supervisor for further instructions.

=====

COMPLAINT: driver complaint that the wheel chair lift stopped going down

CAUSE: confirmed complaint and diagnosed as the bridge plate was sticking.

CORRECTION: lubricated all moving and sliding parts.

Cycled lift up and down many times and problem did not return.

Issue resolved and vehicle returned to service.

No parts used

Activity Header

Activity: 5 999 TOTAL VEHICLE

Activity Note: Personal Risk Assessment

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
18-Nov-15	Manzino,Robert C	0.1666666	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: Personal Risk Assessment

Task: PRA and Meter Readings Performed by: RMANZINO Performed on: 18-NOV-15

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		RMANZINO	Nov 18, 2015 11:43:20 AM	No	
20 - Miles			RMANZINO	Nov 18, 2015 11:43:20 AM	No	
30 - Kilometers			RMANZINO	Nov 18, 2015 11:43:20 AM	No	
40 - Hours			RMANZINO	Nov 18, 2015 11:43:20 AM	No	

Activity Sub Total

Activity 5 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	0.17
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 26599699
Invoice No. 55345 - 26599699


Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FD4E4FS7EDB17176
Wheel chair lift bridge plate sticking		Ford E450 Champion Challenger	
Requested By:	RMANZINO	Status:	40 - Closed (40)
Created By:	RMANZINO	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	21,026 - DH

Activity Header				
Activity: 15 055 HANDLING, CARGO RESTRAINT & LIFT SYSTEM (POWER UNITS, TRAILERS)				
Activity Note: Wheel chair lift bridge plate sticking				
Reason for Repair: 04 Driver's Report				
Work Accomplished:				
Part Failure:				
Activity Comments:				
Activity Parts				
No Data Available				
Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
18-Nov-15	Manzino,Robert C	0.75	0	0
Activity Sublet				
No Data Available				
Activity Checklist				
No Data Available				
No Data Available				
Activity Sub Total				
			Activity 15 Sub Total	
			Parts:	0.00
			Labor:	0.00
			Labor Hours:	0.75
			Sublet Parts:	0.00
			Sublet Labor:	0.00
			Activity Sub Total	0.00
Work Order Footer				
			Work Order 26599699 Total	
			Parts:	0.00
			Labor:	0.00
			Labor Hours:	0.92
			Sublet Parts:	0.00
			Sublet Labor:	0.00
			Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 26573030
Invoice No. 55345 - 26573030

Client Department:

Department: 55345M

Work Order Description

Exhaust Pipe hanger check

Requested By: FSIMON

Created By: FSIMON

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 2 - Medium

Driver:

Phone:

ETA:

Meter: 20,506 - DH

Chronology

Reported	Nov 5, 2015 9:50:05 AM	Nov 5, 2015 9:50:05 AM
Started	Nov 5, 2015 9:55:00 AM	
Completed	Nov 5, 2015 10:10:00 AM	Nov 5, 2015 10:10:00 AM
Down Time		

Work Order Notes

Line 10 Have you completed a satisfactory Personal Risk Assessment? Yes() No ().

If the answer is NO stop what you are doing, complete an IP Safety Contact Slip and see your supervisor for further instructions.

=====

COMPLAINT:Exhaust pipe hanger

CAUSE:Hanger bushing

CORRECTION:Exhaust pipe hanger fixed

Exhaust pipe hanger visually inspected
Hanger bushing out of normal spot
Exhaust pipe bushing pushed back to its normal spot
Exhaust pipe hanger tightened
Exhaust pipe hanger OK.

No parts utilized

Activity Header

Activity:5 999 TOTAL VEHICLE

Activity Note: Personal Risk Assessment

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
05-Nov-15	Simon,Fritz	1	0	0

Activity Sublet

No Data Available

Activity Checklist**Check List**

5 Desc: Personal Risk Assessment

Task: PRA and Meter Readings Performed by: FSIMON Performed on: 05-NOV-15


Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		FSIMON	Nov 5, 2015 10:06:57 AM	No	
20 - Miles			FSIMON	Nov 5, 2015 10:06:57 AM	No	
30 - Kilometers			FSIMON	Nov 5, 2015 10:06:57 AM	No	
40 - Hours			FSIMON	Nov 5, 2015 10:06:57 AM	No	

Activity Sub Total**Activity 5 Sub Total**

Parts:	0.00
Labor:	0.00
Labor Hours:	1.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 26573030
Invoice No. 55345 - 26573030

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FD4E4FS7EDB17176
Exhaust Pipe hanger check		Ford E450 Champion Challenger	
Requested By:	FSIMON	Status:	40 - Closed (40)
Created By:	FSIMON	Priority:	2 - Medium
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	20,506 - DH

Activity Header
Activity: 15 043 EXHAUST SYSTEM
Activity Note:
Reason for Repair: 05 Inspection, Routine
Work Accomplished:
Part Failure:
Activity Comments:

Activity Parts
No Data Available

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
05-Nov-15	Simon,Fritz	0.2	0	0

Activity Sublet
No Data Available


Activity Checklist
No Data Available
No Data Available

Activity Sub Total		Activity 15 Sub Total	
		Parts:	0.00
		Labor:	0.00
		Labor Hours:	0.20
		Sublet Parts:	0.00
		Sublet Labor:	0.00
		Activity Sub Total	0.00

Work Order Footer		Work Order 26573030 Total	
		Parts:	0.00
		Labor:	0.00
		Labor Hours:	1.20
		Sublet Parts:	0.00
		Sublet Labor:	0.00
		Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 26280690
Invoice No. 55345 - 26280690

Client Department:

Department: 55345M

Work Order Description

PM A

Requested By: LCAPAZZOLI

Created By: LCAPAZZOLI

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 20,506 - DH

Chronology

Reported	Nov 4, 2015 12:00:00 AM	Nov 4, 2015 12:00:00 AM
Started	Nov 4, 2015 12:00:00 AM	
Completed	Nov 4, 2015 6:12:00 PM	Nov 4, 2015 6:12:00 PM
Down Time		

Work Order Notes

Line 10 COMPLAINT: pm a

CAUSE: regular maintenance

CORRECTION: perform service lube all pivoting point and cross rotate front tires

Replace left rear outer to good use one whit 10 mm completed

Parts# oil filter b 329 qty 1

Oil# 5w20 qt 6

Activity Header

Activity: 10 999 TOTAL VEHICLE

Activity Note: Personal Risk Assessment and Meter Reading

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
06-Nov-15	B329	GOING OUT OF SERVICE DO NOT ORDER USE B329 IN THE FLEET ORG FILTER, OIL	1	1.84	1.84
17-Nov-15	B329	GOING OUT OF SERVICE DO NOT ORDER USE B329 IN THE FLEET ORG FILTER, OIL	-1	1.84	-1.84
17-Nov-15	B329	GOING OUT OF SERVICE DO NOT ORDER USE B329 IN THE FLEET ORG FILTER, OIL	1	1.92	1.92

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
04-Nov-15	Pierre, Hubert J	0.05	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: Personal Risk Assessment and Meter Reading
Task: PRA and Meter Readings Performed by: HPIERRE Performed on: 04-NOV-15

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		HPIERRE	Nov 4, 2015 6:01:01 PM	No	
20 - Miles			HPIERRE	Nov 4, 2015 6:01:01 PM	No	
30 - Kilometers			HPIERRE	Nov 4, 2015 6:01:01 PM	No	
40 - Hours			HPIERRE	Nov 4, 2015 6:01:01 PM	No	

Activity Sub Total

Activity 10 Sub Total

Parts:	1.92
Labor:	0.00
Labor Hours:	0.05
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	1.92



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 26280690
Invoice No. 55345 - 26280690

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
PM A		Ford E450 Champion Challenger	
Requested By:	LCAPAZZOLI	Status:	40 - Closed (40)
Created By:	LCAPAZZOLI	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	20,506 - DH

Activity Header				
Activity:20 999 TOTAL VEHICLE				
Activity Note: PM Inspection				
Reason for Repair: 08 Preventive Maintenance				
Work Accomplished: A PM Level A				
Part Failure:				
Activity Comments:				
Activity Parts				
No Data Available				
Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
04-Nov-15	Pierre,Hubert J	1.95	0	0
Activity Sublet				
No Data Available				
Activity Checklist				
No Data Available				
No Data Available				
Activity Sub Total				
			Activity 20 Sub Total	
			Parts:	0.00
			Labor:	0.00
			Labor Hours:	1.95
			Sublet Parts:	0.00
			Sublet Labor:	0.00
			Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 26280690
Invoice No. 55345 - 26280690

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
PM A		Ford E450 Champion Challenger	
Requested By:	LCAPAZZOLI	Status:	40 - Closed (40)
Created By:	LCAPAZZOLI	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	20,506 - DH

Activity Header
Activity:30 999 TOTAL VEHICLE
Activity Note: PM A
Reason for Repair: 08 Preventive Maintenance
Work Accomplished: A PM Level A
Part Failure:
Activity Comments:

Activity Parts
No Data Available

Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
04-Nov-15	Pierre,Hubert J	0.5	0	0

Activity Sublet
No Data Available

Activity Checklist						
Check List						
30 Desc: PM A						
Task: PM A SERVICE Performed by: HPIERRE Performed on: 04-NOV-15						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
100,000 - "A" PMI SERVICING ITEMS	Done		HPIERRE	Nov 4, 2015 6:02:00 PM	No	
101,000 - FRA Change Oil Filters	Yes		HPIERRE	Nov 4, 2015 6:02:00 PM	No	
102,000 - FRA Drain Engine Oil	Yes		HPIERRE	Nov 4, 2015 6:02:00 PM	No	
103,000 - FRA Check Transmission Fluid	Done		HPIERRE	Nov 4, 2015 6:02:00 PM	No	
104,000 - Lubricate Chassis	Done		HPIERRE	Nov 4, 2015 6:02:00 PM	No	
105,000 - Replace or Clean A/C Filters	Done		HPIERRE	Nov 4, 2015 6:02:00 PM	No	
107,000 - FRA Change Primary Fuel Filter	No	N/A	HPIERRE	Nov 4, 2015 6:02:00 PM	No	
108,000 - Lube all pivoting Mechanisms	Done		HPIERRE	Nov 4, 2015 6:02:00 PM	No	

Activity Sub Total	
Activity 30 Sub Total	
Parts:	0.00
Labor:	0.00

	Labor Hours:	0.50
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	0.00
Work Order Footer		
	Work Order 26280690 Total	
	Parts:	1.92
	Labor:	0.00
	Labor Hours:	2.50
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	1.92



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 26556126
Invoice No. 55345 - 26556126

Client Department:

Department: 55345M

Work Order Description

Install new windshield camera per county request

Requested By: RMANZINO

Created By: RMANZINO

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 20,019 - DH

Chronology

Reported	Oct 23, 2015 8:47:22 AM	Oct 23, 2015 8:47:22 AM
Started	Oct 23, 2015 12:00:00 AM	
Completed	Oct 23, 2015 9:34:00 AM	Oct 23, 2015 9:34:00 AM
Down Time		

Work Order Notes

Line 10 Have you completed a satisfactory Personal Risk Assessment? Yes() No ().

If the answer is NO stop what you are doing, complete an IP Safety Contact Slip and see your supervisor for further instructions.

=====

COMPLAINT: install new windshield mounted camera per request by county

CAUSE: county request

CORRECTION: removed original camera head.

Installed new camera head.

Used dvr tablet to view and aim camera head.

Installed cover.

Returned vehicle to service. Line 20 No parts used (county provided camera head)

Activity Header

Activity: 5 999 TOTAL VEHICLE

Activity Note: Personal Risk Assessment

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
23-Oct-15	Manzino,Robert C	0.1666666	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: Personal Risk Assessment

Task: PRA and Meter Readings Performed by: RMANZINO Performed on: 23-OCT-15

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		RMANZINO	Oct 23, 2015 9:33:42 AM	No	
20 - Miles			RMANZINO	Oct 23, 2015 9:33:42 AM	No	
30 - Kilometers			RMANZINO	Oct 23, 2015 9:33:42 AM	No	
40 - Hours			RMANZINO	Oct 23, 2015 9:33:42 AM	No	
Activity Sub Total						
			Activity 5 Sub Total			
			Parts:			0.00
			Labor:			0.00
			Labor Hours:			0.17
			Sublet Parts:			0.00
			Sublet Labor:			0.00
			Activity Sub Total			0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 26556126
Invoice No. 55345 - 26556126


Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Install new windshield camera per county request		Ford E450 Champion Challenger	
Requested By:	RMANZINO	Status:	40 - Closed (40)
Created By:	RMANZINO	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	20,019 - DH

Activity Header				
Activity: 15 052 EILECTRICAL ACCESSORIES (POWER UNITS, TRAILERS, ETC.)				
Activity Note: Install new windshield camera per county request				
Reason for Repair: 05 Inspection, Routine				
Work Accomplished:				
Part Failure:				
Activity Comments:				
Activity Parts				
No Data Available				
Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
23-Oct-15	Manzino,Robert C	1	0	0
Activity Sublet				
No Data Available				
Activity Checklist				
No Data Available				
No Data Available				
Activity Sub Total				
			Activity 15 Sub Total	
			Parts:	0.00
			Labor:	0.00
			Labor Hours:	1.00
			Sublet Parts:	0.00
			Sublet Labor:	0.00
			Activity Sub Total	0.00
Work Order Footer				
			Work Order 26556126 Total	
			Parts:	0.00
			Labor:	0.00
			Labor Hours:	1.17
			Sublet Parts:	0.00
			Sublet Labor:	0.00
			Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 26404629
Invoice No. 55345 - 26404629

Client Department:

Department: 55345M

Work Order Description

rear bumper cover

Requested By: CVERGARA

Created By: CVERGARA

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 2 - Medium

Driver:

Phone:

ETA:

Meter: 16,690 - DH

Chronology

Reported	Sep 2, 2015 3:21:00 PM	Sep 2, 2015 3:21:00 PM
Started		
Completed	Sep 2, 2015 3:36:00 PM	Sep 2, 2015 3:36:00 PM
Down Time		

Work Order Notes

Line 10 Have you completed a satisfactory Personal Risk Assessment? Yes() No ().

If the answer is NO stop what you are doing, complete an IP Safety Contact Slip and see your supervisor for further instructions.

=====

COMPLAINT:

CAUSE:

CORRECTION:installed rubber back on rear bumper

Activity Header

Activity:5 999 TOTAL VEHICLE

Activity Note: Personal Risk Assessment

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
02-Sep-15	Capazzoli,Louis	2	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

5 Desc: Personal Risk Assessment

Task: PRA and Meter Readings Performed by: Performed on:

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done				No	
20 - Miles					No	
Activity Sub Total						
				Activity 5 Sub Total		
				Parts:		0.00
				Labor:		0.00
				Labor Hours:		2.00
				Sublet Parts:		0.00
				Sublet Labor:		0.00
				Activity Sub Total		0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 26404629
Invoice No. 55345 - 26404629

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
rear bumper cover		Ford E450 Champion Challenger	
Requested By:	CVERGARA	Status:	40 - Closed (40)
Created By:	CVERGARA	Priority:	2 - Medium
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	16,690 - DH

Activity Header															
Activity: 15 078 TRIM & MISCELLANEOUS HARDWARE															
Activity Note:															
Reason for Repair:	05 Inspection, Routine														
Work Accomplished:															
Part Failure:															
Activity Comments:															
Activity Parts															
No Data Available															
Activity Labor															
No Data Available															
Activity Sublet															
No Data Available															
Activity Checklist															
No Data Available															
No Data Available															
Activity Sub Total															
<table><tr><td colspan="2">Activity 15 Sub Total</td></tr><tr><td>Parts:</td><td>0.00</td></tr><tr><td>Labor:</td><td>0.00</td></tr><tr><td>Labor Hours:</td><td>0.00</td></tr><tr><td>Sublet Parts:</td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td>0.00</td></tr></table>		Activity 15 Sub Total		Parts:	0.00	Labor:	0.00	Labor Hours:	0.00	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	0.00
Activity 15 Sub Total															
Parts:	0.00														
Labor:	0.00														
Labor Hours:	0.00														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	0.00														
Work Order Footer															
<table><tr><td colspan="2">Work Order 26404629 Total</td></tr><tr><td>Parts:</td><td>0.00</td></tr><tr><td>Labor:</td><td>0.00</td></tr><tr><td>Labor Hours:</td><td>2.00</td></tr><tr><td>Sublet Parts:</td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td>0.00</td></tr></table>		Work Order 26404629 Total		Parts:	0.00	Labor:	0.00	Labor Hours:	2.00	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	0.00
Work Order 26404629 Total															
Parts:	0.00														
Labor:	0.00														
Labor Hours:	2.00														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	0.00														



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 2



Work Order No. 26280746
Invoice No. 55345 - 26280746

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Install driver side step rail		Ford E450 Champion Challenger	
Requested By:	DCARTER	Status:	40 - Closed (40)
Created By:	DCARTER	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	15,868 - DH

Chronology		
Reported	Aug 28, 2015 4:28:00 PM	Aug 28, 2015 4:28:00 PM
Started		
Completed	Aug 28, 2015 5:49:00 PM	Aug 28, 2015 5:49:00 PM
Down Time		

Work Order Notes

Line 10 Have you completed a satisfactory Personal Risk Assessment? Yes() No ().
If the answer is NO stop what you are doing, complete an IP Safety Contact Slip and see your supervisor for further instructions.
=====

COMPLAINT:

CAUSE:

CORRECTION: installed step rail.

Activity Header						
Activity:5 999 TOTAL VEHICLE						
Activity Note: Personal Risk Assessment						
Reason for Repair: 05 Inspection, Routine						
Work Accomplished: 06 Inspect						
Part Failure:						
Activity Comments:						
Activity Parts						
No Data Available						
Activity Labor						
No Data Available						
Activity Sublet						
No Data Available						
Activity Checklist						
Check List						
5 Desc: Personal Risk Assessment						
Task: PRA and Meter Readings Performed by: LCAPAZZOLI Performed on: 28-AUG-15						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		LCAPAZZOLI	Aug 28, 2015 5:48:24 PM	No	
20 - Miles			LCAPAZZOLI	Aug 28, 2015 5:48:24 PM	No	
Activity Sub Total						

	Activity 5 Sub Total	
	Parts:	0.00
	Labor:	0.00
	Labor Hours:	0.00
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 2



Work Order No. 26280746
Invoice No. 55345 - 26280746

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Install driver side step rail		Ford E450 Champion Challenger	
Requested By:	DCARTER	Status:	40 - Closed (40)
Created By:	DCARTER	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	15,868 - DH

Activity Header															
Activity: 15 079 DEVICES, SAFETY/STABILITY, TRAILER															
Activity Note: Install driver side step rail															
Reason for Repair: 38 Warranty															
Work Accomplished:															
Part Failure:															
Activity Comments:															
Activity Parts															
No Data Available															
Activity Labor															
No Data Available															
Activity Sublet															
No Data Available															
Activity Checklist															
No Data Available															
No Data Available															
Activity Sub Total															
<table><tr><td colspan="2">Activity 15 Sub Total</td></tr><tr><td>Parts:</td><td>0.00</td></tr><tr><td>Labor:</td><td>0.00</td></tr><tr><td>Labor Hours:</td><td>0.00</td></tr><tr><td>Sublet Parts:</td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td>0.00</td></tr></table>		Activity 15 Sub Total		Parts:	0.00	Labor:	0.00	Labor Hours:	0.00	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	0.00
Activity 15 Sub Total															
Parts:	0.00														
Labor:	0.00														
Labor Hours:	0.00														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	0.00														
Work Order Footer															
<table><tr><td colspan="2">Work Order 26280746 Total</td></tr><tr><td>Parts:</td><td>0.00</td></tr><tr><td>Labor:</td><td>0.00</td></tr><tr><td>Labor Hours:</td><td>0.00</td></tr><tr><td>Sublet Parts:</td><td>0.00</td></tr><tr><td>Sublet Labor:</td><td>0.00</td></tr><tr><td>Activity Sub Total</td><td>0.00</td></tr></table>		Work Order 26280746 Total		Parts:	0.00	Labor:	0.00	Labor Hours:	0.00	Sublet Parts:	0.00	Sublet Labor:	0.00	Activity Sub Total	0.00
Work Order 26280746 Total															
Parts:	0.00														
Labor:	0.00														
Labor Hours:	0.00														
Sublet Parts:	0.00														
Sublet Labor:	0.00														
Activity Sub Total	0.00														



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 26066638
Invoice No. 55345 - 26066638

Client Department:

Department: 55345M

Work Order Description

PM A

Requested By: DCARTER

Created By: DCARTER

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 15,868 - DH

Chronology

Reported	Aug 27, 2015 12:00:00 AM	Aug 27, 2015 12:00:00 AM
Started	Aug 28, 2015 2:52:00 PM	
Completed	Aug 28, 2015 3:59:00 PM	Aug 28, 2015 3:59:00 PM
Down Time		

Work Order Notes

Line 10 COMPLAINT:

CAUSE:

CORRECTION: Line 20 Perform pm. Replace oil and oil filter

Parts. 6 quarts oil. 5w-20. 1 oil filter. B329

Activity Header

Activity: 10 999 TOTAL VEHICLE

Activity Note: LIGHT MEDIUM DUTY PMI

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: A PM Level A

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
28-Aug-15	B329	GOING OUT OF SERVICE DO NOT ORDER USE B329 IN THE FLEET ORG FILTER, OIL	1	1.52	1.52

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
28-Aug-15	Capazzoli, Louis	1	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

10 Desc: LIGHT MEDIUM DUTY PMI

Task: First Transit Light-Medium Duty PMI Performed by: LCAPAZZOLI Performed on: 28-AUG-15

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10,000 - SECTION 1 Preparation and Drive	Done		LCAPAZZOLI	Aug 28, 2015	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
On (In Lot) Inspection				3:50:50 PM		
10,100 - Safety Inspection	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
10,110 - FRA Check Drivers Pre-trip or DVIR/EVIR & Authorization Forms	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
10,120 - FRA Check All Warning Lights and Alarms	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
10,130 - FRA Check Automatic Transmission Neutral Start Operation	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
10,140 - Check Service Brakes	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
10,150 - FRA Start Engine and Listen for Any Unusual Noises	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
10,160 - FRA Check Instruments and Horns	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
10,170 - Check Fast Idle	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
10,180 - Check Starter Protection Circuit	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
10,190 - Check Reverse Warning System	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
11,100 - Check Parking Brake	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
11,110 - Check HVAC Switches and Other Controls	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
11,120 - FRA Inspect Windshields, Mirror and Sun Visor Condition	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
11,130 - FRA Check Wiper and Washer Operation	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
11,140 - Road Test: Check for Proper Operation	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
11,150 - Perform Brake Test	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
11,161 - FRA Check/Record Oil Pressure / @1500 rpm	Pounds per Square Inch	n/a	LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
11,162 - FRA Check/Record Water Temperature	Degree Fahrenheit	n/a	LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
11,170 - FRA Check Door Operation	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
11,180 - FRA Check Operation of All Other Accessories	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
20,000 - SECTION 2 Interior Circle Inspection	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
20,210 - Check Condition of Operator's Area	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
20,220 - Check Accelerator and Brake Pedals	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
20,230 - FRA Check Wiring Under Dash	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
20,240 - FRA Check Interior Lights	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
20,250 - FRA Check Interior Electrical Panels	Done		LCAPAZZOLI	Aug 28, 2015	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
				3:50:50 PM		
20,260 - Check Stop Request System	-	n/a	LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
20,270 - Check Fare Box Mounting (If Applicable)	-	n/a	LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
20,280 - Check Seats, Seat Belts, Hand Rails and Floor Covering	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
20,290 - Check for Physical Damage, Water Leaks, and Graffiti	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
22,100 - Check Emergency Windows and Glass Condition	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
22,110 - Check Emergency Hatches	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
22,120 - Check All Safety Equipment	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
30,000 - SECTION 3 Exterior Circle Inspection	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
30,310 - Check Passenger Doors	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
30,320 - Inspect Step-well and Hand Rails	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
30,330 - Check Wheelchair Lift Operation	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
30,340 - FRA Check Destination Sign and Run Box	-	n/a	LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
30,350 - FRA Inspect Mirror and Mountings	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
30,360 - Check for Physical Damage and Decals	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
30,370 - Check Wiper Blade and Arm Condition	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
30,380 - Check Exterior Compartment Doors	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
30,390 - FRA Check Fuel Tank Cap	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
33,100 - Check Lights and Reflectors	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
33,110 - Check License Plate, Permits and State Inspection Decals	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
40,000 - SECTION 4 Engine Compartment Inspection	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
40,410 - FRA Check Engine Compartment/Condition for Fire Risk	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
40,420 - Check Hood	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
40,430 - Check Fan, Shroud and Radiator	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
40,440 - Test Coolant System Using Test Strips and Record Results	-	n/a	LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
40,441 - Inhibitor Test Pass or Fail (Indicate with a Yes or No)	No	n/a	LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
40,442 - Freeze Point	Degree	n/a	LCAPAZZOLI	Aug 28, 2015	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
	Fahrenheit			3:50:50 PM		
40,450 - FRA Check Coolant Recovery System Condition & for Leaks	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
40,460 - Record Antifreeze Protection Level Using Refractometer	-	n/a	LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
40,461 - Refractometer Reading	Degree Fahrenheit	n/a	LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
40,470 - Pressure Test Cooling System and Check for Leaks	-	n/a	LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
40,480 - FRA Check Coolant Hose Condition	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
40,490 - FRA Check Alternator Mount and Condition	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
44,100 - FRA Check Fuel Control and Transmission Connections	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
44,110 - FRA Check Master Cylinder Fluid Level	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
44,120 - FRA Check All Belts for Condition, Alignment and Tension	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
44,130 - FRA Check Exhaust System	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
44,140 - FRA Check Intake System	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
44,150 - FRA Inspect Turbocharger	-	n/a	LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
44,160 - FRA Inspect Power Steering and Hydraulic Fluid	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
44,170 - FRA Check All Engine or Belt Driven Components	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
44,180 - FRA Check for Leaks	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
44,190 - FRA Perform Battery Inspection	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
44,200 - FRA Check Battery Box Corrosion, Cables and Hold-Downs	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
50,000 - SECTION 5 Steering System Inspection	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
50,510 - Check Entire Steering System	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
60,000 - SECTION 6 Tires and Wheel Inspection	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
60,610 - FRA Check and Record Air Pressure	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
60,611 - Air Pressure RF	65 Pounds per Square Inch		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
60,612 - Air Pressure LF	65 Pounds per Square Inch		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
60,613 - Air Pressure RRO	70 Pounds per Square Inch		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
60,614 - Air Pressure RRI	70 Pounds per Square Inch		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
60,615 - Air Pressure LRI	70 Pounds per		LCAPAZZOLI	Aug 28, 2015	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
	Square Inch			3:50:50 PM		
60,616 - Air Pressure LRO	70 Pounds per Square Inch		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
60,620 - Check Valve Stems and Caps	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
60,630 - Check and Record Tread Depth	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
60,631 - Tread Depth RF	12 32nds of an inch		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
60,632 - Tread Depth LF	12 32nds of an inch		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
60,633 - Tread Depth RRO	4 32nds of an inch		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
60,634 - Tread Depth RRI	4 32nds of an inch		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
60,635 - Tread Depth LRI	4 32nds of an inch		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
60,636 - Tread Depth LRO	4 32nds of an inch		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
60,640 - Check for Mismatched Tread or Casing Design	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
60,650 - Check Sidewall Wear	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
60,660 - Inspect for Cuts and Tears	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
60,670 - Check Dual Mating With Square	-	n/a	LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
60,680 - Check Wheels for Cracks and Loose Lugs	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
60,690 - Check Tires for Irregular or Alignment Wear	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
66,100 - FRA Check Outer Hubs for Leaks	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
70,000 - SECTION 7 Under Vehicle Inspection	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
70,710 - Check Vibration Damper	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
70,720 - Check Engine and Transmission Mounts	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
70,730 - FRA Check Starter	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
70,740 - FRA Check Bottom of Engine for Fluid Leaks	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
70,750 - FRA Check Transmission for Leaks	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
70,760 - FRA Check Differential Breather and Fluid	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
70,770 - FRA Check Exhaust System	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
70,780 - Check Driveline, U-joint and Slip Yokes	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
70,790 - Check All Body Mounts and Chassis	Done		LCAPAZZOLI	Aug 28, 2015	No	

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
Frame				3:50:50 PM		
77,100 - FRA Check Security, Integrity and Length of Ground Straps	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
77,110 - FRA Check Fuel Tank	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
77,120 - Check Suspension Components	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
77,130 - FRA Check Brake Pad Thickness and Rotor for Wear	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
77,131 - Brake Pad Thickness LF	10 Inch		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
77,132 - Brake Pad Thickness RF	10 Inch		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
77,133 - Brake Pad Thickness LR	10 Inch		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
77,134 - Brake Pad Thickness RR	10 Inch		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
77,135 - Brake Rotor LF	Inch	n/a	LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
77,136 - Brake Rotor RF	Inch	n/a	LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
77,137 - Brake Rotor LR	Inch	n/a	LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
77,138 - Brake Rotor RR	Inch	n/a	LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
77,140 - FRA Check Brake Hoses	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
77,150 - Check King Pins	-	n/a	LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
77,160 - FRA Check for Loose or Noisy Wheel Bearings	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
80,000 - SECTION 8 PMI Report Completion	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
80,810 - Completion of PMI Report	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
90,000 - SECTION 9 Completion of PMI	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	
90,910 - Vehicle Returned to predetermined location	Done		LCAPAZZOLI	Aug 28, 2015 3:50:50 PM	No	

Activity Sub Total

Activity 10 Sub Total	
Parts:	1.52
Labor:	0.00
Labor Hours:	1.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	1.52



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 26066638
Invoice No. 55345 - 26066638

Client Department:

Department: 55345M

Work Order Description

PM A

Requested By: DCARTER

Created By: DCARTER

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 15,868 - DH

Activity Header

Activity: 20 999 TOTAL VEHICLE

Activity Note: PM A SERVICE

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: A PM Level A

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
28-Aug-15	Capazzoli,Louis	0.03	0	0
28-Aug-15	Capazzoli,Louis	2	0	0

Activity Sublet

No Data Available

Activity Checklist

Check List

20 Desc: PM A SERVICE

Task: PM A SERVICE Performed by: LCAPAZZOLI Performed on: 28-AUG-15

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
100,000 - "A" PMI SERVICING ITEMS	Done		LCAPAZZOLI	Aug 28, 2015 3:58:44 PM	No	
101,000 - FRA Change Oil Filters	Yes		LCAPAZZOLI	Aug 28, 2015 3:58:44 PM	No	
102,000 - FRA Drain Engine Oil	Yes		LCAPAZZOLI	Aug 28, 2015 3:58:44 PM	No	
103,000 - FRA Check Transmission Fluid	Done		LCAPAZZOLI	Aug 28, 2015 3:58:44 PM	No	
104,000 - Lubricate Chassis	Done		LCAPAZZOLI	Aug 28, 2015 3:58:44 PM	No	
105,000 - Replace or Clean A/C Filters	Done		LCAPAZZOLI	Aug 28, 2015 3:58:44 PM	No	
107,000 - FRA Change Primary Fuel Filter	No	n/a	LCAPAZZOLI	Aug 28, 2015 3:58:44 PM	No	
108,000 - Lube all pivoting Mechanisms	Done		LCAPAZZOLI	Aug 28, 2015 3:58:44 PM	No	

Activity Sub Total

Activity 20 Sub Total

Parts:

0.00

	Labor:	0.00
	Labor Hours:	2.03
	Sublet Parts:	0.00
	Sublet Labor:	0.00
	Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 26066638
Invoice No. 55345 - 26066638

Client Department:

Department: 55345M

Work Order Description

PM A

Requested By: DCARTER

Created By: DCARTER

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 15,868 - DH

Activity Header

Activity: 30 999 TOTAL VEHICLE

Activity Note: PRAMETER

Reason for Repair: 05 Inspection, Routine

Work Accomplished: 06 Inspect

Part Failure:

Activity Comments:

Activity Parts

No Data Available

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

Check List

30 Desc: PRAMETER

Task: PRA and Meter Readings Performed by: LCAPAZZOLI Performed on: 28-AUG-15

Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		LCAPAZZOLI	Aug 28, 2015 2:52:08 PM	No	
20 - Miles			LCAPAZZOLI	Aug 28, 2015 2:52:08 PM	No	

Activity Sub Total

Activity 30 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00

Work Order Footer

Work Order 26066638 Total

Parts:	1.52
Labor:	0.00
Labor Hours:	3.03
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	1.52



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 1



Work Order No. 26250050
Invoice No. 55345 - 26250050

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
Rear Ac not blowing on low speed		Ford E450 Champion Challenger	
Requested By:	FSIMON	Status:	40 - Closed (40)
Created By:	FSIMON	Priority:	2 - Medium
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	13,998 - DH

Chronology		
Reported	Aug 6, 2015 3:50:51 PM	Aug 6, 2015 3:50:51 PM
Started	Aug 10, 2015 12:00:00 AM	
Completed	Aug 10, 2015 10:55:00 AM	Aug 10, 2015 10:55:00 AM
Down Time		

Work Order Notes

Line 10 Have you completed a satisfactory Personal Risk Assessment? Yes() No ().
If the answer is NO stop what you are doing, complete an IP Safety Contact Slip and see your supervisor for further instructions.
=====

COMPLAINT:Rear AC is not blowing cold

CAUSE Faulty resistors

CORRECTION:Resistors replaced
Rear AC diagnosed
Resistors found faulty
Blowers deinstalled
Resistors replaced by good used ones
Finally rear A/C blowing Cold Line 20 No new parts used

Activity Header				
Activity:5 999 TOTAL VEHICLE				
Activity Note: Personal Risk Assessment				
Reason for Repair:		05 Inspection, Routine		
Work Accomplished:		06 Inspect		
Part Failure:				
Activity Comments:				
Activity Parts				
No Data Available				
Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
10-Aug-15	Simon,Fritz	1.15	0	0
Activity Sublet				
No Data Available				
Activity Checklist				

Check List						
5 Desc: Personal Risk Assessment						
Task: PRA and Meter Readings Performed by: FSIMON Performed on: 10-AUG-15						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done		FSIMON	Aug 10, 2015 10:50:35 AM	No	
20 - Miles			FSIMON	Aug 10, 2015 10:50:35 AM	No	
Activity Sub Total			Activity 5 Sub Total Parts: 0.00 Labor: 0.00 Labor Hours: 1.15 Sublet Parts: 0.00 Sublet Labor: 0.00 Activity Sub Total 0.00			
Work Order Footer			Work Order 26250050 Total Parts: 0.00 Labor: 0.00 Labor Hours: 1.15 Sublet Parts: 0.00 Sublet Labor: 0.00 Activity Sub Total 0.00			



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 25835789
Invoice No. 55345 - 25835789

Client Department:

Department: 55345M

Work Order Description

PM B

Requested By: DCARTER

Created By: DCARTER

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 11,247 - DH

Chronology

Reported	Jun 16, 2015 12:00:00 AM	Jun 16, 2015 12:00:00 AM
Started	Jun 16, 2015 12:00:00 AM	
Completed	Jun 17, 2015 10:26:03 AM	Jun 17, 2015 10:26:03 AM
Down Time		

Work Order Notes

Line 10 COMPLAINT:

CAUSE:

CORRECTION: Line 20 PM-B SERVICE COMPLETED
CHECK TIRES INSPECT BRALES, LUBRICATE CHASSIS ON VEHICLE

Activity Header

Activity: 10 999 TOTAL VEHICLE

Activity Note: PM B INSPECTION

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: B PM Level B

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
17-Jun-15	B329	GOING OUT OF SERVICE DO NOT ORDER USE B329 IN THE FLEET ORG FILTER, OIL	1	1.77	1.77

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
16-Jun-15	Owens, Arthur	3	0	0

Activity Sublet

No Data Available

Activity Checklist

No Data Available

No Data Available

Activity Sub Total

Activity 10 Sub Total

Parts:	1.77
Labor:	0.00
Labor Hours:	3.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	1.77



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 25835789
Invoice No. 55345 - 25835789

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
PM B		Ford E450 Champion Challenger	
Requested By:	DCARTER	Status:	40 - Closed (40)
Created By:	DCARTER	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	11,247 - DH

Activity Header
Activity:30 999 TOTAL VEHICLE
Activity Note: PRAMETER
Reason for Repair: 05 Inspection, Routine
Work Accomplished: 06 Inspect
Part Failure:
Activity Comments:

Activity Parts
No Data Available

Activity Labor
No Data Available

Activity Sublet
No Data Available

Check List						
30 Desc: PRAMETER						
Task: PRA and Meter Readings Performed by: Performed on:						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done				No	
20 - Miles					No	

Activity Sub Total		Activity 30 Sub Total	
		Parts:	0.00
		Labor:	0.00
		Labor Hours:	0.00
		Sublet Parts:	0.00
		Sublet Labor:	0.00
		Activity Sub Total	0.00

Work Order Footer		Work Order 25835789 Total	
		Parts:	1.77
		Labor:	0.00
		Labor Hours:	3.00
		Sublet Parts:	0.00
		Sublet Labor:	0.00
		Activity Sub Total	1.77



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 25738615
Invoice No. 55345 - 25738615

Client Department:

Department: 55345M

Work Order Description

PM A

Requested By: KCONCEPCION

Created By: KCONCEPCION

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 6,744 - DH

Chronology

Reported	Apr 16, 2015 12:00:00 AM	Apr 16, 2015 12:00:00 AM
Started	Apr 16, 2015 12:00:00 AM	
Completed	Apr 17, 2015 10:31:00 AM	Apr 17, 2015 10:31:00 AM
Down Time		

Work Order Notes

Line 10 COMPLAINT:

CAUSE:

CORRECTION: Line 20 PMB SERVICE PERFORM
REPLACED OIL FILTER
CHANGED ENGINE OIL
WASHED FLUID
ROTATE AND TORQUE TIRES TO SPEC.

Activity Header

Activity: 10 999 TOTAL VEHICLE

Activity Note: PM A INSPECTION

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: A PM Level A

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
17-Apr-15	B329	GOING OUT OF SERVICE DO NOT ORDER USE B329 IN THE FLEET ORG FILTER, OIL	1	1.63	1.63

Activity Labor

Booked Date	Technician	Hours	Shop Rate	Extended
16-Apr-15	Owens, Arthur	3	0	0

Activity Sublet

No Data Available

Activity Checklist

No Data Available

No Data Available

Activity Sub Total

Activity 10 Sub Total

Parts:	1.63
Labor:	0.00
Labor Hours:	3.00
Sublet Parts:	0.00
Sublet Labor:	0.00

	Activity Sub Total	1.63
--	---------------------------	-------------



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 25738615
Invoice No. 55345 - 25738615

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
PM A		Ford E450 Champion Challenger	
Requested By:	KCONCEPCION	Status:	40 - Closed (40)
Created By:	KCONCEPCION	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	6,744 - DH

Activity Header
Activity:30 999 TOTAL VEHICLE
Activity Note: PRAMETER
Reason for Repair: 05 Inspection, Routine
Work Accomplished: 06 Inspect
Part Failure:
Activity Comments:

Activity Parts
No Data Available

Activity Labor
No Data Available

Activity Sublet
No Data Available

Activity Checklist

Check List						
30 Desc: PRAMETER						
Task: PRA and Meter Readings Performed by: Performed on:						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done				No	
20 - Miles					No	

Activity Sub Total		Activity 30 Sub Total	
		Parts:	0.00
		Labor:	0.00
		Labor Hours:	0.00
		Sublet Parts:	0.00
		Sublet Labor:	0.00
		Activity Sub Total	0.00

Work Order Footer		Work Order 25738615 Total	
		Parts:	1.63
		Labor:	0.00
		Labor Hours:	3.00
		Sublet Parts:	0.00
		Sublet Labor:	0.00
		Activity Sub Total	1.63



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 1 of 3



Work Order No. 24687413
Invoice No. 55345 - 24687413

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
PM A		Ford E450 Champion Challenger	
Requested By:	DKNOTT	Status:	40 - Closed (40)
Created By:	DKNOTT	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	2,232 - DH

Chronology		
Reported	Mar 17, 2015 4:12:56 PM	Mar 17, 2015 4:12:56 PM
Started	Mar 18, 2015 12:00:00 AM	
Completed	Mar 18, 2015 8:23:39 AM	Mar 18, 2015 8:23:39 AM
Down Time		

Work Order Notes

Line 10 COMPLAINT:

CAUSE:

CORRECTION: Line 20 part#FL5Z-6730-AB

Activity Header				
Activity:10 999 TOTAL VEHICLE				
Activity Note: PM A INSPECTION				
Reason for Repair: 08 Preventive Maintenance				
Work Accomplished: A PM Level A				
Part Failure:				
Activity Comments:				
Activity Parts				
No Data Available				
Activity Labor				
Booked Date	Technician	Hours	Shop Rate	Extended
18-Mar-15	Owens,Arthur	2.5	0	0
Activity Sublet				
No Data Available				
Activity Checklist				
No Data Available				
No Data Available				
Activity Sub Total				
			Activity 10 Sub Total	
			Parts:	0.00
			Labor:	0.00
			Labor Hours:	2.50
			Sublet Parts:	0.00
			Sublet Labor:	0.00
			Activity Sub Total	0.00



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 2 of 3



Work Order No. 24687413
Invoice No. 55345 - 24687413

Client Department:

Department: 55345M

Work Order Description

PM A

Requested By: DKNOTT

Created By: DKNOTT

Assigned To:

Class: WO - WORK ORDER

Arrangement: Unassigned

Potential Warranty: No

Equipment No.: 4514-P

VIN: 1FDFE4FS7EDB17176

Ford E450 Champion Challenger

Status: 40 - Closed (40)

Priority: 1 - Low

Driver:

Phone:

ETA:

Meter: 2,232 - DH

Activity Header

Activity: 20 999 TOTAL VEHICLE

Activity Note: PM A SERVICE

Reason for Repair: 08 Preventive Maintenance

Work Accomplished: A PM Level A

Part Failure:

Activity Comments:

Activity Parts

Booked Date	Part Number	Part Description	Quantity	Each	Extended
22-Sep-15	F757-6730-BA	PLUG, DRAIN, OIL, ENGINE	1	6.66	6.66

Activity Labor

No Data Available

Activity Sublet

No Data Available

Activity Checklist

No Data Available

No Data Available

Activity Sub Total

Activity 20 Sub Total

Parts:	6.66
Labor:	0.00
Labor Hours:	0.00
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	6.66



Work Order
55345 - Palm Tran Connection
v 3.0
Activity 3 of 3



Work Order No. 24687413
Invoice No. 55345 - 24687413

Client Department:

Department:	55345M	Equipment No.:	4514-P
Work Order Description		VIN:	1FDFE4FS7EDB17176
PM A		Ford E450 Champion Challenger	
Requested By:	DKNOTT	Status:	40 - Closed (40)
Created By:	DKNOTT	Priority:	1 - Low
Assigned To:		Driver:	
Class:	WO - WORK ORDER	Phone:	
Arrangement:	Unassigned	ETA:	
Potential Warranty:	No	Meter:	2,232 - DH

Activity Header
Activity:30 999 TOTAL VEHICLE
Activity Note: PRAMETER
Reason for Repair: 05 Inspection, Routine
Work Accomplished: 06 Inspect
Part Failure:
Activity Comments:

Activity Parts
No Data Available

Activity Labor
No Data Available

Activity Sublet
No Data Available

Check List						
30 Desc: PRAMETER						
Task: PRA and Meter Readings Performed by: Performed on:						
Inspection Item	RESULTS	Inspector's Note	Inspector	Date Inspected	Follow Up Needed	Follow Up WO
10 - Have you successfully completed the Personal Risk Assessment?	Done				No	
20 - Miles					No	

Activity Sub Total		Activity 30 Sub Total	
		Parts:	0.00
		Labor:	0.00
		Labor Hours:	0.00
		Sublet Parts:	0.00
		Sublet Labor:	0.00
		Activity Sub Total	0.00

Work Order Footer		Work Order 24687413 Total	
		Parts:	6.66
		Labor:	0.00
		Labor Hours:	2.50
		Sublet Parts:	0.00
		Sublet Labor:	0.00
		Activity Sub Total	6.66



WorkOrder
55345 Palm Tran Connection
v 2.2
Page 1 of 9



WorkOrder: 51447121
Invoice Number: 55345-51447121

Client Department:

MRC:	55345M	Equipment:	4514-P
WO Desc:			Ford E450 Champion Challenger
PM A		VIN:	1FDFE4FS7EDB17176
Requested By:	RGASPARD	Status:	40
Created By:	RGASPARD	Priority:	1
Class:	WO	Driver:	
Arrangement:	Unassigned	Phone:	
Potential Warranty:	No	ETA:	

Chronology		
Reported	Jul 19, 2018	11:19 AM
Started	Jul 24, 2018	
Completed	Jul 24, 2018	12:14 AM
Down Time		

Meter	Reading	UOM
WO		DH
Life	117,185	DH
System	117,043	DH

WorkOrder Notes

Line	Comment
10	COMPLAINT:pmA CAUSE:Service CORRECTION:Perform pmA Service Oil filter B329 qty1 Engine oil 5w20 qty 7 Qts Fixed right front tire patched and balanced tire Torque wheel 140 lbs second torque 140 lbs

Activity: 10 **999 TOTAL VEHICLE**
Activity Note: Light Medium Duty PMI
Reason for Repair: 08 - Preventive Maintenance
Work Accomplished: A - PM Level A
Part Failure: -

Activity Comments

Parts Issued

Date	Part Number	Description	Qty	Each	Extended
------	-------------	-------------	-----	------	----------

Labor Posted

Date	Technician	Hours	Rate	Extended
24-Jul-18	Gaspard,Ronald	1.53	0.00	0.00

Activity 10 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours: 1.53	
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00

Activity: 20 **999 TOTAL VEHICLE**
Activity Note: PM A
Reason for Repair: 08 - Preventive Maintenance
Work Accomplished: A - PM Level A
Part Failure: -

Activity Comments

Parts Issued



WorkOrder
55345 Palm Tran Connection
v 2.2
Page 1 of 9



WorkOrder: 51534064
Invoice Number: 55345-51534064

Client Department:

MRC: 55345M

WO Desc:

PM A

Requested By:

RGASPARD

Created By:

RGASPARD

Class:

WO

Arrangement:

Unassigned

Potential Warranty:

No

Equipment:

4514-P

Ford E450 Champion Challenger

VIN:

1FD4E4FS7EDB17176

Status:

40

Priority:

1

Driver:

Phone:

ETA:

Chronology		
Reported	Aug 17, 2018	11:28 AM
Started	Aug 19, 2018	
Completed	Aug 19, 2018	6:06 PM
Down Time		

Meter	Reading	UOM
WO		DH
Life	121,344	DH
System	121,577	DH

WorkOrder Notes

Line	Comment
10	COMPLAINT: Performed PM service CAUSE: Preventive Maintenance CORRECTION: performed service, tires, brakes good at this time Parts B329qty 1

Activity: 10



999 TOTAL VEHICLE

Activity Note: Light Medium Duty PMI

Reason for Repair: 08 - Preventive Maintenance

Work Accomplished: A - PM Level A

Part Failure: -

Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
------	-------------	-------------	------	------	----------

Labor Posted

Date	Technician	Hours	Rate	Extended
19-Aug-18	Owens,Arthur	1.00	0.00	0.00

Activity 10 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours: 1.00	
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00

Activity: 20



999 TOTAL VEHICLE

Activity Note: PM A

Reason for Repair: 08 - Preventive Maintenance

Work Accomplished: A - PM Level A

Part Failure: -

Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
19-Aug-18	B329(F)	FILTER, OIL SAME AS LF3681	1.00	1.96	1.96



WorkOrder
55345 Palm Tran Connection
v 2.2
Page 1 of 9



WorkOrder: 51722137
Invoice Number: 55345-51722137

Client Department:

MRC: 55345M
WO Desc: PM A
Requested By: RGASPARD
Created By: RGASPARD
Class: WO
Arrangement: Unassigned
Potential Warranty: No

Equipment: 4514-P
Ford E450 Champion Challenger
VIN: 1FDFE4FS7EDB17176
Status: 40
Priority: 1
Driver:
Phone:
ETA:

Chronology		
Reported	Oct 9, 2018	12:49 PM
Started	Oct 9, 2018	
Completed	Oct 9, 2018	11:55 PM
Down Time		

Meter	Reading	UOM
WO		DH
Life	130,030	DH
System	130,270	DH

WorkOrder Notes

Line	Comment
10	COMPLAINT:pmA CAUSE:Service CORRECTION:Perform pmA Service Oil filter B329 Qty1 Engine oil 5w20 qty 7 Qts

Activity: 10  **999 TOTAL VEHICLE**
Activity Note: Light Medium Duty PMI
Reason for Repair: 08 - Preventive Maintenance
Work Accomplished: A - PM Level A
Part Failure: -

Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
------	-------------	-------------	------	------	----------

Labor Posted

Date	Technician	Hours	Rate	Extended
09-Oct-18	Gaspard,Ronald	1.57	0.00	0.00

Activity 10 Sub Total

Parts: 0.00
Labor: 0.00
Labor Hours: 1.57
Sublet Parts: 0.00
Sublet Labor: 0.00
Activity Sub Total 0.00

Activity: 20  **999 TOTAL VEHICLE**
Activity Note: PM A
Reason for Repair: 08 - Preventive Maintenance
Work Accomplished: A - PM Level A
Part Failure: -

Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
09-Oct-18	B329(F)	FILTER, OIL SAME AS LF3681	1.00	1.96	1.96



WorkOrder
55345 Palm Tran Connection
v 2.2
Page 1 of 9



WorkOrder: 51797823
Invoice Number: 55345-51797823

Client Department:

MRC: 55345M

Equipment: 4514-P

WO Desc:
PM A

Ford E450 Champion Challenger
1FDFE4FS7EDB17176

Requested By: RGASPARD

VIN: 40

Created By: RGASPARD

Status: 40

Class: WO

Priority: 1

Arrangement: Unassigned

Driver:

Potential Warranty: No

Phone:

ETA:

Chronology		
Reported	Nov 1, 2018	1:04 PM
Started	Nov 1, 2018	
Completed	Nov 1, 2018	11:51 PM
Down Time		

Meter	Reading	UOM
WO		DH
Life	134,285	DH
System	134,502	DH

WorkOrder Notes

Line	Comment
10	COMPLAINT:pmA CAUSE:Service CORRECTION:Perform pmA Service Oil filter B329 Qty1 Engine oil 5w20 qty 7 Qts

Activity: 10 **999 TOTAL VEHICLE**
Activity Note: Light Medium Duty PMI
Reason for Repair: 08 - Preventive Maintenance
Work Accomplished: A - PM Level A
Part Failure: -

Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
------	-------------	-------------	------	------	----------

Labor Posted

Date	Technician	Hours	Rate	Extended
01-Nov-18	Gaspard,Ronald	1.53	0.00	0.00

Activity 10 Sub Total

Parts: 0.00
Labor: 0.00
Labor Hours: 1.53
Sublet Parts: 0.00
Sublet Labor: 0.00
Activity Sub Total 0.00

Activity: 20 **999 TOTAL VEHICLE**
Activity Note: PM A
Reason for Repair: 08 - Preventive Maintenance
Work Accomplished: A - PM Level A
Part Failure: -

Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
01-Nov-18	B329(F)	FILTER, OIL SAME AS LF3681	1.00	1.96	1.96



WorkOrder
55345 Palm Tran Connection
v 2.2
Page 1 of 9



WorkOrder: 51946226
Invoice Number: 55345-51946226

Client Department:

MRC: 55345M
WO Desc: PM A
Requested By: DARTHURS
Created By: DARTHURS
Class: WO
Arrangement: Unassigned
Potential Warranty: No

Equipment: 4514-P
Ford E450 Champion Challenger
1FDFE4FS7EDB17176
VIN:
Status: 40
Priority: 1
Driver:
Phone:
ETA:

Chronology		
Reported	Dec 24, 2018	10:29 AM
Started	Dec 24, 2018	
Completed	Dec 24, 2018	10:34 PM
Down Time		

Meter	Reading	UOM
WO		DH
Life	143,068	DH
System	143,247	DH

WorkOrder Notes

Line	Comment
10	COMPLAINT: PMA CAUSE: Service due CORRECTION: Performed and completed pma Changed engine oil and replaced engine oil filter

Activity: 10 **999 TOTAL VEHICLE**
Activity Note: Light Medium Duty PMI
Reason for Repair: 08 - Preventive Maintenance
Work Accomplished: A - PM Level A
Part Failure: -

Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
------	-------------	-------------	------	------	----------

Labor Posted

Date	Technician	Hours	Rate	Extended
24-Dec-18	Delva, Terry	0.50	0.00	0.00

Activity 10 Sub Total

Parts: 0.00
Labor: 0.00
Labor Hours: 0.50
Sublet Parts: 0.00
Sublet Labor: 0.00
Activity Sub Total 0.00

Activity: 20 **999 TOTAL VEHICLE**
Activity Note: PM A
Reason for Repair: 08 - Preventive Maintenance
Work Accomplished: A - PM Level A
Part Failure: -


Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
24-Dec-18	B329(F)	FILTER, OIL SAME AS LF3681	1.00	1.96	1.96



WorkOrder
55345 Palm Tran Connection
v 2.2
Page 1 of 9



WorkOrder: 52021846
Invoice Number: 55345-52021846

Client Department:

MRC: 55345M
WO Desc: PM A
Requested By: TDELVA
Created By: TDELVA
Class: WO
Arrangement: Unassigned
Potential Warranty: No

Equipment: 4514-P
Ford E450 Champion Challenger
VIN: 1FDFE4FS7EDB17176
Status: 40
Priority: 1
Driver:
Phone:
ETA:

Chronology		
Reported	Jan 24, 2019	12:28 PM
Started	Jan 24, 2019	
Completed	Jan 24, 2019	10:57 PM
Down Time		

Meter	Reading	UOM
WO		DH
Life	147,440	DH

WorkOrder Notes

Line	Comment
10	COMPLAINT: PMA Service CAUSE: Service Due by Mileage. CORRECTION: Change Oil & Filter ,lube all Pivoting Points. Check brakes . Clean batteries. Replace drain plugs. Replace A/C Filter. Parts # B329 Qty (1) Parts# 65266 Qty (1) Oil 5W20QTY (7.0) Qt

Activity: **10** **999 TOTAL VEHICLE**
Activity Note: Light Medium Duty PMI
Reason for Repair: 08 - Preventive Maintenance
Work Accomplished: A - PM Level A
Part Failure: -

Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
------	-------------	-------------	------	------	----------

Labor Posted

Date	Technician	Hours	Rate	Extended
24-Jan-19	Arthurs,Durvin	1.50	0.00	0.00

Activity 10 Sub Total

Parts: 0.00
Labor: 0.00
Labor Hours: 1.50
Sublet Parts: 0.00
Sublet Labor: 0.00
Activity Sub Total 0.00

Activity: **20** **999 TOTAL VEHICLE**
Activity Note: PM A
Reason for Repair: 08 - Preventive Maintenance
Work Accomplished: A - PM Level A
Part Failure: -

Activity Comments

Parts Issued



WorkOrder
55345 Palm Tran Connection
v 2.2
Page 1 of 9



WorkOrder: 52189555
Invoice Number: 55345-52189555

Client Department:

MRC: 55345M

Equipment: 4514-P

WO Desc:

Ford E450 Champion Challenger

PM A

VIN: 1FDFE4FS7EDB17176

Requested By: CVERGARA

Status: 32

Created By: CVERGARA

Priority: 1

Class: WO

Driver:

Arrangement: Unassigned

Phone:

Potential Warranty: No

ETA:

Chronology		
Reported	Mar 14, 2019	11:57 AM
Started		
Completed	Mar 15, 2019	9:07 AM
Down Time		

Meter	Reading	UOM
WO		DH
Life	156,090	DH
System	156,090	DH

WorkOrder Notes

Line	Comment
10	COMPLAINT:
	CAUSE:
	CORRECTION:
20	PmA
	Preventive maintenance
	Perform Service lube all Pivoting Points Cross Rotate Tires Completed

Activity: 10



999 TOTAL VEHICLE

Activity Note: Light Medium Duty PMI

Reason for Repair: 08 - Preventive Maintenance

Work Accomplished: A - PM Level A

Part Failure: -

Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
------	-------------	-------------	------	------	----------

Labor Posted

Date	Technician	Hours	Rate	Extended
------	------------	-------	------	----------

Activity 10 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours: 0.00	
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00

Activity: 20



999 TOTAL VEHICLE

Activity Note: PM A

Reason for Repair: 08 - Preventive Maintenance

Work Accomplished: A - PM Level A

Part Failure: -

Activity Comments

Parts Issued

**WorkOrder**55345 Palm Tran Connection
v 2.2

Page 1 of 9

**WorkOrder: 52255861****Invoice Number: 55345-52255861****Client Department:****MRC:** 55345M**Equipment:** 4514-P**WO Desc:**

Ford E450 Champion Challenger

PM A

VIN: 1FDFE4FS7EDB17176**Requested By:**

CVERGARA

Status: 40**Created By:**

CVERGARA

Priority: 1**Class:**

WO

Driver:**Arrangement:**

Unassigned

Phone:**Potential Warranty:**

No

ETA:

Chronology		
Reported	Apr 12, 2019	12:00 AM
Started	Apr 12, 2019	
Completed	Apr 12, 2019	5:39 PM
Down Time		

Meter	Reading	UOM
WO		DH
Life	160,720	DH
System	160,831	DH

WorkOrder Notes

Line	Comment
10	COMPLAINT: PmA CAUSE: Service due CORRECTION: Performed and completed PmA Changed engine oil and replaced engine oil filter

Activity: 10**999 TOTAL VEHICLE****Activity Note:** Light Medium Duty PMI**Reason for Repair:** 08 - Preventive Maintenance**Work Accomplished:** A - PM Level A**Part Failure:** -**Activity Comments****Parts Issued**

Date	Part Number	Description	Qty.	Each	Extended
------	-------------	-------------	------	------	----------

Labor Posted

Date	Technician	Hours	Rate	Extended
12-Apr-19	Delva, Terry	1.50	0.00	0.00

Activity 10 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours: 1.50	
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00

Activity: 20**999 TOTAL VEHICLE****Activity Note:** PM A**Reason for Repair:** 08 - Preventive Maintenance**Work Accomplished:** A - PM Level A**Part Failure:** -**Activity Comments****Parts Issued**


Date	Part Number	Description	Qty.	Each	Extended
12-Apr-19	B329(F)	FILTER, OIL SAME AS LF3681	1.00	1.96	1.96



WorkOrder

55345 Palm Tran Connection
v 2.2

Page 1 of 9



WorkOrder: 52436180

Invoice Number: 55345-52436180

Client Department:

MRC: 55345M

Equipment: 4514-P

WO Desc:

Ford E450 Champion Challenger

PM A

VIN:

1FDFE4FS7EDB17176

Requested By:

CVERGARA

Status:

40

Created By:

CVERGARA

Priority:

1

Class:

WO

Driver:

Arrangement:

Unassigned

Phone:

Potential Warranty:

No

ETA:

Chronology

Reported	Jun 13, 2019	4:16 PM
Started	Jun 13, 2019	
Completed	Jun 13, 2019	11:57 PM

Down Time

Meter	Reading	UOM
WO		DH
Life	169,711	DH
System	169,919	DH

WorkOrder Notes

Line	Comment
10	COMPLAINT:pmA CAUSE: Service CORRECTION:Perform pmA Service Oil filter B329 Qty1 Engine oil 5w20 qty 7 Qts Air filter PA4075

Activity: 10



999 TOTAL VEHICLE

Activity Note: Light Medium Duty PMI

Reason for Repair: 08 - Preventive Maintenance

Work Accomplished: A - PM Level A

Part Failure: -

Activity Comments

Parts Issued

Date	Part Number	Description	Qty	Each	Extended
------	-------------	-------------	-----	------	----------

Labor Posted

Date	Technician	Hours	Rate	Extended
13-Jun-19	Gaspard,Ronald	1.60	65.00	104.00

Activity 10 Sub Total

Parts:	0.00
Labor:	104.00
Labor Hours: 1.60	
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	104.00

Activity: 20



999 TOTAL VEHICLE

Activity Note: PM A

Reason for Repair: 08 - Preventive Maintenance

Work Accomplished: A - PM Level A

Part Failure: -

Activity Comments

Parts Issued



WorkOrder
55345 Palm Tran Connection
v 2.2
Page 1 of 9



WorkOrder: 52516871
Invoice Number: 55345-52516871

Client Department:

MRC: 55345M
WO Desc: PM A
Requested By: RGASPARD
Created By: RGASPARD
Class: WO
Arrangement: Unassigned
Potential Warranty: No

Equipment: 4514-P
Ford E450 Champion Challenger
VIN: 1FDFE4FS7EDB17176
Status: 40
Priority: 1
Driver:
Phone:
ETA:

Chronology		
Reported	Jul 11, 2019	10:21 AM
Started	Jul 12, 2019	
Completed	Jul 12, 2019	12:17 AM
Down Time		

Meter	Reading	UOM
WO		DH
Life	173,864	DH
System	174,056	DH

WorkOrder Notes

Line	Comment
10	COMPLAINT: Perform PMA Service CAUSE: Service due by Mileage. CORRECTION: Change Oil & Filter Lube all Pivoting Points. Check brakes. Clean batteries. Replace A/C Filter. Parts # B329 Qty (1) Oil 5W20 Qty (7.0) Qt

Activity: 10 **999 TOTAL VEHICLE**
Activity Note: Light Medium Duty PMI
Reason for Repair: 08 - Preventive Maintenance
Work Accomplished: A - PM Level A
Part Failure: -

Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
------	-------------	-------------	------	------	----------

Labor Posted

Date	Technician	Hours	Rate	Extended
12-Jul-19	Arthurs,Durvin	1.50	65.00	97.50

Activity 10 Sub Total

Parts: 0.00
Labor: 97.50
Labor Hours: 1.50
Sublet Parts: 0.00
Sublet Labor: 0.00
Activity Sub Total 97.50

Activity: 20 **999 TOTAL VEHICLE**
Activity Note: PM A
Reason for Repair: 08 - Preventive Maintenance
Work Accomplished: A - PM Level A
Part Failure: -

Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
12-Jul-19	B329(F)	FILTER, OIL SAME AS LF3681	1.00	1.96	1.96



WorkOrder
55345 Palm Tran Connection
v 2.2
Page 1 of 9



WorkOrder: 52675930
Invoice Number: 55345-52675930

Client Department:

MRC: 55345M

Equipment: 4514-P

WO Desc:

Ford E450 Champion Challenger

PM A

VIN: 1FDFE4FS7EDB17176

Requested By:

HPIERRE

Status: 40

Created By:

HPIERRE

Priority: 1

Class:

WO

Driver:

Arrangement:

Unassigned

Phone:

Potential Warranty:

No

ETA:

Chronology

Reported	Sep 10, 2019	10:32 AM
Started	Sep 10, 2019	
Completed	Sep 10, 2019	10:08 PM
Down Time		

Meter	Reading	UOM
WO		DH
Life	182,719	DH

WorkOrder Notes

Line	Comment
10	COMPLAINT: PMA SERVICE
	CAUSE: PREVENTIVE MAINTENANCE
	CORRECTION: PERFORM AND COMPLETED PMA SERVICE REPLACED DRAIN PLUG

Activity: 10



999 TOTAL VEHICLE

Activity Note: Light Medium Duty PMI

Reason for Repair: 08 - Preventive Maintenance

Work Accomplished: A - PM Level A

Part Failure: -

Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
------	-------------	-------------	------	------	----------

Labor Posted

Date	Technician	Hours	Rate	Extended
10-Sep-19	AMRIT TEEMAL,VISHNU	1.50	65.00	97.50

Activity 10 Sub Total

Parts:	0.00
Labor:	97.50
Labor Hours: 1.50	
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	97.50

Activity: 20



999 TOTAL VEHICLE

Activity Note: PM A

Reason for Repair: 08 - Preventive Maintenance

Work Accomplished: A - PM Level A

Part Failure: -

Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
10-Sep-19	65266	PLUG, DRAIN, OIL, ENGINE	1.00	4.35	4.35



WorkOrder
55345 Palm Tran Connection
v 2.2
Page 1 of 9



WorkOrder: 52778369
Invoice Number: 55345-52778369

Client Department:

MRC: 55345M

Equipment: 4514-P

WO Desc:

Ford E450 Champion Challenger

PM A

VIN: 1FDFE4FS7EDB17176

Requested By: AOWENS

Status: 40

Created By: AOWENS

Priority: 1

Class: WO

Driver:

Arrangement: Unassigned

Phone:

Potential Warranty: No

ETA:

Chronology		
Reported	Oct 7, 2019	2:17 PM
Started	Oct 8, 2019	
Completed	Oct 9, 2019	8:07 AM
Down Time		

Meter	Reading	UOM
WO		DH
Life	187,405	DH
System	187,405	DH

WorkOrder Notes

Line	Comment
10	COMPLAINT: PMA CAUSE: Service due CORRECTION: Performed and completed pmA Lubricate all Pivoting Points

Activity: 10 **999 TOTAL VEHICLE**
Activity Note: Light Medium Duty PMI
Reason for Repair: 08 - Preventive Maintenance
Work Accomplished: A - PM Level A
Part Failure: -

Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
------	-------------	-------------	------	------	----------

Labor Posted

Date	Technician	Hours	Rate	Extended
08-Oct-19	Delva,Terry	1.43	0.00	0.00
08-Oct-19	Delva,Terry	1.38	0.00	0.00

Activity 10 Sub Total

Parts: 0.00
Labor: 0.00
Labor Hours: 2.82
Sublet Parts: 0.00
Sublet Labor: 0.00
Activity Sub Total 0.00

Activity: 20 **999 TOTAL VEHICLE**
Activity Note: PM A
Reason for Repair: 08 - Preventive Maintenance
Work Accomplished: A - PM Level A
Part Failure: -

Activity Comments

Parts Issued



WorkOrder
55345 Palm Tran Connection
v 2.2
Page 1 of 9



WorkOrder: 52973065
Invoice Number: 55345-52973065

Client Department:

MRC: 55345M

Equipment: 4514-P

WO Desc:
PM A

Ford E450 Champion Challenger
1FDFE4FS7EDB17176

Requested By: RRENE

VIN: 40

Created By: RRENE

Status: 40

Class: WO

Priority: 1

Arrangement: Unassigned

Driver:

Potential Warranty: No

Phone:

ETA:

Chronology		
Reported	Dec 4, 2019	4:14 PM
Started	Dec 5, 2019	
Completed	Dec 5, 2019	4:42 PM
Down Time		

Meter	Reading	UOM
WO		DH
Life	196,301	DH
System	196,301	DH

WorkOrder Notes

Line	Comment
10	COMPLAINT: pmA CAUSE: Service CORRECTION: perform pmA service Oil filter B329 qty1 Engine oil 5w20 qty 7 Qts

Activity: 10



999 TOTAL VEHICLE

Activity Note: Light Medium Duty PMI

Reason for Repair: 08 - Preventive Maintenance

Work Accomplished: A - PM Level A

Part Failure: -

Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
------	-------------	-------------	------	------	----------

Labor Posted

Date	Technician	Hours	Rate	Extended
05-Dec-19	Gaspard, Ronald	1.62	65.00	105.08

Activity 10 Sub Total

Parts:	0.00
Labor:	105.08
Labor Hours: 1.62	
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	105.08

Activity: 20



999 TOTAL VEHICLE

Activity Note: PM A

Reason for Repair: 08 - Preventive Maintenance

Work Accomplished: A - PM Level A

Part Failure: -


Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
05-Dec-19	B329(F)	FILTER, OIL SAME AS LF3681	1.00	1.96	1.96



WorkOrder
55345 Palm Tran Connection
v 2.2
Page 1 of 9



WorkOrder: 53066320
Invoice Number: 55345-53066320

Client Department:

MRC: 55345M
WO Desc:
PM A
Requested By: RGASPARD
Created By: RGASPARD
Class: WO
Arrangement: Unassigned
Potential Warranty: No

Equipment: 4514-P
Ford E450 Champion Challenger
VIN: 1FDFE4FS7EDB17176
Status: 40
Priority: 1
Driver:
Phone:
ETA:

Chronology		
Reported	Jan 7, 2020	12:01 PM
Started	Jan 8, 2020	
Completed	Jan 8, 2020	8:47 AM
Down Time		

Meter	Reading	UOM
WO		DH
Life	200,542	DH
System	200,542	DH

WorkOrder Notes

Line	Comment
10	COMPLAINT: PmA Service CAUSE: preventive maintenance CORRECTION: perform PmA Service lube all Pivoting Points

Activity: 10 **999/999/999 TOTAL VEHICLE**
Activity Note: Light Duty PMI
Reason for Repair: 08 - Preventive Maintenance
Work Accomplished: -
Part Failure: -

Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
------	-------------	-------------	------	------	----------

Labor Posted

Date	Technician	Hours	Rate	Extended
08-Jan-20	NELSON PIERRE-LOUIS	2.50	0.00	0.00

Activity 10 Sub Total

Parts: 0.00
Labor: 0.00
Labor Hours: 2.50
Sublet Parts: 0.00
Sublet Labor: 0.00
Activity Sub Total 0.00

Activity: 20 **999 TOTAL VEHICLE**
Activity Note: PM A
Reason for Repair: 08 - Preventive Maintenance
Work Accomplished: A - PM Level A
Part Failure: -

Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
08-Jan-20	B329(F)	FILTER, OIL SAME AS LF3681	1.00	1.96	1.96



WorkOrder
55345 Palm Tran Connection
v 2.2
Page 1 of 9



WorkOrder: 53249837
Invoice Number: 55345-53249837

Client Department:

MRC: 55345M

Equipment: 4514-P

WO Desc:

Ford E450 Champion Challenger

PM A

VIN: 1FDFE4FS7EDB17176

Requested By:

VAMRITTEEMAL

Status: 40

Created By:

VAMRITTEEMAL

Priority: 1

Class:

WO

Driver:

Arrangement:

Unassigned

Phone:

Potential Warranty:

No

ETA:

Chronology		
Reported	Mar 2, 2020	10:27 AM
Started	Mar 2, 2020	
Completed	Mar 2, 2020	12:12 PM
Down Time		

Meter	Reading	UOM
WO		DH
Life	209,349	DH

WorkOrder Notes

Line	Comment
10	COMPLAINT: PMA SERVICE CAUSE: PREVENTIVE MAINTENANCE CORRECTION: PERFORM AND COMPLETED PMA SERVICE

Activity: 10



999/999/999 TOTAL VEHICLE

Activity Note:

Light Duty PMI

Reason for Repair:

08 - Preventive Maintenance

Work Accomplished: -

Part Failure: -

Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
------	-------------	-------------	------	------	----------

Labor Posted

Date	Technician	Hours	Rate	Extended
02-Mar-20	AMRIT TEEMAL,VISHNU	0.67	0.00	0.00

Activity 10 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours: 0.67	
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00

Activity: 20



999 TOTAL VEHICLE

Activity Note:

PM A

Reason for Repair:

08 - Preventive Maintenance

Work Accomplished: A - PM Level A

Part Failure: -

Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
02-Mar-20	B329(F)	FILTER, OIL, SPIN-ON	1.00	1.96	1.96



WorkOrder
55345 Palm Tran Connection
v 2.2
Page 1 of 9



WorkOrder: 53340899
Invoice Number: 55345-53340899

Client Department:

MRC: 55345M

Equipment: 4514-P

WO Desc:

PM A

Ford E450 Champion Challenger

1FDFE4FS7EDB17176

Requested By: VAMRITTEEMAL

VIN: 40

Created By: VAMRITTEEMAL

Status: 1

Class: WO

Priority: 1

Arrangement: Unassigned

Driver:

Potential Warranty: No

Phone:

ETA:

Chronology		
Reported	Apr 3, 2020	10:35 AM
Started	Apr 5, 2020	
Completed	Apr 5, 2020	1:28 PM
Down Time		

Meter	Reading	UOM
WO		DH
Life	213,257	DH

WorkOrder Notes

Line	Comment
10	COMPLAINT: pmA service
	CAUSE: preventive maintenance
	CORRECTION: perform pmA service and lube all Pivoting Points

Activity: 10 999/999/999 TOTAL VEHICLE

Activity Note: Light Duty PMI

Reason for Repair: 08 - Preventive Maintenance

Work Accomplished: -

Part Failure: -

Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
------	-------------	-------------	------	------	----------

Labor Posted

Date	Technician	Hours	Rate	Extended
05-Apr-20	NELSON PIERRE-LOUIS	2.03	0.00	0.00

Activity 10 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours: 2.03	
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00

Activity: 20 999 TOTAL VEHICLE

Activity Note: PM A

Reason for Repair: 08 - Preventive Maintenance

Work Accomplished: A - PM Level A

Part Failure: -

Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
05-Apr-20	B329(F)	FILTER, OIL, SPIN-ON SEE BALDWIN B329	1.00	1.96	1.96

**WorkOrder**55345 Palm Tran Connection
v 2.2

Page 1 of 10

**WorkOrder: 53560789****Invoice Number: 55345-53560789****Client Department:**

MRC:	55345M	Equipment:	4514-P
WO Desc:			Ford E450 Champion Challenger
55345-LIGHT DUTY PMA		VIN:	1FDFE4FS7EDB17176
Requested By:	RRENE	Status:	40
Created By:	RRENE	Priority:	3
Class:	WO	Driver:	
Arrangement:	Unassigned	Phone:	
Potential Warranty:	No	ETA:	

Chronology		
Reported	Jun 30, 2020	12:00 AM
Started	Jul 1, 2020	
Completed	Jul 1, 2020	11:49 PM
Down Time		

Meter	Reading	UOM
WO		DH
Life	222,106	DH
System	222,106	DH

WorkOrder Notes

Line	Comment
10	COMPLAINT: PmA CAUSE: Service CORRECTION: perform PmA Service Oil filter B329 Qty1 Engine oil 10w30 qty 7 Qts Air filter PA4075 Qty1 Drain plug oil 65266 Qty1

Activity: 5

999/999/999 TOTAL VEHICLE

Activity Note: PERSONAL RISK ASSESSMENT
Reason for Repair: SW - Shop Work Order
Work Accomplished: 06 - Inspect
Part Failure: 00 - No Failure

Activity Comments**Parts Issued**

Date	Part Number	Description	Qty.	Each	Extended
------	-------------	-------------	------	------	----------

Labor Posted

Date	Technician	Hours	Rate	Extended
------	------------	-------	------	----------

Activity 5 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours: 0.00	
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00

Activity: 10

999/999/999 TOTAL VEHICLE

Activity Note: Light Duty PMI
Reason for Repair: 08 - Preventive Maintenance
Work Accomplished: -
Part Failure: -

Activity Comments**Parts Issued**

Date	Part Number	Description	Qty.	Each	Extended
------	-------------	-------------	------	------	----------



WorkOrder
55345 Palm Tran Connection
v 2.2
Page 1 of 12



WorkOrder: 53666694
Invoice Number: 55345-53666694

Client Department:

MRC:	55345M	Equipment:	4514-P
WO Desc:			Ford E450 Champion Challenger
55345-LIGHT DUTY PMA		VIN:	1FD4E4FS7EDB17176
Requested By:	RGASPARD	Status:	40
Created By:	RGASPARD	Priority:	3
Class:	WO	Driver:	
Arrangement:	Unassigned	Phone:	
Potential Warranty:	No	ETA:	

Chronology		
Reported	Aug 5, 2020	12:00 AM
Started	Aug 5, 2020	
Completed	Aug 6, 2020	12:00 AM
Down Time		

Meter	Reading	UOM
WO		DH
Life	226,398	DH
System	226,647	DH

WorkOrder Notes

Line	Comment
10	COMPLAINT:
	CAUSE:
	CORRECTION:

Activity: 5 **999/999/999 TOTAL VEHICLE**

Activity Note: PERSONAL RISK ASSESSMENT
Reason for Repair: SW - Shop Work Order
Work Accomplished: 06 - Inspect
Part Failure: 00 - No Failure

Activity Comments

Parts Issued

Date	Part Number		Description	Qty.	Each	Extended
------	-------------	--	-------------	------	------	----------

Labor Posted

Date	Technician	Hours	Rate	Extended
------	------------	-------	------	----------

Activity 5 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours: 0.00	
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00

Activity: 10 **999/999/999 TOTAL VEHICLE**

Activity Note: Light Duty PMI
Reason for Repair: 08 - Preventive Maintenance
Work Accomplished: -
Part Failure: -

Activity Comments

Parts Issued

Date	Part Number		Description	Qty.	Each	Extended
------	-------------	--	-------------	------	------	----------

Labor Posted



WorkOrder
55345 Palm Tran Connection
v 2.2
Page 1 of 10



WorkOrder: 53863713
Invoice Number: 55345-53863713

Client Department:

MRC: 55345M
WO Desc: 55345-LIGHT DUTY PMA
Requested By: NPIERRE-LOUIS
Created By: NPIERRE-LOUIS
Class: WO
Arrangement: Unassigned
Potential Warranty: No

Equipment: 4514-P
Ford E450 Champion Challenger
VIN: 1FDFE4FS7EDB17176
Status: 40
Priority: 3
Driver:
Phone:
ETA:

Chronology		
Reported	Oct 21, 2020	12:00 AM
Started	Oct 21, 2020	
Completed	Oct 21, 2020	10:17 PM
Down Time		

Meter	Reading	UOM
WO		DH
Life	235,236	DH
System	235,325	DH

WorkOrder Notes

Line	Comment
10	COMPLAINT: PmA CAUSE: Service CORRECTION:perform PmA Service Oil filter B329 Qty1 Engine oil 10w30 qty 7 qts

Activity: 5 **999/999/999 TOTAL VEHICLE**
Activity Note: PERSONAL RISK ASSESSMENT
Reason for Repair: SW - Shop Work Order
Work Accomplished: 06 - Inspect
Part Failure: 00 - No Failure

Activity Comments

Parts Issued

Date	Part Number		Description	Qty.	Each	Extended
------	-------------	--	-------------	------	------	----------

Labor Posted

Date	Technician	Hours	Rate	Extended
------	------------	-------	------	----------

Activity 5 Sub Total

Parts: 0.00
Labor: 0.00
Labor Hours: 0.00
Sublet Parts: 0.00
Sublet Labor: 0.00
Activity Sub Total 0.00

Activity: 10 **999/999/999 TOTAL VEHICLE**
Activity Note: Light Duty PMI
Reason for Repair: 08 - Preventive Maintenance
Work Accomplished: -
Part Failure: -

Activity Comments

Parts Issued

Date	Part Number		Description	Qty.	Each	Extended
------	-------------	--	-------------	------	------	----------

Labor Posted



WorkOrder
55345 Palm Tran Connection
v 2.2
Page 1 of 10



WorkOrder: 53984261
Invoice Number: 55345-53984261

Client Department:

MRC: 55345M
WO Desc: 55345-LIGHT DUTY PMA
Requested By: RGASPARD
Created By: RGASPARD
Class: WO
Arrangement: Unassigned
Potential Warranty: No

Equipment: 4514-P
Ford E450 Champion Challenger
VIN: 1FD4E4FS7EDB17176
Status: 40
Priority: 3
Driver:
Phone:
ETA:

Chronology		
Reported	Nov 26, 2020	12:00 AM
Started	Nov 27, 2020	
Completed	Nov 27, 2020	9:57 AM
Down Time		

Meter	Reading	UOM
WO		DH
Life	239,547	DH

WorkOrder Notes

Line	Comment
10	PM. Perform pmA service, lube front end, tire rotation, torque and re torque tires (140 f/p), R&R engine oil and filter, road test, all okay at this time. Parts. Engine oil filter part # B329 qty 1 engine oil. 5W20 Qty 6 qts

Activity: 5



999/999/999 TOTAL VEHICLE

Activity Note: PERSONAL RISK ASSESSMENT
Reason for Repair: SW - Shop Work Order
Work Accomplished: 06 - Inspect
Part Failure: 00 - No Failure

Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
------	-------------	-------------	------	------	----------

Labor Posted

Date	Technician	Hours	Rate	Extended
------	------------	-------	------	----------

Activity 5 Sub Total

Parts: 0.00
Labor: 0.00
Labor Hours: 0.00
Sublet Parts: 0.00
Sublet Labor: 0.00
Activity Sub Total 0.00

Activity: 10



999/999/999 TOTAL VEHICLE

Activity Note: Light Duty PMI
Reason for Repair: 08 - Preventive Maintenance
Work Accomplished: -
Part Failure: -

Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
------	-------------	-------------	------	------	----------

Labor Posted



WorkOrder
55345 Palm Tran Connection
v 2.2
Page 1 of 10



WorkOrder: 54199060
Invoice Number: 55345-54199060

Client Department:

MRC: 55345M
WO Desc: 55345-LIGHT DUTY PMA
Requested By: RGASPARD
Created By: RGASPARD
Class: WO
Arrangement: Unassigned
Potential Warranty: No

Equipment: 4514-P
Ford E450 Champion Challenger
VIN: 1FDPE4FS7EDB17176
Status: 40
Priority: 3
Driver:
Phone:
ETA:

Chronology		
Reported	Feb 11, 2021	12:00 AM
Started	Feb 11, 2021	
Completed	Feb 11, 2021	4:20 PM
Down Time		

Meter	Reading	UOM
WO		DH
Life	248,309	DH
System	248,500	DH

WorkOrder Notes

Line	Comment
10	COMPLAINT: Unit came in for service CAUSE: time for service CORRECTION: job complete replace one good used tire to right rear of unit after return vehicle back to work

Activity: 5 **999/999/999 TOTAL VEHICLE**

Activity Note: PERSONAL RISK ASSESSMENT
Reason for Repair: SW - Shop Work Order
Work Accomplished: 06 - Inspect
Part Failure: 00 - No Failure

Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
------	-------------	-------------	------	------	----------

Labor Posted

Date	Technician	Hours	Rate	Extended
11-Feb-21	Junior Hurst	0.02	0.00	0.00

Activity 5 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours: 0.02	
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00

Activity: 10
Activity Note: Light Duty PMI
Reason for Repair: -
Work Accomplished: -
Part Failure: -

Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
------	-------------	-------------	------	------	----------

Labor Posted



WorkOrder
55345 Palm Tran Connection
v 2.2
Page 1 of 10



WorkOrder: 54292626
Invoice Number: 55345-54292626

Client Department:

MRC: 55345M
WO Desc: 55345-LIGHT DUTY PMA
Requested By: JUHURST
Created By: JUHURST
Class: WO
Arrangement: Unassigned
Potential Warranty: No

Equipment: 4514-P
Ford E450 Champion Challenger
VIN: 1FDFE4FS7EDB17176
Status: 40
Priority: 3
Driver:
Phone:
ETA:

Chronology

Reported	Mar 12, 2021	12:00 PM
Started	Mar 12, 2021	
Completed	Mar 12, 2021	11:42 PM
Down Time		

Meter	Reading	UOM
WO		DH
Life	252,540	DH

WorkOrder Notes

Line	Comment
10	COMPLAINT: Perform PMA Service.. CAUSE: Service Due by Mileage. CORRECTION: Change Oil & Filter Lube all Pivoting Points. Check Brakes Clean batteries. Both rear Caliper dust boots Missing. Parts # B329 Qty (1) Oil 5W20QTY Qty (7.0) Qt.

Activity: 5



999/999/999 TOTAL VEHICLE

Activity Note: PERSONAL RISK ASSESSMENT
Reason for Repair: SW - Shop Work Order
Work Accomplished: 06 - Inspect
Part Failure: 00 - No Failure

Activity Comments

Parts Issued

Date	Part Number		Description	Qty.	Each	Extended
------	-------------	--	-------------	------	------	----------

Labor Posted

Date	Technician	Hours	Rate	Extended
------	------------	-------	------	----------

Activity 5 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours: 0.00	
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00

Activity: 10



079 DEVICES, SAFETY/STABILITY, TRAILER

Activity Note: Light Duty PMI
Reason for Repair: 05 - Inspection, Routine
Work Accomplished: -
Part Failure: -

Activity Comments

Parts Issued

Date	Part Number		Description	Qty.	Each	Extended
------	-------------	--	-------------	------	------	----------

Labor Posted



WorkOrder
55345 Palm Tran Connection
v 2.2
Page 1 of 10



WorkOrder: 54572283
Invoice Number: 55345-54572283

Client Department:

MRC: 55345M
WO Desc: 55345-LIGHT DUTY PMA
Requested By: JUHURST
Created By: JUHURST
Class: WO
Arrangement: Unassigned
Potential Warranty: No

Equipment: 4514-P
Ford E450 Champion Challenger
VIN: 1FDPE4FS7EDB17176
Status: 40
Priority: 3
Driver:
Phone:
ETA:

Chronology

Reported	Jun 25, 2021	12:00 AM
Started	Jun 25, 2021	
Completed	Jun 25, 2021	3:14 PM
Down Time		

Meter	Reading	UOM
WO		DH
Life	265,209	DH

WorkOrder Notes

Line	Comment
10	COMPLAINT:
	CAUSE:
	CORRECTION:

Activity: 5 **999/999/999 TOTAL VEHICLE**

Activity Note: PERSONAL RISK ASSESSMENT
Reason for Repair: SW - Shop Work Order
Work Accomplished: 06 - Inspect
Part Failure: 00 - No Failure

Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
------	-------------	-------------	------	------	----------

Labor Posted

Date	Technician	Hours	Rate	Extended
25-Jun-21	Junior Hurst	0.03	0.00	0.00

Activity 5 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours: 0.03	
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00

Activity: 10 **020 GROUP, DRIVETRAIN**

Activity Note: Light Duty PMI
Reason for Repair: 11 - Routine
Work Accomplished: -
Part Failure: -

Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
25-Jun-21	B329(F)	GOING OUT OF SERVICE SEE BALDWIN B329 IN THE FLEET ORG. FILTER, OIL, SPIN-ON	1.00	1.98	1.98



WorkOrder
55345 Palm Tran Connection
v 2.2
Page 1 of 10



WorkOrder: 54802382
Invoice Number: 55345-54802382

Client Department:

MRC:	55345M	Equipment:	4514-P
WO Desc:			Ford E450 Champion Challenger
55345-LIGHT DUTY PMA		VIN:	1FD4E4FS7EDB17176
Requested By:	HPIERRE	Status:	40
Created By:	HPIERRE	Priority:	3
Class:	WO	Driver:	
Arrangement:	Unassigned	Phone:	
Potential Warranty:	No	ETA:	

Chronology		
Reported	Sep 7, 2021	12:00 AM
Started	Sep 9, 2021	
Completed	Sep 9, 2021	3:10 PM
Down Time		

Meter	Reading	UOM
WO		DH
Life	274,615	DH
System	274,397	DH

WorkOrder Notes

Line	Comment
10	COMPLAINT: PMA
	CAUSE: PMA service due
	CORRECTION: Performed and completed PMA

Activity: 5 **999/999/999 TOTAL VEHICLE**

Activity Note: PERSONAL RISK ASSESSMENT
Reason for Repair: SW - Shop Work Order
Work Accomplished: 06 - Inspect
Part Failure: 00 - No Failure

Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
------	-------------	-------------	------	------	----------

Labor Posted

Date	Technician	Hours	Rate	Extended
------	------------	-------	------	----------

Activity 5 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours: 0.00	
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00

Activity: 10

Activity Note: Light Duty PMI
Reason for Repair: -
Work Accomplished: -
Part Failure: -

Activity Comments


Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
------	-------------	-------------	------	------	----------

Labor Posted



WorkOrder
55345 Palm Tran Connection
v 2.2
Page 1 of 10



WorkOrder: 54884375
Invoice Number: 55345-54884375

Client Department:

MRC:	55345M	Equipment:	4514-P
WO Desc:			Ford E450 Champion Challenger
55345-LIGHT DUTY PMA		VIN:	1FD4E4FS7EDB17176
Requested By:	TDELVA	Status:	40
Created By:	TDELVA	Priority:	3
Class:	WO	Driver:	
Arrangement:	Unassigned	Phone:	
Potential Warranty:	No	ETA:	

Chronology

Reported	Oct 21, 2021	12:00 AM
Started	Oct 21, 2021	
Completed	Oct 22, 2021	12:11 AM
Down Time		

Meter	Reading	UOM
WO		DH
Life	278,887	DH
System	278,968	DH

WorkOrder Notes

Line	Comment
10	COMPLAINT: pmA CAUSE: Service CORRECTION: Perform pmA Service Oil filter B329 qty1 Engine oil 10w30 qty 7 qts Oil pan sipping oil

Activity: 5 **999/999/999 TOTAL VEHICLE**
Activity Note: PERSONAL RISK ASSESSMENT
Reason for Repair: SW - Shop Work Order
Work Accomplished: 06 - Inspect
Part Failure: 00 - No Failure

Activity Comments

Parts Issued

Date	Part Number		Description	Qty.	Each	Extended
------	-------------	--	-------------	------	------	----------

Labor Posted

Date	Technician	Hours	Rate	Extended
------	------------	-------	------	----------

Activity 5 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours: 0.00	
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00

Activity: 10 **079 DEVICES, SAFETY/STABILITY, TRAILER**
Activity Note: Light Duty PMI
Reason for Repair: 05 - Inspection, Routine
Work Accomplished: -
Part Failure: -


Activity Comments

Parts Issued

Date	Part Number		Description	Qty.	Each	Extended
------	-------------	--	-------------	------	------	----------



WorkOrder
55345 Palm Tran Connection
v 2.2
Page 1 of 10



WorkOrder: 55321843
Invoice Number: 55345-55321843

Client Department:

MRC: 55345M
WO Desc: 55345-LIGHT DUTY PMA
Requested By: NPIERRE-LOUIS
Created By: NPIERRE-LOUIS
Class: WO
Arrangement: Unassigned
Potential Warranty: No

Equipment: 4514-P
Ford E450 Champion Challenger
VIN: 1FDFE4FS7EDB17176
Status: 32
Priority: 3
Driver:
Phone:
ETA:

Chronology			Meter	Reading	UOM
Reported	Mar 9, 2022	12:00 AM	WO		DH
Started	Mar 13, 2022		Life	288,239	DH
Completed	Mar 13, 2022	4:22 PM	System	288,239	DH
Down Time					

WorkOrder Notes

Line	Comment
10	COMPLAINT: Perform PMA Service. CAUSE: Service due by mileage.. CORRECTION: Change Oil & Filter. Lube all Pivoting Points .remove Wheels to Check brakes,hydro booster teaking need to replace. parts # B329 Qty (1) Oil 5W30 Qty (7.0)Qt,

Activity: 5 **999/999/999 TOTAL VEHICLE**
Activity Note: PERSONAL RISK ASSESSMENT
Reason for Repair: SW - Shop Work Order
Work Accomplished: 06 - Inspect
Part Failure: 00 - No Failure

Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
13-Mar-22	B329	FILTER, OIL, SPIN-ON	1.00	1.99	1.99

Labor Posted

Date	Technician	Hours	Rate	Extended
------	------------	-------	------	----------

Activity 5 Sub Total

Parts: 1.99
Labor: 0.00
Labor Hours: 0.00
Sublet Parts: 0.00
Sublet Labor: 0.00
Activity Sub Total 1.99

Activity: 10 **079 DEVICES, SAFETY/STABILITY, TRAILER**
Activity Note: Light Duty PMI
Reason for Repair: 05 - Inspection, Routine
Work Accomplished: -
Part Failure: -

Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
------	-------------	-------------	------	------	----------



WorkOrder
55345 Palm Tran Connection
v 2.2
Page 1 of 10



WorkOrder: 55428153
Invoice Number: 55345-55428153

Client Department:

MRC: 55345M
WO Desc: 55345-LIGHT DUTY PMA
Requested By: DARTHURS
Created By: DARTHURS
Class: WO
Arrangement: Unassigned
Potential Warranty: No

Equipment: 4514-P
Ford E450 Champion Challenger
VIN: 1FDFE4FS7EDB17176
Status: 40
Priority: 3
Driver:
Phone:
ETA:

Chronology			Meter	Reading	UOM
Reported	Apr 12, 2022	12:00 AM	WO		DH
Started	Apr 14, 2022		Life	292,927	DH
Completed	Apr 14, 2022	11:30 PM	System	292,694	DH
Down Time					

WorkOrder Notes

Line	Comment
10	COMPLAINT: Perform PMA Service. CAUSE: Service due by Mileage CORRECTION: Change Oil & Filter. Lube all Pivoting Points. Check brakes . Clean battery. Replace A/C filter.Remove Swheel to check brakes. Replace Oil drain Plugs. parts # B329 Qty (1) oil 5W30 Qty (7.0) Qt

Activity: 5 **999/999/999 TOTAL VEHICLE**
Activity Note: PERSONAL RISK ASSESSMENT
Reason for Repair: SW - Shop Work Order
Work Accomplished: 06 - Inspect
Part Failure: 00 - No Failure

Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
14-Apr-22	B329	FILTER, OIL, SPIN-ON	1.00	1.99	1.99

Labor Posted

Date	Technician	Hours	Rate	Extended
------	------------	-------	------	----------

Activity 5 Sub Total

Parts:	1.99
Labor:	0.00
Labor Hours: 0.00	
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	1.99

Activity: 10 **079 DEVICES, SAFETY/STABILITY, TRAILER**
Activity Note: Light Duty PMI
Reason for Repair: 05 - Inspection, Routine
Work Accomplished: -
Part Failure: -

Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
------	-------------	-------------	------	------	----------



WorkOrder
55345 Palm Tran Connection
v 2.2
Page 2 of 10



WorkOrder: 55428153
Invoice Number: 55345-55428153

Client Department:

MRC: 55345M
WO Desc: 55345-LIGHT DUTY PMA
Requested By: DARTHURS
Created By: DARTHURS
Class: WO
Arrangement: Unassigned
Potential Warranty: No

Equipment: 4514-P
Ford E450 Champion Challenger
VIN: 1FDFE4FS7EDB17176
Status: 40
Priority: 3
Driver:
Phone:
ETA:

Labor Posted

Date	Technician	Hours	Rate	Extended
14-Apr-22	Arthurs,Durvin	1.60	0.00	0.00

Activity 10 Sub Total

Parts: 0.00
Labor: 0.00
Labor Hours: 1.60
Sublet Parts: 0.00
Sublet Labor: 0.00
Activity Sub Total 0.00

Activity: 20 **999 TOTAL VEHICLE**

Activity Note: PM A
Reason for Repair: 08 - Preventive Maintenance
Work Accomplished: A - PM Level A
Part Failure: -

Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
------	-------------	-------------	------	------	----------

Labor Posted

Date	Technician	Hours	Rate	Extended
14-Apr-22	Arthurs,Durvin	0.37	0.00	0.00

Activity 20 Sub Total

Parts: 0.00
Labor: 0.00
Labor Hours: 0.37
Sublet Parts: 0.00
Sublet Labor: 0.00
Activity Sub Total 0.00

WorkOrder 55428153 Grand Total

Parts: 1.99
Labor: 0.00
Labor Hours: 1.97
Sublet Parts: 0.00
Sublet Labor: 0.00
WorkOrder Grand Total 1.99

Recent Repair History

WorkOrder	Date Completed	Life Meter	Class	Description
55428153	14-Apr-22	292,927	WO	55345-LIGHT DUTY PMA
55503344	10-Apr-22	291,737	WO	PER PTC COORDINATOR DRIVE CAM NOT RECORDING



WorkOrder
55345 Palm Tran Connection
v 2.2
Page 3 of 10



WorkOrder: 55428153
Invoice Number: 55345-55428153

Client Department:

MRC: 55345M

Equipment: 4514-P

WO Desc:

55345-LIGHT DUTY PMA

VIN: Ford E450 Champion Challenger

1FDFE4FS7EDB17176

Requested By: DARTHURS

Status: 40

Created By: DARTHURS

Priority: 3

Class: WO

Driver:

Arrangement: Unassigned

Phone:

Potential Warranty: No

ETA:

WorkOrder	Date Completed	Life Meter	Class	Description
55463052	5-Apr-22	289,576	WO	Replace Driver Side Head Light/ No start
55430097	18-Mar-22	288,239	WO	HYDRO BOOSTER
55321843	13-Mar-22	288,239	WO	55345-LIGHT DUTY PMA

Scheduled Preventative Maintenance

Nest	PM	WorkOrder	Due Date	Due Life Meter	Due Meter Reading	Due Life Meter 2	Due Meter Reading 2
------	----	-----------	----------	----------------	-------------------	------------------	---------------------

Other Open Repairs

WorkOrder8	Date Reported	Life Meter	Class	Description
55480015	31-Mar-22	290,533	WO	VEHICLE HAS SCRATCHES ON LEFT SIDE AREA

PH: Work Order: 55428153 Desc: 55345-LIGHT DUTY PMA
Equip: 4514-P Desc: Ford E450 Champion Challenger VIN: 1FDFE4FS7EDB17176

LH: 10 Desc: Light Duty PMI

Task: First Transit North America Light Duty PM Inspection Sheet Performed by: DARTHURS Performed on: 14-APR-22

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
10,000	SECTION 1 - Preparation Inspection	Done		DARTHURS	Apr 14, 2022 10:49:03 PM	No	
10,100	INSPECT_Auto-Transmission Operation/Controller; Neutral Safety Switch	Done		DARTHURS	Apr 14, 2022 10:49:08 PM	No	
10,200	!FRA!INSPECT_Starter Operation	Done		DARTHURS	Apr 14, 2022 10:49:12 PM	No	
10,300	!FRA!INSPECT_Warning Lights and Alarms	Done		DARTHURS	Apr 14, 2022 10:49:17 PM	No	
10,400	!FRA!INSPECT_Back Up Alarm	Done		DARTHURS	Apr 14, 2022 10:49:22 PM	No	
10,500	!FRA!INSPECT_Engine Operation, OBSERVE_ Exhaust for Excessive Smoke	Done		DARTHURS	Apr 14, 2022 10:49:31 PM	No	
10,600	Check Driver's Pre-trip or DVIR/EVIR & Authorization Forms	Done		DARTHURS	Apr 14, 2022 10:49:37 PM	No	
10,700	INSPECT_All Exterior Lights (Turn on until Completion of this section)	Done		DARTHURS	Apr 14, 2022 10:49:43 PM	No	
10,800	*RPT*INSPECT_Body Damage, Corrosion;DOCUMENT_Issues	Done		DARTHURS	Apr 14, 2022 10:49:50 PM	No	
10,900	INSPECT_Fuel Tank Cap, and Doors	Done		DARTHURS	Apr 14, 2022 10:49:56 PM	No	
11,100	INSPECT_License Plate, Bracket, Bumpers	Done		DARTHURS	Apr 14, 2022 10:50:02 PM	No	
20,000	SECTION 2 - Test Drive and Operator Area Inspection	Done		DARTHURS	Apr 14, 2022 10:50:07 PM	No	
20,100	INSPECT_Driver Seat condition/operation/seatbelt	Done		DARTHURS	Apr 14, 2022 10:50:13 PM	No	
20,200	TEST DRIVE_INSPECT_Proper Operation; Drive into Shop	Done		DARTHURS	Apr 14, 2022 10:50:18 PM	No	
20,300	*RPT*INSPECT_Steering Wheel for Play/Bind/Horn Op./Turn Signal Cancelation	Done		DARTHURS	Apr 14, 2022 10:50:24 PM	No	
20,400	PERFORM_Brake Test (Apply hard enough to check wheel pull and Application)	Done		DARTHURS	Apr 14, 2022 10:50:30 PM	No	
20,500	*RPT*FRA INSPECT_Lighting/Operation of all Gauges	Done		DARTHURS	Apr 14, 2022 10:50:36 PM	No	
20,600	*RPT*INSPECT_Windshields, Sun Visors	Done		DARTHURS	Apr 14, 2022 10:50:41 PM	No	
20,700	INSPECT_Wiper/Washer Operation, Condition	Done		DARTHURS	Apr 14, 2022 10:50:47 PM	No	
20,800	INSPECT_High Idle Control	Done		DARTHURS	Apr 14, 2022 10:50:52 PM	No	
20,900	*RPT*!FRA!INSPECT_HVAC Controls, Operation	Done		DARTHURS	Apr 14, 2022 10:50:57 PM	No	
21,000	*RPT*!FRA!INSPECT_Operation of all Switches and Accessories	Done		DARTHURS	Apr 14, 2022 10:51:03 PM	No	
21,100	INSPECT_Parking Brake Operation	Done		DARTHURS	Apr 14, 2022 10:51:08 PM	No	
21,200	!FRA!TEST_Service Brake Backup System (Stationary Brake Tests HYD)	Done		DARTHURS	Apr 14, 2022 10:51:15 PM	No	
21,300	INSPECT_VIN, Tire Pressure Decal, Data Tags	Done		DARTHURS	Apr 14, 2022	No	

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
					10:51:21 PM		
21,400	*RPT*INSPECT_Drivers Door Hinges, Handles, Controls and Panels	Done		DARTHURS	Apr 14, 2022 10:51:29 PM	No	
21,500	!FRA!INSPECT_Under Dash Wiring for Proper Routing/Chafing/Securement	Done		DARTHURS	Apr 14, 2022 10:51:35 PM	No	
21,550	INSPECT_Driver Floor Area for Rust/Water Leaks	Done		DARTHURS	Apr 14, 2022 10:51:40 PM	No	
21,600	*RPT*INSPECT for WEAR_Pedal Pads, Accelerator, Brake, Parking Brake	Done		DARTHURS	Apr 14, 2022 10:51:46 PM	No	
21,700	INSPECT_Engine Fault Codes	Done		DARTHURS	Apr 14, 2022 10:51:51 PM	No	
30,000	SECTION 3 - EXTERIOR INSPECTION - Front	Done		DARTHURS	Apr 14, 2022 10:51:56 PM	No	
31,000	SSF (Street Side Front)	Done		DARTHURS	Apr 14, 2022 10:52:00 PM	No	
31,010	*RPT*!FRA!INSPECT_Mirror Mountings, Brackets, Glass	Done		DARTHURS	Apr 14, 2022 10:52:08 PM	No	
31,020	*RPT*INSPECT_FRONT Springs, Shocks, Spring Shackles	Done		DARTHURS	Apr 14, 2022 10:52:14 PM	No	
31,030	INSPECT_Mud Flaps, Brackets	Done		DARTHURS	Apr 14, 2022 10:52:18 PM	No	
31,040	INSPECT_Wiper Blades, Arms	Done		DARTHURS	Apr 14, 2022 10:52:23 PM	No	
32,000	Engine Inspection	Done		DARTHURS	Apr 14, 2022 10:52:28 PM	No	
32,010	INSPECT_Hood, Springs and Props	Done		DARTHURS	Apr 14, 2022 10:52:33 PM	No	
32,020	!FRA!INSPECT_Engine Compartment Condition for Fire Risk Avoidance	Done		DARTHURS	Apr 14, 2022 10:52:38 PM	No	
32,030	!FRA!INSPECT_for Fluid Leaks, Levels	Done		DARTHURS	Apr 14, 2022 10:52:43 PM	No	
32,040	!FRA!INSPECT_Hyd_Brake Fluid with Test Strips	-	NA	DARTHURS	Apr 14, 2022 10:52:55 PM	No	
32,050	!FRA!INSPECT_RECORD_Coolant Recovery with Refractometer; Test Strips	Degree Fahrenheit	NA	DARTHURS	Apr 14, 2022 10:53:07 PM	No	
32,060	PRESSURE TEST_Cooling Systems (Radiator, Cap, hoses and clamps)	Done		DARTHURS	Apr 14, 2022 10:53:12 PM	No	
32,070	*RPT*INSPECT_Radiator and Mountings, Cores	Done		DARTHURS	Apr 14, 2022 10:53:18 PM	No	
32,080	*RPT*INSPECT_Fan Assembly,Shroud,Tensioner,Belts,All Belt Driven Components	Done		DARTHURS	Apr 14, 2022 10:53:24 PM	No	
32,090	*RPT*!FRA!INSPECT_Mounting, Installation of Alternator, AC Compressor	Done		DARTHURS	Apr 14, 2022 10:53:31 PM	No	
32,100	INSPECT_Intake System	Done		DARTHURS	Apr 14, 2022 10:53:36 PM	No	
32,140	*RPT*!FRA!RECORD_Underhood Battery Voltages (volts)	0 Volt*		DARTHURS	Apr 14, 2022 10:53:48 PM	No	
33,010	CSF (Curb Side Front)	Done		DARTHURS	Apr 14, 2022 10:53:53 PM	No	
33,020	*RPT*!FRA!INSPECT_Mirror Mountings, Brackets, Glass	Done		DARTHURS	Apr 14, 2022 10:53:58 PM	No	
33,030	*RPT*INSPECT_FRONT Springs, Shocks, Spring Shackles	Done		DARTHURS	Apr 14, 2022 10:54:05 PM	No	
33,040	INSPECT_Mud Flaps, Brackets	Done		DARTHURS	Apr 14, 2022	No	

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
					10:54:09 PM		
33,050	INSPECT_Wiper Blades, Arms	Done		DARTHURS	Apr 14, 2022 10:54:14 PM	No	
33,060	!FRA!INSPECT_LUBE_Battery Box, Batteries, Tray Slides, Hold Downs	Done		DARTHURS	Apr 14, 2022 10:54:19 PM	No	
33,070	*RPT*!FRA!RECORD_Side Mounted Battery Voltages (volts)	1396 Volt*		DARTHURS	Apr 14, 2022 10:54:32 PM	No	
33,070	*RPT*!FRA!RECORD_Side Mounted Battery Voltages (volts)	13.96 Volt*		DARTHURS	Apr 14, 2022 10:55:02 PM	No	
33,080	INSPECT_Entry door, OPEN_with external lock/switch (if equipped)	Done		DARTHURS	Apr 14, 2022 10:55:11 PM	No	
40,000	SECTION 4 - Interior Inspection	Done		DARTHURS	Apr 14, 2022 10:55:16 PM	No	
40,100	*RPT*INSPECT_Step-Well, Step-Tread, Hand Rails, Step-well Light	Done		DARTHURS	Apr 14, 2022 10:55:23 PM	No	
40,200	INSPECT_Insurance/Registration/Regulatory Forms Dates	Done		DARTHURS	Apr 14, 2022 10:55:29 PM	No	
40,250	INSPECT_Overhead Compartment for Water Leaks	Done		DARTHURS	Apr 14, 2022 10:55:33 PM	No	
40,300	INSPECT_Safety Equipment, Fire Extinguisher/Suppression	Done		DARTHURS	Apr 14, 2022 10:55:38 PM	No	
40,400	INSPECT_Camera Systems, Filter, Electrical Inputs/Outputs-SOP M038	Done		DARTHURS	Apr 14, 2022 10:55:43 PM	No	
40,600	!FRA!CHECK for HOTSPOTS_Interior Elec Panel Fuses/Circuit Breakers/Connectors	Done		DARTHURS	Apr 14, 2022 10:55:48 PM	No	
40,700	*RPT*INSPECT_Seats, Covering, Belts, Loose Cushions, Operation	Done		DARTHURS	Apr 14, 2022 10:55:55 PM	No	
40,800	*RPT*!FRA!INSPECT_Interior Lights; Mirrors	Done		DARTHURS	Apr 14, 2022 10:56:00 PM	No	
40,900	!FRA!INSPECT_Interior Cleanliness/Potential Projectiles	Done		DARTHURS	Apr 14, 2022 10:56:05 PM	No	
41,000	INSPECT_All ADA Equip (Lift Seat Belt, floor hold Downs, Belts, Cover, Alarms)	Done		DARTHURS	Apr 14, 2022 10:56:11 PM	No	
41,100	INSPECT_CLEAN_AC Filter	Done		DARTHURS	Apr 14, 2022 10:56:16 PM	No	
41,200	INSPECT_Emergency Windows,Hatches,Doors,Alarms/Lights;CHECK_for Leaks	Done		DARTHURS	Apr 14, 2022 10:56:21 PM	No	
41,300	*RPT*INSPECT_Interior Body, Floor, Stanchions	Done		DARTHURS	Apr 14, 2022 10:56:27 PM	No	
41,400	*RPT*INSPECT_Passenger Doors, Glass, Seal	Done		DARTHURS	Apr 14, 2022 10:56:33 PM	No	
50,000	SECTION 5 - UNDER VEHICLE INSPECTION	Done		DARTHURS	Apr 14, 2022 10:56:37 PM	No	
50,100	*RPT*INSPECT_Steering components-Drag Link, Tie Rods ends and Steering Damper	Done		DARTHURS	Apr 14, 2022 10:56:44 PM	No	
50,200	INSPECT_Ball Joint Play	Done		DARTHURS	Apr 14, 2022 10:56:48 PM	No	
50,300	!FRA!INSPECT_Front Wheel Bearings for Play	Done		DARTHURS	Apr 14, 2022 10:56:53 PM	No	
50,400	LUBE_All Chassis Components	Done		DARTHURS	Apr 14, 2022 10:56:58 PM	No	
50,500	!FRA!CHANGE_Engine oil,filters	Done		DARTHURS	Apr 14, 2022 10:57:02 PM	No	
50,700	INSPECT_Tire Condition	Done		DARTHURS	Apr 14, 2022	No	

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
					10:57:07 PM		
50,800	INSPECT_Tire Valve Stems, Double Check Caps	Done		DARTHURS	Apr 14, 2022 10:57:13 PM	No	
50,900	!FRA!INSPECT_Wheels for Cracks, Loose Lugs/Indicators, Outer Hub Leaks	Done		DARTHURS	Apr 14, 2022 10:57:18 PM	No	
51,000	RECORD_LF-Tire Tread Depth (32nds)	12 32nds of an inch		DARTHURS	Apr 14, 2022 10:57:33 PM	No	
51,100	RECORD_LF-Tire Air Pressure (psi)	70 Pounds per Square Inch		DARTHURS	Apr 14, 2022 10:57:42 PM	No	
51,200	RECORD_RF-Tire Tread Depth (32nds)	12 32nds of an inch		DARTHURS	Apr 14, 2022 10:57:48 PM	No	
51,300	RECORD_RF-Air Pressure (psi)	70 Pounds per Square Inch		DARTHURS	Apr 14, 2022 10:57:55 PM	No	
51,400	!FRA!INSPECT_FRONT ABS Tone Rings, Sensors, Routing of Cables	Done		DARTHURS	Apr 14, 2022 10:58:02 PM	No	
51,500	!FRA!INSPECT_Wheel Seals for Leaks	Done		DARTHURS	Apr 14, 2022 10:58:06 PM	No	
51,600	!FRA!INSPECT_ Front Brake Assemblies	Done		DARTHURS	Apr 14, 2022 10:58:11 PM	No	
51,700	MEASURE_RECORD_LF - Brake Lining, Pad Thickness (32nds)	11 32nds of an inch		DARTHURS	Apr 14, 2022 10:58:21 PM	No	
51,800	MEASURE_RECORD_RF - Brake Lining, Pad Thickness (32nds)	11 32nds of an inch		DARTHURS	Apr 14, 2022 10:58:28 PM	No	
51,900	INSPECT VISUALLY_ RECORD_ LF Rotor Condition (inches)	1.554 Inch		DARTHURS	Apr 14, 2022 10:58:40 PM	No	
52,000	INSPECT VISUALLY_ RECORD_ RF Rotor Condition (inches)	1.554 Inch		DARTHURS	Apr 14, 2022 10:58:49 PM	No	
52,100	INSPECT_Vibration Damper	Done		DARTHURS	Apr 14, 2022 10:58:54 PM	No	
52,200	!FRA!INSPECT_Battery Cable Routing from Battery Box to Starter	Done		DARTHURS	Apr 14, 2022 10:59:04 PM	No	
52,400	!FRA!INSPECT_ Starter Mounting	Done		DARTHURS	Apr 14, 2022 10:59:10 PM	No	
52,500	!FRA!INSPECT_Engine Exhaust System	Done		DARTHURS	Apr 14, 2022 10:59:15 PM	No	
52,700	INSPECT_Engine, Transmission Mounts	Done		DARTHURS	Apr 14, 2022 10:59:20 PM	No	
52,800	!FRA!INSPECT_Engine, Transmission for Fluid Leaks	Done		DARTHURS	Apr 14, 2022 10:59:30 PM	No	
52,900	INSPECT_ Shift Cable Adjustment - All Transmissions	Done		DARTHURS	Apr 14, 2022 10:59:35 PM	No	
53,000	!FRA!INSPECT_ Transmission Breather and Clean	Done		DARTHURS	Apr 14, 2022 10:59:40 PM	No	
53,100	*RPT*!FRA!INSPECT_Parking Brake Cables, Shoes for Wear, Contamination	Done		DARTHURS	Apr 14, 2022 10:59:48 PM	No	
53,200	*RPT*INSPECT_A/C Condensor, Fans, Safety Grills	Done		DARTHURS	Apr 14, 2022 10:59:52 PM	No	
53,300	*RPT*INSPECT_ Driveline, Hanger Bearings, U-Joints, Slip Joints, Safety Loop	Done		DARTHURS	Apr 14, 2022 10:59:58 PM	No	
53,400	*RPT*INSPECT_All Body Mounts and Chassis Frame for Corrosion, Cracks	Done		DARTHURS	Apr 14, 2022 11:00:04 PM	No	
53,500	!FRA!INSPECT_Fuel Tank, Mountings, Lines	Done		DARTHURS	Apr 14, 2022 11:00:09 PM	No	
53,600	INSPECT_Tire Condition	Done		DARTHURS	Apr 14, 2022 11:00:15 PM	No	

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
53,700	INSPECT_Tire Valve Stems, Double Check Caps	Done		DARTHURS	Apr 14, 2022 11:00:21 PM	No	
53,800	INSPECT_ Mismatched Tire Tread, Casing Design	Done		DARTHURS	Apr 14, 2022 11:00:26 PM	No	
53,900	INSPECT_Dual Mating Tires w/Square	Done		DARTHURS	Apr 14, 2022 11:00:31 PM	No	
54,000	!FRA!INSPECT_Wheels for Cracks, Loose Lugs/Indicators, Outer Hub Leaks	Done		DARTHURS	Apr 14, 2022 11:00:35 PM	No	
54,100	INSPECT_Mud Flaps, Brackets	Done		DARTHURS	Apr 14, 2022 11:00:43 PM	No	
54,200	RECORD_RRO-Tire Tread Depth (32nds)	5 32nds of an inch		DARTHURS	Apr 14, 2022 11:00:50 PM	No	
54,300	RECORD_RRI-Tire Tread Depth (32nds)	5 32nds of an inch		DARTHURS	Apr 14, 2022 11:00:56 PM	No	
54,400	RECORD_RRO-Air Pressure (psi)	65 Pounds per Square Inch		DARTHURS	Apr 14, 2022 11:01:02 PM	No	
54,500	RECORD_RRI-Air Pressure (psi)	65 Pounds per Square Inch		DARTHURS	Apr 14, 2022 11:01:07 PM	No	
54,600	RECORD_LRO-Tire Tread Depth (32nds)	5 32nds of an inch		DARTHURS	Apr 14, 2022 11:01:16 PM	No	
54,700	RECORD_LRI-Tire Tread Depth (32nds)	5 32nds of an inch		DARTHURS	Apr 14, 2022 11:01:21 PM	No	
54,800	RECORD_LRO-Air Pressure (psi)	65 Pounds per Square Inch		DARTHURS	Apr 14, 2022 11:01:26 PM	No	
54,900	RECORD_LRI-Air Pressure (psi)	65 Pounds per Square Inch		DARTHURS	Apr 14, 2022 11:01:33 PM	No	
55,000	!FRA!INSPECT_ REAR Brake Assemblies	Done		DARTHURS	Apr 14, 2022 11:01:38 PM	No	
55,100	!FRA!INSPECT_ REAR Hubs, Wheel Seals for Oil Leaks	-	R/R hub seal leaking	DARTHURS	Apr 14, 2022 11:02:10 PM	Yes	55522415
55,200	!FRA!INSPECT_REAR ABS Tone Rings, Sensors, Routing Of Cables (if equipped)	Done		DARTHURS	Apr 14, 2022 11:02:15 PM	No	
55,300	MEASURE_RECORD_LR - Brake Lining, Pad Thickness (32nds)	3 32nds of an inch	Rear Brakes	DARTHURS	Apr 14, 2022 11:02:41 PM	Yes	55522415
55,400	MEASURE_RECORD_RR - Brake Lining, Pad Thickness (32nds)	4 32nds of an inch		DARTHURS	Apr 14, 2022 11:02:51 PM	No	
55,500	INSPECT VISUALLY_MEASURE_RECORD_ LR Drum, Rotor Condition (inches)	1.654 Inch		DARTHURS	Apr 14, 2022 11:03:01 PM	No	
55,600	INSPECT VISUALLY_MEASURE_RECORD_ RR Drum, Rotor Condition (inches)	1.654 Inch		DARTHURS	Apr 14, 2022 11:03:08 PM	No	
55,700	!FRA!INSPECT_ Under Body Exhaust System	Done		DARTHURS	Apr 14, 2022 11:03:13 PM	No	
55,800	*RPT*INSPECT_ REAR Axle Housing, Breather; CLEAN_Breather	Done		DARTHURS	Apr 14, 2022 11:03:18 PM	No	
55,900	*RPT*INSPECT_ REAR Springs, Shocks, Suspension, Airbags	Done		DARTHURS	Apr 14, 2022 11:03:23 PM	No	
60,000	SECTION 6 - Wheelchair Inspection	Done		DARTHURS	Apr 14, 2022 11:03:28 PM	No	
60,100	RECORD_Wheelchair Cycle Count	14035 Cycles		DARTHURS	Apr 14, 2022 11:03:41 PM	No	
60,200	CHECK_ Lift Access Door for Ease of Opening,Latch Security,Door Hold Back	Done		DARTHURS	Apr 14, 2022 11:03:49 PM	No	
60,300	CHECK_Platform Emergency Release Mechanism for Ease of Operation	Done		DARTHURS	Apr 14, 2022 11:03:54 PM	No	
60,400	OPERATE_Lift thru Complete	Done		DARTHURS	Apr 14, 2022	No	

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
	Cycle;CHECK_Noises,Jerky Op,Too Fast-Slow,Drift Down				11:03:59 PM		
60,500	INSPECT_ Bridgeplate Operation	Done		DARTHURS	Apr 14, 2022 11:04:03 PM	No	
60,600	INSPECT_All Pivot Points for Wear and Looseness	Done		DARTHURS	Apr 14, 2022 11:04:08 PM	No	
60,700	INSPECT_Rollers for Wear and Smooth Rotation	Done		DARTHURS	Apr 14, 2022 11:04:13 PM	No	
60,800	INSPECT_Operation of Platform Barrier Mechanism	Done		DARTHURS	Apr 14, 2022 11:04:18 PM	No	
60,900	INSPECT_Cam Slots for Wear and Proper Alignment	Done		DARTHURS	Apr 14, 2022 11:04:22 PM	No	
61,000	INSPECT_Cable Condition (If Applicable)	Done		DARTHURS	Apr 14, 2022 11:04:27 PM	No	
61,100	INSPECT_Hydraulic Hoses for Leaks, Chafing or Cracks	Done		DARTHURS	Apr 14, 2022 11:04:32 PM	No	
61,200	INSPECT_Electrical Connections and Routing of Wires and Cables	Done		DARTHURS	Apr 14, 2022 11:04:36 PM	No	
61,300	INSPECT_Operation and Adjustment of All Safety Switches	Done		DARTHURS	Apr 14, 2022 11:04:41 PM	No	
61,400	INSPECT_All Lift Mounting Brackets for Loose Bolts Broken Welds, etc.	Done		DARTHURS	Apr 14, 2022 11:04:46 PM	No	
61,500	INSPECT_Manual Back-up Raise/Lower System (If Applicable)	Done		DARTHURS	Apr 14, 2022 11:04:50 PM	No	
61,600	INSPECT_HydrPump Reservoir Oil Level. Consult SvcManual for Fluid to Use.	Done		DARTHURS	Apr 14, 2022 11:04:55 PM	No	
61,700	CHECK_Operator Decals for Proper Positioning;CONSULT_Service Manual	Done		DARTHURS	Apr 14, 2022 11:05:00 PM	No	
61,800	CHECK_WC Holddowns Inside Vehicle for Secure Mounting,Proper Operation	Done		DARTHURS	Apr 14, 2022 11:05:04 PM	No	
61,900	CLEAN_Linkages and Mechanisms	Done		DARTHURS	Apr 14, 2022 11:05:09 PM	No	
62,000	LUBRICATE_Linkages and Mechanisms (DO NOT OVER Lubricate)	Done		DARTHURS	Apr 14, 2022 11:05:14 PM	No	
62,100	INSPECT_Emergency Platform Release Mechanism	Done		DARTHURS	Apr 14, 2022 11:05:19 PM	No	
62,200	INSPECT_Platform Barrier Latch Mechanism	Done		DARTHURS	Apr 14, 2022 11:05:23 PM	No	
62,300	INSPECT_Bridgeplate Hinge	Done		DARTHURS	Apr 14, 2022 11:05:28 PM	No	
62,400	INSPECT_All Pivot Points	Done		DARTHURS	Apr 14, 2022 11:05:32 PM	No	
62,500	INSPECT_Cams and Slots	Done		DARTHURS	Apr 14, 2022 11:05:37 PM	No	
62,600	INSPECT_Rollers	Done		DARTHURS	Apr 14, 2022 11:05:41 PM	No	
62,700	INSPECT_All Linkages	Done		DARTHURS	Apr 14, 2022 11:05:46 PM	No	
70,000	SECTION 7 - ALTERNATIVE FUELS INSPECTION	Done		DARTHURS	Apr 14, 2022 11:05:51 PM	No	
70,300	INSPECT_Condition of Fuel Pressure Gauge	Done		DARTHURS	Apr 14, 2022 11:05:56 PM	No	
70,400	PROVIDE PROOF_Tank_Dents/Scratches and Re-Certification	Done		DARTHURS	Apr 14, 2022 11:06:00 PM	No	
70,500	INSPECT_Tank test date, labels-Reference-ST.4	Done		DARTHURS	Apr 14, 2022	No	

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
	FMMVSS 304 & ANSI-CSA NGV2				11:06:05 PM		
70,600	INSPECT_ Tank Lines to Ensure Secure Mounting, Insulation Against Vibration	Done		DARTHURS	Apr 14, 2022 11:06:10 PM	No	
70,700	INSPECT_ Filling Nozzle for Securely Fitting Cap	Done		DARTHURS	Apr 14, 2022 11:06:14 PM	No	
70,800	INSPECT_ Pressure Relief Device's Venting System, Valves, Ducting to MNFR Specs	Done		DARTHURS	Apr 14, 2022 11:06:19 PM	No	
80,000	SECTION 8 - PMI Report Completion	Done		DARTHURS	Apr 14, 2022 11:06:24 PM	No	
80,100	COMPLETE_PMI Report; Follow-ups	Done		DARTHURS	Apr 14, 2022 11:06:28 PM	No	
80,200	RETURN_Vehicle to Predetermined Location	Done		DARTHURS	Apr 14, 2022 11:06:33 PM	No	

LH: 20 Desc: PM A

Task: PM A SERVICE Performed by: DARTHURS Performed on: 14-APR-22

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
100,000	"A" PMI SERVICING ITEMS	Done		DARTHURS	Apr 14, 2022 11:07:53 PM	No	
101,000	FRA Change Oil Filters	Yes		DARTHURS	Apr 14, 2022 11:07:58 PM	No	
102,000	FRA Drain Engine Oil	Yes		DARTHURS	Apr 14, 2022 11:08:03 PM	No	
103,000	FRA Check Transmission Fluid	Done		DARTHURS	Apr 14, 2022 11:08:08 PM	No	
104,000	Lubricate Chassis	Done		DARTHURS	Apr 14, 2022 11:08:12 PM	No	
105,000	Replace or Clean A/C Filters	Done	replace filter	DARTHURS	Apr 14, 2022 11:08:35 PM	No	
107,000	FRA Change Primary Fuel Filter	No	NA	DARTHURS	Apr 14, 2022 11:09:01 PM	No	
108,000	Lube all pivoting Mechanisms	Done		DARTHURS	Apr 14, 2022 11:09:05 PM	No	

LH: 5 Desc: PERSONAL RISK ASSESSMENT

Task: PRA and Meter Readings Performed by: DARTHURS Performed on: 14-APR-22

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
1	Are you properly trained to perform the task?	Done		DARTHURS	Apr 14, 2022 11:09:43 PM	No	
2	If task requires lifting, are lifts secured, are jack stands used correctly?	Done		DARTHURS	Apr 14, 2022 11:09:47 PM	No	
4	Are you wearing the appropriate PPE?	Done		DARTHURS	Apr 14, 2022 11:09:52 PM	No	
7	Have you performed the proper LOTO?	Done		DARTHURS	Apr 14, 2022 11:09:57 PM	No	
10	Are you aware of the potential risks of performing this repair?	Done		DARTHURS	Apr 14, 2022 11:10:01 PM	No	
11	Have you successfully completed the Personal Risk Assessment?	Done		DARTHURS	Apr 14, 2022 11:10:06 PM	No	



WorkOrder
55345 Palm Tran Connection
v 2.2
Page 1 of 10



WorkOrder: 55612088
Invoice Number: 55345-55612088

Client Department:

MRC:	55345M	Equipment:	4514-P
WO Desc:			Ford E450 Champion Challenger
55345-LIGHT DUTY PMA		VIN:	1FDFE4FS7EDB17176
Requested By:	JUHURST	Status:	40
Created By:	JUHURST	Priority:	3
Class:	WO	Driver:	
Arrangement:	Unassigned	Phone:	
Potential Warranty:	No	ETA:	

Chronology

Reported	Jun 15, 2022	12:00 AM
Started	Jun 17, 2022	
Completed	Jun 17, 2022	7:53 PM
Down Time		

Meter	Reading	UOM
WO		DH
Life	302,630	DH
System	302,437	DH

WorkOrder Notes

Line	Comment
10	PERFORMED PMA INSPECTION AND SERVICE

Activity: 5 **999/999/999 TOTAL VEHICLE**

Activity Note: PERSONAL RISK ASSESSMENT
Reason for Repair: SW - Shop Work Order
Work Accomplished: 06 - Inspect
Part Failure: 00 - No Failure

Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
------	-------------	-------------	------	------	----------

Labor Posted

Date	Technician	Hours	Rate	Extended
------	------------	-------	------	----------

Activity 5 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours: 0.00	
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00

Activity: 10

Activity Note: Light Duty PMI
Reason for Repair: -
Work Accomplished: -
Part Failure: -

Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
17-Jun-22	B329	FILTER, OIL, SPIN-ON	1.00	2.14	2.14

Labor Posted

Date	Technician	Hours	Rate	Extended
17-Jun-22	Junior Hurst	3.45	0.00	0.00



WorkOrder
55345 Palm Tran Connection
v 2.2
Page 2 of 10



WorkOrder: 55612088
Invoice Number: 55345-55612088

Client Department:

MRC: 55345M
WO Desc: 55345-LIGHT DUTY PMA
Requested By: JUHURST
Created By: JUHURST
Class: WO
Arrangement: Unassigned
Potential Warranty: No

Equipment: 4514-P
Ford E450 Champion Challenger
1FDDE4FS7EDB17176
VIN:
Status: 40
Priority: 3
Driver:
Phone:
ETA:

Activity 10 Sub Total

Parts: 2.14
Labor: 0.00
Labor Hours: 3.45
Sublet Parts: 0.00
Sublet Labor: 0.00
Activity Sub Total 2.14

Activity: 20 **999 TOTAL VEHICLE**

Activity Note: PM A
Reason for Repair: 08 - Preventive Maintenance
Work Accomplished: A - PM Level A
Part Failure: -

Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
------	-------------	-------------	------	------	----------

Labor Posted

Date	Technician	Hours	Rate	Extended
17-Jun-22	Junior Hurst	0.22	0.00	0.00

Activity 20 Sub Total

Parts: 0.00
Labor: 0.00
Labor Hours: 0.22
Sublet Parts: 0.00
Sublet Labor: 0.00
Activity Sub Total 0.00

WorkOrder 55612088 Grand Total

Parts: 2.14
Labor: 0.00
Labor Hours: 3.67
Sublet Parts: 0.00
Sublet Labor: 0.00
WorkOrder Grand Total 2.14

Recent Repair History

WorkOrder	Date Completed	Life Meter	Class	Description
55612088	17-Jun-22	302,630	WO	55345-LIGHT DUTY PMA
55679281	13-Jun-22	301,637	WO	CHECK AND WRENCH LIGHT ON
55668976	6-Jun-22	301,018	WO	FLAT TIRE
55522428	16-May-22	297,854	WO	55345-LIGHT DUTY PMB

Scheduled Preventative Maintenance



WorkOrder
55345 Palm Tran Connection
v 2.2
Page 3 of 10



WorkOrder: 55612088
Invoice Number: 55345-55612088

Client Department:

MRC: 55345M
WO Desc: 55345-LIGHT DUTY PMA
Requested By: JUHURST
Created By: JUHURST
Class: WO
Arrangement: Unassigned
Potential Warranty: No

Equipment: 4514-P
Ford E450 Champion Challenger
1FDFE4FS7EDB17176
VIN:
Status: 40
Priority: 3
Driver:
Phone:
ETA:

Nest	PM	WorkOrder	Due Date	Due Life Meter	Due Meter Reading	Due Life Meter 2	Due Meter Reading 2
------	----	-----------	----------	----------------	-------------------	------------------	---------------------

Other Open Repairs

WorkOrder8	Date Reported	Life Meter	Class	Description
------------	---------------	------------	-------	-------------

PH: Work Order: 55612088 Desc: 55345-LIGHT DUTY PMA
Equip: 4514-P Desc: Ford E450 Champion Challenger VIN: 1FDFE4FS7EDB17176

LH: 10 Desc: Light Duty PMI

Task: First Transit North America Light Duty PM Inspection Sheet Performed by: JUHURST Performed on: 17-JUN-22

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
10,000	SECTION 1 - Preparation Inspection	Done		JUHURST	Jun 17, 2022 6:01:56 PM	No	
10,100	INSPECT_Auto-Transmission Operation/Controller; Neutral Safety Switch	Done		JUHURST	Jun 17, 2022 7:16:21 PM	No	55702233
10,200	!FRA!INSPECT_Starter Operation	Done		JUHURST	Jun 17, 2022 6:02:08 PM	No	
10,300	!FRA!INSPECT_Warning Lights and Alarms	Done		JUHURST	Jun 17, 2022 6:02:28 PM	No	
10,400	!FRA!INSPECT_Back Up Alarm	Done		JUHURST	Jun 17, 2022 7:15:29 PM	No	
10,500	!FRA!INSPECT_Engine Operation, OBSERVE_ Exhaust for Excessive Smoke	Done		JUHURST	Jun 17, 2022 6:02:40 PM	No	
10,600	Check Driver's Pre-trip or DVIR/EVIR & Authorization Forms	Done		JUHURST	Jun 17, 2022 7:19:35 PM	No	
10,700	INSPECT_All Exterior Lights (Turn on until Completion of this section)	Done		JUHURST	Jun 17, 2022 6:02:51 PM	No	
10,800	*RPT*INSPECT_Body Damage, Corrosion;DOCUMENT_Issues	Done		JUHURST	Jun 17, 2022 6:03:00 PM	No	
10,900	INSPECT_Fuel Tank Cap, and Doors	Done		JUHURST	Jun 17, 2022 6:04:00 PM	No	
11,100	INSPECT_License Plate, Bracket, Bumpers	Done		JUHURST	Jun 17, 2022 6:05:38 PM	No	
20,000	SECTION 2 - Test Drive and Operator Area Inspection	Done		JUHURST	Jun 17, 2022 6:05:57 PM	No	
20,100	INSPECT_Driver Seat condition/operation/seatbelt	Done		JUHURST	Jun 17, 2022 6:06:04 PM	No	
20,200	TEST DRIVE_INSPECT_Proper Operation; Drive into Shop	Done		JUHURST	Jun 17, 2022 6:06:42 PM	No	
20,300	*RPT*INSPECT_Steering Wheel for Play/Bind/Horn Op./Turn Signal Cancelation	Done		JUHURST	Jun 17, 2022 6:07:48 PM	No	
20,400	PERFORM_Brake Test (Apply hard enough to check wheel pull and Application)	Done		JUHURST	Jun 17, 2022 6:08:12 PM	No	
20,500	*RPT*FRA INSPECT_Lighting/Operation of all Gauges	Done		JUHURST	Jun 17, 2022 6:08:26 PM	No	
20,600	*RPT*INSPECT_Windshields, Sun Visors	Done		JUHURST	Jun 17, 2022 6:08:38 PM	No	
20,700	INSPECT_Wiper/Washer Operation, Condition	Done		JUHURST	Jun 17, 2022 6:08:52 PM	No	
20,800	INSPECT_High Idle Control	Done		JUHURST	Jun 17, 2022 6:09:03 PM	No	
20,900	*RPT*!FRA!INSPECT_HVAC Controls, Operation	Done		JUHURST	Jun 17, 2022 6:09:12 PM	No	
21,000	*RPT*!FRA!INSPECT_Operation of all Switches and Accessories	Done		JUHURST	Jun 17, 2022 6:09:22 PM	No	
21,100	INSPECT_Parking Brake Operation	Done		JUHURST	Jun 17, 2022 6:09:28 PM	No	
21,200	!FRA!TEST_Service Brake Backup System (Stationary Brake Tests HYD)	Done		JUHURST	Jun 17, 2022 6:09:46 PM	No	
21,300	INSPECT_VIN, Tire Pressure Decal, Data Tags	Done		JUHURST	Jun 17, 2022	No	

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
					6:10:00 PM		
21,400	*RPT*INSPECT_Drivers Door Hinges, Handles, Controls and Panels	Done		JUHURST	Jun 17, 2022 6:10:11 PM	No	
21,500	!FRA!INSPECT_Under Dash Wiring for Proper Routing/Chafing/Securement	Done		JUHURST	Jun 17, 2022 6:13:51 PM	No	
21,550	INSPECT_Driver Floor Area for Rust/Water Leaks	Done		JUHURST	Jun 17, 2022 6:14:15 PM	No	
21,600	*RPT*INSPECT for WEAR_Pedal Pads, Accelerator, Brake, Parking Brake	Done		JUHURST	Jun 17, 2022 6:14:56 PM	No	
21,700	INSPECT_Engine Fault Codes	Done		JUHURST	Jun 17, 2022 6:15:04 PM	No	
30,000	SECTION 3 - EXTERIOR INSPECTION - Front	Done		JUHURST	Jun 17, 2022 6:15:34 PM	No	
31,000	SSF (Street Side Front)	Done		JUHURST	Jun 17, 2022 6:15:49 PM	No	
31,010	*RPT*!FRA!INSPECT_Mirror Mountings, Brackets, Glass	Done		JUHURST	Jun 17, 2022 6:16:16 PM	No	
31,020	*RPT*INSPECT_FRONT Springs, Shocks, Spring Shackles	Done		JUHURST	Jun 17, 2022 6:16:32 PM	No	
31,030	INSPECT_Mud Flaps, Brackets	Done		JUHURST	Jun 17, 2022 6:16:49 PM	No	
31,040	INSPECT_Wiper Blades, Arms	Done		JUHURST	Jun 17, 2022 6:16:54 PM	No	
32,000	Engine Inspection	Done		JUHURST	Jun 17, 2022 6:17:11 PM	No	
32,010	INSPECT_Hood, Springs and Props	Done		JUHURST	Jun 17, 2022 6:17:22 PM	No	
32,020	!FRA!INSPECT_Engine Compartment Condition for Fire Risk Avoidance	Done		JUHURST	Jun 17, 2022 6:17:40 PM	No	
32,030	!FRA!INSPECT_for Fluid Leaks, Levels	Done		JUHURST	Jun 17, 2022 6:17:58 PM	No	
32,040	!FRA!INSPECT_Hyd_Brake Fluid with Test Strips	Done		JUHURST	Jun 17, 2022 6:18:22 PM	No	
32,050	!FRA!INSPECT_RECORD_Coolant Recovery with Refractometer; Test Strips	26 Degree Fahrenheit		JUHURST	Jun 17, 2022 6:18:59 PM	No	
32,060	PRESSURE TEST_Cooling Systems (Radiator, Cap, hoses and clamps)	Done		JUHURST	Jun 17, 2022 6:19:23 PM	No	
32,070	*RPT*INSPECT_Radiator and Mountings, Cores	Done		JUHURST	Jun 17, 2022 6:19:44 PM	No	
32,080	*RPT*INSPECT_Fan Assembly,Shroud,Tensioner,Belts,All Belt Driven Components	Done		JUHURST	Jun 17, 2022 6:20:20 PM	No	
32,090	*RPT*!FRA!INSPECT_Mounting, Installation of Alternator, AC Compressor	Done		JUHURST	Jun 17, 2022 6:20:36 PM	No	
32,100	INSPECT_Intake System	Done		JUHURST	Jun 17, 2022 6:21:56 PM	No	
32,140	*RPT*!FRA!RECORD_Underhood Battery Voltages (volts)	14 Volt*		JUHURST	Jun 17, 2022 6:22:43 PM	No	
33,010	CSF (Curb Side Front)	Done		JUHURST	Jun 17, 2022 6:22:54 PM	No	
33,020	*RPT*!FRA!INSPECT_Mirror Mountings, Brackets, Glass	Done		JUHURST	Jun 17, 2022 6:23:09 PM	No	
33,030	*RPT*INSPECT_FRONT Springs, Shocks, Spring Shackles	Done		JUHURST	Jun 17, 2022 6:23:28 PM	No	
33,040	INSPECT_Mud Flaps, Brackets	Done		JUHURST	Jun 17, 2022	No	

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
					6:23:36 PM		
33,050	INSPECT_Wiper Blades, Arms	Done		JUHURST	Jun 17, 2022 6:23:47 PM	No	
33,060	!FRA!INSPECT_LUBE_Battery Box, Batteries, Tray Slides, Hold Downs	Done		JUHURST	Jun 17, 2022 6:23:43 PM	No	
33,070	*RPT*!FRA!RECORD_Side Mounted Battery Voltages (volts)	14 Volt*		JUHURST	Jun 17, 2022 6:24:03 PM	No	
33,080	INSPECT_Entry door, OPEN_with external lock/switch (if equipped)	Done		JUHURST	Jun 17, 2022 6:24:09 PM	No	
40,000	SECTION 4 - Interior Inspection	Done		JUHURST	Jun 17, 2022 6:24:17 PM	No	
40,100	*RPT*INSPECT_Step-Well, Step-Tread, Hand Rails, Step-well Light	Done		JUHURST	Jun 17, 2022 6:24:23 PM	No	
40,200	INSPECT_Insurance/Registration/Regulatory Forms Dates	Done		JUHURST	Jun 17, 2022 6:24:28 PM	No	
40,250	INSPECT_Overhead Compartment for Water Leaks	Done		JUHURST	Jun 17, 2022 6:24:51 PM	No	
40,300	INSPECT_Safety Equipment, Fire Extinguisher/Suppression	Done		JUHURST	Jun 17, 2022 6:24:47 PM	No	
40,400	INSPECT_Camera Systems, Filter, Electrical Inputs/Outputs-SOP M038	Done		JUHURST	Jun 17, 2022 6:25:12 PM	No	
40,600	!FRA!CHECK for HOTSPOTS_Interior Elec Panel Fuses/Circuit Breakers/Connectors	Done		JUHURST	Jun 17, 2022 6:25:17 PM	No	
40,700	*RPT*INSPECT_Seats, Covering, Belts, Loose Cushions, Operation	Done		JUHURST	Jun 17, 2022 6:25:27 PM	No	
40,800	*RPT*!FRA!INSPECT_Interior Lights; Mirrors	Done		JUHURST	Jun 17, 2022 6:25:36 PM	No	
40,900	!FRA!INSPECT_Interior Cleanliness/Potential Projectiles	Done		JUHURST	Jun 17, 2022 6:25:48 PM	No	
41,000	INSPECT_All ADA Equip (Lift Seat Belt, floor hold Downs, Belts, Cover, Alarms)	Done		JUHURST	Jun 17, 2022 6:25:58 PM	No	
41,100	INSPECT_CLEAN_AC Filter	Done		JUHURST	Jun 17, 2022 6:26:05 PM	No	
41,200	INSPECT_Emergency Windows,Hatches,Doors,Alarms/Lights;CHECK_for Leaks	Done		JUHURST	Jun 17, 2022 6:26:12 PM	No	
41,300	*RPT*INSPECT_Interior Body, Floor, Stanchions	Done		JUHURST	Jun 17, 2022 6:26:21 PM	No	
41,400	*RPT*INSPECT_Passenger Doors, Glass, Seal	Done		JUHURST	Jun 17, 2022 6:26:32 PM	No	
50,000	SECTION 5 - UNDER VEHICLE INSPECTION	Done		JUHURST	Jun 17, 2022 6:26:39 PM	No	
50,100	*RPT*INSPECT_Steering components-Drag Link, Tie Rods ends and Steering Damper	Done		JUHURST	Jun 17, 2022 6:26:52 PM	No	
50,200	INSPECT_Ball Joint Play	Done	Balljoint need replace	JUHURST	Jun 17, 2022 6:29:25 PM	Yes	55702233
50,300	!FRA!INSPECT_Front Wheel Bearings for Play	Done		JUHURST	Jun 17, 2022 6:29:37 PM	No	
50,400	LUBE_All Chassis Components	Done		JUHURST	Jun 17, 2022 6:29:45 PM	No	
50,500	!FRA!CHANGE_Engine oil,filters	Done		JUHURST	Jun 17, 2022 6:29:54 PM	No	
50,700	INSPECT_Tire Condition	Done		JUHURST	Jun 17, 2022 6:30:01 PM	No	
50,800	INSPECT_Tire Valve Stems, Double Check Caps	Done		JUHURST	Jun 17, 2022	No	

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
					6:30:10 PM		
50,900	!FRA!INSPECT_Wheels for Cracks, Loose Lugs/Indicators, Outer Hub Leaks	Done		JUHURST	Jun 17, 2022 6:30:17 PM	No	
51,000	RECORD_LF-Tire Tread Depth (32nds)	12 32nds of an inch		JUHURST	Jun 17, 2022 6:30:35 PM	No	
51,100	RECORD_LF-Tire Air Pressure (psi)	65 Pounds per Square Inch		JUHURST	Jun 17, 2022 6:30:42 PM	No	
51,200	RECORD_RF-Tire Tread Depth (32nds)	10 32nds of an inch		JUHURST	Jun 17, 2022 6:30:55 PM	No	
51,300	RECORD_RF-Air Pressure (psi)	65 Pounds per Square Inch		JUHURST	Jun 17, 2022 6:31:03 PM	No	
51,400	!FRA!INSPECT_FRONT ABS Tone Rings, Sensors, Routing of Cables	Done		JUHURST	Jun 17, 2022 6:31:08 PM	No	
51,500	!FRA!INSPECT_Wheel Seals for Leaks	Done		JUHURST	Jun 17, 2022 6:31:15 PM	No	
51,600	!FRA!INSPECT_ Front Brake Assemblies	Done		JUHURST	Jun 17, 2022 6:31:25 PM	No	
51,700	MEASURE_RECORD_LF - Brake Lining, Pad Thickness (32nds)	12 32nds of an inch		JUHURST	Jun 17, 2022 6:32:17 PM	No	
51,800	MEASURE_RECORD_RF - Brake Lining, Pad Thickness (32nds)	12 32nds of an inch		JUHURST	Jun 17, 2022 6:32:24 PM	No	
51,900	INSPECT VISUALLY_ RECORD_ LF Rotor Condition (inches)	1.2299 Inch		JUHURST	Jun 17, 2022 6:32:57 PM	No	
52,000	INSPECT VISUALLY_ RECORD_ RF Rotor Condition (inches)	1.2299 Inch		JUHURST	Jun 17, 2022 6:33:08 PM	No	
52,100	INSPECT_Vibration Damper	Done		JUHURST	Jun 17, 2022 6:33:24 PM	No	
52,200	!FRA!INSPECT_Battery Cable Routing from Battery Box to Starter	Done		JUHURST	Jun 17, 2022 6:33:33 PM	No	
52,400	!FRA!INSPECT_ Starter Mounting	Done		JUHURST	Jun 17, 2022 6:33:48 PM	No	
52,500	!FRA!INSPECT_Engine Exhaust System	Done	two Engine mounts need replace	JUHURST	Jun 17, 2022 6:36:34 PM	Yes	55702233
52,700	INSPECT_ Engine, Transmission Mounts	Done		JUHURST	Jun 17, 2022 6:34:12 PM	No	
52,800	!FRA!INSPECT_Engine, Transmission for Fluid Leaks	Done		JUHURST	Jun 17, 2022 6:36:49 PM	No	
52,900	INSPECT_ Shift Cable Adjustment - All Transmissions	Done		JUHURST	Jun 17, 2022 6:36:54 PM	No	
53,000	!FRA!INSPECT_ Transmission Breather and Clean	Done		JUHURST	Jun 17, 2022 6:36:59 PM	No	
53,100	*RPT*!FRA!INSPECT_Parking Brake Cables, Shoes for Wear, Contamination	Done		JUHURST	Jun 17, 2022 6:37:17 PM	No	
53,200	*RPT*INSPECT_A/C Condensor, Fans, Safety Grills	Done		JUHURST	Jun 17, 2022 6:37:22 PM	No	
53,300	*RPT*INSPECT_ Driveline, Hanger Bearings, U-Joints, Slip Joints, Safety Loop	Done		JUHURST	Jun 17, 2022 6:37:27 PM	No	
53,400	*RPT*INSPECT_All Body Mounts and Chassis Frame for Corrosion, Cracks	Done		JUHURST	Jun 17, 2022 6:37:31 PM	No	
53,500	!FRA!INSPECT_Fuel Tank, Mountings, Lines	Done		JUHURST	Jun 17, 2022 6:37:44 PM	No	
53,600	INSPECT_Tire Condition	Done		JUHURST	Jun 17, 2022 6:37:48 PM	No	
53,700	INSPECT_Tire Valve Stems, Double Check Caps	Done		JUHURST	Jun 17, 2022	No	

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
					6:37:53 PM		
53,800	INSPECT_ Mismatched Tire Tread, Casing Design	Done		JUHURST	Jun 17, 2022 6:38:01 PM	No	
53,900	INSPECT_Dual Mating Tires w/Square	Done		JUHURST	Jun 17, 2022 6:38:11 PM	No	
54,000	!FRA!INSPECT_Wheels for Cracks, Loose Lugs/Indicators, Outer Hub Leaks	Done		JUHURST	Jun 17, 2022 6:38:17 PM	No	
54,100	INSPECT_Mud Flaps, Brackets	Done		JUHURST	Jun 17, 2022 6:38:22 PM	No	
54,200	RECORD_RRO-Tire Tread Depth (32nds)	7 32nds of an inch		JUHURST	Jun 17, 2022 6:39:14 PM	No	
54,300	RECORD_RRI-Tire Tread Depth (32nds)	6 32nds of an inch		JUHURST	Jun 17, 2022 6:39:23 PM	No	
54,400	RECORD_RRO-Air Pressure (psi)	65 Pounds per Square Inch		JUHURST	Jun 17, 2022 6:39:33 PM	No	
54,500	RECORD_RRI-Air Pressure (psi)	65 Pounds per Square Inch		JUHURST	Jun 17, 2022 6:39:46 PM	No	
54,600	RECORD_LRO-Tire Tread Depth (32nds)	7 32nds of an inch		JUHURST	Jun 17, 2022 6:40:13 PM	No	
54,700	RECORD_LRI-Tire Tread Depth (32nds)	6 32nds of an inch		JUHURST	Jun 17, 2022 6:40:21 PM	No	
54,800	RECORD_LRO-Air Pressure (psi)	65 Pounds per Square Inch		JUHURST	Jun 17, 2022 6:40:34 PM	No	
54,900	RECORD_LRI-Air Pressure (psi)	65 Pounds per Square Inch		JUHURST	Jun 17, 2022 6:40:40 PM	No	
55,000	!FRA!INSPECT_ REAR Brake Assemblies	Done		JUHURST	Jun 17, 2022 6:40:45 PM	No	
55,100	!FRA!INSPECT_ REAR Hubs, Wheel Seals for Oil Leaks	Done		JUHURST	Jun 17, 2022 6:40:57 PM	No	
55,200	!FRA!INSPECT_REAR ABS Tone Rings, Sensors, Routing Of Cables (if equipped)	Done		JUHURST	Jun 17, 2022 6:41:01 PM	No	
55,300	MEASURE_RECORD_LR - Brake Lining, Pad Thickness (32nds)	10 32nds of an inch		JUHURST	Jun 17, 2022 6:41:21 PM	No	
55,400	MEASURE_RECORD_RR - Brake Lining, Pad Thickness (32nds)	10 32nds of an inch		JUHURST	Jun 17, 2022 6:41:29 PM	No	
55,500	INSPECT VISUALLY_MEASURE_RECORD_LR Drum, Rotor Condition (inches)	1.269 Inch		JUHURST	Jun 17, 2022 6:41:39 PM	No	
55,600	INSPECT VISUALLY_MEASURE_RECORD_RR Drum, Rotor Condition (inches)	1.269 Inch		JUHURST	Jun 17, 2022 6:41:55 PM	No	
55,700	!FRA!INSPECT_ Under Body Exhaust System	Done		JUHURST	Jun 17, 2022 6:41:50 PM	No	
55,800	*RPT*INSPECT_ REAR Axle Housing, Breather; CLEAN_Breather	Done		JUHURST	Jun 17, 2022 6:42:16 PM	No	
55,900	*RPT*INSPECT_ REAR Springs, Shocks, Suspension, Airbags	Done		JUHURST	Jun 17, 2022 6:42:12 PM	No	
60,000	SECTION 6 - Wheelchair Inspection	Done		JUHURST	Jun 17, 2022 6:42:22 PM	No	
60,100	RECORD_Wheelchair Cycle Count	14491 Cycles		JUHURST	Jun 17, 2022 6:42:40 PM	No	
60,200	CHECK_ Lift Access Door for Ease of Opening,Latch Security,Door Hold Back	Done		JUHURST	Jun 17, 2022 6:42:47 PM	No	
60,300	CHECK_Platform Emergency Release Mechanism for Ease of Operation	Done		JUHURST	Jun 17, 2022 6:42:52 PM	No	
60,400	OPERATE_Lift thru Complete Cycle;CHECK_Noises,Jerky Op,Too Fast-	Done		JUHURST	Jun 17, 2022 6:43:01 PM	No	

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
	Slow,Drift Down						
60,500	INSPECT_ Bridgeplate Operation	Done		JUHURST	Jun 17, 2022 6:43:08 PM	No	
60,600	INSPECT_All Pivot Points for Wear and Looseness	Done		JUHURST	Jun 17, 2022 6:43:14 PM	No	
60,700	INSPECT_Rollers for Wear and Smooth Rotation	Done		JUHURST	Jun 17, 2022 6:43:19 PM	No	
60,800	INSPECT_Operation of Platform Barrier Mechanism	Done		JUHURST	Jun 17, 2022 6:43:23 PM	No	
60,900	INSPECT_Cam Slots for Wear and Proper Alignment	Done		JUHURST	Jun 17, 2022 6:43:28 PM	No	
61,000	INSPECT_Cable Condition (If Applicable)	Done		JUHURST	Jun 17, 2022 6:43:33 PM	No	
61,100	INSPECT_Hydraulic Hoses for Leaks, Chafing or Cracks	Done		JUHURST	Jun 17, 2022 6:43:38 PM	No	
61,200	INSPECT_Electrical Connections and Routing of Wires and Cables	Done		JUHURST	Jun 17, 2022 6:43:42 PM	No	
61,300	INSPECT_Operation and Adjustment of All Safety Switches	Done		JUHURST	Jun 17, 2022 6:43:50 PM	No	
61,400	INSPECT_All Lift Mounting Brackets for Loose Bolts Broken Welds, etc.	Done		JUHURST	Jun 17, 2022 6:43:55 PM	No	
61,500	INSPECT_Manual Back-up Raise/Lower System (If Applicable)	Done		JUHURST	Jun 17, 2022 6:44:00 PM	No	
61,600	INSPECT_HydrPump Reservoir Oil Level. Consult SrvManual for Fluid to Use.	Done		JUHURST	Jun 17, 2022 6:44:08 PM	No	
61,700	CHECK_Operator Decals for Proper Positioning;CONSULT_Service Manual	Done		JUHURST	Jun 17, 2022 6:44:31 PM	No	
61,800	CHECK_WC Holddowns Inside Vehicle for Secure Mounting,Proper Operation	Done		JUHURST	Jun 17, 2022 6:44:36 PM	No	
61,900	CLEAN_Linkages and Mechanisms	Done		JUHURST	Jun 17, 2022 6:44:43 PM	No	
62,000	LUBRICATE_Linkages and Mechanisms (DO NOT OVER Lubricate)	Done		JUHURST	Jun 17, 2022 6:44:48 PM	No	
62,100	INSPECT_Emergency Platform Release Mechanism	Done		JUHURST	Jun 17, 2022 6:44:54 PM	No	
62,200	INSPECT_Platform Barrier Latch Mechanism	Done		JUHURST	Jun 17, 2022 6:44:59 PM	No	
62,300	INSPECT_Bridgeplate Hinge	Done		JUHURST	Jun 17, 2022 6:45:08 PM	No	
62,400	INSPECT_All Pivot Points	Done		JUHURST	Jun 17, 2022 6:45:13 PM	No	
62,500	INSPECT_Cams and Slots	Done		JUHURST	Jun 17, 2022 6:45:19 PM	No	
62,600	INSPECT_Rollers	Done		JUHURST	Jun 17, 2022 6:45:25 PM	No	
62,700	INSPECT_All Linkages	Done		JUHURST	Jun 17, 2022 6:45:30 PM	No	
70,000	SECTION 7 - ALTERNATIVE FUELS INSPECTION	Done		JUHURST	Jun 17, 2022 6:45:34 PM	No	
70,300	INSPECT_Condition of Fuel Pressure Gauge	Done		JUHURST	Jun 17, 2022 6:45:39 PM	No	
70,400	PROVIDE PROOF_Tank_Dents/Scratches and Re-Certification	Done		JUHURST	Jun 17, 2022 6:45:46 PM	No	
70,500	INSPECT_Tank test date, labels-Reference-ST.4 FMMVSS 304 & ANSI-CSA NGV2	Done		JUHURST	Jun 17, 2022 6:45:51 PM	No	

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
70,600	INSPECT_ Tank Lines to Ensure Secure Mounting, Insulation Against Vibration	Done		JUHURST	Jun 17, 2022 6:45:59 PM	No	
70,700	INSPECT_ Filling Nozzle for Securely Fitting Cap	Done		JUHURST	Jun 17, 2022 6:46:06 PM	No	
70,800	INSPECT_ Pressure Relief Device's Venting System, Valves, Ducting to MNFR Specs	Done		JUHURST	Jun 17, 2022 6:46:12 PM	No	
80,000	SECTION 8 - PMI Report Completion	Done		JUHURST	Jun 17, 2022 6:46:17 PM	No	
80,100	COMPLETE_PM Report; Follow-ups	Done		JUHURST	Jun 17, 2022 6:58:13 PM	No	
80,200	RETURN_Vehicle to Predetermined Location	Done		JUHURST	Jun 17, 2022 6:46:29 PM	No	

LH: 20 Desc: PM A

Task: PM A SERVICE Performed by: JUHURST Performed on: 17-JUN-22

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
100,000	"A" PMI SERVICING ITEMS	Done		JUHURST	Jun 17, 2022 7:34:22 PM	No	
101,000	FRA Change Oil Filters	Yes		JUHURST	Jun 17, 2022 7:34:28 PM	No	
102,000	FRA Drain Engine Oil	Yes		JUHURST	Jun 17, 2022 7:34:40 PM	No	
103,000	FRA Check Transmission Fluid	Done		JUHURST	Jun 17, 2022 7:34:54 PM	No	
104,000	Lubricate Chassis	Done		JUHURST	Jun 17, 2022 7:35:00 PM	No	
105,000	Replace or Clean A/C Filters	Done		JUHURST	Jun 17, 2022 7:35:05 PM	No	
107,000	FRA Change Primary Fuel Filter	No		JUHURST	Jun 17, 2022 7:35:16 PM	No	
108,000	Lube all pivoting Mechanisms	Done		JUHURST	Jun 17, 2022 7:35:23 PM	No	

LH: 5 Desc: PERSONAL RISK ASSESSMENT

Task: PRA and Meter Readings Performed by: JUHURST Performed on: 17-JUN-22

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
1	Are you properly trained to perform the task?	Done		JUHURST	Jun 17, 2022 3:53:52 PM	No	
2	If task requires lifting, are lifts secured, are jack stands used correctly?	Done		JUHURST	Jun 17, 2022 3:53:48 PM	No	
4	Are you wearing the appropriate PPE?	Done		JUHURST	Jun 17, 2022 3:58:43 PM	No	
7	Have you performed the proper LOTO?	Done		JUHURST	Jun 17, 2022 3:58:47 PM	No	
10	Are you aware of the potential risks of performing this repair?	Done		JUHURST	Jun 17, 2022 3:58:52 PM	No	
11	Have you successfully completed the Personal Risk Assessment?	Done		JUHURST	Jun 17, 2022 3:58:57 PM	No	



WorkOrder
55345 Palm Tran Connection
v 2.2
Page 1 of 10



WorkOrder: 55702294
Invoice Number: 55345-55702294

Client Department:

MRC:	55345M	Equipment:	4514-P
WO Desc:			Ford E450 Champion Challenger
55345-LIGHT DUTY PMA		VIN:	1FDFE4FS7EDB17176
Requested By:	JUHURST	Status:	40
Created By:	JUHURST	Priority:	3
Class:	WO	Driver:	
Arrangement:	Unassigned	Phone:	
Potential Warranty:	No	ETA:	

Chronology		
Reported	Jul 21, 2022	12:00 AM
Started	Jul 27, 2022	
Completed	Jul 27, 2022	7:34 PM
Down Time		

Meter	Reading	UOM
WO		DH
Life	307,414	DH

WorkOrder Notes

Line	Comment
10	COMPLAINT: Perform PMA Service. CAUSE: Service Due by Mileage CORRECTION: Change Oil & Filter Lube all Pivoting Points. Check Brakes Clean batteries, parts # B329 Qty (1) Oil 5W30 Qty (7,0) Qts

Activity: 5 **999/999/999 TOTAL VEHICLE**

Activity Note: PERSONAL RISK ASSESSMENT
Reason for Repair: SW - Shop Work Order
Work Accomplished: 06 - Inspect
Part Failure: 00 - No Failure

Activity Comments

Parts Issued

Date	Part Number		Description	Qty.	Each	Extended
------	-------------	--	-------------	------	------	----------

Labor Posted

Date	Technician	Hours	Rate	Extended
------	------------	-------	------	----------

Activity 5 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours: 0.00	
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00

Activity: 10 **079 DEVICES, SAFETY/STABILITY, TRAILER**

Activity Note: Light Duty PMI
Reason for Repair: 05 - Inspection, Routine
Work Accomplished: -
Part Failure: -

Activity Comments

Parts Issued

Date	Part Number		Description	Qty.	Each	Extended
27-Jul-22	B329		FILTER, OIL, SPIN-ON	1.00	2.19	2.19



WorkOrder
55345 Palm Tran Connection
v 2.2
Page 2 of 10



WorkOrder: 55702294
Invoice Number: 55345-55702294

Client Department:

MRC: 55345M
WO Desc: 55345-LIGHT DUTY PMA
Requested By: JUHURST
Created By: JUHURST
Class: WO
Arrangement: Unassigned
Potential Warranty: No

Equipment: 4514-P
Ford E450 Champion Challenger
1FD4E4FS7EDB17176
VIN:
Status: 40
Priority: 3
Driver:
Phone:
ETA:

Labor Posted

Date	Technician	Hours	Rate	Extended
27-Jul-22	Arthurs,Durvin	2.18	0.00	0.00

Activity 10 Sub Total

Parts: 2.19
Labor: 0.00
Labor Hours: 2.18
Sublet Parts: 0.00
Sublet Labor: 0.00
Activity Sub Total 2.19

Activity: 20 999 TOTAL VEHICLE

Activity Note: PM A
Reason for Repair: 08 - Preventive Maintenance
Work Accomplished: A - PM Level A
Part Failure: -

Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
------	-------------	-------------	------	------	----------

Labor Posted

Date	Technician	Hours	Rate	Extended
27-Jul-22	Arthurs,Durvin	0.37	0.00	0.00

Activity 20 Sub Total

Parts: 0.00
Labor: 0.00
Labor Hours: 0.37
Sublet Parts: 0.00
Sublet Labor: 0.00
Activity Sub Total 0.00

WorkOrder 55702294 Grand Total

Parts: 2.19
Labor: 0.00
Labor Hours: 2.55
Sublet Parts: 0.00
Sublet Labor: 0.00
WorkOrder Grand Total 2.19

Recent Repair History

WorkOrder	Date Completed	Life Meter	Class	Description
55702294	27-Jul-22	307,414	WO	55345-LIGHT DUTY PMA
55794542	22-Jul-22	306,917	WO	check bus for coolant smell



WorkOrder
55345 Palm Tran Connection
v 2.2
Page 3 of 10



WorkOrder: 55702294
Invoice Number: 55345-55702294

Client Department:

MRC: 55345M
WO Desc: 55345-LIGHT DUTY PMA
Requested By: JUHURST
Created By: JUHURST
Class: WO
Arrangement: Unassigned
Potential Warranty: No

Equipment: 4514-P
Ford E450 Champion Challenger
VIN: 1FDFE4FS7EDB17176
Status: 40
Priority: 3
Driver:
Phone:
ETA:

WorkOrder	Date Completed	Life Meter	Class	Description
55764309	11-Jul-22	305,489	WO	w/c lift not working

Scheduled Preventative Maintenance

Nest	PM	WorkOrder	Due Date	Due Life Meter	Due Meter Reading	Due Life Meter 2	Due Meter Reading 2
------	----	-----------	----------	----------------	-------------------	------------------	---------------------

Other Open Repairs

WorkOrder8	Date Reported	Life Meter	Class	Description
------------	---------------	------------	-------	-------------

PH: Work Order: 55702294 Desc: 55345-LIGHT DUTY PMA
Equip: 4514-P Desc: Ford E450 Champion Challenger VIN: 1FDFE4FS7EDB17176

LH: 10 Desc: Light Duty PMI

Task: First Transit North America Light Duty PM Inspection Sheet Performed by: DARTHURS Performed on: 27-JUL-22

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
10,000	SECTION 1 - Preparation Inspection	Done		DARTHURS	Jul 27, 2022 6:28:32 PM	No	
10,100	INSPECT_Auto-Transmission Operation/Controller; Neutral Safety Switch	Done		DARTHURS	Jul 27, 2022 6:28:37 PM	No	
10,200	!FRA!INSPECT_Starter Operation	Done		DARTHURS	Jul 27, 2022 6:28:44 PM	No	
10,300	!FRA!INSPECT_Warning Lights and Alarms	Done		DARTHURS	Jul 27, 2022 6:28:48 PM	No	
10,400	!FRA!INSPECT_Back Up Alarm	Done		DARTHURS	Jul 27, 2022 6:28:54 PM	No	
10,500	!FRA!INSPECT_Engine Operation, OBSERVE_ Exhaust for Excessive Smoke	Done		DARTHURS	Jul 27, 2022 6:29:00 PM	No	
10,600	Check Driver's Pre-trip or DVIR/EVIR & Authorization Forms	Done		DARTHURS	Jul 27, 2022 6:29:07 PM	No	
10,700	INSPECT_All Exterior Lights (Turn on until Completion of this section)	Done		DARTHURS	Jul 27, 2022 6:29:14 PM	No	
10,800	*RPT*INSPECT_Body Damage, Corrosion;DOCUMENT_Issues	Done		DARTHURS	Jul 27, 2022 6:29:20 PM	No	
10,900	INSPECT_Fuel Tank Cap, and Doors	Done		DARTHURS	Jul 27, 2022 6:29:27 PM	No	
11,100	INSPECT_License Plate, Bracket, Bumpers	Done		DARTHURS	Jul 27, 2022 6:29:33 PM	No	
20,000	SECTION 2 - Test Drive and Operator Area Inspection	Done		DARTHURS	Jul 27, 2022 6:29:39 PM	No	
20,100	INSPECT_Driver Seat condition/operation/seatbelt	Done		DARTHURS	Jul 27, 2022 6:29:44 PM	No	
20,200	TEST DRIVE_INSPECT_Proper Operation; Drive into Shop	Done		DARTHURS	Jul 27, 2022 6:29:50 PM	No	
20,300	*RPT*INSPECT_Steering Wheel for Play/Bind/Horn Op./Turn Signal Cancelation	Done		DARTHURS	Jul 27, 2022 6:30:01 PM	No	
20,400	PERFORM_Brake Test (Apply hard enough to check wheel pull and Application)	Done		DARTHURS	Jul 27, 2022 6:30:08 PM	No	
20,500	*RPT*FRA INSPECT_Lighting/Operation of all Gauges	Done		DARTHURS	Jul 27, 2022 6:30:14 PM	No	
20,600	*RPT*INSPECT_Windshields, Sun Visors	Done		DARTHURS	Jul 27, 2022 6:30:20 PM	No	
20,700	INSPECT_Wiper/Washer Operation, Condition	Done		DARTHURS	Jul 27, 2022 6:30:28 PM	No	
20,800	INSPECT_High Idle Control	Done		DARTHURS	Jul 27, 2022 6:30:33 PM	No	
20,900	*RPT*!FRA!INSPECT_HVAC Controls, Operation	Done		DARTHURS	Jul 27, 2022 6:30:39 PM	No	
21,000	*RPT*!FRA!INSPECT_Operation of all Switches and Accessories	Done		DARTHURS	Jul 27, 2022 6:30:46 PM	No	
21,100	INSPECT_Parking Brake Operation	Done		DARTHURS	Jul 27, 2022 6:30:51 PM	No	
21,200	!FRA!TEST_Service Brake Backup System (Stationary Brake Tests HYD)	Done		DARTHURS	Jul 27, 2022 6:30:56 PM	No	
21,300	INSPECT_VIN, Tire Pressure Decal, Data Tags	Done		DARTHURS	Jul 27, 2022	No	

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
					6:31:02 PM		
21,400	*RPT*INSPECT_Drivers Door Hinges, Handles, Controls and Panels	Done		DARTHURS	Jul 27, 2022 6:31:11 PM	No	
21,500	!FRA!INSPECT_Under Dash Wiring for Proper Routing/Chafing/Securement	Done		DARTHURS	Jul 27, 2022 6:31:19 PM	No	
21,550	INSPECT_Driver Floor Area for Rust/Water Leaks	Done		DARTHURS	Jul 27, 2022 6:31:26 PM	No	
21,600	*RPT*INSPECT for WEAR_Pedal Pads, Accelerator, Brake, Parking Brake	Done		DARTHURS	Jul 27, 2022 6:31:32 PM	No	
21,700	INSPECT_Engine Fault Codes	Done		DARTHURS	Jul 27, 2022 6:31:37 PM	No	
30,000	SECTION 3 - EXTERIOR INSPECTION - Front	Done		DARTHURS	Jul 27, 2022 6:31:42 PM	No	
31,000	SSF (Street Side Front)	Done		DARTHURS	Jul 27, 2022 6:31:47 PM	No	
31,010	*RPT*!FRA!INSPECT_Mirror Mountings, Brackets, Glass	Done		DARTHURS	Jul 27, 2022 6:31:57 PM	No	
31,020	*RPT*INSPECT_ FRONT Springs, Shocks, Spring Shackles	Done		DARTHURS	Jul 27, 2022 6:32:04 PM	No	
31,030	INSPECT_Mud Flaps, Brackets	Done		DARTHURS	Jul 27, 2022 6:32:09 PM	No	
31,040	INSPECT_Wiper Blades, Arms	Done		DARTHURS	Jul 27, 2022 6:32:18 PM	No	
32,000	Engine Inspection	Done		DARTHURS	Jul 27, 2022 6:32:24 PM	No	
32,010	INSPECT_Hood, Springs and Props	Done		DARTHURS	Jul 27, 2022 6:32:29 PM	No	
32,020	!FRA!INSPECT_Engine Compartment Condition for Fire Risk Avoidance	Done		DARTHURS	Jul 27, 2022 6:32:34 PM	No	
32,030	!FRA!INSPECT_for Fluid Leaks, Levels	Done		DARTHURS	Jul 27, 2022 6:32:39 PM	No	
32,040	!FRA!INSPECT_Hyd_Brake Fluid with Test Strips	-	NA	DARTHURS	Jul 27, 2022 6:32:53 PM	No	
32,050	!FRA!INSPECT_RECORD_Coolant Recovery with Refractometer; Test Strips	Degree Fahrenheit	NA	DARTHURS	Jul 27, 2022 6:33:04 PM	No	
32,060	PRESSURE TEST_Cooling Systems (Radiator, Cap, hoses and clamps)	Done		DARTHURS	Jul 27, 2022 6:33:11 PM	No	
32,070	*RPT*INSPECT_Radiator and Mountings, Cores	Done		DARTHURS	Jul 27, 2022 6:33:19 PM	No	
32,080	*RPT*INSPECT_Fan Assembly,Shroud,Tensioner,Belts,All Belt Driven Components	Done		DARTHURS	Jul 27, 2022 6:33:27 PM	No	
32,090	*RPT*!FRA!INSPECT_Mounting, Installation of Alternator, AC Compressor	Done		DARTHURS	Jul 27, 2022 6:33:34 PM	No	
32,100	INSPECT_Intake System	Done		DARTHURS	Jul 27, 2022 6:33:40 PM	No	
32,140	*RPT*!FRA!RECORD_Underhood Battery Voltages (volts)	0 Volt*		DARTHURS	Jul 27, 2022 6:33:51 PM	No	
33,010	CSF (Curb Side Front)	Done		DARTHURS	Jul 27, 2022 6:33:57 PM	No	
33,020	*RPT*!FRA!INSPECT_Mirror Mountings, Brackets, Glass	Done		DARTHURS	Jul 27, 2022 6:34:02 PM	No	
33,030	*RPT*INSPECT_ FRONT Springs, Shocks, Spring Shackles	Done		DARTHURS	Jul 27, 2022 6:34:08 PM	No	
33,040	INSPECT_Mud Flaps, Brackets	Done		DARTHURS	Jul 27, 2022	No	

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
					6:34:14 PM		
33,050	INSPECT_Wiper Blades, Arms	Done		DARTHURS	Jul 27, 2022 6:34:18 PM	No	
33,060	!FRA!INSPECT_LUBE_Battery Box, Batteries, Tray Slides, Hold Downs	Done		DARTHURS	Jul 27, 2022 6:34:23 PM	No	
33,070	*RPT*!FRA!RECORD_Side Mounted Battery Voltages (volts)	13.96 Volt*		DARTHURS	Jul 27, 2022 6:35:04 PM	No	
33,070	*RPT*!FRA!RECORD_Side Mounted Battery Voltages (volts)	13.96 Volt*		DARTHURS	Jul 27, 2022 6:34:40 PM	No	
33,080	INSPECT_Entry door, OPEN_with external lock/switch (if equipped)	Done		DARTHURS	Jul 27, 2022 6:35:09 PM	No	
40,000	SECTION 4 - Interior Inspection	Done		DARTHURS	Jul 27, 2022 6:35:15 PM	No	
40,100	*RPT*INSPECT_Step-Well, Step-Tread, Hand Rails, Step-well Light	Done		DARTHURS	Jul 27, 2022 6:35:21 PM	No	
40,200	INSPECT_Insurance/Registration/Regulatory Forms Dates	Done		DARTHURS	Jul 27, 2022 6:35:27 PM	No	
40,250	INSPECT_Overhead Compartment for Water Leaks	Done		DARTHURS	Jul 27, 2022 6:35:32 PM	No	
40,300	INSPECT_Safety Equipment, Fire Extinguisher/Suppression	Done		DARTHURS	Jul 27, 2022 6:35:37 PM	No	
40,400	INSPECT_Camera Systems, Filter, Electrical Inputs/Outputs-SOP M038	Done		DARTHURS	Jul 27, 2022 6:35:42 PM	No	
40,600	!FRA!CHECK for HOTSPOTS_Interior Elec Panel Fuses/Circuit Breakers/Connectors	Done		DARTHURS	Jul 27, 2022 6:35:48 PM	No	
40,700	*RPT*INSPECT_Seats, Covering, Belts, Loose Cushions, Operation	Done		DARTHURS	Jul 27, 2022 6:35:55 PM	No	
40,800	*RPT*!FRA!INSPECT_Interior Lights; Mirrors	Done		DARTHURS	Jul 27, 2022 6:36:01 PM	No	
40,900	!FRA!INSPECT_Interior Cleanliness/Potential Projectiles	Done		DARTHURS	Jul 27, 2022 6:36:06 PM	No	
41,000	INSPECT_All ADA Equip (Lift Seat Belt, floor hold Downs, Belts, Cover, Alarms)	Done		DARTHURS	Jul 27, 2022 6:36:13 PM	No	
41,100	INSPECT_CLEAN_AC Filter	Done		DARTHURS	Jul 27, 2022 6:36:17 PM	No	
41,200	INSPECT_Emergency Windows,Hatches,Doors,Alarms/Lights;CHECK_for Leaks	Done		DARTHURS	Jul 27, 2022 6:36:23 PM	No	
41,300	*RPT*INSPECT_Interior Body, Floor, Stanchions	Done		DARTHURS	Jul 27, 2022 6:36:31 PM	No	
41,400	*RPT*INSPECT_Passenger Doors, Glass, Seal	Done		DARTHURS	Jul 27, 2022 6:36:38 PM	No	
50,000	SECTION 5 - UNDER VEHICLE INSPECTION	Done		DARTHURS	Jul 27, 2022 6:36:43 PM	No	
50,100	*RPT*INSPECT_Steering components-Drag Link, Tie Rods ends and Steering Damper	Done		DARTHURS	Jul 27, 2022 6:36:48 PM	No	
50,200	INSPECT_Ball Joint Play	Done		DARTHURS	Jul 27, 2022 6:37:01 PM	No	
50,300	!FRA!INSPECT_Front Wheel Bearings for Play	Done		DARTHURS	Jul 27, 2022 6:37:05 PM	No	
50,400	LUBE_All Chassis Components	Done		DARTHURS	Jul 27, 2022 6:37:10 PM	No	
50,500	!FRA!CHANGE_Engine oil,filters	Done		DARTHURS	Jul 27, 2022 6:37:19 PM	No	
50,700	INSPECT_Tire Condition	Done		DARTHURS	Jul 27, 2022	No	

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
					6:37:24 PM		
50,800	INSPECT_Tire Valve Stems, Double Check Caps	Done		DARTHURS	Jul 27, 2022 6:37:29 PM	No	
50,900	!FRA!INSPECT_Wheels for Cracks, Loose Lugs/Indicators, Outer Hub Leaks	Done		DARTHURS	Jul 27, 2022 6:37:33 PM	No	
51,000	RECORD_LF-Tire Tread Depth (32nds)	10 32nds of an inch		DARTHURS	Jul 27, 2022 6:37:45 PM	No	
51,100	RECORD_LF-Tire Air Pressure (psi)	70 Pounds per Square Inch		DARTHURS	Jul 27, 2022 6:37:51 PM	No	
51,200	RECORD_RF-Tire Tread Depth (32nds)	8 32nds of an inch		DARTHURS	Jul 27, 2022 6:37:58 PM	No	
51,300	RECORD_RF-Air Pressure (psi)	70 Pounds per Square Inch		DARTHURS	Jul 27, 2022 6:38:08 PM	No	
51,400	!FRA!INSPECT_FRONT ABS Tone Rings, Sensors, Routing of Cables	Done		DARTHURS	Jul 27, 2022 6:38:12 PM	No	
51,500	!FRA!INSPECT_Wheel Seals for Leaks	Done		DARTHURS	Jul 27, 2022 6:38:17 PM	No	
51,600	!FRA!INSPECT_Front Brake Assemblies	Done		DARTHURS	Jul 27, 2022 6:38:22 PM	No	
51,700	MEASURE_RECORD_LF - Brake Lining, Pad Thickness (32nds)	4 32nds of an inch		DARTHURS	Jul 27, 2022 6:38:29 PM	No	
51,800	MEASURE_RECORD_RF - Brake Lining, Pad Thickness (32nds)	5 32nds of an inch		DARTHURS	Jul 27, 2022 6:38:35 PM	No	
51,900	INSPECT VISUALLY_RECORD_LF Rotor Condition (inches)	1.554 Inch		DARTHURS	Jul 27, 2022 6:38:48 PM	No	
52,000	INSPECT VISUALLY_RECORD_RF Rotor Condition (inches)	1.554 Inch		DARTHURS	Jul 27, 2022 6:38:55 PM	No	
52,100	INSPECT_Vibration Damper	Done		DARTHURS	Jul 27, 2022 6:39:01 PM	No	
52,200	!FRA!INSPECT_Battery Cable Routing from Battery Box to Starter	Done		DARTHURS	Jul 27, 2022 6:39:07 PM	No	
52,400	!FRA!INSPECT_Starter Mounting	Done		DARTHURS	Jul 27, 2022 6:39:11 PM	No	
52,500	!FRA!INSPECT_Engine Exhaust System	Done		DARTHURS	Jul 27, 2022 6:39:16 PM	No	
52,700	INSPECT_Engine, Transmission Mounts	-	Right Engine Mount	DARTHURS	Jul 27, 2022 6:39:58 PM	Yes	55809206
52,800	!FRA!INSPECT_Engine, Transmission for Fluid Leaks	Done		DARTHURS	Jul 27, 2022 6:40:04 PM	No	
52,900	INSPECT_Shift Cable Adjustment - All Transmissions	Done		DARTHURS	Jul 27, 2022 6:40:10 PM	No	
53,000	!FRA!INSPECT_Transmission Breather and Clean	Done		DARTHURS	Jul 27, 2022 6:40:14 PM	No	
53,100	*RPT*!FRA!INSPECT_Parking Brake Cables, Shoes for Wear, Contamination	Done		DARTHURS	Jul 27, 2022 6:40:21 PM	No	
53,200	*RPT*INSPECT_A/C Condensor, Fans, Safety Grills	Done		DARTHURS	Jul 27, 2022 6:40:37 PM	No	
53,300	*RPT*INSPECT_Driveline, Hanger Bearings, U-Joints, Slip Joints, Safety Loop	Done		DARTHURS	Jul 27, 2022 6:40:41 PM	No	
53,400	*RPT*INSPECT_All Body Mounts and Chassis Frame for Corrosion, Cracks	Done		DARTHURS	Jul 27, 2022 6:40:48 PM	No	
53,500	!FRA!INSPECT_Fuel Tank, Mountings, Lines	Done		DARTHURS	Jul 27, 2022 6:40:53 PM	No	
53,600	INSPECT_Tire Condition	Done		DARTHURS	Jul 27, 2022	No	

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
					6:40:57 PM		
53,700	INSPECT_Tire Valve Stems, Double Check Caps	Done		DARTHURS	Jul 27, 2022 6:41:03 PM	No	
53,800	INSPECT_ Mismatched Tire Tread, Casing Design	Done		DARTHURS	Jul 27, 2022 6:41:09 PM	No	
53,900	INSPECT_Dual Mating Tires w/Square	Done		DARTHURS	Jul 27, 2022 6:41:14 PM	No	
54,000	!FRA!INSPECT_Wheels for Cracks, Loose Lugs/Indicators, Outer Hub Leaks	Done		DARTHURS	Jul 27, 2022 6:41:21 PM	No	
54,100	INSPECT_Mud Flaps, Brackets	Done		DARTHURS	Jul 27, 2022 6:41:27 PM	No	
54,200	RECORD_RRO-Tire Tread Depth (32nds)	2 32nds of an inch		DARTHURS	Jul 27, 2022 6:41:37 PM	No	
54,300	RECORD_RRI-Tire Tread Depth (32nds)	2 32nds of an inch		DARTHURS	Jul 27, 2022 6:41:43 PM	No	
54,400	RECORD_RRO-Air Pressure (psi)	65 Pounds per Square Inch		DARTHURS	Jul 27, 2022 6:41:53 PM	No	
54,500	RECORD_RRI-Air Pressure (psi)	65 Pounds per Square Inch		DARTHURS	Jul 27, 2022 6:42:01 PM	No	
54,600	RECORD_LRO-Tire Tread Depth (32nds)	2 32nds of an inch		DARTHURS	Jul 27, 2022 6:42:07 PM	No	
54,700	RECORD_LRI-Tire Tread Depth (32nds)	2 32nds of an inch	Rear Tires	DARTHURS	Jul 27, 2022 6:44:26 PM	Yes	55809206
54,800	RECORD_LRO-Air Pressure (psi)	65 Pounds per Square Inch		DARTHURS	Jul 27, 2022 6:42:20 PM	No	
54,900	RECORD_LRI-Air Pressure (psi)	65 Pounds per Square Inch		DARTHURS	Jul 27, 2022 6:42:26 PM	No	
55,000	!FRA!INSPECT_ REAR Brake Assemblies	Done		DARTHURS	Jul 27, 2022 6:42:31 PM	No	
55,100	!FRA!INSPECT_ REAR Hubs, Wheel Seals for Oil Leaks	Done		DARTHURS	Jul 27, 2022 6:42:35 PM	No	
55,200	!FRA!INSPECT_ REAR ABS Tone Rings, Sensors, Routing Of Cables (if equipped)	Done		DARTHURS	Jul 27, 2022 6:42:40 PM	No	
55,300	MEASURE_RECORD_LR - Brake Lining, Pad Thickness (32nds)	12 32nds of an inch		DARTHURS	Jul 27, 2022 6:42:50 PM	No	
55,400	MEASURE_RECORD_RR - Brake Lining, Pad Thickness (32nds)	12 32nds of an inch		DARTHURS	Jul 27, 2022 6:42:57 PM	No	
55,500	INSPECT VISUALLY_MEASURE_RECORD_ LR Drum, Rotor Condition (inches)	1.665 Inch		DARTHURS	Jul 27, 2022 6:43:09 PM	No	
55,600	INSPECT VISUALLY_MEASURE_RECORD_ RR Drum, Rotor Condition (inches)	1.665 Inch		DARTHURS	Jul 27, 2022 6:43:16 PM	No	
55,700	!FRA!INSPECT_ Under Body Exhaust System	Done		DARTHURS	Jul 27, 2022 6:43:21 PM	No	
55,800	*RPT*INSPECT_ REAR Axle Housing, Breather; CLEAN_Breather	Done		DARTHURS	Jul 27, 2022 6:43:26 PM	No	
55,900	*RPT*INSPECT_ REAR Springs, Shocks, Suspension, Airbags	Done		DARTHURS	Jul 27, 2022 6:43:32 PM	No	
60,000	SECTION 6 - Wheelchair Inspection	Done		DARTHURS	Jul 27, 2022 6:43:37 PM	No	
60,100	RECORD_Wheelchair Cycle Count	14748 Cycles		DARTHURS	Jul 27, 2022 6:45:02 PM	No	
60,200	CHECK_ Lift Access Door for Ease of Opening,Latch Security,Door Hold Back	Done		DARTHURS	Jul 27, 2022 6:45:07 PM	No	
60,300	CHECK_Platform Emergency Release Mechanism for Ease of Operation	Done		DARTHURS	Jul 27, 2022 6:45:11 PM	No	

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
60,400	OPERATE_Lift thru Complete Cycle;CHECK_Noises,Jerky Op,Too Fast-Slow,Drift Down	Done		DARTHURS	Jul 27, 2022 6:45:16 PM	No	
60,500	INSPECT_ Bridgeplate Operation	Done		DARTHURS	Jul 27, 2022 6:45:21 PM	No	
60,600	INSPECT_All Pivot Points for Wear and Looseness	Done		DARTHURS	Jul 27, 2022 6:45:26 PM	No	
60,700	INSPECT_Rollers for Wear and Smooth Rotation	Done		DARTHURS	Jul 27, 2022 6:45:31 PM	No	
60,800	INSPECT_Operation of Platform Barrier Mechanism	Done		DARTHURS	Jul 27, 2022 6:45:35 PM	No	
60,900	INSPECT_Cam Slots for Wear and Proper Alignment	Done		DARTHURS	Jul 27, 2022 6:45:40 PM	No	
61,000	INSPECT_Cable Condition (If Applicable)	Done		DARTHURS	Jul 27, 2022 6:45:45 PM	No	
61,100	INSPECT_Hydraulic Hoses for Leaks, Chafing or Cracks	Done		DARTHURS	Jul 27, 2022 6:45:49 PM	No	
61,200	INSPECT_Electrical Connections and Routing of Wires and Cables	Done		DARTHURS	Jul 27, 2022 6:45:54 PM	No	
61,300	INSPECT_Operation and Adjustment of All Safety Switches	Done		DARTHURS	Jul 27, 2022 6:46:01 PM	No	
61,400	INSPECT_All Lift Mounting Brackets for Loose Bolts Broken Welds, etc.	Done		DARTHURS	Jul 27, 2022 6:46:06 PM	No	
61,500	INSPECT_Manual Back-up Raise/Lower System (If Applicable)	Done		DARTHURS	Jul 27, 2022 6:46:10 PM	No	
61,600	INSPECT_HydrPump Reservoir Oil Level. Consult SvcManual for Fluid to Use.	Done		DARTHURS	Jul 27, 2022 6:46:15 PM	No	
61,700	CHECK_Operator Decals for Proper Positioning;CONSULT_Service Manual	Done		DARTHURS	Jul 27, 2022 6:46:20 PM	No	
61,800	CHECK_WC Holddowns Inside Vehicle for Secure Mounting,Proper Operation	Done		DARTHURS	Jul 27, 2022 6:46:24 PM	No	
61,900	CLEAN_Linkages and Mechanisms	Done		DARTHURS	Jul 27, 2022 6:46:29 PM	No	
62,000	LUBRICATE_Linkages and Mechanisms (DO NOT OVER Lubricate)	Done		DARTHURS	Jul 27, 2022 6:46:33 PM	No	
62,100	INSPECT_Emergency Platform Release Mechanism	Done		DARTHURS	Jul 27, 2022 6:46:38 PM	No	
62,200	INSPECT_Platform Barrier Latch Mechanism	Done		DARTHURS	Jul 27, 2022 6:46:43 PM	No	
62,300	INSPECT_Bridgeplate Hinge	Done		DARTHURS	Jul 27, 2022 6:46:47 PM	No	
62,400	INSPECT_All Pivot Points	Done		DARTHURS	Jul 27, 2022 6:46:52 PM	No	
62,500	INSPECT_Cams and Slots	Done		DARTHURS	Jul 27, 2022 6:46:59 PM	No	
62,600	INSPECT_Rollers	Done		DARTHURS	Jul 27, 2022 6:47:04 PM	No	
62,700	INSPECT_All Linkages	Done		DARTHURS	Jul 27, 2022 6:47:08 PM	No	
70,000	SECTION 7 - ALTERNATIVE FUELS INSPECTION	Done		DARTHURS	Jul 27, 2022 6:47:13 PM	No	
70,300	INSPECT_Condition of Fuel Pressure Gauge	Done		DARTHURS	Jul 27, 2022 6:47:19 PM	No	
70,400	PROVIDE PROOF_Tank_Dents/Scratches and Re-Certification	Done		DARTHURS	Jul 27, 2022 6:47:23 PM	No	

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
70,500	INSPECT_Tank test date, labels-Reference-ST.4 FMMVSS 304 & ANSI-CSA NGV2	Done		DARTHURS	Jul 27, 2022 6:47:28 PM	No	
70,600	INSPECT_ Tank Lines to Ensure Secure Mounting, Insulation Against Vibration	Done		DARTHURS	Jul 27, 2022 6:47:33 PM	No	
70,700	INSPECT_ Filling Nozzle for Securely Fitting Cap	Done		DARTHURS	Jul 27, 2022 6:47:38 PM	No	
70,800	INSPECT_ Pressure Relief Device's Venting System, Valves, Ducting to MNFR Specs	Done		DARTHURS	Jul 27, 2022 6:47:43 PM	No	
80,000	SECTION 8 - PMI Report Completion	Done		DARTHURS	Jul 27, 2022 6:47:48 PM	No	
80,100	COMPLETE_PM Report; Follow-ups	Done		DARTHURS	Jul 27, 2022 6:47:52 PM	No	
80,200	RETURN_Vehicle to Predetermined Location	Done		DARTHURS	Jul 27, 2022 6:47:57 PM	No	

LH: 20 Desc: PM A

Task: PM A SERVICE Performed by: DARTHURS Performed on: 27-JUL-22

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
100,000	"A" PMI SERVICING ITEMS	Done		DARTHURS	Jul 27, 2022 6:48:28 PM	No	
101,000	FRA Change Oil Filters	Yes		DARTHURS	Jul 27, 2022 6:48:32 PM	No	
102,000	FRA Drain Engine Oil	Yes		DARTHURS	Jul 27, 2022 6:48:37 PM	No	
103,000	FRA Check Transmission Fluid	Done		DARTHURS	Jul 27, 2022 6:48:43 PM	No	
104,000	Lubricate Chassis	Done		DARTHURS	Jul 27, 2022 6:48:47 PM	No	
105,000	Replace or Clean A/C Filters	Done		DARTHURS	Jul 27, 2022 6:48:52 PM	No	
107,000	FRA Change Primary Fuel Filter	No		DARTHURS	Jul 27, 2022 6:49:05 PM	No	
108,000	Lube all pivoting Mechanisms	Done		DARTHURS	Jul 27, 2022 6:49:17 PM	No	

LH: 5 Desc: PERSONAL RISK ASSESSMENT

Task: PRA and Meter Readings Performed by: DARTHURS Performed on: 27-JUL-22

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
1	Are you properly trained to perform the task?	Done		DARTHURS	Jul 27, 2022 6:49:49 PM	No	
2	If task requires lifting, are lifts secured, are jack stands used correctly?	Done		DARTHURS	Jul 27, 2022 6:49:53 PM	No	
4	Are you wearing the appropriate PPE?	Done		DARTHURS	Jul 27, 2022 6:49:58 PM	No	
7	Have you performed the proper LOTO?	Done		DARTHURS	Jul 27, 2022 6:50:02 PM	No	
10	Are you aware of the potential risks of performing this repair?	Done		DARTHURS	Jul 27, 2022 6:50:11 PM	No	
11	Have you successfully completed the Personal Risk Assessment?	Done		DARTHURS	Jul 27, 2022 6:50:16 PM	No	



WorkOrder
55345 Palm Tran Connection
v 2.2
Page 1 of 10



WorkOrder: 55923658
Invoice Number: 55345-55923658

Client Department:

MRC:	55345M	Equipment:	4514-P
WO Desc:			Ford E450 Champion Challenger
55345-LIGHT DUTY PMA		VIN:	1FDFE4FS7EDB17176
Requested By:	DARTHURS	Status:	40
Created By:	DARTHURS	Priority:	3
Class:	WO	Driver:	
Arrangement:	Unassigned	Phone:	
Potential Warranty:	No	ETA:	

Chronology

Reported	Oct 31, 2022	12:00 AM
Started	Nov 2, 2022	
Completed	Nov 2, 2022	8:41 PM
Down Time		

Meter	Reading	UOM
WO		DH
Life	316,924	DH

WorkOrder Notes

Line	Comment
10	COMPLAINT: Vehicle came in for service CAUSE: Service due by Mileage CORRECTION: Service job complete also change oil filter part # B329 wash rear A/C change lift side engine mount Part # F7UZ-6038EB. FRONT AND REAR A/C WORKING ASDSIGN. RETURN VEHICLE BACK TO WORK

Activity: 5



999/999/999 TOTAL VEHICLE

Activity Note: PERSONAL RISK ASSESSMENT
Reason for Repair: SW - Shop Work Order
Work Accomplished: 06 - Inspect
Part Failure: 00 - No Failure

Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
------	-------------	-------------	------	------	----------

Labor Posted

Date	Technician	Hours	Rate	Extended
------	------------	-------	------	----------

Activity 5 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours: 0.00	
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00

Activity: 10



Activity Note: Light Duty PMI
Reason for Repair: -
Work Accomplished: -
Part Failure: -

Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
02-Nov-22	B329	FILTER, OIL, SPIN-ON	1.00	4.11	4.11
02-Nov-22	F7UZ-6038-EB	INSULATOR, SUPPORT, ENGINE, FRONT, LH	1.00	43.69	43.69



WorkOrder
55345 Palm Tran Connection
v 2.2
Page 2 of 10



WorkOrder: 55923658
Invoice Number: 55345-55923658

Client Department:

MRC: 55345M
WO Desc: 55345-LIGHT DUTY PMA
Requested By: DARTHURS
Created By: DARTHURS
Class: WO
Arrangement: Unassigned
Potential Warranty: No

Equipment: 4514-P
Ford E450 Champion Challenger
1FDFE4FS7EDB17176
VIN:
Status: 40
Priority: 3
Driver:
Phone:
ETA:

Labor Posted

Date	Technician	Hours	Rate	Extended
02-Nov-22	Junior Hurst	5.92	0.00	0.00

Activity 10 Sub Total

Parts: 47.80
Labor: 0.00
Labor Hours: 5.92
Sublet Parts: 0.00
Sublet Labor: 0.00
Activity Sub Total 47.80

Activity: 20 999 TOTAL VEHICLE

Activity Note: PM A
Reason for Repair: 08 - Preventive Maintenance
Work Accomplished: A - PM Level A
Part Failure: -

Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
------	-------------	-------------	------	------	----------

Labor Posted

Date	Technician	Hours	Rate	Extended
------	------------	-------	------	----------

Activity 20 Sub Total

Parts: 0.00
Labor: 0.00
Labor Hours: 0.00
Sublet Parts: 0.00
Sublet Labor: 0.00
Activity Sub Total 0.00

WorkOrder 55923658 Grand Total

Parts: 47.80
Labor: 0.00
Labor Hours: 5.92
Sublet Parts: 0.00
Sublet Labor: 0.00
WorkOrder Grand Total 47.80

Recent Repair History

WorkOrder	Date Completed	Life Meter	Class	Description
55923658	2-Nov-22	316,924	WO	55345-LIGHT DUTY PMA
56084701	30-Oct-22	316,379	WO	WC lift malfunction.

Scheduled Preventative Maintenance



WorkOrder
55345 Palm Tran Connection
v 2.2
Page 3 of 10



WorkOrder: 55923658
Invoice Number: 55345-55923658

Client Department:

MRC: 55345M

Equipment: 4514-P

WO Desc:

55345-LIGHT DUTY PMA

VIN: Ford E450 Champion Challenger

1FDFE4FS7EDB17176

Requested By: DARTHURS

Status: 40

Created By: DARTHURS

Priority: 3

Class: WO

Driver:

Arrangement: Unassigned

Phone:

Potential Warranty: No

ETA:

Nest	PM	WorkOrder	Due Date	Due Life Meter	Due Meter Reading	Due Life Meter 2	Due Meter Reading 2
------	----	-----------	----------	----------------	-------------------	------------------	---------------------

Other Open Repairs

WorkOrder8	Date Reported	Life Meter	Class	Description
56084701	30-Oct-22	316,379	WO	WC lift malfunction.

PH: Work Order: 55923658 Desc: 55345-LIGHT DUTY PMA
Equip: 4514-P Desc: Ford E450 Champion Challenger VIN: 1FDFE4FS7EDB17176

LH: 10 Desc: Light Duty PMI

Task: First Transit North America Light Duty PM Inspection Sheet Performed by: JUHURST Performed on: 02-NOV-22

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
10,000	SECTION 1 - Preparation Inspection	Done		JUHURST	Nov 2, 2022 7:46:14 PM	No	
10,100	INSPECT_Auto-Transmission Operation/Controller; Neutral Safety Switch	Done		JUHURST	Nov 2, 2022 7:46:19 PM	No	
10,200	!FRA!INSPECT_Starter Operation	Done		JUHURST	Nov 2, 2022 7:46:30 PM	No	
10,300	!FRA!INSPECT_Warning Lights and Alarms	Done		JUHURST	Nov 2, 2022 7:46:42 PM	No	
10,400	!FRA!INSPECT_Back Up Alarm	Done		JUHURST	Nov 2, 2022 7:46:47 PM	No	
10,500	!FRA!INSPECT_Engine Operation, OBSERVE_ Exhaust for Excessive Smoke	Done		JUHURST	Nov 2, 2022 7:46:52 PM	No	
10,600	Check Driver's Pre-trip or DVIR/EVIR & Authorization Forms	Done		JUHURST	Nov 2, 2022 7:46:57 PM	No	
10,700	INSPECT_All Exterior Lights (Turn on until Completion of this section)	Done		JUHURST	Nov 2, 2022 7:47:07 PM	No	
10,800	*RPT*INSPECT_Body Damage, Corrosion;DOCUMENT_Issues	Done		JUHURST	Nov 2, 2022 7:47:15 PM	No	
10,900	INSPECT_Fuel Tank Cap, and Doors	Done		JUHURST	Nov 2, 2022 7:47:24 PM	No	
11,100	INSPECT_License Plate, Bracket, Bumpers	Done		JUHURST	Nov 2, 2022 7:47:32 PM	No	
20,000	SECTION 2 - Test Drive and Operator Area Inspection	Done		JUHURST	Nov 2, 2022 7:47:37 PM	No	
20,100	INSPECT_Driver Seat condition/operation/seatbelt	Done		JUHURST	Nov 2, 2022 7:47:43 PM	No	
20,200	TEST DRIVE_INSPECT_Proper Operation; Drive into Shop	Done		JUHURST	Nov 2, 2022 7:47:48 PM	No	
20,300	*RPT*INSPECT_Steering Wheel for Play/Bind/Horn Op./Turn Signal Cancelation	Done		JUHURST	Nov 2, 2022 7:47:57 PM	No	
20,400	PERFORM_Brake Test (Apply hard enough to check wheel pull and Application)	Done		JUHURST	Nov 2, 2022 7:48:04 PM	No	
20,500	*RPT*FRA INSPECT_Lighting/Operation of all Gauges	Done		JUHURST	Nov 2, 2022 7:48:20 PM	No	
20,600	*RPT*INSPECT_Windshields, Sun Visors	Done		JUHURST	Nov 2, 2022 7:48:32 PM	No	
20,700	INSPECT_Wiper/Washer Operation, Condition	Done		JUHURST	Nov 2, 2022 7:49:00 PM	No	
20,800	INSPECT_High Idle Control	Done		JUHURST	Nov 2, 2022 7:49:04 PM	No	
20,900	*RPT*!FRA!INSPECT_HVAC Controls, Operation	Done		JUHURST	Nov 2, 2022 7:49:10 PM	No	
21,000	*RPT*!FRA!INSPECT_Operation of all Switches and Accessories	Done		JUHURST	Nov 2, 2022 7:49:17 PM	No	
21,100	INSPECT_Parking Brake Operation	Done		JUHURST	Nov 2, 2022 7:49:25 PM	No	
21,200	!FRA!TEST_Service Brake Backup System (Stationary Brake Tests HYD)	Done		JUHURST	Nov 2, 2022 7:49:30 PM	No	
21,300	INSPECT_VIN, Tire Pressure Decal, Data Tags	Done		JUHURST	Nov 2, 2022	No	

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
					7:49:37 PM		
21,400	*RPT*INSPECT_Drivers Door Hinges, Handles, Controls and Panels	Done		JUHURST	Nov 2, 2022 7:49:48 PM	No	
21,500	!FRA!INSPECT_Under Dash Wiring for Proper Routing/Chafing/Securement	Done		JUHURST	Nov 2, 2022 7:49:56 PM	No	
21,550	INSPECT_Driver Floor Area for Rust/Water Leaks	Done		JUHURST	Nov 2, 2022 7:50:01 PM	No	
21,600	*RPT*INSPECT for WEAR_Pedal Pads, Accelerator, Brake, Parking Brake	Done		JUHURST	Nov 2, 2022 7:50:06 PM	No	
21,700	INSPECT_Engine Fault Codes	Done		JUHURST	Nov 2, 2022 7:50:14 PM	No	
30,000	SECTION 3 - EXTERIOR INSPECTION - Front	Done		JUHURST	Nov 2, 2022 7:50:27 PM	No	
31,000	SSF (Street Side Front)	Done		JUHURST	Nov 2, 2022 7:50:34 PM	No	
31,010	*RPT*!FRA!INSPECT_Mirror Mountings, Brackets, Glass	Done		JUHURST	Nov 2, 2022 7:50:41 PM	No	
31,020	*RPT*INSPECT_FRONT Springs, Shocks, Spring Shackles	Done		JUHURST	Nov 2, 2022 7:50:48 PM	No	
31,030	INSPECT_Mud Flaps, Brackets	Done		JUHURST	Nov 2, 2022 7:50:54 PM	No	
31,040	INSPECT_Wiper Blades, Arms	Done		JUHURST	Nov 2, 2022 7:51:04 PM	No	
32,000	Engine Inspection	Done		JUHURST	Nov 2, 2022 7:51:14 PM	No	
32,010	INSPECT_Hood, Springs and Props	Done		JUHURST	Nov 2, 2022 7:51:23 PM	No	
32,020	!FRA!INSPECT_Engine Compartment Condition for Fire Risk Avoidance	Done		JUHURST	Nov 2, 2022 7:51:32 PM	No	
32,030	!FRA!INSPECT_for Fluid Leaks, Levels	Done		JUHURST	Nov 2, 2022 7:51:50 PM	No	
32,040	!FRA!INSPECT_Hyd_Brake Fluid with Test Strips	Done		JUHURST	Nov 2, 2022 7:51:54 PM	No	
32,050	!FRA!INSPECT_RECORD_Coolant Recovery with Refractometer; Test Strips	26 Degree Fahrenheit		JUHURST	Nov 2, 2022 7:53:05 PM	No	
32,060	PRESSURE TEST_Cooling Systems (Radiator, Cap, hoses and clamps)	Done		JUHURST	Nov 2, 2022 7:53:09 PM	No	
32,070	*RPT*INSPECT_Radiator and Mountings, Cores	Done		JUHURST	Nov 2, 2022 7:53:32 PM	No	
32,080	*RPT*INSPECT_Fan Assembly,Shroud,Tensioner,Belts,All Belt Driven Components	Done		JUHURST	Nov 2, 2022 7:53:41 PM	No	
32,090	*RPT*!FRA!INSPECT_Mounting, Installation of Alternator, AC Compressor	Done		JUHURST	Nov 2, 2022 7:54:05 PM	No	
32,100	INSPECT_Intake System	Done		JUHURST	Nov 2, 2022 7:54:10 PM	No	
32,140	*RPT*!FRA!RECORD_Underhood Battery Voltages (volts)	14 Volt*		JUHURST	Nov 2, 2022 7:54:43 PM	No	
33,010	CSF (Curb Side Front)	Done		JUHURST	Nov 2, 2022 7:54:48 PM	No	
33,020	*RPT*!FRA!INSPECT_Mirror Mountings, Brackets, Glass	Done		JUHURST	Nov 2, 2022 7:55:26 PM	No	
33,030	*RPT*INSPECT_FRONT Springs, Shocks, Spring Shackles	Done		JUHURST	Nov 2, 2022 7:55:33 PM	No	
33,040	INSPECT_Mud Flaps, Brackets	Done		JUHURST	Nov 2, 2022 7:55:54 PM	No	

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
33,050	INSPECT_Wiper Blades, Arms	Done		JUHURST	Nov 2, 2022 7:56:08 PM	No	
33,060	!FRA!INSPECT_LUBE_Battery Box, Batteries, Tray Slides, Hold Downs	Done		JUHURST	Nov 2, 2022 7:56:16 PM	No	
33,070	*RPT*~!FRA!RECORD_Side Mounted Battery Voltages (volts)	14 Volt*		JUHURST	Nov 2, 2022 7:56:42 PM	No	
33,080	INSPECT_Entry door, OPEN_with external lock/switch (if equipped)	Done		JUHURST	Nov 2, 2022 7:56:49 PM	No	
40,000	SECTION 4 - Interior Inspection	Done		JUHURST	Nov 2, 2022 7:57:11 PM	No	
40,100	*RPT*INSPECT_Step-Well, Step-Tread, Hand Rails, Step-well Light	Done		JUHURST	Nov 2, 2022 7:57:18 PM	No	
40,200	INSPECT_Insurance/Registration/Regulatory Forms Dates	Done		JUHURST	Nov 2, 2022 7:57:22 PM	No	
40,250	INSPECT_Overhead Compartment for Water Leaks	Done		JUHURST	Nov 2, 2022 7:57:32 PM	No	
40,300	INSPECT_Safety Equipment, Fire Extinguisher/Suppression	Done		JUHURST	Nov 2, 2022 7:57:38 PM	No	
40,400	INSPECT_Camera Systems, Filter, Electrical Inputs/Outputs-SOP M038	Done		JUHURST	Nov 2, 2022 7:57:50 PM	No	
40,600	!FRA!CHECK for HOTSPOTS_Interior Elec Panel Fuses/Circuit Breakers/Connectors	Done		JUHURST	Nov 2, 2022 7:58:35 PM	No	
40,700	*RPT*INSPECT_Seats, Covering, Belts, Loose Cushions, Operation	Done		JUHURST	Nov 2, 2022 7:59:07 PM	No	
40,800	*RPT*!FRA!INSPECT_Interior Lights; Mirrors	Done		JUHURST	Nov 2, 2022 7:59:34 PM	No	
40,900	!FRA!INSPECT_Interior Cleanliness/Potential Projectiles	Done		JUHURST	Nov 2, 2022 7:59:48 PM	No	
41,000	INSPECT_All ADA Equip (Lift Seat Belt, floor hold Downs, Belts, Cover, Alarms)	Done		JUHURST	Nov 2, 2022 8:00:08 PM	No	
41,100	INSPECT_CLEAN_AC Filter	Done		JUHURST	Nov 2, 2022 8:00:12 PM	No	
41,200	INSPECT_Emergency Windows,Hatches,Doors,Alarms/Lights;CHECK_for Leaks	Done		JUHURST	Nov 2, 2022 8:00:19 PM	No	
41,300	*RPT*INSPECT_Interior Body, Floor, Stanchions	Done		JUHURST	Nov 2, 2022 8:00:28 PM	No	
41,400	*RPT*INSPECT_Passenger Doors, Glass, Seal	Done		JUHURST	Nov 2, 2022 8:00:34 PM	No	
50,000	SECTION 5 - UNDER VEHICLE INSPECTION	Done		JUHURST	Nov 2, 2022 8:01:01 PM	No	
50,100	*RPT*INSPECT_Steering components-Drag Link, Tie Rods ends and Steering Damper	Done		JUHURST	Nov 2, 2022 8:00:55 PM	No	
50,200	INSPECT_Ball Joint Play	Done		JUHURST	Nov 2, 2022 8:01:26 PM	No	
50,300	!FRA!INSPECT_Front Wheel Bearings for Play	Done		JUHURST	Nov 2, 2022 8:01:37 PM	No	
50,400	LUBE_All Chassis Components	Done		JUHURST	Nov 2, 2022 8:01:43 PM	No	
50,500	!FRA!CHANGE_Engine oil,filters	Done		JUHURST	Nov 2, 2022 8:01:58 PM	No	
50,700	INSPECT_Tire Condition	Done		JUHURST	Nov 2, 2022 8:03:21 PM	No	
50,800	INSPECT_Tire Valve Stems, Double Check Caps	Done		JUHURST	Nov 2, 2022 8:03:35 PM	No	
50,900	!FRA!INSPECT_Wheels for Cracks, Loose	Done		JUHURST	Nov 2, 2022	No	

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
	Lugs/Indicators, Outer Hub Leaks				8:04:13 PM		
51,000	RECORD_LF-Tire Tread Depth (32nds)	10 32nds of an inch		JUHURST	Nov 2, 2022 8:04:40 PM	No	
51,100	RECORD_LF-Tire Air Pressure (psi)	65 Pounds per Square Inch		JUHURST	Nov 2, 2022 8:05:41 PM	No	
51,200	RECORD_RF-Tire Tread Depth (32nds)	9 32nds of an inch		JUHURST	Nov 2, 2022 8:05:51 PM	No	
51,300	RECORD_RF-Air Pressure (psi)	65 Pounds per Square Inch		JUHURST	Nov 2, 2022 8:05:56 PM	No	
51,400	!FRA!INSPECT_FRONT ABS Tone Rings, Sensors, Routing of Cables	Done		JUHURST	Nov 2, 2022 8:06:01 PM	No	
51,500	!FRA!INSPECT_Wheel Seals for Leaks	Done		JUHURST	Nov 2, 2022 8:06:06 PM	No	
51,600	!FRA!INSPECT_ Front Brake Assemblies	Done		JUHURST	Nov 2, 2022 8:06:12 PM	No	
51,700	MEASURE_RECORD_LF - Brake Lining, Pad Thickness (32nds)	10 32nds of an inch		JUHURST	Nov 2, 2022 8:06:39 PM	No	
51,800	MEASURE_RECORD_RF - Brake Lining, Pad Thickness (32nds)	10 32nds of an inch		JUHURST	Nov 2, 2022 8:06:45 PM	No	
51,900	INSPECT VISUALLY_ RECORD_ LF Rotor Condition (inches)	1.2299 Inch		JUHURST	Nov 2, 2022 8:07:02 PM	No	
52,000	INSPECT VISUALLY_ RECORD_ RF Rotor Condition (inches)	1.2299 Inch		JUHURST	Nov 2, 2022 8:07:10 PM	No	
52,100	INSPECT_Vibration Damper	Done		JUHURST	Nov 2, 2022 8:07:15 PM	No	
52,200	!FRA!INSPECT_Battery Cable Routing from Battery Box to Starter	Done		JUHURST	Nov 2, 2022 8:07:28 PM	No	
52,400	!FRA!INSPECT_ Starter Mounting	Done		JUHURST	Nov 2, 2022 8:07:33 PM	No	
52,500	!FRA!INSPECT_Engine Exhaust System	Done		JUHURST	Nov 2, 2022 8:07:38 PM	No	
52,700	INSPECT_ Engine, Transmission Mounts	Done		JUHURST	Nov 2, 2022 8:07:45 PM	No	
52,800	!FRA!INSPECT_Engine, Transmission for Fluid Leaks	Done		JUHURST	Nov 2, 2022 8:07:54 PM	No	
52,900	INSPECT_ Shift Cable Adjustment - All Transmissions	Done		JUHURST	Nov 2, 2022 8:08:00 PM	No	
53,000	!FRA!INSPECT_ Transmission Breather and Clean	Done		JUHURST	Nov 2, 2022 8:08:05 PM	No	
53,100	*RPT*!FRA!INSPECT_Parking Brake Cables, Shoes for Wear, Contamination	Done		JUHURST	Nov 2, 2022 8:08:17 PM	No	
53,200	*RPT*INSPECT_A/C Condensor, Fans, Safety Grills	Done		JUHURST	Nov 2, 2022 8:08:22 PM	No	
53,300	*RPT*INSPECT_ Driveline, Hanger Bearings, U-Joints, Slip Joints, Safety Loop	Done		JUHURST	Nov 2, 2022 8:09:10 PM	No	
53,400	*RPT*INSPECT_All Body Mounts and Chassis Frame for Corrosion, Cracks	Done		JUHURST	Nov 2, 2022 8:09:15 PM	No	
53,500	!FRA!INSPECT_Fuel Tank, Mountings, Lines	Done		JUHURST	Nov 2, 2022 8:09:31 PM	No	
53,600	INSPECT_Tire Condition	Done		JUHURST	Nov 2, 2022 8:09:41 PM	No	
53,700	INSPECT_Tire Valve Stems, Double Check Caps	Done		JUHURST	Nov 2, 2022 8:10:33 PM	No	
53,800	INSPECT_ Mismatched Tire Tread, Casing Design	Done		JUHURST	Nov 2, 2022 8:10:38 PM	No	

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
53,900	INSPECT_Dual Mating Tires w/Square	Done		JUHURST	Nov 2, 2022 8:10:43 PM	No	
54,000	!FRA!INSPECT_Wheels for Cracks, Loose Lugs/Indicators, Outer Hub Leaks	Done		JUHURST	Nov 2, 2022 8:10:48 PM	No	
54,100	INSPECT_Mud Flaps, Brackets	Done		JUHURST	Nov 2, 2022 8:10:52 PM	No	
54,200	RECORD_RRO-Tire Tread Depth (32nds)	9 32nds of an inch		JUHURST	Nov 2, 2022 8:11:33 PM	No	
54,300	RECORD_RRI-Tire Tread Depth (32nds)	9 32nds of an inch		JUHURST	Nov 2, 2022 8:11:29 PM	No	
54,400	RECORD_RRO-Air Pressure (psi)	65 Pounds per Square Inch		JUHURST	Nov 2, 2022 8:11:44 PM	No	
54,500	RECORD_RRI-Air Pressure (psi)	65 Pounds per Square Inch		JUHURST	Nov 2, 2022 8:11:48 PM	No	
54,600	RECORD_LRO-Tire Tread Depth (32nds)	6 32nds of an inch		JUHURST	Nov 2, 2022 8:12:12 PM	No	
54,700	RECORD_LRI-Tire Tread Depth (32nds)	7 32nds of an inch		JUHURST	Nov 2, 2022 8:12:18 PM	No	
54,800	RECORD_LRO-Air Pressure (psi)	65 Pounds per Square Inch		JUHURST	Nov 2, 2022 8:12:24 PM	No	
54,900	RECORD_LRI-Air Pressure (psi)	65 Pounds per Square Inch		JUHURST	Nov 2, 2022 8:12:29 PM	No	
55,000	!FRA!INSPECT_ REAR Brake Assemblies	Done		JUHURST	Nov 2, 2022 8:12:35 PM	No	
55,100	!FRA!INSPECT_ REAR Hubs, Wheel Seals for Oil Leaks	Done		JUHURST	Nov 2, 2022 8:12:40 PM	No	
55,200	!FRA!INSPECT_REAR ABS Tone Rings, Sensors, Routing Of Cables (if equipped)	Done		JUHURST	Nov 2, 2022 8:12:44 PM	No	
55,300	MEASURE_RECORD_LR - Brake Lining, Pad Thickness (32nds)	8 32nds of an inch		JUHURST	Nov 2, 2022 8:13:00 PM	No	
55,400	MEASURE_RECORD_RR - Brake Lining, Pad Thickness (32nds)	8 32nds of an inch		JUHURST	Nov 2, 2022 8:13:08 PM	No	
55,500	INSPECT VISUALLY_MEASURE_RECORD_ LR Drum, Rotor Condition (inches)	1.2299 Inch		JUHURST	Nov 2, 2022 8:13:28 PM	No	
55,600	INSPECT VISUALLY_MEASURE_RECORD_ RR Drum, Rotor Condition (inches)	1.2299 Inch		JUHURST	Nov 2, 2022 8:13:36 PM	No	
55,700	!FRA!INSPECT_ Under Body Exhaust System	Done		JUHURST	Nov 2, 2022 8:13:40 PM	No	
55,800	*RPT*INSPECT_ REAR Axle Housing, Breather; CLEAN_Breather	Done		JUHURST	Nov 2, 2022 8:13:46 PM	No	
55,900	*RPT*INSPECT_ REAR Springs, Shocks, Suspension, Airbags	Done		JUHURST	Nov 2, 2022 8:13:54 PM	No	
60,000	SECTION 6 - Wheelchair Inspection	Done		JUHURST	Nov 2, 2022 8:14:07 PM	No	
60,100	RECORD_Wheelchair Cycle Count	4710 Cycles		JUHURST	Nov 2, 2022 8:14:20 PM	No	
60,200	CHECK_ Lift Access Door for Ease of Opening,Latch Security,Door Hold Back	Done		JUHURST	Nov 2, 2022 8:14:26 PM	No	
60,300	CHECK_Platform Emergency Release Mechanism for Ease of Operation	Done		JUHURST	Nov 2, 2022 8:14:32 PM	No	
60,400	OPERATE_Lift thru Complete Cycle;CHECK_Noises,Jerky Op,Too Fast-Slow,Drift Down	Done		JUHURST	Nov 2, 2022 8:14:36 PM	No	
60,500	INSPECT_ Bridgeplate Operation	Done		JUHURST	Nov 2, 2022 8:14:41 PM	No	
60,600	INSPECT_All Pivot Points for Wear and Looseness	Done		JUHURST	Nov 2, 2022	No	

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
					8:14:45 PM		
60,700	INSPECT_Rollers for Wear and Smooth Rotation	Done		JUHURST	Nov 2, 2022 8:15:09 PM	No	
60,800	INSPECT_Operation of Platform Barrier Mechanism	Done		JUHURST	Nov 2, 2022 8:15:15 PM	No	
60,900	INSPECT_Cam Slots for Wear and Proper Alignment	Done		JUHURST	Nov 2, 2022 8:15:21 PM	No	
61,000	INSPECT_Cable Condition (If Applicable)	Done		JUHURST	Nov 2, 2022 8:15:28 PM	No	
61,100	INSPECT_Hydraulic Hoses for Leaks, Chafing or Cracks	Done		JUHURST	Nov 2, 2022 8:15:33 PM	No	
61,200	INSPECT_Electrical Connections and Routing of Wires and Cables	Done		JUHURST	Nov 2, 2022 8:15:38 PM	No	
61,300	INSPECT_Operation and Adjustment of All Safety Switches	Done		JUHURST	Nov 2, 2022 8:18:58 PM	No	
61,400	INSPECT_All Lift Mounting Brackets for Loose Bolts Broken Welds, etc.	Done		JUHURST	Nov 2, 2022 8:15:48 PM	No	
61,500	INSPECT_Manual Back-up Raise/Lower System (If Applicable)	Done		JUHURST	Nov 2, 2022 8:15:52 PM	No	
61,600	INSPECT_HydrPump Reservoir Oil Level. Consult SvcManual for Fluid to Use.	Done		JUHURST	Nov 2, 2022 8:15:57 PM	No	
61,700	CHECK_Operator Decals for Proper Positioning;CONSULT_Service Manual	Done		JUHURST	Nov 2, 2022 8:16:02 PM	No	
61,800	CHECK_WC Holddowns Inside Vehicle for Secure Mounting,Proper Operation	Done		JUHURST	Nov 2, 2022 8:16:07 PM	No	
61,900	CLEAN_Linkages and Mechanisms	Done		JUHURST	Nov 2, 2022 8:16:11 PM	No	
62,000	LUBRICATE_Linkages and Mechanisms (DO NOT OVER Lubricate)	Done		JUHURST	Nov 2, 2022 8:16:16 PM	No	
62,100	INSPECT_Emergency Platform Release Mechanism	Done		JUHURST	Nov 2, 2022 8:16:20 PM	No	
62,200	INSPECT_Platform Barrier Latch Mechanism	Done		JUHURST	Nov 2, 2022 8:16:25 PM	No	
62,300	INSPECT_Bridgeplate Hinge	Done		JUHURST	Nov 2, 2022 8:16:31 PM	No	
62,400	INSPECT_All Pivot Points	Done		JUHURST	Nov 2, 2022 8:16:40 PM	No	
62,500	INSPECT_Cams and Slots	Done		JUHURST	Nov 2, 2022 8:16:44 PM	No	
62,600	INSPECT_Rollers	Done		JUHURST	Nov 2, 2022 8:16:51 PM	No	
62,700	INSPECT_All Linkages	Done		JUHURST	Nov 2, 2022 8:16:56 PM	No	
70,000	SECTION 7 - ALTERNATIVE FUELS INSPECTION	Done		JUHURST	Nov 2, 2022 8:17:00 PM	No	
70,300	INSPECT_Condition of Fuel Pressure Gauge	Done		JUHURST	Nov 2, 2022 8:17:20 PM	No	
70,400	PROVIDE PROOF_Tank_Dents/Scratches and Re-Certification	Done		JUHURST	Nov 2, 2022 8:17:26 PM	No	
70,500	INSPECT_Tank test date, labels-Reference-ST.4 FMMVSS 304 & ANSI-CSA NGV2	Done		JUHURST	Nov 2, 2022 8:17:31 PM	No	
70,600	INSPECT_ Tank Lines to Ensure Secure Mounting, Insulation Against Vibration	Done		JUHURST	Nov 2, 2022 8:17:36 PM	No	
70,700	INSPECT_ Filling Nozzle for Securely Fitting Cap	Done		JUHURST	Nov 2, 2022 8:17:42 PM	No	

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
70,800	INSPECT_ Pressure Relief Device's Venting System, Valves, Ducting to MNFR Specs	Done		JUHURST	Nov 2, 2022 8:17:56 PM	No	
80,000	SECTION 8 - PMI Report Completion	Done		JUHURST	Nov 2, 2022 8:17:51 PM	No	
80,100	COMPLETE_PM Report; Follow-ups	Done		JUHURST	Nov 2, 2022 8:18:07 PM	No	
80,200	RETURN_Vehicle to Predetermined Location	Done		JUHURST	Nov 2, 2022 8:18:03 PM	No	

LH: 20 Desc: PM A

Task: PM A SERVICE Performed by: JUHURST Performed on: 02-NOV-22

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
100,000	"A" PMI SERVICING ITEMS	Done		JUHURST	Nov 2, 2022 8:29:29 PM	No	
101,000	FRA Change Oil Filters	Yes		JUHURST	Nov 2, 2022 8:29:34 PM	No	
102,000	FRA Drain Engine Oil	Yes		JUHURST	Nov 2, 2022 8:29:43 PM	No	
103,000	FRA Check Transmission Fluid	Done		JUHURST	Nov 2, 2022 8:29:49 PM	No	
104,000	Lubricate Chassis	Done		JUHURST	Nov 2, 2022 8:29:55 PM	No	
105,000	Replace or Clean A/C Filters	Done		JUHURST	Nov 2, 2022 8:30:00 PM	No	
107,000	FRA Change Primary Fuel Filter	Yes		JUHURST	Nov 2, 2022 8:30:17 PM	No	
108,000	Lube all pivoting Mechanisms	Done		JUHURST	Nov 2, 2022 8:30:24 PM	No	

LH: 5 Desc: PERSONAL RISK ASSESSMENT

Task: PRA and Meter Readings Performed by: JUHURST Performed on: 02-NOV-22

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
1	Are you properly trained to perform the task?	Done		JUHURST	Nov 2, 2022 7:41:47 PM	No	
2	If task requires lifting, are lifts secured, are jack stands used correctly?	Done		JUHURST	Nov 2, 2022 7:41:43 PM	No	
4	Are you wearing the appropriate PPE?	Done		JUHURST	Nov 2, 2022 7:41:59 PM	No	
7	Have you performed the proper LOTO?	Done		JUHURST	Nov 2, 2022 7:41:54 PM	No	
10	Are you aware of the potential risks of performing this repair?	Done		JUHURST	Nov 2, 2022 7:42:04 PM	No	
11	Have you successfully completed the Personal Risk Assessment?	Done		JUHURST	Nov 2, 2022 7:42:09 PM	No	



WorkOrder
55345 Palm Tran Connection
v 2.2
Page 1 of 13



WorkOrder: 56195703
Invoice Number: 55345-56195703

Client Department:

MRC:	55345M	Equipment:	4514-P
WO Desc:			Ford E450 Champion Challenger
55345-MEDIUM DUTY PMA		VIN:	1FD4E4FS7EDB17176
Requested By:	SPACE	Status:	32
Created By:	SPACE	Priority:	3
Class:	WO	Driver:	
Arrangement:	Unassigned	Phone:	
Potential Warranty:	No	ETA:	

Chronology

Reported	Mar 16, 2023	12:00 AM
Started	Mar 16, 2023	
Completed	Mar 16, 2023	9:44 PM
Down Time		

Meter	Reading	UOM
WO		DH
Life	321,669	DH

WorkOrder Notes

Line	Comment
10	Complaint: PM A service. Cause: Due by mileage. Correction: LOF engine oil and filter. Performed tire and brake inspection.

Activity: 5 **999/999/999 TOTAL VEHICLE**

Activity Note: Personal Risk Assessment
Reason for Repair: SW - Shop Work Order
Work Accomplished: 06 - Inspect
Part Failure: 00 - No Failure

Activity Comments

Parts Issued

Date	Part Number		Description	Qty.	Each	Extended
------	-------------	--	-------------	------	------	----------

Labor Posted

Date	Technician	Hours	Rate	Extended
------	------------	-------	------	----------

Activity 5 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours: 0.00	
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00

Activity: 10 **999/999/999 TOTAL VEHICLE**

Activity Note: Medium Duty PM Inspection
Reason for Repair: 08 - Preventive Maintenance
Work Accomplished: -
Part Failure: -

Activity Comments

Parts Issued

Date	Part Number		Description	Qty.	Each	Extended
------	-------------	--	-------------	------	------	----------

Labor Posted



WorkOrder
55345 Palm Tran Connection
v 2.2
Page 2 of 13



WorkOrder: 56195703
Invoice Number: 55345-56195703

Client Department:

MRC: 55345M
WO Desc: 55345-MEDIUM DUTY PMA
Requested By: SPACE
Created By: SPACE
Class: WO
Arrangement: Unassigned
Potential Warranty: No

Equipment: 4514-P
Ford E450 Champion Challenger
VIN: 1FDFE4FS7EDB17176
Status: 32
Priority: 3
Driver:
Phone:
ETA:

Date	Technician	Hours	Rate	Extended
16-Mar-23	Earl Johnson	4.08	65.00	265.20

Activity 10 Sub Total

Parts: 0.00
Labor: 265.20
Labor Hours: 4.08
Sublet Parts: 0.00
Sublet Labor: 0.00
Activity Sub Total 265.20

Activity: 20  **999/999/999 TOTAL VEHICLE**
Activity Note: Medium Duty PMA Service
Reason for Repair: 08 - Preventive Maintenance
Work Accomplished: A - PM Level A
Part Failure: -

Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
16-Mar-23	B329	FILTER, OIL, SPIN-ON SEE P550965	1.00	2.51	2.51

Labor Posted

Date	Technician	Hours	Rate	Extended
16-Mar-23	Earl Johnson	1.05	65.00	68.25

Activity 20 Sub Total

Parts: 2.51
Labor: 68.25
Labor Hours: 1.05
Sublet Parts: 0.00
Sublet Labor: 0.00
Activity Sub Total 70.76

WorkOrder 56195703 Grand Total

Parts: 2.51
Labor: 333.45
Labor Hours: 5.13
Sublet Parts: 0.00
Sublet Labor: 0.00
WorkOrder Grand Total 335.96

Recent Repair History

WorkOrder	Date Completed	Life Meter	Class	Description
56195703	16-Mar-23	321,669	WO	55345-MEDIUM DUTY PMA
56483457	7-Mar-23	320,666	WO	Check AC.



WorkOrder
55345 Palm Tran Connection
v 2.2
Page 3 of 13



WorkOrder: 56195703
Invoice Number: 55345-56195703

Client Department:

MRC: 55345M
WO Desc: 55345-MEDIUM DUTY PMA
Requested By: SPACE
Created By: SPACE
Class: WO
Arrangement: Unassigned
Potential Warranty: No

Equipment: 4514-P
Ford E450 Champion Challenger
VIN: 1FDFE4FS7EDB17176
Status: 32
Priority: 3
Driver:
Phone:
ETA:

WorkOrder	Date Completed	Life Meter	Class	Description
56381700	14-Feb-23	320,666	WO	FOLLOW UP TO QCC INSP

Scheduled Preventative Maintenance

Nest	PM	WorkOrder	Due Date	Due Life Meter	Due Meter Reading	Due Life Meter 2	Due Meter Reading 2
------	----	-----------	----------	----------------	-------------------	------------------	---------------------

Other Open Repairs

WorkOrder8	Date Reported	Life Meter	Class	Description
------------	---------------	------------	-------	-------------

PH: Work Order: 56195703 Desc: 55345-MEDIUM DUTY PMA
Equip: 4514-P Desc: Ford E450 Champion Challenger VIN: 1FDFE4FS7EDB17176

LH: 10 Desc: Medium Duty PM Inspection

Task: First Transit North America Medium Duty PM Inspection Sheet Performed by: EARJOHNSON
Performed on: 16-MAR-23

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
10,000	SECTION 1 - Preparation Inspection	Done		EARJOHNSON	Mar 16, 2023 5:25:14 PM	No	
10,100	INSPECT_Auto-Transmission Operation/Controller; Neutral Safety Switch	Done		EARJOHNSON	Mar 16, 2023 5:25:12 PM	No	
10,200	!FRA!INSPECT_Starter Operation	Done		EARJOHNSON	Mar 16, 2023 5:25:18 PM	No	
10,300	!FRA!INSPECT_Warning Lights and Alarms	Done		EARJOHNSON	Mar 16, 2023 5:25:29 PM	No	
10,400	!FRA!INSPECT_Back Up Alarm	Done		EARJOHNSON	Mar 16, 2023 5:25:32 PM	No	
10,500	!FRA!INSPECT_Engine Operation, OBSERVE_ Exhaust for Excessive Smoke	Done		EARJOHNSON	Mar 16, 2023 5:25:37 PM	No	
10,600	Check Driver's Pre-trip or DVIR/EVIR & Authorization Forms	Done		EARJOHNSON	Mar 16, 2023 5:25:41 PM	No	
10,700	INSPECT_All Exterior Lights (Turn on until Completion of this section)	Done		EARJOHNSON	Mar 16, 2023 5:25:44 PM	No	
10,800	CHECK_All Destination Signage	-	NA	EARJOHNSON	Mar 16, 2023 5:25:55 PM	No	
10,900	*RPT*INSPECT_Body Damage, Corrosion;DOCUMENT_Issues	Done		EARJOHNSON	Mar 16, 2023 5:26:04 PM	No	
11,000	INSPECT_Fuel Tank Cap, and Doors	Done		EARJOHNSON	Mar 16, 2023 5:26:12 PM	No	
11,200	INSPECT_License Plate, Bracket, Bumpers	Done		EARJOHNSON	Mar 16, 2023 5:26:16 PM	No	
20,000	SECTION 2 - Test Drive and Operator Area Inspection	Done		EARJOHNSON	Mar 16, 2023 5:26:20 PM	No	
20,100	INSPECT_Driver Seat condition/operation/seatbelt	Done		EARJOHNSON	Mar 16, 2023 5:26:23 PM	No	
20,200	CHECK_Public Address System	-	NA	EARJOHNSON	Mar 16, 2023 5:26:33 PM	No	
20,300	TEST DRIVE_INSPECT_Proper Operation; Drive into Shop	Done		EARJOHNSON	Mar 16, 2023 5:26:36 PM	No	
20,400	*RPT*INSPECT_Steering Wheel for Play,Bind; Horn Op; Turn Signal Cancelation	Done		EARJOHNSON	Mar 16, 2023 5:26:45 PM	No	
20,500	PERFORM_Brake Test (Apply hard	Done		EARJOHNSON	Mar 16,	No	

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
	enough to check wheel pull and Application)				2023 5:26:49 PM		
20,600	RECORD_Brake Performance Test E.T.	Second*	NA	EARJOHNSON	Mar 16, 2023 5:26:59 PM	No	
20,700	RECORD_Brake Performance Test Speed	Miles per Hour	NA	EARJOHNSON	Mar 16, 2023 5:27:06 PM	No	
20,800	RECORD_Brake Performance Test Distance	FEET	NA	EARJOHNSON	Mar 16, 2023 5:27:18 PM	No	
20,900	RECORD_Brake Performance Test Adj Distance (20mph)	FEET	NA	EARJOHNSON	Mar 16, 2023 5:27:24 PM	No	
21,000	RECORD_Brake Performance Test Ave GX	Gravitational Force	NA	EARJOHNSON	Mar 16, 2023 5:27:43 PM	No	
21,100	ADD_Image of Brake Test Results to PM Work Order	-	NA	EARJOHNSON	Mar 16, 2023 5:30:06 PM	No	
21,200	*RPT*FRA INSPECT_Lighting/Operation of all Gauges	Done		EARJOHNSON	Mar 16, 2023 5:30:18 PM	No	
21,300	*RPT*INSPECT_Windshields, Sun Visors	Done		EARJOHNSON	Mar 16, 2023 5:30:21 PM	No	
21,400	INSPECT_Wiper/Washer Operation, Condition	Done		EARJOHNSON	Mar 16, 2023 5:30:25 PM	No	
21,500	INSPECT_High Idle Control	Done		EARJOHNSON	Mar 16, 2023 5:30:28 PM	No	
21,600	*RPT*!FRA!INSPECT_HVAC Controls, Operation	Done		EARJOHNSON	Mar 16, 2023 5:30:33 PM	No	
21,700	*RPT*!FRA!INSPECT_Operation of all Switches and Accessories	Done		EARJOHNSON	Mar 16, 2023 5:30:39 PM	No	
21,800	INSPECT_Parking Brake Operation	Done		EARJOHNSON	Mar 16, 2023 5:30:43 PM	No	
21,900	!FRA!TEST_Service Brake Backup System (Stationary Brake Tests HYD)	-	NA	EARJOHNSON	Mar 16, 2023 5:30:58 PM	No	
22,000	INSPECT_VIN, Tire Pressure Decal, Data Tags	Done		EARJOHNSON	Mar 16, 2023 5:31:12 PM	No	
22,100	*RPT*INSPECT_Drivers Door Hinges, Handles, Controls and Panels	Done		EARJOHNSON	Mar 16, 2023 5:31:22 PM	No	
22,200	!FRA!INSPECT_Under Dash Wiring for Proper Routing/Chafing/Securement	Done		EARJOHNSON	Mar 16, 2023 5:31:29 PM	No	
22,250	INSPECT_Driver Floor Area for Water Leaks	Done		EARJOHNSON	Mar 16, 2023 5:31:32 PM	No	
22,300	*RPT*INSPECT for WEAR_Pedal Pads, Accelerator, Brake, Parking Brake	Done		EARJOHNSON	Mar 16, 2023 5:31:36 PM	No	

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
22,400	INSPECT_Engine Fault Codes	Done		EARJOHNSON	Mar 16, 2023 5:31:40 PM	No	
30,000	SECTION 3 - EXTERIOR INSPECTION	Done		EARJOHNSON	Mar 16, 2023 5:31:44 PM	No	
31,000	SSF (Street Side Front)	Done		EARJOHNSON	Mar 16, 2023 5:31:47 PM	No	
31,010	*RPT*!FRA!INSPECT_Mirror Mountings, Brackets, Glass	Done		EARJOHNSON	Mar 16, 2023 5:31:51 PM	No	
31,020	*RPT*INSPECT_ FRONT Springs, Shocks, Spring Shackles	Done		EARJOHNSON	Mar 16, 2023 5:31:55 PM	No	
31,030	INSPECT_Mud Flaps, Brackets	Done		EARJOHNSON	Mar 16, 2023 5:31:58 PM	No	
31,040	INSPECT_Wiper Blades, Arms	Done		EARJOHNSON	Mar 16, 2023 5:32:02 PM	No	
32,000	Engine Inspection	Done		EARJOHNSON	Mar 16, 2023 5:32:05 PM	No	
32,010	INSPECT_Hood, Springs and Props	Done		EARJOHNSON	Mar 16, 2023 5:32:08 PM	No	
32,020	!FRA!INSPECT_Engine Compartment Condition for Fire Risk Avoidance	Done		EARJOHNSON	Mar 16, 2023 5:32:12 PM	No	
32,030	!FRA!INSPECT_for Fluid Leaks, Levels	Done		EARJOHNSON	Mar 16, 2023 5:32:17 PM	No	
32,040	!FRA!INSPECT_Hyd_Brake Fluid with Test Strips	-	NA	EARJOHNSON	Mar 16, 2023 5:33:44 PM	No	
32,050	!FRA!INSPECT_RECORD_Coolant Recovery with Refractometer; Test Strips	Degree Fahrenheit	NA	EARJOHNSON	Mar 16, 2023 5:33:57 PM	No	
32,060	PRESSURE TEST_Cooling Systems (Radiator, Cap, hoses and clamps)	Done		EARJOHNSON	Mar 16, 2023 5:34:00 PM	No	
32,070	*RPT*INSPECT_Radiator and Mountings, Cores	Done		EARJOHNSON	Mar 16, 2023 5:34:23 PM	No	
32,080	*RPT*INSPECT_Fan Assembly,Shroud,Tensioner,Belts,All Belt Driven Components	Done		EARJOHNSON	Mar 16, 2023 5:34:31 PM	No	
32,090	*RPT*!FRA!INSPECT_Mounting, Installation of Alternator, AC Compressor	Done		EARJOHNSON	Mar 16, 2023 5:34:38 PM	No	
32,100	INSPECT_Intake System	Done		EARJOHNSON	Mar 16, 2023 5:34:43 PM	No	
32,140	*RPT*!FRA!RECORD_Underhood Battery Voltages (volts)	13 Volt*	At idle, with loads.	EARJOHNSON	Mar 16, 2023 5:35:05 PM	No	
33,000	CSF (Curb Side Front)	Done		EARJOHNSON	Mar 16, 2023	No	

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
					5:35:08 PM		
33,010	*RPT*!FRA!INSPECT_Mirror Mountings, Brackets, Glass	Done		EARJOHNSON	Mar 16, 2023 5:35:12 PM	No	
33,020	*RPT*INSPECT_ FRONT Springs, Shocks, Spring Shackles	Done		EARJOHNSON	Mar 16, 2023 5:35:16 PM	No	
33,030	INSPECT_Mud Flaps, Brackets	Done		EARJOHNSON	Mar 16, 2023 5:35:47 PM	No	
33,040	INSPECT_Wiper Blades, Arms	Done		EARJOHNSON	Mar 16, 2023 5:35:50 PM	No	
33,050	!FRA!INSPECT_LUBE_Battery Box, Batteries, Tray Slides, Hold Downs	Done		EARJOHNSON	Mar 16, 2023 5:35:53 PM	No	
33,060	*RPT*!FRA!RECORD_Side Mounted Battery Voltages (volts)	12.6 Volt*		EARJOHNSON	Mar 16, 2023 5:36:27 PM	No	
33,070	INSPECT_Entry door, OPEN_with external lock/switch (if equipped)	Done		EARJOHNSON	Mar 16, 2023 5:36:31 PM	No	
40,000	SECTION 4 - Interior Inspection	Done		EARJOHNSON	Mar 16, 2023 7:55:44 PM	No	
40,100	*RPT*INSPECT_Step-Well, Step-Tread, Hand Rails, Step-well Light	Done		EARJOHNSON	Mar 16, 2023 7:55:48 PM	No	
40,200	INSPECT_Insurance/Registration/Regulatory Forms Dates	Done		EARJOHNSON	Mar 16, 2023 7:55:51 PM	No	
40,250	INSPECT_Overhead Compartment for Water Leaks	Done		EARJOHNSON	Mar 16, 2023 7:55:54 PM	No	
40,300	INSPECT_Safety Equipment, Fire Extinguisher/Suppression	Done		EARJOHNSON	Mar 16, 2023 7:55:57 PM	No	
40,400	INSPECT_Camera Systems, Filter, Electrical Inputs/Outputs-SOP M038	Done		EARJOHNSON	Mar 16, 2023 7:55:59 PM	No	
40,600	!FRA!CHECK for HOTSPOTS_Interior Elec Panel Fuses/Circuit Breakers/Connectors	Done		EARJOHNSON	Mar 16, 2023 8:14:13 PM	No	
40,700	CHECK_Passenger Stop Request System	-	NA	EARJOHNSON	Mar 16, 2023 8:14:20 PM	No	
40,800	*RPT*INSPECT_Seats, Covering, Belts, Loose Cushions, Operation	Done		EARJOHNSON	Mar 16, 2023 8:14:22 PM	No	
40,900	*RPT*!FRA!INSPECT_Interior Lights; Mirrors	Done		EARJOHNSON	Mar 16, 2023 8:14:25 PM	No	
41,000	!FRA!INSPECT_Interior Cleanliness/Potential Projectiles	Done		EARJOHNSON	Mar 16, 2023 8:14:29 PM	No	
41,100	INSPECT_All ADA Equip (Lift Seat Belt, floor hold Downs, Belts, Cover, Alarms)	Done		EARJOHNSON	Mar 16, 2023 8:14:32 PM	No	
41,200	INSPECT_CLEAN_AC Filter	Done		EARJOHNSON	Mar 16,	No	

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
					2023 8:14:35 PM		
41,300	INSPECT_ Emergency Windows, Hatches, Doors, Associated Alarms and Lights	Done		EARJOHNSON	Mar 16, 2023 8:14:38 PM	No	
41,400	*RPT*INSPECT_Interior Body, Floor, Stanchions	Done		EARJOHNSON	Mar 16, 2023 8:14:42 PM	No	
41,500	*RPT*INSPECT_Passenger Doors, Glass, Seal	Done		EARJOHNSON	Mar 16, 2023 8:14:47 PM	No	
50,000	SECTION 5 - UNDER VEHICLE INSPECTION	Done		EARJOHNSON	Mar 16, 2023 8:14:55 PM	No	
50,100	*RPT*INSPECT_Steering components-Drag Link, Tie Rods ends and Steering Damper	Done		EARJOHNSON	Mar 16, 2023 8:15:01 PM	No	
50,200	INSPECT_Ball Joint Play	Done		EARJOHNSON	Mar 16, 2023 8:15:04 PM	No	
50,300	!FRA!INSPECT_Front Wheel Bearings for Play	Done		EARJOHNSON	Mar 16, 2023 8:15:07 PM	No	
50,400	LUBE_All Chassis Components	Done		EARJOHNSON	Mar 16, 2023 8:15:11 PM	No	
50,500	!FRA!CHANGE_Engine oil, filters	Done		EARJOHNSON	Mar 16, 2023 8:15:19 PM	No	
50,700	INSPECT_Tire Condition	-	LRO tire tread depth below spec, rotated RF to LRO.	EARJOHNSON	Mar 16, 2023 8:16:17 PM	Yes	56515052
50,800	INSPECT_Tire Valve Stems, Double Check Caps	Done		EARJOHNSON	Mar 16, 2023 8:16:20 PM	No	
50,900	!FRA!INSPECT_Wheels for Cracks, Loose Lugs/Indicators, Outer Hub Leaks	Done		EARJOHNSON	Mar 16, 2023 8:16:24 PM	No	
51,000	RECORD_LF-Tire Tread Depth (32nds)	10 32nds of an inch		EARJOHNSON	Mar 16, 2023 8:16:47 PM	No	
51,100	RECORD_LF-Tire Air Pressure (psi)	70 Pounds per Square Inch		EARJOHNSON	Mar 16, 2023 8:16:55 PM	No	
51,200	RECORD_RF-Tire Tread Depth (32nds)	8 32nds of an inch		EARJOHNSON	Mar 16, 2023 8:17:04 PM	No	
51,300	RECORD_RF-Air Pressure (psi)	70 Pounds per Square Inch		EARJOHNSON	Mar 16, 2023 8:17:09 PM	No	
51,400	!FRA!INSPECT_FRONT ABS Tone Rings, Sensors, Routing of Cables	Done		EARJOHNSON	Mar 16, 2023 8:17:11 PM	No	
51,500	!FRA!INSPECT_Wheel Seals for Leaks	Done		EARJOHNSON	Mar 16, 2023 8:17:14 PM	No	
51,600	!FRA!INSPECT_Front Brake Assemblies	Done		EARJOHNSON	Mar 16, 2023 8:17:16 PM	No	

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
51,700	MEASURE_RECORD_LF - Brake Lining, Pad Thickness (32nds)	8 32nds of an inch		EARJOHNSON	Mar 16, 2023 8:17:42 PM	No	
51,800	MEASURE_RECORD_RF - Brake Lining, Pad Thickness (32nds)	8 32nds of an inch		EARJOHNSON	Mar 16, 2023 8:17:49 PM	No	
51,900	INSPECT VISUALLY_RECORD_LF Rotor Condition (inches)	1.543 Inch		EARJOHNSON	Mar 16, 2023 8:17:59 PM	No	
52,000	INSPECT VISUALLY_RECORD_RF Rotor Condition (inches)	1.55 Inch		EARJOHNSON	Mar 16, 2023 8:18:07 PM	No	
52,100	INSPECT_Vibration Damper	Done		EARJOHNSON	Mar 16, 2023 8:18:10 PM	No	
52,200	!FRA!INSPECT_Battery Cable Routing from Battery Box to Starter	Done		EARJOHNSON	Mar 16, 2023 8:18:13 PM	No	
52,400	!FRA!INSPECT_Starter Mounting	Done		EARJOHNSON	Mar 16, 2023 8:18:16 PM	No	
52,500	!FRA!INSPECT_Engine Exhaust System	Done		EARJOHNSON	Mar 16, 2023 8:18:19 PM	No	
52,700	INSPECT_Engine, Transmission Mounts	Done		EARJOHNSON	Mar 16, 2023 8:18:23 PM	No	
52,800	!FRA!INSPECT_Engine, Transmission for Fluid Leaks	Done		EARJOHNSON	Mar 16, 2023 8:18:25 PM	No	
52,900	INSPECT_Shift Cable Adjustment - All Transmissions	Done		EARJOHNSON	Mar 16, 2023 8:18:28 PM	No	
53,000	!FRA!INSPECT_Transmission Breather and Clean	Done		EARJOHNSON	Mar 16, 2023 8:18:30 PM	No	
53,100	*RPT*!FRA!INSPECT_Parking Brake Cables, Shoes for Wear, Contamination	Done		EARJOHNSON	Mar 16, 2023 8:18:36 PM	No	
53,200	*RPT*INSPECT_A/C Condensor, Fans, Safety Grills	Done		EARJOHNSON	Mar 16, 2023 8:18:42 PM	No	
53,300	*RPT*INSPECT_Driveline, Hanger Bearings, U-Joints, Slip Joints, Safety Loop	Done		EARJOHNSON	Mar 16, 2023 8:18:46 PM	No	
53,400	*RPT*INSPECT_All Body Mounts and Chassis Frame for Corrosion, Cracks	Done		EARJOHNSON	Mar 16, 2023 8:18:49 PM	No	
53,500	!FRA!INSPECT_Fuel Tank, Mountings, Lines	Done		EARJOHNSON	Mar 16, 2023 8:18:52 PM	No	
53,600	INSPECT_Tire Condition	Done		EARJOHNSON	Mar 16, 2023 8:18:55 PM	No	
53,700	INSPECT_Tire Valve Stems, Double Check Caps	Done		EARJOHNSON	Mar 16, 2023 8:18:58 PM	No	
53,800	INSPECT_Mismatched Tire Tread, Casing Design	Done		EARJOHNSON	Mar 16, 2023	No	

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
					8:19:01 PM		
53,900	INSPECT_Dual Mating Tires w/Square	-	NA	EARJOHNSON	Mar 16, 2023 8:19:08 PM	No	
54,000	!FRA!INSPECT_Wheels for Cracks, Loose Lugs/Indicators, Outer Hub Leaks	Done		EARJOHNSON	Mar 16, 2023 8:19:10 PM	No	
54,100	INSPECT_Mud Flaps, Brackets	Done		EARJOHNSON	Mar 16, 2023 8:19:13 PM	No	
54,200	RECORD_RRO-Tire Tread Depth (32nds)	7 32nds of an inch		EARJOHNSON	Mar 16, 2023 8:19:27 PM	No	
54,300	RECORD_RRI-Tire Tread Depth (32nds)	8 32nds of an inch		EARJOHNSON	Mar 16, 2023 8:19:31 PM	No	
54,400	RECORD_RRO-Air Pressure (psi)	65 Pounds per Square Inch		EARJOHNSON	Mar 16, 2023 8:19:37 PM	No	
54,500	RECORD_RRI-Air Pressure (psi)	65 Pounds per Square Inch		EARJOHNSON	Mar 16, 2023 8:19:43 PM	No	
54,600	RECORD_LRO-Tire Tread Depth (32nds)	4 32nds of an inch		EARJOHNSON	Mar 16, 2023 8:19:56 PM	No	
54,700	RECORD_LRI-Tire Tread Depth (32nds)	8 32nds of an inch		EARJOHNSON	Mar 16, 2023 8:20:01 PM	No	
54,800	RECORD_LRO-Air Pressure (psi)	65 Pounds per Square Inch		EARJOHNSON	Mar 16, 2023 8:20:06 PM	No	
54,900	RECORD_LRI-Air Pressure (psi)	65 Pounds per Square Inch		EARJOHNSON	Mar 16, 2023 8:20:11 PM	No	
55,000	!FRA!INSPECT_ REAR Brake Assemblies	Done		EARJOHNSON	Mar 16, 2023 8:20:13 PM	No	
55,100	!FRA!INSPECT_ REAR Hubs, Wheel Seals for Oil Leaks	Done		EARJOHNSON	Mar 16, 2023 8:20:16 PM	No	
55,200	!FRA!INSPECT_REAR ABS Tone Rings, Sensors, Routing Of Cables (if equipped)	Done		EARJOHNSON	Mar 16, 2023 8:20:19 PM	No	
55,300	MEASURE_RECORD_LR - Brake Lining, Pad Thickness (32nds)	7 32nds of an inch		EARJOHNSON	Mar 16, 2023 8:20:35 PM	No	
55,400	MEASURE_RECORD_RR - Brake Lining, Pad Thickness (32nds)	7 32nds of an inch		EARJOHNSON	Mar 16, 2023 8:20:40 PM	No	
55,500	INSPECT VISUALLY_MEASURE_RECORD_LR Drum, Rotor Condition (inches)	1.64 Inch		EARJOHNSON	Mar 16, 2023 8:20:52 PM	No	
55,600	INSPECT VISUALLY_MEASURE_RECORD_RR Drum, Rotor Condition (inches)	1.643 Inch		EARJOHNSON	Mar 16, 2023 8:21:06 PM	No	
55,700	CHECK_Spring Brake Inversion Valve	-	NA	EARJOHNSON	Mar 16, 2023 8:21:13 PM	No	
55,800	CHECK_Double Check Valve - Primary,	-	NA	EARJOHNSON	Mar 16,	No	

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
	Secondary				2023 8:21:20 PM		
55,900	!FRA!INSPECT_ Under Body Exhaust System	Done		EARJOHNSON	Mar 16, 2023 8:21:23 PM	No	
56,000	*RPT*INSPECT_ REAR Axle Housing, Breather; CLEAN_Breather	Done		EARJOHNSON	Mar 16, 2023 8:21:26 PM	No	
56,100	*RPT*INSPECT_ REAR Springs, Shocks, Suspension, Airbags	Done		EARJOHNSON	Mar 16, 2023 8:21:31 PM	No	
60,000	SECTION 6 - Wheelchair Inspection	Done		EARJOHNSON	Mar 16, 2023 8:21:34 PM	No	
60,100	RECORD_Wheelchair Cycle Count	15393 Cycles		EARJOHNSON	Mar 16, 2023 8:37:54 PM	No	
60,200	CHECK_ Lift Access Door for Ease of Opening,Latch Security,Door Hold Back	Done		EARJOHNSON	Mar 16, 2023 8:37:57 PM	No	
60,300	CHECK_Platform Emergency Release Mechanism for Ease of Operation	Done		EARJOHNSON	Mar 16, 2023 8:37:59 PM	No	
60,400	OPERATE_Lift thru Complete Cycle;CHECK_Noises,Jerky Op,Too Fast-Slow,Drift Down	Done		EARJOHNSON	Mar 16, 2023 8:38:03 PM	No	
60,500	INSPECT_ Bridgeplate Operation	-	Bridgeplate binding.	EARJOHNSON	Mar 16, 2023 8:38:37 PM	Yes	56515052
60,600	INSPECT_All Pivot Points for Wear and Looseness	Done		EARJOHNSON	Mar 16, 2023 8:38:43 PM	No	
60,700	INSPECT_Rollers for Wear and Smooth Rotation	Done		EARJOHNSON	Mar 16, 2023 8:38:53 PM	No	
60,800	INSPECT_Operation of Platform Barrier Mechanism	Done		EARJOHNSON	Mar 16, 2023 8:38:59 PM	No	
60,900	INSPECT_Cam Slots for Wear and Proper Alignment	Done		EARJOHNSON	Mar 16, 2023 8:39:04 PM	No	
61,000	INSPECT_Cable Condition (If Applicable)	Done		EARJOHNSON	Mar 16, 2023 8:39:07 PM	No	
61,100	INSPECT_Hydraulic Hoses for Leaks, Chafing or Cracks	Done		EARJOHNSON	Mar 16, 2023 8:39:10 PM	No	
61,200	INSPECT_Electrical Connections and Routing of Wires and Cables	Done		EARJOHNSON	Mar 16, 2023 8:39:21 PM	No	
61,300	INSPECT_Operation and Adjustment of All Safety Switches	Done		EARJOHNSON	Mar 16, 2023 8:39:24 PM	No	
61,400	INSPECT_All Lift Mounting Brackets for Loose Bolts Broken Welds, etc.	Done		EARJOHNSON	Mar 16, 2023 8:39:26 PM	No	
61,500	INSPECT_Manual Back-up Raise/Lower System (If Applicable)	Done		EARJOHNSON	Mar 16, 2023 8:39:29 PM	No	

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
61,600	INSPECT_HydrPump Reservoir Oil Level. Consult SrvManual for Fluid to Use.	Done		EARJOHNSON	Mar 16, 2023 8:39:32 PM	No	
61,700	CHECK_Operator Decals for Proper Positioning;CONSULT_Service Manual	Done		EARJOHNSON	Mar 16, 2023 8:39:37 PM	No	
61,800	CHECK_WC Holddowns Inside Vehicle for Secure Mounting,Proper Operation	Done		EARJOHNSON	Mar 16, 2023 8:39:39 PM	No	
61,900	CLEAN_Linkages and Mechanisms	Done		EARJOHNSON	Mar 16, 2023 8:39:42 PM	No	
62,000	LUBRICATE_Linkages and Mechanisms (DO NOT OVER Lubricate)	Done		EARJOHNSON	Mar 16, 2023 8:39:45 PM	No	
62,100	INSPECT_Emergency Platform Release Mechanism	Done		EARJOHNSON	Mar 16, 2023 8:39:48 PM	No	
62,200	INSPECT_Platform Barrier Latch Mechanism	Done		EARJOHNSON	Mar 16, 2023 8:39:51 PM	No	
62,300	INSPECT_Bridgeplate Hinge	Done		EARJOHNSON	Mar 16, 2023 8:39:54 PM	No	
62,400	INSPECT_All Pivot Points	Done		EARJOHNSON	Mar 16, 2023 8:39:57 PM	No	
62,500	INSPECT_Cams and Slots	Done		EARJOHNSON	Mar 16, 2023 8:39:59 PM	No	
62,600	INSPECT_Rollers	Done		EARJOHNSON	Mar 16, 2023 8:40:02 PM	No	
62,700	INSPECT_All Linkages	Done		EARJOHNSON	Mar 16, 2023 8:40:04 PM	No	
70,000	SECTION 7 - ALTERNATIVE FUELS INSPECTION	Done		EARJOHNSON	Mar 16, 2023 8:40:07 PM	No	
70,300	INSPECT_Condition of Fuel Pressure Gauge	Done		EARJOHNSON	Mar 16, 2023 8:40:10 PM	No	
70,400	PROVIDE PROOF_Tank Dents/Scratches and Re-Certification	Done		EARJOHNSON	Mar 16, 2023 8:40:20 PM	No	
70,500	INSPECT_Tank test date, labels-Reference-ST.4 FMMVSS 304 & ANSI-CSA NGV2	Done		EARJOHNSON	Mar 16, 2023 8:40:24 PM	No	
70,600	INSPECT_ Tank Lines to Ensure Secure Mounting, Insulation Against Vibration	Done		EARJOHNSON	Mar 16, 2023 8:40:27 PM	No	
70,700	INSPECT_ Filling Nozzle for Securely Fitting Cap	-	No fuel cap.	EARJOHNSON	Mar 16, 2023 8:40:55 PM	Yes	56515052
70,800	INSPECT_ Pressure Relief Device's Venting System, Valves, Ducting to MNFR Specs	Done		EARJOHNSON	Mar 16, 2023 8:40:57 PM	No	
80,000	SECTION 8 - PMI Report Completion	Done		EARJOHNSON	Mar 16, 2023	No	

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
					8:41:00 PM		
80,100	COMPLETE_PM Report; Follow-ups	Done		EARJOHNSON	Mar 16, 2023 8:41:03 PM	No	
80,200	RETURN_Vehicle to Predetermined Location	Done		EARJOHNSON	Mar 16, 2023 8:41:06 PM	No	

LH: 20 Desc: Medium Duty PMA Service

Task: 55345-Medium Duty PMA Inspection Performed by: EARJOHNSON Performed on: 16-MAR-23

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
100,000	"A" PMI SERVICING ITEMS	Done		EARJOHNSON	Mar 16, 2023 9:37:33 PM	No	
101,000	FRA Change Oil Filters	Yes		EARJOHNSON	Mar 16, 2023 9:37:33 PM	No	
102,000	FRA Drain Engine Oil	Yes		EARJOHNSON	Mar 16, 2023 9:37:33 PM	No	
103,000	FRA Check Transmission Fluid	Done		EARJOHNSON	Mar 16, 2023 9:37:33 PM	No	
104,000	Lubricate Chassis	Done		EARJOHNSON	Mar 16, 2023 9:37:33 PM	No	
105,000	Replace or Clean A/C Filters	Done		EARJOHNSON	Mar 16, 2023 9:37:33 PM	No	
106,000	Drain Water from Fuel Water Separator (where applicable)	-	NA	EARJOHNSON	Mar 16, 2023 9:37:33 PM	No	
107,000	FRA Change Primary Fuel Filter	No		EARJOHNSON	Mar 16, 2023 9:37:33 PM	No	
108,000	Lube all pivoting Mechanisms	Done		EARJOHNSON	Mar 16, 2023 9:37:33 PM	No	

LH: 5 Desc: Personal Risk Assessment

Task: PRA and Meter Readings Performed by: EARJOHNSON Performed on: 16-MAR-23

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
1	Are you properly trained to perform the task?	Done		EARJOHNSON	Mar 16, 2023 9:38:46 PM	No	
2	If task requires lifting, are lifts secured, are jack stands used correctly?	Done		EARJOHNSON	Mar 16, 2023 9:38:46 PM	No	
4	Are you wearing the appropriate PPE?	Done		EARJOHNSON	Mar 16, 2023 9:38:46 PM	No	
7	Have you performed the proper LOTO?	Done		EARJOHNSON	Mar 16, 2023 9:38:46 PM	No	
10	Are you aware of the potential risks of performing this repair?	Done		EARJOHNSON	Mar 16, 2023 9:38:45 PM	No	
11	Have you successfully completed the Personal Risk Assessment?	Done		EARJOHNSON	Mar 16, 2023 9:38:46 PM	No	



WorkOrder
55345 Palm Tran Connection
v 2.2
Page 1 of 9



WorkOrder: 51290765
Invoice Number: 55345-51290765

Client Department:

MRC: 55345M
WO Desc: PM A
Requested By: RGASPARD
Created By: RGASPARD
Class: WO
Arrangement: Unassigned
Potential Warranty: No

Equipment: 4514-P
Ford E450 Champion Challenger
1FDFE4FS7EDB17176
VIN:
Status: 40
Priority: 1
Driver:
Phone:
ETA:

Chronology			Meter	Reading	UOM
Reported	May 22, 2018	10:23 AM	WO		DH
Started	May 22, 2018		Life	108,680	DH
Completed	May 22, 2018	12:28 PM	System	108,923	DH
Down Time					

WorkOrder Notes

Line	Comment
10	CAUSE: PM CORRECTION: Perform pmA service, lube front end, tire rotation, torque and re torque tires (140 f/p), R&R engine oil and filter, road test, all okay at this time. Parts. Engine oil filter part # B329 qty 1 engine oil. 5W20 Qty 6 qts Drain plug qty 1

Activity: 10 **999 TOTAL VEHICLE**
Activity Note: Light Medium Duty PMI
Reason for Repair: 08 - Preventive Maintenance
Work Accomplished: A - PM Level A
Part Failure: -

Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
------	-------------	-------------	------	------	----------

Labor Posted

Date	Technician	Hours	Rate	Extended
22-May-18	Rodriguez,Raul	1.45	0.00	0.00

Activity 10 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours: 1.45	
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00

Activity: 20 **999 TOTAL VEHICLE**
Activity Note: PM A
Reason for Repair: 08 - Preventive Maintenance
Work Accomplished: A - PM Level A
Part Failure: -

Activity Comments



WorkOrder
55345 Palm Tran Connection
v 2.2
Page 2 of 9



WorkOrder: 51290765
Invoice Number: 55345-51290765

Client Department:

MRC: 55345M
WO Desc: PM A
Requested By: RGASPARD
Created By: RGASPARD
Class: WO
Arrangement: Unassigned
Potential Warranty: No

Equipment: 4514-P
Ford E450 Champion Challenger
VIN: 1FDFE4FS7EDB17176
Status: 40
Priority: 1
Driver:
Phone:
ETA:

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
22-May-18	B329(F)	FILTER, OIL SAME AS LF3681	1.00	1.96	1.96

Labor Posted

Date	Technician	Hours	Rate	Extended
------	------------	-------	------	----------

Activity 20 Sub Total

Parts: 1.96
Labor: 0.00
Labor Hours: 0.00
Sublet Parts: 0.00
Sublet Labor: 0.00
Activity Sub Total 1.96

Activity: 30  **999 TOTAL VEHICLE**
Activity Note: PRAMETER
Reason for Repair: 05 - Inspection, Routine
Work Accomplished: 06 - Inspect
Part Failure: -

Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
------	-------------	-------------	------	------	----------

Labor Posted

Date	Technician	Hours	Rate	Extended
------	------------	-------	------	----------

Activity 30 Sub Total

Parts: 0.00
Labor: 0.00
Labor Hours: 0.00
Sublet Parts: 0.00
Sublet Labor: 0.00
Activity Sub Total 0.00

WorkOrder 51290765 Grand Total

Parts: 1.96
Labor: 0.00
Labor Hours: 1.45
Sublet Parts: 0.00
Sublet Labor: 0.00
WorkOrder Grand Total 1.96

Recent Repair History



WorkOrder
55345 Palm Tran Connection
v 2.2
Page 3 of 9



WorkOrder: 51290765
Invoice Number: 55345-51290765

Client Department:

MRC: 55345M

WO Desc:

PM A

Requested By: RGASPARD

Created By: RGASPARD

Class: WO

Arrangement: Unassigned

Potential Warranty: No

Equipment: 4514-P

Ford E450 Champion Challenger

VIN: 1FDFE4FS7EDB17176

Status: 40

Priority: 1

Driver:

Phone:

ETA:

WorkOrder	Date Completed	Life Meter	Class	Description
51290765	22-May-18	108,680	WO	PM A
51120881	1-May-18	99,814	WO	FTLMPMI_FOLLOWUP
51290700	26-Apr-18	104,442	WO	Vehicle pull Right when Braking
51132389	26-Apr-18	104,442	WO	PM A

Scheduled Preventative Maintenance

Nest	PM	WorkOrder	Due Date	Due Life Meter	Due Meter Reading	Due Life Meter 2	Due Meter Reading 2
------	----	-----------	----------	----------------	-------------------	------------------	---------------------

Other Open Repairs

WorkOrder8	Date Reported	Life Meter	Class	Description
51114102	22-Mar-18	99,643	WO	Vehicle is pulling

PH: Work Order: 51290765 Desc: PM A

Equip: 4514-P Desc: Ford E450 Champion Challenger VIN: 1FDFE4FS7EDB17176

LH: 10 Desc: Light Medium Duty PMI

Task: First Transit Light-Medium Duty PMI Performed by: RAUODRIGUEZ Performed on: 22-MAY-18

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
10,000	SECTION 1 Preparation and Drive On (In Lot) Inspection	Done		RAUODRIGUEZ	May 22, 2018 12:11:40 PM	No	
10,100	Safety Inspection	Done		RAUODRIGUEZ	May 22, 2018 12:11:40 PM	No	
10,110	FRA Check Drivers Pre-trip or DVIR/EVIR & Authorization Forms	Done		RAUODRIGUEZ	May 22, 2018 12:11:40 PM	No	
10,120	FRA Check All Warning Lights and Alarms	Done		RAUODRIGUEZ	May 22, 2018 12:11:40 PM	No	
10,130	FRA Check Automatic Transmission Neutral Start Operation	Done		RAUODRIGUEZ	May 22, 2018 12:11:40 PM	No	
10,140	Check Service Brakes	Done		RAUODRIGUEZ	May 22, 2018 12:11:41 PM	No	
10,150	FRA Start Engine and Listen for Any Unusual Noises	Done		RAUODRIGUEZ	May 22, 2018 12:11:41 PM	No	
10,160	FRA Check Instruments and Horns	Done		RAUODRIGUEZ	May 22, 2018 12:11:41 PM	No	
10,170	Check Fast Idle	Done		RAUODRIGUEZ	May 22, 2018 12:11:41 PM	No	
10,180	Check Starter Protection Circuit	Done		RAUODRIGUEZ	May 22, 2018 12:11:41 PM	No	
10,190	Check Reverse Warning System	Done		RAUODRIGUEZ	May 22, 2018 12:11:41 PM	No	
11,100	Check Parking Brake	Done		RAUODRIGUEZ	May 22, 2018 12:11:42 PM	No	
11,110	Check HVAC Switches and Other Controls	Done		RAUODRIGUEZ	May 22, 2018 12:11:41 PM	No	
11,120	FRA Inspect Windshields, Mirror and Sun Visor Condition	Done		RAUODRIGUEZ	May 22, 2018 12:11:42 PM	No	
11,130	FRA Check Wiper and Washer Operation	Done		RAUODRIGUEZ	May 22, 2018 12:11:42 PM	No	
11,140	Road Test: Check for Proper Operation	Done		RAUODRIGUEZ	May 22, 2018 12:11:42 PM	No	
11,150	Perform Brake Test	Done		RAUODRIGUEZ	May 22, 2018 12:11:42 PM	No	
11,152	Decelerometer Results Test 1	FEET	na	RAUODRIGUEZ	May 22, 2018 12:11:42 PM	No	
11,154	Decelerometer Results Test 2	FEET	na	RAUODRIGUEZ	May 22, 2018 12:11:42 PM	No	
11,156	Decelerometer Results Test 3	FEET	na	RAUODRIGUEZ	May 22, 2018 12:11:43 PM	No	
11,161	FRA Check/Record Oil Pressure / @1500 rpm	Pounds per Square Inch	na	RAUODRIGUEZ	May 22, 2018 12:11:43 PM	No	
11,162	FRA Check/Record Water Temperature	Degree Fahrenheit	na	RAUODRIGUEZ	May 22, 2018 12:11:43 PM	No	
11,170	FRA Check Door Operation	Done		RAUODRIGUEZ	May 22, 2018 12:11:43 PM	No	
11,180	FRA Check Operation of All Other Accessories	Done		RAUODRIGUEZ	May 22, 2018 12:11:43 PM	No	
20,000	SECTION 2 Interior Circle Inspection	Done		RAUODRIGUEZ	May 22, 2018 12:11:43 PM	No	

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
20,210	Check Condition of Operator's Area	Done		RAUODRIGUEZ	May 22, 2018 12:11:44 PM	No	
20,220	Check Accelerator and Brake Pedals	Done		RAUODRIGUEZ	May 22, 2018 12:11:44 PM	No	
20,230	FRA Check Wiring Under Dash	Done		RAUODRIGUEZ	May 22, 2018 12:11:44 PM	No	
20,240	FRA Check Interior Lights	Done		RAUODRIGUEZ	May 22, 2018 12:11:44 PM	No	
20,250	FRA Check Interior Electrical Panels	Done		RAUODRIGUEZ	May 22, 2018 12:11:44 PM	No	
20,260	Check Stop Request System	-	na	RAUODRIGUEZ	May 22, 2018 12:11:44 PM	No	
20,270	Check Fare Box Mounting (If Applicable)	-	na	RAUODRIGUEZ	May 22, 2018 12:11:44 PM	No	
20,280	Check Seats, Seat Belts, Hand Rails and Floor Covering	Done		RAUODRIGUEZ	May 22, 2018 12:11:45 PM	No	
20,290	Check for Physical Damage, Water Leaks, and Graffiti	Done		RAUODRIGUEZ	May 22, 2018 12:11:45 PM	No	
22,100	Check Emergency Windows and Glass Condition	Done		RAUODRIGUEZ	May 22, 2018 12:11:45 PM	No	
22,110	Check Emergency Hatches	Done		RAUODRIGUEZ	May 22, 2018 12:11:45 PM	No	
22,120	Check All Safety Equipment	Done		RAUODRIGUEZ	May 22, 2018 12:11:45 PM	No	
30,000	SECTION 3 Exterior Circle Inspection	Done		RAUODRIGUEZ	May 22, 2018 12:11:45 PM	No	
30,310	Check Passenger Doors	Done		RAUODRIGUEZ	May 22, 2018 12:11:45 PM	No	
30,320	Inspect Step-well and Hand Rails	Done		RAUODRIGUEZ	May 22, 2018 12:11:46 PM	No	
30,330	Check Wheelchair Lift Operation	Done		RAUODRIGUEZ	May 22, 2018 12:11:46 PM	No	
30,340	FRA Check Destination Sign and Run Box	-	na	RAUODRIGUEZ	May 22, 2018 12:11:46 PM	No	
30,350	FRA Inspect Mirror and Mountings	Done		RAUODRIGUEZ	May 22, 2018 12:11:46 PM	No	
30,360	Check for Physical Damage and Decals	Done		RAUODRIGUEZ	May 22, 2018 12:11:46 PM	No	
30,370	Check Wiper Blade and Arm Condition	Done		RAUODRIGUEZ	May 22, 2018 12:11:46 PM	No	
30,380	Check Exterior Compartment Doors	Done		RAUODRIGUEZ	May 22, 2018 12:11:46 PM	No	
30,390	FRA Check Fuel Tank Cap	Done		RAUODRIGUEZ	May 22, 2018 12:11:46 PM	No	
33,100	Check Lights and Reflectors	Done		RAUODRIGUEZ	May 22, 2018 12:11:47 PM	No	
33,110	Check License Plate, Permits and State Inspection Decals	Done		RAUODRIGUEZ	May 22, 2018 12:11:47 PM	No	
40,000	SECTION 4 Engine Compartment Inspection	Done		RAUODRIGUEZ	May 22, 2018 12:11:47 PM	No	
40,410	FRA Check Engine Compartment/Condition for Fire Risk	Done		RAUODRIGUEZ	May 22, 2018 12:11:47 PM	No	
40,420	Check Hood	Done		RAUODRIGUEZ	May 22, 2018 12:11:47 PM	No	
40,430	Check Fan, Shroud and Radiator	Done		RAUODRIGUEZ	May 22, 2018	No	

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
					12:11:47 PM		
40,440	Test Coolant System Using Test Strips and Record Results	Done		RAUODRIGUEZ	May 22, 2018 12:11:47 PM	No	
40,441	Inhibitor Test Pass or Fail (Indicate with a Yes or No)	No	na	RAUODRIGUEZ	May 22, 2018 12:11:47 PM	No	
40,442	Freeze Point	Degree Fahrenheit	na	RAUODRIGUEZ	May 22, 2018 12:11:47 PM	No	
40,450	FRA Check Coolant Recovery System Condition & for Leaks	Done		RAUODRIGUEZ	May 22, 2018 12:11:47 PM	No	
40,460	Record Antifreeze Protection Level Using Refractometer	-	na	RAUODRIGUEZ	May 22, 2018 12:11:47 PM	No	
40,461	Refractometer Reading	Degree Fahrenheit	na	RAUODRIGUEZ	May 22, 2018 12:11:49 PM	No	
40,470	Pressure Test Cooling System and Check for Leaks	Done		RAUODRIGUEZ	May 22, 2018 12:11:48 PM	No	
40,480	FRA Check Coolant Hose Condition	Done		RAUODRIGUEZ	May 22, 2018 12:11:48 PM	No	
40,490	FRA Check Alternator Mount and Condition	Done		RAUODRIGUEZ	May 22, 2018 12:11:48 PM	No	
44,100	FRA Check Fuel Control and Transmission Connections	Done		RAUODRIGUEZ	May 22, 2018 12:11:48 PM	No	
44,110	FRA Check Master Cylinder Fluid Level	Done		RAUODRIGUEZ	May 22, 2018 12:11:48 PM	No	
44,120	FRA Check All Belts for Condition, Alignment and Tension	Done		RAUODRIGUEZ	May 22, 2018 12:11:48 PM	No	
44,130	FRA Check Exhaust System	Done		RAUODRIGUEZ	May 22, 2018 12:11:48 PM	No	
44,140	FRA Check Intake System	Done		RAUODRIGUEZ	May 22, 2018 12:11:48 PM	No	
44,150	FRA Inspect Turbocharger	-	na	RAUODRIGUEZ	May 22, 2018 12:17:40 PM	No	
44,160	FRA Inspect Power Steering and Hydraulic Fluid	Done		RAUODRIGUEZ	May 22, 2018 12:17:40 PM	No	
44,170	FRA Check All Engine or Belt Driven Components	Done		RAUODRIGUEZ	May 22, 2018 12:17:40 PM	No	
44,180	FRA Check for Leaks	Done		RAUODRIGUEZ	May 22, 2018 12:17:40 PM	No	
44,190	FRA Perform Battery Inspection	Done		RAUODRIGUEZ	May 22, 2018 12:17:40 PM	No	
44,200	FRA Check Battery Box Corrosion, Cables and Hold-Downs	Done		RAUODRIGUEZ	May 22, 2018 12:17:40 PM	No	
50,000	SECTION 5 Steering System Inspection	Done		RAUODRIGUEZ	May 22, 2018 12:17:40 PM	No	
50,510	Check Entire Steering System	Done		RAUODRIGUEZ	May 22, 2018 12:17:40 PM	No	
60,000	SECTION 6 Tires and Wheel Inspection	Done		RAUODRIGUEZ	May 22, 2018 12:17:41 PM	No	
60,610	FRA Check and Record Air Pressure	Done		RAUODRIGUEZ	May 22, 2018 12:17:41 PM	No	
60,611	Air Pressure RF	65 Pounds per Square Inch		RAUODRIGUEZ	May 22, 2018 12:17:41 PM	No	
60,612	Air Pressure LF	65 Pounds per Square Inch		RAUODRIGUEZ	May 22, 2018 12:17:41 PM	No	
60,613	Air Pressure RRO	65 Pounds per Square Inch		RAUODRIGUEZ	May 22, 2018 12:17:41 PM	No	

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
60,614	Air Pressure RRI	65 Pounds per Square Inch		RAUODRIGUEZ	May 22, 2018 12:17:41 PM	No	
60,615	Air Pressure LRI	65 Pounds per Square Inch		RAUODRIGUEZ	May 22, 2018 12:17:41 PM	No	
60,616	Air Pressure LRO	65 Pounds per Square Inch		RAUODRIGUEZ	May 22, 2018 12:17:42 PM	No	
60,620	Check Valve Stems and Caps	Done		RAUODRIGUEZ	May 22, 2018 12:17:41 PM	No	
60,630	Check and Record Tread Depth	Done		RAUODRIGUEZ	May 22, 2018 12:17:42 PM	No	
60,631	Tread Depth RF	10 32nds of an inch		RAUODRIGUEZ	May 22, 2018 12:17:42 PM	No	
60,632	Tread Depth LF	10 32nds of an inch		RAUODRIGUEZ	May 22, 2018 12:17:42 PM	No	
60,633	Tread Depth RRO	10 32nds of an inch		RAUODRIGUEZ	May 22, 2018 12:17:43 PM	No	
60,634	Tread Depth RRI	10 32nds of an inch		RAUODRIGUEZ	May 22, 2018 12:17:42 PM	No	
60,635	Tread Depth LRI	10 32nds of an inch		RAUODRIGUEZ	May 22, 2018 12:17:43 PM	No	
60,636	Tread Depth LRO	10 32nds of an inch		RAUODRIGUEZ	May 22, 2018 12:17:43 PM	No	
60,640	Check for Mismatched Tread or Casing Design	Done		RAUODRIGUEZ	May 22, 2018 12:17:43 PM	No	
60,650	Check Sidewall Wear	Done		RAUODRIGUEZ	May 22, 2018 12:17:43 PM	No	
60,660	Inspect for Cuts and Tears	Done		RAUODRIGUEZ	May 22, 2018 12:17:43 PM	No	
60,670	Check Dual Mating With Square	Done		RAUODRIGUEZ	May 22, 2018 12:17:43 PM	No	
60,680	Check Wheels for Cracks and Loose Lugs	Done		RAUODRIGUEZ	May 22, 2018 12:17:44 PM	No	
60,690	Check Tires for Irregular or Alignment Wear	Done		RAUODRIGUEZ	May 22, 2018 12:17:44 PM	No	
66,100	FRA Check Outer Hubs for Leaks	Done		RAUODRIGUEZ	May 22, 2018 12:17:44 PM	No	
70,000	SECTION 7 Under Vehicle Inspection	Done		RAUODRIGUEZ	May 22, 2018 12:17:44 PM	No	
70,710	Check Vibration Damper	Done		RAUODRIGUEZ	May 22, 2018 12:17:44 PM	No	
70,720	Check Engine and Transmission Mounts	Done		RAUODRIGUEZ	May 22, 2018 12:17:44 PM	No	
70,730	FRA Check Starter	Done		RAUODRIGUEZ	May 22, 2018 12:17:44 PM	No	
70,740	FRA Check Bottom of Engine for Fluid Leaks	Done		RAUODRIGUEZ	May 22, 2018 12:17:44 PM	No	
70,750	FRA Check Transmission for Leaks	Done		RAUODRIGUEZ	May 22, 2018 12:17:45 PM	No	
70,760	FRA Check Differential Breather and Fluid	Done		RAUODRIGUEZ	May 22, 2018 12:17:45 PM	No	
70,770	FRA Check Exhaust System	Done		RAUODRIGUEZ	May 22, 2018 12:17:45 PM	No	
70,780	Check Driveline, U-joint and Slip Yokes	Done		RAUODRIGUEZ	May 22, 2018 12:17:45 PM	No	
70,790	Check All Body Mounts and Chassis Frame	Done		RAUODRIGUEZ	May 22, 2018	No	

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
					12:17:45 PM		
77,100	FRA Check Security, Integrity and Length of Ground Straps	Done		RAUODRIGUEZ	May 22, 2018 12:17:45 PM	No	
77,110	FRA Check Fuel Tank	Done		RAUODRIGUEZ	May 22, 2018 12:17:45 PM	No	
77,120	Check Suspension Components	Done		RAUODRIGUEZ	May 22, 2018 12:17:46 PM	No	
77,130	FRA Check Brake Pad Thickness and Rotor for Wear	Done		RAUODRIGUEZ	May 22, 2018 12:17:46 PM	No	
77,131	Brake Pad Thickness LF	0 Inch	9mm	RAUODRIGUEZ	May 22, 2018 12:23:22 PM	No	
77,132	Brake Pad Thickness RF	Inch	9mm	RAUODRIGUEZ	May 22, 2018 12:23:22 PM	No	
77,133	Brake Pad Thickness LR	Inch	6mm	RAUODRIGUEZ	May 22, 2018 12:23:22 PM	No	
77,134	Brake Pad Thickness RR	Inch	6mm	RAUODRIGUEZ	May 22, 2018 12:23:22 PM	No	
77,135	Brake Rotor LF	Inch	39.7mm	RAUODRIGUEZ	May 22, 2018 12:23:22 PM	No	
77,136	Brake Rotor RF	Inch	39.7mm	RAUODRIGUEZ	May 22, 2018 12:23:23 PM	No	
77,137	Brake Rotor LR	Inch	35.7mm	RAUODRIGUEZ	May 22, 2018 12:23:23 PM	No	
77,138	Brake Rotor RR	Inch	35.7mm	RAUODRIGUEZ	May 22, 2018 12:23:23 PM	No	
77,140	FRA Check Brake Hoses	Done		RAUODRIGUEZ	May 22, 2018 12:23:23 PM	No	
77,150	Check King Pins	-	na	RAUODRIGUEZ	May 22, 2018 12:23:23 PM	No	
77,160	FRA Check for Loose or Noisy Wheel Bearings	Done		RAUODRIGUEZ	May 22, 2018 12:23:24 PM	No	
80,000	SECTION 8 PMI Report Completion	Done		RAUODRIGUEZ	May 22, 2018 12:23:24 PM	No	
80,810	Completion of PMI Report	Done		RAUODRIGUEZ	May 22, 2018 12:23:24 PM	No	
90,000	SECTION 9 Completion of PMI	Done		RAUODRIGUEZ	May 22, 2018 12:23:24 PM	No	
90,910	Vehicle Returned to predetermined location	Done		RAUODRIGUEZ	May 22, 2018 12:23:24 PM	No	

LH: 20 Desc: PM A

Task: PM A SERVICE Performed by: RAUODRIGUEZ Performed on: 22-MAY-18

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
100,000	"A" PMI SERVICING ITEMS	Done		RAUODRIGUEZ	May 22, 2018 12:26:54 PM	No	
101,000	FRA Change Oil Filters	Yes		RAUODRIGUEZ	May 22, 2018 12:26:54 PM	No	
102,000	FRA Drain Engine Oil	Yes		RAUODRIGUEZ	May 22, 2018 12:26:54 PM	No	
103,000	FRA Check Transmission Fluid	Done		RAUODRIGUEZ	May 22, 2018 12:26:54 PM	No	
104,000	Lubricate Chassis	Done		RAUODRIGUEZ	May 22, 2018 12:26:55 PM	No	
105,000	Replace or Clean A/C Filters	Done		RAUODRIGUEZ	May 22, 2018 12:26:55 PM	No	
107,000	FRA Change Primary Fuel Filter	No	na	RAUODRIGUEZ	May 22, 2018 12:26:55 PM	No	
108,000	Lube all pivoting Mechanisms	Done		RAUODRIGUEZ	May 22, 2018 12:26:55 PM	No	

LH: 30 Desc: PRAMETER

Task: PRA and Meter Readings Performed by: RAUODRIGUEZ Performed on: 22-MAY-18

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
10	Have you successfully completed the Personal Risk Assessment?	Done		RAUODRIGUEZ	May 22, 2018 12:27:37 PM	No	
20	Miles					No	
30	Kilometers					No	
40	Hours					No	



WorkOrder
55345 Palm Tran Connection
v 2.2
Page 1 of 10



WorkOrder: 54465331
Invoice Number: 55345-54465331

Client Department:

MRC: 55345M
WO Desc: 55345-LIGHT DUTY PMA
Requested By: JUHURST
Created By: JUHURST
Class: WO
Arrangement: Unassigned
Potential Warranty: No

Equipment: 4514-P
Ford E450 Champion Challenger
VIN: 1FDPE4FS7EDB17176
Status: 40
Priority: 3
Driver:
Phone:
ETA:

Chronology

Reported	May 17, 2021	12:37 PM
Started	May 17, 2021	
Completed	May 17, 2021	3:00 PM

Down Time

Meter	Reading	UOM
WO		DH
Life	260,956	DH

WorkOrder Notes

Line	Comment
10	COMPLAINT: Vehicle came in for service CAUSE:Time for service CORRECTION: service Job complete. For next operation

Activity: 5 **999/999/999 TOTAL VEHICLE**

Activity Note: PERSONAL RISK ASSESSMENT
Reason for Repair: SW - Shop Work Order
Work Accomplished: 06 - Inspect
Part Failure: 00 - No Failure

Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
------	-------------	-------------	------	------	----------

Labor Posted

Date	Technician	Hours	Rate	Extended
17-May-21	Junior Hurst	0.02	0.00	0.00

Activity 5 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours: 0.02	
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00

Activity: 10 **010 CHASSIS GROUP**

Activity Note: Light Duty PMI
Reason for Repair: 11 - Routine
Work Accomplished: -
Part Failure: -

Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
17-May-21	B329(F)	SEE BALDWIN B329 IN THE FLEET ORG. FILTER, OIL, SPIN-ON	1.00	1.98	1.98



WorkOrder
55345 Palm Tran Connection
v 2.2
Page 1 of 9



WorkOrder: 51365408
Invoice Number: 55345-51365408

Client Department:

MRC: 55345M

WO Desc:

PM B

Requested By: RAUODRIGUEZ

Created By: RAUODRIGUEZ

Class: WO

Arrangement: Unassigned

Potential Warranty: No

Equipment: 4514-P

Ford E450 Champion Challenger

VIN: 1FDFE4FS7EDB17176

Status: 40

Priority: 1

Driver:

Phone:

ETA:

Chronology

Reported	Jun 20, 2018	11:31 AM
Started	Jun 20, 2018	
Completed	Jun 21, 2018	12:06 AM
Down Time		

Meter	Reading	UOM
WO		DH
Life	112,821	DH
System	112,941	DH

WorkOrder Notes

Line	Comment
10	COMPLAINT:pmB CAUSE:Service CORRECTION:Perform pmB Service Oil filter B329 qty1 Engine oil 5w20 qty 7 Qts

Activity: 10 **999 TOTAL VEHICLE**

Activity Note: Light Medium Duty PMI

Reason for Repair: 08 - Preventive Maintenance

Work Accomplished: 06 - Inspect

Part Failure: -

Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
------	-------------	-------------	------	------	----------

Labor Posted

Date	Technician	Hours	Rate	Extended
20-Jun-18	Gaspard,Ronald	1.55	0.00	0.00

Activity 10 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours: 1.55	
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00

Activity: 20 **999 TOTAL VEHICLE**

Activity Note: PM B

Reason for Repair: 08 - Preventive Maintenance

Work Accomplished: B - PM Level B

Part Failure: -

Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
20-Jun-18	B329(F)	FILTER, OIL SAME AS LF3681	1.00	1.96	1.96



WorkOrder
55345 Palm Tran Connection
v 2.2
Page 2 of 9



WorkOrder: 51365408
Invoice Number: 55345-51365408

Client Department:

MRC: 55345M

WO Desc:

PM B

Requested By: RAUODRIGUEZ

Created By: RAUODRIGUEZ

Class: WO

Arrangement: Unassigned

Potential Warranty: No

Equipment: 4514-P

Ford E450 Champion Challenger

VIN: 1FDFE4FS7EDB17176

Status: 40

Priority: 1

Driver:

Phone:

ETA:

Labor Posted

Date	Technician	Hours	Rate	Extended
20-Jun-18	Gaspard,Ronald	1.07	0.00	0.00

Activity 20 Sub Total

Parts:	1.96
Labor:	0.00
Labor Hours: 1.07	
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	1.96

Activity: 30  **999 TOTAL VEHICLE**

Activity Note: PRAMETER

Reason for Repair: 05 - Inspection, Routine

Work Accomplished: 06 - Inspect

Part Failure: -

Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
------	-------------	-------------	------	------	----------

Labor Posted

Date	Technician	Hours	Rate	Extended
20-Jun-18	Gaspard,Ronald	0.25	0.00	0.00

Activity 30 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours: 0.25	
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00

WorkOrder 51365408 Grand Total

Parts:	1.96
Labor:	0.00
Labor Hours: 2.87	
Sublet Parts:	0.00
Sublet Labor:	0.00
WorkOrder Grand Total	1.96

Recent Repair History

WorkOrder	Date Completed	Life Meter	Class	Description
51365408	21-Jun-18	112,821	WO	PM B
51290765	22-May-18	108,680	WO	PM A



WorkOrder
55345 Palm Tran Connection
v 2.2
Page 3 of 9



WorkOrder: 51365408
Invoice Number: 55345-51365408

Client Department:

MRC: 55345M

WO Desc:

PM B

Requested By: RAUODRIGUEZ

Created By: RAUODRIGUEZ

Class: WO

Arrangement: Unassigned

Potential Warranty: No

Equipment: 4514-P

Ford E450 Champion Challenger

VIN: 1FDFE4FS7EDB17176

Status: 40

Priority: 1

Driver:

Phone:

ETA:

Scheduled Preventative Maintenance

Nest	PM	WorkOrder	Due Date	Due Life Meter	Due Meter Reading	Due Life Meter 2	Due Meter Reading 2
------	----	-----------	----------	----------------	-------------------	------------------	---------------------

Other Open Repairs

WorkOrder8	Date Reported	Life Meter	Class	Description
51447076	20-Jun-18	112,821	WO	Needs rear brakes job
51114102	22-Mar-18	99,643	WO	Vehicle is pulling

PH: Work Order: 51365408 Desc: PM B

Equip: 4514-P Desc: Ford E450 Champion Challenger VIN: 1FDFE4FS7EDB17176

LH: 10 Desc: Light Medium Duty PMI

Task: First Transit Light-Medium Duty PMI Performed by: RGASPARD Performed on: 20-JUN-18

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
10,000	SECTION 1 Preparation and Drive On (In Lot) Inspection	Done		RGASPARD	Jun 20, 2018 11:38:48 PM	No	
10,100	Safety Inspection	Done		RGASPARD	Jun 20, 2018 11:38:48 PM	No	
10,110	FRA Check Drivers Pre-trip or DVIR/EVIR & Authorization Forms	Done		RGASPARD	Jun 20, 2018 11:38:48 PM	No	
10,120	FRA Check All Warning Lights and Alarms	Done		RGASPARD	Jun 20, 2018 11:38:48 PM	No	
10,130	FRA Check Automatic Transmission Neutral Start Operation	Done		RGASPARD	Jun 20, 2018 11:38:48 PM	No	
10,140	Check Service Brakes	Done		RGASPARD	Jun 20, 2018 11:38:49 PM	No	
10,150	FRA Start Engine and Listen for Any Unusual Noises	Done		RGASPARD	Jun 20, 2018 11:38:49 PM	No	
10,160	FRA Check Instruments and Horns	Done		RGASPARD	Jun 20, 2018 11:38:49 PM	No	
10,170	Check Fast Idle	Done		RGASPARD	Jun 20, 2018 11:38:49 PM	No	
10,180	Check Starter Protection Circuit	Done		RGASPARD	Jun 20, 2018 11:38:49 PM	No	
10,190	Check Reverse Warning System	Done		RGASPARD	Jun 20, 2018 11:38:49 PM	No	
11,100	Check Parking Brake	Done		RGASPARD	Jun 20, 2018 11:38:49 PM	No	
11,110	Check HVAC Switches and Other Controls	Done		RGASPARD	Jun 20, 2018 11:38:49 PM	No	
11,120	FRA Inspect Windshields, Mirror and Sun Visor Condition	Done		RGASPARD	Jun 20, 2018 11:38:50 PM	No	
11,130	FRA Check Wiper and Washer Operation	Done		RGASPARD	Jun 20, 2018 11:38:50 PM	No	
11,140	Road Test: Check for Proper Operation	Done		RGASPARD	Jun 20, 2018 11:38:50 PM	No	
11,150	Perform Brake Test	Done		RGASPARD	Jun 20, 2018 11:38:50 PM	No	
11,152	Decelerometer Results Test 1	FEET	na	RGASPARD	Jun 20, 2018 11:38:50 PM	No	
11,154	Decelerometer Results Test 2	FEET	na	RGASPARD	Jun 20, 2018 11:38:50 PM	No	
11,156	Decelerometer Results Test 3	FEET	na	RGASPARD	Jun 20, 2018 11:38:50 PM	No	
11,161	FRA Check/Record Oil Pressure / @1500 rpm	Pounds per Square Inch	na	RGASPARD	Jun 20, 2018 11:38:51 PM	No	
11,162	FRA Check/Record Water Temperature	Degree Fahrenheit	na	RGASPARD	Jun 20, 2018 11:38:51 PM	No	
11,170	FRA Check Door Operation	Done		RGASPARD	Jun 20, 2018 11:38:51 PM	No	
11,180	FRA Check Operation of All Other Accessories	Done		RGASPARD	Jun 20, 2018 11:38:51 PM	No	
20,000	SECTION 2 Interior Circle Inspection	Done		RGASPARD	Jun 20, 2018 11:38:51 PM	No	

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
20,210	Check Condition of Operator's Area	Done		RGASPARD	Jun 20, 2018 11:38:51 PM	No	
20,220	Check Accelerator and Brake Pedals	Done		RGASPARD	Jun 20, 2018 11:38:51 PM	No	
20,230	FRA Check Wiring Under Dash	Done		RGASPARD	Jun 20, 2018 11:38:52 PM	No	
20,240	FRA Check Interior Lights	Done		RGASPARD	Jun 20, 2018 11:38:52 PM	No	
20,250	FRA Check Interior Electrical Panels	Done		RGASPARD	Jun 20, 2018 11:38:52 PM	No	
20,260	Check Stop Request System	-	na	RGASPARD	Jun 20, 2018 11:38:52 PM	No	
20,270	Check Fare Box Mounting (If Applicable)	-	na	RGASPARD	Jun 20, 2018 11:38:52 PM	No	
20,280	Check Seats, Seat Belts, Hand Rails and Floor Covering	Done		RGASPARD	Jun 20, 2018 11:38:52 PM	No	
20,290	Check for Physical Damage, Water Leaks, and Graffiti	Done		RGASPARD	Jun 20, 2018 11:38:52 PM	No	
22,100	Check Emergency Windows and Glass Condition	Done		RGASPARD	Jun 20, 2018 11:38:52 PM	No	
22,110	Check Emergency Hatches	Done		RGASPARD	Jun 20, 2018 11:38:52 PM	No	
22,120	Check All Safety Equipment	Done		RGASPARD	Jun 20, 2018 11:38:53 PM	No	
30,000	SECTION 3 Exterior Circle Inspection	Done		RGASPARD	Jun 20, 2018 11:38:53 PM	No	
30,310	Check Passenger Doors	Done		RGASPARD	Jun 20, 2018 11:38:53 PM	No	
30,320	Inspect Step-well and Hand Rails	Done		RGASPARD	Jun 20, 2018 11:38:53 PM	No	
30,330	Check Wheelchair Lift Operation	Done		RGASPARD	Jun 20, 2018 11:38:53 PM	No	
30,340	FRA Check Destination Sign and Run Box	-	na	RGASPARD	Jun 20, 2018 11:38:53 PM	No	
30,350	FRA Inspect Mirror and Mountings	Done		RGASPARD	Jun 20, 2018 11:38:53 PM	No	
30,360	Check for Physical Damage and Decals	Done		RGASPARD	Jun 20, 2018 11:38:54 PM	No	
30,370	Check Wiper Blade and Arm Condition	Done		RGASPARD	Jun 20, 2018 11:38:54 PM	No	
30,380	Check Exterior Compartment Doors	Done		RGASPARD	Jun 20, 2018 11:38:54 PM	No	
30,390	FRA Check Fuel Tank Cap	Done		RGASPARD	Jun 20, 2018 11:38:54 PM	No	
33,100	Check Lights and Reflectors	Done		RGASPARD	Jun 20, 2018 11:38:54 PM	No	
33,110	Check License Plate, Permits and State Inspection Decals	Done		RGASPARD	Jun 20, 2018 11:38:54 PM	No	
40,000	SECTION 4 Engine Compartment Inspection	Done		RGASPARD	Jun 20, 2018 11:38:54 PM	No	
40,410	FRA Check Engine Compartment/Condition for Fire Risk	Done		RGASPARD	Jun 20, 2018 11:38:54 PM	No	
40,420	Check Hood	Done		RGASPARD	Jun 20, 2018 11:38:55 PM	No	
40,430	Check Fan, Shroud and Radiator	Done		RGASPARD	Jun 20, 2018	No	

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
					11:38:55 PM		
40,440	Test Coolant System Using Test Strips and Record Results	-	na	RGASPARD	Jun 20, 2018 11:38:55 PM	No	
40,441	Inhibitor Test Pass or Fail (Indicate with a Yes or No)	No	na	RGASPARD	Jun 20, 2018 11:38:55 PM	No	
40,442	Freeze Point	Degree Fahrenheit	na	RGASPARD	Jun 20, 2018 11:38:55 PM	No	
40,450	FRA Check Coolant Recovery System Condition & for Leaks	Done		RGASPARD	Jun 20, 2018 11:38:55 PM	No	
40,460	Record Antifreeze Protection Level Using Refractometer	-	na	RGASPARD	Jun 20, 2018 11:38:55 PM	No	
40,461	Refractometer Reading	Degree Fahrenheit	na	RGASPARD	Jun 20, 2018 11:38:55 PM	No	
40,470	Pressure Test Cooling System and Check for Leaks	Done		RGASPARD	Jun 20, 2018 11:38:55 PM	No	
40,480	FRA Check Coolant Hose Condition	Done		RGASPARD	Jun 20, 2018 11:38:55 PM	No	
40,490	FRA Check Alternator Mount and Condition	Done		RGASPARD	Jun 20, 2018 11:38:55 PM	No	
44,100	FRA Check Fuel Control and Transmission Connections	Done		RGASPARD	Jun 20, 2018 11:38:55 PM	No	
44,110	FRA Check Master Cylinder Fluid Level	Done		RGASPARD	Jun 20, 2018 11:38:56 PM	No	
44,120	FRA Check All Belts for Condition, Alignment and Tension	Done		RGASPARD	Jun 20, 2018 11:38:56 PM	No	
44,130	FRA Check Exhaust System	Done		RGASPARD	Jun 20, 2018 11:38:56 PM	No	
44,140	FRA Check Intake System	Done		RGASPARD	Jun 20, 2018 11:38:56 PM	No	
44,150	FRA Inspect Turbocharger	-	na	RGASPARD	Jun 20, 2018 11:38:56 PM	No	
44,160	FRA Inspect Power Steering and Hydraulic Fluid	Done		RGASPARD	Jun 20, 2018 11:38:57 PM	No	
44,170	FRA Check All Engine or Belt Driven Components	Done		RGASPARD	Jun 20, 2018 11:38:56 PM	No	
44,180	FRA Check for Leaks	Done		RGASPARD	Jun 20, 2018 11:38:57 PM	No	
44,190	FRA Perform Battery Inspection	Done		RGASPARD	Jun 20, 2018 11:38:57 PM	No	
44,200	FRA Check Battery Box Corrosion, Cables and Hold-Downs	Done		RGASPARD	Jun 20, 2018 11:38:57 PM	No	
50,000	SECTION 5 Steering System Inspection	Done		RGASPARD	Jun 20, 2018 11:38:57 PM	No	
50,510	Check Entire Steering System	Done		RGASPARD	Jun 20, 2018 11:38:57 PM	No	
60,000	SECTION 6 Tires and Wheel Inspection	Done		RGASPARD	Jun 20, 2018 11:38:57 PM	No	
60,610	FRA Check and Record Air Pressure	Done		RGASPARD	Jun 20, 2018 11:38:58 PM	No	
60,611	Air Pressure RF	70 Pounds per Square Inch		RGASPARD	Jun 20, 2018 11:38:58 PM	No	
60,612	Air Pressure LF	70 Pounds per Square Inch		RGASPARD	Jun 20, 2018 11:38:58 PM	No	
60,613	Air Pressure RRO	65 Pounds per Square Inch		RGASPARD	Jun 20, 2018 11:38:58 PM	No	

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
60,614	Air Pressure RRI	65 Pounds per Square Inch		RGASPARD	Jun 20, 2018 11:38:58 PM	No	
60,615	Air Pressure LRI	65 Pounds per Square Inch		RGASPARD	Jun 20, 2018 11:38:58 PM	No	
60,616	Air Pressure LRO	65 Pounds per Square Inch		RGASPARD	Jun 20, 2018 11:38:58 PM	No	
60,620	Check Valve Stems and Caps	Done		RGASPARD	Jun 20, 2018 11:38:58 PM	No	
60,630	Check and Record Tread Depth	Done		RGASPARD	Jun 20, 2018 11:38:59 PM	No	
60,631	Tread Depth RF	7 32nds of an inch		RGASPARD	Jun 20, 2018 11:38:59 PM	No	
60,632	Tread Depth LF	8 32nds of an inch		RGASPARD	Jun 20, 2018 11:38:59 PM	No	
60,633	Tread Depth RRO	7 32nds of an inch		RGASPARD	Jun 20, 2018 11:38:59 PM	No	
60,634	Tread Depth RRI	8 32nds of an inch		RGASPARD	Jun 20, 2018 11:38:59 PM	No	
60,635	Tread Depth LRI	10 32nds of an inch		RGASPARD	Jun 20, 2018 11:38:59 PM	No	
60,636	Tread Depth LRO	10 32nds of an inch		RGASPARD	Jun 20, 2018 11:38:59 PM	No	
60,640	Check for Mismatched Tread or Casing Design	Done		RGASPARD	Jun 20, 2018 11:39:00 PM	No	
60,650	Check Sidewall Wear	Done		RGASPARD	Jun 20, 2018 11:39:00 PM	No	
60,660	Inspect for Cuts and Tears	Done		RGASPARD	Jun 20, 2018 11:39:00 PM	No	
60,670	Check Dual Mating With Square	Done		RGASPARD	Jun 20, 2018 11:39:00 PM	No	
60,680	Check Wheels for Cracks and Loose Lugs	Done		RGASPARD	Jun 20, 2018 11:39:00 PM	No	
60,690	Check Tires for Irregular or Alignment Wear	Done		RGASPARD	Jun 20, 2018 11:39:01 PM	No	
66,100	FRA Check Outer Hubs for Leaks	Done		RGASPARD	Jun 20, 2018 11:39:01 PM	No	
70,000	SECTION 7 Under Vehicle Inspection	Done		RGASPARD	Jun 20, 2018 11:39:01 PM	No	
70,710	Check Vibration Damper	Done		RGASPARD	Jun 20, 2018 11:39:01 PM	No	
70,720	Check Engine and Transmission Mounts	Done		RGASPARD	Jun 20, 2018 11:39:01 PM	No	
70,730	FRA Check Starter	Done		RGASPARD	Jun 20, 2018 11:39:01 PM	No	
70,740	FRA Check Bottom of Engine for Fluid Leaks	Done		RGASPARD	Jun 20, 2018 11:39:01 PM	No	
70,750	FRA Check Transmission for Leaks	Done		RGASPARD	Jun 20, 2018 11:39:01 PM	No	
70,760	FRA Check Differential Breather and Fluid	Done		RGASPARD	Jun 20, 2018 11:39:02 PM	No	
70,770	FRA Check Exhaust System	Done		RGASPARD	Jun 20, 2018 11:39:02 PM	No	
70,780	Check Driveline, U-joint and Slip Yokes	Done		RGASPARD	Jun 20, 2018 11:39:02 PM	No	
70,790	Check All Body Mounts and Chassis Frame	Done		RGASPARD	Jun 20, 2018	No	

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
					11:39:02 PM		
77,100	FRA Check Security, Integrity and Length of Ground Straps	Done		RGASPARD	Jun 20, 2018 11:39:03 PM	No	
77,110	FRA Check Fuel Tank	Done		RGASPARD	Jun 20, 2018 11:39:03 PM	No	
77,120	Check Suspension Components	Done		RGASPARD	Jun 20, 2018 11:39:03 PM	No	
77,130	FRA Check Brake Pad Thickness and Rotor for Wear	Done		RGASPARD	Jun 20, 2018 11:39:03 PM	No	
77,131	Brake Pad Thickness LF	8 Inch		RGASPARD	Jun 20, 2018 11:39:03 PM	No	
77,132	Brake Pad Thickness RF	8 Inch		RGASPARD	Jun 20, 2018 11:39:03 PM	No	
77,133	Brake Pad Thickness LR	4 Inch		RGASPARD	Jun 20, 2018 11:39:03 PM	No	
77,134	Brake Pad Thickness RR	4 Inch		RGASPARD	Jun 20, 2018 11:39:03 PM	No	
77,135	Brake Rotor LF	38 Inch		RGASPARD	Jun 20, 2018 11:39:04 PM	No	
77,136	Brake Rotor RF	38 Inch		RGASPARD	Jun 20, 2018 11:39:04 PM	No	
77,137	Brake Rotor LR	40 Inch		RGASPARD	Jun 20, 2018 11:39:04 PM	No	
77,138	Brake Rotor RR	40 Inch		RGASPARD	Jun 20, 2018 11:39:04 PM	No	
77,140	FRA Check Brake Hoses	Done		RGASPARD	Jun 20, 2018 11:39:04 PM	No	
77,150	Check King Pins	-	na	RGASPARD	Jun 20, 2018 11:39:05 PM	No	
77,160	FRA Check for Loose or Noisy Wheel Bearings	Done		RGASPARD	Jun 20, 2018 11:39:05 PM	No	
80,000	SECTION 8 PMI Report Completion	Done		RGASPARD	Jun 20, 2018 11:39:05 PM	No	
80,810	Completion of PMI Report	Done		RGASPARD	Jun 20, 2018 11:39:05 PM	No	
90,000	SECTION 9 Completion of PMI	Done		RGASPARD	Jun 20, 2018 11:39:05 PM	No	
90,910	Vehicle Returned to predetermined location	Done		RGASPARD	Jun 20, 2018 11:39:05 PM	No	

LH: 20 Desc: PM B

Task: PM B SERVICE Performed by: RGASPARD Performed on: 20-JUN-18

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
100,000	"A" PMI SERVICING ITEMS	Done		RGASPARD	Jun 20, 2018 11:40:10 PM	No	
101,000	FRA Change Oil Filters	Yes		RGASPARD	Jun 20, 2018 11:40:10 PM	No	
102,000	FRA Drain Engine Oil	Yes		RGASPARD	Jun 20, 2018 11:40:10 PM	No	
103,000	FRA Check Transmission Fluid	Done		RGASPARD	Jun 20, 2018 11:40:10 PM	No	
104,000	Lubricate Chassis	-	na	RGASPARD	Jun 20, 2018 11:40:11 PM	No	
105,000	Replace or Clean A/C Filters	Done		RGASPARD	Jun 20, 2018	No	

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
					11:40:11 PM		
107,000	FRA Change Primary Fuel Filter	No	na	RGASPARD	Jun 20, 2018 11:40:11 PM	No	
108,000	Lube all pivoting Mechanisms	Done		RGASPARD	Jun 20, 2018 11:40:10 PM	No	
200,000	"B" PMI SERVICING ITEMS (12 MONTH)	Done		RGASPARD	Jun 20, 2018 11:40:11 PM	No	
201,000	Service Crankcase Breather	Done		RGASPARD	Jun 20, 2018 11:40:11 PM	No	
203,000	FRA Change Automatic Transmission Fluid	No		RGASPARD	Jun 20, 2018 11:40:11 PM	No	
204,000	FRA Change Power Steering Fluid and Filter	No		RGASPARD	Jun 20, 2018 11:40:11 PM	No	
205,000	Complete Engine Diagnostics and Clear Codes when Completed	Done		RGASPARD	Jun 20, 2018 11:40:11 PM	No	

LH: 30 Desc: PRAMETER

Task: PRA and Meter Readings Performed by: RGASPARD Performed on: 20-JUN-18

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
10	Have you successfully completed the Personal Risk Assessment?	Done		RGASPARD	Jun 20, 2018 11:40:38 PM	No	
20	Miles					No	
30	Kilometers					No	
40	Hours					No	



WorkOrder
55345 Palm Tran Connection
v 2.2
Page 1 of 9



WorkOrder: 51870025
Invoice Number: 55345-51870025

Client Department:

MRC: 55345M
WO Desc:
PM B
Requested By: RGASPARD
Created By: RGASPARD
Class: WO
Arrangement: Unassigned
Potential Warranty: No

Equipment: 4514-P
Ford E450 Champion Challenger
1FDFE4FS7EDB17176
VIN:
Status: 32
Priority: 1
Driver:
Phone:
ETA:

Chronology		
Reported	Nov 28, 2018	10:49 AM
Started	Nov 28, 2018	
Completed	Nov 28, 2018	11:51 PM
Down Time		

Meter	Reading	UOM
WO		DH
Life	138,592	DH

WorkOrder Notes

Line	Comment
10	COMPLAINT: PMB Service CAUSE: Service due by Mileage.. CORRECTION: Change Oil & Filter. Lube All Pivoting Points. Check Brakes ,Clean batteries . Replace Air Filter. Parts# B329 Qty (1) Parts#PA4075 Qty (1) Oil 5W20 Qty (7,0) Qt

Activity: 10 **999 TOTAL VEHICLE**
Activity Note: Light Medium Duty PMI
Reason for Repair: 08 - Preventive Maintenance
Work Accomplished: 06 - Inspect
Part Failure: -

Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
------	-------------	-------------	------	------	----------

Labor Posted

Date	Technician	Hours	Rate	Extended
28-Nov-18	Arthurs,Durvin	2.00	0.00	0.00

Activity 10 Sub Total

Parts: 0.00
Labor: 0.00
Labor Hours: 2.00
Sublet Parts: 0.00
Sublet Labor: 0.00
Activity Sub Total 0.00

Activity: 20 **999 TOTAL VEHICLE**
Activity Note: PM B
Reason for Repair: 08 - Preventive Maintenance
Work Accomplished: B - PM Level B
Part Failure: -

Activity Comments

Parts Issued



WorkOrder
55345 Palm Tran Connection
v 2.2
Page 1 of 9



WorkOrder: 52340366
Invoice Number: 55345-52340366

Client Department:

MRC: 55345M
WO Desc: PM B
Requested By: TDELVA
Created By: TDELVA
Class: WO
Arrangement: Unassigned
Potential Warranty: No

Equipment: 4514-P
Ford E450 Champion Challenger
VIN: 1FDFE4FS7EDB17176
Status: 40
Priority: 1
Driver:
Phone:
ETA:

Chronology		
Reported	May 14, 2019	12:00 AM
Started		
Completed	May 16, 2019	11:04 AM
Down Time		

Meter	Reading	UOM
WO		DH
Life	165,502	DH
System	165,484	DH

WorkOrder Notes

Line	Comment
10	COMPLAINT:pmB Service CAUSE: preventive maintenance CORRECTION:perform pmB

Activity: 10 **999 - TOTAL VEHICLE**
Activity Note: Light Medium Duty PMI
Reason for Repair: 08 - Preventive Maintenance
Work Accomplished: 06 - Inspect
Part Failure: -

Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
------	-------------	-------------	------	------	----------

Labor Posted

Date	Technician	Hours	Rate	Extended
------	------------	-------	------	----------

Activity 10 Sub Total

Parts: 0.00
Labor: 0.00
Labor Hours: 0.00
Sublet Parts: 0.00
Sublet Labor: 0.00
Activity Sub Total 0.00

Activity: 20 **999 - TOTAL VEHICLE**
Activity Note: PM B
Reason for Repair: 08 - Preventive Maintenance
Work Accomplished: B - PM Level B
Part Failure: -

Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
16-May-19	B329(F)	FILTER, OIL SAME AS LF3681	1.00	1.96	1.96

Labor Posted



WorkOrder
55345 Palm Tran Connection
v 2.2
Page 1 of 9



WorkOrder: 52878022
Invoice Number: 55345-52878022

Client Department:

MRC: 55345M

Equipment: 4514-P

WO Desc:

Ford E450 Champion Challenger

PM B

VIN: 1FDFE4FS7EDB17176

Requested By:

RRENE

Status: 40

Created By:

RRENE

Priority: 1

Class:

WO

Driver:

Arrangement:

Unassigned

Phone:

Potential Warranty:

No

ETA:

Chronology		
Reported	Nov 5, 2019	12:00 AM
Started		
Completed	Nov 6, 2019	10:19 AM
Down Time		

Meter	Reading	UOM
WO		DH
Life	192,124	DH
System	192,124	DH

WorkOrder Notes

Line	Comment
10	COMPLAINT:PMB Service
	CAUSE:preventive maintenance
	CORRECTION: Performed and completed PMB Service

Activity: 10



999 TOTAL VEHICLE

Activity Note: Light Medium Duty PMI

Reason for Repair: 08 - Preventive Maintenance

Work Accomplished: 06 - Inspect

Part Failure: -

Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
------	-------------	-------------	------	------	----------

Labor Posted

Date	Technician	Hours	Rate	Extended
------	------------	-------	------	----------

Activity 10 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours: 0.00	
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00

Activity: 20



999 TOTAL VEHICLE

Activity Note: PM B

Reason for Repair: 08 - Preventive Maintenance

Work Accomplished: B - PM Level B

Part Failure: -

Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
06-Nov-19	B329(F)	FILTER, OIL SAME AS LF3681	1.00	1.96	1.96

Labor Posted



WorkOrder
55345 Palm Tran Connection
v 2.2
Page 1 of 10



WorkOrder: 53451043
Invoice Number: 55345-53451043

Client Department:

MRC: 55345M

WO Desc:

PM B

Requested By: NPIERRE-LOUIS

Created By: NPIERRE-LOUIS

Class: WO

Arrangement: Unassigned

Potential Warranty: No

Equipment: 4514-P

Ford E450 Champion Challenger

VIN: 1FDFE4FS7EDB17176

Status: 40

Priority: 1

Driver:

Phone:

ETA:

Chronology

Reported	May 18, 2020	11:44 AM
Started	May 19, 2020	
Completed	May 19, 2020	8:27 AM
Down Time		

Meter	Reading	UOM
WO		DH
Life	217,303	DH

WorkOrder Notes

Line	Comment
10	COMPLAINT: PMB CAUSE: preventive maintenance CORRECTION: Performed PMB service lube all pivoting point cross rotate tires completed

Activity: 5



999/999/999 TOTAL VEHICLE

Activity Note: PERSONAL RISK ASSESSMENT

Reason for Repair: SW - Shop Work Order

Work Accomplished: 06 - Inspect

Part Failure: 00 - No Failure

Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
------	-------------	-------------	------	------	----------

Labor Posted

Date	Technician	Hours	Rate	Extended
------	------------	-------	------	----------

Activity 5 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours: 0.00	
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00

Activity: 10



999/999/999 TOTAL VEHICLE

Activity Note: Light Duty PMI

Reason for Repair: 08 - Preventive Maintenance

Work Accomplished: -

Part Failure: -

Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
------	-------------	-------------	------	------	----------

Labor Posted

Date	Technician	Hours	Rate	Extended
------	------------	-------	------	----------



WorkOrder
55345 Palm Tran Connection
v 2.2
Page 1 of 11



WorkOrder: 54088359
Invoice Number: 55345-54088359

Client Department:

MRC: 55345M

Equipment: 4514-P

WO Desc:

55345-LIGHT DUTY PMB

Ford E450 Champion Challenger

Requested By:

RAUODRIGUEZ

VIN:

1FDFE4FS7EDB17176

Created By:

RAUODRIGUEZ

Status:

40

Class:

WO

Priority:

3

Arrangement:

Unassigned

Driver:

Phone:

Potential Warranty:

No

ETA:

Chronology

Reported	Jan 11, 2021	12:00 AM
Started	Jan 11, 2021	
Completed	Jan 12, 2021	12:28 AM

Down Time

Meter	Reading	UOM
WO		DH
Life	244,000	DH

WorkOrder Notes

Line	Comment
10	COMPLAINT: PMB CAUSE: Service CORRECTION: perform PMB Service Oil filter B329 Qty1 Engine oil 10w30 qty 7 qts Air filter PA4075 Qty1

Activity: 5



999/999/999 TOTAL VEHICLE

Activity Note:

PERSONAL RISK ASSESSMENT

Reason for Repair:

SW - Shop Work Order

Work Accomplished:

06 - Inspect

Part Failure:

00 - No Failure

Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
------	-------------	-------------	------	------	----------

Labor Posted

Date	Technician	Hours	Rate	Extended
------	------------	-------	------	----------

Activity 5 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours: 0.00	
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00

Activity: 10



079 DEVICES, SAFETY/STABILITY, TRAILER

Activity Note:

Light Duty PMI

Reason for Repair:

05 - Inspection, Routine

Work Accomplished:

-

Part Failure:

-

Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
11-Jan-21	PA4075	FILTER, AIR	1.00	5.28	5.28



WorkOrder
55345 Palm Tran Connection
v 2.2
Page 1 of 11



WorkOrder: 54682232
Invoice Number: 55345-54682232

Client Department:

MRC: 55345M
WO Desc: 55345-LIGHT DUTY PMB
Requested By: JUHURST
Created By: JUHURST
Class: WO
Arrangement: Unassigned
Potential Warranty: No

Equipment: 4514-P
Ford E450 Champion Challenger
VIN: 1FDPE4FS7EDB17176
Status: 40
Priority: 3
Driver:
Phone:
ETA:

Chronology		
Reported	Aug 9, 2021	12:00 AM
Started	Aug 11, 2021	
Completed	Aug 11, 2021	9:32 AM
Down Time		

Meter	Reading	UOM
WO		DH
Life	270,020	DH
System	269,822	DH

WorkOrder Notes

Line	Comment
10	COMPLAINT:PMB CAUSE: preventive maintenance CORRECTION: Performed service PMB service lube all pivoting point cross rotate tires completed

Activity: 5 **999/999/999 TOTAL VEHICLE**

Activity Note: PERSONAL RISK ASSESSMENT
Reason for Repair: SW - Shop Work Order
Work Accomplished: 06 - Inspect
Part Failure: 00 - No Failure

Activity Comments

Parts Issued

Date	Part Number		Description	Qty.	Each	Extended
------	-------------	--	-------------	------	------	----------

Labor Posted

Date	Technician	Hours	Rate	Extended
------	------------	-------	------	----------

Activity 5 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours: 0.00	
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00

Activity: 10

Activity Note: Light Duty PMI
Reason for Repair: -
Work Accomplished: -
Part Failure: -

Activity Comments

Parts Issued

Date	Part Number		Description	Qty.	Each	Extended
------	-------------	--	-------------	------	------	----------

Labor Posted

Date	Technician	Hours	Rate	Extended
------	------------	-------	------	----------



WorkOrder
55345 Palm Tran Connection
v 2.2
Page 1 of 11



WorkOrder: 55522428
Invoice Number: 55345-55522428

Client Department:

MRC:	55345M	Equipment:	4514-P
WO Desc:			Ford E450 Champion Challenger
55345-LIGHT DUTY PMB		VIN:	1FDFE4FS7EDB17176
Requested By:	DARTHURS	Status:	40
Created By:	DARTHURS	Priority:	3
Class:	WO	Driver:	
Arrangement:	Unassigned	Phone:	
Potential Warranty:	No	ETA:	

Chronology

Reported	May 11, 2022	12:00 AM
Started	May 13, 2022	
Completed	May 16, 2022	4:31 PM
Down Time		

Meter	Reading	UOM
WO		DH
Life	297,854	DH
System	297,583	DH

WorkOrder Notes

Line	Comment
10	PERFOMED PMB & SERVICE

Activity: 5 **999/999/999 TOTAL VEHICLE**

Activity Note: PERSONAL RISK ASSESSMENT
Reason for Repair: SW - Shop Work Order
Work Accomplished: 06 - Inspect
Part Failure: 00 - No Failure

Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
------	-------------	-------------	------	------	----------

Labor Posted

Date	Technician	Hours	Rate	Extended
------	------------	-------	------	----------

Activity 5 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours: 0.00	
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00

Activity: 10

Activity Note: Light Duty PMI
Reason for Repair: -
Work Accomplished: -
Part Failure: -

Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
------	-------------	-------------	------	------	----------

Labor Posted

Date	Technician	Hours	Rate	Extended
16-May-22	Junior Hurst	0.78	0.00	0.00
16-May-22	Junior Hurst	1.58	0.00	0.00



WorkOrder
55345 Palm Tran Connection
v 2.2
Page 2 of 11



WorkOrder: 55522428
Invoice Number: 55345-55522428

Client Department:

MRC: 55345M
WO Desc: 55345-LIGHT DUTY PMB
Requested By: DARTHURS
Created By: DARTHURS
Class: WO
Arrangement: Unassigned
Potential Warranty: No

Equipment: 4514-P
Ford E450 Champion Challenger
VIN: 1FDFE4FS7EDB17176
Status: 40
Priority: 3
Driver:
Phone:
ETA:

Activity 10 Sub Total

Parts: 0.00
Labor: 0.00
Labor Hours: 2.36
Sublet Parts: 0.00
Sublet Labor: 0.00
Activity Sub Total 0.00

Activity: 20 **999 TOTAL VEHICLE**

Activity Note: PM B
Reason for Repair: 08 - Preventive Maintenance
Work Accomplished: B - PM Level B
Part Failure: -

Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
17-May-22	B329	FILTER, OIL, SPIN-ON	1.00	1.99	1.99

Labor Posted

Date	Technician	Hours	Rate	Extended
16-May-22	Junior Hurst	0.25	0.00	0.00

Activity 20 Sub Total

Parts: 1.99
Labor: 0.00
Labor Hours: 0.25
Sublet Parts: 0.00
Sublet Labor: 0.00
Activity Sub Total 1.99

WorkOrder 55522428 Grand Total

Parts: 1.99
Labor: 0.00
Labor Hours: 2.61
Sublet Parts: 0.00
Sublet Labor: 0.00
WorkOrder Grand Total 1.99

Recent Repair History

WorkOrder	Date Completed	Life Meter	Class	Description
55522428	16-May-22	297,854	WO	55345-LIGHT DUTY PMB
55480015	13-May-22	290,533	WO	VEHICLE HAS SCRATCHES ON LEFT SIDE AREA
55428153	14-Apr-22	292,927	WO	55345-LIGHT DUTY PMA

Scheduled Preventative Maintenance



WorkOrder
55345 Palm Tran Connection
v 2.2
Page 3 of 11



WorkOrder: 55522428
Invoice Number: 55345-55522428

Client Department:

MRC: 55345M

WO Desc:

55345-LIGHT DUTY PMB

Requested By: DARTHURS

Created By: DARTHURS

Class: WO

Arrangement: Unassigned

Potential Warranty: No

Equipment: 4514-P

VIN: Ford E450 Champion Challenger

Status: 1FDFE4FS7EDB17176

Priority: 40

Driver: 3

Phone:

ETA:

Nest	PM	WorkOrder	Due Date	Due Life Meter	Due Meter Reading	Due Life Meter 2	Due Meter Reading 2
------	----	-----------	----------	-------------------	----------------------	---------------------	------------------------

Other Open Repairs

WorkOrder8	Date Reported	Life Meter	Class	Description
55480015	31-Mar-22	290,533	WO	VEHICLE HAS SCRATCHES ON LEFT SIDE AREA

PH: Work Order: 55522428 Desc: 55345-LIGHT DUTY PMB**Equip: 4514-P Desc: Ford E450 Champion Challenger VIN: 1FDFE4FS7EDB17176****LH: 10 Desc: Light Duty PMI****Task: First Transit North America Light Duty PM Inspection Sheet Performed by: JUHURST Performed on: 16-MAY-22**

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
10,000	SECTION 1 - Preparation Inspection	Done		JUHURST	May 16, 2022 1:54:03 PM	No	
10,100	INSPECT_Auto-Transmission Operation/Controller; Neutral Safety Switch	Done		JUHURST	May 16, 2022 1:54:08 PM	No	
10,200	!FRA!INSPECT_Starter Operation	Done		JUHURST	May 16, 2022 3:20:13 PM	No	
10,300	!FRA!INSPECT_Warning Lights and Alarms	Done		JUHURST	May 16, 2022 3:20:19 PM	No	
10,400	!FRA!INSPECT_Back Up Alarm	Done		JUHURST	May 16, 2022 3:20:30 PM	No	
10,500	!FRA!INSPECT_Engine Operation, OBSERVE_ Exhaust for Excessive Smoke	Done		JUHURST	May 16, 2022 3:20:44 PM	No	
10,600	Check Driver's Pre-trip or DVIR/EVIR & Authorization Forms	Done		JUHURST	May 16, 2022 3:21:05 PM	No	
10,700	INSPECT_All Exterior Lights (Turn on until Completion of this section)	Done		JUHURST	May 16, 2022 3:21:21 PM	No	
10,800	*RPT*INSPECT_Body Damage, Corrosion;DOCUMENT_Issues	Done		JUHURST	May 16, 2022 3:21:30 PM	No	
10,900	INSPECT_Fuel Tank Cap, and Doors	Done		JUHURST	May 16, 2022 3:21:45 PM	No	
11,100	INSPECT_License Plate, Bracket, Bumpers	Done		JUHURST	May 16, 2022 3:21:46 PM	No	
20,000	SECTION 2 - Test Drive and Operator Area Inspection	Done		JUHURST	May 16, 2022 3:22:11 PM	No	
20,100	INSPECT_Driver Seat condition/operation/seatbelt	Done		JUHURST	May 16, 2022 3:22:11 PM	No	
20,200	TEST DRIVE_INSPECT_Proper Operation; Drive into Shop	Done		JUHURST	May 16, 2022 3:25:18 PM	No	
20,300	*RPT*INSPECT_Steering Wheel for Play/Bind/Horn Op./Turn Signal Cancelation	Done	right front signal need change	JUHURST	May 16, 2022 3:27:39 PM	Yes	55612053
20,400	PERFORM_Brake Test (Apply hard enough to check wheel pull and Application)	Done		JUHURST	May 16, 2022 3:28:04 PM	No	
20,500	*RPT*FRA INSPECT_Lighting/Operation of all Gauges	Done		JUHURST	May 16, 2022 3:28:15 PM	No	
20,600	*RPT*INSPECT_Windshields, Sun Visors	Done		JUHURST	May 16, 2022 3:44:22 PM	No	
20,700	INSPECT_Wiper/Washer Operation, Condition	Done		JUHURST	May 16, 2022 3:44:17 PM	No	
20,800	INSPECT_High Idle Control	Done		JUHURST	May 16, 2022 3:44:41 PM	No	
20,900	*RPT*!FRA!INSPECT_HVAC Controls, Operation	Done		JUHURST	May 16, 2022 3:44:47 PM	No	
21,000	*RPT*!FRA!INSPECT_Operation of all Switches and Accessories	Done		JUHURST	May 16, 2022 3:44:58 PM	No	
21,100	INSPECT_Parking Brake Operation	Done		JUHURST	May 16, 2022 3:45:14 PM	No	
21,200	!FRA!TEST_Service Brake Backup System (Stationary Brake Tests HYD)	Done		JUHURST	May 16, 2022 3:45:22 PM	No	
21,300	INSPECT_VIN, Tire Pressure Decal, Data Tags	Done		JUHURST	May 16, 2022	No	

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
					3:45:30 PM		
21,400	*RPT*INSPECT_Drivers Door Hinges, Handles, Controls and Panels	Done		JUHURST	May 16, 2022 3:45:40 PM	No	
21,500	!FRA!INSPECT_Under Dash Wiring for Proper Routing/Chafing/Securement	Done		JUHURST	May 16, 2022 3:45:51 PM	No	
21,550	INSPECT_Driver Floor Area for Rust/Water Leaks	Done		JUHURST	May 16, 2022 3:45:57 PM	No	
21,600	*RPT*INSPECT for WEAR_Pedal Pads, Accelerator, Brake, Parking Brake	Done		JUHURST	May 16, 2022 3:46:06 PM	No	
21,700	INSPECT_Engine Fault Codes	Done		JUHURST	May 16, 2022 3:46:20 PM	No	
30,000	SECTION 3 - EXTERIOR INSPECTION - Front	Done		JUHURST	May 16, 2022 3:46:25 PM	No	
31,000	SSF (Street Side Front)	Done		JUHURST	May 16, 2022 3:46:30 PM	No	
31,010	*RPT*!FRA!INSPECT_Mirror Mountings, Brackets, Glass	Done		JUHURST	May 16, 2022 3:46:41 PM	No	
31,020	*RPT*INSPECT_FRONT Springs, Shocks, Spring Shackles	Done		JUHURST	May 16, 2022 3:46:47 PM	No	
31,030	INSPECT_Mud Flaps, Brackets	Done		JUHURST	May 16, 2022 3:47:46 PM	No	
31,040	INSPECT_Wiper Blades, Arms	Done		JUHURST	May 16, 2022 3:47:51 PM	No	
32,000	Engine Inspection	Done		JUHURST	May 16, 2022 3:47:56 PM	No	
32,010	INSPECT_Hood, Springs and Props	Done		JUHURST	May 16, 2022 3:48:00 PM	No	
32,020	!FRA!INSPECT_Engine Compartment Condition for Fire Risk Avoidance	Done		JUHURST	May 16, 2022 3:48:14 PM	No	
32,030	!FRA!INSPECT_for Fluid Leaks, Levels	Done		JUHURST	May 16, 2022 3:48:20 PM	No	
32,040	!FRA!INSPECT_Hyd_Brake Fluid with Test Strips	Done		JUHURST	May 16, 2022 3:48:27 PM	No	
32,050	!FRA!INSPECT_RECORD_Coolant Recovery with Refractometer; Test Strips	26 Degree Fahrenheit		JUHURST	May 16, 2022 3:49:11 PM	No	
32,060	PRESSURE TEST_Cooling Systems (Radiator, Cap, hoses and clamps)	Done		JUHURST	May 16, 2022 3:49:29 PM	No	
32,070	*RPT*INSPECT_Radiator and Mountings, Cores	Done		JUHURST	May 16, 2022 3:49:24 PM	No	
32,080	*RPT*INSPECT_Fan Assembly,Shroud,Tensioner,Belts,All Belt Driven Components	Done		JUHURST	May 16, 2022 3:49:49 PM	No	
32,090	*RPT*!FRA!INSPECT_Mounting, Installation of Alternator, AC Compressor	Done		JUHURST	May 16, 2022 3:50:01 PM	No	
32,100	INSPECT_Intake System	Done		JUHURST	May 16, 2022 3:55:52 PM	No	
32,140	*RPT*!FRA!RECORD_Underhood Battery Voltages (volts)	14 Volt*		JUHURST	May 16, 2022 3:56:07 PM	No	
33,010	CSF (Curb Side Front)	Done		JUHURST	May 16, 2022 3:56:23 PM	No	
33,020	*RPT*!FRA!INSPECT_Mirror Mountings, Brackets, Glass	Done		JUHURST	May 16, 2022 3:56:29 PM	No	
33,030	*RPT*INSPECT_FRONT Springs, Shocks, Spring Shackles	Done		JUHURST	May 16, 2022 3:56:35 PM	No	
33,040	INSPECT_Mud Flaps, Brackets	Done		JUHURST	May 16, 2022	No	

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
					3:56:41 PM		
33,050	INSPECT_Wiper Blades, Arms	Done		JUHURST	May 16, 2022 3:56:51 PM	No	
33,060	!FRA!INSPECT_LUBE_Battery Box, Batteries, Tray Slides, Hold Downs	Done		JUHURST	May 16, 2022 3:56:56 PM	No	
33,070	*RPT*!FRA!RECORD_Side Mounted Battery Voltages (volts)	14 Volt*		JUHURST	May 16, 2022 3:57:21 PM	No	
33,080	INSPECT_Entry door, OPEN_with external lock/switch (if equipped)	Done		JUHURST	May 16, 2022 3:57:26 PM	No	
40,000	SECTION 4 - Interior Inspection	Done		JUHURST	May 16, 2022 4:00:08 PM	No	
40,100	*RPT*INSPECT_Step-Well, Step-Tread, Hand Rails, Step-well Light	Done		JUHURST	May 16, 2022 4:01:23 PM	No	
40,200	INSPECT_Insurance/Registration/Regulatory Forms Dates	Done		JUHURST	May 16, 2022 4:01:30 PM	No	
40,250	INSPECT_Overhead Compartment for Water Leaks	Done		JUHURST	May 16, 2022 4:01:42 PM	No	
40,300	INSPECT_Safety Equipment, Fire Extinguisher/Suppression	Done		JUHURST	May 16, 2022 4:01:50 PM	No	
40,400	INSPECT_Camera Systems, Filter, Electrical Inputs/Outputs-SOP M038	Done		JUHURST	May 16, 2022 4:01:57 PM	No	
40,600	!FRA!CHECK for HOTSPOTS_Interior Elec Panel Fuses/Circuit Breakers/Connectors	Done		JUHURST	May 16, 2022 4:03:10 PM	No	
40,700	*RPT*INSPECT_Seats, Covering, Belts, Loose Cushions, Operation	Done		JUHURST	May 16, 2022 4:03:20 PM	No	
40,800	*RPT*!FRA!INSPECT_Interior Lights; Mirrors	Done		JUHURST	May 16, 2022 4:03:27 PM	No	
40,900	!FRA!INSPECT_Interior Cleanliness/Potential Projectiles	Done		JUHURST	May 16, 2022 4:03:46 PM	No	
41,000	INSPECT_All ADA Equip (Lift Seat Belt, floor hold Downs, Belts, Cover, Alarms)	Done		JUHURST	May 16, 2022 4:04:08 PM	No	
41,100	INSPECT_CLEAN_AC Filter	Done		JUHURST	May 16, 2022 4:04:20 PM	No	
41,200	INSPECT_Emergency Windows,Hatches,Doors,Alarms/Lights;CHECK_for Leaks	Done		JUHURST	May 16, 2022 4:04:15 PM	No	
41,300	*RPT*INSPECT_Interior Body, Floor, Stanchions	Done		JUHURST	May 16, 2022 4:04:32 PM	No	
41,400	*RPT*INSPECT_Passenger Doors, Glass, Seal	Done		JUHURST	May 16, 2022 4:04:39 PM	No	
50,000	SECTION 5 - UNDER VEHICLE INSPECTION	Done		JUHURST	May 16, 2022 4:04:53 PM	No	
50,100	*RPT*INSPECT_Steering components-Drag Link, Tie Rods ends and Steering Damper	Done		JUHURST	May 16, 2022 4:04:48 PM	No	
50,200	INSPECT_Ball Joint Play	Done		JUHURST	May 16, 2022 4:04:59 PM	No	
50,300	!FRA!INSPECT_Front Wheel Bearings for Play	Done		JUHURST	May 16, 2022 4:05:07 PM	No	
50,400	LUBE_All Chassis Components	Done		JUHURST	May 16, 2022 4:05:22 PM	No	
50,500	!FRA!CHANGE_Engine oil,filters	Done		JUHURST	May 16, 2022 4:05:27 PM	No	
50,700	INSPECT_Tire Condition	Done		JUHURST	May 16, 2022 4:09:48 PM	No	
50,800	INSPECT_Tire Valve Stems, Double Check Caps	Done		JUHURST	May 16, 2022	No	

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
					4:09:43 PM		
50,900	!FRA!INSPECT_Wheels for Cracks, Loose Lugs/Indicators, Outer Hub Leaks	Done		JUHURST	May 16, 2022 4:09:57 PM	No	
51,000	RECORD_LF-Tire Tread Depth (32nds)	13 32nds of an inch		JUHURST	May 16, 2022 4:10:18 PM	No	
51,100	RECORD_LF-Tire Air Pressure (psi)	65 Pounds per Square Inch		JUHURST	May 16, 2022 4:10:38 PM	No	
51,200	RECORD_RF-Tire Tread Depth (32nds)	13 32nds of an inch		JUHURST	May 16, 2022 4:10:47 PM	No	
51,300	RECORD_RF-Air Pressure (psi)	65 Pounds per Square Inch		JUHURST	May 16, 2022 4:10:52 PM	No	
51,400	!FRA!INSPECT_FRONT ABS Tone Rings, Sensors, Routing of Cables	Done		JUHURST	May 16, 2022 4:10:57 PM	No	
51,500	!FRA!INSPECT_Wheel Seals for Leaks	Done		JUHURST	May 16, 2022 4:11:52 PM	No	
51,600	!FRA!INSPECT_Front Brake Assemblies	Done		JUHURST	May 16, 2022 4:11:59 PM	No	
51,700	MEASURE_RECORD_LF - Brake Lining, Pad Thickness (32nds)	8 32nds of an inch		JUHURST	May 16, 2022 4:12:20 PM	No	
51,800	MEASURE_RECORD_RF - Brake Lining, Pad Thickness (32nds)	8 32nds of an inch		JUHURST	May 16, 2022 4:12:32 PM	No	
51,900	INSPECT VISUALLY_RECORD_LF Rotor Condition (inches)	1.299 Inch		JUHURST	May 16, 2022 4:13:00 PM	No	
52,000	INSPECT VISUALLY_RECORD_RF Rotor Condition (inches)	1.299 Inch		JUHURST	May 16, 2022 4:13:15 PM	No	
52,100	INSPECT_Vibration Damper	Done		JUHURST	May 16, 2022 4:13:20 PM	No	
52,200	!FRA!INSPECT_Battery Cable Routing from Battery Box to Starter	Done		JUHURST	May 16, 2022 4:13:26 PM	No	
52,400	!FRA!INSPECT_Starter Mounting	Done		JUHURST	May 16, 2022 4:13:32 PM	No	
52,500	!FRA!INSPECT_Engine Exhaust System	Done		JUHURST	May 16, 2022 4:13:37 PM	No	
52,700	INSPECT_Engine, Transmission Mounts	Done		JUHURST	May 16, 2022 4:13:42 PM	No	
52,800	!FRA!INSPECT_Engine, Transmission for Fluid Leaks	Done		JUHURST	May 16, 2022 4:13:50 PM	No	
52,900	INSPECT_Shift Cable Adjustment - All Transmissions	Done		JUHURST	May 16, 2022 4:13:55 PM	No	
53,000	!FRA!INSPECT_Transmission Breather and Clean	Done		JUHURST	May 16, 2022 4:14:02 PM	No	
53,100	*RPT*!FRA!INSPECT_Parking Brake Cables, Shoes for Wear, Contamination	Done		JUHURST	May 16, 2022 4:14:08 PM	No	
53,200	*RPT*INSPECT_A/C Condensor, Fans, Safety Grills	Done		JUHURST	May 16, 2022 4:14:16 PM	No	
53,300	*RPT*INSPECT_Driveline, Hanger Bearings, U-Joints, Slip Joints, Safety Loop	Done		JUHURST	May 16, 2022 4:14:23 PM	No	
53,400	*RPT*INSPECT_All Body Mounts and Chassis Frame for Corrosion, Cracks	Done		JUHURST	May 16, 2022 4:14:30 PM	No	
53,500	!FRA!INSPECT_Fuel Tank, Mountings, Lines	Done		JUHURST	May 16, 2022 4:14:41 PM	No	
53,600	INSPECT_Tire Condition	Done		JUHURST	May 16, 2022 4:14:45 PM	No	
53,700	INSPECT_Tire Valve Stems, Double Check Caps	Done		JUHURST	May 16, 2022 4:14:50 PM	No	

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
53,800	INSPECT_ Mismatched Tire Tread, Casing Design	Done		JUHURST	May 16, 2022 4:15:00 PM	No	
53,900	INSPECT_Dual Mating Tires w/Square	Done		JUHURST	May 16, 2022 4:14:55 PM	No	
54,000	!FRA!INSPECT_Wheels for Cracks, Loose Lugs/Indicators, Outer Hub Leaks	Done		JUHURST	May 16, 2022 4:15:13 PM	No	
54,100	INSPECT_Mud Flaps, Brackets	Done		JUHURST	May 16, 2022 4:15:08 PM	No	
54,200	RECORD_RRO-Tire Tread Depth (32nds)	6 32nds of an inch		JUHURST	May 16, 2022 4:15:31 PM	No	
54,300	RECORD_RRI-Tire Tread Depth (32nds)	6 32nds of an inch		JUHURST	May 16, 2022 4:15:37 PM	No	
54,400	RECORD_RRO-Air Pressure (psi)	65 Pounds per Square Inch		JUHURST	May 16, 2022 4:15:49 PM	No	
54,500	RECORD_RRI-Air Pressure (psi)	65 Pounds per Square Inch		JUHURST	May 16, 2022 4:15:54 PM	No	
54,600	RECORD_LRO-Tire Tread Depth (32nds)	6 32nds of an inch		JUHURST	May 16, 2022 4:16:09 PM	No	
54,700	RECORD_LRI-Tire Tread Depth (32nds)	6 32nds of an inch		JUHURST	May 16, 2022 4:16:16 PM	No	
54,800	RECORD_LRO-Air Pressure (psi)	65 Pounds per Square Inch		JUHURST	May 16, 2022 4:16:23 PM	No	
54,900	RECORD_LRI-Air Pressure (psi)	65 Pounds per Square Inch		JUHURST	May 16, 2022 4:16:32 PM	No	
55,000	!FRA!INSPECT_ REAR Brake Assemblies	Done		JUHURST	May 16, 2022 4:16:37 PM	No	
55,100	!FRA!INSPECT_ REAR Hubs, Wheel Seals for Oil Leaks	Done		JUHURST	May 16, 2022 4:16:47 PM	No	
55,200	!FRA!INSPECT_REAR ABS Tone Rings, Sensors, Routing Of Cables (if equipped)	Done		JUHURST	May 16, 2022 4:16:52 PM	No	
55,300	MEASURE_RECORD_LR - Brake Lining, Pad Thickness (32nds)	10 32nds of an inch		JUHURST	May 16, 2022 4:17:18 PM	No	
55,400	MEASURE_RECORD_RR - Brake Lining, Pad Thickness (32nds)	10 32nds of an inch		JUHURST	May 16, 2022 4:17:30 PM	No	
55,500	INSPECT VISUALLY_MEASURE_RECORD_LR Drum, Rotor Condition (inches)	1.269 Inch		JUHURST	May 16, 2022 4:17:48 PM	No	
55,600	INSPECT VISUALLY_MEASURE_RECORD_RR Drum, Rotor Condition (inches)	1.269 Inch		JUHURST	May 16, 2022 4:18:00 PM	No	
55,700	!FRA!INSPECT_ Under Body Exhaust System	Done		JUHURST	May 16, 2022 4:18:04 PM	No	
55,800	*RPT*INSPECT_ REAR Axle Housing, Breather; CLEAN_Breather	Done		JUHURST	May 16, 2022 4:18:24 PM	No	
55,900	*RPT*INSPECT_ REAR Springs, Shocks, Suspension, Airbags	Done		JUHURST	May 16, 2022 4:18:49 PM	No	
60,000	SECTION 6 - Wheelchair Inspection	Done		JUHURST	May 16, 2022 4:18:44 PM	No	
60,100	RECORD_Wheelchair Cycle Count	14255 Cycles		JUHURST	May 16, 2022 4:19:05 PM	No	
60,200	CHECK_ Lift Access Door for Ease of Opening,Latch Security,Door Hold Back	Done		JUHURST	May 16, 2022 4:19:10 PM	No	
60,300	CHECK_Platform Emergency Release Mechanism for Ease of Operation	Done		JUHURST	May 16, 2022 4:19:15 PM	No	
60,400	OPERATE_Lift thru Complete Cycle;CHECK_Noises,Jerky Op,Too Fast-Slow,Drift Down	Done		JUHURST	May 16, 2022 4:19:21 PM	No	

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
60,500	INSPECT_ Bridgeplate Operation	Done		JUHURST	May 16, 2022 4:19:50 PM	No	
60,600	INSPECT_All Pivot Points for Wear and Looseness	Done		JUHURST	May 16, 2022 4:19:55 PM	No	
60,700	INSPECT_Rollers for Wear and Smooth Rotation	Done		JUHURST	May 16, 2022 4:20:03 PM	No	
60,800	INSPECT_Operation of Platform Barrier Mechanism	Done		JUHURST	May 16, 2022 4:20:08 PM	No	
60,900	INSPECT_Cam Slots for Wear and Proper Alignment	Done		JUHURST	May 16, 2022 4:20:13 PM	No	
61,000	INSPECT_Cable Condition (If Applicable)	Done		JUHURST	May 16, 2022 4:20:20 PM	No	
61,100	INSPECT_Hydraulic Hoses for Leaks, Chafing or Cracks	Done		JUHURST	May 16, 2022 4:20:25 PM	No	
61,200	INSPECT_Electrical Connections and Routing of Wires and Cables	Done		JUHURST	May 16, 2022 4:20:29 PM	No	
61,300	INSPECT_Operation and Adjustment of All Safety Switches	Done		JUHURST	May 16, 2022 4:20:34 PM	No	
61,400	INSPECT_All Lift Mounting Brackets for Loose Bolts Broken Welds, etc.	Done		JUHURST	May 16, 2022 4:20:39 PM	No	
61,500	INSPECT_Manual Back-up Raise/Lower System (If Applicable)	Done		JUHURST	May 16, 2022 4:20:44 PM	No	
61,600	INSPECT_HydrPump Reservoir Oil Level. Consult SrvManual for Fluid to Use.	Done		JUHURST	May 16, 2022 4:20:48 PM	No	
61,700	CHECK_Operator Decals for Proper Positioning;CONSULT_Service Manual	Done		JUHURST	May 16, 2022 4:20:53 PM	No	
61,800	CHECK_WC Holddowns Inside Vehicle for Secure Mounting,Proper Operation	Done		JUHURST	May 16, 2022 4:20:58 PM	No	
61,900	CLEAN_Linkages and Mechanisms	Done		JUHURST	May 16, 2022 4:21:03 PM	No	
62,000	LUBRICATE_Linkages and Mechanisms (DO NOT OVER Lubricate)	Done		JUHURST	May 16, 2022 4:21:08 PM	No	
62,100	INSPECT_Emergency Platform Release Mechanism	Done		JUHURST	May 16, 2022 4:21:18 PM	No	
62,200	INSPECT_Platform Barrier Latch Mechanism	Done		JUHURST	May 16, 2022 4:21:23 PM	No	
62,300	INSPECT_Bridgeplate Hinge	Done		JUHURST	May 16, 2022 4:21:29 PM	No	
62,400	INSPECT_All Pivot Points	Done		JUHURST	May 16, 2022 4:21:39 PM	No	
62,500	INSPECT_Cams and Slots	Done		JUHURST	May 16, 2022 4:21:34 PM	No	
62,600	INSPECT_Rollers	Done		JUHURST	May 16, 2022 4:21:53 PM	No	
62,700	INSPECT_All Linkages	Done		JUHURST	May 16, 2022 4:21:49 PM	No	
70,000	SECTION 7 - ALTERNATIVE FUELS INSPECTION	Done		JUHURST	May 16, 2022 4:22:05 PM	No	
70,300	INSPECT_Condition of Fuel Pressure Gauge	Done		JUHURST	May 16, 2022 4:22:00 PM	No	
70,400	PROVIDE PROOF_Tank_Dents/Scratches and Re-Certification	Done		JUHURST	May 16, 2022 4:22:19 PM	No	
70,500	INSPECT_Tank test date, labels-Reference-ST.4 FMMVSS 304 & ANSI-CSA NGV2	Done		JUHURST	May 16, 2022 4:22:14 PM	No	
70,600	INSPECT_ Tank Lines to Ensure Secure	Done		JUHURST	May 16, 2022	No	

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
	Mounting, Insulation Against Vibration				4:22:27 PM		
70,700	INSPECT_ Filling Nozzle for Securely Fitting Cap	Done		JUHURST	May 16, 2022 4:22:31 PM	No	
70,800	INSPECT_ Pressure Relief Device's Venting System, Valves, Ducting to MNFR Specs	Done		JUHURST	May 16, 2022 4:22:44 PM	No	
80,000	SECTION 8 - PMI Report Completion	Done		JUHURST	May 16, 2022 4:22:55 PM	No	
80,100	COMPLETE_PM Report; Follow-ups	Done		JUHURST	May 16, 2022 4:22:50 PM	No	
80,200	RETURN_Vehicle to Predetermined Location	Done		JUHURST	May 16, 2022 4:23:05 PM	No	

LH: 20 Desc: PM B

Task: PM B SERVICE Performed by: JUHURST Performed on: 16-MAY-22

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
100,000	"A" PMI SERVICING ITEMS	Done		JUHURST	May 16, 2022 3:29:04 PM	No	
101,000	FRA Change Oil Filters	Yes		JUHURST	May 16, 2022 3:29:32 PM	No	
102,000	FRA Drain Engine Oil	Yes		JUHURST	May 16, 2022 3:29:46 PM	No	
103,000	FRA Check Transmission Fluid	Done		JUHURST	May 16, 2022 3:29:59 PM	No	
104,000	Lubricate Chassis	Done		JUHURST	May 16, 2022 3:30:03 PM	No	
105,000	Replace or Clean A/C Filters	Done		JUHURST	May 16, 2022 3:30:19 PM	No	
107,000	FRA Change Primary Fuel Filter	Yes		JUHURST	May 16, 2022 3:30:25 PM	No	
108,000	Lube all pivoting Mechanisms	Done		JUHURST	May 16, 2022 3:33:49 PM	No	
200,000	"B" PMI SERVICING ITEMS (12 MONTH)	Done		JUHURST	May 16, 2022 3:33:56 PM	No	
201,000	Service Crankcase Breather	Done		JUHURST	May 16, 2022 3:34:03 PM	No	
203,000	FRA Change Automatic Transmission Fluid	No		JUHURST	May 16, 2022 3:35:05 PM	No	
204,000	FRA Change Power Steering Fluid and Filter	Yes		JUHURST	May 16, 2022 3:35:23 PM	No	
205,000	Complete Engine Diagnostics and Clear Codes when Completed	Done		JUHURST	May 16, 2022 3:35:45 PM	No	

LH: 5 Desc: PERSONAL RISK ASSESSMENT

Task: PRA and Meter Readings Performed by: JUHURST Performed on: 16-MAY-22

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
1	Are you properly trained to perform the task?	Done		JUHURST	May 16, 2022 1:50:45 PM	No	
2	If task requires lifting, are lifts secured, are jack stands used correctly?	Done		JUHURST	May 16, 2022 1:50:50 PM	No	
4	Are you wearing the appropriate PPE?	Done		JUHURST	May 16, 2022 1:50:54 PM	No	
7	Have you performed the proper LOTO?	Done		JUHURST	May 16, 2022 1:50:59 PM	No	

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
10	Are you aware of the potential risks of performing this repair?	Done		JUHURST	May 16, 2022 1:51:03 PM	No	
11	Have you successfully completed the Personal Risk Assessment?	Done		JUHURST	May 16, 2022 1:51:08 PM	No	



WorkOrder
55345 Palm Tran Connection
v 2.2
Page 1 of 9



WorkOrder: 51634337
Invoice Number: 55345-51634337

Client Department:

MRC: 55345M
WO Desc: PM C
Requested By: AOWENS
Created By: AOWENS
Class: WO
Arrangement: Unassigned
Potential Warranty: No

Equipment: 4514-P
Ford E450 Champion Challenger
VIN: 1FDFE4FS7EDB17176
Status: 40
Priority: 1
Driver:
Phone:
ETA:

Chronology		
Reported	Sep 14, 2018	12:01 PM
Started	Sep 14, 2018	
Completed	Sep 15, 2018	12:00 AM
Down Time		

Meter	Reading	UOM
WO		DH
Life	125,751	DH
System	125,961	DH

WorkOrder Notes

Line	Comment
10	PMC Service Perform PMC Service Oil filter B329 Qty1 Engine oil 5w20 qty 7 Qts Gear Oil 80w 90 qty 5 Qts Rotate tires and washed rims Torque 140 lbs second torque 140 lbs

Activity: 10 **999 TOTAL VEHICLE**
Activity Note: Light Medium Duty PMI
Reason for Repair: 05 - Inspection, Routine
Work Accomplished: 06 - Inspect
Part Failure: -

Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
------	-------------	-------------	------	------	----------

Labor Posted

Date	Technician	Hours	Rate	Extended
14-Sep-18	Gaspard,Ronald	2.07	0.00	0.00

Activity 10 Sub Total

Parts: 0.00
Labor: 0.00
Labor Hours: 2.07
Sublet Parts: 0.00
Sublet Labor: 0.00
Activity Sub Total 0.00

Activity: 20 **999 TOTAL VEHICLE**
Activity Note: PM C
Reason for Repair: 08 - Preventive Maintenance
Work Accomplished: C - PM Level C
Part Failure: -

Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
------	-------------	-------------	------	------	----------



WorkOrder
55345 Palm Tran Connection
v 2.2
Page 1 of 9



WorkOrder: 52111086
Invoice Number: 55345-52111086

Client Department:

MRC: 55345M

WO Desc:
PM C

Requested By: DARTHURS

Created By: DARTHURS

Class: WO

Arrangement: Unassigned

Potential Warranty: No

Equipment: 4514-P

Ford E450 Champion Challenger

VIN: 1FDFE4FS7EDB17176

Status: 40

Priority: 1

Driver:

Phone:

ETA:

Chronology		
Reported	Feb 20, 2019	7:04 AM
Started		
Completed	Feb 21, 2019	8:09 AM
Down Time		

Meter	Reading	UOM
WO		DH
Life	151,791	DH
System	151,921	DH

WorkOrder Notes

Line	Comment
10	PMC
	Preventive maintenance
	Perform PMC Service lube all Pivoting Points Cross Rotate Tires Completed

Activity: 10 **999 TOTAL VEHICLE**
Activity Note: Light Medium Duty PMI
Reason for Repair: 05 - Inspection, Routine
Work Accomplished: 06 - Inspect
Part Failure: -

Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
------	-------------	-------------	------	------	----------

Labor Posted

Date	Technician	Hours	Rate	Extended
------	------------	-------	------	----------

Activity 10 Sub Total

Parts: 0.00
Labor: 0.00
Labor Hours: 0.00
Sublet Parts: 0.00
Sublet Labor: 0.00
Activity Sub Total 0.00

Activity: 20 **999 TOTAL VEHICLE**
Activity Note: PM C
Reason for Repair: 08 - Preventive Maintenance
Work Accomplished: C - PM Level C
Part Failure: -

Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
20-Feb-19	B329(F)	FILTER, OIL SAME AS LF3681	1.00	1.96	1.96



WorkOrder
55345 Palm Tran Connection
v 2.2
Page 1 of 9



WorkOrder: 52594526
Invoice Number: 55345-52594526

Client Department:

MRC: 55345M
WO Desc: PM C
Requested By: DARTHURS
Created By: DARTHURS
Class: WO
Arrangement: Unassigned
Potential Warranty: No

Equipment: 4514-P
Ford E450 Champion Challenger
1FDFE4FS7EDB17176
VIN: 40
Status: 1
Priority:
Driver:
Phone:
ETA:

Chronology		
Reported	Aug 9, 2019	11:00 AM
Started		
Completed	Aug 9, 2019	11:31 AM
Down Time		

Meter	Reading	UOM
WO		DH
Life	178,318	DH

WorkOrder Notes

Line	Comment
10	PMC Preventive maintenance Perform PMC Service lube all Pivoting Points Cross Rotate Tires Completed

Activity: 10 **999 TOTAL VEHICLE**
Activity Note: Light Medium Duty PMI
Reason for Repair: 05 - Inspection, Routine
Work Accomplished: 06 - Inspect
Part Failure: -

Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
------	-------------	-------------	------	------	----------

Labor Posted

Date	Technician	Hours	Rate	Extended
------	------------	-------	------	----------

Activity 10 Sub Total

Parts: 0.00
Labor: 0.00
Labor Hours: 0.00
Sublet Parts: 0.00
Sublet Labor: 0.00
Activity Sub Total 0.00

Activity: 20 **999 TOTAL VEHICLE**
Activity Note: PM C
Reason for Repair: 08 - Preventive Maintenance
Work Accomplished: C - PM Level C
Part Failure: -

Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
09-Aug-19	B329(F)	FILTER, OIL SAME AS LF3681	1.00	1.96	1.96

Labor Posted

**WorkOrder**55345 Palm Tran Connection
v 2.2

Page 1 of 10

**WorkOrder: 53159324****Invoice Number: 55345-53159324****Client Department:****MRC:** 55345M**Equipment:** 4514-P**WO Desc:**

PM C

Ford E450 Champion Challenger

VIN: 1FDFE4FS7EDB17176**Requested By:** NPIERRE-LOUIS**Status:** 40**Created By:** NPIERRE-LOUIS**Priority:** 1**Class:** WO**Driver:****Arrangement:** Unassigned**Phone:****Potential Warranty:** No**ETA:**

Chronology		
Reported	Feb 3, 2020	1:31 PM
Started	Feb 4, 2020	
Completed	Feb 4, 2020	3:34 PM
Down Time		

Meter	Reading	UOM
WO		DH
Life	205,054	DH
System	205,054	DH

WorkOrder Notes

Line	Comment
10	PMC SERVICE PREVENTIVE MAINTENANCE PERFORM AND COMPLETED PMC SERVICE REPLACED AIR FILTER

Activity: 10 **999/999/999 TOTAL VEHICLE****Activity Note:** Light Duty PMI**Reason for Repair:** 08 - Preventive Maintenance**Work Accomplished:** -**Part Failure:** -**Activity Comments****Parts Issued**

Date	Part Number	Description	Qty.	Each	Extended
------	-------------	-------------	------	------	----------

Labor Posted

Date	Technician	Hours	Rate	Extended
04-Feb-20	AMRIT TEEMAL,VISHNU	1.13	0.00	0.00

Activity 10 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours: 1.13	
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00

Activity: 20 **999 TOTAL VEHICLE****Activity Note:** PM C**Reason for Repair:** 08 - Preventive Maintenance**Work Accomplished:** C - PM Level C**Part Failure:** -**Activity Comments****Parts Issued**

Date	Part Number	Description	Qty.	Each	Extended
04-Feb-20	B329(F)	FILTER, OIL	1.00	1.96	1.96
04-Feb-20	PA4075	FILTER, AIR, PAPER SAME AS AF25590	1.00	5.28	5.28



WorkOrder
55345 Palm Tran Connection
v 2.2
Page 1 of 12



WorkOrder: 53759681
Invoice Number: 55345-53759681

Client Department:

MRC:	55345M	Equipment:	4514-P
WO Desc:			Ford E450 Champion Challenger
55345-LIGHT DUTY PMC		VIN:	1FDFE4FS7EDB17176
Requested By:	RGASPARD	Status:	40
Created By:	RGASPARD	Priority:	3
Class:	WO	Driver:	
Arrangement:	Unassigned	Phone:	
Potential Warranty:	No	ETA:	

Chronology		
Reported	Sep 10, 2020	12:00 AM
Started	Sep 11, 2020	
Completed	Sep 11, 2020	1:01 PM
Down Time		

Meter	Reading	UOM
WO		DH
Life	230,898	DH
System	230,898	DH

WorkOrder Notes

Line	Comment
10	Complaint: PMC Service Cause: preventive maintenance Correction: perform PMC Service and lube all Pivoting Points

Activity: 5 **999/999/999 TOTAL VEHICLE**

Activity Note: PERSONAL RISK ASSESSMENT
Reason for Repair: SW - Shop Work Order
Work Accomplished: 06 - Inspect
Part Failure: 00 - No Failure

Activity Comments

Parts Issued

Date	Part Number		Description	Qty.	Each	Extended
------	-------------	--	-------------	------	------	----------

Labor Posted

Date	Technician	Hours	Rate	Extended
------	------------	-------	------	----------

Activity 5 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours: 0.00	
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00

Activity: 10 **999/999/999 TOTAL VEHICLE**

Activity Note: Light Duty PMI
Reason for Repair: 08 - Preventive Maintenance
Work Accomplished: -
Part Failure: -

Activity Comments

Parts Issued

Date	Part Number		Description	Qty.	Each	Extended
------	-------------	--	-------------	------	------	----------

Labor Posted



WorkOrder
55345 Palm Tran Connection
v 2.2
Page 1 of 11



WorkOrder: 54376284
Invoice Number: 55345-54376284

Client Department:

MRC: 55345M
WO Desc: 55345-LIGHT DUTY PMC
Requested By: DARTHURS
Created By: DARTHURS
Class: WO
Arrangement: Unassigned
Potential Warranty: No

Equipment: 4514-P
Ford E450 Champion Challenger
VIN: 1FDFE4FS7EDB17176
Status: 40
Priority: 3
Driver:
Phone:
ETA:

Chronology		
Reported	Apr 13, 2021	12:00 AM
Started	Apr 13, 2021	
Completed	Apr 13, 2021	7:39 PM
Down Time		

Meter	Reading	UOM
WO		DH
Life	256,867	DH

WorkOrder Notes

Line	Comment
10	Vehicle came in for service. Job complete
20	Front and rear brakes below specifications. Removed and replaced one set front brakes part #8C2Z-2V001-D also one set rear part # 8C2Z-2V200-C and Two set caliper pin part # BC2Z-2C150. This vehicle Ball joint for tomorrow on my shift Please charge out the brakes for me. Can't fine in system

Activity: 5 **999/999/999 TOTAL VEHICLE**
Activity Note: PERSONAL RISK ASSESSMENT
Reason for Repair: SW - Shop Work Order
Work Accomplished: 06 - Inspect
Part Failure: 00 - No Failure

Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
13-Apr-21	B329(F)	SEE BALDWIN B329 IN THE FLEET ORG. FILTER, OIL, SPIN-ON	1.00	1.98	1.98

Labor Posted

Date	Technician	Hours	Rate	Extended
------	------------	-------	------	----------

Activity 5 Sub Total

Parts: 1.98
Labor: 0.00
Labor Hours: 0.00
Sublet Parts: 0.00
Sublet Labor: 0.00
Activity Sub Total 1.98

Activity: 10 **010 CHASSIS GROUP**
Activity Note: Light Duty PMI
Reason for Repair: 11 - Routine
Work Accomplished: -
Part Failure: -

Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
------	-------------	-------------	------	------	----------

Labor Posted



WorkOrder
55345 Palm Tran Connection
v 2.2
Page 1 of 11



WorkOrder: 55013605
Invoice Number: 55345-55013605

Client Department:

MRC:	55345M	Equipment:	4514-P
WO Desc:			Ford E450 Champion Challenger
55345-LIGHT DUTY PMC		VIN:	1FD4E4FS7EDB17176
Requested By:	RGASPARD	Status:	40
Created By:	RGASPARD	Priority:	3
Class:	WO	Driver:	
Arrangement:	Unassigned	Phone:	
Potential Warranty:	No	ETA:	

Chronology

Reported	Jan 22, 2022	12:00 AM
Started	Feb 3, 2022	
Completed	Feb 4, 2022	12:10 PM

Down Time

Meter	Reading	UOM
WO		DH
Life	283,555	DH

WorkOrder Notes

Line	Comment
10	Complaint: PMC service Cause: preventive maintenance Correction: performed pmc service ,transmission and rear end jod was completed

Activity: 5 **999/999/999 TOTAL VEHICLE**

Activity Note: PERSONAL RISK ASSESSMENT
Reason for Repair: SW - Shop Work Order
Work Accomplished: 06 - Inspect
Part Failure: 00 - No Failure

Activity Comments

Parts Issued

Date	Part Number		Description	Qty.	Each	Extended
------	-------------	--	-------------	------	------	----------

Labor Posted

Date	Technician	Hours	Rate	Extended
------	------------	-------	------	----------

Activity 5 Sub Total

Parts:	0.00
Labor:	0.00
Labor Hours: 0.00	
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	0.00

Activity: 10 **999 TOTAL VEHICLE**

Activity Note: Light Duty PMI
Reason for Repair: 08 - Preventive Maintenance
Work Accomplished: -
Part Failure: -

Activity Comments

Parts Issued

Date	Part Number		Description	Qty.	Each	Extended
------	-------------	--	-------------	------	------	----------

Labor Posted



WorkOrder
55345 Palm Tran Connection
v 2.2
Page 1 of 11



WorkOrder: 55809306
Invoice Number: 55345-55809306

Client Department:

MRC:	55345M	Equipment:	4514-P
WO Desc:			Ford E450 Champion Challenger
55345-LIGHT DUTY PMC		VIN:	1FDFE4FS7EDB17176
Requested By:	DARTHURS	Status:	40
Created By:	DARTHURS	Priority:	3
Class:	WO	Driver:	
Arrangement:	Unassigned	Phone:	
Potential Warranty:	No	ETA:	

Chronology			Meter	Reading	UOM
Reported	Sep 2, 2022	12:00 AM	WO		DH
Started	Sep 2, 2022		Life	312,210	DH
Completed	Sep 7, 2022	9:32 PM	System	311,974	DH
Down Time					

WorkOrder Notes

Line	Comment
10	Perform PMC Service. Change Oil & Filter.lube all Pivoting Points. Check Brakes Clewn Batteries. Drain & Fill Differential parts # B 329 Qty (1) Oil 10W30 Qty (7,0) Qts

Activity: 5 **999/999/999 TOTAL VEHICLE**

Activity Note: PERSONAL RISK ASSESSMENT
Reason for Repair: SW - Shop Work Order
Work Accomplished: 06 - Inspect
Part Failure: 00 - No Failure

Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
07-Sep-22	B329	FILTER, OIL, SPIN-ON	1.00	7.57	7.57

Labor Posted

Date	Technician	Hours	Rate	Extended
------	------------	-------	------	----------

Activity 5 Sub Total

Parts:	7.57
Labor:	0.00
Labor Hours: 0.00	
Sublet Parts:	0.00
Sublet Labor:	0.00
Activity Sub Total	7.57

Activity: 10 **079 DEVICES, SAFETY/STABILITY, TRAILER**

Activity Note: Light Duty PMI
Reason for Repair: 05 - Inspection, Routine
Work Accomplished: -
Part Failure: -

Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
------	-------------	-------------	------	------	----------

Labor Posted



WorkOrder
55345 Palm Tran Connection
v 2.2
Page 2 of 11



WorkOrder: 55809306
Invoice Number: 55345-55809306

Client Department:

MRC: 55345M
WO Desc: 55345-LIGHT DUTY PMC
Requested By: DARTHURS
Created By: DARTHURS
Class: WO
Arrangement: Unassigned
Potential Warranty: No

Equipment: 4514-P
Ford E450 Champion Challenger
VIN: 1FDFE4FS7EDB17176
Status: 40
Priority: 3
Driver:
Phone:
ETA:

Date	Technician	Hours	Rate	Extended
07-Sep-22	Arthurs,Durvin	3.08	0.00	0.00

Activity 10 Sub Total

Parts: 0.00
Labor: 0.00
Labor Hours: 3.08
Sublet Parts: 0.00
Sublet Labor: 0.00
Activity Sub Total 0.00

Activity: 20 **999 TOTAL VEHICLE**

Activity Note: PM C
Reason for Repair: 08 - Preventive Maintenance
Work Accomplished: C - PM Level C
Part Failure: -

Activity Comments

Parts Issued

Date	Part Number	Description	Qty.	Each	Extended
------	-------------	-------------	------	------	----------

Labor Posted

Date	Technician	Hours	Rate	Extended
07-Sep-22	Arthurs,Durvin	0.37	0.00	0.00
02-Sep-22	Junior Hurst	0.67	0.00	0.00

Activity 20 Sub Total

Parts: 0.00
Labor: 0.00
Labor Hours: 1.04
Sublet Parts: 0.00
Sublet Labor: 0.00
Activity Sub Total 0.00

WorkOrder 55809306 Grand Total

Parts: 7.57
Labor: 0.00
Labor Hours: 4.12
Sublet Parts: 0.00
Sublet Labor: 0.00
WorkOrder Grand Total 7.57

Recent Repair History

WorkOrder	Date Completed	Life Meter	Class	Description
55809306	7-Sep-22	312,210	WO	55345-LIGHT DUTY PMC
55877152	23-Aug-22	310,526	WO	check engine light on



WorkOrder
55345 Palm Tran Connection
v 2.2
Page 3 of 11



WorkOrder: 55809306
Invoice Number: 55345-55809306

Client Department:

MRC: 55345M
WO Desc: 55345-LIGHT DUTY PMC
Requested By: DARTHURS
Created By: DARTHURS
Class: WO
Arrangement: Unassigned
Potential Warranty: No

Equipment: 4514-P
Ford E450 Champion Challenger
VIN: 1FDFE4FS7EDB17176
Status: 40
Priority: 3
Driver:
Phone:
ETA:

WorkOrder	Date Completed	Life Meter	Class	Description
55868712	19-Aug-22	310,098	WO	55345 PER DVIR (Check Rear AC)

Scheduled Preventative Maintenance

Nest	PM	WorkOrder	Due Date	Due Life Meter	Due Meter Reading	Due Life Meter 2	Due Meter Reading 2
------	----	-----------	----------	----------------	-------------------	------------------	---------------------

Other Open Repairs

WorkOrder8	Date Reported	Life Meter	Class	Description
55877152	22-Aug-22	310,526	WO	check engine light on

PH: Work Order: 55809306 Desc: 55345-LIGHT DUTY PMC
Equip: 4514-P Desc: Ford E450 Champion Challenger VIN: 1FDFE4FS7EDB17176

LH: 10 Desc: Light Duty PMI

Task: First Transit North America Light Duty PM Inspection Sheet Performed by: DARTHURS Performed on: 07-SEP-22

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
10,000	SECTION 1 - Preparation Inspection	Done		DARTHURS	Sep 7, 2022 8:08:06 PM	No	
10,100	INSPECT_Auto-Transmission Operation/Controller; Neutral Safety Switch	Done		DARTHURS	Sep 7, 2022 8:08:14 PM	No	
10,200	!FRA!INSPECT_Starter Operation	Done		DARTHURS	Sep 7, 2022 8:08:22 PM	No	
10,300	!FRA!INSPECT_Warning Lights and Alarms	Done		DARTHURS	Sep 7, 2022 8:08:27 PM	No	
10,400	!FRA!INSPECT_Back Up Alarm	Done		DARTHURS	Sep 7, 2022 8:08:32 PM	No	
10,500	!FRA!INSPECT_Engine Operation, OBSERVE_ Exhaust for Excessive Smoke	Done		DARTHURS	Sep 7, 2022 8:08:40 PM	No	
10,600	Check Driver's Pre-trip or DVIR/EVIR & Authorization Forms	Done		DARTHURS	Sep 7, 2022 8:08:46 PM	No	
10,700	INSPECT_All Exterior Lights (Turn on until Completion of this section)	-	Clearance Light out	DARTHURS	Sep 7, 2022 8:53:18 PM	Yes	55923621
10,800	*RPT*INSPECT_Body Damage, Corrosion;DOCUMENT_Issues	Done		DARTHURS	Sep 7, 2022 8:09:03 PM	No	
10,900	INSPECT_Fuel Tank Cap, and Doors	Done		DARTHURS	Sep 7, 2022 8:09:09 PM	No	
11,100	INSPECT_License Plate, Bracket, Bumpers	Done		DARTHURS	Sep 7, 2022 8:09:15 PM	No	
20,000	SECTION 2 - Test Drive and Operator Area Inspection	Done		DARTHURS	Sep 7, 2022 8:09:20 PM	No	
20,100	INSPECT_Driver Seat condition/operation/seatbelt	Done		DARTHURS	Sep 7, 2022 8:09:28 PM	No	
20,200	TEST DRIVE_INSPECT_Proper Operation; Drive into Shop	Done		DARTHURS	Sep 7, 2022 8:09:35 PM	No	
20,300	*RPT*INSPECT_Steering Wheel for Play/Bind/Horn Op./Turn Signal Cancellation	Done		DARTHURS	Sep 7, 2022 8:10:23 PM	No	
20,400	PERFORM_Brake Test (Apply hard enough to check wheel pull and Application)	Done		DARTHURS	Sep 7, 2022 8:10:29 PM	No	
20,500	*RPT*FRA INSPECT_Lighting/Operation of all Gauges	Done		DARTHURS	Sep 7, 2022 8:10:59 PM	No	
20,600	*RPT*INSPECT_Windshields, Sun Visors	Done		DARTHURS	Sep 7, 2022 8:11:06 PM	No	
20,700	INSPECT_Wiper/Washer Operation, Condition	Done		DARTHURS	Sep 7, 2022 8:11:13 PM	No	
20,800	INSPECT_High Idle Control	Done		DARTHURS	Sep 7, 2022 8:16:06 PM	No	
20,900	*RPT*!FRA!INSPECT_HVAC Controls, Operation	Done		DARTHURS	Sep 7, 2022 8:16:10 PM	No	
21,000	*RPT*!FRA!INSPECT_Operation of all Switches and Accessories	Done		DARTHURS	Sep 7, 2022 8:16:40 PM	No	
21,100	INSPECT_Parking Brake Operation	Done		DARTHURS	Sep 7, 2022 8:16:50 PM	No	
21,200	!FRA!TEST_Service Brake Backup System (Stationary Brake Tests HYD)	Done		DARTHURS	Sep 7, 2022 8:16:55 PM	No	
21,300	INSPECT_VIN, Tire Pressure Decal, Data Tags	Done		DARTHURS	Sep 7, 2022	No	

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
					8:17:03 PM		
21,400	*RPT*INSPECT_Drivers Door Hinges, Handles, Controls and Panels	Done		DARTHURS	Sep 7, 2022 8:17:10 PM	No	
21,500	!FRA!INSPECT_Under Dash Wiring for Proper Routing/Chafing/Securement	Done		DARTHURS	Sep 7, 2022 8:17:19 PM	No	
21,550	INSPECT_Driver Floor Area for Rust/Water Leaks	Done		DARTHURS	Sep 7, 2022 8:17:26 PM	No	
21,600	*RPT*INSPECT for WEAR_Pedal Pads, Accelerator, Brake, Parking Brake	Done		DARTHURS	Sep 7, 2022 8:17:33 PM	No	
21,700	INSPECT_Engine Fault Codes	Done		DARTHURS	Sep 7, 2022 8:18:07 PM	No	
30,000	SECTION 3 - EXTERIOR INSPECTION - Front	Done		DARTHURS	Sep 7, 2022 8:21:57 PM	No	
31,000	SSF (Street Side Front)	Done		DARTHURS	Sep 7, 2022 8:22:05 PM	No	
31,010	*RPT*!FRA!INSPECT_Mirror Mountings, Brackets, Glass	Done		DARTHURS	Sep 7, 2022 8:22:15 PM	No	
31,020	*RPT*INSPECT_FRONT Springs, Shocks, Spring Shackles	Done		DARTHURS	Sep 7, 2022 8:22:23 PM	No	
31,030	INSPECT_Mud Flaps, Brackets	Done		DARTHURS	Sep 7, 2022 8:22:52 PM	No	
31,040	INSPECT_Wiper Blades, Arms	Done		DARTHURS	Sep 7, 2022 8:22:59 PM	No	
32,000	Engine Inspection	Done		DARTHURS	Sep 7, 2022 8:28:12 PM	No	
32,010	INSPECT_Hood, Springs and Props	Done		DARTHURS	Sep 7, 2022 8:28:17 PM	No	
32,020	!FRA!INSPECT_Engine Compartment Condition for Fire Risk Avoidance	Done		DARTHURS	Sep 7, 2022 8:28:23 PM	No	
32,030	!FRA!INSPECT_for Fluid Leaks, Levels	Done		DARTHURS	Sep 7, 2022 8:28:29 PM	No	
32,040	!FRA!INSPECT_Hyd_Brake Fluid with Test Strips	Done		DARTHURS	Sep 7, 2022 8:28:34 PM	No	
32,050	!FRA!INSPECT_RECORD_Coolant Recovery with Refractometer; Test Strips	Degree Fahrenheit	NA	DARTHURS	Sep 7, 2022 8:28:53 PM	No	
32,060	PRESSURE TEST_Cooling Systems (Radiator, Cap, hoses and clamps)	Done		DARTHURS	Sep 7, 2022 8:29:23 PM	No	
32,070	*RPT*INSPECT_Radiator and Mountings, Cores	Done		DARTHURS	Sep 7, 2022 8:29:29 PM	No	
32,080	*RPT*INSPECT_Fan Assembly,Shroud,Tensioner,Belts,All Belt Driven Components	Done		DARTHURS	Sep 7, 2022 8:29:36 PM	No	
32,090	*RPT*!FRA!INSPECT_Mounting, Installation of Alternator, AC Compressor	Done		DARTHURS	Sep 7, 2022 8:29:50 PM	No	
32,100	INSPECT_Intake System	Done		DARTHURS	Sep 7, 2022 8:29:55 PM	No	
32,140	*RPT*!FRA!RECORD_Underhood Battery Voltages (volts)	0 Volt*		DARTHURS	Sep 7, 2022 8:30:07 PM	No	
33,010	CSF (Curb Side Front)	Done		DARTHURS	Sep 7, 2022 8:30:14 PM	No	
33,020	*RPT*!FRA!INSPECT_Mirror Mountings, Brackets, Glass	Done		DARTHURS	Sep 7, 2022 8:30:19 PM	No	
33,030	*RPT*INSPECT_FRONT Springs, Shocks, Spring Shackles	Done		DARTHURS	Sep 7, 2022 8:30:27 PM	No	
33,040	INSPECT_Mud Flaps, Brackets	Done		DARTHURS	Sep 7, 2022	No	

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
					8:30:34 PM		
33,050	INSPECT_Wiper Blades, Arms	Done		DARTHURS	Sep 7, 2022 8:30:39 PM	No	
33,060	!FRA!INSPECT_LUBE_Battery Box, Batteries, Tray Slides, Hold Downs	Done		DARTHURS	Sep 7, 2022 8:30:45 PM	No	
33,070	*RPT*!FRA!RECORD_Side Mounted Battery Voltages (volts)	13.98 Volt*		DARTHURS	Sep 7, 2022 8:55:22 PM	No	
33,070	*RPT*!FRA!RECORD_Side Mounted Battery Voltages (volts)	13.98 Volt*		DARTHURS	Sep 7, 2022 8:30:59 PM	No	
33,080	INSPECT_Entry door, OPEN_with external lock/switch (if equipped)	Done		DARTHURS	Sep 7, 2022 8:31:27 PM	No	
40,000	SECTION 4 - Interior Inspection	Done		DARTHURS	Sep 7, 2022 8:31:31 PM	No	
40,100	*RPT*INSPECT_Step-Well, Step-Tread, Hand Rails, Step-well Light	Done		DARTHURS	Sep 7, 2022 8:31:57 PM	No	
40,200	INSPECT_Insurance/Registration/Regulatory Forms Dates	Done		DARTHURS	Sep 7, 2022 8:33:32 PM	No	
40,250	INSPECT_Overhead Compartment for Water Leaks	Done		DARTHURS	Sep 7, 2022 8:33:39 PM	No	
40,300	INSPECT_Safety Equipment, Fire Extinguisher/Suppression	Done		DARTHURS	Sep 7, 2022 8:33:46 PM	No	
40,400	INSPECT_Camera Systems, Filter, Electrical Inputs/Outputs-SOP M038	Done		DARTHURS	Sep 7, 2022 8:33:54 PM	No	
40,600	!FRA!CHECK for HOTSPOTS_Interior Elec Panel Fuses/Circuit Breakers/Connectors	Done		DARTHURS	Sep 7, 2022 8:34:02 PM	No	
40,700	*RPT*INSPECT_Seats, Covering, Belts, Loose Cushions, Operation	Done		DARTHURS	Sep 7, 2022 8:34:10 PM	No	
40,800	*RPT*!FRA!INSPECT_Interior Lights; Mirrors	Done		DARTHURS	Sep 7, 2022 8:34:17 PM	No	
40,900	!FRA!INSPECT_Interior Cleanliness/Potential Projectiles	Done		DARTHURS	Sep 7, 2022 8:34:23 PM	No	
41,000	INSPECT_All ADA Equip (Lift Seat Belt, floor hold Downs, Belts, Cover, Alarms)	Done		DARTHURS	Sep 7, 2022 8:34:30 PM	No	
41,100	INSPECT_CLEAN_AC Filter	Done		DARTHURS	Sep 7, 2022 8:34:37 PM	No	
41,200	INSPECT_Emergency Windows,Hatches,Doors,Alarms/Lights;CHECK_for Leaks	Done		DARTHURS	Sep 7, 2022 8:34:42 PM	No	
41,300	*RPT*INSPECT_Interior Body, Floor, Stanchions	Done		DARTHURS	Sep 7, 2022 8:34:49 PM	No	
41,400	*RPT*INSPECT_Passenger Doors, Glass, Seal	Done		DARTHURS	Sep 7, 2022 8:34:58 PM	No	
50,000	SECTION 5 - UNDER VEHICLE INSPECTION	Done		DARTHURS	Sep 7, 2022 8:35:13 PM	No	
50,100	*RPT*INSPECT_Steering components-Drag Link, Tie Rods ends and Steering Damper	Done		DARTHURS	Sep 7, 2022 8:35:20 PM	No	
50,200	INSPECT_Ball Joint Play	Done		DARTHURS	Sep 7, 2022 8:35:33 PM	No	
50,300	!FRA!INSPECT_Front Wheel Bearings for Play	Done		DARTHURS	Sep 7, 2022 8:35:44 PM	No	
50,400	LUBE_All Chassis Components	Done		DARTHURS	Sep 7, 2022 8:35:49 PM	No	
50,500	!FRA!CHANGE_Engine oil,filters	Done		DARTHURS	Sep 7, 2022 8:35:54 PM	No	
50,700	INSPECT_Tire Condition	Done		DARTHURS	Sep 7, 2022	No	

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
					8:35:58 PM		
50,800	INSPECT_Tire Valve Stems, Double Check Caps	Done		DARTHURS	Sep 7, 2022 8:36:03 PM	No	
50,900	!FRA!INSPECT_Wheels for Cracks, Loose Lugs/Indicators, Outer Hub Leaks	Done		DARTHURS	Sep 7, 2022 8:36:08 PM	No	
51,000	RECORD_LF-Tire Tread Depth (32nds)	10 32nds of an inch		DARTHURS	Sep 7, 2022 8:36:19 PM	No	
51,100	RECORD_LF-Tire Air Pressure (psi)	70 Pounds per Square Inch		DARTHURS	Sep 7, 2022 8:36:26 PM	No	
51,200	RECORD_RF-Tire Tread Depth (32nds)	11 32nds of an inch		DARTHURS	Sep 7, 2022 8:36:37 PM	No	
51,300	RECORD_RF-Air Pressure (psi)	70 Pounds per Square Inch		DARTHURS	Sep 7, 2022 8:36:51 PM	No	
51,400	!FRA!INSPECT_FRONT ABS Tone Rings, Sensors, Routing of Cables	Done		DARTHURS	Sep 7, 2022 8:37:20 PM	No	
51,500	!FRA!INSPECT_Wheel Seals for Leaks	Done		DARTHURS	Sep 7, 2022 8:38:08 PM	No	
51,600	!FRA!INSPECT_Front Brake Assemblies	Done		DARTHURS	Sep 7, 2022 8:38:21 PM	No	
51,700	MEASURE_RECORD_LF - Brake Lining, Pad Thickness (32nds)	10 32nds of an inch		DARTHURS	Sep 7, 2022 8:38:43 PM	No	
51,800	MEASURE_RECORD_RF - Brake Lining, Pad Thickness (32nds)	10 32nds of an inch		DARTHURS	Sep 7, 2022 8:38:50 PM	No	
51,900	INSPECT VISUALLY_RECORD_LF Rotor Condition (inches)	1.554 Inch		DARTHURS	Sep 7, 2022 8:39:10 PM	No	
52,000	INSPECT VISUALLY_RECORD_RF Rotor Condition (inches)	1.554 Inch		DARTHURS	Sep 7, 2022 8:39:44 PM	No	
52,100	INSPECT_Vibration Damper	Done		DARTHURS	Sep 7, 2022 8:39:56 PM	No	
52,200	!FRA!INSPECT_Battery Cable Routing from Battery Box to Starter	Done		DARTHURS	Sep 7, 2022 8:40:03 PM	No	
52,400	!FRA!INSPECT_Starter Mounting	Done		DARTHURS	Sep 7, 2022 8:40:31 PM	No	
52,500	!FRA!INSPECT_Engine Exhaust System	Done		DARTHURS	Sep 7, 2022 8:40:39 PM	No	
52,700	INSPECT_Engine, Transmission Mounts	Done		DARTHURS	Sep 7, 2022 8:40:43 PM	No	
52,800	!FRA!INSPECT_Engine, Transmission for Fluid Leaks	Done		DARTHURS	Sep 7, 2022 8:41:09 PM	No	
52,900	INSPECT_Shift Cable Adjustment - All Transmissions	Done		DARTHURS	Sep 7, 2022 8:41:16 PM	No	
53,000	!FRA!INSPECT_Transmission Breather and Clean	Done		DARTHURS	Sep 7, 2022 8:41:21 PM	No	
53,100	*RPT*!FRA!INSPECT_Parking Brake Cables, Shoes for Wear, Contamination	Done		DARTHURS	Sep 7, 2022 8:41:29 PM	No	
53,200	*RPT*INSPECT_A/C Condensor, Fans, Safety Grills	Done		DARTHURS	Sep 7, 2022 8:41:37 PM	No	
53,300	*RPT*INSPECT_Driveline, Hanger Bearings, U-Joints, Slip Joints, Safety Loop	Done		DARTHURS	Sep 7, 2022 8:41:44 PM	No	
53,400	*RPT*INSPECT_All Body Mounts and Chassis Frame for Corrosion, Cracks	Done		DARTHURS	Sep 7, 2022 8:41:53 PM	No	
53,500	!FRA!INSPECT_Fuel Tank, Mountings, Lines	Done		DARTHURS	Sep 7, 2022 8:41:59 PM	No	
53,600	INSPECT_Tire Condition	Done		DARTHURS	Sep 7, 2022 8:42:06 PM	No	

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
53,700	INSPECT_Tire Valve Stems, Double Check Caps	Done		DARTHURS	Sep 7, 2022 8:42:11 PM	No	
53,800	INSPECT_ Mismatched Tire Tread, Casing Design	Done		DARTHURS	Sep 7, 2022 8:42:22 PM	No	
53,900	INSPECT_Dual Mating Tires w/Square	Done		DARTHURS	Sep 7, 2022 8:42:28 PM	No	
54,000	!FRA!INSPECT_Wheels for Cracks, Loose Lugs/Indicators, Outer Hub Leaks	Done		DARTHURS	Sep 7, 2022 8:42:36 PM	No	
54,100	INSPECT_Mud Flaps, Brackets	Done		DARTHURS	Sep 7, 2022 8:58:16 PM	No	
54,200	RECORD_RRO-Tire Tread Depth (32nds)	12 32nds of an inch		DARTHURS	Sep 7, 2022 8:42:57 PM	No	
54,300	RECORD_RRI-Tire Tread Depth (32nds)	12 32nds of an inch		DARTHURS	Sep 7, 2022 8:43:04 PM	No	
54,400	RECORD_RRO-Air Pressure (psi)	65 Pounds per Square Inch		DARTHURS	Sep 7, 2022 8:43:15 PM	No	
54,500	RECORD_RRI-Air Pressure (psi)	65 Pounds per Square Inch		DARTHURS	Sep 7, 2022 8:43:21 PM	No	
54,600	RECORD_LRO-Tire Tread Depth (32nds)	7 32nds of an inch		DARTHURS	Sep 7, 2022 8:43:36 PM	No	
54,700	RECORD_LRI-Tire Tread Depth (32nds)	9 32nds of an inch		DARTHURS	Sep 7, 2022 8:43:45 PM	No	
54,800	RECORD_LRO-Air Pressure (psi)	65 Pounds per Square Inch		DARTHURS	Sep 7, 2022 8:43:54 PM	No	
54,900	RECORD_LRI-Air Pressure (psi)	65 Pounds per Square Inch		DARTHURS	Sep 7, 2022 8:44:00 PM	No	
55,000	!FRA!INSPECT_ REAR Brake Assemblies	Done		DARTHURS	Sep 7, 2022 8:44:06 PM	No	
55,100	!FRA!INSPECT_ REAR Hubs, Wheel Seals for Oil Leaks	Done		DARTHURS	Sep 7, 2022 8:44:12 PM	No	
55,200	!FRA!INSPECT_REAR ABS Tone Rings, Sensors, Routing Of Cables (if equipped)	Done		DARTHURS	Sep 7, 2022 8:44:22 PM	No	
55,300	MEASURE_RECORD_LR - Brake Lining, Pad Thickness (32nds)	10 32nds of an inch		DARTHURS	Sep 7, 2022 8:44:35 PM	No	
55,400	MEASURE_RECORD_RR - Brake Lining, Pad Thickness (32nds)	10 32nds of an inch		DARTHURS	Sep 7, 2022 8:44:44 PM	No	
55,500	INSPECT VISUALLY_MEASURE_RECORD_ LR Drum, Rotor Condition (inches)	1.665 Inch		DARTHURS	Sep 7, 2022 8:45:06 PM	No	
55,600	INSPECT VISUALLY_MEASURE_RECORD_ RR Drum, Rotor Condition (inches)	1.665 Inch		DARTHURS	Sep 7, 2022 8:45:14 PM	No	
55,700	!FRA!INSPECT_ Under Body Exhaust System	Done		DARTHURS	Sep 7, 2022 8:45:19 PM	No	
55,800	*RPT*INSPECT_ REAR Axle Housing, Breather; CLEAN_Breather	Done		DARTHURS	Sep 7, 2022 8:45:25 PM	No	
55,900	*RPT*INSPECT_ REAR Springs, Shocks, Suspension, Airbags	Done		DARTHURS	Sep 7, 2022 8:45:31 PM	No	
60,000	SECTION 6 - Wheelchair Inspection	Done		DARTHURS	Sep 7, 2022 8:45:35 PM	No	
60,100	RECORD_Wheelchair Cycle Count	14.894 Cycles		DARTHURS	Sep 7, 2022 8:45:53 PM	No	
60,200	CHECK_ Lift Access Door for Ease of Opening,Latch Security,Door Hold Back	Done		DARTHURS	Sep 7, 2022 8:46:02 PM	No	
60,300	CHECK_Platform Emergency Release Mechanism for Ease of Operation	Done		DARTHURS	Sep 7, 2022 8:46:08 PM	No	
60,400	OPERATE_Lift thru Complete	Done		DARTHURS	Sep 7, 2022	No	

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
	Cycle;CHECK_Noises,Jerky Op,Too Fast-Slow,Drift Down				8:46:13 PM		
60,500	INSPECT_ Bridgeplate Operation	Done		DARTHURS	Sep 7, 2022 8:46:18 PM	No	
60,600	INSPECT_All Pivot Points for Wear and Looseness	Done		DARTHURS	Sep 7, 2022 8:46:23 PM	No	
60,700	INSPECT_Rollers for Wear and Smooth Rotation	Done		DARTHURS	Sep 7, 2022 8:46:28 PM	No	
60,800	INSPECT_Operation of Platform Barrier Mechanism	Done		DARTHURS	Sep 7, 2022 8:46:35 PM	No	
60,900	INSPECT_Cam Slots for Wear and Proper Alignment	Done		DARTHURS	Sep 7, 2022 8:46:39 PM	No	
61,000	INSPECT_Cable Condition (If Applicable)	Done		DARTHURS	Sep 7, 2022 8:46:44 PM	No	
61,100	INSPECT_Hydraulic Hoses for Leaks, Chafing or Cracks	Done		DARTHURS	Sep 7, 2022 8:46:51 PM	No	
61,200	INSPECT_Electrical Connections and Routing of Wires and Cables	Done		DARTHURS	Sep 7, 2022 8:46:57 PM	No	
61,300	INSPECT_Operation and Adjustment of All Safety Switches	Done		DARTHURS	Sep 7, 2022 8:47:04 PM	No	
61,400	INSPECT_All Lift Mounting Brackets for Loose Bolts Broken Welds, etc.	Done		DARTHURS	Sep 7, 2022 8:47:08 PM	No	
61,500	INSPECT_Manual Back-up Raise/Lower System (If Applicable)	Done		DARTHURS	Sep 7, 2022 8:47:13 PM	No	
61,600	INSPECT_HydrPump Reservoir Oil Level. Consult SvcManual for Fluid to Use.	Done		DARTHURS	Sep 7, 2022 8:47:20 PM	No	
61,700	CHECK_Operator Decals for Proper Positioning;CONSULT_Service Manual	Done		DARTHURS	Sep 7, 2022 8:47:25 PM	No	
61,800	CHECK_WC Holddowns Inside Vehicle for Secure Mounting,Proper Operation	Done		DARTHURS	Sep 7, 2022 8:47:30 PM	No	
61,900	CLEAN_Linkages and Mechanisms	Done		DARTHURS	Sep 7, 2022 8:47:37 PM	No	
62,000	LUBRICATE_Linkages and Mechanisms (DO NOT OVER Lubricate)	Done		DARTHURS	Sep 7, 2022 8:47:44 PM	No	
62,100	INSPECT_Emergency Platform Release Mechanism	Done		DARTHURS	Sep 7, 2022 8:47:48 PM	No	
62,200	INSPECT_Platform Barrier Latch Mechanism	Done		DARTHURS	Sep 7, 2022 8:47:56 PM	No	
62,300	INSPECT_Bridgeplate Hinge	Done		DARTHURS	Sep 7, 2022 8:48:01 PM	No	
62,400	INSPECT_All Pivot Points	Done		DARTHURS	Sep 7, 2022 8:48:08 PM	No	
62,500	INSPECT_Cams and Slots	Done		DARTHURS	Sep 7, 2022 8:48:13 PM	No	
62,600	INSPECT_Rollers	Done		DARTHURS	Sep 7, 2022 8:48:18 PM	No	
62,700	INSPECT_All Linkages	Done		DARTHURS	Sep 7, 2022 8:48:23 PM	No	
70,000	SECTION 7 - ALTERNATIVE FUELS INSPECTION	Done		DARTHURS	Sep 7, 2022 8:48:28 PM	No	
70,300	INSPECT_Condition of Fuel Pressure Gauge	Done		DARTHURS	Sep 7, 2022 8:48:33 PM	No	
70,400	PROVIDE PROOF_Tank_Dents/Scratches and Re-Certification	Done		DARTHURS	Sep 7, 2022 8:48:38 PM	No	
70,500	INSPECT_Tank test date, labels-Reference-ST.4	Done		DARTHURS	Sep 7, 2022	No	

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
	FMMVSS 304 & ANSI-CSA NGV2				8:48:46 PM		
70,600	INSPECT_ Tank Lines to Ensure Secure Mounting, Insulation Against Vibration	Done		DARTHURS	Sep 7, 2022 8:48:51 PM	No	
70,700	INSPECT_ Filling Nozzle for Securely Fitting Cap	Done		DARTHURS	Sep 7, 2022 8:48:55 PM	No	
70,800	INSPECT_ Pressure Relief Device's Venting System, Valves, Ducting to MNFR Specs	Done		DARTHURS	Sep 7, 2022 8:49:00 PM	No	
80,000	SECTION 8 - PMI Report Completion	Done		DARTHURS	Sep 7, 2022 8:49:05 PM	No	
80,100	COMPLETE_PM Report; Follow-ups	Done		DARTHURS	Sep 7, 2022 8:49:09 PM	No	
80,200	RETURN_Vehicle to Predetermined Location	Done		DARTHURS	Sep 7, 2022 8:49:14 PM	No	

LH: 20 Desc: PM C

Task: PM C SERVICE Performed by: DARTHURS Performed on: 07-SEP-22

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
100,000	"A" PMI SERVICING ITEMS	Done		DARTHURS	Sep 7, 2022 8:59:30 PM	No	
101,000	FRA Change Oil Filters	Yes		DARTHURS	Sep 7, 2022 8:59:35 PM	No	
102,000	FRA Drain Engine Oil	Yes		DARTHURS	Sep 7, 2022 8:59:41 PM	No	
103,000	FRA Check Transmission Fluid	Done		DARTHURS	Sep 7, 2022 8:59:45 PM	No	
104,000	Lubricate Chassis	Done		DARTHURS	Sep 7, 2022 8:59:50 PM	No	
105,000	Replace or Clean A/C Filters	Done		DARTHURS	Sep 7, 2022 8:59:56 PM	No	
107,000	FRA Change Primary Fuel Filter	-	NA	DARTHURS	Sep 7, 2022 9:00:09 PM	No	
108,000	Lube all pivoting Mechanisms	Done		DARTHURS	Sep 7, 2022 9:00:16 PM	No	
200,000	"B" PMI SERVICING ITEMS (12 MONTH)	Done		DARTHURS	Sep 7, 2022 9:00:21 PM	No	
201,000	Service Crankcase Breather	-	NA	DARTHURS	Sep 7, 2022 9:00:34 PM	No	
203,000	FRA Change Automatic Transmission Fluid	No		DARTHURS	Sep 7, 2022 9:00:46 PM	No	
204,000	FRA Change Power Steering Fluid and Filter	No		DARTHURS	Sep 7, 2022 9:00:50 PM	No	
205,000	Complete Engine Diagnostics and Clear Codes when Completed	Done		DARTHURS	Sep 7, 2022 9:00:55 PM	No	
300,000	"C" PMI SERVICING ITEMS (24 MONTH)	Done		DARTHURS	Sep 7, 2022 9:01:00 PM	No	
301,000	Check and Lubricate Door Linkages	Done		DARTHURS	Sep 7, 2022 9:01:06 PM	No	
302,000	Check Toe-In and Record Reading	-	NA	DARTHURS	Sep 7, 2022 9:01:15 PM	No	
302,001	Record Toe-In Reading	Inches, fraction-actual	NA	DARTHURS	Sep 7, 2022 9:01:24 PM	No	
304,000	1st "C" PMI ONLY: Tune Up Per Engine Mfg's Specifications	No		DARTHURS	Sep 7, 2022 9:01:33 PM	No	
305,000	FRA Change Differential Fluid	Yes		DARTHURS	Sep 7, 2022	No	

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
					9:01:44 PM		

LH: 5 Desc: PERSONAL RISK ASSESSMENT

Task: PRA and Meter Readings Performed by: DARTHURS Performed on: 07-SEP-22

Line	Inspection	RESULTS	Notes	Performed By	Date Inspected	Follow Up	Follow Up WO
1	Are you properly trained to perform the task?	Done		DARTHURS	Sep 7, 2022 9:02:14 PM	No	
2	If task requires lifting, are lifts secured, are jack stands used correctly?	Done		DARTHURS	Sep 7, 2022 9:02:20 PM	No	
4	Are you wearing the appropriate PPE?	Done		DARTHURS	Sep 7, 2022 9:02:25 PM	No	
7	Have you performed the proper LOTO?	Done		DARTHURS	Sep 7, 2022 9:02:31 PM	No	
10	Are you aware of the potential risks of performing this repair?	Done		DARTHURS	Sep 7, 2022 9:02:36 PM	No	
11	Have you successfully completed the Personal Risk Assessment?	Done		DARTHURS	Sep 7, 2022 9:02:41 PM	No	

Vehicle Processing Checklist

Form FAMO 2-010

Date Conducted: ____/____/____

Inspection Date/Time: _____

Conducted By: _____

Location: _____

Phone Number: (____) _____

Vehicle Year/Make/Model ►

General Information

VIN: _____
 Asset No: _____
 Odometer: _____
 Engine: ____ 4 cyl ____ 6 cyl ____ 8 cyl ____ Other
 Engine Displacement: ____ Liter ____ CID ____ HP
 Fuel Type: ____ Diesel ____ CNG ____ Other

General Condition (circle one in each category)

Exterior	Bad	2	3	4	Excllnt
Interior	Bad	2	3	4	Excllnt
Tires	Bad	2	3	4	Excllnt
Glass	Bad	2	3	4	Excllnt
Mechanical	DNR		Runs		Other

(describe "Other")

Options & Equipment (Veach box that applies)

☐ A/C	☐ ABS	☐ Air Brakes
☐ P/S	☐ 4x4	☐ Boom/Bucket
☐ P/B	☐ Power Door Locks	☐ Crane
☐ P/W	☐ Power Seats	☐ Dump Bed _____
☐ A/T	☐ Sunroof	☐ Tank Bed _____
☐ Manual Transmission (____ forward speeds)	☐ Tilt Steering	☐ Lightbar/beacon
☐ AM/FM Radio	☐ Tinted Windows	☐ Power Liftgate
☐ CD Player	_____	☐ Tool Box
☐ Cruise Control	_____	☐ Trailer Hitch
☐ Airbags (circle one) 1 2 3 4	_____	☐ Utility Bed
☐ Performance Package: _____	_____	☐ Winch

Key

4X4	4-Wheel Drive	CID	Cubic Inch Displacement	P/B	Power Brakes
ABS	Antilock Braking System	CNG	Compressed Natural Gas	P/S	Power Steering
A/C	Air Conditioner	DNR	Does Not Run	P/W	Power Windows
A/T	Automatic Transmission	HP	Horsepower	VIN	Vehicle Identification Number

In order to show your vehicles and equipment at their best, use the following chart and descriptions as a guide for preferred camera angles, lighting conditions, and background.

- 1) Take the photos with a high-resolution digital camera (a minimum of 3 mega pixels is recommended).
- 2) Take the photo in an area that is well lit, but not in a glare, and position yourself so that the sun or artificial light source does not cast your shadow into the picture.
- 3) Make sure the vehicle is washed and all logo decals have been removed with automotive adhesive remover (3M or similar). If primer must be used, select a primer color that closely matches the vehicle. If possible, pressure wash off-road equipment to remove grease and caked mud caught in treads, tracks and body panels. Make sure that truck beds are free of accumulated trash.
- 4) Select an area with a neutral background; avoid clutter showing up behind the vehicle. Shrubbery generally makes a good backdrop.
- 5) The preferred camera locations for common vehicles are the right or left front corners of the vehicle, at approximately a 40 degree angle from straight-on, standing 8-10 feet back from the vehicle, and holding the camera at just above rooftop level (except for very tall equipment). By pointing the camera about one-third of the distance down the right or left side of the vehicle, the entire vehicle should be in the photo frame. Under these conditions, the vehicle will be well displayed and you will avoid "fish-eye" distortions of shooting directly at the leading edge (the front edge of the front fender).

L. Front

R. Front

